

SIX-MONTH SURVEILLANCE AHERA REPORT

**NORTHWOOD ELEMENTARY SCHOOL
2760 TRIMBLE ROAD
SAN JOSE, CA 95132**

**PREPARED FOR:
BERRYESSA UNION ELEMENTARY SCHOOL DISTRICT
981 RIDDER PARK DRIVE SAN JOSE, CA 95131
SAN JOSE, CA 95132**

**INSPECTED ON:
FEBRUARY 16, 2024**


HAZMAT DOC PROJECT #24-016

**PREPARED BY:
HAZMAT DOC
3080 OLCOTT STREET • SUITE D135
SANTA CLARA, CA 95054
Tel: 408.748.0055**

BERRYESSA UNION ELEMENTARY SCHOOL DISTRICT
NORTHWOOD ELEMENTARY SCHOOL

INSPECTED ON:
FEBRUARY 16, 2024

INSPECTED BY:

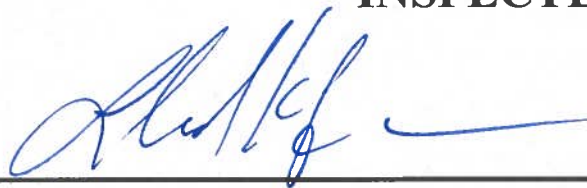

Leland Kafeyan
Cal/OSHA Certified Site Surveillance Technician
Certification Number 06-4110

REPORTED BY:



Zen B. Doctor
Cal/OSHA Certified Asbestos Consultant
Certification Number 02-3166

CONTENTS

PART - I

LEGEND AND GLOSSARY OF TERMS

PART - II

AHERA REPORT A – LIST OF BUILDINGS

PART - III

AHERA REPORT B – SURVEY REPORT

PART - IV

HOMOGENEOUS MATERIALS REPORT

PART - V

FRIABLE LOCATIONS REPORT

PART - VI

NON-FRIABLE LOCATIONS REPORT

PART - VII

RECOMMENDATIONS REPORT

PART - VIII

SAMPLES REPORT

PART - IX

DAMAGE REPORT

PART - X

SITE MAPS

LEGEND

THE FOLLOWING IS A LIST OF ABBREVIATIONS USED IN THIS REPORT:

Asbestos Sample Types

AC	=	ACTINOLITE
AM	=	AMOSITE
AN	=	ANTHOPHYLLITE
CH	=	CHRYSTILE
CR	=	CROCIDOLITE
TR	=	TREMOLITE
ND	=	NONE DETECTED
NS	=	NO SAMPLE

Measurements

APPROX.	=	APPROXIMATELY
EA	=	EACH
I	=	INCHES
LF	=	LINEAR FEET
N	=	NUMBER
O.D.	=	OUTSIDE DIAMETER
SF	=	SQUARE FEET
TBD	=	TO BE DETERMINED

LIST OF BUILDINGS AT

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	BUILDING AREA (APPROXIMATE)
BUILDING USED AS (#FLOORS) CONSTRUCTION	
()	
ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)	
Offices, Multi-Purpose Room, Music Room, Restrooms, Kitchen, Storage Rooms	7,800 SF
(1) Wood, Metal, Plaster, Gypsum Wallboard System	
BUS LOOP	
Covered waiting area	100 SF
(1) Wood, Metal, and Stucco	
CLASSROOMS 201-202 BUILDING (BUILDING 200)	
Classrooms, Restrooms, Utility Rooms	3,200 SF
(1) Wood, Metal, Plaster, Gypsum Wallboard System	
CLASSROOMS 301-306 BUILDING (BUILDING 300)	
Classrooms, RSP Room, Storage Room, Restrooms	10,400 SF
(1) Wood, Metal, Plaster, Gypsum Wallboard System	
CLASSROOMS 400-406 BUILDING (BUILDING 400)	
Classrooms, Library, Storage Room, Restrooms	10,400 SF
(1) Wood, Metal, Plaster, Gypsum Wallboard System	
CLASSROOMS 501-506 BUILDING (BUILDING 500)	
Classrooms, Science and Computer Lab	10,400 SF
(1) Wood, Metal, Plaster, Gypsum Wallboard System	
CLASSROOMS 801 PORTABLE BUILDING	
Classroom	960 SF
(1) Wood and Metal	
DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)	
Classroom	2,040 SF
(1) Wood and Metal Portable	
DAYCARE PORTABLE BUILDING - FED CHILDCARE (BUILDING 900)	
Classroom	960 SF
(1) Wood and Metal Portable	
DAYCARE PORTABLE BUILDING - SDC (BUILDING 800)	
Classroom	960 SF
(1) Wood and Metal Portable	
FAMILY RESOURCE CENTER (BUILDING 700)	
Daycare, Pre-School	1,440 SF
(1) Wood, Metal, Preformed Material	
METAL STORAGE CONTAINERS (3 EA)	
Storage	480 SF
(1) Metal	
MIDDLE QUAD PATIO	
Patio	1,600 SF
(1) Metal, Concrete	

LIST OF BUILDINGS AT

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME BUILDING USED AS (#FLOORS) CONSTRUCTION		BUILDING AREA (APPROXIMATE)
PORTABLE NEXT TO P6 (802)		
Classroom (1) Metal and Wood		900 SF
RIGHT AT SCHOOL PORTABLE (CLASSROOM P6) (803)		
Classroom (1) Metal and Wood		960 SF
WOOD STORAGE SHEDS (2 EA)		
Storage (1) Wood		170 SF
Total Number Of Buildings : <u>17</u>		(Approximate) Total Sq Ft. : <u>52,770</u>
End Of Report, Total Of 2 Pages		

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.

ASBESTOS CONTENT

ASBESTOS NAME

ASBESTOS CODE

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

09/14/2005 BUILDING NOTES:

03/09/2007 Building Name changed from ADMINISTRATION AND MULTI-PURPOSE ROOM to ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100). No other changes as of this date.

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

ALL OFFICES, AND HALLWAY TO STAGE

CARPET MASTIC

4,430 SF

09/15/2016 Mastic/Adhesive for Light Gray, Dark Gray, and Black Carpet. New Material installed during the Summer 2016 Flooring project. This Material is in GOOD condition as of this date.

02/08/2019 This Material is unchanged as of this date.

08/16/2019 This Material is unchanged as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

16-213AAA

NEW

NO SAMPLE

(NS)

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

ATTIC / PLENUM

PIPE FITTING INSULATION

(TBD) LF

09/14/2005	Pipe Fitting Insulation. material may exist in inaccessible locations. This Material is in GOOD condition as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.
08/19/2022	This Material is unchanged as of this date.
02/17/2023	This Material is unchanged as of this date.
08/18/2023	This Material is unchanged as of this date.
02/16/2024	This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

BOOK STORAGE ROOM, CUSTODIAL ROOM, AND PANTRY ROOM

BASEBOARD MASTIC

116 LF

09/14/2005	Mastic/Adhesive for 4" Brown Baseboard. This Material is in GOOD condition as of this date.
08/25/2006	Book Storage Room added to Location. 30 LF added to quantity. Location Name changed from CUSTODIAL ROOM, AND PANTRY ROOM to BOOK STORAGE ROOM, CUSTODIAL ROOM, AND PANTRY ROOM. Quantity changed from 86 LF to 116 LF to reflect this fact. No other changes as of this date.
04/03/2017	Damage Observed. <5% Physical Damage - in the form of 1 LF Damage and Missing Baseboard in Book Storage Room. Material condition changed from GOOD to FAIR overall. Friability changed from Non to Low. No other changes as of this date.
02/08/2019	This Material is unchanged as of this date.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

08/16/2019 This Material is unchanged as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

ENTIRE BUILDING

FIRE DOOR CORE INSULATION

546 SF

08/29/2014 Fire Door Core Insulation. (2 EA Double-Doors + 24 EA Single-Doors). This Material is in GOOD condition as of this date.

02/08/2019 This Material is unchanged as of this date.

08/16/2019 This Material is unchanged as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	
LOCATION	
MATERIAL TYPE	QTY (APPROXIMATE)
COMMENTS	

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/16/2024 This Material is unchanged as of this date.

14-198AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

ENTIRE BUILDING

SMOOTH WALL MISCELLANEOUS

24,500 SF

09/14/2005	Gypsum Wallboard System. (Material also exists behind Vinyl Covered Wall Panels in some areas). Damage: <5% Physical Damage - in exterior Water Heater Room; <10% Water Damage - in exterior Water Heater Room. This Material is in FAIR condition overall as of this date.
03/09/2007	Damage: <10% Water Damage - approximately 20 SF in Kitchen. Condition changed to reflect this fact. No other changes as of this date.
11/09/2007	This Material in POOR condition in Water Heater Room. This Material is in FAIR condition overall as of this date.
04/21/2008	Damage in the Water Heater Room is on all Walls. No other changes as of this date.
10/20/2008	Exterior Water Heater Room has 3/4 of Ceiling missing. <10% Water Damage. No other changes as of this date.
05/14/2009	Additional Damage observed. 2 SF is Water Damaged in the Pantry by the Exhaust. Material is cracked on the East and South Walls of the Book Storage Room/ Conference Room (Old Custodial Room). No other changes as of this date.
09/08/2009	Material remains in <5% Physical Damage and <10% Water Damage. This Material is unchanged as of this date.
02/01/2010	Samples 10-019 NW-69 (Joint Tape / Compound), NW-70 (Drywall) , NW-73 (Joint Tape / Compound) and NW-74 (Drywall) collected on this date.
09/18/2015	Additional Damage observed. Pantry by Exhaust has minor cuts and holes. No other change as of this date.
01/28/2016	Sample 16-030-A07 collected from Storage 121, Drywall Board. Sample 16-030-A08 collected from Storage 121, Joint Mud. Sample 16-030-A13 collected from Multi-purpose Room by 122 Door, Drywall.
09/15/2016	Partial Repairs observed. Damages noted on 05/14/09 have been covered with a Vinyl Panel. No other changes as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	Additional Damage Observed. <5% Physical Damage in the form of 1.5 SF of Missing and Peeling Skimcoat and Mud as well as a 3 LF Water Leak on the Ceiling by West Wall of Mens Staff Restroom. Material remains in FAIR condition overall. No other changes as of this date.		
02/16/2024	This Material is unchanged as of this date.		

10-018 NW-69	ND	NONE DETECTED	(ND)
10-018 NW-69	2	CHRYSTILE	(CH)
10-018 NW-70	ND	NONE DETECTED	(ND)
10-018 NW-73	ND	NONE DETECTED	(ND)
10-018 NW-73	2	CHRYSTILE	(CH)
10-018 NW-74	ND	NONE DETECTED	(ND)
16-030-A07	ND	NONE DETECTED	(ND)
16-030-A13	ND	NONE DETECTED	(ND)
16-030-A13	ND	NONE DETECTED	(ND)
16-030-A08	5%	CHRYSTILE	(CH)

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

ENTIRE BUILDING

SMOOTH WALL SURFACING

24,500 SF

08/25/2006	Skim Coat for Gypsum Wallboard System. (Material also exists behind Vinyl Covered Wall Panels in some areas). Damages noted in exterior Water Heater Room. This Material is in FAIR condition overall as of this date.
03/09/2007	Damage: <10% Water Damage - approximately 20 SF in in Kitchen. Condition changed to reflect this fact. No other changes as of this date.
11/09/2007	This Material in POOR condition in Water Heater Room. This Material is in FAIR condition overall as of this date.
10/20/2008	Exterior Water Heater Room has 3/4 of Ceiling is missing. <10% Water Damage. No other changes as of this date.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
05/14/2009	Additional Damage observed. 2 SF is Water Damaged in the Pantry by the Exhaust. Material is cracked on the East and South Walls of the Book Storage Room/ Conference Room (Old Custodial Room). No other changes as of this date.		
09/08/2009	Material remains in <5% Physical Damage and <10% Water Damage. This Material is unchanged as of this date.		
02/01/2010	Samples 10-019 NW-68 and NW-72 collected on this date.		
09/18/2015	Additional Damage observed. Pantry by Exhaust has minor cuts and holes. No other change as of this date.		
01/28/2016	Sample 16-030-A09 collected from Storage 121, Paint. Sample 16-030-A12 collected from MP Room by 122 Door, Skim Coat and Mud on Drywall.		
09/15/2016	Partial Repairs observed. Damages noted on 05/14/09 have been covered with a Vinyl Panel. No other changes as of this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	Additional Damage Observed. <5% Physical Damage in the form of 1.5 SF of Missing and Peeling Skimcoat and Mud as well as a 3 LF Water Leak on the Ceiling by West Wall of Mens Staff Restroom. Material remains in FAIR condition overall. No other changes as of this date.		
02/16/2024	This Material is unchanged as of this date.		
10-018 NW-68	2	CHRYSTILE	(CH)
10-018 NW-72	ND	NONE DETECTED	(ND)
16-030-A09	ND	NONE DETECTED	(ND)
16-030-A12	ND	NONE DETECTED	(ND)

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

ENTIRE BUILDING EXCEPT CUSTODIAL ROOM AND PANTRY ROOM

BASEBOARD MASTIC

1,420 LF

09/15/2016	Mastic/Adhesive for 4" Black, Gray, Green and 6" Gray and Green Baseboard (Original Entry Updated 8/19/22). New Material installed during Summer 2016 Flooring project. This Material is in GOOD condition as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	Damage Observed. <5% Physical Damage - in the form of 2 LF Loose Baseboard in Hallway near Nurse's Office. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.
08/19/2022	Material Re-Assessed. Material not observed, Material may exist under current 4" Black, Gray, Green and 6" Gray and Green Baseboard. No other changes as of this date.
02/17/2023	This Material is unchanged as of this date.
08/18/2023	This Material is unchanged as of this date.
02/16/2024	This Material is unchanged as of this date.

16-213AAA

NEW

NO SAMPLE

(NS)

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

EXTERIOR WALLS, AND ALL PERIMETER WALLS IN BACK OF BUILDING (UTILITY YARD FOR TRASH CAN ROOM WASHING AREA)

ROUGH WALL

17,180 SF

09/14/2005	Stucco Exterior Walls. This Material is in GOOD condition as of this date.
03/09/2007	Material changed from ' Stucco Walls. ' to ' Stucco Exterior Walls. ' No other changes as of this date.
01/28/2016	Sample 16-030-A10 collected from Storage 121, Exterior Stucco. Sample 16-030-A14 collected from MP Room Exterior by Door 123, Stucco.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		
05-212AAA	ASSUMED	NO SAMPLE	(NS)
16-030-A10	2%	CHRYSTOLE	(CH)
16-030-A14	ND	NONE DETECTED	(ND)

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

EXTERIOR WALLS, AND ALL PERIMETER WALLS IN BACK OF BUILDING (UTILITY YARD FOR TRASH CAN ROOM WASHING AREA)

ROUGH WALL SURFACING

17,180 SF

09/14/2005	Stucco Walls. This Material is in GOOD condition as of this date.		
03/09/2007	Material Description changed from ' Stucco Walls. ' to ' Skim Coat for Stucco Exterior Walls. ' No other changes as of this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

HALLWAY OF CONFERENCE ROOM, CONFERENCE ROOM, STAFF ROOM, DATA EQUIPMENT ROOM, NURSES' ROOM, NURSES' CLOSET, PRINCIPAL'S OFFICE, AND LOBBY

SUSPENDED CEILING TILE

1,490 SF

10/20/2008 2'x4' Suspended Ceiling Tile. Tiles are White with a pitted mark form pattern. This Material is in GOOD condition as of this date. (Original Entry updated 03./19/15.)

05/14/2009 Additional Material identified. Location changed from HALLWAY CONFERENCE ROOM, STAFF ROOM to HALLWAY CONFERENCE ROOM, STAFF ROOM AND DATA EQUIPMENT ROOM. Quantity changed from 1,450 SF to 1,490 SF. 1 Tile is water damaged in the Data Equipment Room next to the air vent. Friability changed from Moderate to High. This Material is in FAIR condition as of this date.

09/08/2009 Damage reassessed. There are now a total of 3 Tiles water damaged in Data Equipment Room next to air vent. Material remains in <10% water damage. No other changes as of this date.

02/01/2010 Sample 10-019 NW-71 collected on this date.

09/02/2010 Location Description changed from HALLWAY CONFERENCE ROOM, STAFF ROOM AND DATA EQUIPMENT ROOM to HALLWAY CONFERENCE ROOM, STAFF ROOM, DATA EQUIPMENT ROOM, AND NURSES' ROOM. Additional damage in the form of 1 Tile is missing in Data Equipment Room. Also, 1 Tile is water stained at Nurses' Room. Data Equipment Room has 1 Tile water damaged. No other changes as of this date.

12/01/2011 Location Description changed from HALLWAY CONFERENCE ROOM, STAFF ROOM, DATA EQUIPMENT ROOM, AND NURSES' ROOM to HALLWAY OF CONFERENCE ROOM, CONFERENCE ROOM, STAFF ROOM, DATA EQUIPMENT ROOM, NURSES' ROOM, NURSES' CLOSET, PRINCIPAL'S OFFICE, AND LOBBY. Additional Damage - in the form of 1 Tile is Water stained in Lobby. Also, 2 Tiles are missing in Data Equipment Room. Material remains in <5% Physical Damage and <10% Water Damage. No other changes as of this date.

03/19/2015 Tiles are White with a pitted mark form pattern. Original Entry updated. No other changes as of this date.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
09/18/2015	Damage Re-Assessed. Repairs made to Lobby and Nurse's Room. Damage Re-Assessed and is currently as follows for the following room: Data Equipment Room has 3 Tiles Physically Damaged and 1 Water Damaged. Additional Damage observed, Staff Room has 3 Tiles Physically Damaged. No other change as of this date.		
04/03/2017	Additional Damage Observed. Data Room now has 2 Tile with Physical Damage, 1 Tile is Missing and 1 has Water Damage. No other changes as of this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	Additional Damage Observed. <5% Physical Damage in the form of a total of 2 Ceiling Tiles with Water Stains in the Data Equipment Room. Staff Room has 2 SF of Water Stains on various Ceiling Tiles and 1 Broken Tile. Material Condition remains in FAIR condition overall. No other changes as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		

08-241AAA	ASSUMED	NO SAMPLE	(NS)
10-018 NW-71	ND	NONE DETECTED	(ND)

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

KITCHEN

VINYL SHEETING

572 SF

09/14/2005	Green Vinyl Sheeting. This Material is in GOOD condition as of this date.
08/25/2006	Material Re-Assessed. (Apparent New Material identified by the AHERA accredited Inspector). Recommendation changed to reflect this status. No other changes as of this date.
10/11/2012	Damage: <5% Physical Damage - in the form of 1 SF is Damaged. Material condition changed from GOOD to FAIR overall as of this date. Friability changed from Non-Friable to Friable to reflect this change.
01/28/2016	Sample 16-030-A04 collected from Kitchen 122, Green Vinyl Sheeting.

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

10

HazMat Doc

AHERA Report B - Survey

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		
05-212AAA	ASSUMED	NO SAMPLE	(NS)
16-030-A04	ND	NONE DETECTED	(ND)

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

KITCHEN

VINYL SHEETING BACKING PAPER/MASTIC

572 SF

09/14/2005	Backing Paper/Adhesive for Green Vinyl Sheeting. This Material is in GOOD condition as of this date.		
08/25/2006	Material Re-Assessed. (Apparent New Material identified by the AHERA accredited Inspector). Recommendation changed to reflect this status. No other changes as of this date.		
10/11/2012	Damage: <5% Physical Damage - in the form of 1 SF is Damaged. Material condition changed from GOOD to FAIR overall as of this date.		
01/28/2016	Sample 16-030-A05 collected from Kitchen 122, Backing Paper for Green Vinyl Sheeting.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
16-030-A05	ND	NONE DETECTED	(ND)

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

KITCHEN PANTRY CLOSET

VINYL FLOOR TILE

60 SF

09/14/2005 9"X9" Red Vinyl Floor Tile. This Material is in GOOD condition as of this date.

10/11/2012 Damage: <5% Physical Damage - in the form of 1 Tile is missing, 3 Tiles are broken, and Mastic/Adhesive is exposed. Material condition changed from GOOD to FAIR overall as of this date. Friability changed from Non-Friable to Friable to reflect this change.

03/07/2014 2 additional Tiles are broken and Mastic/Adhesive is exposed. No other changes as of this date.

04/03/2017 Additional Damage Observed. 8 Tiles Broken with Mastic Exposed and 4 Tiles Loose. 2 SF of Water Damage and debris at back of the closet. No other changes as of this date.

02/08/2019 This Material is unchanged as of this date.

08/16/2019 This Material is unchanged as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

KITCHEN PANTRY CLOSET

VINYL FLOOR TILE MASTIC

60 SF

09/14/2005 Mastic/Adhesive for 9"X9" Red Vinyl Floor Tile. This Material is in GOOD condition as of this date.

03/07/2014 6 Tiles are broken and Mastic/Adhesive is exposed. This Material is in FAIR condition. No other changes as of this date.

04/03/2017 Additional Damage Observed. 8 Tiles Broken with Mastic Exposed and 4 Tiles Loose. 2 SF of Water Damage and debris at back of the closet. No other changes as of this date.

02/08/2019 This Material is unchanged as of this date.

08/16/2019 This Material is unchanged as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	
LOCATION	
MATERIAL TYPE	QTY (APPROXIMATE)
COMMENTS	

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

MULTI-PURPOSE ROOM

SUSPENDED CEILING TILE 2,530 SF

10/20/2008	2'x2' Suspended Ceiling Tile. Tiles are White with a pitted mark form pattern.10 Tiles have Water Stains. This Material is in FAIR condition as of this date. (Original Entry updated 03/19/15.)
09/08/2009	Material remains in <10% Water Damage. Also, <5% Physical Damage in the form of 1 broken Tile. No other changes as of this date.
04/05/2013	Damage Re-Assessed. Only 1 Tile is Water stained. Material remains in FAIR condition. No other changes as of this date.
03/19/2015	Tiles are White with a pitted mark form pattern. Original Entry updated. This Material is unchanged as of this date.
09/18/2015	Damage Re-Assessed. Damage is currently as follows for the following room: Multipurpose Room has 4 Tiles Water Damaged and 1 Tile Physically Damaged. No other changes as of this date.
09/15/2016	Additional Damage observed. Multi-Purpose Room has 8 Tiles with Damage in the form of stains. No other changes as of this date.
04/03/2017	Additional Damage Observed. Multi-Purpose Room now has 12 Tiles with Water Damage. No other changes as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.
08/19/2022	This Material is unchanged as of this date.
02/17/2023	This Material is unchanged as of this date.
08/18/2023	This Material is unchanged as of this date.
02/16/2024	This Material is unchanged as of this date.

08-241AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

MULTI-PURPOSE ROOM, NURSES ROOM, STAFF WORK ROOM, AND SERVING AREA

VINYL FLOOR TILE

4,200 SF

09/15/2016	12"x12" Light Grey and Blue Vinyl Floor Tiles (Original Enty Updated 8/19/22). New Material installed during the Summer 2016 Flooring project. This Material is in GOOD condition as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.
08/19/2022	Material Re-Assessed. Material not observed, Material may exist under current 12"x12" Light Grey and Blue Vinyl Floor Tiles. No other changes as of this date.
02/17/2023	This Material is unchanged as of this date.
08/18/2023	This Material is unchanged as of this date.
02/16/2024	This Material is unchanged as of this date.

16-213AAA

NEW

NO SAMPLE

(NS)

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

MULTI-PURPOSE ROOM, NURSES ROOM, STAFF WORK ROOM, AND SERVING AREA

VINYL FLOOR TILE MASTIC

4,200 SF

09/15/2016	Mastic/Adhesive for 12"x12" Light Grey and Blue Vinyl Floor Tiles (Original Enty Updated 8/19/22). New Material installed during the Summer 2016 Flooring project. This Material is in GOOD condition as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	Material Re-Assessed. Material not observed, Material may exist under current 12"x12" Light Grey and Blue Vinyl Floor Tiles. No other changes as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		

16-213AAA	NEW	NO SAMPLE	(NS)
-----------	-----	-----------	--------

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

MULTI-PURPOSE ROOM, OFFICES, AND HALLWAYS

VINYL WALL COVER

18,680 SF

09/14/2005	4'X8' Vinyl Covered Wall Panels, (over Gypsum Wallboard System). This Material is in GOOD condition as of this date.		
08/30/2017	Damage Observed. <5% Physical Damage - in the form of Seveal areas have Scrapes in the Materail. Material condition changed from GOOD to FAIR overall. No other changes as of this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	Additional Damage Observed. 1 SF of Loose Peeling Vinyl Floor Wall in Staff Lounge. No other changes as of this date.		
09/01/2020	Additional Damage Observed. In Multi-Purpose Room 1 SF of Torn Vinyl Wall Cover on North Wall. 4 SF of Torn Vinyl Wall Cover on South Wall. No other changes as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/16/2024 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

MULTI-PURPOSE ROOM, OFFICES, AND HALLWAYS

VINYL WALL COVER MASTIC

18,680 SF

09/14/2005 Mastic/Adhesive for Vinyl Covered Wall Panels, (over Gypsum Wallboard System). This Material is in GOOD condition as of this date.

08/30/2017 Damage Observed. <5% Physical Damage - in the form of Several areas have Scrapes in the Material. Material condition changed from GOOD to FAIR overall. Friability changed from Non to Low. No other changes as of this date.

02/08/2019 This Material is unchanged as of this date.

08/16/2019 This Material is unchanged as of this date.

01/31/2020 Additional Damage Observed. 1 SF of Loose Peeling Vinyl Floor Wall in Staff Lounge. No other changes as of this date.

09/01/2020 Additional Damage Observed. In Multi-Purpose Room 1 SF of Torn Vinyl Wall Cover on North Wall. 4 SF of Torn Vinyl Wall Cover on South Wall. No other changes as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

PTA ROOM

VINYL FLOOR TILE

144 SF

09/14/2005 12"x12" Off-White Vinyl Floor Tile. This Material is in GOOD condition as of this date.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
03/07/2014	Location name changed from CONFERENCE ROOM (OLD CUSTODIAN ROOM) to PTA ROOM. 1 Tile is broken and Mastic/Adhesive is exposed. No other changes as of this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		
05-212AAA	ASSUMED	NO SAMPLE	(NS)

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

PTA ROOM

VINYL FLOOR TILE MASTIC

144 SF

09/14/2005	Mastic/Adhesive for 12"x12" Off-White Vinyl Floor Tile. This Material is in GOOD condition as of this date.		
03/07/2014	Location name changed from CONFERENCE ROOM (OLD CUSTODIAN ROOM) to PTA ROOM. 1 Tile is broken and Mastic/Adhesive is exposed. No other changes as of this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		
05-212AAA	ASSUMED	NO SAMPLE	(NS)

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

STAFF RESTROOMS (2), NURSES' RESTROOM, AND KITCHEN RESTROOM

MORTAR MISCELLANEOUS

640 SF

12/01/2011	Grout/Mortar for 4"x4" Red, Green, and Brown Ceramic Wall Tiles. This Material is in GOOD condition as of this date. (Original Entry updated on 03/07/14.)		
03/07/2014	Tiles are White, Red, Green, and Brown. Original entry updated. No other changes as of this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		

11-202AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

STAFF RESTROOMS (2), NURSES' RESTROOM, AND KITCHEN RESTROOM

MORTAR MISCELLANEOUS

270 SF

12/01/2011	Grout/Mortar for 8"x8" Green, Red, and Pink Ceramic Floor Tiles This Material is in GOOD condition as of this date. (Original Entry updated on 03/07/14.)
03/07/2014	Material Re-Assessed. Tiles are 8" x 8" and are Green, Red, and Pink. Material Description changed from 'Grout/Mortar for 1"x1" Multicolor Ceramic Floor Tiles' to 'Grout/Mortar for 8"x8" Green, Red, and Pink Ceramic Floor Tiles.' Original entry updated. No other changes as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.
08/19/2022	This Material is unchanged as of this date.
02/17/2023	This Material is unchanged as of this date.
08/18/2023	This Material is unchanged as of this date.
02/16/2024	This Material is unchanged as of this date.

11-202AAA

ASSUMED

NO SAMPLE

(NS)

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

TEACHER'S LOUNGE AND NURSE'S ROOM

SINK UNDERCOATING

8 SF

10/20/2008	Grey Thermal Undercoating on Sink. (2 EA Sink). This Material is in GOOD condition as of this date. (Original Entry updated on 09/02/10.)
09/02/2010	Undercoating is Grey. Original entry updated. No other changes as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		
08-241AAA	ASSUMED	NO SAMPLE	(NS)

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

WOMENS RESTROOM

MORTAR MISCELLANEOUS

120 SF

09/18/2015	Grout/Mortar for 9" Pink Ceramic Tile. This Material is in GOOD condition as of this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
15-174AAA	ASSUMED	NO SAMPLE	' NS '

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.

ASBESTOS CONTENT

ASBESTOS NAME

ASBESTOS CODE

BUS LOOP

BUS LOOP

09/15/2016 BUILDING NOTES:

09/15/2016 Building Name changed from CARPORT / WAITING AREA to BUS LOOP.

BUS LOOP

EXTERIOR WALL

PAPER TYPE INSULATION

800 SF

09/08/2009 Paper Material under Stucco on Exterior Walls and Overhangs. Damage: <5% Physical Damage due to Damaged sections on lower portion of material on various locations. This Material is in FAIR condition as of this date.

03/07/2014 This Material is unchanged as of this date.

08/29/2014 This Material is unchanged as of this date.

03/19/2015 This Material is unchanged as of this date.

09/15/2016 Repairs observed. Damages repaired as of this date. Material Condition changed from FAIR to GOOD. No other changes as of this date.

02/08/2019 This Material is unchanged as of this date.

08/16/2019 This Material is unchanged as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

SF= Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/16/2024 This Material is unchanged as of this date.

09-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

BUS LOOP

EXTERIOR WALL

ROUGH WALL

800 SF

09/08/2009 Stucco on Exterior Walls and Overhangs. Damage: <5% Physical Damage due to damaged sections on lower portion of material on various locations. This Material is in FAIR condition as of this date.

03/07/2014 This Material is unchanged as of this date.

08/29/2014 This Material is unchanged as of this date.

03/19/2015 This Material is unchanged as of this date.

09/15/2016 Repairs observed. Damages repaired as of this date. Material Condition changed from FAIR to GOOD. No other changes as of this date.

02/08/2019 This Material is unchanged as of this date.

08/16/2019 This Material is unchanged as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

09-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

BUS LOOP

EXTERIOR WALL

ROUGH WALL SURFACING

800 SF

09/08/2009	Skim Coat for Stucco on Exterior Walls and Overhangs. Damage: <5% Physical Damage due to damaged sections on lower portion of material on various locations. This Material is in FAIR condition as of this date.		
03/07/2014	This Material is unchanged as of this date.		
08/29/2014	This Material is unchanged as of this date.		
03/19/2015	This Material is unchanged as of this date.		
09/15/2016	Repairs observed. Damages repaired as of this date. Material Condition changed from FAIR to GOOD. No other changes as of this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		

09-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	
LOCATION	
MATERIAL TYPE	QTY (APPROXIMATE)
COMMENTS	

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
-------------------	-------------------------	----------------------	----------------------

CLASSROOMS 201-202 BUILDING (BUILDING 200)

CLASSROOMS 201-202 BUILDING (BUILDING 200)

03/06/2017 BUILDING NOTES:

03/09/2007 Building Name changed from CLASSROOMS 201 AND 202 to CLASSROOMS 201-202 BUILDING (BUILDING 200).

CLASSROOMS 201-202 BUILDING (BUILDING 200)

ALL ROOMS AND CLOSETS

BASEBOARD MASTIC

90 SF

09/15/2016 Mastic/Adhesive for 4" Black Baseboard (Original Entry Updated 8/19/22). New Material installed during Summer of 2016 Flooring project. This Material is unchanged as of this date.

02/08/2019 This Material is unchanged as of this date.

08/16/2019 This Material is unchanged as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 Material Re-Assessed. Material not observed, Material may exist under current 4" Black Baseboard. No other changes as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

16-213AAA	NEW	NO SAMPLE	(NS)
------------------	------------	------------------	---------------

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	
LOCATION	
MATERIAL TYPE	QTY (APPROXIMATE)
COMMENTS	

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

CLASSROOMS 201-202 BUILDING (BUILDING 200)

CLASSROOMS 201 AND 202

CARPET MASTIC

1,500 SF

09/15/2016	Mastic/Adhesive for Gray/Black Carpet. New Material installed during Summer 2016 Flooring project. This Material is in GOOD condition as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.
08/19/2022	This Material is unchanged as of this date.
02/17/2023	This Material is unchanged as of this date.
08/18/2023	This Material is unchanged as of this date.
02/16/2024	This Material is unchanged as of this date.

16-213AAA	NEW	NO SAMPLE	(NS)
-----------	-----	-----------	--------

CLASSROOMS 201-202 BUILDING (BUILDING 200)

CLASSROOMS 201 AND 202

SUSPENDED CEILING TILE

2,600 SF

09/14/2005	2'X4' SUSPENDED CEILING TILE. Tiles are White with a pitted mark form pattern. This Material is in GOOD condition as of this date. (Original Entry updated 03/19/15.)
10/20/2008	3 Tiles are Water Stained in Classroom 202. No other changes as of this date.
09/08/2009	Material remains in <10% Water Damage and in FAIR condition. This Material is unchanged as of this date.
02/01/2010	Sample 10-019 NW-61 collected on this date.
03/11/2010	Additional Damage observed in Classroom 201 has 1 Tile Water Damaged. No other changes as of this date.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
09/02/2010	Additional Damage observed in the form of Classroom 202 now had a total of 6 Tiles Water stained. Also, Classroom 201 has an additional 5 Tiles Water Damaged. No other changes as of this date.		
12/01/2011	Damages Re-Assessed. Classroom 201, 4 Tiles have been replaced, and 1 remains Water Damaged. Classroom 202 now has a total of 5 Tiles Water stained - 1 has been repaired. No other changes as of this date.		
10/11/2012	Material condition Re-Assessed. 4 Water stained Tiles in Classroom 202 have been repaired. Material remains in FAIR condition. No other changes as of this date.		
03/19/2015	Tiles are White with a pitted mark form pattern. Original Entry updated. This Material is unchanged as of this date.		
09/15/2016	Additional Damage observed. Room 202 now has 2 Tiles with Water stains. No other changes as of this date.		
04/03/2017	Additional Damage Observed. <10% Water Damage - in the form of 10 Tiles with Water Damage in Classroom 201. No other changes as of this date.		
08/30/2017	Additional Damage Observed. Room 202 has 2 Tiles with Physical Damage in the form of Cracked and Chipped corners. No other changes as of this date.		
02/16/2018	Additional Damage Observed. Room 202 now has 5 Tiles with Water Stains. Partail Repairs made to Tiles in Classroom 201, 4 other Tiles have Water Stains. No other changes as of this date.		
08/15/2018	Additional Damage Observed. Room 202 now has 6 Tiles with Water Stains. Partail Repairs made to Tiles in Classroom 201 4 Tiles Replaced 2 Tiles have Water Stains. No other changes as of this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		

05-212AAA

ASSUMED

NO SAMPLE

(NS)

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

28

HazMat Doc

AHERA Report B - Survey

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
05-010111	ASSUMED	NO SAMPLE	NS
10-018 NW-61	ND	NONE DETECTED	(ND)

CLASSROOMS 201-202 BUILDING (BUILDING 200)

CLASSROOMS 201 AND 202

VINYL WALL COVER

1,600 SF

08/25/2006	4'x8' Vinyl Covered Wall Panels, (over Gypsum Wallboard System). This Material is in GOOD condition as of this date.
09/26/2013	Friability changed from Low to Non. No other changes as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.
08/19/2022	This Material is unchanged as of this date.
02/17/2023	This Material is unchanged as of this date.
08/18/2023	This Material is unchanged as of this date.
02/16/2024	This Material is unchanged as of this date.

06-223AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS 201-202 BUILDING (BUILDING 200)

CLASSROOMS 201 AND 202

VINYL WALL COVER MASTIC

1,600 SF

08/25/2006	Mastic/Adhesive for 4'X8' Vinyl Covered Wall Panels, (over Gypsum Wallboard System). This Material is in GOOD condition as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		
06-223AAA	ASSUMED	NO SAMPLE	(NS)

CLASSROOMS 201-202 BUILDING (BUILDING 200)

CLASSROOMS 201 AND 202, RESTROOMS, STORAGE ROOMS AND UTILITY ROOMS

SMOOTH WALL MISCELLANEOUS

2,600 SF

09/14/2005	Gypsum Wallboard System, (with 4'x8' Covered Wall Panels in some areas). This Material is in GOOD condition as of this date.
03/09/2007	Material changed from Gypsum Wallboard System. ' to ' GYPSUM WALLBOARD SYSTEM, (with 4'x8' Covered Wall Panels in some areas). ' No other changes as of this date.
05/14/2009	2 SF is Damaged in the Exterior Storage Closets, 1 SF in each, where Exhaust Ducts have been removed. Several holes and cuts observed on the Walls and Ceilings in 2 Storage Closets and the Custodian Room. No other changes as of this date.
09/08/2009	Material remains in <5% physical damage. This Material is unchanged as of this date.
02/01/2010	Samples 10-019 NW-63 (Joint Tape / Compound), NW-64 (Drywall), NW-66 (Joint Tape / Compound), and NW-67 (Drywall) collected on this date.
09/26/2013	Material Re-Assessed. Friability changed from Moderate to Low. Material changed from GOOD to FAIR condition. No other changes as of this date.
03/07/2014	Friability changed from Low to Moderate. No other changes as of this date.
09/18/2015	Additional Damage observed. Exterior Storage Rooms have minor holes and cuts. No other changes as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

30

HazMat Doc

AHERA Report B - Survey

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

01/31/2020	This Material is unchanged as of this date.		
09/01/2020	Additional Damage Observed. 2 SF of Missing Wall in Storage Room near Classroom 201. No other changes as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		

10-018 NW-63	ND	NONE DETECTED	(ND)
10-018 NW-63	ND	NONE DETECTED	(ND)
10-018 NW-64	ND	NONE DETECTED	(ND)
10-018 NW-66	ND	NONE DETECTED	(ND)
10-018 NW-66	2	CHRYSTOLE	(CH)
10-018 NW-67	ND	NONE DETECTED	(ND)

CLASSROOMS 201-202 BUILDING (BUILDING 200)

CLASSROOMS 201 AND 202, RESTROOMS, STORAGE ROOMS AND UTILITY ROOMS

SMOOTH WALL SURFACING

2,600 SF

08/25/2006	Skim Coat for Gypsum Wallboard System, (with 4'x8' Covered Wall Panels in some areas). This Material is in GOOD condition as of this date.		
03/09/2007	Material Description changed from ' Skim Coat for Gypsum Wallboard System. ' to ' Skim Coat for GYPSUM WALLBOARD SYSTEM, (with 4'x8' Covered Wall Panels in some areas). ' No other changes as of this date.		
05/14/2009	2 SF is Damaged in the Exterior Storage Closets, 1 SF in each, where Exhaust Ducts have been removed. Several holes and cuts observed on the Walls and Ceilings in 2 Storage Closets and the Custodian Room. Friability changed from Low to Moderate. No other changes as of this date.		
09/08/2009	Material remains in <5% Physical Damage. This Material is unchanged as of this date.		
02/01/2010	Samples 10-019 NW-62 and NW-65 collected on this date.		
09/26/2013	Material Re-Assessed. Material changed from GOOD to FAIR condition as of this date. No other changes as of this date.		

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

31

HazMat Doc

AHERA Report B - Survey

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
09/18/2015	Additional Damage observed, Exterior Storage Rooms have minor holes and cuts. No other change as of this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	Additional Damage Observed. 2 SF of Missing Wall in Storage Room near Classroom 201. No other changes as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		

10-018 NW-62	ND	NONE DETECTED	(ND)
10-018 NW-65	2	CHRYSTOLE	(CH)

CLASSROOMS 201-202 BUILDING (BUILDING 200)

CLASSROOMS 201 AND 202 WET / SINK AREAS AND STORAGE ROOMS

VINYL FLOOR TILE

1,500 SF

09/15/2016	12"x12" Light Grey Vinyl Floor Tiles. New Material installed during the Summer 2016 Flooring project. This Material is in GOOD condition as of this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	Material Re-Assessed. Material not observed, Material may exist under current 12"x12" Light Gray and Blue Vinyl Floor Tiles. No other changes as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		
16-203AAA	NEW	NO SAMPLE	(NS)

CLASSROOMS 201-202 BUILDING (BUILDING 200)

CLASSROOMS 201 AND 202 WET / SINK AREAS AND STORAGE ROOMS

VINYL FLOOR TILE

1,500 SF

08/19/2022	12"x12" Light Grey and Blue Vinyl Floor Tiles. This Material is in GOOD condition as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		

22-094.NS	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS 201-202 BUILDING (BUILDING 200)

CLASSROOMS 201 AND 202 WET / SINK AREAS AND STORAGE ROOMS

VINYL FLOOR TILE MASTIC

1,500 SF

09/15/2016	12"x12" Light Grey Vinyl Floor Tiles. New Material installed during the Summer 2016 Flooring project. This Material is in GOOD condition as of this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
08/19/2022	Material Re-Assessed. Material not observed, Material may exist under current 12"x12" Light Gray and Blue Vinyl Floor Tiles. No other changes as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		

16-203AAA	NEW	NO SAMPLE	(NS)
------------------	------------	------------------	---------------

CLASSROOMS 201-202 BUILDING (BUILDING 200)

CLASSROOMS 201 AND 202 WET / SINK AREAS AND STORAGE ROOMS

VINYL FLOOR TILE MASTIC

1,500 SF

09/18/2015	12"x12" Light Grey and Blue Vinyl Floor Tiles. This Material is in GOOD condition as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		

22-094.NS	ASSUMED	NO SAMPLE	(NS)
------------------	----------------	------------------	---------------

CLASSROOMS 201-202 BUILDING (BUILDING 200)

CLASSROOMS 201-202

SINK UNDERCOATING

8 SF

10/20/2008	Grey Thermal Undercoating on Sink. (2 EA Sink). This Material is in GOOD condition as of this date. (Original Entry updated on 09/02/10.)		
05/14/2009	This Material is unchanged as of this date. (Apparent New Material identified by the AHERA accredited Inspector.)		
09/02/2010	Undercoating is Grey. Original entry updated. No other changes as of this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

08-241AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS 201-202 BUILDING (BUILDING 200)

CUSTODIAN ROOM AND BOILER ROOM

BASEBOARD MASTIC

80 LF

10/20/2008 Mastic/Adhesive for 4" Brown Baseboard. This Material is in GOOD condition as of this date.

02/08/2019 This Material is unchanged as of this date.

08/16/2019 This Material is unchanged as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

08-241AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

CLASSROOMS 201-202 BUILDING (BUILDING 200)

ENTIRE BUILDING

FIRE DOOR CORE INSULATION

210 SF

08/29/2014	Fire Door Core Insulation. (1 EA Double-Doors + 9 EA Single-Doors). This Material is in GOOD condition as of this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		

14-198AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS 201-202 BUILDING (BUILDING 200)

EXTERIOR WALLS

ROUGH WALL

3,200 SF

09/14/2005	Stucco Walls. This Material is in GOOD condition as of this date.		
03/09/2007	Material Description changed from ' STUCCO WALLS. ' to ' Stucco Exterior Walls. ' No other changes as of this date.		
01/28/2016	Sample 16-030-A18 collected from Exterior Wall by Drinking Fountain, Stucco.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		
05-212AAA	ASSUMED	NO SAMPLE	(NS)
16-030-A18	ND	NONE DETECTED	(ND)

CLASSROOMS 201-202 BUILDING (BUILDING 200)

EXTERIOR WALLS

ROUGH WALL SURFACING

3,200 SF

09/14/2005	Skim Coat for Stucco on Walls. This Material is in GOOD condition as of this date.		
03/09/2007	Material Description changed from ' Skim Coat STUCCO WALLS. ' to ' Skim Coat for Stucco Exterior Walls. ' This Material is unchanged as of this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/16/2024 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS 201-202 BUILDING (BUILDING 200)

EXTERIOR WINDOWS

CAULKING

200 LF

09/08/2009 Caulking on Exterior Windows. Damage: <5% Physical Damage and <10% Water Damage due to existing degradation of heat and moisture factors and missing portion of material in various locations. This Material is in FAIR condition as of this date.

02/08/2019 This Material is unchanged as of this date.

08/16/2019 This Material is unchanged as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

09-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS 201-202 BUILDING (BUILDING 200)

RESTROOMS

MORTAR MISCELLANEOUS

200 SF

05/14/2009 Grout/Mortar for 8"x8" Green Ceramic Floor Tiles. This Material is in GOOD condition as of this date. (Original Entry updated on 09/02/10.)

09/02/2010 Material Description changed from ' Grout/Mortar for 4"x4" Ceramic Wall Tiles. ' to ' Grout/Mortar for 8"x8" Green Ceramic Floor Tiles. ' Quantity changed from 180 SF to 200 SF. Original entry updated. No other changes as of this date.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
01/28/2016	Sample 16-030-A22 collected Classroom 202, Grout for 8"x8" Ceramic Floor Tile.		
08/30/2017	Damage Observed. <5% Physical Damage - in the form of 2 Broken Tiles and Chipped Grout, in Room 201. Material condition changed from GOOD to FAIR overall. Friability changed from Non to Low. No other changes as of this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		

09-098AAA	ASSUMED	NO SAMPLE	(NS)
16-030-A22	ND	NONE DETECTED	(ND)

CLASSROOMS 201-202 BUILDING (BUILDING 200)

RESTROOMS, ENTRY WAY TO CLASSROOMS, AND CUSTODIAL ROOM

MORTAR MISCELLANEOUS

560 SF

10/20/2008	Grout/Mortar for 4"x4" Multi-Colored Ceramic Wall Tiles. This Material is in GOOD condition as of this date. (Original Entry updated 03/19/15.)
05/14/2009	This Material is unchanged as of this date. (Apparent New Material identified by the AHERA accredited Inspector.)
12/01/2011	Location Description changed from RESTROOMS to RESTROOMS, AND ENTRY WAY TO CLASSROOMS. Quantity changed from 180 SF to 252 SF. No other changes as of this date.
03/07/2014	Loaction changed from RESTROOMS, AND ENTRY WAY TO CLASSROOMS to RESTROOMS, ENTRY WAY TO CLASSROOMS, AND CUSTODIAL ROOM. Quantity changed from 252 SF to 560 SF. No other changes as of this date.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
03/19/2015	Material Description changed from 4"x4" Multi-Colored Ceramic Wall Tiles to Grout/Mortar for 4"x4" Multi-Colored Ceramic Wall Tiles. Original Entry updated. Material type changed from Wall Tile to Mortar Miscellaneous. No other changes as of this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		
08-241AAA	ASSUMED	NO SAMPLE	(NS)

CLASSROOMS 201-202 BUILDING (BUILDING 200)

STUDENT RESTROOMS

MORTAR MISCELLANEOUS

300 SF

09/18/2015	Grout/Mortar for 9" Pink Ceramic Tile. This Material is in GOOD condition as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

15-174AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

CLASSROOMS 301-306 BUILDING (BUILDING 300)

CLASSROOMS 301-306 BUILDING (BUILDING 300)

09/14/2005	BUILDING NOTES:
03/09/2007	Building Name changed from CLASSROOMS 301-306 to CLASSROOMS 301-306 BUILDING (BUILDING 300).
09/15/2016	Major Remodel during the Summer of 2016 per information received from the BUESD. REP Classrooms changed to Flexible Instructional Space (F.I.S.)

CLASSROOMS 301-306 BUILDING (BUILDING 300)

ALL CLASSROOMS AND F.I.S. ROOM

VINYL WALL COVER

29,000 SF

09/14/2005	4'x8' Vinyl Covered Wall Panels, (over Gypsum Wallboard System). This Material is in GOOD condition as of this date.
01/28/2016	Sample 16-030-A36 collected from Room 303 Demising Wall, Vinyl Cover on Sheetrock Wall.
09/15/2016	Location Description changed and some Material Removed during the Summer 2016 Renovation Project. Location Description changed from ALL CLASSROOMS AND RSP ROOM to ALL CLASSROOMS AND F.I.S. ROOM. Wall Removed in Classrooms 307 and 308. Material only in Classrooms 301-306. Material Quantity changed from 30,500 SF to 29,000 SF. No other changes as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.
08/19/2022	This Material is unchanged as of this date.
02/17/2023	This Material is unchanged as of this date.
08/18/2023	This Material is unchanged as of this date.
02/16/2024	This Material is unchanged as of this date.

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
05-212AAA	ASSUMED	NO SAMPLE	(NS)
16-030-A36	ND	NONE DETECTED	(ND)

CLASSROOMS 301-306 BUILDING (BUILDING 300)

ALL CLASSROOMS AND F.I.S. ROOM

VINYL WALL COVER MASTIC

29,000 SF

09/14/2005	Mastic/Adhesive for 4'x8' Vinyl Covered Wall Panels, (over Gypsum Wallboard System). This Material is in GOOD condition as of this date.
09/15/2016	Location Description changed and some Material Removed during the Summer 2016 Renovation Project. Location Description changed from ALL CLASSROOMS AND RSP ROOM to ALL CLASSROOMS AND F.I.S. ROOM. Wall Removed in Classrooms 307 and 308. Material only in Classrooms 301-306. Material Quantity changed from 30,500 SF to 29,000 SF. No other changes as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.
08/19/2022	This Material is unchanged as of this date.
02/17/2023	This Material is unchanged as of this date.
08/18/2023	This Material is unchanged as of this date.
02/16/2024	This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS 301-306 BUILDING (BUILDING 300)

BOYS' AND GIRLS' RESTROOMS AND STORAGE ROOM

MORTAR MISCELLANEOUS

350 SF

10/20/2008	Grout/Mortar for 4"x4" Multi-Colored Wall Tiles. This Material is in GOOD condition as of this date.
03/07/2014	Quantity changed from 720 SF to 350 SF. Tiles are White, Green, and Brown. No other changes as of this date.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		
08-241AAA	ASSUMED	NO SAMPLE	(NS)

CLASSROOMS 301-306 BUILDING (BUILDING 300)

CLASSROOMS 301-306, F.I.S. AND FOUR STORAGE ROOMS

SUSPENDED CEILING TILE

9,400 SF

09/14/2005	2'x4' Suspended Ceiling Tile . Tiles are White with a pitted mark form pattern. This Material is in GOOD condition as of this date. (Original Entry updated 03/19/15.)
10/20/2008	Classroom 305 has 3 Tiles Water Stained. RSP Room still has water stains. No other changes as of this date.
05/14/2009	Additional Damage observed. 2 Tiles are Water Damaged in the Storage Room of Classrooms 303 and 304 as of this date.
09/08/2009	Damage Re-Assessed. Additional Damage observed in the form of 2 Tiles are water stained in Classroom 307, and RSP Room has 2 Tiles Water stained. Damage remains in <10% Water Damage. No other changes as of this date.
02/01/2010	Samples 10-019 NW-75 collected on this date.
03/11/2010	Additional Damage observed in the form of Classroom 303 has 2 Tiles Water Damaged. Friability changed from Moderate to High to reflect this change.
09/02/2010	Additional Damage in the form of Classroom 302 has 1 Tile broken and 1 Tile Water stained. Classroom 305 has 2 additional Tiles Water stained. Damages repaired in Storage Room of Classrooms 303 and 304. No other changes as of this date.

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
12/01/2011	Additional Damage - in the form of Classroom 302 has 1 additional Tile water damaged. No other changes as of this date.		
04/05/2013	Material Condition Re-Assessed. Damaged Tiles have been Removed and Replaced with new Tiles in Classrooms 302, 303 and 304. Room 305 still remains Damaged with 2 Water Damaged Tiles. Material remains in FAIR condition. Friability changed from High to Moderate. No other changes as of this date.		
03/07/2014	Friability changed from Moderate to High. No other changes as of this date.		
03/19/2015	Tiles are White with a pitted mark form pattern. Original Entry updated. No other changes as of this date.		
09/18/2015	Damage Re-Assessed. Repairs made to Room 305 and RSP Room. Classroom 307 has 1 Tile Physically Damaged. Additional Damages observed, Storage Room between Rooms 303 and 304 has 1 Tile Physically Damaged and Storage Room between Rooms 301 and 302 has 2 Tiles Physically Damaged. No other changes as of this date.		
01/28/2016	Sample 16-030-A26 collected from Workroom 304, 2'x4' Suspended Ceiling Tile.		
09/15/2016	Location Description changed. Location Description changed from RSP ROOM, CLASSROOMS 301-306 AND FOUR STORAGE ROOMS to CLASSROOMS 301-306, F.I.S. AND FOUR STORAGE ROOMS. No other changes as of this date.		
04/03/2017	Additional Damage Observed. 2 Tiles have Water Damage in Classroom 304. No other changes as of this date.		
02/16/2018	Additional Damage Observed. 2 Broken Tiles in Classroom 306. Partial Repairs made to Tiles in Classroom 304. Remains in FAIR condition. No other changes as of this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	Additional Damage Observed. 3 Tiles Broken in Work Room Between Classrooms 303 and 304. 5 Cracked Tiles in Classroom 305. 4 Tiles with Water Stains in Classroom 306. No other changes as of this date.		
02/12/2021	Additional Damage Observed. <5% Physical Damage in th form of 1 Tile with Water Stains and 1 Tile with Cracks in Work Room of Classrooms 305 and 306. Material remains in FAIR condition overall. No other changes as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/16/2024 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
10-018 NW-75	ND	NONE DETECTED	(ND)
16-030-A26	ND	NONE DETECTED	(ND)

CLASSROOMS 301-306 BUILDING (BUILDING 300)

CLASSROOMS 301-306, F.I.S. AND STORAGE ROOMS

BASEBOARD MASTIC

1,400 LF

09/15/2016 Mastic/Adhesive for 4" and 6" Light Gray and Dark Gray Baseboard. New Material installed during the Summer 2016 Flooring project. This Material is in GOOD condition as of this date.

02/08/2019 This Material is unchanged as of this date.

08/16/2019 This Material is unchanged as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 Material Re-Assessed. Classrooms 301-306 now have 4" Black Baseboard, Old Mastic may be underneath. Teachers Workroom and Storage Rooms have 4" Black Baseboard, Old Mastic may be underneath. FIS Room now has 4" Gray Baseboard, Old Mastic may be underneath. No other changes as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

16-203AAA	NEW	NO SAMPLE	(NS)
-----------	-----	-----------	--------

CLASSROOMS 301-306 BUILDING (BUILDING 300)

CLASSROOMS 301-306, HALLWAY, AND F.I.S.

CARPET MASTIC

7,684 SF

09/15/2016 Mastic/Adhesive for Light Gray, Dark Gray, and Black Carpet. New Material installed during Summer 2016 Flooring project. This Material is in GOOD condition as of this date.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	Material Re-Assessed. Material not observed, Material may exist under current Gray and Black Carpet. No other changes as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		
16-213AAA	NEW	NO SAMPLE	(NS)

CLASSROOMS 301-306 BUILDING (BUILDING 300)

CLASSROOMS 301-308, AND RESTROOMS (2)

MORTAR MISCELLANEOUS

700 SF

09/02/2010	Grout/Mortar for 8"x8" Green Ceramic Wall Tiles. This Material is in GOOD condition as of this date.		
12/01/2011	Location Description changed from CLASSROOMS 301-306, AND RESTROOMS (2) to CLASSROOMS 301-308, AND RESTROOMS (2). Wall Tiles are Green, Red and Pink. No other changes as of this date.		
03/07/2014	These are 8"x8" Green Ceramic Floor Tiles. No other changes as of this date.		
01/28/2016	Sample 16-030-A25 collected from Room 310, Grout for 8"x8" Ceramic Floor Tile.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

10-174AAA	ASSUMED	NO SAMPLE	(NS)
16-030-A25	ND	NONE DETECTED	(ND)

CLASSROOMS 301-306 BUILDING (BUILDING 300)

ENTIRE BUILDING

CEMENTITIOUS MISCELLANEOUS

70 SF

08/29/2014 Exterior A/C Cementitious Window Panel. Replacement on Lower and Upper Window Panel. Only on Some areas. This Material is in GOOD condition as of this date.

02/08/2019 This Material is unchanged as of this date.

08/16/2019 This Material is unchanged as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

14-198AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

CLASSROOMS 301-306 BUILDING (BUILDING 300)

ENTIRE BUILDING

FIRE DOOR CORE INSULATION

672 SF

08/29/2014	Fire Door Core Insulation. (2 EA Double-Doors + 30 EA Single-Doors). This Material is in GOOD condition as of this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		

14-198AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS 301-306 BUILDING (BUILDING 300)

ENTIRE BUILDING INCLUDING RESTROOMS, UTILITY ROOMS AND STORAGE ROOMS

SMOOTH WALL MISCELLANEOUS

37,800 SF

09/14/2005	Gypsum Wallboard system, (with 4'x8' Covered Wall Panels in some areas). This Material is in GOOD condition as of this date.		
02/01/2010	Samples 10-019 NW-77 (Joint Tape / Compound), and NW-78 (Drywall) collected on this date.		
12/01/2011	Damage: <5% Physical Damage - in the form of Storage Room, next to Girls Restroom, approximately 20 SF of Dry Wall has been removed. Material condition changed from GOOD to FAIR overall. No other changes as of this date.		
09/18/2015	Additional Damage observed. Storage Room next to Girls Restroom has minor holes and cuts. No other changes as of this date.		

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
01/28/2016	Sample 16-030-A31 collected from Workroom 304, Wallboard. Sample 16-030-A32 collected from Workroom 304, Joint Compound. Sample 16-030-A35 collected from Room 303, Demising Wall, Sheetrock Wall.		
09/15/2016	Material Removed in various locations and Replaced with New as part of the Summer 2016 renovation project. Material Quantity changed from 38,200 SF to 37,800 SF. No other changes as of this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		

05-212AAA	ASSUMED	NO SAMPLE	(NS)
10-018 NW-77	ND	NONE DETECTED	(ND)
10-018 NW-77	ND	NONE DETECTED	(ND)
10-018 NW-78	ND	NONE DETECTED	(ND)
16-030-A31	ND	NONE DETECTED	(ND)
16-030-A32	ND	NONE DETECTED	(ND)
16-030-A35	ND	NONE DETECTED	(ND)

CLASSROOMS 301-306 BUILDING (BUILDING 300)

ENTIRE BUILDING INCLUDING RESTROOMS, UTILITY ROOMS AND STORAGE ROOMS

SMOOTH WALL SURFACING

37,800 SF

08/25/2006	Skim Coat for Gypsum Wallboard System, (with 4'x8' Covered Wall Panels in some areas). This Material is in GOOD condition as of this date.
02/01/2010	Sample 10-019 NW-76 collected on this date.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
12/01/2011	Damage: <5% Physical Damage - in the form of Storage Room, next to Girls Restroom, approximately 20 SF of Dry Wall has been removed. Material condition changed from GOOD to FAIR overall. No other changes as of this date.		
09/18/2015	Additional Damage observed. Storage Room next to Girls Restroom has minor holes and cuts. No other changes as of this date.		
09/15/2016	Material Removed in various locations and Replaced with New as part of the Summer 2016 renovation project. Material Quantity changed from 38,200 SF to 37,800 SF. No other changes as of this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		

06-223AAA	ASSUMED	NO SAMPLE	(NS)
10-018 NW-76	ND	NONE DETECTED	(ND)

CLASSROOMS 301-306 BUILDING (BUILDING 300)

EXTERIOR WALLS AND OVERHANG ON RESTROOMS

ROUGH WALL

7,200 SF

09/14/2005	Stucco Exterior Walls and Restroom Overhangs. This Material is in GOOD condition as of this date.		
03/09/2007	Location Name changed from EXTERIOR to EXTERIOR WALLS, AND OVERHANG ON RESTROOMS.		
01/28/2016	Sample 16-030-A33 collected from Exterior by Drinking Fountain, Stucco Wall.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
16-030-A33	ND	NONE DETECTED	(ND)

CLASSROOMS 301-306 BUILDING (BUILDING 300)

EXTERIOR WALLS AND OVERHANG ON RESTROOMS

ROUGH WALL SURFACING

7,200 SF

09/14/2005 Skim Coat for Stucco on Exterior Walls and Restroom Overhangs. This Material is in GOOD condition as of this date.

03/09/2007 Location Name changed from EXTERIOR to EXTERIOR WALLS, AND OVERHANG ON RESTROOMS.

02/08/2019 This Material is unchanged as of this date.

08/16/2019 This Material is unchanged as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

SF= Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS 301-306 BUILDING (BUILDING 300)

EXTERIOR WINDOWS AND DOORS

CAULKING

900 LF

09/08/2009 Caulking on Exterior Windows and Doors. Damage: <5% Physical Damage and <10% Water Damage due to existing missing sections of material, and heat and moisture degradation factors in various locations. This Material is in FAIR condition as of this date.

01/28/2016 Sample 16-030-A34 collected from Exterior Door by 304, Interior side, Door Frame Caulking.

02/08/2019 This Material is unchanged as of this date.

08/16/2019 This Material is unchanged as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

09-212AAA	ASSUMED	NO SAMPLE	(NS)
16-030-A34	ND	NONE DETECTED	(ND)

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

CLASSROOMS 301-306 BUILDING (BUILDING 300)

FLEXIBLE INSTRUCTIONAL SPACE

VINYL FLOOR TILE

756 SF

09/15/2016	12"x2' Light Gray (676 SF) and Blue (80 SF) Vinyl Floor Tiles. New Material installed during the Summer 2016 Flooring project. This Material is in GOOD condition as of this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		

16-213AAA	NEW	NO SAMPLE	(NS)
-----------	-----	-----------	--------

CLASSROOMS 301-306 BUILDING (BUILDING 300)

FLEXIBLE INSTRUCTIONAL SPACE

VINYL FLOOR TILE MASTIC

756 SF

09/15/2016	Mastic/Adhesive for 12"x2' Light Gray (676 SF) and Blue (80 SF) Vinyl Floor Tiles. New Material installed during the Summer 2016 Flooring project. This Material is in GOOD condition as of this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

16-213AAA

NEW

NO SAMPLE

(NS)

CLASSROOMS 301-306 BUILDING (BUILDING 300)

TEACHERS' WORK ROOM, AND CLASSROOMS 301-308

SINK UNDERCOATING

28 SF

10/20/2008 Grey Thermal Undercoating on Sink. (7 EA Sink). This Material is in GOOD condition as of this date. (Original Entry updated on 09/02/10.)

09/02/2010 Undercoating is Grey. Original entry updated. No other changes as of this date.

12/01/2011 Location Description changed from CLASSROOMS 301-306 to TEACHERS' WORK ROOM, AND CLASSROOMS 301-308. No other changes as of this date.

01/28/2016 Sample 16-030-A30 collected from Workroom 304, Gray Thermal Undercoating on Sink.

02/08/2019 This Material is unchanged as of this date.

08/16/2019 This Material is unchanged as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/16/2024 This Material is unchanged as of this date.

08-241AAA	ASSUMED	NO SAMPLE	(NS)
16-030-A30	ND	NONE DETECTED	(ND)

CLASSROOMS 301-306 BUILDING (BUILDING 300)

TEACHERS' WORK ROOM, STORAGE ROOMS, AND STAFF RESTROOM

VINYL FLOOR TILE

1,560 SF

09/14/2005 12"x12" Green Vinyl Floor Tile. This Material is in GOOD condition as of this date.

08/25/2006 Material re-Assessed. (Apparent New Material identified by the AHERA accredited Inspector). Recommendation changed to reflect to this status. No other changes as of this date.

09/02/2010 Location Description changed from ALL CLASSROOMS, RSP ROOM AND STORAGE ROOMS to TEACHER WORK ROOM, STORAGE, AND RESTROOM. No other changes as of this date.

01/28/2016 Sample 16-030-A27 collected from Workroom 304, Green 12"x12" Vinyl Floor Tile.

02/08/2019 This Material is unchanged as of this date.

08/16/2019 This Material is unchanged as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
16-030-A27	ND	NONE DETECTED	(ND)

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

CLASSROOMS 301-306 BUILDING (BUILDING 300)

TEACHERS' WORK ROOM, STORAGE ROOMS, AND STAFF RESTROOM

VINYL FLOOR TILE MASTIC

1,560 SF

09/14/2005	Mastic/Adhesive for 12"x12" Green Vinyl Floor Tile. This Material is in GOOD condition as of this date.
08/25/2006	Material re-Assessed. (Apparent New Material identified by the AHERA accredited Inspector). Recommendation changed to reflect to this status. No other changes as of this date.
12/01/2011	Location Description changed from ALL CLASSROOMS, RSP ROOM AND STORAGE ROOMS to TEACHERS' WORK ROOM, STORAGE ROOMS, AND STAFF RESTROOM. No other changes as of this date.
01/28/2016	Sample 16-030-A28 collected from Workroom 304, Yellow Mastic for Green 12"x12" Vinyl Floor Tile.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.
08/19/2022	This Material is unchanged as of this date.
02/17/2023	This Material is unchanged as of this date.
08/18/2023	This Material is unchanged as of this date.
02/16/2024	This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
16-030-A28	ND	NONE DETECTED	(ND)

CLASSROOMS 301-306 BUILDING (BUILDING 300)

WATER HEATER ROOM (NEXT TO RESTROOMS) AND JANITOR CLOSET

BASEBOARD MASTIC

15 LF

09/14/2005	Mastic/Adhesive for 4" Brown Baseboard. This Material is in GOOD condition as of this date.
02/08/2019	This Material is unchanged as of this date.

SF= Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	Damage Observed. <5% Physical Damage in the form of 2 LF of Missing Baseboard with Brown Mastic Exposed. Material condition changed from GOOD to FAIR overall. Friability updated from Non-Friable to Friable. No other changes as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		
05-212AAA	ASSUMED	NO SAMPLE	(NS)

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	
LOCATION	
MATERIAL TYPE	QTY (APPROXIMATE)
COMMENTS	

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

CLASSROOMS 400-406 BUILDING (BUILDING 400)

CLASSROOMS 400-406 BUILDING (BUILDING 400)

03/06/2017	BUILDING NOTES:
03/09/2007	Building Name changed from CLASSROOMS 401-406 to CLASSROOMS 401-406 BUILDING (BUILDING 400). No other changes as of this date.
10/20/2008	Building Name changed from CLASSROOMS 401-406 BUILDING (BUILDING 400) to CLASSROOMS 400-406 BUILDING (BUILDING 400).

CLASSROOMS 400-406 BUILDING (BUILDING 400)

ALL CLASSROOMS

CARPET MASTIC

7,600 SF

09/15/2016	Mastic/Adhesive for Light Gray, Dark Gray, and Black Carpet. New Material installed during the Summer 2016 Flooring project. This Material is in GOOD condition as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.
08/19/2022	Material Re-Assessed. Material not observed, Material may exist behind current Gray Black Carpet. No other changes as of this date.
02/17/2023	This Material is unchanged as of this date.
08/18/2023	This Material is unchanged as of this date.
02/16/2024	This Material is unchanged as of this date.

16-213AAA	NEW	NO SAMPLE	(NS)
-----------	-----	-----------	--------

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	
LOCATION	
MATERIAL TYPE	QTY (APPROXIMATE)
COMMENTS	

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
-------------------	-------------------------	----------------------	----------------------

CLASSROOMS 400-406 BUILDING (BUILDING 400)

ALL CLASSROOMS, AND LIBRARY

SUSPENDED CEILING TILE 8,400 SF

09/14/2005	2'X4' SUSPENDED CEILING TILE. Tiles are White with a pitted mark form pattern. This Material is in GOOD condition as of this date. (Original Entry updated 03/19/15.)
10/20/2008	Classroom 402 has 4 Tiles Water Stained. Classroom 403 has 2 Tiles Water Stained. Classroom 406 has 2 Tiles Water Stained. No other changes as of this date.
05/14/2009	Tiles have been Repaired in Classroom 403. No other changes as of this date.
09/08/2009	Repairs have been made in Classroom 402 and Tiles have been replaced. Material remains in <10% Water Damage and in FAIR condition. No other changes as of this date.
02/01/2010	Sample 10-019 NW-57 collected on this date.
03/11/2010	Material Re-Assessed. Water Damage is located in Classrooms 403 and 406. No other changes as of this date.
09/02/2010	Additional Damage in the form of Library has 4 Tiles Water stained. 1 Tile has been replaced in Classroom 402. Classroom 404 has 1 Tile Water Damaged. 2 Tiles are still Water Damaged in Classroom 406. No other changes as of this date.
12/01/2011	Additional Damage - in the form of Library has 3 more Tiles Water Damaged, Classroom 408 has 2 Tiles Water Damaged, and Classroom 403 has 1 Tile Water Damaged. No other changes as of this date.
04/05/2013	Material condition Re-Assessed. Damaged Tiles have been repaired in Library. Material remains in FAIR condition overall. No other changes as of this date.
03/07/2014	1 Tile is Water Damaged in the Library. No other changes as of this date.
03/19/2015	Tiles are White with a pitted mark form pattern. Original Entry updated. This Material is unchanged as of this date.
09/18/2015	Damage Re-Assessed. Damages are currently as follows: Classroom 406 has 3 Tiles Water Damaged and Library has 2 Tiles Physically Damaged. Previous Damage noted in Classroom 408 is incorrectly entered and is non-existent. Additional Damages observed; Storage Closet between Rooms 401 and 402 has 1 Tile Physically Damaged and Classroom 401 has 3 Water Damaged Tiles. No other changes as of this date.
09/15/2016	Damages clarified. Damages are as follows: 401 has 1 Tile with Water Damage, 402 has 4 Tiles with Water Damage, Workroom for 403 and 404 has 3 Tiles with Water Damage, 404 has 1 Tile with Water Damage, 405 has 3 Tiles with Water Damage, Workroom for 406 has 2 Tiles with Water Damage, and 406 has 4 Tile with Water Damage. No other changes as of this date.
04/03/2017	Additional Damage Observed. 2 Tiles with Water Damage in Classroom 404. No other changes as of this date.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
02/16/2018	Additional Damage Observed. Classroom 402 now has 6 Tiles with Water Damage on them. No other changes as of this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	Material Re-assessed. Water Stains in Classroom 404 Have been Replaced with new Tiles. Partial Repairs in Libray 2 Water Stained Tiles have been Replace with new ons. Addition Damag in Classroom 404 1 Til wil Cracks. No other changes as of this date.		

05-212AAA	ASSUMED	NO SAMPLE	(NS)
10-018 NW-57	ND	NONE DETECTED	(ND)

CLASSROOMS 400-406 BUILDING (BUILDING 400)

ALL ROOMS

BASEBOARD MASTIC

1,400 LF

09/15/2016	Mastic/Adhesive for 4" Black Baseboard (Original Enty Updated 8/19/22). Installed during Summer 2016 Flooring project. This Material is in GOOD condition as of this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	Material Re-Assessed. Material not observed, Material may exist under current 4" Black Baseboard. No other changes as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		

16-213AAA	NEW	NO SAMPLE	(NS)
------------------	------------	------------------	---------------

CLASSROOMS 400-406 BUILDING (BUILDING 400)

ALL ROOMS

BASEBOARD MASTIC

1,400 LF

08/19/2022	Mastic/Adhesive for 4" Black Baseboard. This Material is in GOOD condition as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		

22-094.NS	NEW	NO SAMPLE	(NS)
------------------	------------	------------------	---------------

CLASSROOMS 400-406 BUILDING (BUILDING 400)

BOYS AND GIRLS RESTROOMS AND STORAGE ROOM

MORTAR MISCELLANEOUS

350 SF

03/07/2014	Grout/Mortar for 4"x4" White, Green, and Brown Ceramic Wall Tiles. This Material is in GOOD condition as of this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		
14-051AAA	ASSUMED	NO SAMPLE	(NS)

CLASSROOMS 400-406 BUILDING (BUILDING 400)

CLASSROOMS, AND LIBRARY

VINYL WALL COVER

29,880 SF

09/14/2005	4'X8' VINYL COVERED WALL PANELS. This Material is in GOOD condition as of this date.		
01/28/2016	Sample 16-030-A39 collected from Library (403), Vinyl Cover on Pressed Wood Wall Panel.		
09/15/2016	Damage observed. Damage: <5% Physical Damage - in the form of 6" tear in the Vinyl in Classroom 401. Material Condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.		
02/16/2018	Material Re-assessed. Damage in Classroom 401 is not Observed, possibly covered up. Remains in FAIR condition. No other changes as of this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/16/2024 Additional Damage Observed. Classroom 404 has a 1/2 Foot Teat in Material. No other changes as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
16-030-A39	ND	NONE DETECTED	(ND)

CLASSROOMS 400-406 BUILDING (BUILDING 400)

CLASSROOMS, AND LIBRARY

VINYL WALL COVER MASTIC

29,880 SF

09/14/2005 MASTIC/Adhesive FOR VINYL COVERING oN 4'X8' VINYL COVERED WALL PANELS. This Material is in GOOD condition as of this date.

09/15/2016 Damage observed. Damage: <5% Phyiscal Damage - in the form of 6" tear in the Vinyl in Classroom 401. Material Condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.

02/08/2019 This Material is unchanged as of this date.

08/16/2019 This Material is unchanged as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 Additional Damage Observed. Classroom 404 has a 1/2 Foot Teat in Material. No other changes as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

CLASSROOMS 400-406 BUILDING (BUILDING 400)

ENTIRE BUILDING

CEMENTITIOUS MISCELLANEOUS

50 SF

08/29/2014	Exterior A/C Cementitious Window Panel. Replacement on Lower and Upper Window Panel. Only on Some areas. This Material is in GOOD condition as of this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		

14-18AAA	ASSUMED	NO SAMPLE	(NS)
----------	---------	-----------	--------

CLASSROOMS 400-406 BUILDING (BUILDING 400)

ENTIRE BUILDING

FIRE DOOR CORE INSULATION

399 SF

08/29/2014	Fire Door Core Insulation. (3 EA Double-Doors + 16 EA Single-Doors). This Material is in GOOD condition as of this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	
LOCATION	
MATERIAL TYPE	
COMMENTS	QTY (APPROXIMATE)

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

14-198AAA	ASSUMED	NO SAMPLE	(NS)
------------------	----------------	------------------	---------------

CLASSROOMS 400-406 BUILDING (BUILDING 400)

ENTIRE BUILDING

SMOOTH WALL MISCELLANEOUS

38,100 SF

09/14/2005 GYPSUM WALLBOARD SYSTEM WALLS aND CEILINGS. MATERIAL aSSUMED TO eXIST uNDER 4'X8' VINYL COVERED WALL PANELS. Damage: <5% Physical Damage - in PE Storage Room; Water Damage: <10% - in PE Storage Room. This Material is in FAIR condition overall as of this date.

03/09/2007 Material Description changed from ' GYPSUM WALLBOARD SYSTEM WALLS aND CEILINGS. MATERIAL aSSUMED TO eXIST uNDER 4'X8' VINYL COVERED WALL PANELS. ' to ' Gypsum Wallboard System Walls and Ceilings. (Material is also located under 4'x8' Vinyl Covered Wall Panels). ' No other unchanges as of this date.

04/21/2008 50 SF is Damaged above the Double Entry Doors and 2 SF of debris on Floor. Missing Material with broken edges in the center of the ceiling as of this date.

09/08/2009 Previously mentioned 50 SF of Damage is located in PE Storage Room. No other changes as of this date.

02/01/2010 Samples 10-019 NW-59 (Joint Tape / Compound), and NW-60 (Drywall) collected on this date.

09/18/2015 Additional Damage observed. Exterior Storage Closet by Students Restrooms has minor holes and cuts. No other changes as of this date.

02/08/2019 This Material is unchanged as of this date.

08/16/2019 This Material is unchanged as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 Additional Damage Observed. 2 LF Crack in Work Room of Classroom 402. No other changes as of this date.

02/12/2021 This Material is unchanged as of this date.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	Additional Damage Observed. <5% Physical Damage in the form of 1 SF of Scuffs and Holes in Work Room of Classroom 406. Material remains in FAIR condition overall. No other changes as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		

05-212AAA	ASSUMED	NO SAMPLE	(NS)
10-018 NW-59	ND	NONE DETECTED	(ND)
10-018 NW-59	ND	NONE DETECTED	(ND)
10-018 NW-60	ND	NONE DETECTED	(ND)

CLASSROOMS 400-406 BUILDING (BUILDING 400)

ENTIRE BUILDING

SMOOTH WALL SURFACING

38,100 SF

08/25/2006	Skim Coat for Gypsum Wallboard System Walls and Ceilings. Material Assumed to exist under 4'X8' Vinyl Covered Wall Panels. Damage: <5% Physical Damage - in PE storage Room; Water Damage: <10% - in PE Storage Room. This Material is in FAIR condition overall as of this date.		
03/09/2007	Material Description changed from ' Skim Coat for GYPSUM WALLBOARD SYSTEM WALLS AND CEILINGS. MATERIAL ASSUMED TO EXIST UNDER 4'X8' VINYL COVERED WALL PANELS. ' to ' Skim Coat for Gypsum Wallboard System Walls and Ceilings. (Material is also located under 4'x8' Vinyl Covered Wall Panels). ' No other unchanges as of this date.		
09/18/2015	Additional Damage observed. Exterior Storage Closet by Students Restrooms has minor holes and cuts. No other change as of this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
04/24/2020	This Material is unchanged as of this date.		
09/01/2020	Additional Damage Observed. 2 LF Crack in Work Room of Classroom 402. No other changes as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		

SF= Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

67

HazMat Doc

AHERA Report B - Survey

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	Additional Damage Observed. <5% Physical Damage in the form of 1 SF of Scuffs and Holes in Work Room of Classroom 406. Material remains in FAIR condition overall. No other changes as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		

06-223AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS 400-406 BUILDING (BUILDING 400)

EXTERIOR WALLS, AND OVERHANG OF RESTROOMS

ROUGH WALL

7,200 SF

09/14/2005	Stucco Exterior Walls and Restrooms Overhangs. This Material is in GOOD condition as of this date.		
03/09/2007	Location Name changed from Exterior to Exterior Walls, and Overhang Of Restrooms. Material Description changed from ' Skim Coat for Stucco On Exterior Walls And Restrooms Overhang. ' to ' Skim Coat for Stucco Exterior Walls and Overhang. ' No other changes as of this date.		
05/14/2009	This Material has hairline cracks on various surfaces. Friability changed from Non-Friable to Friable. No other changes as of this date.		
09/08/2009	Material remains in <5% Physical Damage. This Material is unchanged as of this date.		
09/26/2013	Material Re-Assessed. Material changed from GOOD to FAIR condition. No other changes as of this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	
LOCATION	
MATERIAL TYPE	QTY (APPROXIMATE)
COMMENTS	

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/17/2023	Additional Damage Observed. <5% Physical Damage in the form of 4 SF of Peeling Paint and 10 LF of Cracks on South Wall of Building. Material remains in FAIR condition overall. No other changes as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		

05-212AAA	ASSUMED	NO SAMPLE	(NS)
------------------	----------------	------------------	---------------

CLASSROOMS 400-406 BUILDING (BUILDING 400)

EXTERIOR WALLS, AND OVERHANG OF RESTROOMS

ROUGH WALL SURFACING 7,200 SF

09/14/2005	Skim Coat for Stucco on Exterior Walls and Restrooms Overhang. This Material is in GOOD condition as of this date.		
03/09/2007	Location Name changed from Exterior to Exterior Walls, and Overhang Of Restrooms. Material Description changed from ' Skim Coat for Stucco On Exterior Walls And Restrooms Overhang. ' to ' Skim Coat for Stucco Exterior Walls and Overhang. ' No other changes as of this date.		
05/14/2009	This Material has hairline cracks on various surfaces. Friability changed from Non-Friable to Friable. No other changes as of this date.		
09/08/2009	Material remains in <5% Physical Damage. This Material is unchanged as of this date.		
09/26/2013	Material Re-Assessed. Material changed from GOOD to FAIR condition. No other changes as of this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	Additional Damage Observed. <5% Physical Damage in the form of 4 SF of Peeling Paint and 10 LF of Cracks on South Wall of Building. Material remains in FAIR condition overall. No other changes as of this date.		

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS 400-406 BUILDING (BUILDING 400)

EXTERIOR WINDOWS

CAULKING

900 LF

09/08/2009 Caulking on Exterior Windows. Damage: <5% Physical Damage and <10% Water Damage due to existing missing sections of material, and heat and moisture degradation factors in various locations. This Material is in FAIR condition as of this date.

02/08/2019 This Material is unchanged as of this date.

08/16/2019 This Material is unchanged as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

09-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS 400-406 BUILDING (BUILDING 400)

LIBRARY (400), CLASSROOMS 401-406, AND RESTROOMS

MORTAR MISCELLANEOUS

700 SF

09/02/2010 Grout/Mortar for 8"x8" Green, Pink and Red Ceramic Floor Tiles. This Material is in GOOD condition as of this date. (Original Entry updated on 03/07/14.)

03/07/2014 Tiles are Floor Tiles. Original entry updated. No other changes as of this date.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
01/28/2016	Sample 16-030-A37 collected from Library (403), Grout for 8"x8" Ceramic Floor Tile.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		
10-174AAA	ASSUMED	NO SAMPLE	(NS)
16-030-A37	ND	NONE DETECTED	(ND)

CLASSROOMS 400-406 BUILDING (BUILDING 400)

LIBRARY STORAGE

BASEBOARD MASTIC

50 LF

10/20/2008	Mastic/Adhesive for 4" Brown Baseboard. This Material is in GOOD condition as of this date.		
09/15/2016	Damage observed. Damage: <5% Physical Damage - in the form of loose Baseboard in 2 locations exposing Mastic/Adhesive. Material condition changed from GOOD to FAIR overall. Friability changed from Non to Low. No other changes as of this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	
LOCATION	
MATERIAL TYPE	QTY (APPROXIMATE)
COMMENTS	

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		

08-241AAA	ASSUMED	NO SAMPLE	(NS)
------------------	----------------	------------------	---------------

CLASSROOMS 400-406 BUILDING (BUILDING 400)

LIBRARY STORAGE

VINYL FLOOR TILE

144 SF

10/20/2008	9"x9" Beige Vinyl Floor Tile. This Material is in GOOD condition as of this date.
09/02/2010	Damage: <5% Physical Damage - in the form of 1 broken Tile, exposing Mastic/Adhesive. Material condition changed from GOOD to FAIR overall as of this date.
04/05/2013	Material Condition Re-Assessed. Damages repaired as of this date. Material Condition changed from FAIR to GOOD. No other changes as of this date.
09/18/2015	Repair noted on 04/05/13 involves the installation of One 9"x9" Green Vinyl Floor Tile. No other changes as of this date.
09/15/2016	Additional Damage observed. 2 Tiles are missing exposing Mastic/Adhesive. No other changes as of this date.
04/03/2017	Material Re-assessed. Missing Tiles have been replaced however, 1 Tile is Broken with Mastic Exposed. Material remains in FAIR condition. No other changes as of this date.
08/30/2017	Additional Damage Observed. 2 Tiles are Missing Mastic Exposed. No other changes as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	
LOCATION	
MATERIAL TYPE	QTY (APPROXIMATE)
COMMENTS	

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

08-241AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS 400-406 BUILDING (BUILDING 400)

LIBRARY STORAGE

VINYL FLOOR TILE MASTIC

144 SF

10/20/2008 Mastic/Adhesive for 9"x9" Beige Vinyl Floor Tile. This Material is in GOOD condition as of this date.

09/02/2010 Damage: <5% Physical Damage - in the form of 1 broken Tile, exposing Mastic/Adhesive. Material condition changed from GOOD to FAIR overall as of this date.

04/05/2013 Material Condition Re-Assessed. Damages repaired as of this date. Material Condition changed from FAIR to GOOD. No other changes as of this date.

09/18/2015 Repair noted on 04/05/13 involves the installation of One 9"x9" Green Vinyl Floor Tile. No other change as of this date.

09/15/2016 Additional Damage observed. 2 Tiles are missing exposing Mastic/Adhesive. No other changes as of this date.

04/03/2017 Material Re-assessed. Missing Tiles have been replaced however, 1 Tile is Broken with Mastic Exposed. Material remains in FAIR condition. No other changes as of this date.

08/30/2017 Additional Damage Observed. 2 Tiles are Missing Mastic Exposed. No other changes as of this date.

02/08/2019 This Material is unchanged as of this date.

08/16/2019 This Material is unchanged as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

08-241AAA ASSUMED NO SAMPLE (NS)

CLASSROOMS 400-406 BUILDING (BUILDING 400)

TEACHERS' WORK ROOM, AND LIBRARY

SINK UNDERCOATING

24 SF

10/20/2008 Grey Thermal Undercoating on Sink. (6 EA Sink). This Material is in GOOD condition as of this date.
(Original Entry updated on 09/02/10.)

09/02/2010 Undercoating is Grey. Original entry updated. No other changes of this date.

12/01/2011 Location Description changed from CLASSROOM 400-406 AND LIBRARY to TEACHERS' WORK ROOM,
AND LIBRARY. No other changes as of this date.

02/08/2019 This Material is unchanged as of this date.

08/16/2019 This Material is unchanged as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

08-241AAA ASSUMED NO SAMPLE (NS)

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	
LOCATION	
MATERIAL TYPE	QTY (APPROXIMATE)
COMMENTS	

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
05-212AAA	ASSUMED	NO SAMPLE	(NS)

CLASSROOMS 400-406 BUILDING (BUILDING 400)

TEACHERS' WORK ROOM, AND TWO STORAGE ROOMS

VINYL FLOOR TILE 2,200 SF

09/14/2005	12"X12" Green Vinyl Floor Tile. This Material is in GOOD condition as of this date.
08/25/2006	Material Re-Assessed. (Apparent New Material identified by the AHERA accredited Inspector). Recommendation changed to reflect to this status. No other changes as of this date.
12/01/2011	Location Description changed from ALL CLASSROOMS SINK AREAS, AND TWO STORAGE ROOMS to TEACHERS' WORK ROOM, AND TWO STORAGE ROOMS. No other changes as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.
08/19/2022	This Material is unchanged as of this date.
02/17/2023	This Material is unchanged as of this date.
08/18/2023	This Material is unchanged as of this date.
02/16/2024	This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS 400-406 BUILDING (BUILDING 400)

TEACHERS' WORK ROOM, AND TWO STORAGE ROOMS

VINYL FLOOR TILE MASTIC 2,200 SF

09/14/2005	Mastic/Adhesive for 12"x12" Green Vinyl Floor Tile. This Material is in GOOD condition as of this date.
08/25/2006	Material Re-Assessed. (Apparent New Material identified by the AHERA accredited Inspector). Recommendation changed to reflect to this status. No other changes as of this date.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
09/02/2010	Location Description changed from ALL CLASSROOMS SINK AREAS, AND TWO STORAGE ROOMS to ALL CLASSROOMS SINK AREAS, TWO STORAGE ROOMS, AND RESTROOM. No other changes as of this date.		
12/01/2011	Location Description changed from ALL CLASSROOMS SINK AREAS, AND TWO STORAGE ROOMS to TEACHERS' WORK ROOM, AND TWO STORAGE ROOMS. No other changes as of this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS 400-406 BUILDING (BUILDING 400)

WATER HEATER ROOM AND UTILITY CLOSET

BASEBOARD MASTIC

40 LF

09/14/2005	Mastic/Adhesive fir 4" Brown Baseboard. This Material is in GOOD condition as of this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		
05-212AAA	ASSUMED	NO SAMPLE	(NS)

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

CLASSROOMS 501-506 BUILDING (BUILDING 500)

CLASSROOMS 501-506 BUILDING (BUILDING 500)

03/06/2017	BUILDING NOTES:
03/09/2007	Building Name changed from CLASSROOMS 501-506 to CLASSROOMS 501-506 BUILDING (BUILDING 500). No other changes as of this date.
08/18/2023	Staff Restroom 12"x12" Vinyl Flooring abated and replaced with epoxy flooring Summer 2023 per information received from BUESD.

CLASSROOMS 501-506 BUILDING (BUILDING 500)

ALL CLASSROOMS, COMPUTER LAB AND STORAGE ROOMS

BASEBOARD MASTIC

1,400 LF

09/15/2016	Mastic/Adhesive for 4" and 6" Dark Gray Baseboard. New Material installed during Summer 2016 Flooring project. This Material is in GOOD condition as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/21/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.
08/19/2022	Material Re-Assessed. Material not observed, Material may exist under current 4" Black Baseboard. No other changes as of this date.
02/17/2023	This Material is unchanged as of this date.
08/18/2023	This Material is unchanged as of this date.
02/16/2024	This Material is unchanged as of this date.

16-213AAA	NEW	NO SAMPLE	(NS)
-----------	-----	-----------	--------

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	
LOCATION	
MATERIAL TYPE	QTY (APPROXIMATE)
COMMENTS	

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

CLASSROOMS 501-506 BUILDING (BUILDING 500)

BOYS AND GIRLS RESTROOM

MORTAR MISCELLANEOUS 120 SF

04/03/2017	Grout/Mortar for 4"x6" Black Base Ceramic Wall Tiles. Damage Observed. <5% Physical Damage - in the form of 1 Tile is Missing, Mastic Exposed in Boy's Restroom. 1 Tile is Loose and 1 Tile is Cracked in Girl's Restroom. Material condition is FAIR. Friability is Low. No other changes as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/21/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.
08/19/2022	This Material is unchanged as of this date.
02/17/2023	This Material is unchanged as of this date.
08/18/2023	This Material is unchanged as of this date.
02/16/2024	This Material is unchanged as of this date.

17-059AAA	ND	NO SAMPLE	(NS)
-----------	----	-----------	--------

CLASSROOMS 501-506 BUILDING (BUILDING 500)

BOYS AND GIRLS RESTROOMS

MORTAR MISCELLANEOUS 600 SF

10/20/2008	Grout/Mortar for 4"x4" White Wall Tiles. This Material is in GOOD condition as of this date.
04/03/2017	Damage Observed. <5% Physical Damage - in the form of 1 Tile Missing Mastic Exposed in Boys Restroom. 1 Tile is Loose from the grout and 1 Tile is cracked in Girls Restroom. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.
08/30/2017	Additional Damage Observed. In Girls Restroom 2 Tiles detached and lying on the floor Mastic Exposed.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/21/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

08-241AAA ASSUMED NO SAMPLE (NS)

CLASSROOMS 501-506 BUILDING (BUILDING 500)

BOYS AND GIRLS RESTROOMS

MORTAR MISCELLANEOUS

416 SF

10/20/2008 Grout/Mortar for 2"x2" Light Brown Floor Tiles. This Material is in GOOD condition as of this date.

02/08/2019 This Material is unchanged as of this date.

08/16/2019 This Material is unchanged as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/21/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

08-241AAA ASSUMED NO SAMPLE (NS)

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

CLASSROOMS 501-506 BUILDING (BUILDING 500)

CLASSROOMS 501-504 (AND RESTROOMS), AND CLASSROOMS 505 & 506 (AND RESTROOMS)

MORTAR MISCELLANEOUS

800 SF

09/02/2010	Grout/Mortar for 8"x8" Green, Pink and Red Ceramic Floor Tiles. This Material is in GOOD condition as of this date. (Original Entry updated on 03/07/14.)
03/07/2014	Tiles are Floor Tiles. Original entry updated. No other changes as of this date.
01/28/2016	Sample 16-030-A43 collected from Room 517, Mortar for Red 8"x8" Ceramic Floor Tile.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/21/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.
08/19/2022	This Material is unchanged as of this date.
02/17/2023	This Material is unchanged as of this date.
08/18/2023	This Material is unchanged as of this date.
02/16/2024	This Material is unchanged as of this date.

10-174AAA	ASSUMED	NO SAMPLE	(NS)
16-030-A43	ND	NONE DETECTED	(ND)

CLASSROOMS 501-506 BUILDING (BUILDING 500)

CLASSROOMS 501-506

SINK UNDERCOATING

20 SF

10/20/2008	Grey Thermal Undercoating on Sink. (5 EA Sink). This Material is in GOOD condition as of this date. (Original Entry updated on 09/02/10.)
09/02/2010	Undercoating is Grey. Original entry updated. No other changes as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/21/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		
08-241AAA	ASSUMED	NO SAMPLE	(NS)

CLASSROOMS 501-506 BUILDING (BUILDING 500)

CLASSROOMS 501-506 AND COMPUTER LAB

VINYL WALL COVER

30,000 SF

09/14/2005	4'X8' Vinyl Covered Wall Panels. This Material is in GOOD condition as of this date.		
09/18/2015	Damage observed. Center Classroom has 1/2 SF of Physical Damage. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/21/2021	Additional Damage Observed. <5% Physical Damage in the form of 1/4 SF of Missing Vinyl Wall Cover on Wall next to RSP Room. Material remains in FAIR condition overall. No other changes as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
05-212AAA	ASSUMED	NO SAMPLE	(NS)

CLASSROOMS 501-506 BUILDING (BUILDING 500)

CLASSROOMS 501-506 AND COMPUTER LAB

VINYL WALL COVER MASTIC

30,000 SF

09/14/2005	Mastic/Adhesive for Vinyl Covering on 4'x8' Vinyl Covered Wall Panels. This Material is in GOOD condition as of this date.
09/18/2015	Damage observed. Center Classroom has 1/2 SF of Physical Damage. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/21/2021	Additional Damage Observed. <5% Physical Damage in the form of 1/4 SF of Missing Vinyl Wall Cover on Wall next to RSP Room. Material remains in FAIR condition overall. No other changes as of this date.
02/23/2022	This Material is unchanged as of this date.
08/19/2022	This Material is unchanged as of this date.
02/17/2023	This Material is unchanged as of this date.
08/18/2023	This Material is unchanged as of this date.
02/16/2024	This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS 501-506 BUILDING (BUILDING 500)

CLASSROOMS 501-506, AND SCIENCE / COMPUTER LAB

CARPET MASTIC

8,500 SF

09/15/2016	Mastic/Adhesive for Light Gray, Dark Gray, and Black Carpet. New Material installed during the Summer 2016 Flooring project. This Material is in GOOD condition as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	
LOCATION	
MATERIAL TYPE	QTY (APPROXIMATE)
COMMENTS	

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
09/01/2020	This Material is unchanged as of this date.		
02/21/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	Material Re-Assessed. Material not observed, Material may exist under current Gray Black Carpet. No other changes as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		

16-213AAA	NEW	NO SAMPLE	(NS)
------------------	------------	------------------	---------------

CLASSROOMS 501-506 BUILDING (BUILDING 500)

CLASSROOMS 501-506, AND SCIENCE / COMPUTER LAB

CARPET MASTIC 8,500 SF

09/15/2016	Mastic/Adhesive for Gray and Black Carpet. This Material is in GOOD condition as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		

22-094.NS	NEW	NO SAMPLE	(NS)
------------------	------------	------------------	---------------

CLASSROOMS 501-506 BUILDING (BUILDING 500)

CLASSROOMS 501-506, AND SCIENCE / COMPUTER LAB

SUSPENDED CEILING TILE 9,400 SF

09/14/2005	2'x4' Suspended Ceiling Tile. Tiles are White with a pitted mark form pattern. This Material is in GOOD condition as of this date. (Original Entry updated 03/19/15.)		
02/01/2010	Sample 10-019 NW-53 collected on this date.		
03/11/2010	Damage: <10% Water Damage - in the form of 1 Tile has Water stains in Classroom 502. Material remains in GOOD condition overall as of this date.		

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
09/02/2010	Damages reassessed and Material is now in <10% Physical Damage. Additional damage observed in the following locations: Classroom 501, 1 Tile water damaged; Storage Room of Classroom 501 and 502, 1 Tile water damaged; Classroom 503, 1 Tile water damaged; Storage Room of Classroom 503 and 504, 1 Tile Water Damaged; Classroom 504, 3 Tiles Water Damaged; Classroom 506, 1 Tile Water Damaged; Between 505/506, 1 Tile Water Damaged and 1 Tile is broken; Classroom 507, 2 Tiles Water Damaged; and, Classroom 508, 3 Tiles broken, and 1 Tile water stained. No other changes as of this date.		
12/01/2011	Additional Damage observed - in the form of Classroom 502 and 507 each have 1 broken Tile. Classroom 508 has an additional Tile Water stained. Also, Storage Room of Classroom 501 and 502 has 1 additional Tile Water Damaged. No other changes as of this date.		
09/26/2013	Material Re-Assessed. Material changed from GOOD to FAIR condition. No other changes as of this date.		
03/19/2015	Tiles are White with a pitted mark form pattern. Original Entry updated. This Material is unchanged as of this date.		
09/18/2015	Damage Re-Assessed. Repairs made to following rooms: Classroom 501, Classroom 502 and Classroom 508. Damages are currently as follows for the following rooms: Storage Room between Classrooms 501 and 502 has 2 Tiles Physically Damaged, Classroom 503 has 2 Water Damaged Tiles and 1 Tile Physically Damaged, Storage Room between Classrooms 503 and 504 has 3 Water Damaged Tiles, Classroom 504 has 2 Water Damaged Tiles, Classroom 506 has 2 Water Damaged Tiles, Storage Room between Classrooms 505 and 506 has 1 Physically Damaged Tile and Classroom 507 has 1 Water Damaged Tile and 1 Physically Damaged Tile. Additional Damage observed, Classroom 505 has 3 Tiles Physically Damaged. No other changes as of this date.		
09/15/2016	Additional Damage observed. Damage is as follows: Room 501 has 2 Tiles with Water Damage and 1 broken Tile; Workroom for 503 and 504 has 1 Tile with Water Damage; Room 506 has 2 Tiles with Water Damage; and Room 508 has 2 Tiles with Water Damage. No other changes as of this date.		
04/03/2017	Additional Damage Observed. 4 Tiles have Water Damage and 1 Tile is Broken in Classroom 501. No other changes as of this date.		
02/16/2018	Material Re-assessed. Some Water Damage has been Painted Over. Remains in FAIR condition. No other changes as of this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	Additional Damage Observed. <5% Physical Damage in the form of a total of 3 Ceiling Tiles with Water Stains in Classroom 506. Material Condition remains in FAIR condition overall. No other changes as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	Additional Damage Observed. 2 Tiles with Water Stains and 1 Tile with 2 LF Crack in Workroom next to RSP Room. No other changes as of this date.		
02/21/2021	Additional Damage Observed. <5% Physical Damage in the form of 1 Tile with a Cracked Corner in Classroom 502. Material remains in FAIR condition overall. No other changes as of this date.		

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
10-018 NW-53	ND	NONE DETECTED	(ND)

CLASSROOMS 501-506 BUILDING (BUILDING 500)

CLASSROOMS 501-506, STORAGE ROOMS AND COMPUTER LAB

CARPET MASTIC

1,430 SF

08/19/2022 Mastic/Adhesive for Gray Black Carpet. This Material is in GOOD condition as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

22-094.NS	NEW	NO SAMPLE	(NS)
-----------	-----	-----------	--------

CLASSROOMS 501-506 BUILDING (BUILDING 500)

DATA ROOM AND WORK ROOMS

VINYL FLOOR TILE

400 SF

09/14/2005 12"X12" Green Vinyl Floor Tile. This Material is in GOOD condition as of this date.

08/25/2006 Material reassessed. (Apparent New Material identified by the AHERA accredited Inspector). Recommendation changed to reflect to this fact. No other changes as of this date.

01/28/2016 Sample 16-030-A44 collected from Room 507, 12"x12" Green Vinyl Floor Tile.

02/08/2019 This Material is unchanged as of this date.

08/16/2019 This Material is unchanged as of this date.

01/31/2020 This Material is unchanged as of this date.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

09/01/2020	This Material is unchanged as of this date.		
02/21/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	Location and Material Re-Assessed. Location Description changed from CLASSROOMS 501-506, STORAGE ROOMS AND COMPUTER LAB to DATA ROOM. Material only observed in Data Room, Material may exist under current Gray Black Carpet. Material Quantity changed from 1,540 SF to 90 SF. No other changes as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	Material Re-Assessed. Material also Visible in Work Rooms. Location Description and Quantity changed to reflect this fact. Material Removed and Replaced with new Green Epoxy Floor Covering in Staff Restroom Summer of 2023 per information recieved from BUESD. No other changes as of this date.		
02/16/2024	This Material is unchanged as of this date.		

05-212AAA	ASSUMED	NO SAMPLE	(NS)
16-030-A44	ND	NONE DETECTED	(ND)

CLASSROOMS 501-506 BUILDING (BUILDING 500)

DATA ROOM AND WORK ROOMS

VINYL FLOOR TILE MASTIC

400 SF

09/14/2005	Mastic/Adhesive for 12"x12" Green Vinyl Floor Tile. This Material is in GOOD condition as of this date.		
08/25/2006	Material reassessed. (Apparent New Material identified by the AHERA accredited Inspector). Recommendation changed to reflect to this fact. No other changes as of this date.		
01/28/2016	Sample 16-030-A45 collected from Room 507, Mastic for 12"x12" Green Vinyl Floor Tile.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/21/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	This Material is unchanged as of this date.		

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

08/18/2023 Material Re-Assessed. Material also Visible in Work Rooms. Location Description and Quantity changed to reflect this fact. Material Removed and Replaced with new Green Epoxy Floor Covering in Staff Restroom Summer of 2023 per information recieved from BUESD. No other changes as of this date.

02/16/2024 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
16-030-A45	ND	NONE DETECTED	(ND)

CLASSROOMS 501-506 BUILDING (BUILDING 500)

ENTIRE BUILDING

CEMENTITIOUS MISCELLANEOUS

50 SF

08/29/2014 Exterior A/C Cementitious Window Panel. Replacement on lower and upper Window Panel. Only on Some areas. This Material is in GOOD condition as of this date.

09/15/2016 Damage observed. Damage: <5% Physical Damage - in the form of 1 broken Panel in Room 503. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.

08/15/2018 Material Re-assessed. Partial Repairs made to Broken Panel in Classroom 503. Panel is Partially Covered with Plywood. No other changes as of this date.

02/08/2019 This Material is unchanged as of this date.

08/16/2019 This Material is unchanged as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/21/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

14-198AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	
LOCATION	
MATERIAL TYPE	QTY (APPROXIMATE)
COMMENTS	

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

CLASSROOMS 501-506 BUILDING (BUILDING 500)

ENTIRE BUILDING

FIRE DOOR CORE INSULATION

651 SF

08/29/2014	Fire Door Core Insulation. (2 EA Double-Doors + 29 EA Single-Doors). This Material is in GOOD condition as of this date.
09/15/2016	This Material is unchanged as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/21/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.
08/19/2022	This Material is unchanged as of this date.
02/17/2023	This Material is unchanged as of this date.
08/18/2023	This Material is unchanged as of this date.
02/16/2024	This Material is unchanged as of this date.

14-198AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS 501-506 BUILDING (BUILDING 500)

ENTIRE BUILDING INCLUDING RESTROOMS, STORAGE ROOMS AND UTILITY ROOMS

SMOOTH WALL MISCELLANEOUS

38,500 SF

09/14/2005	GYPSUM WALLBOARD SYSTEM WALLS aND CEILINGS. MATERIAL aSSUMED tO eXIST uNDER 4'X8' VINYL COVERED WALL PANELS. This Material is in GOOD condition as of this date.
03/09/2007	Material Description changed from ' GYPSUM WALLBOARD SYSTEM WALLS aND CEILINGS. MATERIAL aSSUMED tO eXIST uNDER 4'X8' VINYL COVERED WALL PANELS. ' to ' Gypsum Wallboard System Walls and Ceilings. (Material is also under 4'x8' Vinyl Covered Wall Panels). ' No other changes as of this date.
02/01/2010	Samples 10-019 NW-55 (Joint Tape / Compound), and NW-56 (Drywall) collected on this date.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
04/12/2012	Damage: <5% Physical Damage - in the form of approximately 1 SF of missing paint on Ceiling, and Joint Tape & Mud is exposed; <10% Water Damage - in the form of Water Damage observed at Main Entrance, between Classrooms 503 & 504. Material condition changed from GOOD to FAIR overall as of this date. No other changes as of this date.		
09/18/2015	Additional Damages observed. Center Classroom has 1/2 SF of Physical Damage, Storage Rooms between Rooms 505 and 506 have minor holes and cuts. No other changes as of this date.		
09/15/2016	Additional Damage observed. Classroom 504 has a small hole, approximately 2"x2". No other changes as of this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/21/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		

05-212AAA	ASSUMED	NO SAMPLE	(NS)
10-018 NW-55	ND	NONE DETECTED	(ND)
10-018 NW-55	ND	NONE DETECTED	(ND)
10-018 NW-56	ND	NONE DETECTED	(ND)

CLASSROOMS 501-506 BUILDING (BUILDING 500)

ENTIRE BUILDING INCLUDING RESTROOMS, STORAGE ROOMS AND UTILITY ROOMS

SMOOTH WALL SURFACING

38,500 SF

08/25/2006	Skim Coat for Gypsum Wallboard System Walls and Ceilings. Material Assumed to exist Under 4'X8' Vinyl Covered Wall Panels. This Material is in GOOD condition as of this date.
03/09/2007	Material Description changed from ' Skim Coat for GYPSUM WALLBOARD SYSTEM WALLS and CEILINGS. MATERIAL ASSUMED TO EXIST UNDER 4'X8' VINYL COVERED WALL PANELS. ' to ' Skim Coat for Gypsum Wallboard System Walls and Ceilings. (Material is also under 4'x8' Vinyl Covered Wall Panels). ' No other changes as of this date.

SF= Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

90

HazMat Doc

AHERA Report B - Survey

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
04/12/2012	Damage: <5% Physical Damage - in the form of approximately 1 SF of missing paint on Ceiling, and Joint Tape & Mud is exposed; <10% Water Damage - in the form of water damage observed at Main Entrance, between Classrooms 503 & 504. Material condition changed from GOOD to FAIR overall as of this date. No other changes as of this date.		
09/26/2013	Friability changed from Moderate to Low. No other changes as of this date.		
03/07/2014	Friability changed from Low to Moderate. No other changes as of this date.		
09/18/2015	Additional Damages observed. Center Classroom has 1/2 SF of Physical Damage, Storage Rooms between Rooms 505 and 506 have minor holes and cuts. No other changes as of this date.		
09/15/2016	Additional Damage observed. Classroom 504 has a small hole, approximately 2"x2". No other changes as of this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/21/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		

06-223AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS 501-506 BUILDING (BUILDING 500)

EXTERIOR WALLS, AND OVERHANG OF RESTROOMS

ROUGH WALL SURFACING

7,200 SF

09/14/2005	SKIM COAT FOR STUCCO ON EXTERIOR WALLS AND RESTROOMS OVERHANG. This Material is in GOOD condition as of this date.
03/09/2007	Location Name changed from EXTERIOR to EXTERIOR WALLS, AND OVERHANGS OF RESTROOMS. Material changed from ' Stucco on Exterior Walls and Restrooms Overhang. ' to
03/06/2017	' Stucco Exterior Walls and Overhangs. ' No other changes as of this date.

SF= Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

91

HazMat Doc

AHERA Report B - Survey

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/08/2019 This Material is unchanged as of this date.

08/16/2019 This Material is unchanged as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/21/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS 501-506 BUILDING (BUILDING 500)

EXTERIOR WALLS, AND OVERHANGS OF RESTROOMS

ROUGH WALL

7,200 SF

09/14/2005 Stucco Exterior Walls and Overhangs. This Material is in GOOD condition as of this date.

03/09/2007 Location Name changed from EXTERIOR to EXTERIOR WALLS, AND OVERHANGS OF RESTROOMS. Material changed from ' Stucco on Exterior Walls and Restrooms Overhang. ' to ' Stucco Exterior Walls and Overhangs. ' No other changes as of this date.

02/08/2019 This Material is unchanged as of this date.

08/16/2019 This Material is unchanged as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/21/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS 501-506 BUILDING (BUILDING 500)

EXTERIOR WINDOWS

CAULKING

900 LF

09/08/2009 Caulking on Exterior Windows. Damage: <5% Physical Damage and <10% Water Damage due to existing missing and damaged sections of material, and heat and moisture degradation factors in various locations. This Material is in FAIR condition as of this date.

02/08/2019 This Material is unchanged as of this date.

08/16/2019 This Material is unchanged as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/21/2021 Additional Damage Observed. <5% Physical Damage in the form of 3 LF of Cracks on Window of Classroom 503. Material remains in FAIR condition overall. No other changes as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

09-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS 501-506 BUILDING (BUILDING 500)

GIRLS' RESTROOMS

MORTAR MISCELLANEOUS

600 SF

10/20/2008 Grout/Mortar for 4"x4" White Wall Tiles. This Material is in GOOD condition as of this date.

02/08/2019 This Material is unchanged as of this date.

08/16/2019 This Material is unchanged as of this date.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/21/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		
08-241AAA	ASSUMED	NO SAMPLE	(NS)

CLASSROOMS 501-506 BUILDING (BUILDING 500)

WATER HEATER CLOSET AND STORAGE

BASEBOARD MASTIC

50 LF

09/14/2005	Mastic/Adhesive for 4" Brown Baseboard. This Material is in GOOD condition as of this date.		
10/20/2008	Location Description changed from WATER HEATER CLOSET to WATER HEATER CLOSET AND STORAGE. Material Quantity changed from 25 LF to 50 LF to reflect this fact. No other changes as of this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/21/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
05-212AAA	ASSUMED	NO SAMPLE	(NS)

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

CLASSROOMS 801 PORTABLE BUILDING

CLASSROOMS 801 PORTABLE BUILDING

10/20/2008 BUILDING INFORMATION:

10/20/2008 Manufacturer's Tag Info:
By American Modular System; Date 07/08; DSA #01-109890; Serial #'s 08-419-004A, 08-419-004B.
This entry for informational and tracking purposes.

CLASSROOMS 801 PORTABLE BUILDING

CLASSROOM 801

PORTABLE BUILDING

960 SF

10/20/2008 New 2008 Construction Relocatable Building per Manufacturer's Tag information.

02/08/2019 This Material is unchanged as of this date.

08/16/2019 This Material is unchanged as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

08-241AAA	NEW	NO SAMPLE	(NS)
-----------	-----	-----------	--------

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

09/14/2005 BUILDING NOTES:

09/14/2005 No Manufacturer's Tag Info. This entry for informational and tracking purposes.

03/09/2007 Building Name changed from PORTABLE DAYCARE - CDC to DAYCARE PORTABLE BUILDING - CDC (BUILDING 600).

DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

CLASSROOMS

BASEBOARD MASTIC

350 LF

09/14/2005 Mastic/Adhesive for 4" Brown Baseboard. This Material is in GOOD condition as of this date.

03/09/2007 Location Name changed from PORTABLE DAYCARE - CDC to CLASSROOMS. No other changes as of this date.

02/08/2019 This Material is unchanged as of this date.

08/16/2019 This Material is unchanged as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	
LOCATION	
MATERIAL TYPE	QTY (APPROXIMATE)
COMMENTS	

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

CLASSROOMS

SMOOTH WALL MISCELLANEOUS

2,120 SF

03/09/2007	Location Name changed from PORTABLE DAYCARE - CDC to CLASSROOMS. No other changes as of this date.
09/14/2007	GYPSUM WALLBOARD SYSTEM. This Material is in GOOD condition as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.
08/19/2022	This Material is unchanged as of this date.
02/17/2023	This Material is unchanged as of this date.
08/18/2023	This Material is unchanged as of this date.
02/16/2024	This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
------------------	----------------	------------------	---------------

DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

CLASSROOMS

SUSPENDED CEILING TILE

2,040 SF

09/14/2005	2'x4' Vinyl Covered Fiberglass Suspended Ceiling Tile. Tiles are White with a smooth texture on fiberglass panel. This Material is in GOOD condition as of this date. (Original Entry updated 03/19/15.)
03/09/2007	Location Name changed from PORTABLE DAYCARE - CDC to CLASSROOMS. No other changes as of this date.
11/09/2007	Material re-assessed. Damage: <5% Physical Damage - due to 14 Tiles with minor holes and cuts. Friability changed from Low to Moderate. Material condition change from GOOD to FAIR overall.
12/01/2011	Additional Damage - in the form of several Tiles are Damaged. No other changes as of this date.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
03/19/2015	Tiles are White with a smooth texture on fiberglass panel. Original Entry updated. This Material is unchanged as of this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		
05-212AAA	ASSUMED	NO SAMPLE	(NS)

DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

CLASSROOMS

VINYL FLOOR TILE

960 SF

09/14/2005	6"x4' Light Brown Wood Design Vinyl Floor Tile. This Material is in GOOD condition overall as of this date. (Original entry updated 8/19/22)
08/25/2006	Quantity changed from 1,265 SF to 960 SF. No other changes as of this date.
03/09/2007	Location Name changed from PORTABLE DAYCARE - CDC to CLASSROOMS. No other changes as of this date.
09/18/2015	Material Description Re-Assessed. Material is Pink. Material description changed from '12"X12" tan VINYL FLOOR TILE' to '12"X12" Pink VINYL FLOOR TILE'. Original entry updated. No other changes as of this date.
04/03/2017	Additional Damage Observed. 2 Broken Tiles near Restroom area. No other changes as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	Material Re-Assessed. Material not observed, Material may exist under current 6"x4' Light Brown Wood Design Vinyl Floor Tile. No other changes as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		

05-212AAA

ASSUMED

NO SAMPLE

(NS)

DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

CLASSROOMS

VINYL FLOOR TILE MASTIC

960 SF

09/14/2005	6"x4' Light Brown Wood Design Vinyl Floor Tile. This Material is in GOOD condition overall as of this date. (Original entry updated 8/19/22)
08/25/2006	Material Quantity changed from 1,265 SF to 960 SF. No other changes as of this date.
03/09/2007	Location Name changed from PORTABLE DAYCARE - CDC to CLASSROOMS. No other changes as of this date.
09/18/2015	Material Description Re-Assessed. Material is Pink. Material description changed from '12"X12" tan VINYL FLOOR TILE' to ' 12"X12" Pink VINYL FLOOR TILE'. Original entry updated. No other changes as of this date.
04/03/2017	Additional Damage Observed. 2 Broken Tiles near Restroom area. No other changes as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	Material Re-Assessed. Material not observed, Material may exist under current 6"x4' Light Brown Wood Design Vinyl Floor Tile. No other changes as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

CLASSROOMS

VINYL WALL COVER

2,100 SF

09/14/2005	4'X10' Vinyl Covered Wall Panels. This Material is in GOOD condition as of this date.		
03/09/2007	Location Name changed from PORTABLE DAYCARE - CDC to CLASSROOMS. No other changes as of this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

101

HazMat Doc

AHERA Report B - Survey

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
05-210AAA	ASSUMED	NO SAMPLE	(NS)

DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

CLASSROOMS

VINYL WALL COVER MASTIC

2,100 SF

09/14/2005	Mastic/Adhesive for Vinyl Covering on 4'x10' Vinyl Covered Wall Panels. This Material is in GOOD condition as of this date.
03/09/2007	Location Name changed from PORTABLE DAYCARE - CDC to CLASSROOMS. No other changes as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.
08/19/2022	This Material is unchanged as of this date.
02/17/2023	This Material is unchanged as of this date.
08/18/2023	This Material is unchanged as of this date.
02/16/2024	This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

CLASSROOMS, OFFICE AND STORAGE ROOM

CARPET MASTIC

150 SF

09/14/2005	Mastic/Adhesive for Brown and Blue Carpets. This Material is in GOOD condition as of this date.
08/25/2006	Material Quantity changed from 675 SF to 1,000 SF. No other changes as of this date.
03/09/2007	Location Name changed from PORTABLE DAYCARE - CDC to CLASSROOMS. No other changes as of this date.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
09/02/2010	Material Re-assessed. (Classroom & Office - 95% Brown - ; Carpet in Storage Room - 5% Blue). This Material is unchanged as of this date.		
12/01/2011	Location Description changed from CLASSROOMS to CLASSROOMS, OFFICE AND STORAGE ROOM. No other changes as of this date.		
03/07/2014	1 SF is Damaged. This Material is in FAIR condition. Friability changed from Non-Friable to Friable. No other changes as of this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	Location Re-Assessed. Material only observed in Storage Room, Material may exist under current Gray Black Carpet. Location Description changed from CLASSROOMS, OFFICE AND STORAGE ROOM to STORAGE ROOM. Material may exist under current Gray Black Carpet. Material Quantity changed from 1,000 SF to 150 SF. No other changes as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		

05-212AAA

ASSUMED

NO SAMPLE

(NS)

DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

DAYCARE PORTABLE (600)

SINK UNDERCOATING

10 SF

09/02/2010	Black Thermal Undercoating on Sink. (4 EA Sinks). Thermal undercoatings are Black and Gray. This Material is in GOOD condition as of this date. (Original Entry updated 03/19/15.)
03/19/2015	Thermal undercoatings are Black and Gray. Original Entry updated. This Material is unchanged as of this date.
02/08/2019	This Material is unchanged as of this date.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

08/16/2019 This Material is unchanged as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

10-174AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

ENTIRE BUILDING

FIRE DOOR CORE INSULATION

63 SF

08/29/2014 Fire Door Core Insulation. (3 EA Single-Doors). This Material is in GOOD condition as of this date.

02/08/2019 This Material is unchanged as of this date.

08/16/2019 This Material is unchanged as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/16/2024 This Material is unchanged as of this date.

14-198AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

FOOD PREPERATION AREA

VINYL SHEETING

90 SF

03/19/2015 6"x4' Light Brown Wood Design Vinyl Floor Tile (Original Enty Updated 8/19/22). This Material is in GOOD condition as of this date.

04/03/2017 Damage Observed. <5% Physical Damage - in the form of 2 SF of Sheeting is Peeling up by Sink Area. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.

02/08/2019 This Material is unchanged as of this date.

08/16/2019 This Material is unchanged as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 Material Re-Assessed. Material not observed, Material may exist under current 6"x4' Light Brown Wood Design Vinyl Floor Tile. No other changes as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

15-042AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

FOOD PREPERATION AREA

VINYL SHEETING BACKING PAPER/MASTIC

90 SF

03/19/2015 6"x4' Light Brown Wood Design Vinyl Floor Tile (Original Enty Updated 8/19/22). This Material is in GOOD condition as of this date.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
04/03/2017	Damage Observed. <5% Physical Damage - in the form of 2 SF of Sheeting is Peeling up by Sink Area. Material condition changed from GOOD to FAIR overall. No other changes as of this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	Material Re-Assessed. Material not observed, Material may exist under current 6"x4' Light Brown Wood Design Vinyl Floor Tile. No other changes as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		
15-042AAA	ASSUMED	NO SAMPLE	(NS)

DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

RESTROOMS (1 EA BOYS' AND GIRLS'), STAFF ROOM, AND CUSTODIAN ROOM

VINYL SHEETING

140 SF

09/14/2005	Beige Vinyl Sheeting. This Material is in GOOD condition as of this date.
08/25/2006	Material Quantity changed from 100 SF to 140 SF. No other changes as of this date.
03/09/2007	Location Name changed from PORTABLE DAYCARE - CDC TWO RESTROOMS to RESTROOMS (2). No other changes as of this date.
09/02/2010	Location Description changed from RESTROOMS (2) to RESTROOMS (2 - BOYS' AND GIRLS'), STAFF ROOM, AND CUSTODIAN ROOM. Material located on Walls and Floor. No other changes as of this date.
12/01/2011	Location Description changed from RESTROOMS (2) to RESTROOMS (1 EA- BOYS' AND GIRLS'), STAFF ROOM, AND CUSTODIAN ROOM. Damage: <5% Physical Damage - in the form of approximately 4 SF is missing in Custodian Room. Material condition changed from GOOD to FAIR overall as of this date.
04/03/2017	Additional Damage Observed. 1 SF of Cracked and Broken Flooring in Both the Boys Restroom and Girls Restroom. No other changes as fo this date.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		
05-212AAA	ASSUMED	NO SAMPLE	(NS)

DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

RESTROOMS (1 EA BOYS' AND GIRLS'), STAFF ROOM, AND CUSTODIAN ROOM

VINYL SHEETING BACKING PAPER/MASTIC

140 SF

09/14/2005	Backing Paper/Adhesive for Beige Vinyl Sheeting. This Material is in GOOD condition as of this date.		
08/25/2006	Material Quantity changed from 100 SF to 140 SF. No other changes as of this date.		
03/09/2007	Location Name changed from PORTABLE DAYCARE - CDC TWO RESTROOMS to RESTROOMS (2). No other changes as of this date.		
12/01/2011	Location Description changed from RESTROOMS (2) to RESTROOMS (1 EA- BOYS' AND GIRLS'), STAFF ROOM, AND CUSTODIAN ROOM. Damage: <5% Physical Damage - in the form of approximately 4 SF is missing in Custodian Room. Material condition changed from GOOD to FAIR overall as of this date.		
04/03/2017	Additional Damage Observed. 1 SF of Cracked and Broken Flooring in Both the Boys Restroom and Girls Restroom. No other changes as fo this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		
05-212AAA	ASSUMED	NO SAMPLE	(NS)

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

DAYCARE PORTABLE BUILDING - FED CHILDCARE (BUILDING 900)

DAYCARE PORTABLE BUILDING - FED CHILDCARE (BUILDING 900)

09/14/2005 BUILDING NOTES:

09/14/2005 Manufacturer's Tag Info:
BY SPACE MASTER; DATE: 4/89; SERIAL: 14786; OSA: 0425.
This entry for informational and tracking purposes.

03/09/2007 Building Name changed from PORTABLE DAYCARE - FED CHILDCARE to DAYCARE PORTABLE BUILDING - FED CHILDCARE (BUILDING 900).
Location Descriptions changed from PORTABLE DAYCARE - FED CHILDCARE to CLASSROOM.

DAYCARE PORTABLE BUILDING - FED CHILDCARE (BUILDING 900)

CLASSROOM

BASEBOARD MASTIC

140 LF

09/14/2005 Mastic/Adhesive for 4" Black Baseboard (Original Entry Updated 8/19/22). This Material is in GOOD condition as of this date.

02/08/2019 This Material is unchanged as of this date.

08/16/2019 This Material is unchanged as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 Material Re-Assessed. Material not observed, Material may exist behind current 4" Black Baseboard. No other changes as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

05-212AAA

ASSUMED

NO SAMPLE

(NS)

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

DAYCARE PORTABLE BUILDING - FED CHILDCARE (BUILDING 900)

CLASSROOM

CARPET MASTIC

480 SF

09/14/2005	Mastic/Adhesive for Grey Balck Carpet (Original Enty Updated 8/19/22). This Material is in GOOD condition as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.
08/19/2022	Material Re-Assessed. Material not observed, Material may exist behind current Gray Black Carpet. No other changes as of this date.
02/17/2023	This Material is unchanged as of this date.
08/18/2023	This Material is unchanged as of this date.
02/16/2024	This Material is unchanged as of this date.

05-212AAA

ASSUMED

NO SAMPLE

(NS)

DAYCARE PORTABLE BUILDING - FED CHILDCARE (BUILDING 900)

CLASSROOM

SUSPENDED CEILING TILE

960 SF

09/14/2005	2'x4' Suspended Ceiling Tile. Tiles are White with 'chicken feet' mark form pattern. Some replacement Tiles have a pin hole form pattern. Some replacement Tiles are White with a rough texture form pattern on a plastic cover on yellow fiberglass panel. This Material is in GOOD condition as of this date. (Original entry updated 03/19/15).
12/01/2011	Damage: <5% Physical Damage - in the form of Restroom has 2 broken Tiles and 1 hole observed; <10% Water Damage - in the form of 1 Tile is Water Damaged. Material condition changed from GOOD to FAIR overall as of this date. No other changes as of this date.
03/07/2014	Water Damaged Tiles have been replaced. No other changes as of this date.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
03/19/2015	Tiles are White with 'chicken feet' mark form pattern. Some replacement Tiles have a pin hole form pattern. Some replacement Tiles are White with a rough texture form pattern on a plastic cover on yellow fiberglass panel. Original Entry updated. This Material is unchanged as of this date.		
09/18/2015	Additional Damage observed. 2 Tiles Water Damaged, and Classroom has 4 Tiles Physically Damaged. No other changes as of this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		

05-212AAA

ASSUMED

NO SAMPLE

(NS)

DAYCARE PORTABLE BUILDING - FED CHILDCARE (BUILDING 900)

CLASSROOM

VINYL WALL COVER

1,800 SF

09/14/2005	4'X10' Vinyl Covered Wall Panels. This Material is in GOOD condition as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

111

HazMat Doc

AHERA Report B - Survey

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		
05-212AAA	ASSUMED	NO SAMPLE	(NS)

DAYCARE PORTABLE BUILDING - FED CHILDCARE (BUILDING 900)

CLASSROOM

VINYL WALL COVER MASTIC

1,800 SF

09/14/2005	Mastic/Adhesive for Vinyl Covering on 4'X10' Vinyl Covered Wall Panels. This Material is in GOOD condition as of this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

DAYCARE PORTABLE BUILDING - FED CHILDCARE (BUILDING 900)

CLASSROOM 900

VINYL WALL COVER

1,800 SF

03/11/2010 Vinyl Wall Cover, (over Gypsum Wallboard System). This Material is in GOOD condition as of this date.

02/08/2019 This Material is unchanged as of this date.

08/16/2019 This Material is unchanged as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

10-052AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

DAYCARE PORTABLE BUILDING - FED CHILDCARE (BUILDING 900)

CLASSROOM 900

VINYL WALL COVER MASTIC

1,800 SF

03/11/2010 Mastic/Adhesive for Vinyl Wall Cover, (over Gypsum Wallboard System). This Material is in GOOD condition as of this date.

02/08/2019 This Material is unchanged as of this date.

08/16/2019 This Material is unchanged as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

10-052AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

DAYCARE PORTABLE BUILDING - FED CHILDCARE (BUILDING 900)

CLASSROOM AND RESTROOMS

VINYL SHEETING

480 SF

09/14/2005 Beige Vinyl Sheeting. This Material is in GOOD condition as of this date.

05/14/2009 Location changed from CLASSROOMS to CLASSROOM AND RESTROOMS. No other changes as of this date.

02/08/2019 This Material is unchanged as of this date.

08/16/2019 This Material is unchanged as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

DAYCARE PORTABLE BUILDING - FED CHILDCARE (BUILDING 900)

CLASSROOM AND RESTROOMS

VINYL SHEETING BACKING PAPER/MASTIC

480 SF

09/14/2005	BACKING PAPER/Adhesive FOR beige VINYL SHEETING. This Material is in GOOD condition as of this date.
05/14/2009	Location changed from CLASSROOMS to CLASSROOM AND RESTROOMS. No other changes as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.
08/19/2022	This Material is unchanged as of this date.
02/17/2023	This Material is unchanged as of this date.
08/18/2023	This Material is unchanged as of this date.
02/16/2024	This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

DAYCARE PORTABLE BUILDING - FED CHILDCARE (BUILDING 900)

ENTIRE BUILDING

FIRE DOOR CORE INSULATION

84 SF

08/29/2014	Fire Door Core Insulation. (4 EA Single-Doors). This Material is in GOOD condition as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	Material Quantity Re-Assessed. Additional Material Quantity observed. Material Quantity changed from 42 SF to 84 SF. No other changes as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		
14-198AAA	ASSUMED	NO SAMPLE	(NS)

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

DAYCARE PORTABLE BUILDING - SDC (BUILDING 800)

DAYCARE PORTABLE BUILDING - SDC (BUILDING 800)

09/14/2005	BUILDING NOTES:
09/14/2005	Manufacturer's Tag Info: By American Modular; OSA #65132; SERIAL# 96-R24-004A, 96-R24-004B. This entry for informational and tracking purposes.
03/09/2007	Building Name changed from PORTABLE DAYCARE - SDC to DAYCARE PORTABLE BUILDING - SDC (BUILDING 800).
10/20/2008	Serial #'s on Manufacturer's Tag Info changed from 96-R24-004A, 96-R24-004B to 96-R243-004A, 96-R243-004B. Date 7/96

DAYCARE PORTABLE BUILDING - SDC (BUILDING 800)

PORTABLE DAYCARE - SDC

PORTABLE BUILDING

960 SF

04/20/2006	New 1996 Construction Relocatable Building per Manufacturer's Tag information.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.
02/17/2023	This Material is unchanged as of this date.
08/18/2023	This Material is unchanged as of this date.
02/16/2024	This Material is unchanged as of this date.

05-212.NS	NEW	NO SAMPLE	(NS)
-----------	-----	-----------	--------

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

FAMILY RESOURCE CENTER (BUILDING 700)

FAMILY RESOURCE CENTER (BUILDING 700)

04/21/2008 BUILDING NOTES:

04/21/2008 Manufacturers Tag Info:
By American Modular System. Date of manufacturer 07/07. DSA #01-108993.
Serial #07-352-001A, 07-352-001B, 07-352-001C, 07-352-001D, 07-352-001E.

05/14/2009 Building name changed from DAYCARE PORTABLE BUILDING - STATE to STATE PRESCHOOL PORTABLE BUILDING (BUILDING 700).

FAMILY RESOURCE CENTER (BUILDING 700)

DAYCARE PORTABLE BUILDING - STATE

PORTABLE BUILDING

1,440 SF

04/21/2008 New 2007 Construction Relocatable Building per Manufacturer's Tag information.

02/08/2019 This Material is unchanged as of this date.

08/16/2019 This Material is unchanged as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

08-075AAA	NEW	NO SAMPLE	(NS)
-----------	-----	-----------	--------

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

METAL STORAGE CONTAINERS (3 EA)

METAL STORAGE CONTAINERS (3 EA)

05/14/2009 BUILDING NOTES:

05/14/2009 Metal Storage Containers (3 EA).

METAL STORAGE CONTAINERS (3 EA)

METAL STORAGE CONTAINERS (3 EA)

STORAGE CONTAINER

480 SF

03/21/2016 Metal Storage Containers. 3 EA, approximately 160 SF EA.

02/08/2019 This Material is unchanged as of this date.

08/16/2019 This Material is unchanged as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

16-074.NS	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

MIDDLE QUAD PATIO

MIDDLE QUAD PATIO

09/18/2015 BUILDING NOTES:

09/18/2015 Metal and concrete construction building.

MIDDLE QUAD PATIO

MIDDLE QUAD PATIO

PERMANENT BUILDING

1,600 SF

09/18/2015 Middle Quad Patio. Apparent New Metal and Concrete Structure identified by the AHERA Accredited inspector. This Material is in GOOD condition as of this date.

02/08/2019 This Material is unchanged as of this date.

08/16/2019 This Material is unchanged as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

15-174.NS	NEW	NO SAMPLE	(NS)
-----------	-----	-----------	--------

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

PORTABLE NEXT TO P6 (802)

PORTABLE NEXT TO P6 (802)

02/08/2019 BUILDING NOTES:

02/08/2019 Building is not currently in Use.

American Modular System
DSA# 01-112697
Serial# 12-825-001A&B
Date MFG 06-12

PORTABLE NEXT TO P6 (802)

PORTABLE NEXT TO P6 (802)

PORTABLE BUILDING

900 SF

02/08/2019 New 2006 Relocatable Construction Building per Manufacture's Tag info.

08/16/2019 This Material is unchanged as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

19-011AAA	NEW	NO SAMPLE	(NS)
-----------	-----	-----------	--------

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

RIGHT AT SCHOOL PORTABLE (CLASSROOM P6) (803)

RIGHT AT SCHOOL PORTABLE (CLASSROOM P6) (803)

02/08/2019 BUILDING NOTES:

02/08/2019 Building Not currently in use.

American Modular System
DSA# 01-07065
Serial# 05-107-001 A, B, C
Date MFG 05-05

02/17/2023 Building is currently used for After School Program.

RIGHT AT SCHOOL PORTABLE (CLASSROOM P6) (803)

CLASSROOM 6(803)

PERMANENT BUILDING

960 SF

02/08/2019 Classroom P6. Building in GOOD condition as of this date.

08/16/2019 This Material is unchanged as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/17/2022 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

19-011AAA

NEW

NO SAMPLE

(NS)

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

WOOD STORAGE SHEDS (2 EA)

WOOD STORAGE SHEDS (2 EA)

05/14/2009	BUILDING NOTES:
05/14/2009	Wood Storage Shed (1 EA) used for PE Equipment storage. Located on the west side of Building 400.
12/01/2011	Building Name changed from WOOD STORAGE SHED (1 EA) to WOOD STORAGE SHEDS (2 EA). Area changed from 40 SF to 80 SF. (Second portable is located next to Building 900).

WOOD STORAGE SHEDS (2 EA)

WOOD STORAGE SHEDS (2 EA)

STORAGE BUILDING

170 SF

05/14/2009	Apparent New Wood Construction Structures identified by the AHERA Accredited inspector. This Material is in GOOD condition as of this date.
12/01/2011	Location Description changed from WOOD STORAGE SHED (1 EA) to WOOD STORAGE SHED (1 EA). Quantity changed from 40 SF to 80 SF. No other changes as of this date.
03/07/2014	This Material is unchanged as of this date.
08/29/2014	This Material is unchanged as of this date.
09/18/2015	Quantity Re-Assessed. Quantity changed from 80 SF to 170 SF. No other changes as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.
02/17/2023	This Material is unchanged as of this date.
08/18/2023	This Material is unchanged as of this date.
02/16/2024	This Material is unchanged as of this date.

09-098AAA

NEW

NO SAMPLE

(NS)

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

123

HazMat Doc

AHERA Report B - Survey

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.

ASBESTOS CONTENT

ASBESTOS NAME

ASBESTOS CODE

End Of Report, Total Of 124 Pages

HOMOGENEOUS MATERIALS IN NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

MATERIAL CATEGORY

LOCATION

MATERIAL TYPE

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

MISCELLANEOUS MATERIAL

ALL OFFICES, AND HALLWAY TO STAGE	CARPET MASTIC
BOOK STORAGE ROOM, CUSTODIAL ROOM, AND PANTRY ROOM	BASEBOARD MASTIC
ENTIRE BUILDING	FIRE DOOR CORE INSULATION
ENTIRE BUILDING	SMOOTH WALL
	MISCELLANEOUS
ENTIRE BUILDING EXCEPT CUSTODIAL ROOM AND PANTRY ROOM	BASEBOARD MASTIC
HALLWAY OF CONFERENCE ROOM, CONFERENCE ROOM, STAFF ROOM, DATA EQUIPMENT ROOM, NURSES' ROOM, NURSES' CLOSET, PRINCIPAL'S OFFICE, AND LOBBY	SUSPENDED CEILING TILE
KITCHEN	
KITCHEN	VINYL SHEETING
	VINYL SHEETING BACKING
	PAPER/MASTIC
KITCHEN PANTRY CLOSET	VINYL FLOOR TILE
KITCHEN PANTRY CLOSET	VINYL FLOOR TILE MASTIC
MULTI-PURPOSE ROOM	SUSPENDED CEILING TILE
MULTI-PURPOSE ROOM, NURSES ROOM, STAFF WORK ROOM, AND SERVING AREA	VINYL FLOOR TILE
MULTI-PURPOSE ROOM, NURSES ROOM, STAFF WORK ROOM, AND SERVING AREA	VINYL FLOOR TILE MASTIC
MULTI-PURPOSE ROOM, OFFICES, AND HALLWAYS	VINYL WALL COVER
MULTI-PURPOSE ROOM, OFFICES, AND HALLWAYS	VINYL WALL COVER MASTIC
PTA ROOM	VINYL FLOOR TILE
PTA ROOM	VINYL FLOOR TILE MASTIC
STAFF RESTROOMS (2), NURSES' RESTROOM, AND KITCHEN RESTROOM	MORTAR MISCELLANEOUS
STAFF RESTROOMS (2), NURSES' RESTROOM, AND KITCHEN RESTROOM	MORTAR MISCELLANEOUS
TEACHER'S LOUNGE AND NURSE'S ROOM	SINK UNDERCOATING
WOMENS RESTROOM	MORTAR MISCELLANEOUS

SURFACING MATERIAL

ENTIRE BUILDING	SMOOTH WALL SURFACING
EXTERIOR WALLS, AND ALL PERIMETER WALLS IN BACK OF BUILDING (UTILITY YARD FOR TRASH CAN ROOM WASHING AREA)	ROUGH WALL
EXTERIOR WALLS, AND ALL PERIMETER WALLS IN BACK OF BUILDING (UTILITY YARD FOR TRASH CAN ROOM WASHING AREA)	ROUGH WALL SURFACING

THERMAL SYSTEM INSULATION

ATTIC / PLENUM	PIPE FITTING INSULATION
----------------	-------------------------

BUS LOOP

SURFACING MATERIAL

EXTERIOR WALL	ROUGH WALL
EXTERIOR WALL	ROUGH WALL SURFACING

HOMOGENEOUS MATERIALS IN NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

MATERIAL CATEGORY

LOCATION

MATERIAL TYPE

THERMAL SYSTEM INSULATION

EXTERIOR WALL

PAPER TYPE INSULATION

CLASSROOMS 201-202 BUILDING (BUILDING 200)

MISCELLANEOUS MATERIAL

ALL ROOMS AND CLOSETS

CLASSROOMS 201 AND 202

CLASSROOMS 201 AND 202

CLASSROOMS 201 AND 202

CLASSROOMS 201 AND 202

CLASSROOMS 201 AND 202, RESTROOMS, STORAGE ROOMS AND UTILITY ROOMS

CLASSROOMS 201 AND 202 WET / SINK AREAS AND STORAGE ROOMS

CLASSROOMS 201 AND 202 WET / SINK AREAS AND STORAGE ROOMS

CLASSROOMS 201 AND 202 WET / SINK AREAS AND STORAGE ROOMS

CLASSROOMS 201 AND 202 WET / SINK AREAS AND STORAGE ROOMS

CLASSROOMS 201-202

CUSTODIAN ROOM AND BOILER ROOM

ENTIRE BUILDING

EXTERIOR WINDOWS

RESTROOMS

RESTROOMS, ENTRY WAY TO CLASSROOMS, AND CUSTODIAL ROOM

STUDENT RESTROOMS

BASEBOARD MASTIC

CARPET MASTIC

SUSPENDED CEILING TILE

VINYL WALL COVER

VINYL WALL COVER MASTIC

SMOOTH WALL

MISCELLANEOUS

VINYL FLOOR TILE

VINYL FLOOR TILE

VINYL FLOOR TILE MASTIC

VINYL FLOOR TILE MASTIC

SINK UNDERCOATING

BASEBOARD MASTIC

FIRE DOOR CORE INSULATION

CAULKING

MORTAR MISCELLANEOUS

MORTAR MISCELLANEOUS

MORTAR MISCELLANEOUS

SURFACING MATERIAL

CLASSROOMS 201 AND 202, RESTROOMS, STORAGE ROOMS AND UTILITY ROOMS

EXTERIOR WALLS

EXTERIOR WALLS

SMOOTH WALL SURFACING

ROUGH WALL

ROUGH WALL SURFACING

CLASSROOMS 301-306 BUILDING (BUILDING 300)

MISCELLANEOUS MATERIAL

ALL CLASSROOMS AND F.I.S. ROOM

ALL CLASSROOMS AND F.I.S. ROOM

BOYS' AND GIRLS' RESTROOMS AND STORAGE ROOM

CLASSROOMS 301-306, F.I.S. AND FOUR STORAGE ROOMS

CLASSROOMS 301-306, F.I.S. AND STORAGE ROOMS

CLASSROOMS 301-306, HALLWAY, AND F.I.S.

CLASSROOMS 301-308, AND RESTROOMS (2)

ENTIRE BUILDING

ENTIRE BUILDING

ENTIRE BUILDING INCLUDING RESTROOMS, UTILITY ROOMS AND STORAGE ROOMS

EXTERIOR WINDOWS AND DOORS

FLEXIBLE INSTRUCTIONAL SPACE

FLEXIBLE INSTRUCTIONAL SPACE

VINYL WALL COVER

VINYL WALL COVER MASTIC

MORTAR MISCELLANEOUS

SUSPENDED CEILING TILE

BASEBOARD MASTIC

CARPET MASTIC

MORTAR MISCELLANEOUS

CEMENTITIOUS

MISCELLANEOUS

FIRE DOOR CORE INSULATION

SMOOTH WALL

MISCELLANEOUS

CAULKING

VINYL FLOOR TILE

VINYL FLOOR TILE MASTIC

HOMOGENEOUS MATERIALS IN NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

MATERIAL CATEGORY

LOCATION

MATERIAL TYPE

TEACHERS' WORK ROOM, AND CLASSROOMS 301-308
TEACHERS' WORK ROOM, STORAGE ROOMS, AND STAFF RESTROOM
TEACHERS' WORK ROOM, STORAGE ROOMS, AND STAFF RESTROOM
WATER HEATER ROOM (NEXT TO RESTROOMS) AND JANITOR CLOSET

SINK UNDERCOATING
VINYL FLOOR TILE
VINYL FLOOR TILE MASTIC
BASEBOARD MASTIC

SURFACING MATERIAL

ENTIRE BUILDING INCLUDING RESTROOMS, UTILITY ROOMS AND STORAGE ROOMS
EXTERIOR WALLS AND OVERHANG ON RESTROOMS
EXTERIOR WALLS AND OVERHANG ON RESTROOMS

SMOOTH WALL SURFACING
ROUGH WALL
ROUGH WALL SURFACING

CLASSROOMS 400-406 BUILDING (BUILDING 400)

MISCELLANEOUS MATERIAL

ALL CLASSROOMS
ALL CLASSROOMS, AND LIBRARY
ALL ROOMS
ALL ROOMS
BOYS AND GIRLS RESTROOMS AND STORAGE ROOM
CLASSROOMS, AND LIBRARY
CLASSROOMS, AND LIBRARY
ENTIRE BUILDING

ENTIRE BUILDING
ENTIRE BUILDING

EXTERIOR WINDOWS
LIBRARY (400), CLASSROOMS 401-406, AND RESTROOMS
LIBRARY STORAGE
LIBRARY STORAGE
LIBRARY STORAGE
TEACHERS' WORK ROOM, AND LIBRARY
TEACHERS' WORK ROOM, AND TWO STORAGE ROOMS
TEACHERS' WORK ROOM, AND TWO STORAGE ROOMS
WATER HEATER ROOM AND UTILITY CLOSET

CARPET MASTIC
SUSPENDED CEILING TILE
BASEBOARD MASTIC
BASEBOARD MASTIC
MORTAR MISCELLANEOUS
VINYL WALL COVER
VINYL WALL COVER MASTIC
CEMENTITIOUS
MISCELLANEOUS
FIRE DOOR CORE INSULATION
SMOOTH WALL
MISCELLANEOUS
CAULKING
MORTAR MISCELLANEOUS
BASEBOARD MASTIC
VINYL FLOOR TILE
VINYL FLOOR TILE MASTIC
SINK UNDERCOATING
VINYL FLOOR TILE
VINYL FLOOR TILE MASTIC
BASEBOARD MASTIC

SURFACING MATERIAL

ENTIRE BUILDING
EXTERIOR WALLS, AND OVERHANG OF RESTROOMS
EXTERIOR WALLS, AND OVERHANG OF RESTROOMS

SMOOTH WALL SURFACING
ROUGH WALL
ROUGH WALL SURFACING

CLASSROOMS 501-506 BUILDING (BUILDING 500)

MISCELLANEOUS MATERIAL

ALL CLASSROOMS, COMPUTER LAB AND STORAGE ROOMS
BOYS AND GIRLS RESTROOM
BOYS AND GIRLS RESTROOMS
BOYS AND GIRLS RESTROOMS
CLASSROOMS 501-504 (AND RESTROOMS), AND CLASSROOMS 505 & 506 (AND RESTROOMS)

BASEBOARD MASTIC
MORTAR MISCELLANEOUS
MORTAR MISCELLANEOUS
MORTAR MISCELLANEOUS
MORTAR MISCELLANEOUS

HOMOGENEOUS MATERIALS IN NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

MATERIAL CATEGORY

LOCATION

MATERIAL TYPE

CLASSROOMS 501-506	SINK UNDERCOATING
CLASSROOMS 501-506 AND COMPUTER LAB	VINYL WALL COVER
CLASSROOMS 501-506 AND COMPUTER LAB	VINYL WALL COVER MASTIC
CLASSROOMS 501-506, AND SCIENCE / COMPUTER LAB	CARPET MASTIC
CLASSROOMS 501-506, AND SCIENCE / COMPUTER LAB	CARPET MASTIC
CLASSROOMS 501-506, AND SCIENCE / COMPUTER LAB	SUSPENDED CEILING TILE
CLASSROOMS 501-506, STORAGE ROOMS AND COMPUTER LAB	CARPET MASTIC
DATA ROOM AND WORK ROOMS	VINYL FLOOR TILE
DATA ROOM AND WORK ROOMS	VINYL FLOOR TILE MASTIC
ENTIRE BUILDING	CEMENTITIOUS
	MISCELLANEOUS
ENTIRE BUILDING	FIRE DOOR CORE INSULATION
ENTIRE BUILDING INCLUDING RESTROOMS, STORAGE ROOMS AND UTILITY ROOMS	SMOOTH WALL
	MISCELLANEOUS
EXTERIOR WINDOWS	CAULKING
GIRLS' RESTROOMS	MORTAR MISCELLANEOUS
WATER HEATER CLOSET AND STORAGE	BASEBOARD MASTIC
SURFACING MATERIAL	
ENTIRE BUILDING INCLUDING RESTROOMS, STORAGE ROOMS AND UTILITY ROOMS	SMOOTH WALL SURFACING
EXTERIOR WALLS, AND OVERHANG OF RESTROOMS	ROUGH WALL SURFACING
EXTERIOR WALLS, AND OVERHANGS OF RESTROOMS	ROUGH WALL

CLASSROOMS 801 PORTABLE BUILDING

MISCELLANEOUS MATERIAL

CLASSROOM 801

PORTABLE BUILDING

DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

MISCELLANEOUS MATERIAL

CLASSROOMS	BASEBOARD MASTIC
CLASSROOMS	SMOOTH WALL
	MISCELLANEOUS
CLASSROOMS	SUSPENDED CEILING TILE
CLASSROOMS	VINYL FLOOR TILE
CLASSROOMS	VINYL FLOOR TILE MASTIC
CLASSROOMS	VINYL WALL COVER
CLASSROOMS	VINYL WALL COVER MASTIC
CLASSROOMS, OFFICE AND STORAGE ROOM	CARPET MASTIC
DAYCARE PORTABLE (600)	SINK UNDERCOATING
ENTIRE BUILDING	FIRE DOOR CORE INSULATION
FOOD PREPERATION AREA	VINYL SHEETING
FOOD PREPERATION AREA	VINYL SHEETING BACKING
	PAPER/MASTIC
RESTROOMS (1 EA BOYS' AND GIRLS'), STAFF ROOM, AND CUSTODIAN ROOM	VINYL SHEETING
RESTROOMS (1 EA BOYS' AND GIRLS'), STAFF ROOM, AND CUSTODIAN ROOM	VINYL SHEETING BACKING
	PAPER/MASTIC

DAYCARE PORTABLE BUILDING - FED CHILDCARE (BUILDING 900)

HOMOGENEOUS MATERIALS IN NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME		MATERIAL TYPE
MATERIAL CATEGORY	LOCATION	
MISCELLANEOUS MATERIAL		
CLASSROOM		BASEBOARD MASTIC
CLASSROOM		CARPET MASTIC
CLASSROOM		SUSPENDED CEILING TILE
CLASSROOM		VINYL WALL COVER
CLASSROOM		VINYL WALL COVER MASTIC
CLASSROOM 900		VINYL WALL COVER
CLASSROOM 900		VINYL WALL COVER MASTIC
CLASSROOM AND RESTROOMS		VINYL SHEETING
CLASSROOM AND RESTROOMS		VINYL SHEETING BACKING PAPER/MASTIC
ENTIRE BUILDING		FIRE DOOR CORE INSULATION
DAYCARE PORTABLE BUILDING - SDC (BUILDING 800)		
MISCELLANEOUS MATERIAL		
PORTABLE DAYCARE - SDC		PORTABLE BUILDING
FAMILY RESOURCE CENTER (BUILDING 700)		
MISCELLANEOUS MATERIAL		
DAYCARE PORTABLE BUILDING - STATE		PORTABLE BUILDING
METAL STORAGE CONTAINERS (3 EA)		
MISCELLANEOUS MATERIAL		
METAL STORAGE CONTAINERS (3 EA)		STORAGE CONTAINER
MIDDLE QUAD PATIO		
MISCELLANEOUS MATERIAL		
MIDDLE QUAD PATIO		PERMANENT BUILDING
PORTABLE NEXT TO P6 (802)		
MISCELLANEOUS MATERIAL		
PORTABLE NEXT TO P6 (802)		PORTABLE BUILDING
RIGHT AT SCHOOL PORTABLE (CLASSROOM P6) (803)		
MISCELLANEOUS MATERIAL		
CLASSROOM 6(803)		PERMANENT BUILDING
WOOD STORAGE SHEDS (2 EA)		

HOMOGENEOUS MATERIALS IN
NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

MATERIAL CATEGORY

LOCATION

MATERIAL TYPE

MISCELLANEOUS MATERIAL

WOOD STORAGE SHEDS (2 EA)

STORAGE BUILDING

End Of Report, Total Of 6 Pages

FRIABLE LOCATIONS IN NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME			
LOCATION		QTY	ASBESTOS
MATERIAL TYPE		(APPROXIMATE)	CONTENT
ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)			
ATTIC / PLENUM			
PIPE FITTING INSULATION		(TBD) LF	Assumed
BOOK STORAGE ROOM, CUSTODIAL ROOM, AND PANTRY ROOM			
BASEBOARD MASTIC		116 LF	New Material
ENTIRE BUILDING			
FIRE DOOR CORE INSULATION		546 SF	Assumed
ENTIRE BUILDING			
SMOOTH WALL MISCELLANEOUS		24,500 SF	Greater Than 1%
ENTIRE BUILDING			
SMOOTH WALL SURFACING		24,500 SF	Greater Than 1%
ENTIRE BUILDING EXCEPT CUSTODIAL ROOM AND PANTRY ROOM			
BASEBOARD MASTIC		1,420 LF	Assumed
HALLWAY OF CONFERENCE ROOM, CONFERENCE ROOM, STAFF ROOM, DATA EQUIPMENT ROOM, NURSES' ROOM, NURSES' CLOSET, PRINCIPAL'S OFFICE, AND LOBBY			
SUSPENDED CEILING TILE		1,490 SF	Assumed
KITCHEN			
VINYL SHEETING		572 SF	Assumed
KITCHEN			
VINYL SHEETING BACKING PAPER/MASTIC		572 SF	Assumed
KITCHEN PANTRY CLOSET			
VINYL FLOOR TILE		60 SF	Assumed
KITCHEN PANTRY CLOSET			
VINYL FLOOR TILE MASTIC		60 SF	Assumed
MULTI-PURPOSE ROOM			
SUSPENDED CEILING TILE		2,530 SF	Assumed
MULTI-PURPOSE ROOM, OFFICES, AND HALLWAYS			
VINYL WALL COVER		18,680 SF	Assumed
MULTI-PURPOSE ROOM, OFFICES, AND HALLWAYS			
VINYL WALL COVER MASTIC		18,680 SF	Assumed
PTA ROOM			
VINYL FLOOR TILE		144 SF	Assumed
PTA ROOM			
VINYL FLOOR TILE MASTIC		144 SF	Assumed

FRIABLE LOCATIONS IN NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME			
LOCATION	MATERIAL TYPE	QTY (APPROXIMATE)	ASBESTOS CONTENT
BUS LOOP			
EXTERIOR WALL	PAPER TYPE INSULATION	800 SF	Assumed
CLASSROOMS 201-202 BUILDING (BUILDING 200)			
CLASSROOMS 201 AND 202	SUSPENDED CEILING TILE	2,600 SF	Assumed
CLASSROOMS 201 AND 202, RESTROOMS, STORAGE ROOMS AND UTILITY ROOMS	SMOOTH WALL MISCELLANEOUS	2,600 SF	Greater Than 1%
CLASSROOMS 201 AND 202, RESTROOMS, STORAGE ROOMS AND UTILITY ROOMS	SMOOTH WALL SURFACING	2,600 SF	Greater Than 1%
ENTIRE BUILDING	FIRE DOOR CORE INSULATION	210 SF	Assumed
EXTERIOR WINDOWS	CAULKING	200 LF	Assumed
CLASSROOMS 301-306 BUILDING (BUILDING 300)			
CLASSROOMS 301-306, F.I.S. AND FOUR STORAGE ROOMS	SUSPENDED CEILING TILE	9,400 SF	Assumed
ENTIRE BUILDING	FIRE DOOR CORE INSULATION	672 SF	Assumed
ENTIRE BUILDING INCLUDING RESTROOMS, UTILITY ROOMS AND STORAGE ROOMS	SMOOTH WALL MISCELLANEOUS	37,800 SF	Assumed
ENTIRE BUILDING INCLUDING RESTROOMS, UTILITY ROOMS AND STORAGE ROOMS	SMOOTH WALL SURFACING	37,800 SF	Assumed
EXTERIOR WINDOWS AND DOORS	CAULKING	900 LF	Assumed
WATER HEATER ROOM (NEXT TO RESTROOMS) AND JANITOR CLOSET	BASEBOARD MASTIC	15 LF	Assumed
CLASSROOMS 400-406 BUILDING (BUILDING 400)			
ALL CLASSROOMS, AND LIBRARY	SUSPENDED CEILING TILE	8,400 SF	Assumed
CLASSROOMS, AND LIBRARY	VINYL WALL COVER	29,880 SF	Assumed
CLASSROOMS, AND LIBRARY	VINYL WALL COVER MASTIC	29,880 SF	Assumed

FRIABLE LOCATIONS IN NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	QTY (APPROXIMATE)	ASBESTOS CONTENT
	MATERIAL TYPE		
ENTIRE BUILDING	FIRE DOOR CORE INSULATION	399 SF	Assumed
ENTIRE BUILDING	SMOOTH WALL MISCELLANEOUS	38,100 SF	Assumed
ENTIRE BUILDING	SMOOTH WALL SURFACING	38,100 SF	Assumed
EXTERIOR WALLS, AND OVERHANG OF RESTROOMS	ROUGH WALL	7,200 SF	Assumed
EXTERIOR WALLS, AND OVERHANG OF RESTROOMS	ROUGH WALL SURFACING	7,200 SF	Assumed
EXTERIOR WINDOWS	CAULKING	900 LF	Assumed
LIBRARY STORAGE	BASEBOARD MASTIC	50 LF	Assumed
LIBRARY STORAGE	VINYL FLOOR TILE	144 SF	Assumed
LIBRARY STORAGE	VINYL FLOOR TILE MASTIC	144 SF	Assumed
CLASSROOMS 501-506 BUILDING (BUILDING 500)			
BOYS AND GIRLS RESTROOM	MORTAR MISCELLANEOUS	120 SF	Assumed
BOYS AND GIRLS RESTROOMS	MORTAR MISCELLANEOUS	600 SF	Assumed
CLASSROOMS 501-506 AND COMPUTER LAB	VINYL WALL COVER	30,000 SF	Assumed
CLASSROOMS 501-506 AND COMPUTER LAB	VINYL WALL COVER MASTIC	30,000 SF	Assumed
CLASSROOMS 501-506, AND SCIENCE / COMPUTER LAB	SUSPENDED CEILING TILE	9,400 SF	Assumed
ENTIRE BUILDING	CEMENTITIOUS MISCELLANEOUS	50 SF	Assumed
ENTIRE BUILDING	FIRE DOOR CORE INSULATION	651 SF	Assumed
ENTIRE BUILDING INCLUDING RESTROOMS, STORAGE ROOMS AND UTILITY ROOMS	SMOOTH WALL MISCELLANEOUS	38,500 SF	Assumed

FRIABLE LOCATIONS IN NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME			
LOCATION		QTY	ASBESTOS
MATERIAL TYPE		(APPROXIMATE)	CONTENT
ENTIRE BUILDING INCLUDING RESTROOMS, STORAGE ROOMS AND UTILITY ROOMS			
SMOOTH WALL SURFACING		38,500 SF	Assumed
EXTERIOR WINDOWS			
CAULKING		900 LF	Assumed
DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)			
CLASSROOMS			
SMOOTH WALL MISCELLANEOUS		2,120 SF	Assumed
CLASSROOMS			
SUSPENDED CEILING TILE		2,040 SF	Assumed
CLASSROOMS			
VINYL FLOOR TILE		960 SF	Assumed
CLASSROOMS			
VINYL FLOOR TILE MASTIC		960 SF	Assumed
CLASSROOMS, OFFICE AND STORAGE ROOM			
CARPET MASTIC		150 SF	Assumed
ENTIRE BUILDING			
FIRE DOOR CORE INSULATION		63 SF	Assumed
RESTROOMS (1 EA BOYS' AND GIRLS'), STAFF ROOM, AND CUSTODIAN ROOM			
VINYL SHEETING		140 SF	Assumed
RESTROOMS (1 EA BOYS' AND GIRLS'), STAFF ROOM, AND CUSTODIAN ROOM			
VINYL SHEETING BACKING PAPER/MASTIC		140 SF	Assumed
DAYCARE PORTABLE BUILDING - FED CHILDCARE (BUILDING 900)			
CLASSROOM			
SUSPENDED CEILING TILE		960 SF	Assumed
CLASSROOM AND RESTROOMS			
VINYL SHEETING BACKING PAPER/MASTIC		480 SF	Assumed
ENTIRE BUILDING			
FIRE DOOR CORE INSULATION		84 SF	Assumed

End Of Report, Total Of 4 Pages

Non- Friable Locations In NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	QTY (APPROXIMATE)	ASBESTOS CONTENT
MATERIAL TYPE			
ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)			
	ALL OFFICES, AND HALLWAY TO STAGE		
	CARPET MASTIC	4,430 SF	New Material
	EXTERIOR WALLS, AND ALL PERIMETER WALLS IN BACK OF BUILDING (UTILITY YARD FOR TRASH CAN ROOM WASHING AREA)		
	ROUGH WALL	17,180 SF	Assumed
	EXTERIOR WALLS, AND ALL PERIMETER WALLS IN BACK OF BUILDING (UTILITY YARD FOR TRASH CAN ROOM WASHING AREA)		
	ROUGH WALL SURFACING	17,180 SF	Assumed
	MULTI-PURPOSE ROOM, NURSES ROOM, STAFF WORK ROOM, AND SERVING AREA		
	VINYL FLOOR TILE	4,200 SF	New Material
	MULTI-PURPOSE ROOM, NURSES ROOM, STAFF WORK ROOM, AND SERVING AREA		
	VINYL FLOOR TILE MASTIC	4,200 SF	New Material
	STAFF RESTROOMS (2), NURSES' RESTROOM, AND KITCHEN RESTROOM		
	MORTAR MISCELLANEOUS	640 SF	Assumed
	STAFF RESTROOMS (2), NURSES' RESTROOM, AND KITCHEN RESTROOM		
	MORTAR MISCELLANEOUS	270 SF	Assumed
	TEACHER'S LOUNGE AND NURSE'S ROOM		
	SINK UNDERCOATING	8 SF	Assumed
	WOMENS RESTROOM		
	MORTAR MISCELLANEOUS	120 SF	Assumed
BUS LOOP			
	EXTERIOR WALL		
	ROUGH WALL	800 SF	Assumed
	EXTERIOR WALL		
	ROUGH WALL SURFACING	800 SF	Assumed
CLASSROOMS 201-202 BUILDING (BUILDING 200)			
	ALL ROOMS AND CLOSETS		
	BASEBOARD MASTIC	90 SF	New Material
	CLASSROOMS 201 AND 202		
	CARPET MASTIC	1,500 SF	New Material
	CLASSROOMS 201 AND 202		
	VINYL WALL COVER	1,600 SF	Assumed
	CLASSROOMS 201 AND 202		
	VINYL WALL COVER MASTIC	1,600 SF	Assumed
	CLASSROOMS 201 AND 202 WET / SINK AREAS AND STORAGE ROOMS		
	VINYL FLOOR TILE	1,500 SF	New Material
	CLASSROOMS 201 AND 202 WET / SINK AREAS AND STORAGE ROOMS		
	VINYL FLOOR TILE	1,500 SF	Assumed
	CLASSROOMS 201 AND 202 WET / SINK AREAS AND STORAGE ROOMS		
	VINYL FLOOR TILE MASTIC	1,500 SF	New Material

Non- Friable Locations In NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	QTY (APPROXIMATE)	ASBESTOS CONTENT
		CLASSROOMS 201 AND 202 WET / SINK AREAS AND STORAGE ROOMS		
		VINYL FLOOR TILE MASTIC	1,500 SF	Assumed
		CLASSROOMS 201-202		
		SINK UNDERCOATING	8 SF	Assumed
		CUSTODIAN ROOM AND BOILER ROOM		
		BASEBOARD MASTIC	80 LF	Assumed
		EXTERIOR WALLS		
		ROUGH WALL	3,200 SF	Assumed
		EXTERIOR WALLS		
		ROUGH WALL SURFACING	3,200 SF	Assumed
		RESTROOMS		
		MORTAR MISCELLANEOUS	200 SF	Assumed
		RESTROOMS, ENTRY WAY TO CLASSROOMS, AND CUSTODIAL ROOM		
		MORTAR MISCELLANEOUS	560 SF	Assumed
		STUDENT RESTROOMS		
		MORTAR MISCELLANEOUS	300 SF	Assumed
CLASSROOMS 301-306 BUILDING (BUILDING 300)				
		ALL CLASSROOMS AND F.I.S. ROOM		
		VINYL WALL COVER	29,000 SF	Assumed
		ALL CLASSROOMS AND F.I.S. ROOM		
		VINYL WALL COVER MASTIC	29,000 SF	Assumed
		BOYS' AND GIRLS' RESTROOMS AND STORAGE ROOM		
		MORTAR MISCELLANEOUS	350 SF	Assumed
		CLASSROOMS 301-306, F.I.S. AND STORAGE ROOMS		
		BASEBOARD MASTIC	1,400 LF	New Material
		CLASSROOMS 301-306, HALLWAY, AND F.I.S.		
		CARPET MASTIC	7,684 SF	New Material
		CLASSROOMS 301-308, AND RESTROOMS (2)		
		MORTAR MISCELLANEOUS	700 SF	Assumed
		ENTIRE BUILDING		
		CEMENTITIOUS MISCELLANEOUS	70 SF	Assumed
		EXTERIOR WALLS AND OVERHANG ON RESTROOMS		
		ROUGH WALL	7,200 SF	Assumed
		EXTERIOR WALLS AND OVERHANG ON RESTROOMS		
		ROUGH WALL SURFACING	7,200 SF	Assumed
		FLEXIBLE INSTRUCTIONAL SPACE		
		VINYL FLOOR TILE	756 SF	New Material
		FLEXIBLE INSTRUCTIONAL SPACE		
		VINYL FLOOR TILE MASTIC	756 SF	New Material
		TEACHERS' WORK ROOM, AND CLASSROOMS 301-308		
		SINK UNDERCOATING	28 SF	Assumed

Non- Friable Locations In NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME			
LOCATION		QTY	ASBESTOS
MATERIAL TYPE		(APPROXIMATE)	CONTENT
TEACHERS' WORK ROOM, STORAGE ROOMS, AND STAFF RESTROOM			
VINYL FLOOR TILE		1,560 SF	Assumed
TEACHERS' WORK ROOM, STORAGE ROOMS, AND STAFF RESTROOM			
VINYL FLOOR TILE MASTIC		1,560 SF	Assumed
CLASSROOMS 400-406 BUILDING (BUILDING 400)			
ALL CLASSROOMS			
CARPET MASTIC		7,600 SF	New Material
ALL ROOMS			
BASEBOARD MASTIC		1,400 LF	New Material
ALL ROOMS			
BASEBOARD MASTIC		1,400 LF	Assumed
BOYS AND GIRLS RESTROOMS AND STORAGE ROOM			
MORTAR MISCELLANEOUS		350 SF	Assumed
ENTIRE BUILDING			
CEMENTITIOUS MISCELLANEOUS		50 SF	Assumed
LIBRARY (400), CLASSROOMS 401-406, AND RESTROOMS			
MORTAR MISCELLANEOUS		700 SF	Assumed
TEACHERS' WORK ROOM, AND LIBRARY			
SINK UNDERCOATING		24 SF	Assumed
TEACHERS' WORK ROOM, AND TWO STORAGE ROOMS			
VINYL FLOOR TILE		2,200 SF	Assumed
TEACHERS' WORK ROOM, AND TWO STORAGE ROOMS			
VINYL FLOOR TILE MASTIC		2,200 SF	Assumed
WATER HEATER ROOM AND UTILITY CLOSET			
BASEBOARD MASTIC		40 LF	Assumed
CLASSROOMS 501-506 BUILDING (BUILDING 500)			
ALL CLASSROOMS, COMPUTER LAB AND STORAGE ROOMS			
BASEBOARD MASTIC		1,400 LF	New Material
BOYS AND GIRLS RESTROOMS			
MORTAR MISCELLANEOUS		416 SF	Assumed
CLASSROOMS 501-504 (AND RESTROOMS), AND CLASSROOMS 505 & 506 (AND RESTROOMS)			
MORTAR MISCELLANEOUS		800 SF	Assumed
CLASSROOMS 501-506			
SINK UNDERCOATING		20 SF	Assumed
CLASSROOMS 501-506, AND SCIENCE / COMPUTER LAB			
CARPET MASTIC		8,500 SF	New Material
CLASSROOMS 501-506, AND SCIENCE / COMPUTER LAB			
CARPET MASTIC		8,500 SF	New Material
CLASSROOMS 501-506, STORAGE ROOMS AND COMPUTER LAB			
CARPET MASTIC		1,430 SF	Assumed
DATA ROOM AND WORK ROOMS			
VINYL FLOOR TILE		400 SF	Assumed

S= Sq. Ft, l=Inches, L=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

Non- Friable Locations In NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME			
LOCATION		QTY	ASBESTOS
MATERIAL TYPE		(APPROXIMATE)	CONTENT
DATA ROOM AND WORK ROOMS			
VINYL FLOOR TILE MASTIC		400 SF	Assumed
EXTERIOR WALLS, AND OVERHANG OF RESTROOMS			
ROUGH WALL SURFACING		7,200 SF	Assumed
EXTERIOR WALLS, AND OVERHANGS OF RESTROOMS			
ROUGH WALL		7,200 SF	Assumed
GIRLS' RESTROOMS			
MORTAR MISCELLANEOUS		600 SF	Assumed
WATER HEATER CLOSET AND STORAGE			
BASEBOARD MASTIC		50 LF	Assumed
DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)			
CLASSROOMS			
BASEBOARD MASTIC		350 LF	Assumed
CLASSROOMS			
VINYL WALL COVER		2,100 SF	Assumed
CLASSROOMS			
VINYL WALL COVER MASTIC		2,100 SF	Assumed
DAYCARE PORTABLE (600)			
SINK UNDERCOATING		10 SF	Assumed
FOOD PREPERATION AREA			
VINYL SHEETING		90 SF	Assumed
FOOD PREPERATION AREA			
VINYL SHEETING BACKING PAPER/MASTIC		90 SF	Assumed
DAYCARE PORTABLE BUILDING - FED CHILDCARE (BUILDING 900)			
CLASSROOM			
BASEBOARD MASTIC		140 LF	Assumed
CLASSROOM			
CARPET MASTIC		480 SF	Assumed
CLASSROOM			
VINYL WALL COVER		1,800 SF	Assumed
CLASSROOM			
VINYL WALL COVER MASTIC		1,800 SF	Assumed
CLASSROOM 900			
VINYL WALL COVER		1,800 SF	Assumed
CLASSROOM 900			
VINYL WALL COVER MASTIC		1,800 SF	Assumed
CLASSROOM AND RESTROOMS			
VINYL SHEETING		480 SF	Assumed

**Non- Friable Locations In
NORTHWOOD ELEMENTARY SCHOOL**

BUILDING NAME			
LOCATION			
MATERIAL TYPE			QTY (APPROXIMATE)ASBESTOS CONTENT
METAL STORAGE CONTAINERS (3 EA)			
PORTABLE NEXT TO P6 (802)			
PORTABLE NEXT TO P6 (802)			
PORTABLE BUILDING			900 SFNew Material
RIGHT AT SCHOOL PORTABLE (CLASSROOM P6) (803)			
CLASSROOM 6(803)			
PERMANENT BUILDING			960 SFNew Material
End Of Report, Total Of 5 Pages			

RECOMMENDATIONS FOR
NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

ALL OFFICES, AND HALLWAY TO STAGE

CARPET MASTIC

4,430 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

ATTIC / PLENUM

PIPE FITTING INSULATION

(TBD) LF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

BOOK STORAGE ROOM, CUSTODIAL ROOM, AND PANTRY ROOM

BASEBOARD MASTIC

116 LF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

ENTIRE BUILDING

FIRE DOOR CORE INSULATION

546 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

ENTIRE BUILDING

SMOOTH WALL MISCELLANEOUS 24,500 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

ENTIRE BUILDING

SMOOTH WALL SURFACING 24,500 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

ENTIRE BUILDING EXCEPT CUSTODIAL ROOM AND PANTRY ROOM

BASEBOARD MASTIC 1,420 LF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

EXTERIOR WALLS, AND ALL PERIMETER WALLS IN BACK OF BUILDING (UTILITY YARD FOR TRASH CAN ROOM WASHING AREA)

ROUGH WALL 17,180 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

EXTERIOR WALLS, AND ALL PERIMETER WALLS IN BACK OF BUILDING (UTILITY YARD FOR TRASH CAN ROOM WASHING AREA)

ROUGH WALL SURFACING 17,180 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

HALLWAY OF CONFERENCE ROOM, CONFERENCE ROOM, STAFF ROOM, DATA EQUIPMENT ROOM, NURSES' ROOM, NURSES' CLOSET, PRINCIPAL'S OFFICE, AND LOBBY

SUSPENDED CEILING TILE 1,490 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

KITCHEN

VINYL SHEETING 572 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

KITCHEN

VINYL SHEETING BACKING PAPER/MASTIC 572 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

RECOMMENDATIONS FOR
NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

KITCHEN PANTRY CLOSET

VINYL FLOOR TILE

60 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

KITCHEN PANTRY CLOSET

VINYL FLOOR TILE MASTIC

60 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

MULTI-PURPOSE ROOM

SUSPENDED CEILING TILE

2,530 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

MULTI-PURPOSE ROOM, NURSES ROOM, STAFF WORK ROOM, AND SERVING AREA

VINYL FLOOR TILE

4,200 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

RECOMMENDATIONS FOR
NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME**LOCATION****MATERIAL TYPE****RECOMMENDATION****QTY****(APPROXIMATE)**

MULTI-PURPOSE ROOM, NURSES ROOM, STAFF WORK ROOM, AND SERVING AREA**VINYL FLOOR TILE MASTIC****4,200 SF**

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

MULTI-PURPOSE ROOM, OFFICES, AND HALLWAYS**VINYL WALL COVER****18,680 SF**

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

MULTI-PURPOSE ROOM, OFFICES, AND HALLWAYS**VINYL WALL COVER MASTIC****18,680 SF**

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

PTA ROOM**VINYL FLOOR TILE****144 SF**

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR
NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

PTA ROOM

VINYL FLOOR TILE MASTIC

144 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

STAFF RESTROOMS (2), NURSES' RESTROOM, AND KITCHEN RESTROOM

MORTAR MISCELLANEOUS

640 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

STAFF RESTROOMS (2), NURSES' RESTROOM, AND KITCHEN RESTROOM

MORTAR MISCELLANEOUS

270 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

TEACHER'S LOUNGE AND NURSE'S ROOM

SINK UNDERCOATING

8 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR
NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME**LOCATION****MATERIAL TYPE****RECOMMENDATION****QTY****(APPROXIMATE)**

WOMENS RESTROOM

MORTAR MISCELLANEOUS

120 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

BUS LOOP

EXTERIOR WALL

PAPER TYPE INSULATION

800 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

EXTERIOR WALL

ROUGH WALL

800 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

EXTERIOR WALL

ROUGH WALL SURFACING

800 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR
NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

CLASSROOMS 201-202 BUILDING (BUILDING 200)

ALL ROOMS AND CLOSETS

BASEBOARD MASTIC

90 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

CLASSROOMS 201 AND 202

CARPET MASTIC

1,500 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

CLASSROOMS 201 AND 202

SUSPENDED CEILING TILE

2,600 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

CLASSROOMS 201 AND 202

VINYL WALL COVER

1,600 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

CLASSROOMS 201 AND 202

VINYL WALL COVER MASTIC

1,600 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOMS 201 AND 202, RESTROOMS, STORAGE ROOMS AND UTILITY ROOMS

SMOOTH WALL MISCELLANEOUS

2,600 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOMS 201 AND 202, RESTROOMS, STORAGE ROOMS AND UTILITY ROOMS

SMOOTH WALL SURFACING

2,600 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOMS 201 AND 202 WET / SINK AREAS AND STORAGE ROOMS

VINYL FLOOR TILE

1,500 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

RECOMMENDATIONS FOR
NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

CLASSROOMS 201 AND 202 WET / SINK AREAS AND STORAGE ROOMS

VINYL FLOOR TILE

1,500 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOMS 201 AND 202 WET / SINK AREAS AND STORAGE ROOMS

VINYL FLOOR TILE MASTIC

1,500 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

CLASSROOMS 201 AND 202 WET / SINK AREAS AND STORAGE ROOMS

VINYL FLOOR TILE MASTIC

1,500 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOMS 201-202

SINK UNDERCOATING

8 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

RECOMMENDATIONS FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

CUSTODIAN ROOM AND BOILER ROOM

BASEBOARD MASTIC

80 LF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

ENTIRE BUILDING

FIRE DOOR CORE INSULATION

210 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

EXTERIOR WALLS

ROUGH WALL

3,200 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

EXTERIOR WALLS

ROUGH WALL SURFACING

3,200 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR
NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

EXTERIOR WINDOWS

CAULKING

200 LF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RESTROOMS

MORTAR MISCELLANEOUS

200 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RESTROOMS, ENTRY WAY TO CLASSROOMS, AND CUSTODIAL ROOM

MORTAR MISCELLANEOUS

560 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

STUDENT RESTROOMS

MORTAR MISCELLANEOUS

300 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	
LOCATION	
MATERIAL TYPE	QTY
RECOMMENDATION	(APPROXIMATE)

CLASSROOMS 301-306 BUILDING (BUILDING 300)

ALL CLASSROOMS AND F.I.S. ROOM

VINYL WALL COVER 29,000 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

ALL CLASSROOMS AND F.I.S. ROOM

VINYL WALL COVER MASTIC 29,000 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

BOYS' AND GIRLS' RESTROOMS AND STORAGE ROOM

MORTAR MISCELLANEOUS 350 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOMS 301-306, F.I.S. AND FOUR STORAGE ROOMS

SUSPENDED CEILING TILE 9,400 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR
NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME**LOCATION****MATERIAL TYPE****RECOMMENDATION****QTY****(APPROXIMATE)**

CLASSROOMS 301-306, F.I.S. AND STORAGE ROOMS**BASEBOARD MASTIC****1,400 LF**

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

CLASSROOMS 301-306, HALLWAY, AND F.I.S.**CARPET MASTIC****7,684 SF**

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

CLASSROOMS 301-308, AND RESTROOMS (2)**MORTAR MISCELLANEOUS****700 SF**

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

ENTIRE BUILDING**CEMENTITIOUS MISCELLANEOUS****70 SF**

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.
-

RECOMMENDATIONS FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

ENTIRE BUILDING

FIRE DOOR CORE INSULATION

672 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

ENTIRE BUILDING INCLUDING RESTROOMS, UTILITY ROOMS AND STORAGE ROOMS

SMOOTH WALL MISCELLANEOUS

37,800 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

ENTIRE BUILDING INCLUDING RESTROOMS, UTILITY ROOMS AND STORAGE ROOMS

SMOOTH WALL SURFACING

37,800 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

EXTERIOR WALLS AND OVERHANG ON RESTROOMS

ROUGH WALL

7,200 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR
NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

EXTERIOR WALLS AND OVERHANG ON RESTROOMS

ROUGH WALL SURFACING

7,200 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

EXTERIOR WINDOWS AND DOORS

CAULKING

900 LF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

FLEXIBLE INSTRUCTIONAL SPACE

VINYL FLOOR TILE

756 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

FLEXIBLE INSTRUCTIONAL SPACE

VINYL FLOOR TILE MASTIC

756 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

RECOMMENDATIONS FOR
NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

TEACHERS' WORK ROOM, AND CLASSROOMS 301-308

SINK UNDERCOATING

28 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

TEACHERS' WORK ROOM, STORAGE ROOMS, AND STAFF RESTROOM

VINYL FLOOR TILE

1,560 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

TEACHERS' WORK ROOM, STORAGE ROOMS, AND STAFF RESTROOM

VINYL FLOOR TILE MASTIC

1,560 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

WATER HEATER ROOM (NEXT TO RESTROOMS) AND JANITOR CLOSET

BASEBOARD MASTIC

15 LF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR
NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

CLASSROOMS 400-406 BUILDING (BUILDING 400)

ALL CLASSROOMS

CARPET MASTIC 7,600 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

ALL CLASSROOMS, AND LIBRARY

SUSPENDED CEILING TILE 8,400 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

ALL ROOMS

BASEBOARD MASTIC 1,400 LF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

ALL ROOMS

BASEBOARD MASTIC 1,400 LF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

RECOMMENDATIONS FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

BOYS AND GIRLS RESTROOMS AND STORAGE ROOM

MORTAR MISCELLANEOUS

350 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOMS, AND LIBRARY

VINYL WALL COVER

29,880 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOMS, AND LIBRARY

VINYL WALL COVER MASTIC

29,880 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

ENTIRE BUILDING

CEMENTITIOUS MISCELLANEOUS

50 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

ENTIRE BUILDING

FIRE DOOR CORE INSULATION

399 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

ENTIRE BUILDING

SMOOTH WALL MISCELLANEOUS

38,100 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

ENTIRE BUILDING

SMOOTH WALL SURFACING

38,100 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

EXTERIOR WALLS, AND OVERHANG OF RESTROOMS

ROUGH WALL

7,200 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR
NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

EXTERIOR WALLS, AND OVERHANG OF RESTROOMS

ROUGH WALL SURFACING

7,200 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

EXTERIOR WINDOWS

CAULKING

900 LF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

LIBRARY (400), CLASSROOMS 401-406, AND RESTROOMS

MORTAR MISCELLANEOUS

700 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

LIBRARY STORAGE

BASEBOARD MASTIC

50 LF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR
NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

LIBRARY STORAGE

VINYL FLOOR TILE

144 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

LIBRARY STORAGE

VINYL FLOOR TILE MASTIC

144 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

TEACHERS' WORK ROOM, AND LIBRARY

SINK UNDERCOATING

24 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

TEACHERS' WORK ROOM, AND TWO STORAGE ROOMS

VINYL FLOOR TILE

2,200 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

RECOMMENDATIONS FOR
NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME**LOCATION****MATERIAL TYPE****RECOMMENDATION****QTY****(APPROXIMATE)**

TEACHERS' WORK ROOM, AND TWO STORAGE ROOMS

VINYL FLOOR TILE MASTIC

2,200 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

WATER HEATER ROOM AND UTILITY CLOSET

BASEBOARD MASTIC

40 LF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOMS 501-506 BUILDING (BUILDING 500)

ALL CLASSROOMS, COMPUTER LAB AND STORAGE ROOMS

BASEBOARD MASTIC

1,400 LF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

BOYS AND GIRLS RESTROOM

MORTAR MISCELLANEOUS

120 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.
-

RECOMMENDATIONS FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

BOYS AND GIRLS RESTROOMS

MORTAR MISCELLANEOUS

600 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

BOYS AND GIRLS RESTROOMS

MORTAR MISCELLANEOUS

416 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOMS 501-504 (AND RESTROOMS), AND CLASSROOMS 505 & 506 (AND RESTROOMS)

MORTAR MISCELLANEOUS

800 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOMS 501-506

SINK UNDERCOATING

20 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR
NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

CLASSROOMS 501-506 AND COMPUTER LAB

VINYL WALL COVER 30,000 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOMS 501-506 AND COMPUTER LAB

VINYL WALL COVER MASTIC 30,000 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOMS 501-506, AND SCIENCE / COMPUTER LAB

CARPET MASTIC 8,500 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

CLASSROOMS 501-506, AND SCIENCE / COMPUTER LAB

CARPET MASTIC 8,500 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

RECOMMENDATIONS FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

CLASSROOMS 501-506, AND SCIENCE / COMPUTER LAB

SUSPENDED CEILING TILE 9,400 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOMS 501-506, STORAGE ROOMS AND COMPUTER LAB

CARPET MASTIC 1,430 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

DATA ROOM AND WORK ROOMS

VINYL FLOOR TILE 400 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

DATA ROOM AND WORK ROOMS

VINYL FLOOR TILE MASTIC 400 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

ENTIRE BUILDING

CEMENTITIOUS MISCELLANEOUS 50 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

ENTIRE BUILDING

FIRE DOOR CORE INSULATION

651 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

ENTIRE BUILDING INCLUDING RESTROOMS, STORAGE ROOMS AND UTILITY ROOMS

SMOOTH WALL MISCELLANEOUS

38,500 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

ENTIRE BUILDING INCLUDING RESTROOMS, STORAGE ROOMS AND UTILITY ROOMS

SMOOTH WALL SURFACING

38,500 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

EXTERIOR WALLS, AND OVERHANG OF RESTROOMS

ROUGH WALL SURFACING

7,200 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR
NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

EXTERIOR WALLS, AND OVERHANGS OF RESTROOMS

ROUGH WALL

7,200 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

EXTERIOR WINDOWS

CAULKING

900 LF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

GIRLS' RESTROOMS

MORTAR MISCELLANEOUS

600 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

WATER HEATER CLOSET AND STORAGE

BASEBOARD MASTIC

50 LF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR
NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

CLASSROOMS 801 PORTABLE BUILDING

CLASSROOM 801

PORTABLE BUILDING

960 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

CLASSROOMS

BASEBOARD MASTIC

350 LF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOMS

SMOOTH WALL MISCELLANEOUS

2,120 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR
NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

CLASSROOMS

SUSPENDED CEILING TILE 2,040 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOMS

VINYL FLOOR TILE 960 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOMS

VINYL FLOOR TILE MASTIC 960 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOMS

VINYL WALL COVER 2,100 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

CLASSROOMS

VINYL WALL COVER MASTIC 2,100 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOMS, OFFICE AND STORAGE ROOM

CARPET MASTIC 150 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

DAYCARE PORTABLE (600)

SINK UNDERCOATING 10 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

ENTIRE BUILDING

FIRE DOOR CORE INSULATION 63 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

FOOD PREPERATION AREA

VINYL SHEETING

90 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

FOOD PREPERATION AREA

VINYL SHEETING BACKING PAPER/MASTIC

90 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RESTROOMS (1 EA BOYS' AND GIRLS'), STAFF ROOM, AND CUSTODIAN ROOM

VINYL SHEETING

140 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RESTROOMS (1 EA BOYS' AND GIRLS'), STAFF ROOM, AND CUSTODIAN ROOM

VINYL SHEETING BACKING PAPER/MASTIC

140 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR
NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

DAYCARE PORTABLE BUILDING - FED CHILDCARE (BUILDING 900)

CLASSROOM

BASEBOARD MASTIC

140 LF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOM

CARPET MASTIC

480 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOM

SUSPENDED CEILING TILE

960 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOM

VINYL WALL COVER

1,800 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR
NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

CLASSROOM

VINYL WALL COVER MASTIC

1,800 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOM 900

VINYL WALL COVER

1,800 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOM 900

VINYL WALL COVER MASTIC

1,800 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOM AND RESTROOMS

VINYL SHEETING

480 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR
NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME**LOCATION****MATERIAL TYPE****RECOMMENDATION****QTY****(APPROXIMATE)**

CLASSROOM AND RESTROOMS

VINYL SHEETING BACKING PAPER/MASTIC

480 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

ENTIRE BUILDING

FIRE DOOR CORE INSULATION

84 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

DAYCARE PORTABLE BUILDING - SDC (BUILDING 800)

PORTABLE DAYCARE - SDC

PORTABLE BUILDING

960 SF

- (a) This is a replacement/new material.
- (b) The district should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the district's AHERA records.

RECOMMENDATIONS FOR
NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

FAMILY RESOURCE CENTER (BUILDING 700)

DAYCARE PORTABLE BUILDING - STATE

PORTABLE BUILDING

1,440 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

METAL STORAGE CONTAINERS (3 EA)

METAL STORAGE CONTAINERS (3 EA)

STORAGE CONTAINER

480 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR
NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

MIDDLE QUAD PATIO

MIDDLE QUAD PATIO

PERMANENT BUILDING

1,600 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

PORTABLE NEXT TO P6 (802)

PORTABLE NEXT TO P6 (802)

PORTABLE BUILDING

900 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

RIGHT AT SCHOOL PORTABLE (CLASSROOM P6) (803)

CLASSROOM 6(803)

PERMANENT BUILDING

960 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

RECOMMENDATIONS FOR
NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

WOOD STORAGE SHEDS (2 EA)

WOOD STORAGE SHEDS (2 EA)

STORAGE BUILDING

170 SF

- (a) This is a replacement/new material.
 - (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
 - (c) This documentation is to be maintained with the District's AHERA records.
-

End Of Report, Total Of 38 Pages

SAMPLES REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

ALL OFFICES, AND HALLWAY TO STAGE
 CARPET MASTIC

<u>16-213AAA</u>	9/15/2016	Negative	NEW MATERIAL	NO SAMPLE	NS
-------------------------	-----------	----------	--------------	-----------	----

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

ATTIC / PLENUM
 PIPE FITTING INSULATION

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

BOOK STORAGE ROOM, CUSTODIAL ROOM, AND PANTRY ROOM
 BASEBOARD MASTIC

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

ENTIRE BUILDING
 FIRE DOOR CORE INSULATION

<u>14-198AAA</u>	8/29/2014	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

ENTIRE BUILDING
 SMOOTH WALL MISCELLANEOUS

<u>10-018 NW-69</u>	2/1/2010	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

Joint Tape

<u>10-018 NW-69</u>	2/1/2010	Positive	2	CHRYSTOTILE	CH
----------------------------	----------	----------	---	-------------	----

Joint Compound

<u>10-018 NW-70</u>	2/1/2010	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

Drywall

<u>10-018 NW-73</u>	2/1/2010	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

Joint Tape

	2/1/2010	Positive	2	CHRYSTOTILE	CH
--	----------	----------	---	-------------	----

Joint Compound

SAMPLES REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
<u>10-018 NW-74</u> Drywall	2/1/2010	Negative	ND	NONE DETECTED	ND
<u>16-030-A07</u> Storage 121, Drywall Board.	1/28/2016	Negative	ND	NONE DETECTED	ND
<u>16-030-A08</u> Storage 121, Joint Mud.	1/28/2016	Positive	5%	CHRYSTILE	CH
<u>16-030-A13</u> MP Room by 122 Door, Drywall.	1/28/2016	Negative	ND	NONE DETECTED	ND
<u>16-030-A13</u> MP Room by 122 Door, Joint Compound.	1/28/2016	Negative	ND	NONE DETECTED	ND

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

ENTIRE BUILDING
SMOOTH WALL SURFACING

<u>10-018 NW-68</u>	2/1/2010	Positive	2	CHRYSTILE	CH
<u>10-018 NW-72</u>	2/1/2010	Negative	ND	NONE DETECTED	ND
<u>16-030-A09</u> Storage 121, Skim Coat -Paint.	1/28/2016	Negative	ND	NONE DETECTED	ND
<u>16-030-A12</u> MP Room by 122 Door, Skim Coat and Mud on Drywall.	1/28/2016	Negative	ND	NONE DETECTED	ND

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

ENTIRE BUILDING EXCEPT CUSTODIAL ROOM AND PANTRY ROOM
BASEBOARD MASTIC

<u>16-213AAA</u>	9/15/2016	Negative	NEW MATERIAL	NO SAMPLE	NS
-------------------------	-----------	----------	--------------	-----------	----

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

EXTERIOR WALLS, AND ALL PERIMETER WALLS IN BACK OF BUILDING (UTILITY YARD FOR TRASH CAN ROOM WASHING AREA)
ROUGH WALL

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

SAMPLES REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

<u>16-030-A10</u>	1/28/2016	Positive	2%	CHRYSTOTILE	CH
Storage 121, Exterior Stucco.					

<u>16-030-A14</u>	1/28/2016	Negative	ND	NONE DETECTED	ND
MP Room Exterior by Door 122, Stucco.					

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

EXTERIOR WALLS, AND ALL PERIMETER WALLS IN BACK OF BUILDING (UTILITY YARD FOR TRASH CAN ROOM WASHING AREA)
ROUGH WALL SURFACING

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

HALLWAY OF CONFERENCE ROOM, CONFERENCE ROOM, STAFF ROOM, DATA EQUIPMENT ROOM, NURSES' ROOM, NURSES' CLOSET, PRINCIPAL'S OFFICE, AND LOBBY
SUSPENDED CEILING TILE

<u>08-241AAA</u>	10/20/2008	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	------------	----------	---------	-----------	----

<u>10-018 NW-71</u>	2/1/2010	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

KITCHEN
VINYL SHEETING

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

Apparent New Material as of this date.

<u>16-030-A04</u>	1/28/2016	Negative	ND	NONE DETECTED	ND
--------------------------	-----------	----------	----	---------------	----

Kitchen 122, Green Vinyl Sheeting.

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

KITCHEN
VINYL SHEETING BACKING PAPER/MASTIC

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

Apparent New Material as of this date.

<u>16-030-A05</u>	1/28/2016	Negative	ND	NONE DETECTED	ND
--------------------------	-----------	----------	----	---------------	----

Kitchen 122, Backing Paper for Green Vinyl Sheeting.

SAMPLES REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE No. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

KITCHEN PANTRY CLOSET
 VINYL FLOOR TILE

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

KITCHEN PANTRY CLOSET
 VINYL FLOOR TILE MASTIC

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

MULTI-PURPOSE ROOM
 SUSPENDED CEILING TILE

<u>08-241AAA</u>	10/20/2008	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	------------	----------	---------	-----------	----

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

MULTI-PURPOSE ROOM, NURSES ROOM, STAFF WORK ROOM, AND SERVING AREA
 VINYL FLOOR TILE

<u>16-213AAA</u>	9/15/2016	Negative	NEW MATERIAL	NO SAMPLE	NS
-------------------------	-----------	----------	--------------	-----------	----

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

MULTI-PURPOSE ROOM, NURSES ROOM, STAFF WORK ROOM, AND SERVING AREA
 VINYL FLOOR TILE MASTIC

<u>16-213AAA</u>	9/15/2016	Negative	NEW MATERIAL	NO SAMPLE	NS
-------------------------	-----------	----------	--------------	-----------	----

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

MULTI-PURPOSE ROOM, OFFICES, AND HALLWAYS
 VINYL WALL COVER

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

MULTI-PURPOSE ROOM, OFFICES, AND HALLWAYS
 VINYL WALL COVER MASTIC

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

SAMPLES REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE No. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

PTA ROOM
 VINYL FLOOR TILE

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

PTA ROOM
 VINYL FLOOR TILE MASTIC

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

STAFF RESTROOMS (2), NURSES' RESTROOM, AND KITCHEN RESTROOM
 MORTAR MISCELLANEOUS

<u>11-202AAA</u>	12/1/2011	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

STAFF RESTROOMS (2), NURSES' RESTROOM, AND KITCHEN RESTROOM
 MORTAR MISCELLANEOUS

<u>11-202AAA</u>	12/1/2011	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

TEACHER'S LOUNGE AND NURSE'S ROOM
 SINK UNDERCOATING

<u>08-241AAA</u>	10/20/2008	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	------------	----------	---------	-----------	----

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

WOMENS RESTROOM
 MORTAR MISCELLANEOUS

<u>15-174AAA</u>	9/18/2015	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

SAMPLES REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

BUS LOOP

BUS LOOP

EXTERIOR WALL

PAPER TYPE INSULATION

<u>09-212AAA</u>	9/8/2009	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

BUS LOOP

EXTERIOR WALL

ROUGH WALL

<u>09-212AAA</u>	9/8/2009	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

BUS LOOP

EXTERIOR WALL

ROUGH WALL SURFACING

<u>09-212AAA</u>	9/8/2009	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

SAMPLES REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

CLASSROOMS 201-202 BUILDING (BUILDING 200)

CLASSROOMS 201-202 BUILDING (BUILDING 200)

ALL ROOMS AND CLOSETS
 BASEBOARD MASTIC

<u>16-213AAA</u>	9/15/2016	Negative	NEW MATERIAL	NO SAMPLE	NS
-------------------------	-----------	----------	--------------	-----------	----

CLASSROOMS 201-202 BUILDING (BUILDING 200)

CLASSROOMS 201 AND 202
 CARPET MASTIC

<u>16-213AAA</u>	9/15/2016	Negative	NEW MATERIAL	NO SAMPLE	NS
-------------------------	-----------	----------	--------------	-----------	----

CLASSROOMS 201-202 BUILDING (BUILDING 200)

CLASSROOMS 201 AND 202
 SUSPENDED CEILING TILE

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

<u>10-018 NW-61</u>	2/1/2010	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

CLASSROOMS 201-202 BUILDING (BUILDING 200)

CLASSROOMS 201 AND 202
 VINYL WALL COVER

<u>06-223AAA</u>	8/25/2006	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS 201-202 BUILDING (BUILDING 200)

CLASSROOMS 201 AND 202
 VINYL WALL COVER MASTIC

<u>06-223AAA</u>	8/25/2006	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS 201-202 BUILDING (BUILDING 200)

CLASSROOMS 201 AND 202, RESTROOMS, STORAGE ROOMS AND UTILITY ROOMS
 SMOOTH WALL MISCELLANEOUS

<u>10-018 NW-63</u>	2/1/2010	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

Joint Tape

<u>10-018 NW-63</u>	2/1/2010	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

Joint Compound

SAMPLES REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

<u>10-018 NW-64</u> Drywall	2/1/2010	Negative	ND	NONE DETECTED	ND
---------------------------------------	----------	----------	----	---------------	----

<u>10-018 NW-66</u> Joint Tape	2/1/2010	Negative	ND	NONE DETECTED	ND
--	----------	----------	----	---------------	----

<u>10-018 NW-66</u> Joint Compound	2/1/2010	Positive	2	CHRYSTOTILE	CH
--	----------	----------	---	-------------	----

<u>10-018 NW-67</u> Drywall	2/1/2010	Negative	ND	NONE DETECTED	ND
---------------------------------------	----------	----------	----	---------------	----

CLASSROOMS 201-202 BUILDING (BUILDING 200)

CLASSROOMS 201 AND 202, RESTROOMS, STORAGE ROOMS AND UTILITY ROOMS
 SMOOTH WALL SURFACING

<u>10-018 NW-62</u>	2/1/2010	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

<u>10-018 NW-65</u>	2/1/2010	Positive	2	CHRYSTOTILE	CH
----------------------------	----------	----------	---	-------------	----

CLASSROOMS 201-202 BUILDING (BUILDING 200)

CLASSROOMS 201 AND 202 WET / SINK AREAS AND STORAGE ROOMS
 VINYL FLOOR TILE

<u>16-203AAA</u>	9/15/2016	Negative	NEW MATERIAL	NO SAMPLE	NS
-------------------------	-----------	----------	--------------	-----------	----

CLASSROOMS 201-202 BUILDING (BUILDING 200)

CLASSROOMS 201 AND 202 WET / SINK AREAS AND STORAGE ROOMS
 VINYL FLOOR TILE

<u>22-094.NS</u>	8/19/2022	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS 201-202 BUILDING (BUILDING 200)

CLASSROOMS 201 AND 202 WET / SINK AREAS AND STORAGE ROOMS
 VINYL FLOOR TILE MASTIC

<u>16-203AAA</u>	9/15/2016	Negative	NEW MATERIAL	NO SAMPLE	NS
-------------------------	-----------	----------	--------------	-----------	----

CLASSROOMS 201-202 BUILDING (BUILDING 200)

CLASSROOMS 201 AND 202 WET / SINK AREAS AND STORAGE ROOMS
 VINYL FLOOR TILE MASTIC

<u>22-094.NS</u>	8/19/2022	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

SAMPLES REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

CLASSROOMS 201-202 BUILDING (BUILDING 200)

CLASSROOMS 201-202
 SINK UNDERCOATING

<u>08-241AAA</u>	10/20/2008	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	------------	----------	---------	-----------	----

CLASSROOMS 201-202 BUILDING (BUILDING 200)

CUSTODIAN ROOM AND BOILER ROOM
 BASEBOARD MASTIC

<u>08-241AAA</u>	10/20/2008	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	------------	----------	---------	-----------	----

CLASSROOMS 201-202 BUILDING (BUILDING 200)

ENTIRE BUILDING
 FIRE DOOR CORE INSULATION

<u>14-198AAA</u>	8/29/2014	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS 201-202 BUILDING (BUILDING 200)

EXTERIOR WALLS
 ROUGH WALL

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

<u>16-030-A18</u>	1/28/2016	Negative	ND	NONE DETECTED	ND
--------------------------	-----------	----------	----	---------------	----

Exterior Wall by Drinking Fountain, Stucco.

CLASSROOMS 201-202 BUILDING (BUILDING 200)

EXTERIOR WALLS
 ROUGH WALL SURFACING

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS 201-202 BUILDING (BUILDING 200)

EXTERIOR WINDOWS
 CAULKING

<u>09-212AAA</u>	9/8/2009	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

CLASSROOMS 201-202 BUILDING (BUILDING 200)

RESTROOMS
 MORTAR MISCELLANEOUS

<u>09-098AAA</u>	5/14/2009	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

SAMPLES REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

16-030-A22

1/28/2016

Negative

ND

NONE DETECTED

ND

Classroom 202, Grout for 8"x8" Ceramic Floor Tile.

CLASSROOMS 201-202 BUILDING (BUILDING 200)

RESTROOMS, ENTRY WAY TO CLASSROOMS, AND CUSTODIAL ROOM

MORTAR MISCELLANEOUS

08-241AAA

10/20/2008

Positive

ASSUMED

NO SAMPLE

NS

CLASSROOMS 201-202 BUILDING (BUILDING 200)

STUDENT RESTROOMS

MORTAR MISCELLANEOUS

15-174AAA

9/18/2015

Positive

ASSUMED

NO SAMPLE

NS

SAMPLES REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

CLASSROOMS 301-306 BUILDING (BUILDING 300)

CLASSROOMS 301-306 BUILDING (BUILDING 300)

ALL CLASSROOMS AND F.I.S. ROOM
 VINYL WALL COVER

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

<u>16-030-A36</u>	1/28/2016	Negative	ND	NONE DETECTED	ND
--------------------------	-----------	----------	----	---------------	----

Room 303, Demising Wall, Vinyl Cover on Sheetrock Wall.

CLASSROOMS 301-306 BUILDING (BUILDING 300)

ALL CLASSROOMS AND F.I.S. ROOM
 VINYL WALL COVER MASTIC

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS 301-306 BUILDING (BUILDING 300)

BOYS' AND GIRLS' RESTROOMS AND STORAGE ROOM
 MORTAR MISCELLANEOUS

<u>08-241AAA</u>	10/14/2008	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	------------	----------	---------	-----------	----

CLASSROOMS 301-306 BUILDING (BUILDING 300)

CLASSROOMS 301-306, F.I.S. AND FOUR STORAGE ROOMS
 SUSPENDED CEILING TILE

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

<u>10-018 NW-75</u>	2/1/2010	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

<u>16-030-A26</u>	1/28/2016	Negative	ND	NONE DETECTED	ND
--------------------------	-----------	----------	----	---------------	----

Workroom 304, 2'x4' Suspended Ceiling Tile.

CLASSROOMS 301-306 BUILDING (BUILDING 300)

CLASSROOMS 301-306, F.I.S. AND STORAGE ROOMS
 BASEBOARD MASTIC

<u>16-203AAA</u>	9/15/2016	Negative	NEW MATERIAL	NO SAMPLE	NS
-------------------------	-----------	----------	--------------	-----------	----

SAMPLES REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

CLASSROOMS 301-306 BUILDING (BUILDING 300)

CLASSROOMS 301-306, HALLWAY, AND F.I.S.

CARPET MASTIC

<u>16-213AAA</u>	9/15/2016	Negative	NEW MATERIAL	NO SAMPLE	NS
-------------------------	-----------	----------	--------------	-----------	----

CLASSROOMS 301-306 BUILDING (BUILDING 300)

CLASSROOMS 301-308, AND RESTROOMS (2)

MORTAR MISCELLANEOUS

<u>10-174AAA</u>	9/2/2010	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

<u>16-030-A25</u>	1/28/2016	Negative	ND	NONE DETECTED	ND
--------------------------	-----------	----------	----	---------------	----

Room 310, Grout for 8"x8" Ceramic Floor Tile.

CLASSROOMS 301-306 BUILDING (BUILDING 300)

ENTIRE BUILDING

CEMENTITIOUS MISCELLANEOUS

<u>14-198AAA</u>	8/29/2014	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS 301-306 BUILDING (BUILDING 300)

ENTIRE BUILDING

FIRE DOOR CORE INSULATION

<u>14-198AAA</u>	8/29/2014	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS 301-306 BUILDING (BUILDING 300)

ENTIRE BUILDING INCLUDING RESTROOMS, UTILITY ROOMS AND STORAGE ROOMS

SMOOTH WALL MISCELLANEOUS

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

<u>10-018 NW-77</u>	2/1/2010	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

Joint Tape

<u>10-018 NW-77</u>	2/1/2010	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

Joint Compound

<u>10-018 NW-78</u>	2/1/2010	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

Walboard

SAMPLES REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

<u>16-030-A31</u>	1/28/2016	Negative	ND	NONE DETECTED	ND
Workroom 304, Wallboard.					

<u>16-030-A32</u>	1/28/2016	Negative	ND	NONE DETECTED	ND
Workroom 304, Joint Compound.					

<u>16-030-A35</u>	1/28/2016	Negative	ND	NONE DETECTED	ND
Room 303, Demising Wall, Sheetrock Wall.					

CLASSROOMS 301-306 BUILDING (BUILDING 300)

ENTIRE BUILDING INCLUDING RESTROOMS, UTILITY ROOMS AND STORAGE ROOMS
 SMOOTH WALL SURFACING

<u>06-223AAA</u>	8/25/2006	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

<u>10-018 NW-76</u>	2/1/2010	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

CLASSROOMS 301-306 BUILDING (BUILDING 300)

EXTERIOR WALLS AND OVERHANG ON RESTROOMS
 ROUGH WALL

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

<u>16-030-A33</u>	1/28/2016	Negative	ND	NONE DETECTED	ND
Exterior by Drinking Fountain, Stucco Wall.					

CLASSROOMS 301-306 BUILDING (BUILDING 300)

EXTERIOR WALLS AND OVERHANG ON RESTROOMS
 ROUGH WALL SURFACING

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS 301-306 BUILDING (BUILDING 300)

EXTERIOR WINDOWS AND DOORS
 CAULKING

<u>09-212AAA</u>	9/8/2009	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

<u>16-030-A34</u>	1/28/2016	Negative	ND	NONE DETECTED	ND
Exterior Door by 304, Interior side, Door Frame Caulking.					

SAMPLES REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

CLASSROOMS 301-306 BUILDING (BUILDING 300)

FLEXIBLE INSTRUCTIONAL SPACE

VINYL FLOOR TILE

<u>16-213AAA</u>	9/15/2016	Negative	NEW MATERIAL	NO SAMPLE	NS
-------------------------	-----------	----------	--------------	-----------	----

CLASSROOMS 301-306 BUILDING (BUILDING 300)

FLEXIBLE INSTRUCTIONAL SPACE

VINYL FLOOR TILE MASTIC

<u>16-213AAA</u>	9/15/2016	Negative	NEW MATERIAL	NO SAMPLE	NS
-------------------------	-----------	----------	--------------	-----------	----

CLASSROOMS 301-306 BUILDING (BUILDING 300)

TEACHERS' WORK ROOM, AND CLASSROOMS 301-308

SINK UNDERCOATING

<u>08-241AAA</u>	10/14/2008	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	------------	----------	---------	-----------	----

<u>16-030-A30</u>	1/28/2016	Negative	ND	NONE DETECTED	ND
--------------------------	-----------	----------	----	---------------	----

Workroom 304, Gray Thermal Undercoating on Sink.

CLASSROOMS 301-306 BUILDING (BUILDING 300)

TEACHERS' WORK ROOM, STORAGE ROOMS, AND STAFF RESTROOM

VINYL FLOOR TILE

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

<u>16-030-A27</u>	1/28/2016	Negative	ND	NONE DETECTED	ND
--------------------------	-----------	----------	----	---------------	----

Workroom 304, Green 12"x12" Vinyl Floor Tile.

CLASSROOMS 301-306 BUILDING (BUILDING 300)

TEACHERS' WORK ROOM, STORAGE ROOMS, AND STAFF RESTROOM

VINYL FLOOR TILE MASTIC

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

<u>16-030-A28</u>	1/28/2016	Negative	ND	NONE DETECTED	ND
--------------------------	-----------	----------	----	---------------	----

Workroom 304, Yellow Mastic for Green 12"x12" Vinyl Floor Tile.

CLASSROOMS 301-306 BUILDING (BUILDING 300)

WATER HEATER ROOM (NEXT TO RESTROOMS) AND JANITOR CLOSET

BASEBOARD MASTIC

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

SAMPLES REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

CLASSROOMS 400-406 BUILDING (BUILDING 400)

CLASSROOMS 400-406 BUILDING (BUILDING 400)

ALL CLASSROOMS
 CARPET MASTIC

<u>16-213AAA</u>	9/15/2016	Negative	NEW MATERIAL	NO SAMPLE	NS
-------------------------	-----------	----------	--------------	-----------	----

CLASSROOMS 400-406 BUILDING (BUILDING 400)

ALL CLASSROOMS, AND LIBRARY
 SUSPENDED CEILING TILE

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

<u>10-018 NW-57</u>	2/1/2010	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

CLASSROOMS 400-406 BUILDING (BUILDING 400)

ALL ROOMS
 BASEBOARD MASTIC

<u>16-213AAA</u>	9/15/2016	Negative	NEW MATERIAL	NO SAMPLE	NS
-------------------------	-----------	----------	--------------	-----------	----

CLASSROOMS 400-406 BUILDING (BUILDING 400)

ALL ROOMS
 BASEBOARD MASTIC

<u>22-094.NS</u>	8/19/2022	Negative	NEW MATERIAL	NO SAMPLE	NS
-------------------------	-----------	----------	--------------	-----------	----

CLASSROOMS 400-406 BUILDING (BUILDING 400)

BOYS AND GIRLS RESTROOMS AND STORAGE ROOM
 MORTAR MISCELLANEOUS

<u>14-051AAA</u>	3/7/2014	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

CLASSROOMS 400-406 BUILDING (BUILDING 400)

CLASSROOMS, AND LIBRARY
 VINYL WALL COVER

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

<u>16-030-A39</u>	1/28/2016	Negative	ND	NONE DETECTED	ND
--------------------------	-----------	----------	----	---------------	----

Library (403), Vinyl Cover on Pressed Wood Wall Panel.

SAMPLES REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

CLASSROOMS 400-406 BUILDING (BUILDING 400)

CLASSROOMS, AND LIBRARY
 VINYL WALL COVER MASTIC

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS 400-406 BUILDING (BUILDING 400)

ENTIRE BUILDING
 CEMENTITIOUS MISCELLANEOUS

<u>14-18AAA</u>	8/29/2014	Positive	ASSUMED	NO SAMPLE	NS
------------------------	-----------	----------	---------	-----------	----

CLASSROOMS 400-406 BUILDING (BUILDING 400)

ENTIRE BUILDING
 FIRE DOOR CORE INSULATION

<u>14-198AAA</u>	8/29/2014	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS 400-406 BUILDING (BUILDING 400)

ENTIRE BUILDING
 SMOOTH WALL MISCELLANEOUS

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

<u>10-018 NW-59</u>	2/1/2010	Negative	ND	NONE DETECTED	ND
Joint Tape					

<u>10-018 NW-59</u>	2/1/2010	Negative	ND	NONE DETECTED	ND
Joint Compound					

<u>10-018 NW-60</u>	2/1/2010	Negative	ND	NONE DETECTED	ND
Drywall					

CLASSROOMS 400-406 BUILDING (BUILDING 400)

ENTIRE BUILDING
 SMOOTH WALL SURFACING

<u>06-223AAA</u>	8/25/2006	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS 400-406 BUILDING (BUILDING 400)

EXTERIOR WALLS, AND OVERHANG OF RESTROOMS
 ROUGH WALL

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

SAMPLES REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

CLASSROOMS 400-406 BUILDING (BUILDING 400)

EXTERIOR WALLS, AND OVERHANG OF RESTROOMS
 ROUGH WALL SURFACING

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS 400-406 BUILDING (BUILDING 400)

EXTERIOR WINDOWS
 CAULKING

<u>09-212AAA</u>	9/8/2009	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

CLASSROOMS 400-406 BUILDING (BUILDING 400)

LIBRARY (400), CLASSROOMS 401-406, AND RESTROOMS
 MORTAR MISCELLANEOUS

<u>10-174AAA</u>	9/2/2010	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

<u>16-030-A37</u>	1/28/2016	Negative	ND	NONE DETECTED	ND
--------------------------	-----------	----------	----	---------------	----

Library, Grout for 8"x8" Ceramic Floor Tile.

CLASSROOMS 400-406 BUILDING (BUILDING 400)

LIBRARY STORAGE
 BASEBOARD MASTIC

<u>08-241AAA</u>	10/20/2008	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	------------	----------	---------	-----------	----

CLASSROOMS 400-406 BUILDING (BUILDING 400)

LIBRARY STORAGE
 VINYL FLOOR TILE

<u>08-241AAA</u>	10/20/2008	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	------------	----------	---------	-----------	----

CLASSROOMS 400-406 BUILDING (BUILDING 400)

LIBRARY STORAGE
 VINYL FLOOR TILE MASTIC

<u>08-241AAA</u>	10/20/2008	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	------------	----------	---------	-----------	----

CLASSROOMS 400-406 BUILDING (BUILDING 400)

TEACHERS' WORK ROOM, AND LIBRARY
 SINK UNDERCOATING

<u>08-241AAA</u>	10/20/2008	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	------------	----------	---------	-----------	----

SAMPLES REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE No. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

CLASSROOMS 400-406 BUILDING (BUILDING 400)

TEACHERS' WORK ROOM, AND TWO STORAGE ROOMS

VINYL FLOOR TILE

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

Apparent New Material as of this date.

CLASSROOMS 400-406 BUILDING (BUILDING 400)

TEACHERS' WORK ROOM, AND TWO STORAGE ROOMS

VINYL FLOOR TILE MASTIC

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

Apparent New Material as of this date.

CLASSROOMS 400-406 BUILDING (BUILDING 400)

WATER HEATER ROOM AND UTILITY CLOSET

BASEBOARD MASTIC

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

SAMPLES REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

CLASSROOMS 501-506 BUILDING (BUILDING 500)

CLASSROOMS 501-506 BUILDING (BUILDING 500)

ALL CLASSROOMS, COMPUTER LAB AND STORAGE ROOMS
 BASEBOARD MASTIC

<u>16-213AAA</u>	9/15/2016	Negative	NEW MATERIAL	NO SAMPLE	NS
-------------------------	-----------	----------	--------------	-----------	----

CLASSROOMS 501-506 BUILDING (BUILDING 500)

BOYS AND GIRLS RESTROOM
 MORTAR MISCELLANEOUS

<u>17-059AAA</u>	4/3/2017	Negative	ND	NO SAMPLE	NS
-------------------------	----------	----------	----	-----------	----

CLASSROOMS 501-506 BUILDING (BUILDING 500)

BOYS AND GIRLS RESTROOMS
 MORTAR MISCELLANEOUS

<u>08-241AAA</u>	10/20/2008	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	------------	----------	---------	-----------	----

CLASSROOMS 501-506 BUILDING (BUILDING 500)

BOYS AND GIRLS RESTROOMS
 MORTAR MISCELLANEOUS

<u>08-241AAA</u>	10/20/2008	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	------------	----------	---------	-----------	----

CLASSROOMS 501-506 BUILDING (BUILDING 500)

CLASSROOMS 501-504 (AND RESTROOMS), AND CLASSROOMS 505 & 506 (AND RESTROOMS)
 MORTAR MISCELLANEOUS

<u>10-174AAA</u>	9/2/2010	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

<u>16-030-A43</u>	1/28/2016	Negative	ND	NONE DETECTED	ND
--------------------------	-----------	----------	----	---------------	----

Room 517, Mortar for Red 8"x8" Ceramic Floor Tile.

CLASSROOMS 501-506 BUILDING (BUILDING 500)

CLASSROOMS 501-506
 SINK UNDERCOATING

<u>08-241AAA</u>	10/20/2008	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	------------	----------	---------	-----------	----

SAMPLES REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

CLASSROOMS 501-506 BUILDING (BUILDING 500)

CLASSROOMS 501-506 AND COMPUTER LAB
 VINYL WALL COVER

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS 501-506 BUILDING (BUILDING 500)

CLASSROOMS 501-506 AND COMPUTER LAB
 VINYL WALL COVER MASTIC

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS 501-506 BUILDING (BUILDING 500)

CLASSROOMS 501-506, AND SCIENCE / COMPUTER LAB
 CARPET MASTIC

<u>16-213AAA</u>	9/15/2016	Negative	NEW MATERIAL	NO SAMPLE	NS
-------------------------	-----------	----------	--------------	-----------	----

CLASSROOMS 501-506 BUILDING (BUILDING 500)

CLASSROOMS 501-506, AND SCIENCE / COMPUTER LAB
 CARPET MASTIC

<u>22-094.NS</u>	8/19/2022	Negative	NEW MATERIAL	NO SAMPLE	NS
-------------------------	-----------	----------	--------------	-----------	----

CLASSROOMS 501-506 BUILDING (BUILDING 500)

CLASSROOMS 501-506, AND SCIENCE / COMPUTER LAB
 SUSPENDED CEILING TILE

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

<u>10-018 NW-53</u>	2/1/2010	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

CLASSROOMS 501-506 BUILDING (BUILDING 500)

CLASSROOMS 501-506, STORAGE ROOMS AND COMPUTER LAB
 CARPET MASTIC

<u>22-094.NS</u>	8/19/2022	Negative	NEW MATERIAL	NO SAMPLE	NS
-------------------------	-----------	----------	--------------	-----------	----

CLASSROOMS 501-506 BUILDING (BUILDING 500)

DATA ROOM AND WORK ROOMS
 VINYL FLOOR TILE

-----	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------	-----------	----------	---------	-----------	----

Apparent New Material as of this date.

SAMPLES REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

<u>16-030-A44</u>	1/28/2016	Negative	ND	NONE DETECTED	ND
--------------------------	-----------	----------	----	---------------	----

Room 507, 12"x12" Green Vinyl Floor Tile.

CLASSROOMS 501-506 BUILDING (BUILDING 500)

DATA ROOM AND WORK ROOMS
 VINYL FLOOR TILE MASTIC

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

Apparent New Material as of this date.

<u>16-030-A45</u>	1/28/2016	Negative	ND	NONE DETECTED	ND
--------------------------	-----------	----------	----	---------------	----

Room 507, Mastic for 12"x12" Green Vinyl Floor Tile.

CLASSROOMS 501-506 BUILDING (BUILDING 500)

ENTIRE BUILDING
 CEMENTITIOUS MISCELLANEOUS

<u>14-198AAA</u>	8/29/2014	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS 501-506 BUILDING (BUILDING 500)

ENTIRE BUILDING
 FIRE DOOR CORE INSULATION

<u>14-198AAA</u>	8/29/2014	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS 501-506 BUILDING (BUILDING 500)

ENTIRE BUILDING INCLUDING RESTROOMS, STORAGE ROOMS AND UTILITY ROOMS
 SMOOTH WALL MISCELLANEOUS

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

<u>10-018 NW-55</u>	2/1/2010	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

Joint Tape

<u>10-018 NW-55</u>	2/1/2010	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

Joint Compound

<u>10-018 NW-56</u>	2/1/2010	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

Drywall

SAMPLES REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

CLASSROOMS 501-506 BUILDING (BUILDING 500)

ENTIRE BUILDING INCLUDING RESTROOMS, STORAGE ROOMS AND UTILITY ROOMS
 SMOOTH WALL SURFACING

<u>06-223AAA</u>	8/25/2006	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS 501-506 BUILDING (BUILDING 500)

EXTERIOR WALLS, AND OVERHANG OF RESTROOMS
 ROUGH WALL SURFACING

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS 501-506 BUILDING (BUILDING 500)

EXTERIOR WALLS, AND OVERHANGS OF RESTROOMS
 ROUGH WALL

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS 501-506 BUILDING (BUILDING 500)

EXTERIOR WINDOWS
 CAULKING

<u>09-212AAA</u>	9/8/2009	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

CLASSROOMS 501-506 BUILDING (BUILDING 500)

GIRLS' RESTROOMS
 MORTAR MISCELLANEOUS

<u>08-241AAA</u>	10/20/2008	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	------------	----------	---------	-----------	----

CLASSROOMS 501-506 BUILDING (BUILDING 500)

WATER HEATER CLOSET AND STORAGE
 BASEBOARD MASTIC

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

SAMPLES REPORT FOR
NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE No. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

CLASSROOMS 801 PORTABLE BUILDING
CLASSROOMS 801 PORTABLE BUILDING

CLASSROOM 801
PORTABLE BUILDING

08-241AAA	10/20/2008	Negative	NEW MATERIAL	NO SAMPLE	NS
New 2008 Construction Relocatable Building per Manufacturer's Tag information.					

SAMPLES REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

CLASSROOMS

BASEBOARD MASTIC

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

CLASSROOMS

SMOOTH WALL MISCELLANEOUS

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

CLASSROOMS

SUSPENDED CEILING TILE

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

CLASSROOMS

VINYL FLOOR TILE

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

CLASSROOMS

VINYL FLOOR TILE MASTIC

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

CLASSROOMS

VINYL WALL COVER

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

CLASSROOMS

VINYL WALL COVER MASTIC

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

SAMPLES REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

CLASSROOMS, OFFICE AND STORAGE ROOM

CARPET MASTIC

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

DAYCARE PORTABLE (600)

SINK UNDERCOATING

<u>10-174AAA</u>	9/2/2010	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

ENTIRE BUILDING

FIRE DOOR CORE INSULATION

<u>14-198AAA</u>	8/29/2014	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

FOOD PREPERATION AREA

VINYL SHEETING

<u>15-042AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

FOOD PREPERATION AREA

VINYL SHEETING BACKING PAPER/MASTIC

<u>15-042AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

RESTROOMS (1 EA BOYS' AND GIRLS'), STAFF ROOM, AND CUSTODIAN ROOM

VINYL SHEETING

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

RESTROOMS (1 EA BOYS' AND GIRLS'), STAFF ROOM, AND CUSTODIAN ROOM

VINYL SHEETING BACKING PAPER/MASTIC

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

SAMPLES REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

DAYCARE PORTABLE BUILDING - FED CHILDCARE (BUILDING 900)

DAYCARE PORTABLE BUILDING - FED CHILDCARE (BUILDING 900)

CLASSROOM

BASEBOARD MASTIC

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

DAYCARE PORTABLE BUILDING - FED CHILDCARE (BUILDING 900)

CLASSROOM

CARPET MASTIC

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

DAYCARE PORTABLE BUILDING - FED CHILDCARE (BUILDING 900)

CLASSROOM

SUSPENDED CEILING TILE

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

DAYCARE PORTABLE BUILDING - FED CHILDCARE (BUILDING 900)

CLASSROOM

VINYL WALL COVER

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

DAYCARE PORTABLE BUILDING - FED CHILDCARE (BUILDING 900)

CLASSROOM

VINYL WALL COVER MASTIC

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

DAYCARE PORTABLE BUILDING - FED CHILDCARE (BUILDING 900)

CLASSROOM 900

VINYL WALL COVER

<u>10-052AAA</u>	3/10/2010	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

DAYCARE PORTABLE BUILDING - FED CHILDCARE (BUILDING 900)

CLASSROOM 900

VINYL WALL COVER MASTIC

<u>10-052AAA</u>	3/10/2010	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

SAMPLES REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

DAYCARE PORTABLE BUILDING - FED CHILDCARE (BUILDING 900)

CLASSROOM AND RESTROOMS

VINYL SHEETING

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

DAYCARE PORTABLE BUILDING - FED CHILDCARE (BUILDING 900)

CLASSROOM AND RESTROOMS

VINYL SHEETING BACKING PAPER/MASTIC

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

DAYCARE PORTABLE BUILDING - FED CHILDCARE (BUILDING 900)

ENTIRE BUILDING

FIRE DOOR CORE INSULATION

<u>14-198AAA</u>	8/29/2014	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

SAMPLES REPORT FOR
NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

DAYCARE PORTABLE BUILDING - SDC (BUILDING 800)

DAYCARE PORTABLE BUILDING - SDC (BUILDING 800)

PORTABLE DAYCARE - SDC
PORTABLE BUILDING

05-212.NS	9/14/2005	Negative	NEW MATERIAL	NO SAMPLE	NS
New 1996 Construction Relocatable Building per Manufacturer's Tag information.					

SAMPLES REPORT FOR
NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE No.	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
COMMENTS					

FAMILY RESOURCE CENTER (BUILDING 700)

FAMILY RESOURCE CENTER (BUILDING 700)

DAYCARE PORTABLE BUILDING - STATE

PORTABLE BUILDING

08-075AAA

4/21/2008

Negative

NEW MATERIAL

NO SAMPLE

NS

New 2007 Construction Relocatable Building per Manufacturer's Tag information.

SAMPLES REPORT FOR
NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

METAL STORAGE CONTAINERS (3 EA)

METAL STORAGE CONTAINERS (3 EA)

METAL STORAGE CONTAINERS (3 EA)
STORAGE CONTAINER

16-074.NS	3/21/2016	Positive	ASSUMED	NO SAMPLE	NS
Metal Storage Structure.					

SAMPLES REPORT FOR
NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

MIDDLE QUAD PATIO

MIDDLE QUAD PATIO

MIDDLE QUAD PATIO
PERMANENT BUILDING

15-174.NS	9/18/2015	Negative	NEW MATERIAL	NO SAMPLE	NS
Apparent New Metal and Concrete Construction Building.					

SAMPLES REPORT FOR
NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

PORTABLE NEXT TO P6 (802)

PORTABLE NEXT TO P6 (802)

PORTABLE NEXT TO P6 (802)
PORTABLE BUILDING

<u>19-011AAA</u>	2/8/2019	Negative	NEW MATERIAL	NO SAMPLE	NS
-------------------------	----------	----------	--------------	-----------	----

SAMPLES REPORT FOR
NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

RIGHT AT SCHOOL PORTABLE (CLASSROOM P6) (803)

RIGHT AT SCHOOL PORTABLE (CLASSROOM P6) (803)

CLASSROOM 6(803)
PERMANENT BUILDING

<u>19-011AAA</u>	2/8/2019	Negative	NEW MATERIAL	NO SAMPLE	NS
-------------------------	----------	----------	--------------	-----------	----

SAMPLES REPORT FOR
NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

WOOD STORAGE SHEDS (2 EA)

WOOD STORAGE SHEDS (2 EA)

WOOD STORAGE SHEDS (2 EA)
STORAGE BUILDING

09-098AAA	5/14/2009	Negative	NEW MATERIAL	NO SAMPLE	NS
------------------	-----------	----------	--------------	-----------	----

Wood Construction Structures.

End Of Report, Total Of 34 Pages

DAMAGE REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
RISK ASSESMENT CATEGORY	COMMENTS			

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

BOOK STORAGE ROOM, CUSTODIAL ROOM, AND PANTRY ROOM

BASEBOARD MASTIC

116 LF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/14/2005	Mastic/Adhesive for 4" Brown Baseboard. This Material is in GOOD condition as of this date.
08/25/2006	Book Storage Room added to Location. 30 LF added to quantity. Location Name changed from CUSTODIAL ROOM, AND PANTRY ROOM to BOOK STORAGE ROOM, CUSTODIAL ROOM, AND PANTRY ROOM. Quantity changed from 86 LF to 116 LF to reflect this fact. No other changes as of this date.
04/03/2017	Damage Observed. <5% Physical Damage - in the form of 1 LF Damage and Missing Baseboard in Book Storage Room. Material condition changed from GOOD to FAIR overall. Friability changed from Non to Low. No other changes as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.
08/19/2022	This Material is unchanged as of this date.
02/17/2023	This Material is unchanged as of this date.
08/18/2023	This Material is unchanged as of this date.
02/16/2024	This Material is unchanged as of this date.

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

ENTIRE BUILDING

SMOOTH WALL MISCELLANEOUS

24,500 SF

P: Less Than 5%

W: <10% Stains or Flaking

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/14/2005	Gypsum Wallboard System. (Material also exists behind Vinyl Covered Wall Panels in some areas). Damage: <5% Physical Damage - in exterior Water Heater Room; <10% Water Damage - in exterior Water Heater Room. This Material is in FAIR condition overall as of this date.
03/09/2007	Damage: <10% Water Damage - approximately 20 SF in Kitchen. Condition changed to reflect this fact. No other changes as of this date.

DAMAGE REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME		QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
LOCATION	MATERIAL TYPE		
RISK ASSESMENT CATEGORY			
COMMENTS			
11/09/2007	This Material in POOR condition in Water Heater Room. This Material is in FAIR condition overall as of this date.		
04/21/2008	Damage in the Water Heater Room is on all Walls. No other changes as of this date.		
10/20/2008	Exterior Water Heater Room has 3/4 of Ceiling missing. <10% Water Damage. No other changes as of this date.		
05/14/2009	Additional Damage observed. 2 SF is Water Damaged in the Pantry by the Exhaust. Material is cracked on the East and South Walls of the Book Storage Room/ Conference Room (Old Custodial Room). No other changes as of this date.		
09/08/2009	Material remains in <5% Physical Damage and <10% Water Damage. This Material is unchanged as of this date.		
02/01/2010	Samples 10-019 NW-69 (Joint Tape / Compound), NW-70 (Drywall) , NW-73 (Joint Tape / Compound) and NW-74 (Drywall) collected on this date.		
09/18/2015	Additional Damage observed. Pantry by Exhaust has minor cuts and holes. No other change as of this date.		
01/28/2016	Sample 16-030-A07 collected from Storage 121, Drywall Board. Sample 16-030-A08 collected from Storage 121, Joint Mud. Sample 16-030-A13 collected from Multi-purpose Room by 122 Door, Drywall.		
09/15/2016	Partial Repairs observed. Damages noted on 05/14/09 have been covered with a Vinyl Panel. No other changes as of this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	Additional Damage Observed. <5% Physical Damage in the form of 1.5 SF of Missing and Peeling Skimcoat and Mud as well as a 3 LF Water Leak on the Ceiling by West Wall of Mens Staff Restroom. Material remains in FAIR condition overall. No other changes as of this date.		
02/16/2024	This Material is unchanged as of this date.		

DAMAGE REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESSMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	--------------------------	----------	----------------------	---

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

ENTIRE BUILDING

SMOOTH WALL SURFACING

24,500 SF

P: Less Than 5%

W: <10% Stains or Flaking

DAMAGED FRIABLE SURFACING ACM

08/25/2006	Skim Coat for Gypsum Wallboard System. (Material also exists behind Vinyl Covered Wall Panels in some areas). Damages noted in exterior Water Heater Room. This Material is in FAIR condition overall as of this date.
03/09/2007	Damage: <10% Water Damage - approximately 20 SF in in Kitchen. Condition changed to reflect this fact. No other changes as of this date.
11/09/2007	This Material in POOR condition in Water Heater Room. This Material is in FAIR condition overall as of this date.
10/20/2008	Exterior Water Heater Room has 3/4 of Ceiling is missing. <10% Water Damage. No other changes as of this date.
05/14/2009	Additional Damage observed. 2 SF is Water Damaged in the Pantry by the Exhaust. Material is cracked on the East and South Walls of the Book Storage Room/ Conference Room (Old Custodial Room). No other changes as of this date.
09/08/2009	Material remains in <5% Physical Damage and <10% Water Damage. This Material is unchanged as of this date.
02/01/2010	Samples 10-019 NW-68 and NW-72 collected on this date.
09/18/2015	Additional Damage observed. Pantry by Exhaust has minor cuts and holes. No other change as of this date.
01/28/2016	Sample 16-030-A09 collected from Storage 121, Paint. Sample 16-030-A12 collected from MP Room by 122 Door, Skim Coat and Mud on Drywall.
09/15/2016	Partial Repairs observed. Damages noted on 05/14/09 have been covered with a Vinyl Panel. No other changes as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.
08/19/2022	This Material is unchanged as of this date.
02/17/2023	This Material is unchanged as of this date.

DAMAGE REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

08/18/2023 Additional Damage Observed. <5% Physical Damage in the form of 1.5 SF of Missing and Peeling Skimcoat and Mud as well as a 3 LF Water Leak on the Ceiling by West Wall of Mens Staff Restroom. Material remains in FAIR condition overall. No other changes as of this date.

02/16/2024 This Material is unchanged as of this date.

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

ENTIRE BUILDING EXCEPT CUSTODIAL ROOM AND PANTRY ROOM

BASEBOARD MASTIC

1,420 LF

P: Less Than 5%

W: No Evidence

DAMAGED FRIABLE SURFACING ACM

09/15/2016 Mastic/Adhesive for 4" Black, Gray, Green and 6" Gray and Green Baseboard (Original Entry Updated 8/19/22). New Material installed during Summer 2016 Flooring project. This Material is in GOOD condition as of this date.

02/08/2019 This Material is unchanged as of this date.

08/16/2019 This Material is unchanged as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 Damage Observed. <5% Physical Damage - in the form of 2 LF Loose Baseboard in Hallway near Nurse's Office. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 Material Re-Assessed. Material not observed, Material may exist under current 4" Black, Gray, Green and 6" Gray and Green Baseboard. No other changes as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

HALLWAY OF CONFERENCE ROOM, CONFERENCE ROOM, STAFF ROOM, DATA EQUIPMENT ROOM, NURSES' ROOM, NURSES' CLOSET, PRINCIPAL'S OFFICE, AND LOBBY

SUSPENDED CEILING TILE

1,490 SF

P: Less Than 5%

W: <10% Stains or Flaking

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

10/20/2008 2'x4' Suspended Ceiling Tile. Tiles are White with a pitted mark form pattern. This Material is in GOOD condition as of this date. (Original Entry updated 03./19/15.)

DAMAGE REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME		QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:)
LOCATION	MATERIAL TYPE		WATER DAMAGE (W:)
RISK ASSESMENT CATEGORY			
COMMENTS			
05/14/2009	Additional Material identified. Location changed from HALLWAY CONFERENCE ROOM, STAFF ROOM to HALLWAY CONFERENCE ROOM, STAFF ROOM AND DATA EQUIPMENT ROOM. Quantity changed from 1,450 SF to 1,490 SF. 1 Tile is water damaged in the Data Equipment Room next to the air vent. Friability changed from Moderate to High. This Material is in FAIR condition as of this date.		
09/08/2009	Damage reassessed. There are now a total of 3 Tiles water damaged in Data Equipment Room next to air vent. Material remains in <10% water damage. No other changes as of this date.		
02/01/2010	Sample 10-019 NW-71 collected on this date.		
09/02/2010	Location Description changed from HALLWAY CONFERENCE ROOM, STAFF ROOM AND DATA EQUIPMENT ROOM to HALLWAY CONFERENCE ROOM, STAFF ROOM, DATA EQUIPMENT ROOM, AND NURSES' ROOM. Additional damage in the form of 1 Tile is missing in Data Equipment Room. Also, 1 Tile is water stained at Nurses' Room. Data Equipment Room has 1 Tile water damaged. No other changes as of this date.		
12/01/2011	Location Description changed from HALLWAY CONFERENCE ROOM, STAFF ROOM, DATA EQUIPMENT ROOM, AND NURSES' ROOM to HALLWAY OF CONFERENCE ROOM, CONFERENCE ROOM, STAFF ROOM, DATA EQUIPMENT ROOM, NURSES' ROOM, NURSES' CLOSET, PRINCIPAL'S OFFICE, AND LOBBY. Additional Damage - in the form of 1 Tile is Water stained in Lobby. Also, 2 Tiles are missing in Data Equipment Room. Material remains in <5% Physical Damage and <10% Water Damage. No other changes as of this date.		
03/19/2015	Tiles are White with a pitted mark form pattern. Original Entry updated. No other changes as of this date.		
09/18/2015	Damage Re-Assessed. Repairs made to Lobby and Nurse's Room. Damage Re-Assessed and is currently as follows for the following room: Date Equipment Room has 3 Tiles Physically Damaged and 1 Water Damaged. Additional Damage observed, Staff Room has 3 Tiles Physically Damaged. No other change as of this date.		
04/03/2017	Additional Damage Observed. Data Room now has 2 Tile with Physical Damage, 1 Tile is Missing and 1 has Water Damage. No other changes as of this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	Additional Damage Observed. <5% Physical Damage in the form of a total of 2 Ceiling Tiles with Water Stains in the Data Equipment Room. Staff Room has 2 SF of Water Stains on various Ceiling Tiles and 1 Broken Tile. Material Condition remains in FAIR condition overall. No other changes as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		

DAMAGE REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME		QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
LOCATION	MATERIAL TYPE		
RISK ASSESMENT CATEGORY			
COMMENTS			

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

KITCHEN

VINYL SHEETING

572 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/14/2005	Green Vinyl Sheeting. This Material is in GOOD condition as of this date.
08/25/2006	Material Re-Assessed. (Apparent New Material identified by the AHERA accredited Inspector). Recommendation changed to reflect this status. No other changes as of this date.
10/11/2012	Damage: <5% Physical Damage - in the form of 1 SF is Damaged. Material condition changed from GOOD to FAIR overall as of this date. Friability changed from Non-Friable to Friable to reflect this change.
01/28/2016	Sample 16-030-A04 collected from Kitchen 122, Green Vinyl Sheeting.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.
08/19/2022	This Material is unchanged as of this date.
02/17/2023	This Material is unchanged as of this date.
08/18/2023	This Material is unchanged as of this date.
02/16/2024	This Material is unchanged as of this date.

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

KITCHEN

VINYL SHEETING BACKING PAPER/MASTIC

572 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/14/2005	Backing Paper/Adhesive for Green Vinyl Sheeting. This Material is in GOOD condition as of this date.
08/25/2006	Material Re-Assessed. (Apparent New Material identified by the AHERA accredited Inspector). Recommendation changed to reflect this status. No other changes as of this date.
10/11/2012	Damage: <5% Physical Damage - in the form of 1 SF is Damaged. Material condition changed from GOOD to FAIR overall as of this date.
01/28/2016	Sample 16-030-A05 collected from Kitchen 122, Backing Paper for Green Vinyl Sheeting.

DAMAGE REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

02/08/2019 This Material is unchanged as of this date.

08/16/2019 This Material is unchanged as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

KITCHEN PANTRY CLOSET

VINYL FLOOR TILE

60 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/14/2005 9"X9" Red Vinyl Floor Tile. This Material is in GOOD condition as of this date.

10/11/2012 Damage: <5% Physical Damage - in the form of 1 Tile is missing, 3 Tiles are broken, and Mastic/Adhesive is exposed. Material condition changed from GOOD to FAIR overall as of this date. Friability changed from Non-Friable to Friable to reflect this change.

03/07/2014 2 additional Tiles are broken and Mastic/Adhesive is exposed. No other changes as of this date.

04/03/2017 Additional Damage Observed. 8 Tiles Broken with Mastic Exposed and 4 Tiles Loose. 2 SF of Water Damage and debris at back of the closet. No other changes as of this date.

02/08/2019 This Material is unchanged as of this date.

08/16/2019 This Material is unchanged as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

DAMAGE REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
RISK ASSESSMENT CATEGORY	COMMENTS			

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

KITCHEN PANTRY CLOSET

VINYL FLOOR TILE MASTIC

60 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/14/2005 Mastic/Adhesive for 9"X9" Red Vinyl Floor Tile. This Material is in GOOD condition as of this date.

03/07/2014 6 Tiles are broken and Mastic/Adhesive is exposed. This Material is in FAIR condition. No other changes as of this date.

04/03/2017 Additional Damage Observed. 8 Tiles Broken with Mastic Exposed and 4 Tiles Loose. 2 SF of Water Damage and debris at back of the closet. No other changes as of this date.

02/08/2019 This Material is unchanged as of this date.

08/16/2019 This Material is unchanged as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

MULTI-PURPOSE ROOM

SUSPENDED CEILING TILE

2,530 SF

P: Less Than 5%

W: <10% Stains or Flaking

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

10/20/2008 2'x2' Suspended Ceiling Tile. Tiles are White with a pitted mark form pattern. 10 Tiles have Water Stains. This Material is in FAIR condition as of this date. (Original Entry updated 03/19/15.)

09/08/2009 Material remains in <10% Water Damage. Also, <5% Physical Damage in the form of 1 broken Tile. No other changes as of this date.

DAMAGE REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

04/05/2013	Damage Re-Assessed. Only 1 Tile is Water stained. Material remains in FAIR condition. No other changes as of this date.					
03/19/2015	Tiles are White with a pitted mark form pattern. Original Entry updated. This Material is unchanged as of this date.					
09/18/2015	Damage Re-Assessed. Damage is currently as follows for the following room: Multipurpose Room has 4 Tiles Water Damaged and 1 Tile Physically Damaged. No other changes as of this date.					
09/15/2016	Additional Damage observed. Multi-Purpose Room has 8 Tiles with Damage in the form of stains. No other changes as of this date.					
04/03/2017	Additional Damage Observed. Multi-Purpose Room now has 12 Tiles with Water Damage. No other changes as of this date.					
02/08/2019	This Material is unchanged as of this date.					
08/16/2019	This Material is unchanged as of this date.					
01/31/2020	This Material is unchanged as of this date.					
09/01/2020	This Material is unchanged as of this date.					
02/12/2021	This Material is unchanged as of this date.					
08/13/2021	This Material is unchanged as of this date.					
02/23/2022	This Material is unchanged as of this date.					
08/19/2022	This Material is unchanged as of this date.					
02/17/2023	This Material is unchanged as of this date.					
08/18/2023	This Material is unchanged as of this date.					
02/16/2024	This Material is unchanged as of this date.					

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

MULTI-PURPOSE ROOM, OFFICES, AND HALLWAYS

VINYL WALL COVER

18,680 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/14/2005	4'X8' Vinyl Covered Wall Panels, (over Gypsum Wallboard System). This Material is in GOOD condition as of this date.					
08/30/2017	Damage Observed. <5% Physical Damage - in the form of Seveal areas have Scrapes in the Materail. Material condition changed from GOOD to FAIR overall. No other changes as of this date.					
02/08/2019	This Material is unchanged as of this date.					
08/16/2019	This Material is unchanged as of this date.					
01/31/2020	Additional Damage Observed. 1 SF of Loose Peeling Vinyl Floor Wall in Staff Lounge. No other changes as of this date.					

DAMAGE REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
RISK ASSESMENT CATEGORY	COMMENTS			

09/01/2020	Additional Damage Observed. In Multi-Purpose Room 1 SF of Torn Vinyl Wall Cover on North Wall. 4 SF of Torn Vinyl Wall Cover on South Wall. No other changes as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.
08/19/2022	This Material is unchanged as of this date.
02/17/2023	This Material is unchanged as of this date.
08/18/2023	This Material is unchanged as of this date.
02/16/2024	This Material is unchanged as of this date.

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

MULTI-PURPOSE ROOM, OFFICES, AND HALLWAYS

VINYL WALL COVER MASTIC	18,680 SF	P: Less Than 5% W: No Evidence
-------------------------	-----------	-----------------------------------

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/14/2005	Mastic/Adhesive for Vinyl Covered Wall Panels, (over Gypsum Wallboard System). This Material is in GOOD condition as of this date.
08/30/2017	Damage Observed. <5% Physical Damage - in the form of Seveal areas have Scrapes in the Materail. Material condition changed from GOOD to FAIR overall. Friability changed from Non to Low. No other changes as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	Additional Damage Observed. 1 SF of Loose Peeling Vinyl Floor Wall in Staff Lounge. No other changes as of this date.
09/01/2020	Additional Damage Observed. In Multi-Purpose Room 1 SF of Torn Vinyl Wall Cover on North Wall. 4 SF of Torn Vinyl Wall Cover on South Wall. No other changes as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.
08/19/2022	This Material is unchanged as of this date.
02/17/2023	This Material is unchanged as of this date.
08/18/2023	This Material is unchanged as of this date.
02/16/2024	This Material is unchanged as of this date.

DAMAGE REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME		QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
LOCATION	MATERIAL TYPE		
RISK ASSESMENT CATEGORY			
COMMENTS			

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

PTA ROOM

VINYL FLOOR TILE

144 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/14/2005	12"x12" Off-White Vinyl Floor Tile. This Material is in GOOD condition as of this date.
03/07/2014	Location name changed from CONFERENCE ROOM (OLD CUSTODIAN ROOM) to PTA ROOM. 1 Tile is broken and Mastic/Adhesive is exposed. No other changes as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.
08/19/2022	This Material is unchanged as of this date.
02/17/2023	This Material is unchanged as of this date.
08/18/2023	This Material is unchanged as of this date.
02/16/2024	This Material is unchanged as of this date.

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

PTA ROOM

VINYL FLOOR TILE MASTIC

144 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/14/2005	Mastic/Adhesive for 12"x12" Off-White Vinyl Floor Tile. This Material is in GOOD condition as of this date.
03/07/2014	Location name changed from CONFERENCE ROOM (OLD CUSTODIAN ROOM) to PTA ROOM. 1 Tile is broken and Mastic/Adhesive is exposed. No other changes as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.

DAMAGE REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME		QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
LOCATION	MATERIAL TYPE		
RISK ASSESMENT CATEGORY			
COMMENTS			

08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.
08/19/2022	This Material is unchanged as of this date.
02/17/2023	This Material is unchanged as of this date.
08/18/2023	This Material is unchanged as of this date.
02/16/2024	This Material is unchanged as of this date.

DAMAGE REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESSMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P): WATER DAMAGE (W:)
---------------	----------	---------------	--------------------------	----------	----------------------	---

CLASSROOMS 201-202 BUILDING (BUILDING 200)

CLASSROOMS 201-202 BUILDING (BUILDING 200)

CLASSROOMS 201 AND 202

SUSPENDED CEILING TILE

2,600 SF

P: No Visible Damage

W: <10% Stains or Flaking

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/14/2005	2'X4' SUSPENDED CEILING TILE. Tiles are White with a pitted mark form pattern. This Material is in GOOD condition as of this date. (Original Entry updated 03/19/15.)
10/20/2008	3 Tiles are Water Stained in Classroom 202. No other changes as of this date.
09/08/2009	Material remains in <10% Water Damage and in FAIR condition. This Material is unchanged as of this date.
02/01/2010	Sample 10-019 NW-61 collected on this date.
03/11/2010	Additional Damage observed in Classroom 201 has 1 Tile Water Damaged. No other changes as of this date.
09/02/2010	Additional Damage observed in the form of Classroom 202 now had a total of 6 Tiles Water stained. Also, Classroom 201 has an additional 5 Tiles Water Damaged. No other changes as of this date.
12/01/2011	Damages Re-Assessed. Classroom 201, 4 Tiles have been replaced, and 1 remains Water Damaged. Classroom 202 now has a total of 5 Tiles Water stained - 1 has been repaired. No other changes as of this date.
10/11/2012	Material condition Re-Assessed. 4 Water stained Tiles in Classroom 202 have been repaired. Material remains in FAIR condition. No other changes as of this date.
03/19/2015	Tiles are White with a pitted mark form pattern. Original Entry updated. This Material is unchanged as of this date.
09/15/2016	Additional Damage observed. Room 202 now has 2 Tiles with Water stains. No other changes as of this date.
04/03/2017	Additional Damage Observed. <10% Water Damage - in the form of 10 Tiles with Water Damage in Classroom 201. No other changes as of this date.
08/30/2017	Additional Damage Observed. Room 202 has 2 Tiles with Physical Damage in the form of Cracked and Chipped corners. No other changes as of this date.
02/16/2018	Additional Damage Observed. Room 202 now has 5 Tiles with Water Stains. Partail Repairs made to Tiles in Classroom 201, 4 other Tiles have Water Stains. No other changes as of this date.
08/15/2018	Additional Damage Observed. Room 202 now has 6 Tiles with Water Stains. Partail Repairs made to Tiles in Classroom 201 4 Tiles Replaced 2 Tiles have Water Stains. No other changes as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.

DAMAGE REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME		QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
LOCATION	MATERIAL TYPE		
RISK ASSESMENT CATEGORY			
COMMENTS			

02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.
08/19/2022	This Material is unchanged as of this date.
02/17/2023	This Material is unchanged as of this date.
08/18/2023	This Material is unchanged as of this date.
02/16/2024	This Material is unchanged as of this date.

CLASSROOMS 201-202 BUILDING (BUILDING 200)

CLASSROOMS 201 AND 202, RESTROOMS, STORAGE ROOMS AND UTILITY ROOMS

SMOOTH WALL MISCELLANEOUS

2,600 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/14/2005	Gypsum Wallboard System, (with 4'x8' Covered Wall Panels in some areas). This Material is in GOOD condition as of this date.
03/09/2007	Material changed from Gypsum Wallboard System. ' to ' GYPSUM WALLBOARD SYSTEM, (with 4'x8' Covered Wall Panels in some areas). ' No other changes as of this date.
05/14/2009	2 SF is Damaged in the Exterior Storage Closets, 1 SF in each, where Exhaust Ducts have been removed. Several holes and cuts observed on the Walls and Ceilings in 2 Storage Closets and the Custodian Room. No other changes as of this date.
09/08/2009	Material remains in <5% physical damage. This Material is unchanged as of this date.
02/01/2010	Samples 10-019 NW-63 (Joint Tape / Compound), NW-64 (Drywall), NW-66 (Joint Tape / Compound), and NW-67 (Drywall) collected on this date.
09/26/2013	Material Re-Assessed. Friability changed from Moderate to Low. Material changed from GOOD to FAIR condition. No other changes as of this date.
03/07/2014	Friability changed from Low to Moderate. No other changes as of this date.
09/18/2015	Additional Damage observed. Exterior Storage Rooms have minor holes and cuts. No other changes as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	Additional Damage Observed. 2 SF of Missing Wall in Storage Room near Classroom 201. No other changes as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.

DAMAGE REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

CLASSROOMS 201-202 BUILDING (BUILDING 200)

CLASSROOMS 201 AND 202, RESTROOMS, STORAGE ROOMS AND UTILITY ROOMS

SMOOTH WALL SURFACING

2,600 SF

P: Less Than 5%

W: No Evidence

DAMAGED FRIABLE SURFACING ACM

08/25/2006 Skim Coat for Gypsum Wallboard System, (with 4'x8' Covered Wall Panels in some areas). This Material is in GOOD condition as of this date.

03/09/2007 Material Description changed from ' Skim Coat for Gypsum Wallboard System. ' to ' Skim Coat for GYPSUM WALLBOARD SYSTEM, (with 4'x8' Covered Wall Panels in some areas). ' No other changes as of this date.

05/14/2009 2 SF is Damaged in the Exterior Storage Closets, 1 SF in each, where Exhaust Ducts have been removed. Several holes and cuts observed on the Walls and Ceilings in 2 Storage Closets and the Custodian Room. Friability changed from Low to Moderate. No other changes as of this date.

09/08/2009 Material remains in <5% Physical Damage. This Material is unchanged as of this date.

02/01/2010 Samples 10-019 NW-62 and NW-65 collected on this date.

09/26/2013 Material Re-Assessed. Material changed from GOOD to FAIR condition as of this date. No other changes as of this date.

09/18/2015 Additional Damage observed, Exterior Storage Rooms have minor holes and cuts. No other change as of this date.

02/08/2019 This Material is unchanged as of this date.

08/16/2019 This Material is unchanged as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 Additional Damage Observed. 2 SF of Missing Wall in Storage Room near Classroom 201. No other changes as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

DAMAGE REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

CLASSROOMS 201-202 BUILDING (BUILDING 200)

EXTERIOR WINDOWS

CAULKING

200 LF

P: Less Than 5%

W: <10% Stains or Flaking

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/08/2009 Caulking on Exterior Windows. Damage: <5% Physical Damage and <10% Water Damage due to existing degradation of heat and moisture factors and missing portion of material in various locations. This Material is in FAIR condition as of this date.

02/08/2019 This Material is unchanged as of this date.

08/16/2019 This Material is unchanged as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

DAMAGE REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

CLASSROOMS 301-306 BUILDING (BUILDING 300)

CLASSROOMS 301-306 BUILDING (BUILDING 300)

CLASSROOMS 301-306, F.I.S. AND FOUR STORAGE ROOMS

SUSPENDED CEILING TILE

9,400 SF

P: Less Than 5%

W: <10% Stains or Flaking

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/14/2005	2'x4' Suspended Ceiling Tile . Tiles are White with a pitted mark form pattern. This Material is in GOOD condition as of this date. (Original Entry updated 03/19/15.)
10/20/2008	Classroom 305 has 3 Tiles Water Stained. RSP Room still has water stains. No other changes as of this date.
05/14/2009	Additional Damage observed. 2 Tiles are Water Damaged in the Storage Room of Classrooms 303 and 304 as of this date.
09/08/2009	Damage Re-Assessed. Additional Damage observed in the form of 2 Tiles are water stained in Classroom 307, and RSP Room has 2 Tiles Water stained. Damage remains in <10% Water Damage. No other changes as of this date.
02/01/2010	Samples 10-019 NW-75 collected on this date.
03/11/2010	Additional Damage observed in the form of Classroom 303 has 2 Tiles Water Damaged. Friability changed from Moderate to High to reflect this change.
09/02/2010	Additional Damage in the form of Classroom 302 has 1 Tile broken and 1 Tile Water stained. Classroom 305 has 2 additional Tiles Water stained. Damages repaired in Storage Room of Classrooms 303 and 304. No other changes as of this date.
12/01/2011	Additional Damage - in the form of Classroom 302 has 1 additional Tile water damaged. No other changes as of this date.
04/05/2013	Material Condition Re-Assessed. Damaged Tiles have been Removed and Replaced with new Tiles in Classrooms 302, 303 and 304. Room 305 still remains Damaged with 2 Water Damaged Tiles. Material remains in FAIR condition. Friability changed from High to Moderate. No other changes as of this date.
03/07/2014	Friability changed from Moderate to High. No other changes as of this date.
03/19/2015	Tiles are White with a pitted mark form pattern. Original Entry updated. No other changes as of this date.
09/18/2015	Damage Re-Assessed. Repairs made to Room 305 and RSP Room. Classroom 307 has 1 Tile Physically Damaged. Additional Damages observed, Storage Room between Rooms 303 and 304 has 1 Tile Physically Damaged and Storage Room between Rooms 301 and 302 has 2 Tiles Physically Damaged. No other changes as of this date.
01/28/2016	Sample 16-030-A26 collected from Workroom 304, 2'x4' Suspended Ceiling Tile.
09/15/2016	Location Description changed. Location Description changed from RSP ROOM, CLASSROOMS 301-306 AND FOUR STORAGE ROOMS to CLASSROOMS 301-306, F.I.S. AND FOUR STORAGE ROOMS. No other changes as of this date.
04/03/2017	Additional Damage Observed. 2 Tiles have Water Damage in Classroom 304. No other changes as of this date.

DAMAGE REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME		QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
LOCATION	MATERIAL TYPE		
RISK ASSESMENT CATEGORY			
COMMENTS			
02/16/2018	Additional Damage Observed. 2 Broken Tiles in Classroom 306. Partial Repairs made to Tiles in Classroom 304. Remains in FAIR condition. No other changes as of this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	Additional Damage Observed. 3 Tiles Broken in Work Room Between Classrooms 303 and 304. 5 Cracked Tiles in Classroom 305. 4 Tiles with Water Stains in Classroom 306. No other changes as of this date.		
02/12/2021	Additional Damage Observed. <5% Physical Damage in th form of 1 Tile with Water Stains and 1 Tile with Cracks in Work Room of Classrooms 305 and 306. Material remains in FAIR condition overall. No other changes as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		

CLASSROOMS 301-306 BUILDING (BUILDING 300)

ENTIRE BUILDING INCLUDING RESTROOMS, UTILITY ROOMS AND STORAGE ROOMS

SMOOTH WALL MISCELLANEOUS

37,800 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/14/2005	Gypsum Wallboard system, (with 4'x8' Covered Wall Panels in some areas). This Material is in GOOD condition as of this date.
02/01/2010	Samples 10-019 NW-77 (Joint Tape / Compound), and NW-78 (Drywall) collected on this date.
12/01/2011	Damage: <5% Physical Damage - in the form of Storage Room, next to Girls Restroom, approximately 20 SF of Dry Wall has been removed. Material condition changed from GOOD to FAIR overall. No other changes as of this date.
09/18/2015	Additional Damage observed. Storage Room next to Girls Restroom has minor holes and cuts. No other changes as of this date.
01/28/2016	Sample 16-030-A31 collected from Workroom 304, Wallboard. Sample 16-030-A32 collected from Workroom 304, Joint Compound. Sample 16-030-A35 collected from Room 303, Demising Wall, Sheetrock Wall.
09/15/2016	Material Removed in various locations and Replaced with New as part of the Summer 2016 renovation project. Material Quantity changed from 38,200 SF to 37,800 SF. No other changes as of this date.
02/08/2019	This Material is unchanged as of this date.

DAMAGE REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.
08/19/2022	This Material is unchanged as of this date.
02/17/2023	This Material is unchanged as of this date.
08/18/2023	This Material is unchanged as of this date.
02/16/2024	This Material is unchanged as of this date.

CLASSROOMS 301-306 BUILDING (BUILDING 300)

ENTIRE BUILDING INCLUDING RESTROOMS, UTILITY ROOMS AND STORAGE ROOMS

SMOOTH WALL SURFACING

37,800 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

08/25/2006	Skim Coat for Gypsum Wallboard System, (with 4'x8' Covered Wall Panels in some areas). This Material is in GOOD condition as of this date.
02/01/2010	Sample 10-019 NW-76 collected on this date.
12/01/2011	Damage: <5% Physical Damage - in the form of Storage Room, next to Girls Restroom, approximately 20 SF of Dry Wall has been removed. Material condition changed from GOOD to FAIR overall. No other changes as of this date.
09/18/2015	Additional Damage observed. Storage Room next to Girls Restroom has minor holes and cuts. No other changes as of this date.
09/15/2016	Material Removed in various locations and Replaced with New as part of the Summer 2016 renovation project. Material Quantity changed from 38,200 SF to 37,800 SF. No other changes as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.

DAMAGE REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

CLASSROOMS 301-306 BUILDING (BUILDING 300)

EXTERIOR WINDOWS AND DOORS

CAULKING

900 LF

P: Less Than 5%

W: <10% Stains or Flaking

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/08/2009 Caulking on Exterior Windows and Doors. Damage: <5% Physical Damage and <10% Water Damage due to existing missing sections of material, and heat and moisture degradation factors in various locations. This Material is in FAIR condition as of this date.

01/28/2016 Sample 16-030-A34 collected from Exterior Door by 304, Interior side, Door Frame Caulking.

02/08/2019 This Material is unchanged as of this date.

08/16/2019 This Material is unchanged as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

CLASSROOMS 301-306 BUILDING (BUILDING 300)

WATER HEATER ROOM (NEXT TO RESTROOMS) AND JANITOR CLOSET

BASEBOARD MASTIC

15 LF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/14/2005 Mastic/Adhesive for 4" Brown Baseboard. This Material is in GOOD condition as of this date.

02/08/2019 This Material is unchanged as of this date.

08/16/2019 This Material is unchanged as of this date.

DAMAGE REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME		QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
LOCATION	MATERIAL TYPE		
RISK ASSESMENT CATEGORY			
COMMENTS			

01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.
08/19/2022	Damage Observed. <5% Physical Damage in the form of 2 LF of Missing Baseboard with Brown Mastic Exposed. Material condition changed from GOOD to FAIR overall. Friability updated from Non-Friable to Friable. No other changes as of this date.
02/17/2023	This Material is unchanged as of this date.
08/18/2023	This Material is unchanged as of this date.
02/16/2024	This Material is unchanged as of this date.

DAMAGE REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESSMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P): WATER DAMAGE (W:)
---------------	----------	---------------	--------------------------	----------	----------------------	---

CLASSROOMS 400-406 BUILDING (BUILDING 400)

CLASSROOMS 400-406 BUILDING (BUILDING 400)

ALL CLASSROOMS, AND LIBRARY

SUSPENDED CEILING TILE

8,400 SF

P: Less Than 5%

W: <10% Stains or Flaking

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/14/2005	2'X4' SUSPENDED CEILING TILE. Tiles are White with a pitted mark form pattern. This Material is in GOOD condition as of this date. (Original Entry updated 03/19/15.)
10/20/2008	Classroom 402 has 4 Tiles Water Stained. Classroom 403 has 2 Tiles Water Stained. Classroom 406 has 2 Tiles Water Stained. No other changes as of this date.
05/14/2009	Tiles have been Repaired in Classroom 403. No other changes as of this date.
09/08/2009	Repairs have been made in Classroom 402 and Tiles have been replaced. Material remains in <10% Water Damage and in FAIR condition. No other changes as of this date.
02/01/2010	Sample 10-019 NW-57 collected on this date.
03/11/2010	Material Re-Assessed. Water Damage is located in Classrooms 403 and 406. No other changes as of this date.
09/02/2010	Additional Damage in the form of Library has 4 Tiles Water stained. 1 Tile has been replaced in Classroom 402. Classroom 404 has 1 Tile Water Damaged. 2 Tiles are still Water Damaged in Classroom 406. No other changes as of this date.
12/01/2011	Additional Damage - in the form of Library has 3 more Tiles Water Damaged, Classroom 408 has 2 Tiles Water Damaged, and Classroom 403 has 1 Tile Water Damaged. No other changes as of this date.
04/05/2013	Material condition Re-Assessed. Damaged Tiles have been repaired in Library. Material remains in FAIR condition overall. No other changes as of this date.
03/07/2014	1 Tile is Water Damaged in the Library. No other changes as of this date.
03/19/2015	Tiles are White with a pitted mark form pattern. Original Entry updated. This Material is unchanged as of this date.
09/18/2015	Damage Re-Assessed. Damages are currently as follows: Classroom 406 has 3 Tiles Water Damaged and Library has 2 Tiles Physically Damaged. Previous Damage noted in Classroom 408 is incorrectly entered and is non-existent. Additional Damages observed; Storage Closet between Rooms 401 and 402 has 1 Tile Physically Damaged and Classroom 401 has 3 Water Damaged Tiles. No other changes as of this date.
09/15/2016	Damages clarified. Damages are as follows: 401 has 1 Tile with Water Damage, 402 has 4 Tiles with Water Damage, Workroom for 403 and 404 has 3 Tiles with Water Damage, 404 has 1 Tile with Water Damage, 405 has 3 Tiles with Water Damage, Workroom for 406 has 2 Tiles with Water Damage, and 406 has 4 Tile with Water Damage. No other changes as of this date.
04/03/2017	Additional Damage Observed. 2 Tiles with Water Damage in Classroom 404. No other changes as of this date.
02/16/2018	Additional Damage Observed. Classroom 402 now has 6 Tiles with Water Damage on them. No other changes as of this date.

DAMAGE REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

02/08/2019	This Material is unchanged as of this date.					
08/16/2019	This Material is unchanged as of this date.					
01/31/2020	This Material is unchanged as of this date.					
09/01/2020	This Material is unchanged as of this date.					
02/12/2021	This Material is unchanged as of this date.					
08/13/2021	This Material is unchanged as of this date.					
02/23/2022	This Material is unchanged as of this date.					
08/19/2022	This Material is unchanged as of this date.					
02/17/2023	This Material is unchanged as of this date.					
08/18/2023	This Material is unchanged as of this date.					
02/16/2024	Material Re-assessed. Water Stains in Classroom 404 Have been Replaced with new Tiles. Partial Repairs in Libray 2 Water Stained Tiles have been Replace with new ons. Addition Damag in Classroom 404 1 Til wil Cracks. No other changes as of this date.					

CLASSROOMS 400-406 BUILDING (BUILDING 400)

CLASSROOMS, AND LIBRARY

VINYL WALL COVER

29,880 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/14/2005	4'X8' VINYL COVERED WALL PANELS. This Material is in GOOD condition as of this date.					
01/28/2016	Sample 16-030-A39 collected from Library (403), Vinyl Cover on Pressed Wood Wall Panel.					
09/15/2016	Damage observed. Damage: <5% Phyiscal Damage - in the form of 6" tear in the Vinyl in Classroom 401. Material Condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.					
02/16/2018	Material Re-assessed. Damage in Classroom 401 is not Observed, possibly covered up. Remains in FAIR condition. No other changes as of this date.					
02/08/2019	This Material is unchanged as of this date.					
08/16/2019	This Material is unchanged as of this date.					
01/31/2020	This Material is unchanged as of this date.					
09/01/2020	This Material is unchanged as of this date.					
02/12/2021	This Material is unchanged as of this date.					
08/13/2021	This Material is unchanged as of this date.					
02/23/2022	This Material is unchanged as of this date.					

DAMAGE REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)	COMMENTS
---------------	----------	---------------	-------------------------	----------------------	---	----------

08/19/2022	This Material is unchanged as of this date.					
02/17/2023	This Material is unchanged as of this date.					
08/18/2023	This Material is unchanged as of this date.					
02/16/2024	Additional Damage Observed. Classroom 404 has a 1/2 Foot Teat in Material. No other changes as of this date.					

CLASSROOMS 400-406 BUILDING (BUILDING 400)

CLASSROOMS, AND LIBRARY

VINYL WALL COVER MASTIC	29,880 SF	P: Less Than 5% W: No Evidence
-------------------------	-----------	---

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/14/2005	MASTIC/Adhesive FOR VINYL COVERING oN 4'X8' VINYL COVERED WALL PANELS. This Material is in GOOD condition as of this date.					
09/15/2016	Damage observed. Damage: <5% Phyiscal Damage - in the form of 6" tear in the Vinyl in Classroom 401. Material Condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.					
02/08/2019	This Material is unchanged as of this date.					
08/16/2019	This Material is unchanged as of this date.					
01/31/2020	This Material is unchanged as of this date.					
09/01/2020	This Material is unchanged as of this date.					
02/12/2021	This Material is unchanged as of this date.					
08/13/2021	This Material is unchanged as of this date.					
02/23/2022	This Material is unchanged as of this date.					
08/19/2022	This Material is unchanged as of this date.					
02/17/2023	This Material is unchanged as of this date.					
08/18/2023	This Material is unchanged as of this date.					
02/16/2024	Additional Damage Observed. Classroom 404 has a 1/2 Foot Teat in Material. No other changes as of this date.					

DAMAGE REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

CLASSROOMS 400-406 BUILDING (BUILDING 400)

ENTIRE BUILDING

SMOOTH WALL MISCELLANEOUS

38,100 SF

P: Less Than 5%

W: <10% Stains or Flaking

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/14/2005	GYPSUM WALLBOARD SYSTEM WALLS AND CEILINGS. MATERIAL ASSUMED TO EXIST UNDER 4'X8' VINYL COVERED WALL PANELS. Damage: <5% Physical Damage - in PE Storage Room; Water Damage: <10% - in PE Storage Room. This Material is in FAIR condition overall as of this date.
03/09/2007	Material Description changed from ' GYPSUM WALLBOARD SYSTEM WALLS AND CEILINGS. MATERIAL ASSUMED TO EXIST UNDER 4'X8' VINYL COVERED WALL PANELS. ' to ' Gypsum Wallboard System Walls and Ceilings. (Material is also located under 4'x8' Vinyl Covered Wall Panels). ' No other unchanges as of this date.
04/21/2008	50 SF is Damaged above the Double Entry Doors and 2 SF of debris on Floor. Missing Material with broken edges in the center of the ceiling as of this date.
09/08/2009	Previously mentioned 50 SF of Damage is located in PE Storage Room. No other changes as of this date.
02/01/2010	Samples 10-019 NW-59 (Joint Tape / Compound), and NW-60 (Drywall) collected on this date.
09/18/2015	Additional Damage observed. Exterior Storage Closet by Students Restrooms has minor holes and cuts. No other changes as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	Additional Damage Observed. 2 LF Crack in Work Room of Classroom 402. No other changes as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.
08/19/2022	This Material is unchanged as of this date.
02/17/2023	Additional Damage Observed. <5% Physical Damage in the form of 1 SF of Scuffs and Holes in Work Room of Classroom 406. Material remains in FAIR condition overall. No other changes as of this date.
08/18/2023	This Material is unchanged as of this date.
02/16/2024	This Material is unchanged as of this date.

DAMAGE REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESSMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	--------------------------	----------	----------------------	---

CLASSROOMS 400-406 BUILDING (BUILDING 400)

ENTIRE BUILDING

SMOOTH WALL SURFACING

38,100 SF

P: Less Than 5%

W: <10% Stains or Flaking

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

08/25/2006	Skim Coat for Gypsum Wallboard System Walls and Ceilings. Material Assumed to exist under 4'X8' Vinyl Covered Wall Panels. Damage: <5% Physical Damage - in PE storage Room; Water Damage: <10% - in PE Storage Room. This Material is in FAIR condition overall as of this date.
03/09/2007	Material Description changed from ' Skim Coat for GYPSUM WALLBOARD SYSTEM WALLS AND CEILINGS. MATERIAL ASSUMED TO EXIST UNDER 4'X8' VINYL COVERED WALL PANELS. ' to ' Skim Coat for Gypsum Wallboard System Walls and Ceilings. (Material is also located under 4'x8' Vinyl Covered Wall Panels). ' No other unchanges as of this date.
09/18/2015	Additional Damage observed. Exterior Storage Closet by Students Restrooms has minor holes and cuts. No other change as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	Additional Damage Observed. 2 LF Crack in Work Room of Classroom 402. No other changes as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.
08/19/2022	This Material is unchanged as of this date.
02/17/2023	Additional Damage Observed. <5% Physical Damage in the form of 1 SF of Scuffs and Holes in Work Room of Classroom 406. Material remains in FAIR condition overall. No other changes as of this date.
08/18/2023	This Material is unchanged as of this date.
02/16/2024	This Material is unchanged as of this date.

CLASSROOMS 400-406 BUILDING (BUILDING 400)

EXTERIOR WALLS, AND OVERHANG OF RESTROOMS

ROUGH WALL

7,200 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/14/2005	Stucco Exterior Walls and Restrooms Overhangs. This Material is in GOOD condition as of this date.
------------	--

DAMAGE REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

03/09/2007	Location Name changed from Exterior to Exterior Walls, and Overhang Of Restrooms. Material Description changed from ' Skim Coat for Stucco On Exterior Walls And Restrooms Overhang. ' to ' Skim Coat for Stucco Exterior Walls and Overhang. ' No other changes as of this date.					
05/14/2009	This Material has hairline cracks on various surfaces. Friability changed from Non-Friable to Friable. No other changes as of this date.					
09/08/2009	Material remains in <5% Physical Damage. This Material is unchanged as of this date.					
09/26/2013	Material Re-Assessed. Material changed from GOOD to FAIR condition. No other changes as of this date.					
02/08/2019	This Material is unchanged as of this date.					
08/16/2019	This Material is unchanged as of this date.					
01/31/2020	This Material is unchanged as of this date.					
09/01/2020	This Material is unchanged as of this date.					
02/12/2021	This Material is unchanged as of this date.					
08/13/2021	This Material is unchanged as of this date.					
02/23/2022	This Material is unchanged as of this date.					
08/19/2022	This Material is unchanged as of this date.					
02/17/2023	Additional Damage Observed. <5% Physical Damage in the form of 4 SF of Peeling Paint and 10 LF of Cracks on South Wall of Building. Material remains in FAIR condition overall. No other changes as of this date.					
08/18/2023	This Material is unchanged as of this date.					
02/16/2024	This Material is unchanged as of this date.					

CLASSROOMS 400-406 BUILDING (BUILDING 400)

EXTERIOR WALLS, AND OVERHANG OF RESTROOMS

ROUGH WALL SURFACING	7,200 SF	P: Less Than 5% W: No Evidence
----------------------	----------	---

DAMAGED FRIABLE SURFACING ACM

09/14/2005	Skim Coat for Stucco on Exterior Walls and Restrooms Overhang. This Material is in GOOD condition as of this date.					
03/09/2007	Location Name changed from Exterior to Exterior Walls, and Overhang Of Restrooms. Material Description changed from ' Skim Coat for Stucco On Exterior Walls And Restrooms Overhang. ' to ' Skim Coat for Stucco Exterior Walls and Overhang. ' No other changes as of this date.					
05/14/2009	This Material has hairline cracks on various surfaces. Friability changed from Non-Friable to Friable. No other changes as of this date.					
09/08/2009	Material remains in <5% Physical Damage. This Material is unchanged as of this date.					
09/26/2013	Material Re-Assessed. Material changed from GOOD to FAIR condition. No other changes as of this date.					

DAMAGE REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

02/08/2019	This Material is unchanged as of this date.					
08/16/2019	This Material is unchanged as of this date.					
01/31/2020	This Material is unchanged as of this date.					
09/01/2020	This Material is unchanged as of this date.					
02/12/2021	This Material is unchanged as of this date.					
08/13/2021	This Material is unchanged as of this date.					
02/23/2022	This Material is unchanged as of this date.					
08/19/2022	This Material is unchanged as of this date.					
02/17/2023	Additional Damage Observed. <5% Physical Damage in the form of 4 SF of Peeling Paint and 10 LF of Cracks on South Wall of Building. Material remains in FAIR condition overall. No other changes as of this date.					
08/18/2023	This Material is unchanged as of this date.					
02/16/2024	This Material is unchanged as of this date.					

CLASSROOMS 400-406 BUILDING (BUILDING 400)

EXTERIOR WINDOWS

CAULKING

900 LF

P: Less Than 5%

W: <10% Stains or Flaking

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/08/2009	Caulking on Exterior Windows. Damage: <5% Physical Damage and <10% Water Damage due to existing missing sections of material, and heat and moisture degradation factors in various locations. This Material is in FAIR condition as of this date.					
02/08/2019	This Material is unchanged as of this date.					
08/16/2019	This Material is unchanged as of this date.					
01/31/2020	This Material is unchanged as of this date.					
09/01/2020	This Material is unchanged as of this date.					
02/12/2021	This Material is unchanged as of this date.					
08/13/2021	This Material is unchanged as of this date.					
02/23/2022	This Material is unchanged as of this date.					
08/19/2022	This Material is unchanged as of this date.					
02/17/2023	This Material is unchanged as of this date.					
08/18/2023	This Material is unchanged as of this date.					
02/16/2024	This Material is unchanged as of this date.					

DAMAGE REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESSMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	--------------------------	----------	----------------------	---

CLASSROOMS 400-406 BUILDING (BUILDING 400)

LIBRARY STORAGE

BASEBOARD MASTIC

50 LF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

10/20/2008	Mastic/Adhesive for 4" Brown Baseboard. This Material is in GOOD condition as of this date.
09/15/2016	Damage observed. Damage: <5% Physical Damage - in the form of loose Baseboard in 2 locations exposing Mastic/Adhesive. Material condition changed from GOOD to FAIR overall. Friability changed from Non to Low. No other changes as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.
08/19/2022	This Material is unchanged as of this date.
02/17/2023	This Material is unchanged as of this date.
08/18/2023	This Material is unchanged as of this date.
02/16/2024	This Material is unchanged as of this date.

CLASSROOMS 400-406 BUILDING (BUILDING 400)

LIBRARY STORAGE

VINYL FLOOR TILE

144 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

10/20/2008	9"x9" Beige Vinyl Floor Tile. This Material is in GOOD condition as of this date.
09/02/2010	Damage: <5% Physical Damage - in the form of 1 broken Tile, exposing Mastic/Adhesive. Material condition changed from GOOD to FAIR overall as of this date.
04/05/2013	Material Condition Re-Assessed. Damages repaired as of this date. Material Condition changed from FAIR to GOOD. No other changes as of this date.
09/18/2015	Repair noted on 04/05/13 involves the installation of One 9"x9" Green Vinyl Floor Tile. No other changes as of this date.
09/15/2016	Additional Damage observed. 2 Tiles are missing exposing Mastic/Adhesive. No other changes as of this date.

DAMAGE REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESSMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	--------------------------	----------	----------------------	---

04/03/2017	Material Re-assessed. Missing Tiles have been replaced however, 1 Tile is Broken with Mastic Exposed. Material remains in FAIR condition. No other changes as of this date.					
08/30/2017	Additional Damage Observed. 2 Tiles are Missing Mastic Exposed. No other changes as of this date.					
02/08/2019	This Material is unchanged as of this date.					
08/16/2019	This Material is unchanged as of this date.					
01/31/2020	This Material is unchanged as of this date.					
09/01/2020	This Material is unchanged as of this date.					
02/12/2021	This Material is unchanged as of this date.					
08/13/2021	This Material is unchanged as of this date.					
08/13/2021	This Material is unchanged as of this date.					
02/23/2022	This Material is unchanged as of this date.					
08/19/2022	This Material is unchanged as of this date.					
02/17/2023	This Material is unchanged as of this date.					
08/18/2023	This Material is unchanged as of this date.					
02/16/2024	This Material is unchanged as of this date.					

CLASSROOMS 400-406 BUILDING (BUILDING 400)

LIBRARY STORAGE

VINYL FLOOR TILE MASTIC

144 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

10/20/2008	Mastic/Adhesive for 9"x9" Beige Vinyl Floor Tile. This Material is in GOOD condition as of this date.					
09/02/2010	Damage: <5% Physical Damage - in the form of 1 broken Tile, exposing Mastic/Adhesive. Material condition changed from GOOD to FAIR overall as of this date.					
04/05/2013	Material Condition Re-Assessed. Damages repaired as of this date. Material Condition changed from FAIR to GOOD. No other changes as of this date.					
09/18/2015	Repair noted on 04/05/13 involves the installation of One 9"x9" Green Vinyl Floor Tile. No other change as of this date.					
09/15/2016	Additional Damage observed. 2 Tiles are missing exposing Mastic/Adhesive. No other changes as of this date.					
04/03/2017	Material Re-assessed. Missing Tiles have been replaced however, 1 Tile is Broken with Mastic Exposed. Material remains in FAIR condition. No other changes as of this date.					
08/30/2017	Additional Damage Observed. 2 Tiles are Missing Mastic Exposed. No other changes as of this date.					
02/08/2019	This Material is unchanged as of this date.					

DAMAGE REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME		QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
LOCATION	MATERIAL TYPE		
RISK ASSESMENT CATEGORY			
COMMENTS			

08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.
08/19/2022	This Material is unchanged as of this date.
02/17/2023	This Material is unchanged as of this date.
08/18/2023	This Material is unchanged as of this date.
02/16/2024	This Material is unchanged as of this date.

DAMAGE REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

CLASSROOMS 501-506 BUILDING (BUILDING 500)

CLASSROOMS 501-506 BUILDING (BUILDING 500)

BOYS AND GIRLS RESTROOM

MORTAR MISCELLANEOUS

120 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

04/03/2017	Grout/Mortar for 4"x6" Black Base Ceramic Wall Tiles. Damage Observed. <5% Physical Damage - in the form of 1 Tile is Missing, Mastic Exposed in Boy's Restroom. 1 Tile is Loose and 1 Tile is Cracked in Girl's Restroom. Material condition is FAIR. Friability is Low. No other changes as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/21/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.
08/19/2022	This Material is unchanged as of this date.
02/17/2023	This Material is unchanged as of this date.
08/18/2023	This Material is unchanged as of this date.
02/16/2024	This Material is unchanged as of this date.

CLASSROOMS 501-506 BUILDING (BUILDING 500)

BOYS AND GIRLS RESTROOMS

MORTAR MISCELLANEOUS

600 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

10/20/2008	Grout/Mortar for 4"x4" White Wall Tiles. This Material is in GOOD condition as of this date.
04/03/2017	Damage Observed. <5% Physical Damage - in the form of 1 Tile Missing Mastic Exposed in Boys Restroom. 1 Tile is Loose from the grout and 1 Tile is cracked in Girls Restroom. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.
08/30/2017	Additional Damage Observed. In Girls Restroom 2 Tiles detached and lying on the floor Mastic Exposed.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.

DAMAGE REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

09/01/2020 This Material is unchanged as of this date.

02/21/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

CLASSROOMS 501-506 BUILDING (BUILDING 500)

CLASSROOMS 501-506 AND COMPUTER LAB

VINYL WALL COVER

30,000 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/14/2005 4'X8' Vinyl Covered Wall Panels. This Material is in GOOD condition as of this date.

09/18/2015 Damage observed. Center Classroom has 1/2 SF of Physical Damage. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.

02/08/2019 This Material is unchanged as of this date.

08/16/2019 This Material is unchanged as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/21/2021 Additional Damage Observed. <5% Physical Damage in the form of 1/4 SF of Missing Vinyl Wall Cover on Wall next to RSP Room. Material remains in FAIR condition overall. No other changes as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

DAMAGE REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESSMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	--------------------------	----------	----------------------	---

CLASSROOMS 501-506 BUILDING (BUILDING 500)

CLASSROOMS 501-506 AND COMPUTER LAB

VINYL WALL COVER MASTIC

30,000 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/14/2005	Mastic/Adhesive for Vinyl Covering on 4'x8' Vinyl Covered Wall Panels. This Material is in GOOD condition as of this date.
09/18/2015	Damage observed. Center Classroom has 1/2 SF of Physical Damage. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/21/2021	Additional Damage Observed. <5% Physical Damage in the form of 1/4 SF of Missing Vinyl Wall Cover on Wall next to RSP Room. Material remains in FAIR condition overall. No other changes as of this date.
02/23/2022	This Material is unchanged as of this date.
08/19/2022	This Material is unchanged as of this date.
02/17/2023	This Material is unchanged as of this date.
08/18/2023	This Material is unchanged as of this date.
02/16/2024	This Material is unchanged as of this date.

CLASSROOMS 501-506 BUILDING (BUILDING 500)

CLASSROOMS 501-506, AND SCIENCE / COMPUTER LAB

SUSPENDE CEILING TILE

9,400 SF

P: Less Than 5%

W: <10% Stains or Flaking

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/14/2005	2'x4' Suspended Ceiling Tile. Tiles are White with a pitted mark form pattern. This Material is in GOOD condition as of this date. (Original Entry updated 03/19/15.)
02/01/2010	Sample 10-019 NW-53 collected on this date.
03/11/2010	Damage: <10% Water Damage - in the form of 1 Tile has Water stains in Classroom 502. Material remains in GOOD condition overall as of this date.

DAMAGE REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME		QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
LOCATION	MATERIAL TYPE		
RISK ASSESMENT CATEGORY			
COMMENTS			
09/02/2010	Damages reassessed and Material is now in <10% Physical Damage. Additional damage observed in the following locations: Classroom 501, 1 Tile water damaged; Storage Room of Classroom 501 and 502, 1 Tile water damaged; Classroom 503, 1 Tile water damaged; Storage Room of Classroom 503 and 504, 1 Tile Water Damaged; Classroom 504, 3 Tiles Water Damaged; Classroom 506, 1 Tile Water Damaged; Between 505/506, 1 Tile Water Damaged and 1 Tile is broken; Classroom 507, 2 Tiles Water Damaged; and, Classroom 508, 3 Tiles broken, and 1 Tile water stained. No other changes as of this date.		
12/01/2011	Additional Damage observed - in the form of Classroom 502 and 507 each have 1 broken Tile. Classroom 508 has an additional Tile Water stained. Also, Storage Room of Classroom 501 and 502 has 1 additional Tile Water Damaged. No other changes as of this date.		
09/26/2013	Material Re-Assessed. Material changed from GOOD to FAIR condition. No other changes as of this date.		
03/19/2015	Tiles are White with a pitted mark form pattern. Original Entry updated. This Material is unchanged as of this date.		
09/18/2015	Damage Re-Assessed. Repairs made to following rooms: Classroom 501, Classroom 502 and Classroom 508. Damages are currently as follows for the following rooms: Storage Room between Classrooms 501 and 502 has 2 Tiles Physically Damaged, Classroom 503 has 2 Water Damaged Tiles and 1 Tile Physically Damaged, Storage Room between Classrooms 503 and 504 has 3 Water Damaged Tiles, Classroom 504 has 2 Water Damaged Tiles, Classroom 506 has 2 Water Damaged Tiles, Storage Room between Classrooms 505 and 506 has 1 Physically Damaged Tile and Classroom 507 has 1 Water Damaged Tile and 1 Physically Damaged Tile. Additional Damage observed, Classroom 505 has 3 Tiles Physically Damaged. No other changes as of this date.		
09/15/2016	Additional Damage observed. Damage is as follows: Room 501 has 2 Tiles with Water Damage and 1 broken Tile; Workroom for 503 and 504 has 1 Tile with Water Damage; Room 506 has 2 Tiles with Water Damage; and Room 508 has 2 Tiles with Water Damage. No other changes as of this date.		
04/03/2017	Additional Damage Observed. 4 Tiles have Water Damage and 1 Tile is Broken in Classroom 501. No other changes as of this date.		
02/16/2018	Material Re-assessed. Some Water Damage has been Painted Over. Remains in FAIR condition. No other changes as of this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	Additional Damage Observed. <5% Physical Damage in the form of a total of 3 Ceiling Tiles with Water Stains in Classroom 506. Material Condition remains in FAIR condition overall. No other changes as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	Additional Damage Observed. 2 Tiles with Water Stains and 1 Tile with 2 LF Crack in Workroom next to RSP Room. No other changes as of this date.		
02/21/2021	Additional Damage Observed. <5% Physical Damage in the form of 1 Tile with a Cracked Corner in Classroom 502. Material remains in FAIR condition overall. No other changes as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		

DAMAGE REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESSMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	--------------------------	----------	----------------------	---

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

CLASSROOMS 501-506 BUILDING (BUILDING 500)

ENTIRE BUILDING

CEMENTITIOUS MISCELLANEOUS

50 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

08/29/2014 Exterior A/C Cementitious Window Panel. Replacement on lower and upper Window Panel. Only on Some areas. This Material is in GOOD condition as of this date.

09/15/2016 Damage observed. Damage: <5% Physical Damage - in the form of 1 broken Panel in Room 503. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.

08/15/2018 Material Re-assessed. Partial Repairs made to Broken Panel in Classroom 503. Panel is Partially Covered with Plywood. No other changes as of this date.

02/08/2019 This Material is unchanged as of this date.

08/16/2019 This Material is unchanged as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/21/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

CLASSROOMS 501-506 BUILDING (BUILDING 500)

ENTIRE BUILDING INCLUDING RESTROOMS, STORAGE ROOMS AND UTILITY ROOMS

SMOOTH WALL MISCELLANEOUS

38,500 SF

P: Less Than 5%

W: <10% Stains or Flaking

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/14/2005 GYPSUM WALLBOARD SYSTEM WALLS AND CEILINGS. MATERIAL ASSUMED TO EXIST UNDER 4'X8' VINYL COVERED WALL PANELS. This Material is in GOOD condition as of this date.

DAMAGE REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESSMENT CATEGORY	COMMENTS
			QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)

03/09/2007	Material Description changed from ' GYPSUM WALLBOARD SYSTEM WALLS aND CEILINGS. MATERIAL aSSUMED tO eXIST uNDER 4'X8' VINYL COVERED WALL PANELS. ' to ' Gypsum Wallboard System Walls and Ceilings. (Material is also under 4'x8' Vinyl Covered Wall Panels). ' No other changes as of this date.			
02/01/2010	Samples 10-019 NW-55 (Joint Tape / Compound), and NW-56 (Drywall) collected on this date.			
04/12/2012	Damage: <5% Physical Damage - in the form of approximately 1 SF of missing paint on Ceiling, and Joint Tape & Mud is exposed; <10% Water Damage - in the form of Water Damage observed at Main Entrance, between Classrooms 503 & 504. Material condition changed from GOOD to FAIR overall as of this date. No other changes as of this date.			
09/18/2015	Additional Damages observed. Center Classroom has 1/2 SF of Physical Damage, Storage Rooms between Rooms 505 and 506 have minor holes and cuts. No other changes as of this date.			
09/15/2016	Additional Damage observed. Classroom 504 has a small hole, approximately 2"x2". No other changes as of this date.			
02/08/2019	This Material is unchanged as of this date.			
08/16/2019	This Material is unchanged as of this date.			
01/31/2020	This Material is unchanged as of this date.			
09/01/2020	This Material is unchanged as of this date.			
02/21/2021	This Material is unchanged as of this date.			
02/23/2022	This Material is unchanged as of this date.			
08/19/2022	This Material is unchanged as of this date.			
02/17/2023	This Material is unchanged as of this date.			
08/18/2023	This Material is unchanged as of this date.			
02/16/2024	This Material is unchanged as of this date.			

CLASSROOMS 501-506 BUILDING (BUILDING 500)

ENTIRE BUILDING INCLUDING RESTROOMS, STORAGE ROOMS AND UTILITY ROOMS

SMOOTH WALL SURFACING

38,500 SF

P: Less Than 5%

W: <10% Stains or Flaking

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

08/25/2006	Skim Coat for Gypsum Wallboard System Walls and Ceilings. Material Assumed to exist Under 4'X8' Vinyl Covered Wall Panels. This Material is in GOOD condition as of this date.			
03/09/2007	Material Description changed from ' Skim Coat for GYPSUM WALLBOARD SYSTEM WALLS aND CEILINGS. MATERIAL aSSUMED tO eXIST uNDER 4'X8' VINYL COVERED WALL PANELS. ' to ' Skim Coat for Gypsum Wallboard System Walls and Ceilings. (Material is also under 4'x8' Vinyl Covered Wall Panels). ' No other changes as of this date.			

DAMAGE REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME		QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
LOCATION	MATERIAL TYPE		
RISK ASSESSMENT CATEGORY			
COMMENTS			
04/12/2012	Damage: <5% Physical Damage - in the form of approximately 1 SF of missing paint on Ceiling, and Joint Tape & Mud is exposed; <10% Water Damage - in the form of water damage observed at Main Entrance, between Classrooms 503 & 504. Material condition changed from GOOD to FAIR overall as of this date. No other changes as of this date.		
09/26/2013	Friability changed from Moderate to Low. No other changes as of this date.		
03/07/2014	Friability changed from Low to Moderate. No other changes as of this date.		
09/18/2015	Additional Damages observed. Center Classroom has 1/2 SF of Physical Damage, Storage Rooms between Rooms 505 and 506 have minor holes and cuts. No other changes as of this date.		
09/15/2016	Additional Damage observed. Classroom 504 has a small hole, approximately 2"x2". No other changes as of this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/21/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		

CLASSROOMS 501-506 BUILDING (BUILDING 500)

EXTERIOR WINDOWS

CAULKING

900 LF

P: Less Than 5%

W: <10% Stains or Flaking

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/08/2009	Caulking on Exterior Windows. Damage: <5% Physical Damage and <10% Water Damage due to existing missing and damaged sections of material, and heat and moisture degradation factors in various locations. This Material is in FAIR condition as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/21/2021	Additional Damage Observed. <5% Physical Damage in the form of 3 LF of Cracks on Window of Classroom 503. Material remains in FAIR condition overall. No other changes as of this date.

DAMAGE REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME		QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
LOCATION	MATERIAL TYPE		
RISK ASSESMENT CATEGORY			
COMMENTS			

02/23/2022	This Material is unchanged as of this date.
08/19/2022	This Material is unchanged as of this date.
02/17/2023	This Material is unchanged as of this date.
08/18/2023	This Material is unchanged as of this date.
02/16/2024	This Material is unchanged as of this date.

DAMAGE REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

CLASSROOMS

SUSPENDED CEILING TILE	2,040 SF	P: Less Than 5% W: No Evidence
------------------------	----------	-----------------------------------

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/14/2005	2'x4' Vinyl Covered Fiberglass Suspended Ceiling Tile. Tiles are White with a smooth texture on fiberglass panel. This Material is in GOOD condition as of this date. (Original Entry updated 03/19/15.)
03/09/2007	Location Name changed from PORTABLE DAYCARE - CDC to CLASSROOMS. No other changes as of this date.
11/09/2007	Material re-assessed. Damage: <5% Physical Damage - due to 14 Tiles with minor holes and cuts. Friability changed from Low to Moderate. Material condition change from GOOD to FAIR overall.
12/01/2011	Additional Damage - in the form of several Tiles are Damaged. No other changes as of this date.
03/19/2015	Tiles are White with a smooth texture on fiberglass panel. Original Entry updated. This Material is unchanged as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.
08/19/2022	This Material is unchanged as of this date.
02/17/2023	This Material is unchanged as of this date.
08/18/2023	This Material is unchanged as of this date.
02/16/2024	This Material is unchanged as of this date.

DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

CLASSROOMS

VINYL FLOOR TILE	960 SF	P: Less Than 10% W: No Evidence
------------------	--------	------------------------------------

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/14/2005	6"x4' Light Brown Wood Design Vinyl Floor Tile. This Material is in GOOD condition overall as of this date. (Original entry updated 8/19/22)
------------	--

DAMAGE REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
RISK ASSESSMENT CATEGORY	COMMENTS			

08/25/2006	Quantity changed from 1,265 SF to 960 SF. No other changes as of this date.
03/09/2007	Location Name changed from PORTABLE DAYCARE - CDC to CLASSROOMS. No other changes as of this date.
09/18/2015	Material Description Re-Assessed. Material is Pink. Material description changed from '12"X12" tan VINYL FLOOR TILE' to ' 12"X12" Pink VINYL FLOOR TILE'. Original entry updated. No other changes as of this date.
04/03/2017	Additional Damage Observed. 2 Broken Tiles near Restroom area. No other changes as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.
08/19/2022	Material Re-Assessed. Material not observed, Material may exist under current 6"x4' Light Brown Wood Design Vinyl Floor Tile. No other changes as of this date.
02/17/2023	This Material is unchanged as of this date.
08/18/2023	This Material is unchanged as of this date.
02/16/2024	This Material is unchanged as of this date.

DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

CLASSROOMS

VINYL FLOOR TILE MASTIC	960 SF	P: Less Than 10% W: No Evidence
-------------------------	--------	------------------------------------

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/14/2005	6"x4' Light Brown Wood Design Vinyl Floor Tile. This Material is in GOOD condition overall as of this date. (Original entry updated 8/19/22)
08/25/2006	Material Quantity changed from 1,265 SF to 960 SF. No other changes as of this date.
03/09/2007	Location Name changed from PORTABLE DAYCARE - CDC to CLASSROOMS. No other changes as of this date.
09/18/2015	Material Description Re-Assessed. Material is Pink. Material description changed from '12"X12" tan VINYL FLOOR TILE' to ' 12"X12" Pink VINYL FLOOR TILE'. Original entry updated. No other changes as of this date.
04/03/2017	Additional Damage Observed. 2 Broken Tiles near Restroom area. No other changes as of this date.
02/08/2019	This Material is unchanged as of this date.

DAMAGE REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

08/16/2019	This Material is unchanged as of this date.					
01/31/2020	This Material is unchanged as of this date.					
09/01/2020	This Material is unchanged as of this date.					
02/12/2021	This Material is unchanged as of this date.					
08/13/2021	This Material is unchanged as of this date.					
02/23/2022	Material Re-Assessed. Material not observed, Material may exist under current 6"x4' Light Brown Wood Design Vinyl Floor Tile. No other changes as of this date.					
08/19/2022	This Material is unchanged as of this date.					
02/17/2023	This Material is unchanged as of this date.					
08/18/2023	This Material is unchanged as of this date.					
02/16/2024	This Material is unchanged as of this date.					

DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

CLASSROOMS, OFFICE AND STORAGE ROOM

CARPET MASTIC	150 SF	P: Less Than 5% W: No Evidence
---------------	--------	-----------------------------------

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/14/2005	Mastic/Adhesive for Brown and Blue Carpets. This Material is in GOOD condition as of this date.					
08/25/2006	Material Quantity changed from 675 SF to 1,000 SF. No other changes as of this date.					
03/09/2007	Location Name changed from PORTABLE DAYCARE - CDC to CLASSROOMS. No other changes as of this date.					
09/02/2010	Material Re-assessed. (Classroom & Office - 95% Brown - ; Carpet in Storage Room - 5% Blue). This Material is unchanged as of this date.					
12/01/2011	Location Description changed from CLASSROOMS to CLASSROOMS, OFFICE AND STORAGE ROOM. No other changes as of this date.					
03/07/2014	1 SF is Damaged. This Material is in FAIR condition. Friability changed from Non-Friable to Friable. No other changes as of this date.					
02/08/2019	This Material is unchanged as of this date.					
08/16/2019	This Material is unchanged as of this date.					
01/31/2020	This Material is unchanged as of this date.					
09/01/2020	This Material is unchanged as of this date.					
02/12/2021	This Material is unchanged as of this date.					
08/13/2021	This Material is unchanged as of this date.					
02/23/2022	This Material is unchanged as of this date.					

DAMAGE REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

08/19/2022	Location Re-Assessed. Material only observed in Storage Room, Material may exist under current Gray Black Carpet. Location Description changed from CLASSROOMS, OFFICE AND STORAGE ROOM to STORAGE ROOM. Material may exist under current Gray Black Carpet. Material Quantity changed from 1,000 SF to 150 SF. No other changes as of this date.					
02/17/2023	This Material is unchanged as of this date.					
08/18/2023	This Material is unchanged as of this date.					
02/16/2024	This Material is unchanged as of this date.					

DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

RESTROOMS (1 EA BOYS' AND GIRLS'), STAFF ROOM, AND CUSTODIAN ROOM

VINYL SHEETING

140 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/14/2005	Beige Vinyl Sheeting. This Material is in GOOD condition as of this date.					
08/25/2006	Material Quantity changed from 100 SF to 140 SF. No other changes as of this date.					
03/09/2007	Location Name changed from PORTABLE DAYCARE - CDC TWO RESTROOMS to RESTROOMS (2). No other changes as of this date.					
09/02/2010	Location Description changed from RESTROOMS (2) to RESTROOMS (2 - BOYS' AND GIRLS'), STAFF ROOM, AND CUSTODIAN ROOM. Material located on Walls and Floor. No other changes as of this date.					
12/01/2011	Location Description changed from RESTROOMS (2) to RESTROOMS (1 EA- BOYS' AND GIRLS'), STAFF ROOM, AND CUSTODIAN ROOM. Damage: <5% Physical Damage - in the form of approximately 4 SF is missing in Custodian Room. Material condition changed from GOOD to FAIR overall as of this date.					
04/03/2017	Additional Damage Observed. 1 SF of Cracked and Broken Flooring in Both the Boys Restroom and Girls Restroom. No other changes as fo this date.					
02/08/2019	This Material is unchanged as of this date.					
08/16/2019	This Material is unchanged as of this date.					
01/31/2020	This Material is unchanged as of this date.					
09/01/2020	This Material is unchanged as of this date.					
02/12/2021	This Material is unchanged as of this date.					
08/13/2021	This Material is unchanged as of this date.					
02/23/2022	This Material is unchanged as of this date.					
08/19/2022	This Material is unchanged as of this date.					
02/17/2023	This Material is unchanged as of this date.					
08/18/2023	This Material is unchanged as of this date.					
02/16/2024	This Material is unchanged as of this date.					

DAMAGE REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
RISK ASSESMENT CATEGORY	COMMENTS			

DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

RESTROOMS (1 EA BOYS' AND GIRLS'), STAFF ROOM, AND CUSTODIAN ROOM

VINYL SHEETING BACKING PAPER/MASTIC

140 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/14/2005	Backing Paper/Adhesive for Beige Vinyl Sheeting. This Material is in GOOD condition as of this date.
08/25/2006	Material Quantity changed from 100 SF to 140 SF. No other changes as of this date.
03/09/2007	Location Name changed from PORTABLE DAYCARE - CDC TWO RESTROOMS to RESTROOMS (2). No other changes as of this date.
12/01/2011	Location Description changed from RESTROOMS (2) to RESTROOMS (1 EA- BOYS' AND GIRLS'), STAFF ROOM, AND CUSTODIAN ROOM. Damage: <5% Physical Damage - in the form of approximately 4 SF is missing in Custodian Room. Material condition changed from GOOD to FAIR overall as of this date.
04/03/2017	Additional Damage Observed. 1 SF of Cracked and Broken Flooring in Both the Boys Restroom and Girls Restroom. No other changes as fo this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.
08/19/2022	This Material is unchanged as of this date.
02/17/2023	This Material is unchanged as of this date.
08/18/2023	This Material is unchanged as of this date.
02/16/2024	This Material is unchanged as of this date.

DAMAGE REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

DAYCARE PORTABLE BUILDING - FED CHILDCARE (BUILDING 900)

DAYCARE PORTABLE BUILDING - FED CHILDCARE (BUILDING 900)

CLASSROOM

SUSPENDED CEILING TILE

960 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/14/2005	2'x4' Suspended Ceiling Tile. Tiles are White with 'chicken feet' mark form pattern. Some replacement Tiles have a pin hole form pattern. Some replacement Tiles are White with a rough texture form pattern on a plastic cover on yellow fiberglass panel. This Material is in GOOD condition as of this date. (Original entry updated 03/19/15).
12/01/2011	Damage: <5% Physical Damage - in the form of Restroom has 2 broken Tiles and 1 hole observed; <10% Water Damage - in the form of 1 Tile is Water Damaged. Material condition changed from GOOD to FAIR overall as of this date. No other changes as of this date.
03/07/2014	Water Damaged Tiles have been replaced. No other changes as of this date.
03/19/2015	Tiles are White with 'chicken feet' mark form pattern. Some replacement Tiles have a pin hole form pattern. Some replacement Tiles are White with a rough texture form pattern on a plastic cover on yellow fiberglass panel. Original Entry updated. This Material is unchanged as of this date.
09/18/2015	Additional Damage observed. 2 Tiles Water Damaged, and Classroom has 4 Tiles Physically Damaged. No other changes as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.
08/19/2022	This Material is unchanged as of this date.
02/17/2023	This Material is unchanged as of this date.
08/18/2023	This Material is unchanged as of this date.
02/16/2024	This Material is unchanged as of this date.

End Of Report, Total Of 45 Pages

Northwood Elementary School

2760 E. Trimble Road
San Jose, CA 95132
(408)923-1940

Field

Park

Playground

Lakewood Drive

Bus Loop

NORTHWOOD ELEMENTARY SCHOOL
INSPECTED ON: 4-2-91-2

900
Bldg.
1846

801 Bldg.
3081
Music-Rocco

800 Bldg.
3080
Music-Amador

600
Bldg.
1943
SJB

Pre School
Playground

Parking Lot

Trimble Road

802 Bldg.
3082
4/5-Vaughn

803 Bldg.
3083
Isolation

404
3044
3-Shem
403
3043
Speech
402
3042
3-Cheadle
405
3045
406
3046
Teaching
Coach
401
3041
3-Walker
Library
3135
400 Bldg.
Student
Restroom

Flag

508
3058
SW-Stiggall
Student
Restroom
500 Bldg.
501
3051
5-Higashi
506
3056
1-Santa Cruz
507
3057
RSP
5-Boyd
505
3055
K-Lam
504
3054
Wait-Reading tutor
503
3053
4-Sundaram
3/4-Kim

Lunch
Tables

309
3039
Psych
300 Bldg.
306
3036
2-Shalkh
301
3031
2-Orth
302
3032
1-Lee
FIS
305
3035
1/2-Huynh
303
3033
1-Williamson
2-Kinney
304
3034
Student
Restroom

PTA
Room
Staff
Lounge
3130
Principal
Office
3110
Multi
Kitchen
3145
Nurse/CUM
3125
Conf. Rm
3120
Front office
3101-3100
Supply
room
100 Bldg.

700
Bldg.
SJB
Office

200 Bldg.
202
3022
K-Helfenberger
201
3021
K-Hyburger

Northwood Elementary School
2760 E. Trimble Road
San Jose, CA 95132
(408)923-1940

Field

802 Bldg.
3082
4/5-Vaughn

803 Bldg.
3083
Isolation

Park

Playground

801 Bldg.
3081
Music-Rocco

800 Bldg.
3080
Music-Amador

900
Bldg.
1846

404
3044
3-Shem
403
3043
Speech
402
3042
3-Cheadle
405
3045
406
3046
Teaching
Coach
400 Bldg.
Library
3135
401
3041
3-Walker
Student
Restroom

Flag

508
3058
SW-Stiggall
Student
Restroom
500 Bldg.
501
3051
5-Higashi
506
3056
1-Santa Cruz
507
3057
RSP
5-Boyd
505
3055
K-Lam
504
3054
Watt-Reading tutor
503
3053
4-Sundaram
3/4-Kim

600
Bldg.
1943
SJB

Bus Loop

Student
Restroom

309
3039
Psych
300 Bldg.
306
3036
2-Shalkh
301
3031
2-Orth
FIS
302
3032
1-Lee
1/2-Huynh
305
3035
303
3033
1-Williamson
2-Kinney
304
3034

Lunch
Tables

PTA
Room
Multi
Supply
room
100 Bldg.
Kitchen
3145
Nurse/CUM
3125
Principal
Office
3110
Conf. Rm
3120
Front office
3101-3100

700
Bldg.
SJB
Office

Pre School
Playground

Parking Lot

200 Bldg.

202
3022
K-Heffenberger
201
3021
K-Hybarger

NORTHWOOD ELEMENTARY SCHOOL
INSPECTED ON: 8-18-2023

Lakewood Drive

Trimble Road

Northwood Elementary School

2760 E. Trimble Road
San Jose, CA 95132
(408)923-1940

Field

802 Bldg.

3082

4/5-Vaughn

803 Bldg.

3083

Isolation

Park

Playground

Lakewood Drive

900

Bldg.
1846

801 Bldg.

3081

Music-Rocco

800 Bldg.

3080

Music-
Amador

600

Bldg.
1943

SJB

404

3044

3-Shem

403

3043

Speech

402

3-Cheadle

405

3045

Teaching

Coach

400 Bldg.

Library

3135

401

3041

3-Walker

Student
Restroom

Flag

508

3058

SW-Siggall

500 Bldg.

506

3056

1-Santa Cruz

5-Higashi

507

3057

RSP

5-Boyd

507

3059

Wait-Reading tutor

503

3053

4-Sundaram

3/4-Kim

Student
Restroom

501

3051

502

3052

5-Boyd

507

3057

RSP

5-Boyd

507

3059

Wait-Reading tutor

503

3053

4-Sundaram

3/4-Kim

700

Bldg.

SJB

Office

Pre School
Playground

Parking Lot

Trimble Road

PTA Room
Staff Lounge 3130
Principal Office 3110
Multi
100 Bldg.
Kitchen 3145
Nurse/CUM 3125
Conf. Rm 3120
Front office 3101-3100
Supply room

Student Restroom
309
3039
Psych
300 Bldg.
306
3036
2-Shalkh
301
3031
2-Orth
FIS
302
3032
1-Lee
305
3035
1/2-Huynh
303
3033
1-Williamson
2-Kinney

Bus Loop

NORTHWOOD ELEMENTARY SCHOOL
INSPECTED ON: 2/13/23

200 Bldg.
202
3022
K-Helfenberger
201
3021
K-Hyarger

Northwood Elementary School

2760 E. Trimble Road
San Jose, CA 95132
(408) 923-1940

Field

Park

Playground

Lakewood Drive

Bus Loop

NORTHWOOD ELEMENTARY SCHOOL
INSPECTED ON: 08-19-2022

801 Bldg.
3081

900 Bldg.
Federal
Pre-School
1846
1846

800 Bldg.
3080

Flag

509 3059
506 3056
507 3057
505 3055
504 3054
501 3051
502 3052
503 3053

301 3031
302 3032
303 3033
306 3036
307 3038
305 3035
304 3034
316 (Speech)
3039

Middle
Quad
Patio

600 Bldg.
Child
Development
1943

700 Bldg.
State Pre-school
1944

Playground

100 Bldg.
Lounge 3130
Multipurpose Room
Conference Room
Nurse 3125
Front Office 3100 & 3101

202 3022
201 3021
200 Bldg.

Parking Lot

Trimble Road

2760 E. Trimble Road
San Jose, CA 95132
(408)923-1940

**800 Bldg.
3080
Music-
Amador**

900
Bldg.
1846

600
Bldg.
1943

Pre School Playground

Parking Lot

802 Bldg.
3082
4/5-Vaug

803 Bldg.
3083
Isolation

Field

Park

Playground

Lakewood Drive

NORTHWOOD ELEMENTARY SCHOOL
INSPECTED ON: 08-19-2022

Bus Loop

700
Bldg.
SJB
Office

PTA Room	Multi	Supply room
Staff Lounge	100 Bldg.	
3130	Kitchen	Nurse/CUM
	3145	3125
Principal Office	Conf. Rm	Front office
3110	3120	3101-3100

100 Bldg.

200 Bldg.

202	201
3022	3021
K-Helfenberger	K-Hybart

Trimble Road

Northwood Elementary School 2760 E. Trimble Road San Jose, CA 95132 (408) 923-1940

Field










Park

Playground

Lakewood Drive

Bus Loop

NORTHWOOD ELEMENTARY SCHOOL
 INSPECTED ON: 2202-32-2022

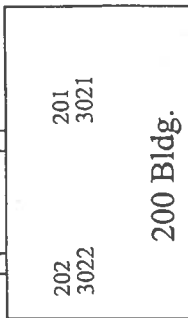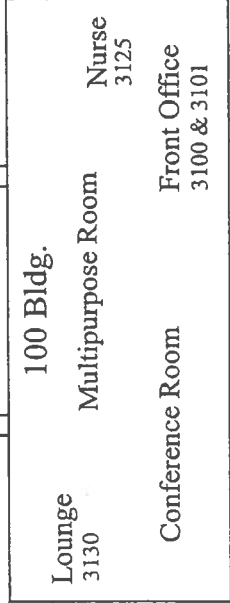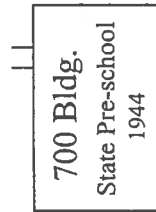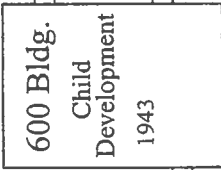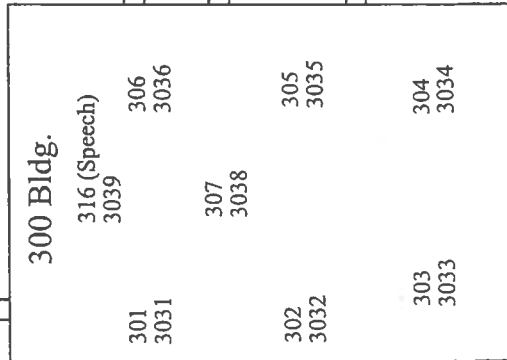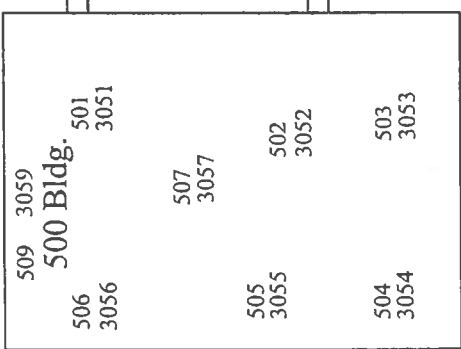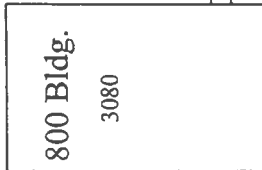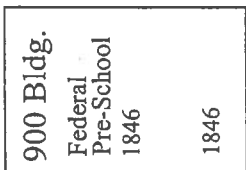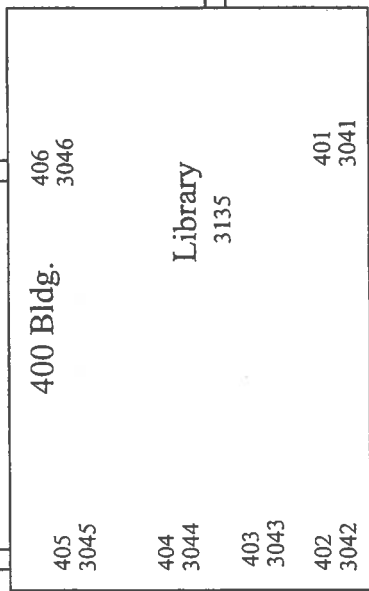

Playground

Parking Lot

Trimble Road

Northwood Elementary School

2760 E. Trimble Road
San Jose, CA 95132
(408) 923-1940

Field













Park

Playground

Lakewood Drive

Bus Loop

NORTHWOOD ELEMENTARY SCHOOL
INSPECTED ON: 12/31/8

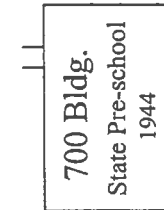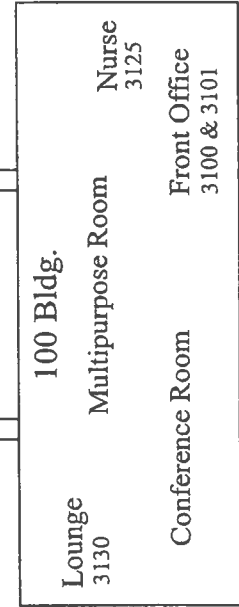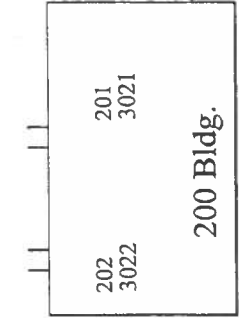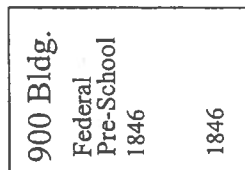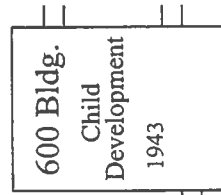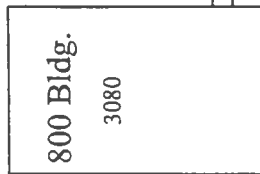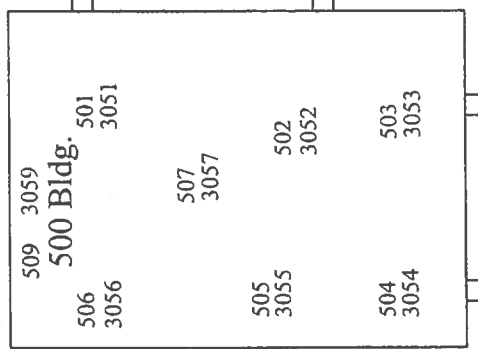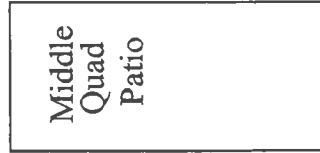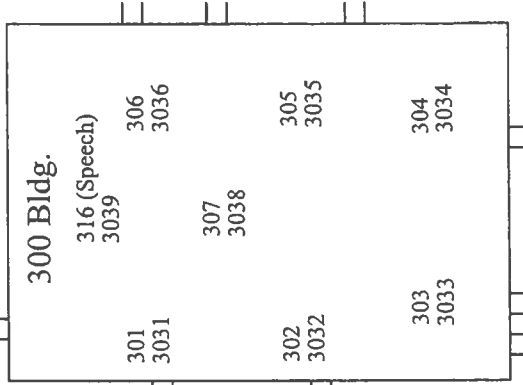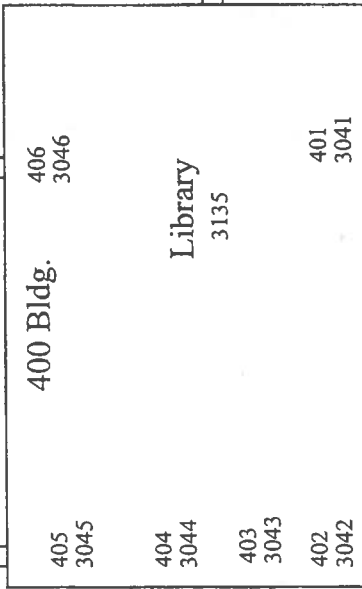

Playground

Parking Lot

Trimble Road

Northwood Elementary School
 2760 E. Trimble Road
 San Jose, CA 95132
 (408) 923-1940

Field












Park

Playground

Lakewood Drive

Bus Loop

NORTHWOOD ELEMENTARY SCHOOL
 INSPECTED ON 1/2/21

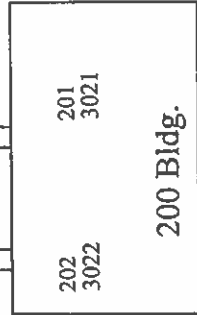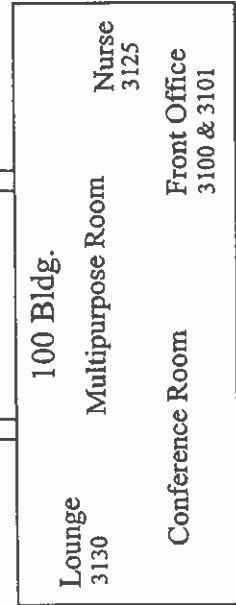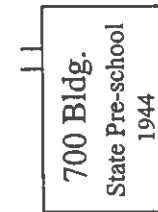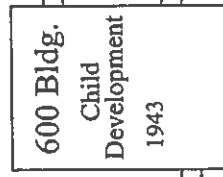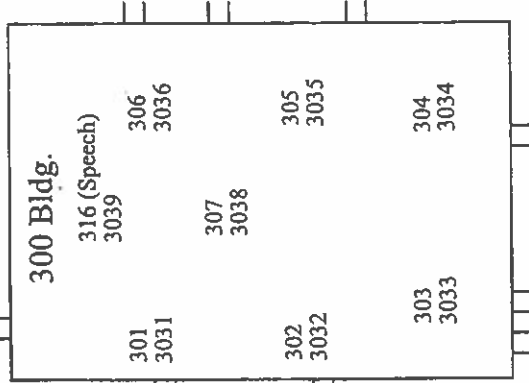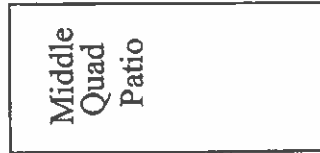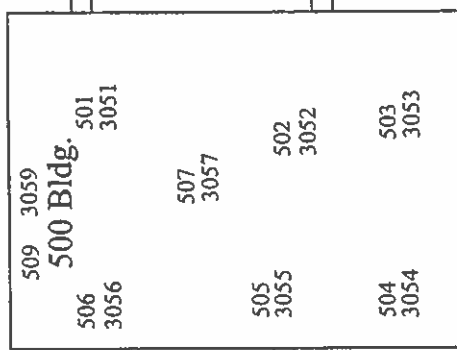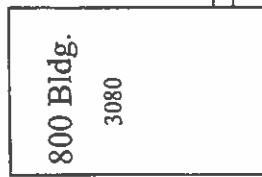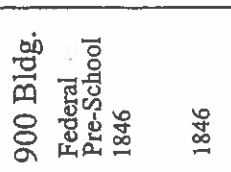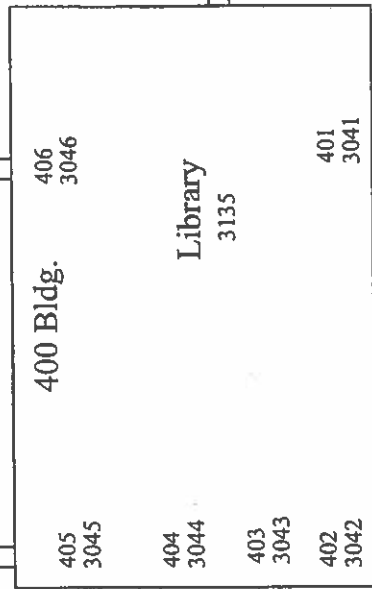

Playground

Parking Lot

Trimble Road

Northwood Elementary School

2760 E. Trimble Road

San Jose, CA 95132

(408) 923-1940

Field










Park

Playground



Lakewood Drive

Bus Loop

NORTHWOOD ELEMENTARY SCHOOL
INSPECTED ON: 02/11/96

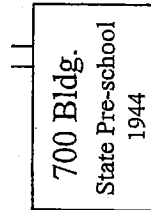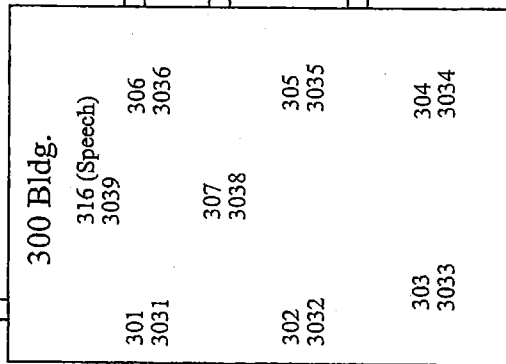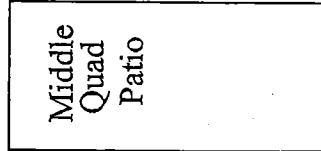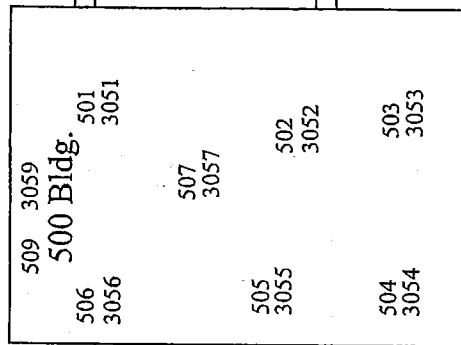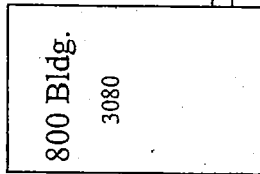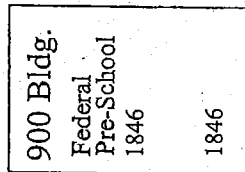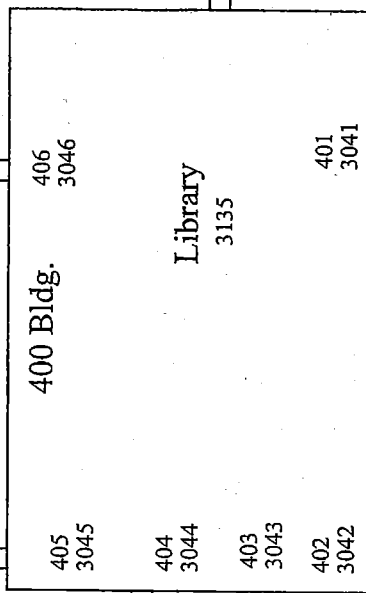

Playground

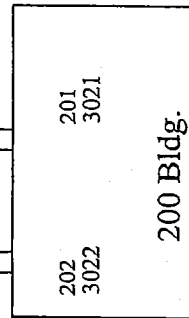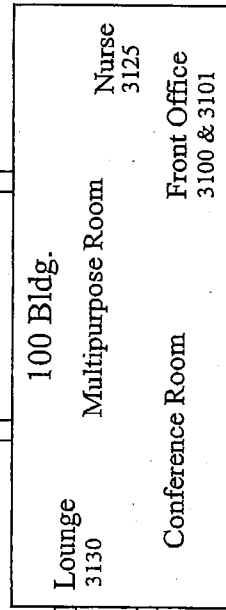

Parking Lot

Trimble Road

Northwood Elementary School

2760 E. Trimble Road
San Jose, CA 95132
(408) 923-1940

Field

Park

Playground

801 Bldg.
3081

900 Bldg.
Federal
Pre-School
1846
1846

800 Bldg.
3080

400 Bldg.
405 3045
406 3046
404 3044
403 3043
402 3042
Library
3135
401 3041

Flag

500 Bldg.
509 3059
506 3056
507 3057
505 3055
504 3054
501 3051
502 3052
503 3053

Middle
Quad
Patio

300 Bldg.
301 3031
302 3032
303 3033
304 3034
305 3035
306 3036
307 3038
316 (Speech)
3039

Bus Loop

600 Bldg.
Child
Development
1943

700 Bldg.
State Pre-school
1944

Playground

100 Bldg.
Lounge
3130
Multipurpose Room
Nurse
3125
Conference Room
Front Office
3100 & 3101

200 Bldg.
201 3021
202 3022

Parking Lot

Trimble Road

Lakewood Drive

NORTHWOOD ELEMENTARY SCHOOL
INSPECTED ON: 1-31-2020

Northwood Elementary School
 2760 E. Trimble Road
 San Jose, CA 95132
 (408) 923-1940

Field













Park

Playground

Lakewood Drive

Bus Loop

NORTHWOOD ELEMENTARY SCHOOL
 INSPECTED ON: 5/13/78

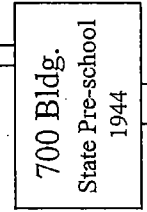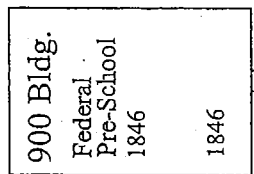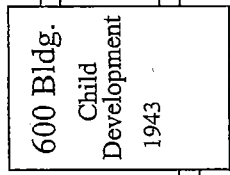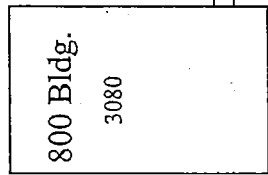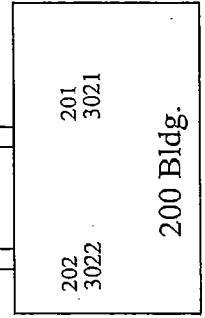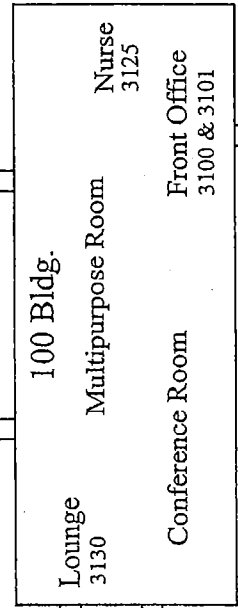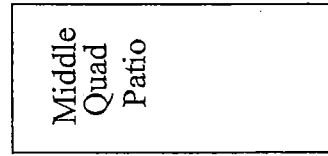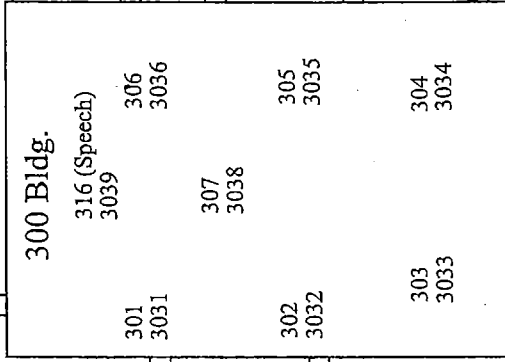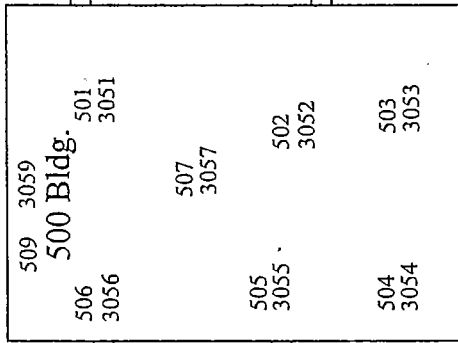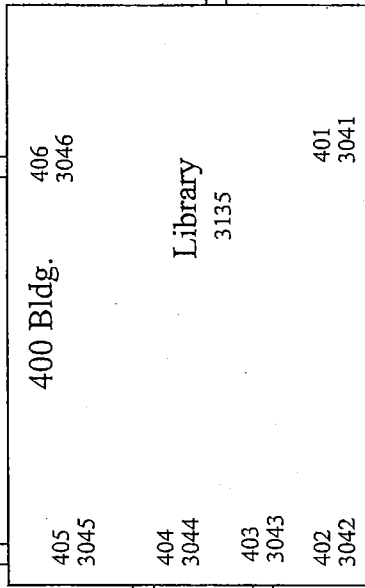

Playground

Parking Lot

Trimble Road

Northwood Elementary School

2760 E. Trimble Road
San Jose, CA 95132
(408) 923-1940

Field

Park

Playground

Lakewood Drive

Bus Loop

NORTHWOOD ELEMENTARY SCHOOL
INSPECTED ON: 6/02-8-02-2019

801 Bldg.
3081

900 Bldg.
Federal Pre-School
1846
1846

800 Bldg.
3080

600 Bldg.
Child Development
1943

700 Bldg.
State Pre-school
1944

Playground

Parking Lot

Trimble Road

400 Bldg.
405 3045
406 3046
404 3044
403 3043
402 3042
Library
3135
401 3041

Flag

509 3059
500 Bldg.
506 3056
507 3057
505 3055
502 3052
503 3053
504 3054

Middle Quad
Patio

300 Bldg.
316 (Speech)
3039
306 3036
307 3038
305 3035
304 3034
301 3031
302 3032
303 3033

100 Bldg.
Lounge 3130
Multipurpose Room
Nurse 3125
Conference Room
Front Office 3100 & 3101

200 Bldg.
202 3022
201 3021

Northwood Elementary School
 2760 E. Trimble Road
 San Jose, CA 95132
 (408) 923-1940

Field

Park

Playground

Lakewood Drive

Bus Loop

NORTHWOOD ELEMENTARY SCHOOL
 INSPECTED ON: 8/15/18

400 Bldg.

405 3045 406 3046

404 3044 403 3043 402 3042

Library 3135

401 3041

Flag

300 Bldg.

301 3031 302 3032 303 3033

316 (Speech) 3039 306 3036 307 3038 305 3035 304 3034

Middle Quad Patio

500 Bldg.

509 3059 506 3056 507 3057 505 3055 504 3054 501 3051 502 3052 503 3053

801 Bldg.

3081

800 Bldg.

3080

600 Bldg.

Child Development 1943

900 Bldg.

Federal Pre-School 1846 1846

200 Bldg.

202 3022 201 3021

100 Bldg.

Lounge 3130 Multipurpose Room 3125 Nurse 3125

Conference Room 3100 & 3101 Front Office 3100 & 3101

700 Bldg.

State Pre-school 1944

Playground

Parking Lot

Trimble Road

Northwood Elementary School

2760 E. Trimble Road
San Jose, CA 95132
(408) 923-1940

Field











Park

Playground

Lakewood Drive

Bus Loop

NORTHWOOD ELEMENTARY SCHOOL
INSPECTED ON: 8/16/18

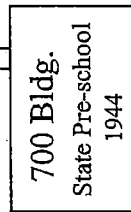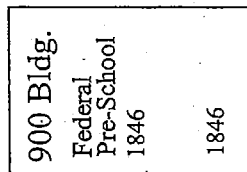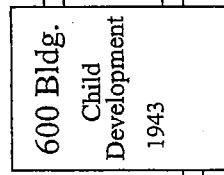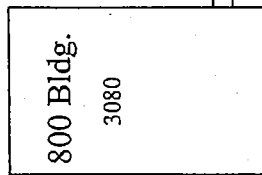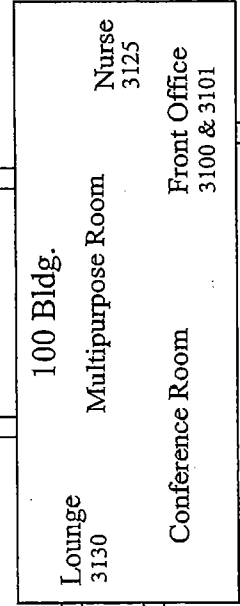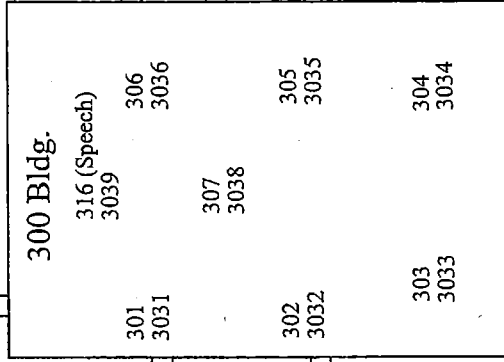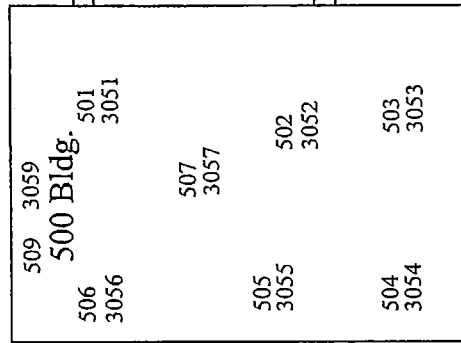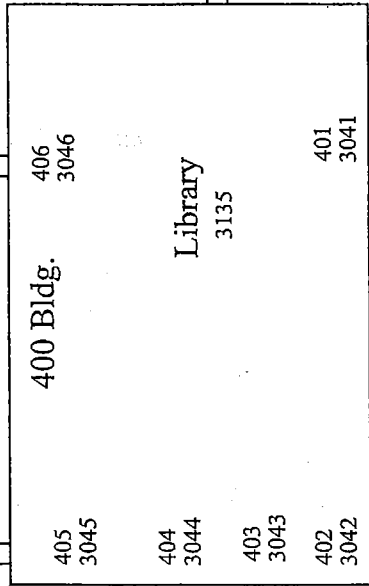

Playground

Parking Lot

Trimble Road

Northwood Elementary School

2760 E. Trimble Road
San Jose, CA 95132
(408) 923-1940

Field

Park

Playground

801 Bldg.
3081

900 Bldg.
Federal
Pre-School
1846
1846

800 Bldg.
3080

Flag

509 3059
500 Bldg. 501 3051
506 3056
507 3057
502 3052
505 3055
504 3054
503 3053

Middle
Quad
Patio

300 Bldg.
316 (Speech) 3039
306 3036
307 3038
305 3035
304 3034
303 3033
302 3032
301 3031

Bus Loop

NORTHWOOD ELEMENTARY SCHOOL
INSPECTED ON: 8/10/81

600 Bldg.
Child
Development
1943

700 Bldg.
State Pre-school
1944

Playground

100 Bldg.
Lounge 3130
Multipurpose Room
Nurse 3125
Conference Room
Front Office 3100 & 3101

200 Bldg.
202 3022
201 3021

Parking Lot

Trimble Road

Lakewood Drive

Northwood Elementary School
 2760 E. Trimble Road
 San Jose, CA 95132
 (408) 923-1940

Field











Park

Playground

Lakewood Drive

Bus Loop

NORTHWOOD ELEMENTARY SCHOOL
 INSPECTED ON: 4/3/17

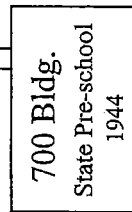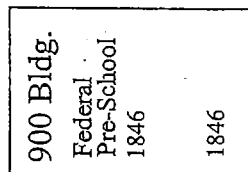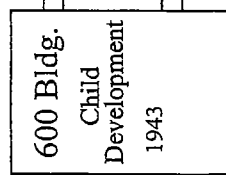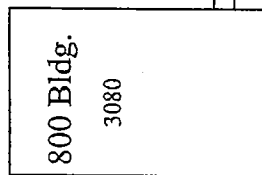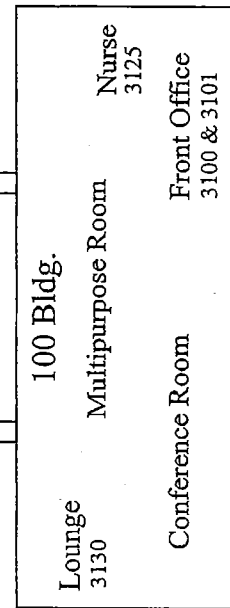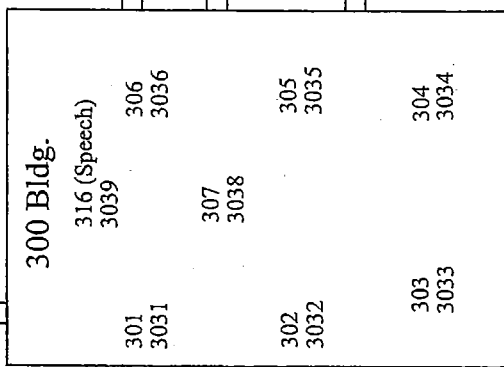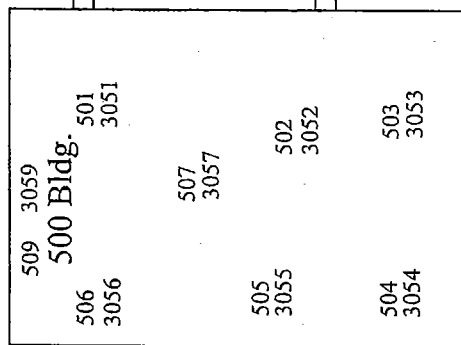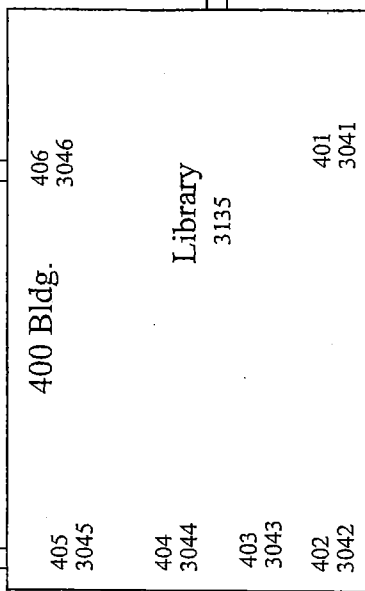

Playground

Parking Lot













Trimble Road

Northwood Elementary School
 2760 E. Trimble Road
 San Jose, CA 95132
 (408) 923-1940

Field

Park

Playground

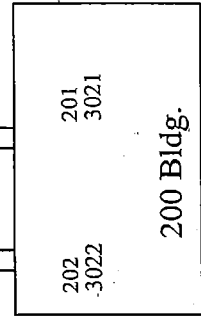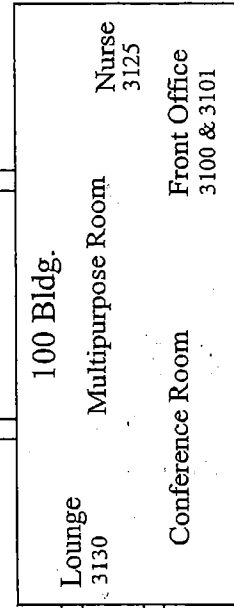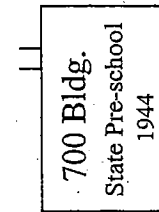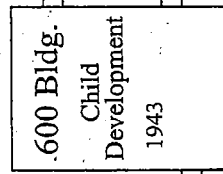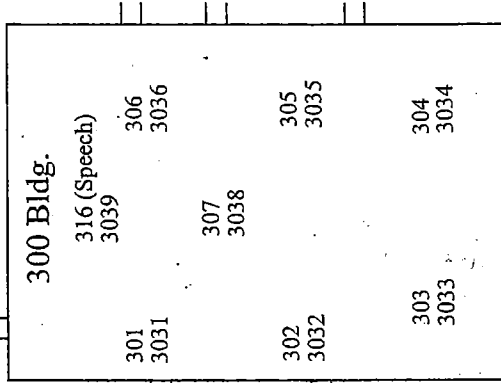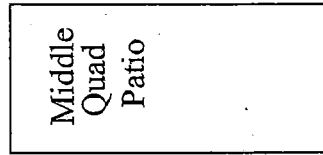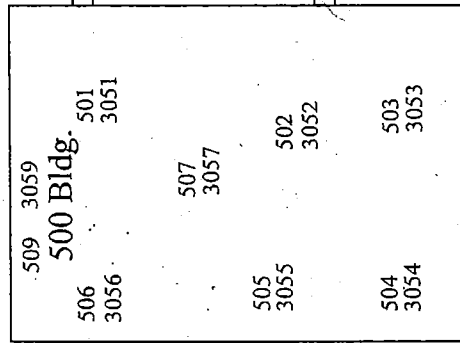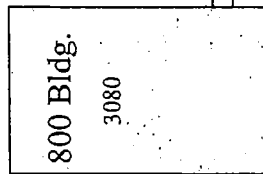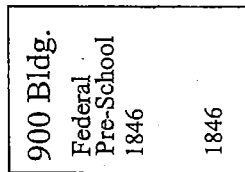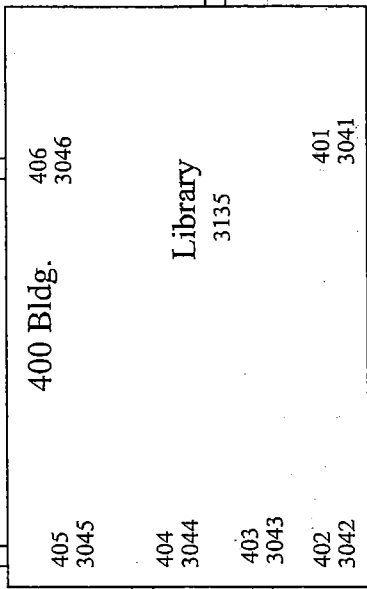

Bus Loop

Lakewood Drive

NORTHWOOD ELEMENTARY SCHOOL
 INSPECTED ON: 9/15/16

Trimble Road

Parking Lot

Playground

Northwood Elementary School
 2760 E. Trimble Road
 San Jose, CA 95132
 (408) 923-1940

Field












Park

Playground

Lakewood Drive

Bus Loop

NORTHWOOD ELEMENTARY SCHOOL
 INSPECTED ON: 9/02-12-30

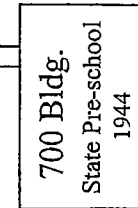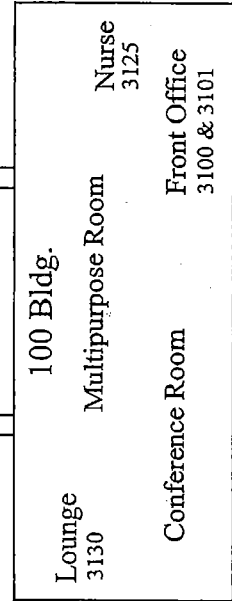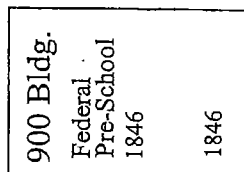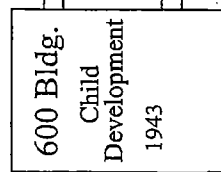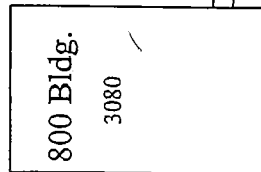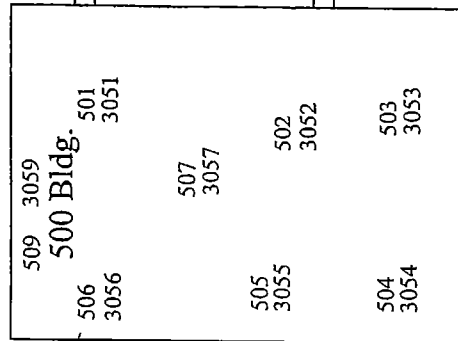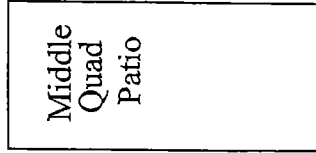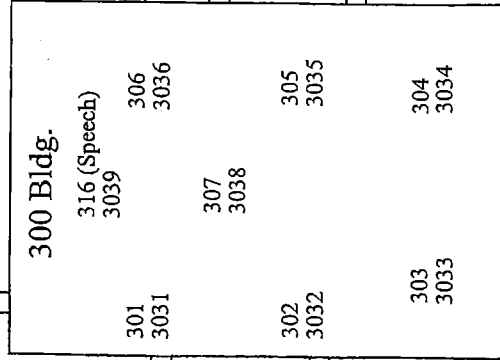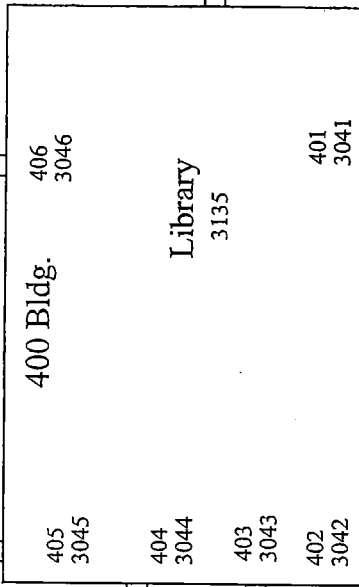

Playground

Parking Lot

Trimble Road

Northwood Elementary School 2760 E. Trimble Road San Jose, CA 95132 (408) 923-1940

Field

Park

Playground

801 Bldg.
3081

900 Bldg.
Federal
Pre-School
1846
1846

800 Bldg.
3080

509 3059
500 Bldg.
501 3051
506 3056
507 3057
502 3052
503 3053
505 3055
504 3054

Flag

Middle
Quad
Patio

300 Bldg.
316 (Speech)
3039
301 3031
306 3036
307 3038
302 3032
305 3035
303 3033
304 3034

Bus Loop

NORTHWOOD ELEMENTARY SCHOOL
 INSPECTED ON: 9-18-15

700 Bldg.
State Pre-school
1944

Playground

100 Bldg.
Lounge 3130
Multipurpose Room
Nurse 3125
Conference Room
Front Office 3100 & 3101

200 Bldg.
202 3022
201 3021

Parking Lot

Trimble Road

Lakewood Drive

Northwood Elementary School

2760 E. Trimble Road
San Jose, CA 95132
(408) 923-1940

Field













Park

Playground

Lakewood Drive

Bus Loop

NORTHWOOD ELEMENTARY SCHOOL
INSPECTED ON: 03-19-2015

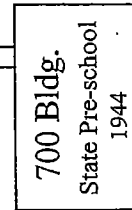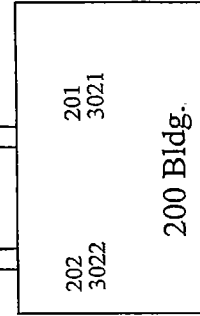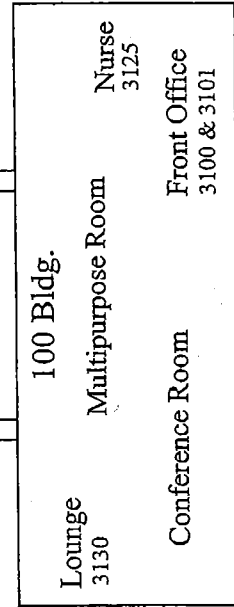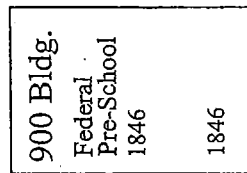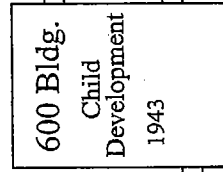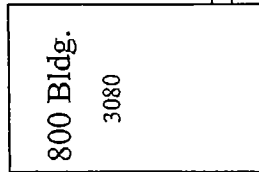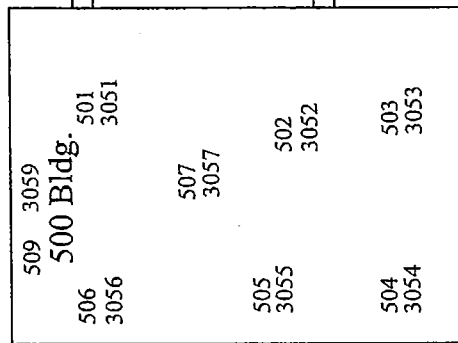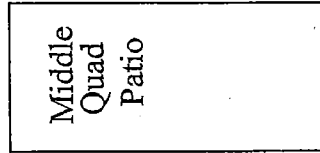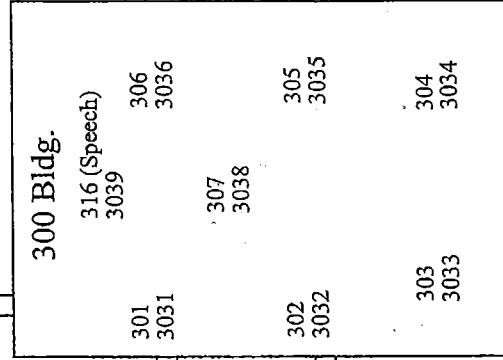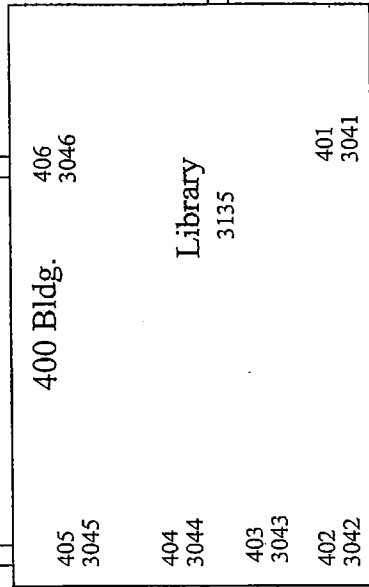

Playground

Parking Lot

Trimble Road

Northwood SCHOOL

2760 E. Trimble Road

San Jose, CA 95132

(408) 923-1940

Metal Container

801 Bldg.
Carabal (3)

900 Bldg.

Federal
Pre-School
Winquist,
Radford,
Bala

800 Bldg.

Tanaka (2)

509 Athwal (1)

500 Bldg.

506 Brown (SDC)
Boyd (4)
middle 507

501 Wong (4/5)

220
295

505 Serochi (SDC)
502 Burroughs(5)

504 Kramer(5)
503 Lyle(4)

600 Bldg.

Child
Development

Playground

Metal Containers



700 Bldg.

State Preschool
Wilburn (Pre)

100 Bldg.

Lounge

Multipurpose Room

Nurse

Conference Room

Front Office

200 Bldg.

202

LaTendresse (K)

201

Green (K)

Playground

Parking Lot

Field

Park

400 Bldg.

406 Williamson(1)

405 Heiss (1/2)

404 Helfenberger (K)

403 Lewis-Cook (3)

402 Cheadle II (3)

Library (middle 400)

401 Stinson (3)

Playground

Wood Shed



300 Bldg.

316 (Speech)

301 Orth (2/3)

306 Fujikawa(1)

307 RSP (middle) - Yee

302 Lui (1)

305 Evans/Lewis(2)

303 Brum (K)

304 Kinney (2)

**MIDDLE
QUAD
PATIO**

Bus Loop

NORTHWOOD ELEMENTARY SCHOOL
INSPECTED ON: 08-29-2014

NORTHWOOD ELEMENTARY SCHOOL
INSPECTED ON: 3-7-14

Bus Loop

Playground

Park

Playground

Field

Wood Shed

405 Heiss (1/2)
404 Helfenberger (K)
403 Lewis-Cook (3)
402 Cheadle II (3)
406 Williamson(1)
Library (middle 400)
401 Stinson (3)

300 Bldg.

316 (Speech)
306 Fujikawa(1)
307 RSP (middle) - Yee
305 Evans/Lewis(2)
304 Kinney (2)
303 Brum (K)
302 Lui (1)
301 Orth (2/3)



Flag

MIDDLE
QUAD
PATIO

509 Athwal (1)
500 Bldg.

506 Brown (SDC)
505 Serochi (SDC)
504 Kramer(5)
501 Wong (4/5)
502 Burroughs(5)
503 Lyle(4)
Boyd (4)
middle 507

800 Bldg.

Tanaka (2)

900 Bldg.

Federal
Pre-School
Winquist,
Radford,
Bala

600 Bldg.

Child
Development

700 Bldg.

State Preschool
Wilburn (Pre)

Playground

Metal Containers

100 Bldg.

Lounge
Multipurpose Room
Nurse
Conference Room
Front Office

200 Bldg.

202 LaTendresse (K)
201 Green (K)

Parking Lot

NORTHWOOD ELEMENTARY SCHOOL
INSPECTED ON: 09-26-2013

Bus Loop

Playground

Park

Field

Playground

Northwood SCHOOL
2760 E. Trimble Road
San Jose, CA 95132
(408) 923-1940

Metal Container

Metal Containers

Parking Lot

Wood Shed

900 Bldg.
Federal
Pre-School
Winquist,
Radford,
Bala

800 Bldg.
Tanaka (2)

801 Bldg.
Carabal (3)

400 Bldg.
405 Heiss (1/2)
404 Helfenberger (K)
403 Lewis-Cook (3)
402 Cheadle II (3)
406 Williamson(1)
Library (middle 400)
401 Stinson (3)



500 Bldg.
509 Athwal (1)
506 Brown (SDC)
Boyd (4)
middle 507
505 Serochi (SDC)
502 Burroughs(5)
503 Lyle(4)
504 Kramer(5)

MIDDLE
QUAD
PATIO

300 Bldg.
316 (Speech)
306 Fujikawa(1)
307 RSP (middle) - Yee
305 Evans/Lewis(2)
304 Kinney (2)
303 Brum (K)
302 Lui (1)

700 Bldg.
State Preschool
Wilburn (Pre)

100 Bldg.
Lounge
Conference Room
Multipurpose Room
Nurse
Front Office

200 Bldg.
202 LaTendresse (K)
201 Green (K)

600 Bldg.
Child
Development

NORTHWOOD ELEMENTARY SCHOOL
INSPECTED ON: 4/05/13

Bus Loop

Playground

Park

Field

Wood Shed

Playground

400 Bldg.

405 Heiss (1/2)
404 Helfenberger (K)
403 Lewis-Cook (3)
402 Cheadle II (3)
406 Williamson(1)
Library (middle 400)
401 Stinson (3)

Metal Container


801 Bldg.
Carabal (3)

900 Bldg.
Federal Pre-School
Winquist,
Radford,
Bala

800 Bldg.
Tanaka (2)

500 Bldg.

509 Athwal (1)
506 Brown (SDC)
501 Wong (4/5)
Boyd (4) middle 507
505 Serochi (SDC)
502 Burroughs(5)
503 Lyle(4)
504 Kramer(5)



MIDDLE
QUAD
PATIO

300 Bldg.

301 Orth (2/3)
306 Fujikawa(1)
307 RSP (middle) - Yee
302 Lui (1)
305 Evans/Lewis(2)
303 Brum (K)
304 Kinney (2)
316 (Speech)

600 Bldg.
Child Development

700 Bldg.
State Preschool
Wilburn (Pre)

100 Bldg.

Lounge
Conference Room
Multipurpose Room
Nurse
Front Office

200 Bldg.

202 LaTendresse (K)
201 Green (K)

Playground

Metal Containers

Parking Lot

Northwood SCHOOL

2760 E. Trimble Road

San Jose, CA 95132

(408) 923-1940

NORTHWOOD ELEMENTARY SCHOOL
INSPECTED ON: 10-11-12

Field

Park

Metal Container

Playground

400 Bldg.

405 Heiss (1/2)

404 Helfenberger (K)

403 Lewis-Cook (3)

402 Cheadle II (3)

406 Williamson(1)

Library (middle 400)

401 Stinson (3)



801 Bldg.

Carabal (3)

900 Bldg.

Federal
Pre-School
Winquist,
Radford,
Bala

800 Bldg.

Tanaka (2)

500 Bldg.

509 Athwal (1)

506 Brown (SDC)

505 Serochi (SDC)


504 Kramer(5)

501 Wong (4/5)

Boyd (4)
middle 507

502 Burroughs(5)

503 Lyle(4)



300 Bldg.

316 (Speech)

301 Orth (2/3)

302 Lui (1)

303 Brum (K)

306 Fujikawa(1)

307 RSP (middle) - Yee

305 Evans/Lewis(2)

304 Kinney (2)

**MIDDLE
QUAD
PATIO**

600 Bldg.

Child
Development

Playground

Metal Containers

700 Bldg.

State Preschool
Wilburn (Pre)

100 Bldg.

Lounge

Multipurpose Room

Conference Room

Nurse

Front Office

200 Bldg.

202 LaTendresse (K)

201 Green (K)

Playground

Parking Lot

Bus Loop

Northwood SCHOOL
2760 E. Trimble Road
San Jose, CA 95132
(408) 923-1940

NORTHWOOD ELEMENTARY SCHOOL
INSPECTED ON: 04-12-12

Field

Park

Playground

400 Bldg.

405 Heiss (1/2)
404 Helfenberger (K)
403 Lewis-Cook (3)
402 Cheadle II (3)

406 Williamson(1)
Library (middle 400)
401 Stinson (3)

Wood Shed

Metal Container


801 Bldg.
Carabal (3)

900 Bldg.
Federal
Pre-School
Winquist,
Radford,
Bala

800 Bldg.
Tanaka (2)

500 Bldg.

509 Athwal (1)
501 Wong (4/5)
506 Brown (SDC)
Boyd (4)
middle 507
505 Serochi (SDC)
502 Burroughs(5)
503 Lyle(4)
504 Kramer(5)



**MIDDLE
QUAD
PATIO**

300 Bldg.

316 (Speech)
306 Fujikawa(1)
307 RSP (middle) - Yee
305 Evans/Lewis(2)
304 Kinney (2)
303 Brum (K)
302 Lui (1)
301 Orth (2/3)

Bus Loop

600 Bldg.
Child
Development

700 Bldg.
State Preschool
Wilburn (Pre)

100 Bldg.

Lounge
Conference Room
Multipurpose Room
Nurse
Front Office

200 Bldg.

202 LaTendresse (K)
201 Green (K)

Playground

Metal Containers



Parking Lot

Northwood SCHOOL

2760 E. Trimble Road
San Jose, CA 95132
(408) 923-1940

NORTHWOOD ELEMENTARY SCHOOL
INSPECTED ON: 12-1-11

Field

Park

Metal Container

Playground

Bus Loop

Playground

Parking Lot

801 Bldg.
Carabal (3)

900 Bldg.
Federal
Pre-School
Winquist,
Radford,
Bala

800 Bldg.
Tanaka (2)

500 Bldg.
509 Athwal (1)
506 Brown (SDC)
501 Wong (4/5)
Boyd (4)
middle 507
502 Burroughs(5)
503 Lyle(4)
505 Serochi (SDC)
504 Kramer(5)

Flag

MIDDLE
QUAD
PATIO

300 Bldg.
316 (Speech)
301 Orth (2/3)
306 Fujikawa(1)
307 RSP (middle) - Yee
305 Evans/Lewis(2)
302 Lui (1)
303 Brum (K)
304 Kinney (2)

Playground

Metal Containers

700 Bldg.
State Preschool
Wilburn (Pre)

100 Bldg.

Lounge
Multipurpose Room
Nurse
Conference Room
Front Office

200 Bldg.

202 LaTendresse (K)
201 Green (K)

Northwood SCHOOL
2760 E. Trimble Road
San Jose, CA 95132
(408) 923-1940

NORTHWOOD ELEMENTARY SCHOOL
INSPECTED ON: 9/2-3/10

Field

Park

Playground

Playground

Bus Loop

Draw


900 Bldg.
Federal
Pre-School
Winquist,
Radford,
Bala

800 Bldg.
Tanaka (2)

801 Bldg.
Carabal (3)

400 Bldg.

405 Heiss (1/2)	406 Williamson(1)
404 Helfenberger (K)	Library (middle 400)
403 Lewis-Cook (3)	401 Stinson (3)
402 Cheadle II (3)	



500 Bldg.

509 Athwal (1)	501 Wong (4/5)
506 Brown (SDC)	Boyd (4) middle 507
505 Serochi (SDC)	502 Burroughs(5)
504 Kramer(5)	503 Lyle(4)

**MIDDLE
QUAD
PATIO**

300 Bldg.

301 Orth (2/3)	306 Fujikawa(1)
302 Lui (1)	307 RSP (middle) - Yee
303 Brum (K)	305 Evans/Lewis(2)
	304 Kinney (2)

Playground

700 Bldg.
State Preschool
Wilburn (Pre)

100 Bldg.

Lounge	Nurse
Conference Room	Front Office
Multipurpose Room	

200 Bldg.

202 LaTendresse (K)	201 Green (K)
------------------------	------------------

Parking Lot

Northwood SCHOOL
2760 E. Trimble Road
San Jose, CA 95132
(408) 923-1940

Field

Park

NORTHWOOD ELEMENTARY SCHOOL
 INSPECTED ON: 3/11/10

Playground

400 Bldg.

405 Heiss (1/2) 406 Williamson(1)

404 Helfenberger (K)

403 Lewis-Cook (3)

402 Cheadle II (3)

401 Stinson (3)

Library (middle 400)

801 Bldg.
 Carabal (3)

900 Bldg.
 Federal
 Pre-School
 Winquist,
 Radford,
 Bala

800 Bldg.
 Tanaka (2)

500 Bldg.

509 Athwal (1)

506 Brown (SDC)

505 Serochi (SDC)

504 Kramer(5)

501 Wong (4/5)

Boyd (4)
 middle 507

502 Burroughs(5)

503 Lyle(4)



**MIDDLE
 QUAD
 PATIO**

300 Bldg.

316 (Speech)

301 Orth (2/3)

307 RSP (middle) - Yee

302 Lui (1)

305 Evans/Lewis(2)

304 Kinney (2)

303 Brum (K)

306 Fujikawa(1)

Bus Loop

Playground

700 Bldg.
 State Preschool
 Wilburn (Pre)

100 Bldg.

Lounge

Multipurpose Room

Conference Room

Nurse

Front Office

200 Bldg.

202 LaTendresse (K)

201 Green (K)

Playground

Parking Lot

Northwood SCHOOL
2760 E. Trimble Road
San Jose, CA 95132
(408) 923-1940

NORTHWOOD ELEMENTARY SCHOOL
 INSPECTED ON: 09-08-09

Park

Field

Playground

Playground

Bus Loop


wood storage

900 Bldg.
 Federal
 Pre-School
 Winquist,
 Radford,
 Bala

800 Bldg.
 Tanaka (2)

801 Bldg.
 Carabal (3)

500 Bldg.
 509 Athwal (1)
 506 Brown (SDC)
 501 Wong (4/5)
 507 Boyd (4) middle
 502 Burroughs(5)
 503 Lyle(4)
 504 Kramer(5)
 505 Serochi (SDC)



**MIDDLE
 QUAD
 PATIO**

300 Bldg.
 316 (Speech)
 301 Orth (2/3)
 307 RSP (middle) - Yee
 302 Lui (1)
 305 Evans/Lewis(2)
 303 Brum (K)
 304 Kinney (2)
 306 Fujikawa(1)

700 Bldg.
 State Preschool
 Wilburn (Pre)

100 Bldg.
 Lounge
 Multipurpose Room
 Conference Room
 Nurse
 Front Office

200 Bldg.
 202 LaTendresse (K)
 201 Green (K)

400 Bldg.
 405 Heiss (1/2)
 404 Helfenberger (K)
 403 Lewis-Cook (3)
 402 Cheadle II (3)
 406 Williamson(1)
 Library (middle 400)
 401 Stinson (3)

metal storage

Parking Lot

NORTHWOOD ELEMENTARY SCHOOL
INSPECTED ON: 5/14/09

Park

Field

Playground

Northwood SCHOOL
2760 E. Trimble Road
San Jose, CA 95132
(408) 923-1940

400 Bldg.

405 Heiss (1/2) 406 Williamson(1)

404 Helfenberger (K) **Library** (middle 400)


403 Lewis-Cook (3) 401 Stinson (3)

402 Cheadle II (3)

801 Bldg.
Carabal (3)

900 Bldg.
Federal
Pre-School
Winquist,
Radford,
Bala

800 Bldg.
Tanaka (2)



500 Bldg.

509 Athwal (1) 501 Wong (4/5)

506 Brown (SDC) Boyd (4) middle 507

505 Serochi (SDC) 502 Burroughs(5)

504 Kramer(5) 503 Lyle(4)

MIDDLE
QUAD
PATIO

300 Bldg.

316 (Speech)

301 Orth (2/3) 306 Fujikawa(1)

307 RSP (middle) - Yee

302 Lui (1) 305 Evans/Lewis(2)

303 Brum (K) 304 Kinney (2)

Bus Loop

Playground

700 Bldg.
State Preschool
Wilburn (Pre)

100 Bldg.

Lounge Multipurpose Room Nurse

Conference Room Front Office

200 Bldg.

202 LaTendresse (K) 201 Green (K)









Playground

Parking Lot




Northwood SCHOOL **2760 E. Trimble Road** **San Jose, CA 95132** **(408) 923-1940**

VIEW

Playground

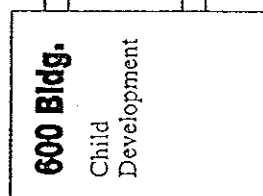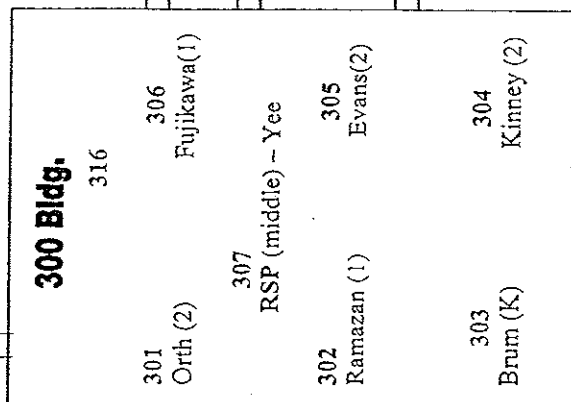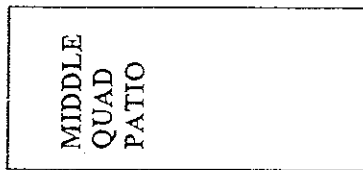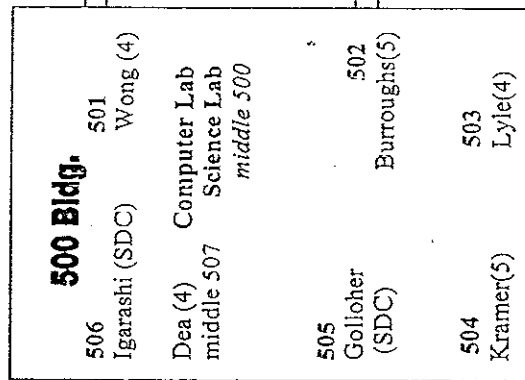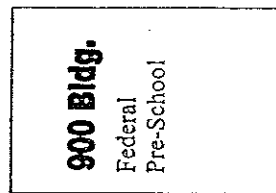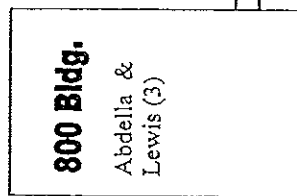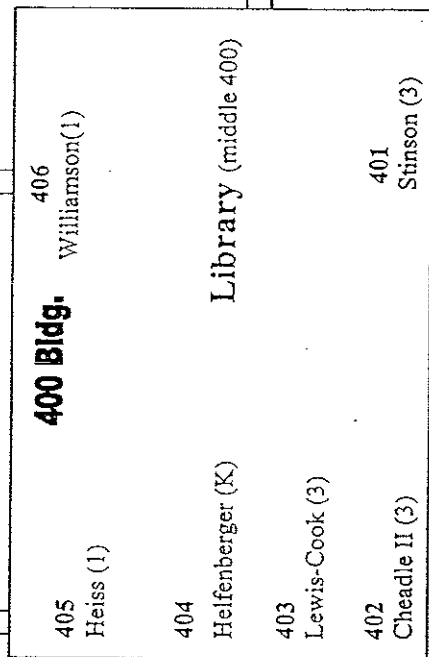

Playground

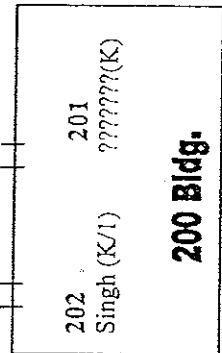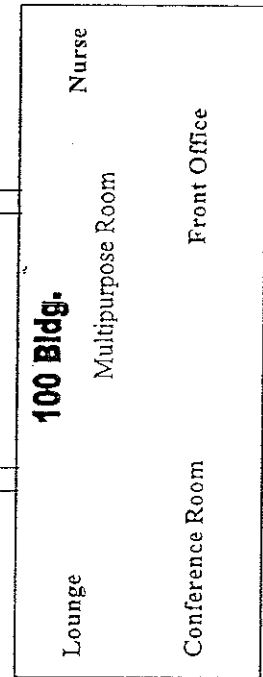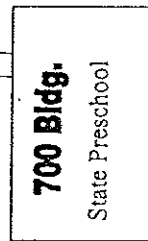

Bus Loop

NORTHWOOD ELEMENTARY SCHOOL
 INSPECTED ON: 10/20/80

Parking Lot

Northwood SCHOOL

2760 E. Trimble Road
San Jose, CA 95132
(408) 923-1940

NORTHWOOD ELEMENTARY SCHOOL
INSPECTED ON: 4-21-08


Bus Loop

Playground

Playground

400 Bldg.

405 Heiss (1)	406 Williamson(1)
404 Helfenberger (K)	Library (middle 400)
403 Lewis-Cook (3)	
402 Cheadle II (3)	401 Stinson (3)



800 Bldg.

Abdella & Lewis (3)

500 Bldg.

506 Igarashi (SDC)	501 Wong (4)
Dea (4) middle 507	Computer Lab Science Lab middle 500
505 Golloher (SDC)	502 Burroughs(5)
504 Kramer(5)	503 Lyle(4)

MIDDLE QUAD PATIO

300 Bldg.

301 Orth (2)	306 Fujikawa(1)
302 Ramazan (1)	305 Evans(2)
303 Brum (K)	304 Kinney (2)
	307 RSP (middle) - Yee
	316

900 Bldg.

Federal Pre-School

600 Bldg.

Child Development

100 Bldg.

Lounge	Nurse
Conference Room	Multipurpose Room
	Front Office

700 Bldg.

State Preschool

200 Bldg.

202 Singh (K/1)	201 ??????(K)
--------------------	------------------

Playground

Parking Lot

Northwood SCHOOL
2760 E. Trimble Road
San Jose, CA 95132
(408) 923-1940

NORTHWOOD ELEMENTARY SCHOOL
INSPECTED ON: 11-09-07

Bus Loop

Playground

Playground

200 Bldg.


202 Singh (K/1) 201 ??????(K)

Playground

Parking Lot

400 Bldg.

405 Heiss (1)	406 Williamson(1)
404 Helfenberger (K)	Library (middle 400)
403 Lewis-Cook (3)	
402 Cheadle II (3)	401 Stinson (3)



500 Bldg.

506 Igarashi (SDC)	501 Wong (4)
Dea (4) middle 507	Computer Lab Science Lab middle 500
505 Golloher (SDC)	502 Burroughs(5)
504 Kramer(5)	503 Lyle(4)

MIDDLE QUAD PATIO

300 Bldg.

301 Orth (2)	306 Fujikawa(1)
307 RSP (middle) - Yee	305 Evans(2)
302 Ramazan (1)	304 Kinney (2)
303 Brum (K)	

100 Bldg.

Lounge	Nurse
Conference Room	Multipurpose Room
	Front Office

800 Bldg.

Abdella & Lewis (3)

600 Bldg.

Child Development

900 Bldg.

Federal Pre-School

700 Bldg.

State Preschool

FIRE ESCAPE MAP

NORTHWOOD SCHOOL

2760 E. TRIMBLE ROAD
SAN JOSE, CA 95132
(408) 923-1940

NORTHWOOD ELEMENTARY SCHOOL
INSPECTED ON: 03/09/07


Bus Loop

Playground

Park

Playground

Field

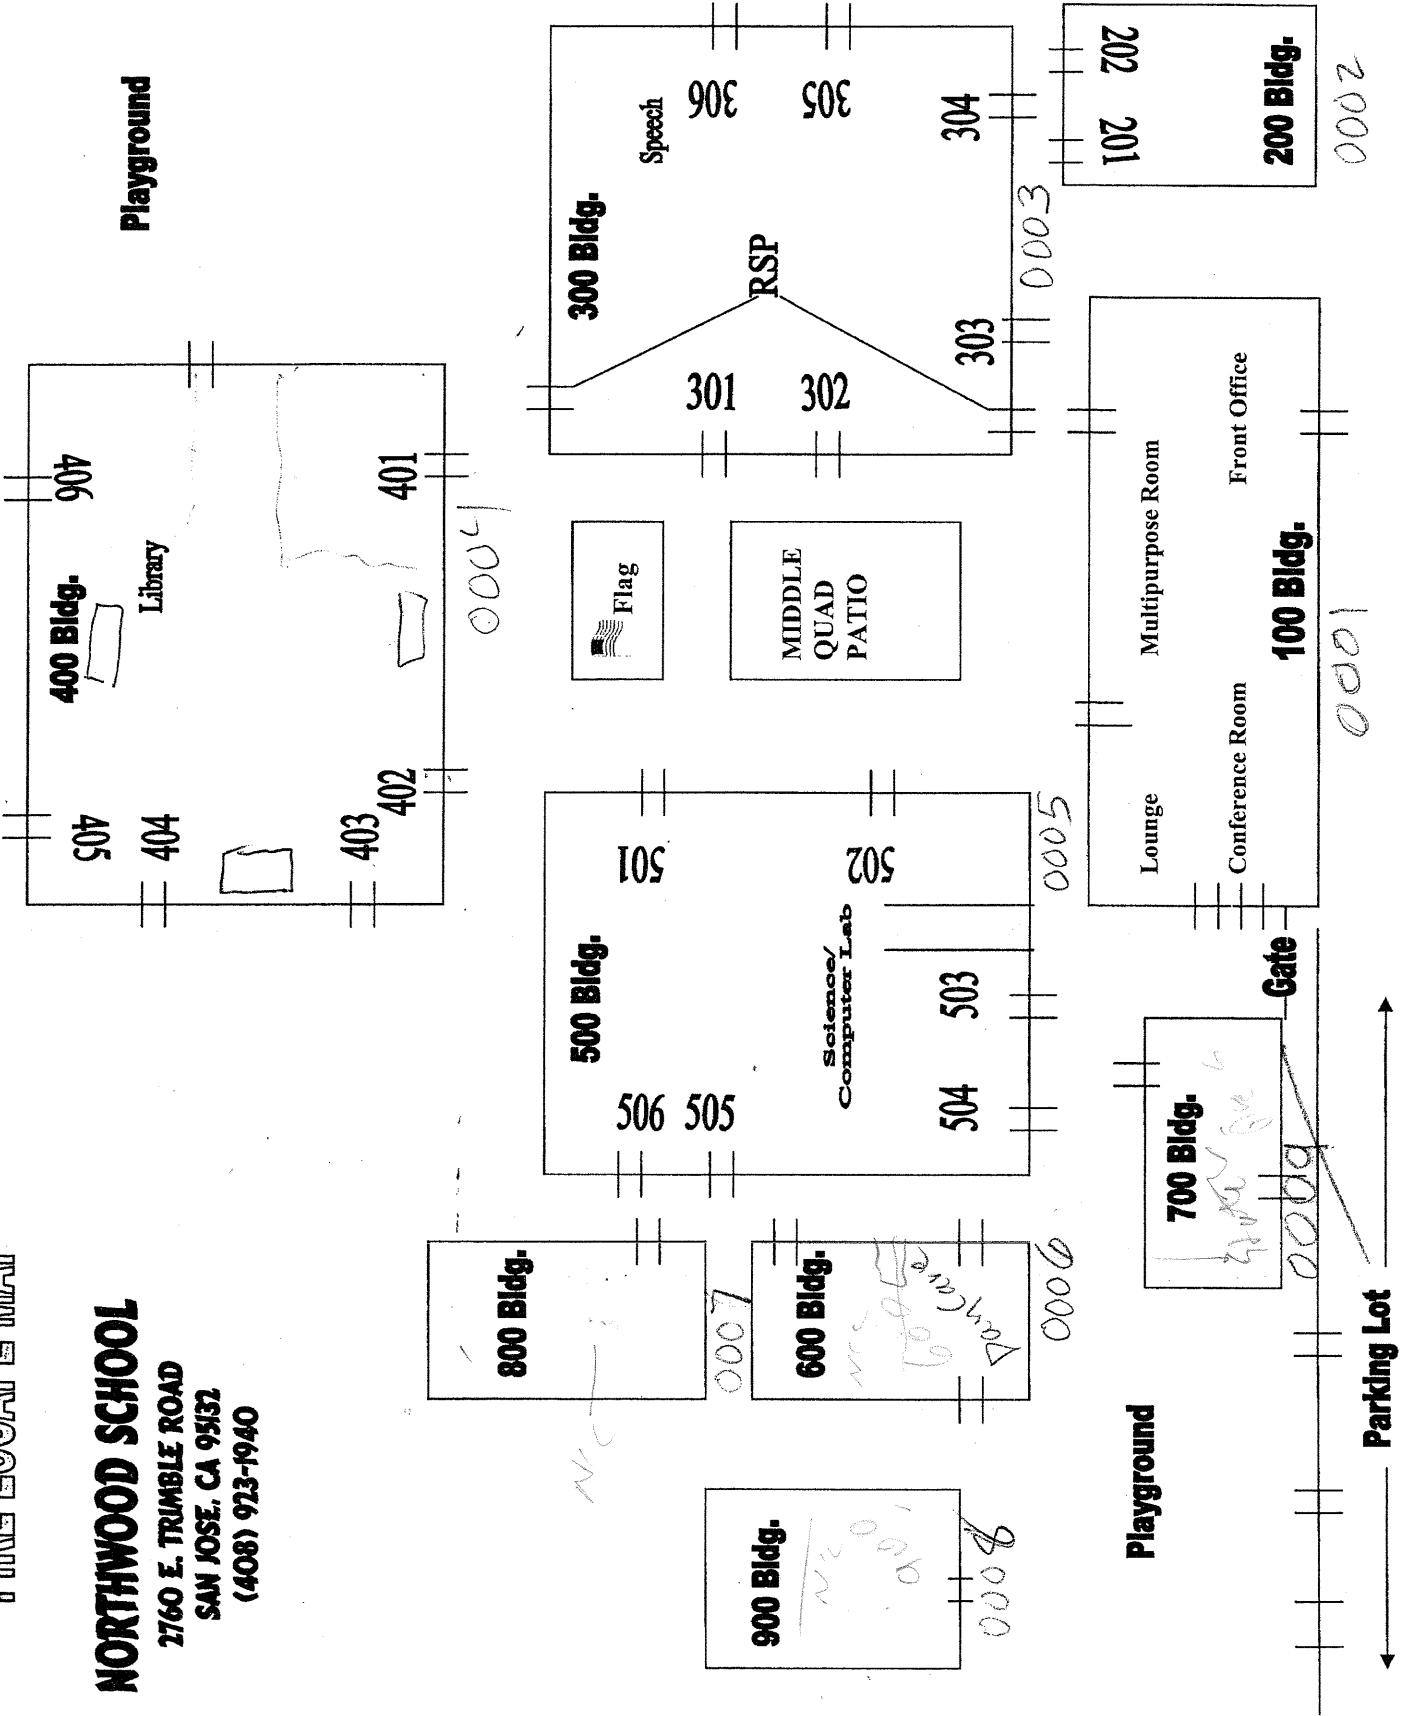

FIRE ESCAPE MAP

NORTHWOOD SCHOOL

2760 E. TRIMBLE ROAD
SAN JOSE, CA 95132
(408) 923-1940

NORTHWOOD ELEMENTARY SCHOOL
INSPECTED ON: 08-25-06


Park

Playground

Field

Bus Loop

Playground

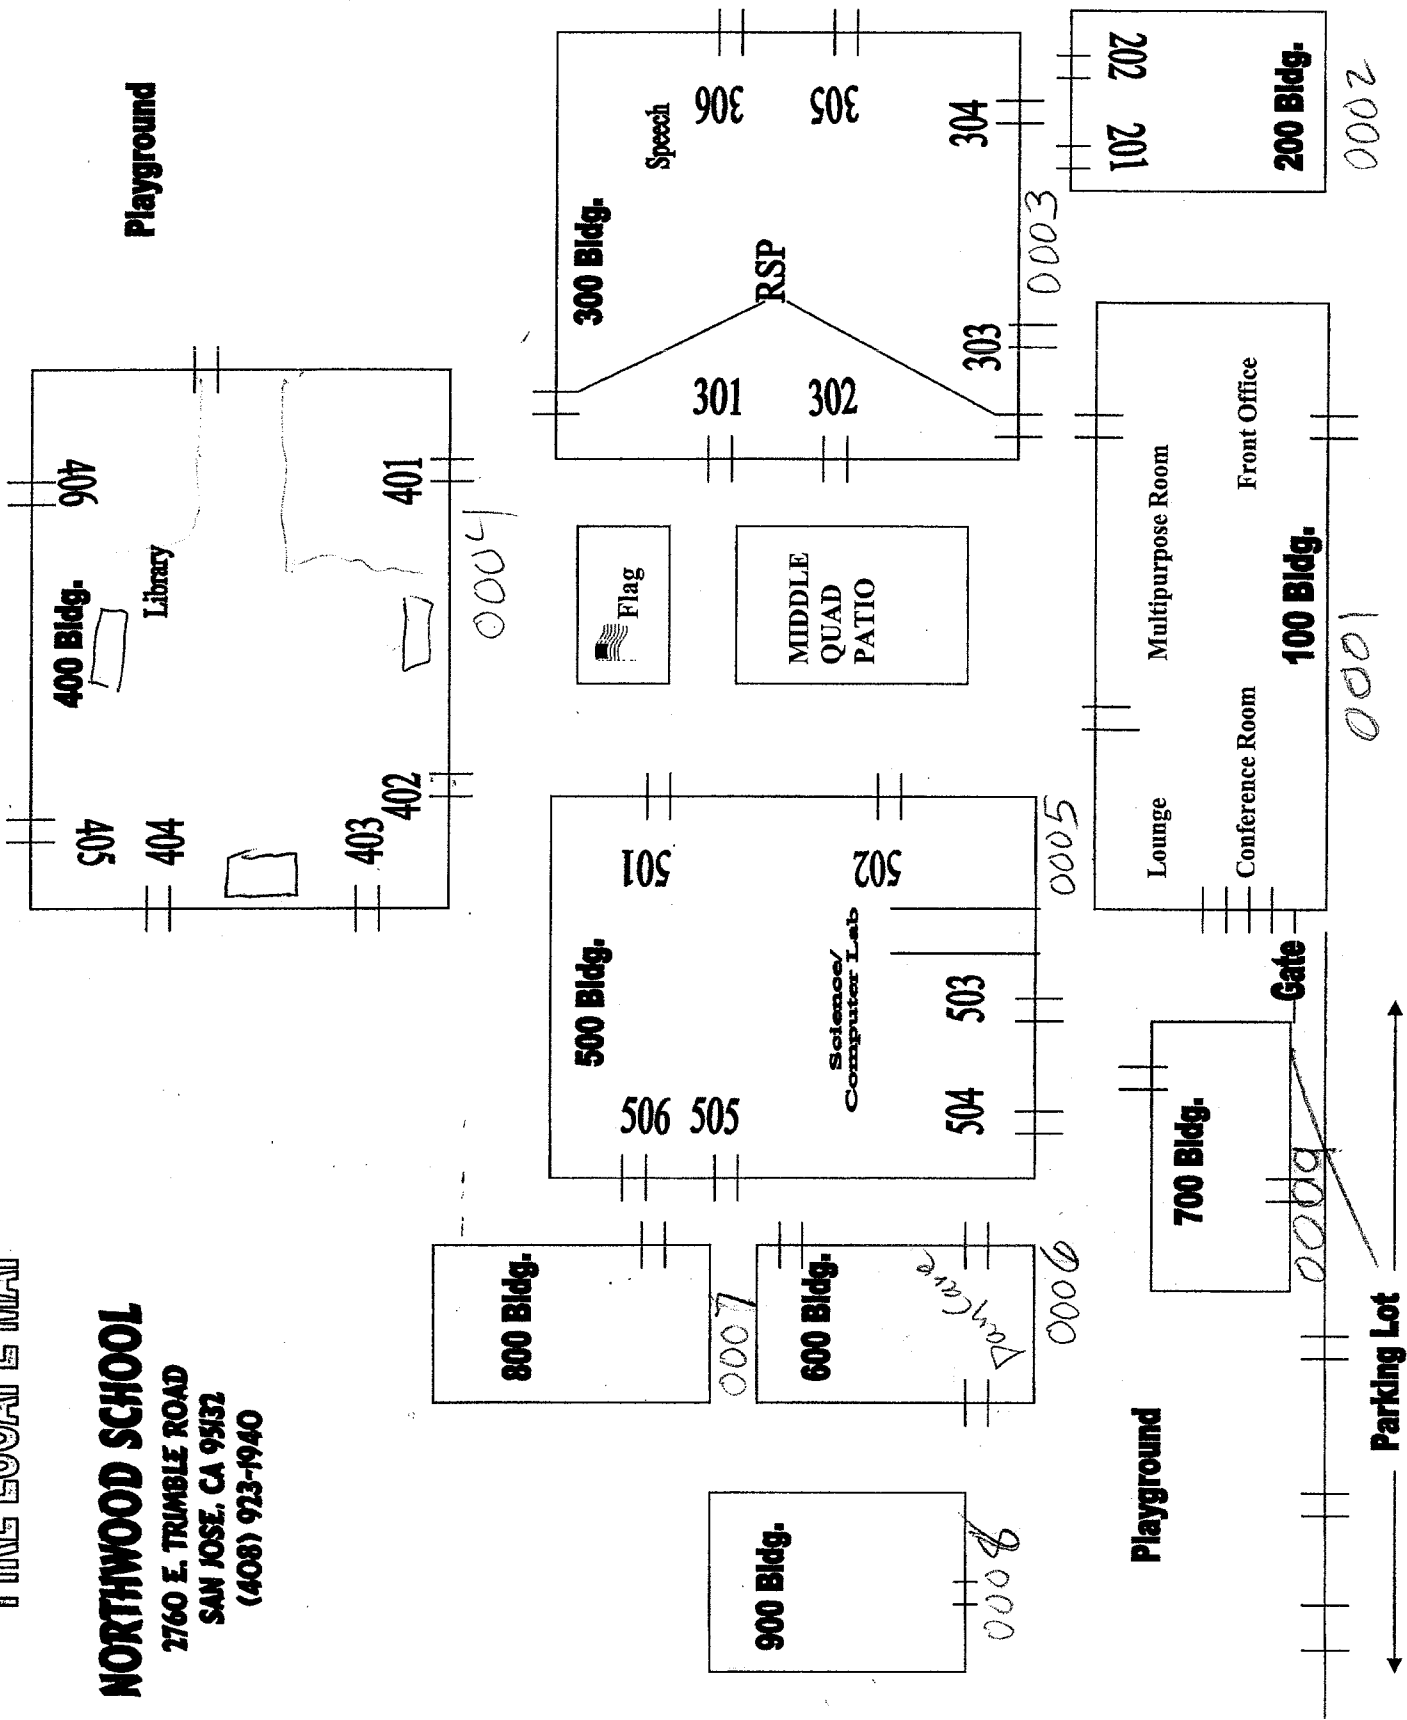


Bus Loop

Playground

Park

Playground

Field

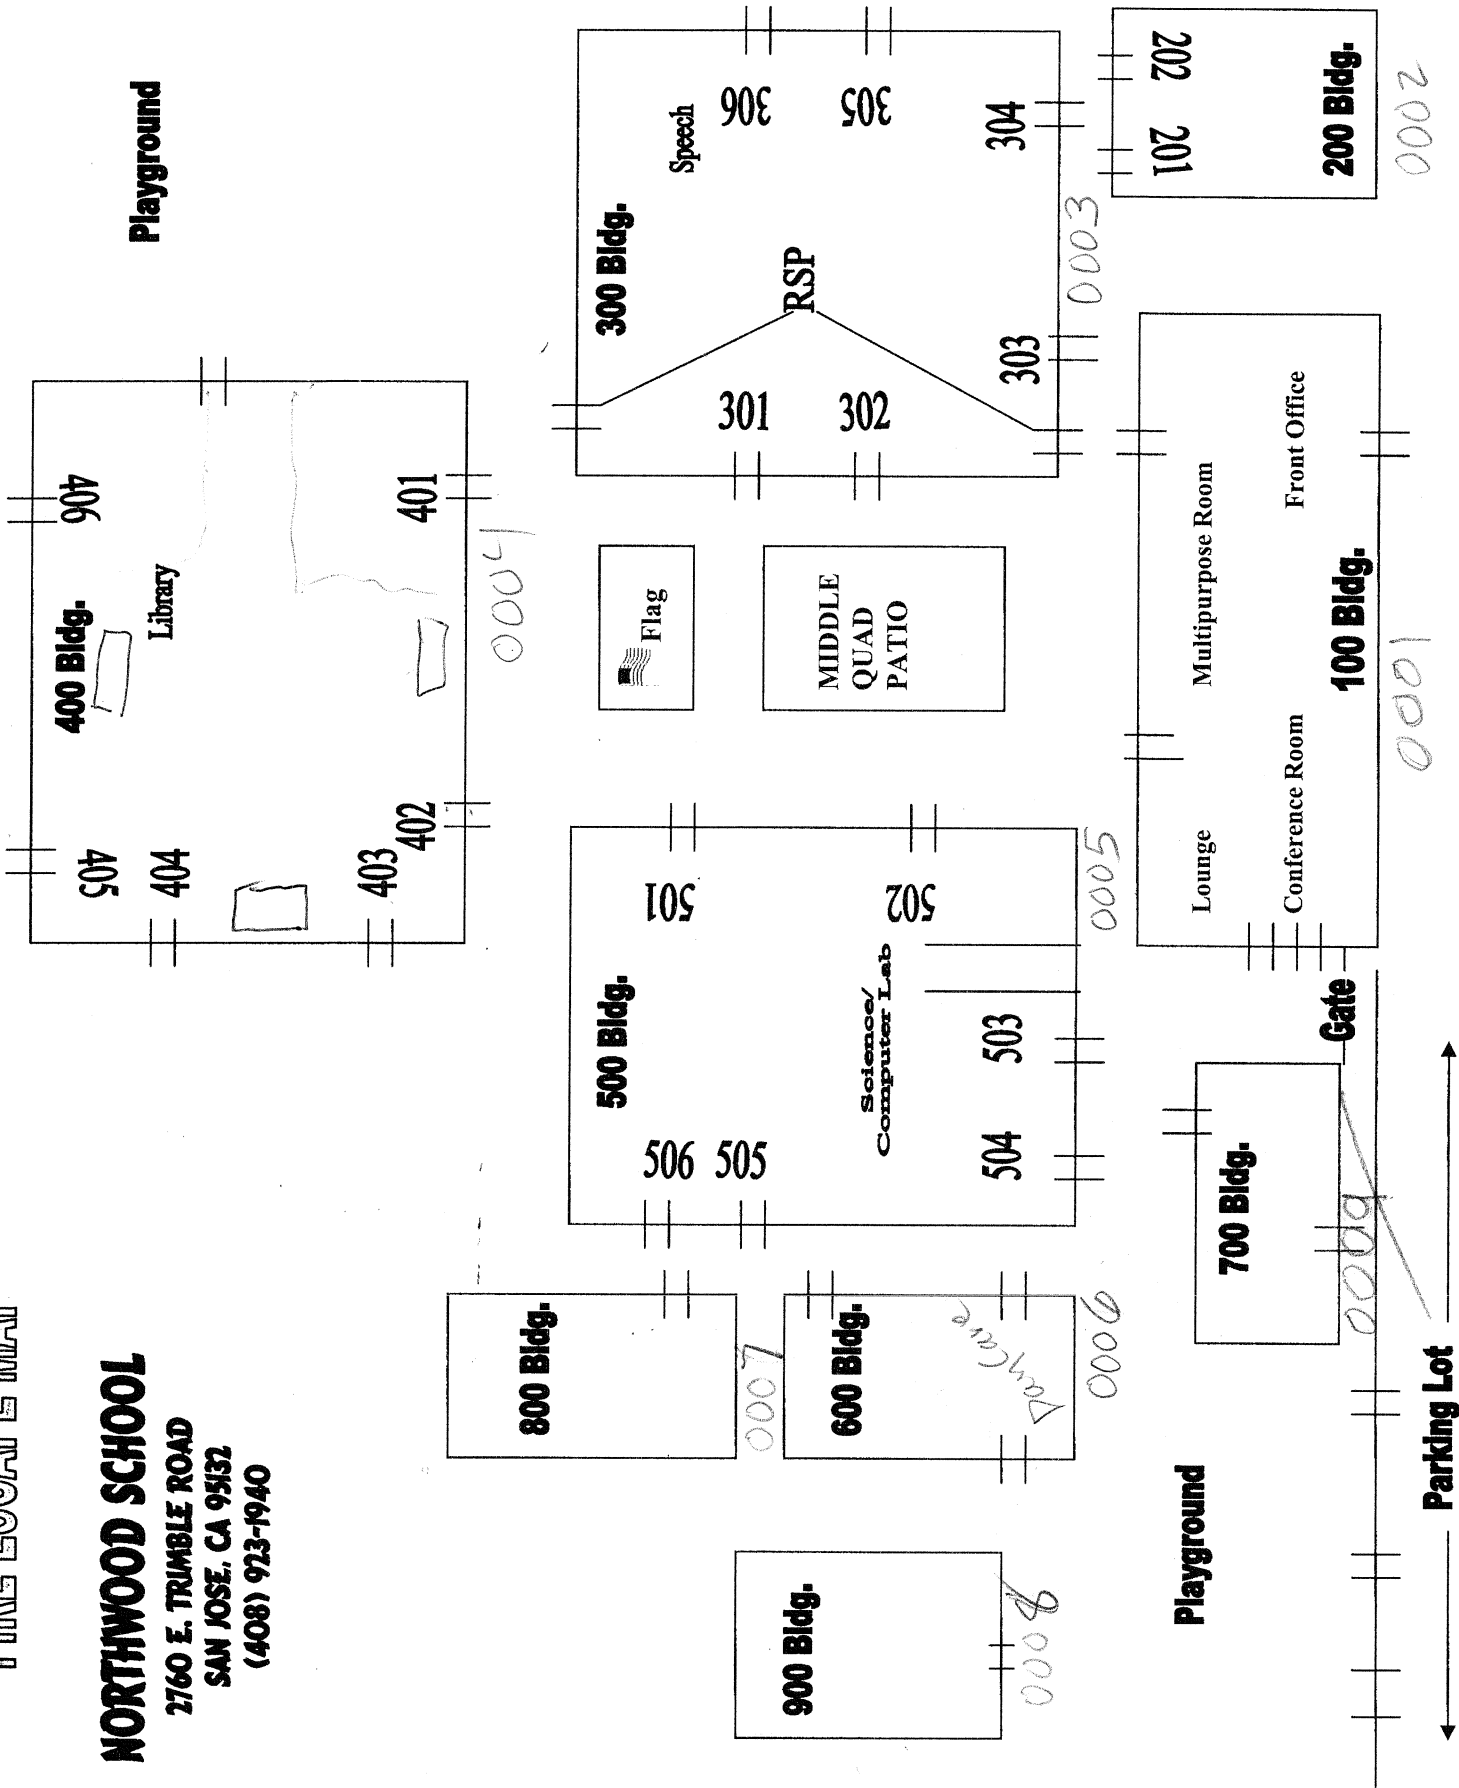

NORTHWOOD SCHOOL

2760 E. TRIMBLE ROAD
SAN JOSE, CA 95132
(408) 923-1940

Bus Loop

Playground

Park

Playground

Field

FIRE ESCAPE MAP

NORTHWOOD SCHOOL

2760 E. TRIMBLE ROAD
SAN JOSE, CA 95132
(408) 923-1940

