

SIX-MONTH SURVEILLANCE AHERA REPORT

**NORTHWOOD ELEMENTARY SCHOOL
2760 TRIMBLE ROAD
SAN JOSE, CA 95132**

**PREPARED FOR:
BERRYESSA UNION ELEMENTARY SCHOOL DISTRICT
981 RIDDER PARK DRIVE
SAN JOSE, CA 95131**

**INSPECTED ON:
SEPTEMBER 19, 2025**

HAZMAT DOC PROJECT #25-101

**PREPARED BY:
HAZMAT DOC
3080 OLCOTT STREET • SUITE D135
SANTA CLARA, CA 95054
Tel: 408.748.0055**

BERRYESSA UNION ELEMENTARY SCHOOL DISTRICT
NORTHWOOD ELEMENTARY SCHOOL

INSPECTED ON:
SEPTEMBER 19, 2025

INSPECTED BY:



Leland Kafeyan
Cal/OSHA Certified Site Surveillance Technician
Certification Number 06-4110

REPORTED BY:

Maheen B. Doctor

Maheen B. Doctor
Cal/OSHA Certified Asbestos Consultant
Certification Number 95-1798

CONTENTS

PART - I

LEGEND AND GLOSSARY OF TERMS

PART - II

AHERA REPORT A – LIST OF BUILDINGS

PART - III

AHERA REPORT B – SURVEY REPORT

PART - IV

HOMOGENEOUS MATERIALS REPORT

PART - V

FRIABLE LOCATIONS REPORT

PART - VI

NON-FRIABLE LOCATIONS REPORT

PART - VII

RECOMMENDATIONS REPORT

PART - VIII

SAMPLES REPORT

PART - IX

DAMAGE REPORT

PART - X

SITE MAPS

LEGEND

THE FOLLOWING IS A LIST OF ABBREVIATIONS USED IN THIS REPORT:

Asbestos Sample Types

AC	=	ACTINOLITE
AM	=	AMOSITE
AN	=	ANTHOPHYLLITE
CH	=	CHRYSOTILE
CR	=	CROCIDOLITE
TR	=	TREMOLITE
ND	=	NONE DETECTED
NS	=	NO SAMPLE

Measurements

APPROX.	=	APPROXIMATELY
EA	=	EACH
I	=	INCHES
LF	=	LINEAR FEET
N	=	NUMBER
O.D.	=	OUTSIDE DIAMETER
SF	=	SQUARE FEET
TBD	=	TO BE DETERMINED

LIST OF BUILDINGS AT

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME BUILDING USED AS (#FLOORS) CONSTRUCTION	BUILDING AREA (APPROXIMATE)
()	
ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)	
Offices, Multi-Purpose Room, Music Room, Restrooms, Kitchen, Storage Rooms (1) Wood, Metal, Plaster, Gypsum Wallboard System	7,800 SF
BUS LOOP	
Covered waiting area (1) Wood, Metal, and Stucco	100 SF
CLASSROOMS 201-202 BUILDING (BUILDING 200)	
Classrooms, Restrooms, Utility Rooms (1) Wood, Metal, Plaster, Gypsum Wallboard System	3,200 SF
CLASSROOMS 301-306 BUILDING (BUILDING 300)	
Classrooms, RSP Room, Storage Room, Restrooms (1) Wood, Metal, Plaster, Gypsum Wallboard System	10,400 SF
CLASSROOMS 400-406 BUILDING (BUILDING 400)	
Classrooms, Library, Storage Room, Restrooms (1) Wood, Metal, Plaster, Gypsum Wallboard System	10,400 SF
CLASSROOMS 501-506 BUILDING (BUILDING 500)	
Classrooms, Science and Computer Lab (1) Wood, Metal, Plaster, Gypsum Wallboard System	10,400 SF
CLASSROOMS 801 PORTABLE BUILDING	
Classroom (1) Wood and Metal	960 SF
DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)	
Classroom (1) Wood and Metal Portable	2,040 SF
DAYCARE PORTABLE BUILDING - FED CHILDCARE (BUILDING 900)	
Classroom (1) Wood and Metal Portable	960 SF
DAYCARE PORTABLE BUILDING - SDC (BUILDING 800)	
Classroom (1) Wood and Metal Portable	960 SF
FAMILY RESOURCE CENTER (BUILDING 700)	
Daycare, Pre-School (1) Wood, Metal, Preformed Material	1,440 SF
METAL STORAGE CONTAINERS (3 EA)	
Storage (1) Metal	480 SF
MIDDLE QUAD PATIO	
Patio (1) Metal, Concrete	1,600 SF

LIST OF BUILDINGS AT

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME BUILDING USED AS (#FLOORS) CONSTRUCTION		BUILDING AREA (APPROXIMATE)
PORTABLE NEXT TO P6 (802)		
Classroom (1) Metal and Wood		900 SF
RIGHT AT SCHOOL PORTABLE (CLASSROOM P6) (803)		
Classroom (1) Metal and Wood		960 SF
WOOD STORAGE SHEDS (2 EA)		
Storage (1) Wood		170 SF
Total Number Of Buildings : <u>17</u>		(Approximate) Total Sq Ft. : <u>52,770</u>
End Of Report, Total Of 2 Pages		

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.

ASBESTOS CONTENT

ASBESTOS NAME

ASBESTOS CODE

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

09/14/2005 BUILDING NOTES:

09/14/2005 Existing Gypsum Wallboard Systems Removed and Replaced with new in-kind in Path-of-Construction.

03/09/2007 Building Name changed from ADMINISTRATION AND MULTI-PURPOSE ROOM to ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100). No other changes as of this date.

09/15/2016 New Flooring Finishes installed Summer 2015 per information received from the BUESD. New Suspended Ceiling Tiles installed.

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

ATTIC / PLENUM

PIPE FITTING INSULATION

(TBD) LF

09/14/2005 Pipe Fitting Insulation. material may exist in inaccessible locations. This Material is in GOOD condition as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

08/16/2024 This Material is unchanged as of this date.

03/03/2025 This Material is unchanged as of this date.

09/19/2025 This Material is unchanged as of this date.

05-212AAA

ASSUMED

NO SAMPLE

(NS)

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

BOOK STORAGE ROOM, CUSTODIAL ROOM, AND PANTRY ROOM

BASEBOARD MASTIC

116 LF

09/14/2005	Mastic/Adhesive for 4" Brown Baseboard. This Material is in GOOD condition as of this date.
08/25/2006	Book Storage Room added to Location. 30 LF added to quantity. Location Name changed from CUSTODIAL ROOM, AND PANTRY ROOM to BOOK STORAGE ROOM, CUSTODIAL ROOM, AND PANTRY ROOM. Quantity changed from 86 LF to 116 LF to reflect this fact. No other changes as of this date.
04/03/2017	Damage Observed. <5% Physical Damage - in the form of 1 LF Damage and Missing Baseboard in Book Storage Room. Material condition changed from GOOD to FAIR overall. Friability changed from Non to Low. No other changes as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.
08/19/2022	This Material is unchanged as of this date.
02/17/2023	This Material is unchanged as of this date.
08/18/2023	This Material is unchanged as of this date.
02/16/2024	This Material is unchanged as of this date.
08/16/2024	This Material is unchanged as of this date.
03/03/2025	This Material is unchanged as of this date.
09/19/2025	This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

ENTIRE BUILDING

FIRE DOOR CORE INSULATION

546 SF

08/29/2014	Fire Door Core Insulation. (2 EA Double-Doors + 24 EA Single-Doors). This Material is in GOOD condition as of this date.
------------	--

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		
08/16/2024	This Material is unchanged as of this date.		
03/03/2025	This Material is unchanged as of this date.		
09/19/2025	This Material is unchanged as of this date.		
14-198AAA	ASSUMED	NO SAMPLE	(NS)

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

ENTIRE BUILDING

SMOOTH WALL MISCELLANEOUS

24,500 SF

09/14/2005	Gypsum Wallboard System. (Material also exists behind Vinyl Covered Wall Panels in some areas). Damage: <5% Physical Damage - in exterior Water Heater Room; <10% Water Damage - in exterior Water Heater Room. Existing Gypsum Wallboard Systems Removed and Replaced with new in-kind in Path-of-Construction. This Material is in FAIR condition overall as of this date.
03/09/2007	Damage: <10% Water Damage - approximately 20 SF in Kitchen. Condition changed to reflect this fact. No other changes as of this date.
11/09/2007	This Material in POOR condition in Water Heater Room. This Material is in FAIR condition overall as of this date.
04/21/2008	Damage in the Water Heater Room is on all Walls. No other changes as of this date.
10/20/2008	Exterior Water Heater Room has 3/4 of Ceiling missing. <10% Water Damage. No other changes as of this date.
09/08/2009	Material remains in <5% Physical Damage and <10% Water Damage. This Material is unchanged as of this date.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

COMMENTS

QTY (APPROXIMATE)

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
02/01/2010	Samples 10-019 NW-69 (Joint Tape / Compound), NW-70 (Drywall) , NW-73 (Joint Tape / Compound) and NW-74 (Drywall) collected on this date.		
09/18/2015	Additional Damage observed. Pantry by Exhaust has minor cuts and holes. No other change as of this date.		
01/28/2016	Sample 16-030-A07 collected from Storage 121, Drywall Board. Sample 16-030-A08 collected from Storage 121, Joint Mud. Sample 16-030-A13 collected from Multi-purpose Room by 122 Door, Drywall.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	Additional Damage Observed. <5% Physical Damage in the form of 1.5 SF of Missing and Peeling Skimcoat and Mud as well as a 3 LF Water Leak on the Ceiling by West Wall of Mens Staff Restroom. Material remains in FAIR condition overall. No other changes as of this date.		
02/16/2024	This Material is unchanged as of this date.		
08/16/2024	This Material is unchanged as of this date.		
03/03/2025	This Material is unchanged as of this date.		
09/19/2025	This Material is unchanged as of this date.		

10-018 NW-69	ND	NONE DETECTED	(ND)
10-018 NW-69	2	CHRYSTILE	(CH)
10-018 NW-70	ND	NONE DETECTED	(ND)
10-018 NW-73	ND	NONE DETECTED	(ND)
10-018 NW-73	2	CHRYSTILE	(CH)
10-018 NW-74	ND	NONE DETECTED	(ND)
16-030-A07	ND	NONE DETECTED	(ND)
16-030-A13	ND	NONE DETECTED	(ND)
16-030-A13	ND	NONE DETECTED	(ND)
16-030-A08	5%	CHRYSTILE	(CH)

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

ENTIRE BUILDING

SMOOTH WALL SURFACING

24,500 SF

08/25/2006	Skim Coat for Gypsum Wallboard System. (Material also exists behind Vinyl Covered Wall Panels in some areas). Damages noted in exterior Water Heater Room. Existing Gypsum Wallboard Systems Removed and Replaced with new in-kind in Path-of-Construction. This Material is in FAIR condition overall as of this date.		
03/09/2007	Damage: <10% Water Damage - approximately 20 SF in in Kitchen. Condition changed to reflect this fact. No other changes as of this date.		
11/09/2007	This Material in POOR condition in Water Heater Room. This Material is in FAIR condition overall as of this date.		
10/20/2008	Exterior Water Heater Room has 3/4 of Ceiling is missing. <10% Water Damage. No other changes as of this date.		
09/08/2009	Material remains in <5% Physical Damage and <10% Water Damage. This Material is unchanged as of this date.		
02/01/2010	Samples 10-019 NW-68 and NW-72 collected on this date.		
09/18/2015	Additional Damage observed. Pantry by Exhaust has minor cuts and holes. No other change as of this date.		
01/28/2016	Sample 16-030-A09 collected from Storage 121, Paint. Sample 16-030-A12 collected from MP Room by 122 Door, Skim Coat and Mud on Drywall.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	Additional Damage Observed. <5% Physical Damage in the form of 1.5 SF of Missing and Peeling Skimcoat and Mud as well as a 3 LF Water Leak on the Ceiling by West Wall of Mens Staff Restroom. Material remains in FAIR condition overall. No other changes as of this date.		
02/16/2024	This Material is unchanged as of this date.		
08/16/2024	This Material is unchanged as of this date.		

SF= Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

03/03/2025 This Material is unchanged as of this date.

09/19/2025 This Material is unchanged as of this date.

10-018 NW-68	2	CHRYSTILE	(CH)
10-018 NW-72	ND	NONE DETECTED	(ND)
16-030-A09	ND	NONE DETECTED	(ND)
16-030-A12	ND	NONE DETECTED	(ND)

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

EXTERIOR WALLS, AND ALL PERIMETER WALLS IN BACK OF BUILDING (UTILITY YARD FOR TRASH CAN ROOM WASHING AREA)

ROUGH WALL

17,180 SF

09/14/2005 Stucco Exterior Walls. This Material is in GOOD condition as of this date.

03/09/2007 Material changed from ' Stucco Walls. ' to ' Stucco Exterior Walls. ' No other changes as of this date.

01/28/2016 Sample 16-030-A10 collected from Storage 121, Exterior Stucco. Sample 16-030-A14 collected from MP Room Exterior by Door 123, Stucco.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

08/16/2024 This Material is unchanged as of this date.

03/03/2025 This Material is unchanged as of this date.

09/19/2025 This Material is unchanged as of this date.

16-030-A10	2%	CHRYSTILE	(CH)
16-030-A14	ND	NONE DETECTED	(ND)

SF= Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
05-212AAA	ASSUMED	NO SAMPLE	(NS)

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

EXTERIOR WALLS, AND ALL PERIMETER WALLS IN BACK OF BUILDING (UTILITY YARD FOR TRASH CAN ROOM WASHING AREA)

ROUGH WALL SURFACING

17,180 SF

09/14/2005	Stucco Walls. This Material is in GOOD condition as of this date.
03/09/2007	Material Description changed from ' Stucco Walls. ' to ' Skim Coat for Stucco Exterior Walls. ' No other changes as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.
08/19/2022	This Material is unchanged as of this date.
02/17/2023	This Material is unchanged as of this date.
08/18/2023	This Material is unchanged as of this date.
02/16/2024	This Material is unchanged as of this date.
08/16/2024	This Material is unchanged as of this date.
09/19/2025	This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

KITCHEN PANTRY CLOSET

VINYL FLOOR TILE

60 SF

09/14/2005	9"x9" Red Vinyl Floor Tile. This Material is in GOOD condition as of this date.
10/11/2012	Damage: <5% Physical Damage - in the form of 1 Tile is missing, 3 Tiles are broken, and Mastic/Adhesive is exposed. Material condition changed from GOOD to FAIR overall as of this date. Friability changed from Non-Friable to Friable to reflect this change.
03/07/2014	2 additional Tiles are broken and Mastic/Adhesive is exposed. No other changes as of this date.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
04/03/2017	Additional Damage Observed. 8 Tiles Broken with Mastic Exposed and 4 Tiles Loose. 2 SF of Water Damage and debris at back of the closet. No other changes as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		
08/16/2024	This Material is unchanged as of this date.		
03/03/2025	This Material is unchanged as of this date.		
09/19/2025	This Material is unchanged as of this date.		

05-212AAA

ASSUMED

NO SAMPLE

(NS)

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

KITCHEN PANTRY CLOSET

VINYL FLOOR TILE MASTIC

60 SF

09/14/2005	Mastic/Adhesive for 9"x9" Red Vinyl Floor Tile. This Material is in GOOD condition as of this date.		
03/07/2014	6 Tiles are broken and Mastic/Adhesive is exposed. This Material is in FAIR condition. No other changes as of this date.		
04/03/2017	Additional Damage Observed. 8 Tiles Broken with Mastic Exposed and 4 Tiles Loose. 2 SF of Water Damage and debris at back of the closet. No other changes as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		
08/16/2024	This Material is unchanged as of this date.		
03/03/2025	This Material is unchanged as of this date.		
09/19/2025	This Material is unchanged as of this date.		
05-212AAA	ASSUMED	NO SAMPLE	(NS)

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

MULTI-PURPOSE ROOM

SUSPENDED CEILING TILE

2,530 SF

10/20/2008	2'x2' Suspended Ceiling Tile. Tiles are White with a pitted mark form pattern. 10 Tiles have Water Stains. This Material is in FAIR condition as of this date. (Original Entry updated 03/19/15.)
09/18/2015	Damage Re-Assessed. Damage is currently as follows for the following room: Multipurpose Room has 4 Tiles Water Damaged and 1 Tile Physically Damaged. No other changes as of this date.
04/03/2017	Additional Damage Observed. Multi-Purpose Room now has 12 Tiles with Water Damage. No other changes as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.
08/19/2022	This Material is unchanged as of this date.
02/17/2023	This Material is unchanged as of this date.
08/18/2023	This Material is unchanged as of this date.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/16/2024 This Material is unchanged as of this date.

08/16/2024 This Material is unchanged as of this date.

03/03/2025 This Material is unchanged as of this date.

09/19/2025 This Material is unchanged as of this date.

08-241AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

MULTI-PURPOSE ROOM, OFFICES, AND HALLWAYS

VINYL WALL COVER MASTIC

18,680 SF

09/14/2005 Mastic/Adhesive for Vinyl Covered Wall Panels, (over Gypsum Wallboard System). This Material is in GOOD condition as of this date.

08/30/2017 Damage Observed. <5% Physical Damage - in the form of Several areas have Scrapes in the Material. Material condition changed from GOOD to FAIR overall. Friability changed from Non to Low. No other changes as of this date.

01/31/2020 Additional Damage Observed. 1 SF of Loose Peeling Vinyl Floor Wall in Staff Lounge. No other changes as of this date.

09/01/2020 Additional Damage Observed. In Multi-Purpose Room 1 SF of Torn Vinyl Wall Cover on North Wall. 4 SF of Torn Vinyl Wall Cover on South Wall. No other changes as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

08/16/2024 This Material is unchanged as of this date.

03/03/2025 This Material is unchanged as of this date.

09/19/2025 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	
LOCATION	
MATERIAL TYPE	QTY (APPROXIMATE)
COMMENTS	

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

PTA ROOM

VINYL FLOOR TILE

144 SF

09/14/2005	12"x12" Off-White Vinyl Floor Tile. This Material is in GOOD condition as of this date.
03/07/2014	Location name changed from CONFERENCE ROOM (OLD CUSTODIAN ROOM) to PTA ROOM. 1 Tile is broken and Mastic/Adhesive is exposed. No other changes as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.
08/19/2022	This Material is unchanged as of this date.
02/17/2023	This Material is unchanged as of this date.
08/18/2023	This Material is unchanged as of this date.
02/16/2024	This Material is unchanged as of this date.
08/16/2024	This Material is unchanged as of this date.
09/19/2025	This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

PTA ROOM

VINYL FLOOR TILE MASTIC

144 SF

09/14/2005	Mastic/Adhesive for 12"x12" Off-White Vinyl Floor Tile. This Material is in GOOD condition as of this date.
03/07/2014	Location name changed from CONFERENCE ROOM (OLD CUSTODIAN ROOM) to PTA ROOM. 1 Tile is broken and Mastic/Adhesive is exposed. No other changes as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

08/16/2024 This Material is unchanged as of this date.

03/03/2025 This Material is unchanged as of this date.

09/19/2025 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

STAFF RESTROOMS (2), NURSES' RESTROOM, AND KITCHEN RESTROOM

MORTAR MISCELLANEOUS

640 SF

12/01/2011 Grout/Mortar for 4"x4" Red, Green, and Brown Ceramic Wall Tiles. This Material is in GOOD condition as of this date. (Original Entry updated on 03/07/14.)

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

08/16/2024 This Material is unchanged as of this date.

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

12

HazMat Doc

AHERA Report B - Survey

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

03/03/2025 This Material is unchanged as of this date.

09/19/2025 This Material is unchanged as of this date.

11-202AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

STAFF RESTROOMS (2), NURSES' RESTROOM, AND KITCHEN RESTROOM

MORTAR MISCELLANEOUS

270 SF

12/01/2011 Grout/Mortar for 8"x8" Green, Red, and Pink Ceramic Floor Tiles This Material is in GOOD condition as of this date. (Original Entry updated on 03/07/14.)

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

08/16/2024 This Material is unchanged as of this date.

03/03/2025 This Material is unchanged as of this date.

09/19/2025 This Material is unchanged as of this date.

11-202AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

TEACHER'S LOUNGE AND NURSE'S ROOM

SINK UNDERCOATING

8 SF

10/20/2008 Grey Thermal Undercoating on Sink. (2 EA Sink). This Material is in GOOD condition as of this date. (Original Entry updated on 09/02/10.)

01/31/2020 This Material is unchanged as of this date.

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		
08/16/2024	This Material is unchanged as of this date.		
03/03/2025	This Material is unchanged as of this date.		
09/19/2025	This Material is unchanged as of this date.		
08-241AAA	ASSUMED	NO SAMPLE	(NS)

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

WOMENS RESTROOM

MORTAR MISCELLANEOUS

120 SF

09/18/2015	Grout/Mortar for 9" Pink Ceramic Tile. This Material is in GOOD condition as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

08/16/2024 This Material is unchanged as of this date.

03/03/2025 This Material is unchanged as of this date.

09/19/2025 This Material is unchanged as of this date.

15-174AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

BUS LOOP

BUS LOOP

09/15/2016 BUILDING NOTES:

09/15/2016 Building Name changed from CARPORT / WAITING AREA to BUS LOOP.

BUS LOOP

EXTERIOR WALL

PAPER TYPE INSULATION

800 SF

09/08/2009 Paper Material under Stucco on Exterior Walls and Overhangs. Damage: <5% Physical Damage due to Damaged sections on lower portion of material on various locations. This Material is in FAIR condition as of this date.

03/07/2014 This Material is unchanged as of this date.

08/29/2014 This Material is unchanged as of this date.

03/19/2015 This Material is unchanged as of this date.

09/15/2016 Repairs observed. Damages repaired as of this date. Material Condition changed from FAIR to GOOD. No other changes as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

08/16/2024 This Material is unchanged as of this date.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

03/03/2025 This Material is unchanged as of this date.

09/19/2025 This Material is unchanged as of this date.

09-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

BUS LOOP

EXTERIOR WALL

ROUGH WALL

800 SF

09/08/2009 Stucco on Exterior Walls and Overhangs. Damage: <5% Physical Damage due to damaged sections on lower portion of material on various locations. This Material is in FAIR condition as of this date.

03/07/2014 This Material is unchanged as of this date.

08/29/2014 This Material is unchanged as of this date.

03/19/2015 This Material is unchanged as of this date.

09/15/2016 Repairs observed. Damages repaired as of this date. Material Condition changed from FAIR to GOOD. No other changes as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

08/16/2024 This Material is unchanged as of this date.

03/03/2025 This Material is unchanged as of this date.

09/19/2025 This Material is unchanged as of this date.

09-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
09-212AAA	ASSUMED	NO SAMPLE	(NS)

BUS LOOP

EXTERIOR WALL

ROUGH WALL SURFACING

800 SF

09/08/2009	Skim Coat for Stucco on Exterior Walls and Overhangs. Damage: <5% Physical Damage due to damaged sections on lower portion of material on various locations. This Material is in FAIR condition as of this date.
03/07/2014	This Material is unchanged as of this date.
08/29/2014	This Material is unchanged as of this date.
03/19/2015	This Material is unchanged as of this date.
09/15/2016	Repairs observed. Damages repaired as of this date. Material Condition changed from FAIR to GOOD. No other changes as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.
08/19/2022	This Material is unchanged as of this date.
08/19/2022	This Material is unchanged as of this date.
02/17/2023	This Material is unchanged as of this date.
08/18/2023	This Material is unchanged as of this date.
02/16/2024	This Material is unchanged as of this date.
08/16/2024	This Material is unchanged as of this date.
03/03/2025	This Material is unchanged as of this date.
09/19/2025	This Material is unchanged as of this date.

09-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

CLASSROOMS 201-202 BUILDING (BUILDING 200)

CLASSROOMS 201-202 BUILDING (BUILDING 200)

09/06/2005	BUILDING NOTES:
09/06/2005	Existing Gypsum Wallboard Systems Removed and Replaced with new in-kind in Path-of-Construction.
03/09/2007	Building Name changed from CLASSROOMS 201 AND 202 to CLASSROOMS 201-202 BUILDING (BUILDING 200).
10/20/2008	New Sinks with Thermal Undercoating installed in Classrooms and Ceramic Wall Tiles in Restrooms, Classrooms Entries, and Custodial Room installed Summer 2007.
09/15/2016	New Flooring Finishes installed Summer 2015 per information received from the BUESD. New Suspended Ceiling Tiles installed.

CLASSROOMS 201-202 BUILDING (BUILDING 200)

CLASSROOMS 201 AND 202

VINYL WALL COVER MASTIC

1,600 SF

08/25/2006	Mastic/Adhesive for 4'X8' Vinyl Covered Wall Panels, (over Gypsum Wallboard System). This Material is in GOOD condition as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.
08/19/2022	This Material is unchanged as of this date.
02/17/2023	This Material is unchanged as of this date.
08/18/2023	This Material is unchanged as of this date.
02/16/2024	This Material is unchanged as of this date.
08/16/2024	This Material is unchanged as of this date.
03/03/2025	This Material is unchanged as of this date.
09/19/2025	This Material is unchanged as of this date.

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

06-223AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS 201-202 BUILDING (BUILDING 200)

CLASSROOMS 201 AND 202, RESTROOMS, STORAGE ROOMS AND UTILITY ROOMS

SMOOTH WALL MISCELLANEOUS

2,600 SF

09/14/2005	Gypsum Wallboard System, (with 4'x8' Covered Wall Panels in some areas). Existing Gypsum Wallboard Systems Removed and Replaced with new in-kind in Path-of-Construction. This Material is in GOOD condition as of this date.		
05/14/2009	<5% physical damage. 2 SF is Damaged in the Exterior Storage Closets, 1 SF in each, where Exhaust Ducts have been removed. Several holes and cuts observed on the Walls and Ceilings in 2 Storage Closets and the Custodian Room. Material changed from GOOD to FAIR condition as of this date. No other changes as of this date.		
02/01/2010	Samples 10-019 NW-63 (Joint Tape / Compound), NW-64 (Drywall), NW-66 (Joint Tape / Compound), and NW-67 (Drywall) collected on this date.		
09/18/2015	Additional Damage observed. Exterior Storage Rooms have minor holes and cuts. No other changes as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	Additional Damage Observed. 2 SF of Missing Wall in Storage Room near Classroom 201. No other changes as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		
08/16/2024	This Material is unchanged as of this date.		
03/03/2025	This Material is unchanged as of this date.		
09/19/2025	This Material is unchanged as of this date.		

10-018 NW-63	ND	NONE DETECTED	(ND)
10-018 NW-63	ND	NONE DETECTED	(ND)
10-018 NW-64	ND	NONE DETECTED	(ND)

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
10-018 NW-66	ND	NONE DETECTED	(ND)
10-018 NW-66	2	CHRYSTILE	(CH)
10-018 NW-67	ND	NONE DETECTED	(ND)

CLASSROOMS 201-202 BUILDING (BUILDING 200)

CLASSROOMS 201 AND 202, RESTROOMS, STORAGE ROOMS AND UTILITY ROOMS

SMOOTH WALL SURFACING

2,600 SF

08/25/2006	Skim Coat for Gypsum Wallboard System, (with 4'x8' Covered Wall Panels in some areas). Existing Gypsum Wallboard Systems Removed and Replaced with new in-kind in Path-of-Construction. This Material is in GOOD condition as of this date.
05/14/2009	<5% Physical Damage. 2 SF is Damaged in the Exterior Storage Closets, 1 SF in each, where Exhaust Ducts have been removed. Several holes and cuts observed on the Walls and Ceilings in 2 Storage Closets and the Custodian Room. Material changed from GOOD to FAIR condition as of this date. No other changes as of this date.
02/01/2010	Samples 10-019 NW-62 and NW-65 collected on this date.
09/18/2015	Additional Damage observed, Exterior Storage Rooms have minor holes and cuts. No other change as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	Additional Damage Observed. 2 SF of Missing Wall in Storage Room near Classroom 201. No other changes as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.
08/19/2022	This Material is unchanged as of this date.
02/17/2023	This Material is unchanged as of this date.
08/18/2023	This Material is unchanged as of this date.
02/16/2024	This Material is unchanged as of this date.
08/16/2024	This Material is unchanged as of this date.
03/03/2025	This Material is unchanged as of this date.
09/19/2025	This Material is unchanged as of this date.

10-018 NW-65	2	CHRYSTILE	(CH)
--------------	---	-----------	--------

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	
LOCATION	
MATERIAL TYPE	QTY (APPROXIMATE)
COMMENTS	

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

CLASSROOMS 201-202 BUILDING (BUILDING 200)

CUSTODIAN ROOM AND BOILER ROOM

BASEBOARD MASTIC

80 LF

10/20/2008	Mastic/Adhesive for 4" Brown Baseboard. This Material is in GOOD condition as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.
08/19/2022	This Material is unchanged as of this date.
02/17/2023	This Material is unchanged as of this date.
08/18/2023	This Material is unchanged as of this date.
02/16/2024	This Material is unchanged as of this date.
08/16/2024	This Material is unchanged as of this date.
03/03/2025	This Material is unchanged as of this date.
09/19/2025	This Material is unchanged as of this date.

08-241AAA	ASSUMED	NO SAMPLE	(NS)
------------------	----------------	------------------	---------------

CLASSROOMS 201-202 BUILDING (BUILDING 200)

ENTIRE BUILDING

FIRE DOOR CORE INSULATION

210 SF

08/29/2014	Fire Door Core Insulation. (1 EA Double-Doors + 9 EA Single-Doors). This Material is in GOOD condition as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		
08/16/2024	This Material is unchanged as of this date.		
03/03/2025	This Material is unchanged as of this date.		
09/19/2025	This Material is unchanged as of this date.		
14-198AAA	ASSUMED	NO SAMPLE	(NS)

CLASSROOMS 201-202 BUILDING (BUILDING 200)

EXTERIOR WALLS

ROUGH WALL

3,200 SF

09/14/2005	Stucco Walls. This Material is in GOOD condition as of this date.		
01/28/2016	Sample 16-030-A18 collected from Exterior Wall by Drinking Fountain, Stucco.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		
08/16/2024	This Material is unchanged as of this date.		
03/03/2025	This Material is unchanged as of this date.		

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

09/19/2025 This Material is unchanged as of this date.

16-030-A18	ND	NONE DETECTED	(ND)
05-212AAA	ASSUMED	NO SAMPLE	(NS)

CLASSROOMS 201-202 BUILDING (BUILDING 200)

EXTERIOR WALLS

ROUGH WALL SURFACING

3,200 SF

09/14/2005 Skim Coat for Stucco on Walls. This Material is in GOOD condition as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

08/16/2024 This Material is unchanged as of this date.

03/03/2025 This Material is unchanged as of this date.

09/19/2025 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS 201-202 BUILDING (BUILDING 200)

EXTERIOR WINDOWS

WINDOW CAULKING

200 LF

09/08/2009 Caulking on Exterior Windows. Damage: <5% Physical Damage and <10% Water Damage due to existing degradation of heat and moisture factors and missing portion of material in various locations. This Material is in FAIR condition as of this date.

01/31/2020 This Material is unchanged as of this date.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		
08/16/2024	This Material is unchanged as of this date.		
03/03/2025	This Material is unchanged as of this date.		
09/19/2025	This Material is unchanged as of this date.		
09-212AAA	ASSUMED	NO SAMPLE	(NS)

CLASSROOMS 201-202 BUILDING (BUILDING 200)

RESTROOMS

MORTAR MISCELLANEOUS

200 SF

05/14/2009	Grout/Mortar for 8"x8" Green Ceramic Floor Tiles. This Material is in GOOD condition as of this date. (Original Entry updated on 09/02/10.)		
01/28/2016	Sample 16-030-A22 collected Classroom 202, Grout for 8"x8" Ceramic Floor Tile.		
08/30/2017	Damage Observed. <5% Physical Damage - in the form of 2 Broken Tiles and Chipped Grout, in Room 201. Material condition changed from GOOD to FAIR overall. Friability changed from Non to Friable. No other changes as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

08/16/2024 This Material is unchanged as of this date.

03/03/2025 This Material is unchanged as of this date.

09/19/2025 This Material is unchanged as of this date.

09-098AAA	ASSUMED	NO SAMPLE	(NS)
16-030-A22	ND	NONE DETECTED	(ND)

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	
LOCATION	
MATERIAL TYPE	QTY (APPROXIMATE)
COMMENTS	

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

CLASSROOMS 301-306 BUILDING (BUILDING 300)

CLASSROOMS 301-306 BUILDING (BUILDING 300)

09/14/2005	BUILDING NOTES:
09/14/2005	New Flooring installed in Teacher's Work Room, Storage Rooms, and Staff Restroom per information received from BUESD. Existing Gypsum Wallboard Systems Removed and Replaced with new in-kind in Path-of-Construction.
03/09/2007	Building Name changed from CLASSROOMS 301-306 to CLASSROOMS 301-306 BUILDING (BUILDING 300).
09/15/2016	Major Remodel during the Summer of 2016 per information received from the BUESD. REP Classrooms changed to Flexible Instructional Space (F.I.S.). New Suspended Ceiling Tiles installed.

CLASSROOMS 301-306 BUILDING (BUILDING 300)

ALL CLASSROOMS AND F.I.S. ROOM

VINYL WALL COVER MASTIC

29,000 SF

09/14/2005	Mastic/Adhesive for 4'x8' Vinyl Covered Wall Panels, (over Gypsum Wallboard System). This Material is in GOOD condition as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.
08/19/2022	This Material is unchanged as of this date.
02/17/2023	This Material is unchanged as of this date.
08/18/2023	This Material is unchanged as of this date.
02/16/2024	This Material is unchanged as of this date.
08/16/2024	This Material is unchanged as of this date.
03/03/2025	This Material is unchanged as of this date.
09/19/2025	This Material is unchanged as of this date.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

COMMENTS

QTY (APPROXIMATE)

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
05-212AAA	ASSUMED	NO SAMPLE	(NS)

CLASSROOMS 301-306 BUILDING (BUILDING 300)

BOYS' AND GIRLS' RESTROOMS AND STORAGE ROOM

MORTAR MISCELLANEOUS

350 SF

10/20/2008	Grout/Mortar for 4"x4" White, Green, and Brown Wall Tiles. This Material is in GOOD condition as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.
08/19/2022	This Material is unchanged as of this date.
02/17/2023	This Material is unchanged as of this date.
08/18/2023	This Material is unchanged as of this date.
02/16/2024	This Material is unchanged as of this date.
08/16/2024	This Material is unchanged as of this date.
03/03/2025	This Material is unchanged as of this date.
09/19/2025	This Material is unchanged as of this date.

08-241AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS 301-306 BUILDING (BUILDING 300)

CLASSROOMS 301-308, AND RESTROOMS (2)

MORTAR MISCELLANEOUS

700 SF

09/02/2010	Grout/Mortar for 8"x8" Green, Red and Pink Ceramic Floor Tiles. This Material is in GOOD condition as of this date.
01/28/2016	Sample 16-030-A25 collected from Room 310, Grout for 8"x8" Ceramic Floor Tile.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

08/16/2024 This Material is unchanged as of this date.

03/03/2025 This Material is unchanged as of this date.

09/19/2025 This Material is unchanged as of this date.

10-174AAA	ASSUMED	NO SAMPLE	(NS)
16-030-A25	ND	NONE DETECTED	(ND)

CLASSROOMS 301-306 BUILDING (BUILDING 300)

ENTIRE BUILDING

CEMENTITIOUS WINDOW PANEL

70 SF

08/29/2014 Exterior A/C Cementitious Window Panel. Replacement on Lower and Upper Window Panel. Only on Some areas. This Material is in GOOD condition as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

08/16/2024 This Material is unchanged as of this date.

03/03/2025 This Material is unchanged as of this date.

09/19/2025 This Material is unchanged as of this date.

14-198AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS 301-306 BUILDING (BUILDING 300)

ENTIRE BUILDING

FIRE DOOR CORE INSULATION

672 SF

08/29/2014 Fire Door Core Insulation. (2 EA Double-Doors + 30 EA Single-Doors). This Material is in GOOD condition as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

08/16/2024 This Material is unchanged as of this date.

03/03/2025 This Material is unchanged as of this date.

09/19/2025 This Material is unchanged as of this date.

14-198AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

CLASSROOMS 301-306 BUILDING (BUILDING 300)

ENTIRE BUILDING INCLUDING RESTROOMS, UTILITY ROOMS AND STORAGE ROOMS

SMOOTH WALL MISCELLANEOUS

37,800 SF

09/14/2005	Gypsum Wallboard system, (with 4'x8' Covered Wall Panels in some areas). Existing Gypsum Wallboard Systems Removed and Replaced with new in-kind in Path-of-Construction. This Material is in GOOD condition as of this date.		
02/01/2010	Samples 10-019 NW-77 (Joint Tape / Compound), and NW-78 (Drywall) collected on this date.		
12/01/2011	Damage: <5% Physical Damage - in the form of Storage Room, next to Girls Restroom, approximately 20 SF of Dry Wall has been removed. Material condition changed from GOOD to FAIR overall. No other changes as of this date.		
01/28/2016	Sample 16-030-A31 collected from Workroom 304, Wallboard. Sample 16-030-A32 collected from Workroom 304, Joint Compound. Sample 16-030-A35 collected from Room 303, Demising Wall, Sheetrock Wall.		
09/15/2016	Material Removed in various locations and Replaced with New as part of the Summer 2016 renovation project. Material Quantity changed from 38,200 SF to 37,800 SF. No other changes as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		
08/16/2024	This Material is unchanged as of this date.		
03/03/2025	This Material is unchanged as of this date.		
09/19/2025	This Material is unchanged as of this date.		

10-018 NW-77	ND	NONE DETECTED	(ND)
10-018 NW-77	ND	NONE DETECTED	(ND)
10-018 NW-78	ND	NONE DETECTED	(ND)

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
16-030-A31	ND	NONE DETECTED	(ND)
16-030-A32	ND	NONE DETECTED	(ND)
16-030-A35	ND	NONE DETECTED	(ND)
05-212AAA	ASSUMED	NO SAMPLE	(NS)

CLASSROOMS 301-306 BUILDING (BUILDING 300)

ENTIRE BUILDING INCLUDING RESTROOMS, UTILITY ROOMS AND STORAGE ROOMS

SMOOTH WALL SURFACING

37,800 SF

08/25/2006	Skim Coat for Gypsum Wallboard System, (with 4'x8' Covered Wall Panels in some areas). Existing Gypsum Wallboard Systems Removed and Replaced with new in-kind in Path-of-Construction. This Material is in GOOD condition as of this date.		
02/01/2010	Sample 10-019 NW-76 collected on this date.		
12/01/2011	Damage: <5% Physical Damage - in the form of Storage Room, next to Girls Restroom, approximately 20 SF of Dry Wall has been removed. Material condition changed from GOOD to FAIR overall. No other changes as of this date.		
09/15/2016	Material Removed in various locations and Replaced with New as part of the Summer 2016 renovation project. Material Quantity changed from 38,200 SF to 37,800 SF. No other changes as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		
08/16/2024	This Material is unchanged as of this date.		
03/03/2025	This Material is unchanged as of this date.		
09/19/2025	This Material is unchanged as of this date.		

10-018 NW-76	ND	NONE DETECTED	(ND)
06-223AAA	ASSUMED	NO SAMPLE	(NS)

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

COMMENTS

QTY (APPROXIMATE)

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

CLASSROOMS 301-306 BUILDING (BUILDING 300)

EXTERIOR WALLS AND OVERHANG ON RESTROOMS

ROUGH WALL

7,200 SF

09/14/2005 Stucco Exterior Walls and Restroom Overhangs. This Material is in GOOD condition as of this date.

01/28/2016 Sample 16-030-A33 collected from Exterior by Drinking Fountain, Stucco Wall.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

08/16/2024 This Material is unchanged as of this date.

09/19/2025 This Material is unchanged as of this date.

16-030-A33	ND	NONE DETECTED	(ND)
05-212AAA	ASSUMED	NO SAMPLE	(NS)

CLASSROOMS 301-306 BUILDING (BUILDING 300)

EXTERIOR WALLS AND OVERHANG ON RESTROOMS

ROUGH WALL SURFACING

7,200 SF

09/14/2005 Skim Coat for Stucco on Exterior Walls and Restroom Overhangs. This Material is in GOOD condition as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		
08/16/2024	This Material is unchanged as of this date.		
03/03/2025	This Material is unchanged as of this date.		
09/19/2025	This Material is unchanged as of this date.		
05-212AAA	ASSUMED	NO SAMPLE	(NS)

CLASSROOMS 301-306 BUILDING (BUILDING 300)

EXTERIOR WINDOWS AND DOORS

WINDOW CAULKING

900 LF

09/08/2009	Caulking on Exterior Windows and Doors. Damage: <5% Physical Damage and <10% Water Damage due to existing missing sections of material, and heat and moisture degradation factors in various locations. This Material is in FAIR condition as of this date.		
01/28/2016	Sample 16-030-A34 collected from Exterior Door by 304, Interior side, Door Frame Caulking.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

08/16/2024 This Material is unchanged as of this date.

03/03/2025 This Material is unchanged as of this date.

09/19/2025 This Material is unchanged as of this date.

09-212AAA	ASSUMED	NO SAMPLE	(NS)
16-030-A34	ND	NONE DETECTED	(ND)

CLASSROOMS 301-306 BUILDING (BUILDING 300)

TEACHERS' WORK ROOM, AND CLASSROOMS 301-308

SINK UNDERCOATING

28 SF

10/20/2008 Grey Thermal Undercoating on Sink. (7 EA Sink). This Material is in GOOD condition as of this date. (Original Entry updated on 09/02/10.)

01/28/2016 Sample 16-030-A30 collected from Workroom 304, Gray Thermal Undercoating on Sink.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

08/16/2024 This Material is unchanged as of this date.

03/03/2025 This Material is unchanged as of this date.

09/19/2025 This Material is unchanged as of this date.

08-241AAA	ASSUMED	NO SAMPLE	(NS)
16-030-A30	ND	NONE DETECTED	(ND)

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

CLASSROOMS 301-306 BUILDING (BUILDING 300)

WATER HEATER ROOM (NEXT TO RESTROOMS) AND JANITOR CLOSET

BASEBOARD MASTIC

15 LF

09/14/2005	Mastic/Adhesive for 4" Brown Baseboard. This Material is in GOOD condition as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.
08/19/2022	Damage Observed. <5% Physical Damage in the form of 2 LF of Missing Baseboard with Brown Mastic Exposed. Material condition changed from GOOD to FAIR overall. Friability updated from Non-Friable to Friable. No other changes as of this date.
02/17/2023	This Material is unchanged as of this date.
08/18/2023	This Material is unchanged as of this date.
02/16/2024	This Material is unchanged as of this date.
08/16/2024	This Material is unchanged as of this date.
03/03/2025	This Material is unchanged as of this date.
09/19/2025	This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

CLASSROOMS 400-406 BUILDING (BUILDING 400)

CLASSROOMS 400-406 BUILDING (BUILDING 400)

03/07/2014	BUILDING NOTES:
10/20/2008	Building Name changed from CLASSROOMS 401-406 BUILDING (BUILDING 400) to CLASSROOMS 400-406 BUILDING (BUILDING 400).
03/07/2014	New Ceramic Wall Tiles installed in Boys and Girls Restrooms and Storage Room.
09/15/2016	New Flooring Finishes installed Summer 2015 per information received from the BUESD. New Suspended Ceiling Tiles installed.

CLASSROOMS 400-406 BUILDING (BUILDING 400)

CLASSROOMS, AND LIBRARY

VINYL WALL COVER MASTIC

29,880 SF

09/14/2005	Mastic/Adhesive for Vinyl Wall Covering on 4'x8' Vinyl Covered Wall Panels. This Material is in GOOD condition as of this date.
09/15/2016	Damage observed. Damage: <5% Physical Damage - in the form of 6" tear in the Vinyl in Classroom 401. Material Condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.
08/19/2022	This Material is unchanged as of this date.
02/17/2023	This Material is unchanged as of this date.
08/18/2023	This Material is unchanged as of this date.
02/16/2024	Additional Damage Observed. Classroom 404 has a 1/2 Foot Teat in Material. No other changes as of this date.
08/16/2024	This Material is unchanged as of this date.
03/03/2025	This Material is unchanged as of this date.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	
LOCATION	
MATERIAL TYPE	QTY (APPROXIMATE)
COMMENTS	

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

09/19/2025 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
------------------	----------------	------------------	---------------

CLASSROOMS 400-406 BUILDING (BUILDING 400)

ENTIRE BUILDING

CEMENTITIOUS WINDOW PANEL

50 SF

08/29/2014 Exterior A/C Cementitious Window Panel. Replacement on Lower and Upper Window Panel. Only on Some areas. This Material is in GOOD condition as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

08/16/2024 This Material is unchanged as of this date.

03/03/2025 This Material is unchanged as of this date.

09/19/2025 This Material is unchanged as of this date.

14-18AAA	ASSUMED	NO SAMPLE	(NS)
-----------------	----------------	------------------	---------------

CLASSROOMS 400-406 BUILDING (BUILDING 400)

ENTIRE BUILDING

FIRE DOOR CORE INSULATION

399 SF

08/29/2014 Fire Door Core Insulation. (3 EA Double-Doors + 16 EA Single-Doors). This Material is in GOOD condition as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

SF= Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

08/16/2024 This Material is unchanged as of this date.

03/03/2025 This Material is unchanged as of this date.

09/19/2025 This Material is unchanged as of this date.

14-198AAA ASSUMED NO SAMPLE (NS)

CLASSROOMS 400-406 BUILDING (BUILDING 400)

ENTIRE BUILDING

SMOOTH WALL MISCELLANEOUS

38,100 SF

09/14/2005 Gypsum Wallboard System Walls and Ceilings. (Material assumed to exist under 4'x8' Vinyl Covered Wall Panels. Damage: <5% Physical Damage - in PE Storage Room; Water Damage: <10% - in PE Storage Room. This Material is in FAIR condition overall as of this date.

04/21/2008 50 SF in PE Storage Room Damaged above the Double Entry Doors and 2 SF of debris on Floor. Missing Material with broken edges in the center of the ceiling as of this date.

02/01/2010 Samples 10-019 NW-59 (Joint Tape / Compound), and NW-60 (Drywall) collected on this date.

09/18/2015 Additional Damage observed. Exterior Storage Closet by Students Restrooms has minor holes and cuts. No other changes as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 Additional Damage Observed. 2 LF Crack in Work Room of Classroom 402. No other changes as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

SF= Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

08/19/2022	This Material is unchanged as of this date.		
02/17/2023	Additional Damage Observed. <5% Physical Damage in the form of 1 SF of Scuffs and Holes in Work Room of Classroom 406. Material remains in FAIR condition overall. No other changes as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		
08/16/2024	This Material is unchanged as of this date.		
03/03/2025	This Material is unchanged as of this date.		
09/19/2025	This Material is unchanged as of this date.		

10-018 NW-59	ND	NONE DETECTED	(ND)
10-018 NW-59	ND	NONE DETECTED	(ND)
10-018 NW-60	ND	NONE DETECTED	(ND)
05-212AAA	ASSUMED	NO SAMPLE	(NS)

CLASSROOMS 400-406 BUILDING (BUILDING 400)

ENTIRE BUILDING

SMOOTH WALL SURFACING

38,100 SF

08/25/2006	Skim Coat for Gypsum Wallboard System Walls and Ceilings. (Material assumed to exist under 4'x8' Vinyl Covered Wall Panels. Damage: <5% Physical Damage - in PE Storage Room; Water Damage: <10% - in PE Storage Room. This Material is in FAIR condition overall as of this date.		
09/18/2015	Additional Damage observed. Exterior Storage Closet by Students Restrooms has minor holes and cuts. No other change as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	Additional Damage Observed. 2 LF Crack in Work Room of Classroom 402. No other changes as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/17/2023 Additional Damage Observed. <5% Physical Damage in the form of 1 SF of Scuffs and Holes in Work Room of Classroom 406. Material remains in FAIR condition overall. No other changes as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

08/16/2024 This Material is unchanged as of this date.

03/03/2025 This Material is unchanged as of this date.

09/19/2025 This Material is unchanged as of this date.

06-223AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS 400-406 BUILDING (BUILDING 400)

EXTERIOR WALLS, AND OVERHANG OF RESTROOMS

ROUGH WALL

7,200 SF

09/14/2005 Stucco Exterior Walls and Restrooms Overhangs. This Material is in GOOD condition as of this date.

05/14/2009 This Material has hairline cracks on various surfaces. <5% Physical Damage. Friability changed from Non-Friable to Friable. Material changed from GOOD to FAIR condition. No other changes as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 Additional Damage Observed. <5% Physical Damage in the form of 4 SF of Peeling Paint and 10 LF of Cracks on South Wall of Building. Material remains in FAIR condition overall. No other changes as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

08/16/2024 This Material is unchanged as of this date.

03/03/2025 This Material is unchanged as of this date.

SF= Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

09/19/2025 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
05-212AAA	ASSUMED	NO SAMPLE	(NS)

CLASSROOMS 400-406 BUILDING (BUILDING 400)

EXTERIOR WALLS, AND OVERHANG OF RESTROOMS

ROUGH WALL SURFACING

7,200 SF

09/14/2005 Skim Coat for Stucco on Exterior Walls and Restrooms Overhang. This Material is in GOOD condition as of this date.

05/14/2009 This Material has hairline cracks on various surfaces. <5% Physical Damage. Friability changed from Non-Friable to Friable. Material changed from GOOD to FAIR condition. No other changes as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 Additional Damage Observed. <5% Physical Damage in the form of 4 SF of Peeling Paint and 10 LF of Cracks on South Wall of Building. Material remains in FAIR condition overall. No other changes as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

08/16/2024 This Material is unchanged as of this date.

03/03/2025 This Material is unchanged as of this date.

09/19/2025 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

CLASSROOMS 400-406 BUILDING (BUILDING 400)

EXTERIOR WINDOWS

WINDOW CAULKING

900 LF

09/08/2009	Caulking on Exterior Windows. Damage: <5% Physical Damage and <10% Water Damage due to existing missing sections of material, and heat and moisture degradation factors in various locations. This Material is in FAIR condition as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.
08/19/2022	This Material is unchanged as of this date.
02/17/2023	This Material is unchanged as of this date.
08/18/2023	This Material is unchanged as of this date.
02/16/2024	This Material is unchanged as of this date.
08/16/2024	This Material is unchanged as of this date.
03/03/2025	This Material is unchanged as of this date.
09/19/2025	This Material is unchanged as of this date.

09-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS 400-406 BUILDING (BUILDING 400)

LIBRARY (400), CLASSROOMS 401-406, AND RESTROOMS

MORTAR MISCELLANEOUS

700 SF

09/02/2010	Grout/Mortar for 8"x8" Green, Pink and Red Ceramic Floor Tiles. This Material is in GOOD condition as of this date. (Original Entry updated on 03/07/14.)
01/28/2016	Sample 16-030-A37 collected from Library (403), Grout for 8"x8" Ceramic Floor Tile.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		
08/16/2024	This Material is unchanged as of this date.		
03/03/2025	This Material is unchanged as of this date.		
09/19/2025	This Material is unchanged as of this date.		
10-174AAA	ASSUMED	NO SAMPLE	(NS)
16-030-A37	ND	NONE DETECTED	(ND)

CLASSROOMS 400-406 BUILDING (BUILDING 400)

LIBRARY STORAGE

BASEBOARD MASTIC

50 LF

10/20/2008	Mastic/Adhesive for 4" Brown Baseboard. This Material is in GOOD condition as of this date.		
09/15/2016	Damage observed. Damage: <5% Physical Damage - in the form of loose Baseboard in 2 locations exposing Mastic/Adhesive. Material condition changed from GOOD to FAIR overall. Friability changed from Non to Low. No other changes as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	This Material is unchanged as of this date.		

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

08/16/2024 This Material is unchanged as of this date.

03/03/2025 This Material is unchanged as of this date.

09/19/2025 This Material is unchanged as of this date.

08-241AAA ASSUMED NO SAMPLE (NS)

CLASSROOMS 400-406 BUILDING (BUILDING 400)

LIBRARY STORAGE

VINYL FLOOR TILE

144 SF

10/20/2008 9"x9" Beige Vinyl Floor Tile. This Material is in GOOD condition as of this date.

09/15/2016 Additional Damage observed. 2 Tiles are missing exposing Mastic/Adhesive. No other changes as of this date.

04/03/2017 Material Re-assessed. Missing Tiles have been replaced however, 1 Tile is Broken with Mastic Exposed. Material remains in FAIR condition. No other changes as of this date.

08/30/2017 Additional Damage Observed. 2 Tiles are Missing Mastic Exposed. No other changes as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

08/16/2024 This Material is unchanged as of this date.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

03/03/2025 This Material is unchanged as of this date.

09/19/2025 This Material is unchanged as of this date.

08-241AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS 400-406 BUILDING (BUILDING 400)

LIBRARY STORAGE

VINYL FLOOR TILE MASTIC

144 SF

10/20/2008 Mastic/Adhesive for 9"x9" Beige Vinyl Floor Tile. This Material is in GOOD condition as of this date.

09/15/2016 Additional Damage observed. 2 Tiles are missing exposing Mastic/Adhesive. No other changes as of this date.

04/03/2017 Material Re-assessed. Missing Tiles have been replaced however, 1 Tile is Broken with Mastic Exposed. Material remains in FAIR condition. No other changes as of this date.

08/30/2017 Additional Damage Observed. 2 Tiles are Missing Mastic Exposed. No other changes as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

08/16/2024 This Material is unchanged as of this date.

03/03/2025 This Material is unchanged as of this date.

09/19/2025 This Material is unchanged as of this date.

08-241AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

CLASSROOMS 400-406 BUILDING (BUILDING 400)

TEACHERS' WORK ROOM, AND LIBRARY

SINK UNDERCOATING

24 SF

10/20/2008 Grey Thermal Undercoating on Sink. (6 EA Sink). This Material is in GOOD condition as of this date.
(Original Entry updated on 09/02/10.)

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

08/16/2024 This Material is unchanged as of this date.

03/03/2025 This Material is unchanged as of this date.

09/19/2025 This Material is unchanged as of this date.

08-241AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS 400-406 BUILDING (BUILDING 400)

WATER HEATER ROOM AND UTILITY CLOSET

BASEBOARD MASTIC

40 LF

09/14/2005 Mastic/Adhesive for 4" Brown Baseboard. This Material is in GOOD condition as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		
08/16/2024	This Material is unchanged as of this date.		
03/03/2025	This Material is unchanged as of this date.		
09/19/2025	This Material is unchanged as of this date.		
05-212AAA	ASSUMED	NO SAMPLE	(NS)

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	
LOCATION	
MATERIAL TYPE	QTY (APPROXIMATE)
COMMENTS	

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
-------------------	-------------------------	----------------------	----------------------

CLASSROOMS 501-506 BUILDING (BUILDING 500)

CLASSROOMS 501-506 BUILDING (BUILDING 500)

09/14/2005	BUILDING NOTES:
09/14/2005	New Flooring Finishes installed Summer 2005 per information received from the BUESD.
09/15/2016	New Flooring Finishes installed Summer 2015 per information received from the BUESD. New Suspended Ceiling Tiles installed.
04/03/2017	New Ceramic Wall and Floor Tiles installed in the Boys and Girls Restrooms.
08/18/2023	Staff Restroom 12"x12" Vinyl Flooring abated and replaced with epoxy flooring Summer 2023 per information received from BUESD.

CLASSROOMS 501-506 BUILDING (BUILDING 500)

CLASSROOMS 501-504 (AND RESTROOMS), AND CLASSROOMS 505 & 506 (AND RESTROOMS)

MORTAR MISCELLANEOUS

800 SF

09/02/2010	Grout/Mortar for 8"x8" Green, Pink and Red Ceramic Floor Tiles. This Material is in GOOD condition as of this date. (Original Entry updated on 03/07/14.)
01/28/2016	Sample 16-030-A43 collected from Room 517, Mortar for Red 8"x8" Ceramic Floor Tile.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/21/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.
08/19/2022	This Material is unchanged as of this date.
02/17/2023	This Material is unchanged as of this date.
08/18/2023	This Material is unchanged as of this date.
02/16/2024	This Material is unchanged as of this date.
08/16/2024	This Material is unchanged as of this date.
03/03/2025	This Material is unchanged as of this date.
09/19/2025	This Material is unchanged as of this date.

10-174AAA

ASSUMED

NO SAMPLE

(NS)

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
16-030-A43	ND	NONE DETECTED	(ND)

CLASSROOMS 501-506 BUILDING (BUILDING 500)

CLASSROOMS 501-506

SINK UNDERCOATING

20 SF

10/20/2008	Grey Thermal Undercoating on Sink. (5 EA Sink). This Material is in GOOD condition as of this date. (Original Entry updated on 09/02/10.)
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/21/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.
08/19/2022	This Material is unchanged as of this date.
02/17/2023	This Material is unchanged as of this date.
08/18/2023	This Material is unchanged as of this date.
02/16/2024	This Material is unchanged as of this date.
08/16/2024	This Material is unchanged as of this date.
03/03/2025	This Material is unchanged as of this date.
09/19/2025	This Material is unchanged as of this date.

08-241AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS 501-506 BUILDING (BUILDING 500)

CLASSROOMS 501-506 AND COMPUTER LAB

VINYL WALL COVER MASTIC

30,000 SF

09/14/2005	Mastic/Adhesive for Vinyl Covering on 4'x8' Vinyl Covered Wall Panels. This Material is in GOOD condition as of this date.
09/18/2015	Damage observed. Center Classroom has 1/2 SF of Physical Damage. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
02/21/2021	Additional Damage Observed. <5% Physical Damage in the form of 1/4 SF of Missing Vinyl Wall Cover on Wall next to RSP Room. Material remains in FAIR condition overall. No other changes as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		
08/16/2024	This Material is unchanged as of this date.		
08/16/2024	This Material is unchanged as of this date.		
03/03/2025	This Material is unchanged as of this date.		
09/19/2025	This Material is unchanged as of this date.		
05-212AAA	ASSUMED	NO SAMPLE	(NS)

CLASSROOMS 501-506 BUILDING (BUILDING 500)

ENTIRE BUILDING

CEMENTITIOUS WINDOW PANEL

50 SF

08/29/2014	Exterior A/C Cementitious Window Panel. Replacement on lower and upper Window Panel. Only on Some areas. This Material is in GOOD condition as of this date.		
09/15/2016	Damage observed. Damage: <5% Physical Damage - in the form of 1 broken Panel in Room 503. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.		
08/15/2018	Material Re-assessed. Partial Repairs made to Broken Panel in Classroom 503. Panel is Partially Covered with Plywood. No other changes as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/21/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	This Material is unchanged as of this date.		

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

08/16/2024 This Material is unchanged as of this date.

03/03/2025 This Material is unchanged as of this date.

09/19/2025 This Material is unchanged as of this date.

14-198AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS 501-506 BUILDING (BUILDING 500)

ENTIRE BUILDING

FIRE DOOR CORE INSULATION

651 SF

08/29/2014 Fire Door Core Insulation. (2 EA Double-Doors + 29 EA Single-Doors). This Material is in GOOD condition as of this date.

09/15/2016 This Material is unchanged as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/21/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

08/16/2024 This Material is unchanged as of this date.

03/03/2025 This Material is unchanged as of this date.

09/19/2025 This Material is unchanged as of this date.

14-198AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

CLASSROOMS 501-506 BUILDING (BUILDING 500)

ENTIRE BUILDING (INCLUDING RESTROOMS, STORAGE ROOMS AND UTILITY ROOMS)

SMOOTH WALL MISCELLANEOUS

38,500 SF

09/14/2005	Gypsum Wallboard System Walls and Ceilings. Material assumed to exist under 4'x8' Vinyl Covered Wall Panels. This Material is in GOOD condition as of this date.
02/01/2010	Samples 10-019 NW-55 (Joint Tape / Compound), and NW-56 (Drywall) collected on this date.
04/12/2012	Damage: <5% Physical Damage - in the form of approximately 1 SF of missing paint on Ceiling, and Joint Tape & Mud is exposed; <10% Water Damage - in the form of Water Damage observed at Main Entrance, between Classrooms 503 & 504. Material condition changed from GOOD to FAIR overall as of this date. No other changes as of this date.
09/18/2015	Additional Damages observed. Center Classroom has 1/2 SF of Physical Damage, Storage Rooms between Rooms 505 and 506 have minor holes and cuts. No other changes as of this date.
09/15/2016	Additional Damage observed. Classroom 504 has a small hole, approximately 2"x2". No other changes as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/21/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.
08/19/2022	This Material is unchanged as of this date.
02/17/2023	This Material is unchanged as of this date.
08/18/2023	This Material is unchanged as of this date.
02/16/2024	This Material is unchanged as of this date.
08/16/2024	This Material is unchanged as of this date.
03/03/2025	This Material is unchanged as of this date.
09/19/2025	This Material is unchanged as of this date.

10-018 NW-55	ND	NONE DETECTED	(ND)
10-018 NW-55	ND	NONE DETECTED	(ND)
10-018 NW-56	ND	NONE DETECTED	(ND)
05-212AAA	ASSUMED	NO SAMPLE	(NS)

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

CLASSROOMS 501-506 BUILDING (BUILDING 500)

ENTIRE BUILDING INCLUDING RESTROOMS, STORAGE ROOMS AND UTILITY ROOMS

SMOOTH WALL SURFACING

38,500 SF

08/25/2006	Skim Coat for Gypsum Wallboard System Walls and Ceilings. Material Assumed to exist Under 4'X8' Vinyl Covered Wall Panels. This Material is in GOOD condition as of this date.
04/12/2012	Damage: <5% Physical Damage - in the form of approximately 1 SF of missing paint on Ceiling, and Joint Tape & Mud is exposed; <10% Water Damage - in the form of water damage observed at Main Entrance, between Classrooms 503 & 504. Material condition changed from GOOD to FAIR overall as of this date. No other changes as of this date.
09/18/2015	Additional Damages observed. Center Classroom has 1/2 SF of Physical Damage, Storage Rooms between Rooms 505 and 506 have minor holes and cuts. No other changes as of this date.
09/15/2016	Additional Damage observed. Classroom 504 has a small hole, approximately 2"x2". No other changes as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/21/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.
08/19/2022	This Material is unchanged as of this date.
02/17/2023	This Material is unchanged as of this date.
08/18/2023	This Material is unchanged as of this date.
02/16/2024	This Material is unchanged as of this date.
08/16/2024	This Material is unchanged as of this date.
03/03/2025	This Material is unchanged as of this date.
09/19/2025	This Material is unchanged as of this date.

06-223AAA

ASSUMED

NO SAMPLE

(NS)

CLASSROOMS 501-506 BUILDING (BUILDING 500)

EXTERIOR WALLS, AND OVERHANG OF RESTROOMS

ROUGH WALL SURFACING

7,200 SF

09/14/2005	Skim Coat for Stucco on Exterior Walls and Restrooms Overhangs. This Material is in GOOD condition as of this date.
------------	---

SF= Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

54

HazMat Doc

AHERA Report B - Survey

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/21/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		
08/16/2024	This Material is unchanged as of this date.		
03/03/2025	This Material is unchanged as of this date.		
09/19/2025	This Material is unchanged as of this date.		
05-212AAA	ASSUMED	NO SAMPLE	(NS)

CLASSROOMS 501-506 BUILDING (BUILDING 500)

EXTERIOR WALLS, AND OVERHANGS OF RESTROOMS

ROUGH WALL

7,200 SF

09/14/2005	Stucco Exterior Walls and Overhangs. This Material is in GOOD condition as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/21/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		
08/16/2024	This Material is unchanged as of this date.		

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

03/03/2025 This Material is unchanged as of this date.

09/19/2025 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS 501-506 BUILDING (BUILDING 500)

EXTERIOR WINDOWS

WINDOW CAULKING

900 LF

09/08/2009 Caulking on Exterior Windows. Damage: <5% Physical Damage and <10% Water Damage due to existing missing and damaged sections of material, and heat and moisture degradation factors in various locations. This Material is in FAIR condition as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/21/2021 Additional Damage Observed. <5% Physical Damage in the form of 3 LF of Cracks on Window of Classroom 503. Material remains in FAIR condition overall. No other changes as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

08/16/2024 This Material is unchanged as of this date.

03/03/2025 This Material is unchanged as of this date.

09/19/2025 This Material is unchanged as of this date.

09-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS 501-506 BUILDING (BUILDING 500)

WATER HEATER CLOSET AND STORAGE

BASEBOARD MASTIC

50 LF

09/14/2005 Mastic/Adhesive for 4" Brown Baseboard. This Material is in GOOD condition as of this date.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
10/20/2008	Location Description changed from WATER HEATER CLOSET to WATER HEATER CLOSET AND STORAGE. Material Quantity changed from 25 LF to 50 LF to reflect this fact. No other changes as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/21/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		
08/16/2024	This Material is unchanged as of this date.		
03/03/2025	This Material is unchanged as of this date.		
09/19/2025	This Material is unchanged as of this date.		
05-212AAA	ASSUMED	NO SAMPLE	(NS)

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

CLASSROOMS 801 PORTABLE BUILDING

CLASSROOMS 801 PORTABLE BUILDING

10/20/2008 BUILDING INFORMATION:

10/20/2008 Manufacturer's Tag Info:
By American Modular System; Date 07/08; DSA #01-109890; Serial #'s 08-419-004A, 08-419-004B.
This entry for informational and tracking purposes.

CLASSROOMS 801 PORTABLE BUILDING

CLASSROOM 801

PORTABLE BUILDING

960 SF

10/20/2008 New 2008 Construction Relocatable Building per Manufacturer's Tag information.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

08/16/2024 This Material is unchanged as of this date.

03/03/2025 This Material is unchanged as of this date.

09/19/2025 This Material is unchanged as of this date.

08-241AAA	NEW	NO SAMPLE	(NS)
-----------	-----	-----------	--------

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

09/14/2005 BUILDING NOTES:

09/14/2005 No Manufacturer's Tag Info. This entry for informational and tracking purposes.

03/09/2007 Building Name changed from PORTABLE DAYCARE - CDC to DAYCARE PORTABLE BUILDING - CDC (BUILDING 600).

03/19/2015 New Vinyl Plank Flooring installed in Food Prep Area.

DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

CLASSROOMS

BASEBOARD MASTIC

350 LF

09/14/2005 Mastic/Adhesive for 4" Brown Baseboard. This Material is in GOOD condition as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

08/16/2024 This Material is unchanged as of this date.

03/03/2025 This Material is unchanged as of this date.

09/19/2025 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	
LOCATION	
MATERIAL TYPE	QTY (APPROXIMATE)
COMMENTS	

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
-------------------	-------------------------	----------------------	----------------------

DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

CLASSROOMS

SMOOTH WALL MISCELLANEOUS

2,120 SF

09/14/2007	Gypsum Wallboard System. This Material is in GOOD condition as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.
08/19/2022	This Material is unchanged as of this date.
02/17/2023	This Material is unchanged as of this date.
08/18/2023	This Material is unchanged as of this date.
02/16/2024	This Material is unchanged as of this date.
08/16/2024	This Material is unchanged as of this date.
03/03/2025	This Material is unchanged as of this date.
09/19/2025	This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
------------------	----------------	------------------	---------------

DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

CLASSROOMS

SUSPENDED CEILING TILE

2,040 SF

09/14/2005	2'x4' Vinyl Covered Fiberglass Suspended Ceiling Tile. Tiles are White with a smooth texture on fiberglass panel. This Material is in GOOD condition as of this date. (Original Entry updated 03/19/15.)
11/09/2007	Material re-assessed. Damage: <5% Physical Damage - due to 14 Tiles with minor holes and cuts. Friability changed from Non to Friable. Material condition change from GOOD to FAIR overall.
12/01/2011	Additional Damage - in the form of several Tiles are Damaged. No other changes as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

08/16/2024 This Material is unchanged as of this date.

03/03/2025 This Material is unchanged as of this date.

09/19/2025 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

CLASSROOMS

VINYL FLOOR TILE

960 SF

09/14/2005 12"x12" Pink Vinyl Floor Tile. (Material may exist under current 6"x4' Light Brown Wood Design Vinyl Plank Flooring). No other changes as of this date. This Material is in GOOD condition overall as of this date. (Original entry updated 8/19/22)

08/25/2006 Quantity changed from 1,265 SF to 960 SF. No other changes as of this date.

04/03/2017 Additional Damage Observed. 2 Broken Tiles near Restroom area. No other changes as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 Material not observed, Material may exist under current 6"x4' Light Brown Wood Design Vinyl Plank Flooring. No other changes as of this date.

02/17/2023 This Material is unchanged as of this date.

SF= Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		
08/16/2024	This Material is unchanged as of this date.		
03/03/2025	This Material is unchanged as of this date.		
09/19/2025	This Material is unchanged as of this date.		
05-212AAA	ASSUMED	NO SAMPLE	(NS)
05-212AAA	ASSUMED	NO SAMPLE	(NS)

DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

CLASSROOMS

VINYL FLOOR TILE MASTIC

960 SF

09/14/2005	Mastic/Adhesive for 12"x12" Pink Vinyl Floor Tile. (Material may exist under current 6"x4' Light Brown Wood Design Vinyl Plank Flooring). No other changes as of this date. This Material is in GOOD condition overall as of this date. (Original entry updated 8/19/22)		
08/25/2006	Material Quantity changed from 1,265 SF to 960 SF. No other changes as of this date.		
04/03/2017	Additional Damage Observed. 2 Broken Tiles near Restroom area. No other changes as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	Material not observed, Material may exist under current 6"x4' Light Brown Wood Design Vinyl Plank Flooring. No other changes as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		
08/16/2024	This Material is unchanged as of this date.		
03/03/2025	This Material is unchanged as of this date.		

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

09/19/2025 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
05-212AAA	ASSUMED	NO SAMPLE	(NS)

DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

CLASSROOMS

VINYL WALL COVER MASTIC

2,100 SF

09/14/2005 Mastic/Adhesive for Vinyl Covering on 4'x10' Vinyl Covered Wall Panels. This Material is in GOOD condition as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

08/16/2024 This Material is unchanged as of this date.

03/03/2025 This Material is unchanged as of this date.

09/19/2025 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

CLASSROOMS, OFFICE AND STORAGE ROOM

CARPET MASTIC

150 SF

09/14/2005 Mastic/Adhesive for Brown and Blue Carpets. (Classroom & Office - 95% Brown - ; Carpet in Storage Room - 5% Blue). This Material is in GOOD condition as of this date.

08/25/2006 Material Quantity changed from 675 SF to 1,000 SF. No other changes as of this date.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
12/01/2011	Location Description changed from CLASSROOMS to CLASSROOMS, OFFICE AND STORAGE ROOM. No other changes as of this date.		
03/07/2014	1 SF is Damaged. This Material is in FAIR condition. Friability changed from Non-Friable to Friable. No other changes as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	Location Re-Assessed. Material only observed in Storage Room, Material may exist under current Gray Black Carpet. Location Description changed from CLASSROOMS, OFFICE AND STORAGE ROOM to STORAGE ROOM. Material may exist under current Gray Black Carpet. Material Quantity changed from 1,000 SF to 150 SF. No other changes as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		
08/16/2024	This Material is unchanged as of this date.		
03/03/2025	This Material is unchanged as of this date.		
09/19/2025	This Material is unchanged as of this date.		
05-212AAA	ASSUMED	NO SAMPLE	(NS)

DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

DAYCARE PORTABLE (600)

SINK UNDERCOATING

10 SF

09/02/2010	Black Thermal Undercoating on Sink. (4 EA Sinks). Thermal undercoatings are Black and Gray. This Material is in GOOD condition as of this date. (Original Entry updated 03/19/15.)		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		
08/16/2024	This Material is unchanged as of this date.		
03/03/2025	This Material is unchanged as of this date.		
09/19/2025	This Material is unchanged as of this date.		
10-174AAA	ASSUMED	NO SAMPLE	(NS)

DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

ENTIRE BUILDING

FIRE DOOR CORE INSULATION

63 SF

08/29/2014	Fire Door Core Insulation. (3 EA Single-Doors). This Material is in GOOD condition as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		
08/16/2024	This Material is unchanged as of this date.		
03/03/2025	This Material is unchanged as of this date.		

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	
LOCATION	
MATERIAL TYPE	QTY (APPROXIMATE)
COMMENTS	

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

09/19/2025 This Material is unchanged as of this date.

14-198AAA	ASSUMED	NO SAMPLE	(NS)
------------------	----------------	------------------	---------------

DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

RESTROOMS (1 EA BOYS' AND GIRLS'), STAFF ROOM, AND CUSTODIAN ROOM

VINYL SHEETING 140 SF

09/14/2005 Beige Vinyl Sheeting. This Material is in GOOD condition as of this date.

08/25/2006 Material Quantity changed from 100 SF to 140 SF. No other changes as of this date.

12/01/2011 Location Description changed from RESTROOMS (2) to RESTROOMS (1 EA- BOYS' AND GIRLS'), STAFF ROOM, AND CUSTODIAN ROOM. Damage: <5% Physical Damage - in the form of approximately 4 SF is missing in Custodian Room. Material condition changed from GOOD to FAIR overall as of this date.

04/03/2017 Additional Damage Observed. 1 SF of Cracked and Broken Flooring in Both the Boys Restroom and Girls Restroom. No other changes as fo this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

08/16/2024 This Material is unchanged as of this date.

03/03/2025 This Material is unchanged as of this date.

09/19/2025 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
------------------	----------------	------------------	---------------

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	
LOCATION	
MATERIAL TYPE	QTY (APPROXIMATE)
COMMENTS	

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
-------------------	-------------------------	----------------------	----------------------

DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

RESTROOMS (1 EA BOYS' AND GIRLS'), STAFF ROOM, AND CUSTODIAN ROOM

VINYL SHEETING BACKING PAPER/MASTIC

140 SF

09/14/2005	Backing Paper/Adhesive for Beige Vinyl Sheeting. This Material is in GOOD condition as of this date.
08/25/2006	Material Quantity changed from 100 SF to 140 SF. No other changes as of this date.
12/01/2011	Location Description changed from RESTROOMS (2) to RESTROOMS (1 EA- BOYS' AND GIRLS'), STAFF ROOM, AND CUSTODIAN ROOM. Damage: <5% Physical Damage - in the form of approximately 4 SF is missing in Custodian Room. Material condition changed from GOOD to FAIR overall as of this date.
04/03/2017	Additional Damage Observed. 1 SF of Cracked and Broken Flooring in Both the Boys Restroom and Girls Restroom. No other changes as fo this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.
08/19/2022	This Material is unchanged as of this date.
02/17/2023	This Material is unchanged as of this date.
08/18/2023	This Material is unchanged as of this date.
02/16/2024	This Material is unchanged as of this date.
08/16/2024	This Material is unchanged as of this date.
03/03/2025	This Material is unchanged as of this date.
09/19/2025	This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
------------------	----------------	------------------	---------------

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

DAYCARE PORTABLE BUILDING - FED CHILDCARE (BUILDING 900)

DAYCARE PORTABLE BUILDING - FED CHILDCARE (BUILDING 900)

09/14/2005 BUILDING NOTES:

09/14/2005 Manufacturer's Tag Info:
BY SPACE MASTER; DATE: 4/89; SERIAL: 14786; OSA: 0425.
This entry for informational and tracking purposes.

03/09/2007 Building Name changed from PORTABLE DAYCARE - FED CHILDCARE to DAYCARE PORTABLE BUILDING - FED CHILDCARE (BUILDING 900).
Location Descriptions changed from PORTABLE DAYCARE - FED CHILDCARE to CLASSROOM.

DAYCARE PORTABLE BUILDING - FED CHILDCARE (BUILDING 900)

DAYCARE PORTABLE BUILDING - FED CHILDCARE (BUILDING 900)

PORTABLE BUILDING

960 SF

09/14/2005 New Portable Building per Manufacturer's Tag Info.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

08/16/2024 This Material is unchanged as of this date.

03/03/2025 This Material is unchanged as of this date.

09/19/2025 This Material is unchanged as of this date.

05-212.NS	NEW	NO SAMPLE	(NS)
-----------	-----	-----------	--------

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

DAYCARE PORTABLE BUILDING - SDC (BUILDING 800)

DAYCARE PORTABLE BUILDING - SDC (BUILDING 800)

09/14/2005	BUILDING NOTES:
09/14/2005	Manufacturer's Tag Info: By American Modular; OSA #65132; SERIAL# 96-R24-004A, 96-R24-004B. This entry for informational and tracking purposes.
03/09/2007	Building Name changed from PORTABLE DAYCARE - SDC to DAYCARE PORTABLE BUILDING - SDC (BUILDING 800).
10/20/2008	Serial #'s on Manufacturer's Tag Info changed from 96-R24-004A, 96-R24-004B to 96-R243-004A, 96-R243-004B. Date 7/96

DAYCARE PORTABLE BUILDING - SDC (BUILDING 800)

PORTABLE DAYCARE - SDC

PORTABLE BUILDING

960 SF

04/20/2006	New 1996 Construction Relocatable Building per Manufacturer's Tag information.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.
02/17/2023	This Material is unchanged as of this date.
08/18/2023	This Material is unchanged as of this date.
02/16/2024	This Material is unchanged as of this date.
08/16/2024	This Material is unchanged as of this date.
03/03/2025	This Material is unchanged as of this date.
09/19/2025	This Material is unchanged as of this date.

05-212.NS	NEW	NO SAMPLE	(NS)
05-212.NS	NEW	NO SAMPLE	(NS)

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

FAMILY RESOURCE CENTER (BUILDING 700)

FAMILY RESOURCE CENTER (BUILDING 700)

04/21/2008	BUILDING NOTES:
04/21/2008	Manufacturers Tag Info: By American Modular System. Date of manufacturer 07/07. DSA #01-108993. Serial #07-352-001A, 07-352-001B, 07-352-001C, 07-352-001D, 07-352-001E.
05/14/2009	Building name changed from DAYCARE PORTABLE BUILDING - STATE to STATE PRESCHOOL PORTABLE BUILDING (BUILDING 700).

FAMILY RESOURCE CENTER (BUILDING 700)

DAYCARE PORTABLE BUILDING - STATE

PORTABLE BUILDING

1,440 SF

04/21/2008	New 2007 Construction Relocatable Building per Manufacturer's Tag information.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.
08/19/2022	This Material is unchanged as of this date.
02/17/2023	This Material is unchanged as of this date.
08/18/2023	This Material is unchanged as of this date.
02/16/2024	This Material is unchanged as of this date.
08/16/2024	This Material is unchanged as of this date.
03/03/2025	This Material is unchanged as of this date.
09/19/2025	This Material is unchanged as of this date.

08-075AAA

NEW

NO SAMPLE

(NS)

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

METAL STORAGE CONTAINERS (3 EA)

METAL STORAGE CONTAINERS (3 EA)

05/14/2009 BUILDING NOTES:

05/14/2009 Metal Storage Containers (3 EA).

METAL STORAGE CONTAINERS (3 EA)

METAL STORAGE CONTAINERS (3 EA)

STORAGE CONTAINER

480 SF

03/21/2016 Metal Storage Containers. 3 EA, approximately 160 SF EA.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

08/16/2024 This Material is unchanged as of this date.

03/03/2025 This Material is unchanged as of this date.

09/19/2025 This Material is unchanged as of this date.

16-074.NS	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

MIDDLE QUAD PATIO

MIDDLE QUAD PATIO

09/18/2015 BUILDING NOTES:

09/18/2015 Metal and concrete construction building.

MIDDLE QUAD PATIO

MIDDLE QUAD PATIO

PERMANENT BUILDING

1,600 SF

09/18/2015 Middle Quad Patio. Apparent New Metal and Concrete Structure identified by the AHERA Accredited inspector. This Material is in GOOD condition as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

08/16/2024 This Material is unchanged as of this date.

03/03/2025 This Material is unchanged as of this date.

09/19/2025 This Material is unchanged as of this date.

15-174.NS	NEW	NO SAMPLE	(NS)
-----------	-----	-----------	--------

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

PORTABLE NEXT TO P6 (802)

PORTABLE NEXT TO P6 (802)

02/08/2019 BUILDING NOTES:

02/08/2019 Building is not currently in Use.

American Modular System
DSA# 01-112697
Serial# 12-825-001A&B
Date MFG 06-12

PORTABLE NEXT TO P6 (802)

PORTABLE NEXT TO P6 (802)

PORTABLE BUILDING

900 SF

02/08/2019 New 2006 Relocatable Construction Building per Manufacture's Tag info.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

08/16/2024 This Material is unchanged as of this date.

04/21/2025 This Material is unchanged as of this date.

09/19/2025 This Material is unchanged as of this date.

19-011AAA

NEW

NO SAMPLE

(NS)

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	
LOCATION	
MATERIAL TYPE	QTY (APPROXIMATE)
COMMENTS	

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

RIGHT AT SCHOOL PORTABLE (CLASSROOM P6) (803)

RIGHT AT SCHOOL PORTABLE (CLASSROOM P6) (803)

02/08/2019	BUILDING NOTES:
02/08/2019	Building Not currently in use.
	American Modular System DSA# 01-07065 Serial# 05-107-001 A, B, C Date MFG 05-05
02/17/2023	Building is currently used for After School Program.

RIGHT AT SCHOOL PORTABLE (CLASSROOM P6) (803)

CLASSROOM 6(803)

PERMANENT BUILDING

960 SF

02/08/2019	Classroom P6. Building in GOOD condition as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/17/2022	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.
08/19/2022	This Material is unchanged as of this date.
02/17/2023	This Material is unchanged as of this date.
08/18/2023	This Material is unchanged as of this date.
02/16/2024	This Material is unchanged as of this date.
08/16/2024	This Material is unchanged as of this date.
04/21/2025	This Material is unchanged as of this date.
09/19/2025	This Material is unchanged as of this date.

19-011AAA	NEW	NO SAMPLE	(NS)
------------------	------------	------------------	---------------

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME			
LOCATION			
MATERIAL TYPE		QTY (APPROXIMATE)	
COMMENTS			
SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

COMMENTS

QTY (APPROXIMATE)

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

WOOD STORAGE SHEDS (2 EA)

WOOD STORAGE SHEDS (2 EA)

05/14/2009	BUILDING NOTES:		
05/14/2009	Wood Storage Shed (1 EA) used for PE Equipment storage. Located on the west side of Building 400.		
12/01/2011	Building Name changed from WOOD STORAGE SHED (1 EA) to WOOD STORAGE SHEDS (2 EA). Area changed from 40 SF to 80 SF. (Second portable is located next to Building 900).		

WOOD STORAGE SHEDS (2 EA)

WOOD STORAGE SHEDS (2 EA)

STORAGE BUILDING

170 SF

05/14/2009	Apparent New Wood Construction Structures identified by the AHERA Accredited inspector. This Material is in GOOD condition as of this date.		
12/01/2011	Location Description changed from WOOD STORAGE SHED (1 EA) to WOOD STORAGE SHED (1 EA). Quantity changed from 40 SF to 80 SF. No other changes as of this date.		
03/07/2014	This Material is unchanged as of this date.		
08/29/2014	This Material is unchanged as of this date.		
09/18/2015	Quantity Re-Assessed. Quantity changed from 80 SF to 170 SF. No other changes as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		
08/16/2024	This Material is unchanged as of this date.		
04/21/2025	This Material is unchanged as of this date.		
09/19/2025	This Material is unchanged as of this date.		

SURVEY REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
09-098AAA	NEW	NO SAMPLE	(NS)

End Of Report, Total Of 77 Pages

HOMOGENEOUS MATERIALS IN NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	MATERIAL CATEGORY	LOCATION	MATERIAL TYPE
---------------	-------------------	----------	---------------

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

MISCELLANEOUS MATERIAL

BOOK STORAGE ROOM, CUSTODIAL ROOM, AND PANTRY ROOM	BASEBOARD MASTIC
ENTIRE BUILDING	FIRE DOOR CORE INSULATION
ENTIRE BUILDING	SMOOTH WALL
	MISCELLANEOUS
KITCHEN PANTRY CLOSET	VINYL FLOOR TILE
KITCHEN PANTRY CLOSET	VINYL FLOOR TILE MASTIC
MULTI-PURPOSE ROOM	SUSPENDED CEILING TILE
MULTI-PURPOSE ROOM, OFFICES, AND HALLWAYS	VINYL WALL COVER MASTIC
PTA ROOM	VINYL FLOOR TILE
PTA ROOM	VINYL FLOOR TILE MASTIC
STAFF RESTROOMS (2), NURSES' RESTROOM, AND KITCHEN RESTROOM	MORTAR MISCELLANEOUS
STAFF RESTROOMS (2), NURSES' RESTROOM, AND KITCHEN RESTROOM	MORTAR MISCELLANEOUS
TEACHER'S LOUNGE AND NURSE'S ROOM	SINK UNDERCOATING
WOMENS RESTROOM	MORTAR MISCELLANEOUS

SURFACING MATERIAL

ENTIRE BUILDING	SMOOTH WALL SURFACING
EXTERIOR WALLS, AND ALL PERIMETER WALLS IN BACK OF BUILDING (UTILITY YARD FOR TRASH CAN ROOM WASHING AREA)	ROUGH WALL
EXTERIOR WALLS, AND ALL PERIMETER WALLS IN BACK OF BUILDING (UTILITY YARD FOR TRASH CAN ROOM WASHING AREA)	ROUGH WALL SURFACING

THERMAL SYSTEM INSULATION

ATTIC / PLENUM	PIPE FITTING INSULATION
----------------	-------------------------

BUS LOOP

SURFACING MATERIAL

EXTERIOR WALL	ROUGH WALL
EXTERIOR WALL	ROUGH WALL SURFACING

THERMAL SYSTEM INSULATION

EXTERIOR WALL	PAPER TYPE INSULATION
---------------	-----------------------

CLASSROOMS 201-202 BUILDING (BUILDING 200)

MISCELLANEOUS MATERIAL

CLASSROOMS 201 AND 202	VINYL WALL COVER MASTIC
CLASSROOMS 201 AND 202, RESTROOMS, STORAGE ROOMS AND UTILITY ROOMS	SMOOTH WALL
	MISCELLANEOUS
CUSTODIAN ROOM AND BOILER ROOM	BASEBOARD MASTIC
ENTIRE BUILDING	FIRE DOOR CORE INSULATION
EXTERIOR WINDOWS	WINDOW CAULKING
RESTROOMS	MORTAR MISCELLANEOUS

HOMOGENEOUS MATERIALS IN NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

MATERIAL CATEGORY

LOCATION

MATERIAL TYPE

SURFACING MATERIAL

CLASSROOMS 201 AND 202, RESTROOMS, STORAGE ROOMS AND UTILITY ROOMS

SMOOTH WALL SURFACING

EXTERIOR WALLS

ROUGH WALL

EXTERIOR WALLS

ROUGH WALL SURFACING

CLASSROOMS 301-306 BUILDING (BUILDING 300)

MISCELLANEOUS MATERIAL

ALL CLASSROOMS AND F.I.S. ROOM

VINYL WALL COVER MASTIC

BOYS' AND GIRLS' RESTROOMS AND STORAGE ROOM

MORTAR MISCELLANEOUS

CLASSROOMS 301-308, AND RESTROOMS (2)

MORTAR MISCELLANEOUS

ENTIRE BUILDING

CEMENTITIOUS WINDOW PANEL

ENTIRE BUILDING

FIRE DOOR CORE INSULATION

ENTIRE BUILDING INCLUDING RESTROOMS, UTILITY ROOMS AND STORAGE ROOMS

SMOOTH WALL

MISCELLANEOUS

EXTERIOR WINDOWS AND DOORS

WINDOW CAULKING

TEACHERS' WORK ROOM, AND CLASSROOMS 301-308

SINK UNDERCOATING

WATER HEATER ROOM (NEXT TO RESTROOMS) AND JANITOR CLOSET

BASEBOARD MASTIC

SURFACING MATERIAL

ENTIRE BUILDING INCLUDING RESTROOMS, UTILITY ROOMS AND STORAGE ROOMS

SMOOTH WALL SURFACING

EXTERIOR WALLS AND OVERHANG ON RESTROOMS

ROUGH WALL

EXTERIOR WALLS AND OVERHANG ON RESTROOMS

ROUGH WALL SURFACING

CLASSROOMS 400-406 BUILDING (BUILDING 400)

MISCELLANEOUS MATERIAL

CLASSROOMS, AND LIBRARY

VINYL WALL COVER MASTIC

ENTIRE BUILDING

CEMENTITIOUS WINDOW PANEL

ENTIRE BUILDING

FIRE DOOR CORE INSULATION

ENTIRE BUILDING

SMOOTH WALL

MISCELLANEOUS

EXTERIOR WINDOWS

WINDOW CAULKING

LIBRARY (400), CLASSROOMS 401-406, AND RESTROOMS

MORTAR MISCELLANEOUS

LIBRARY STORAGE

BASEBOARD MASTIC

LIBRARY STORAGE

VINYL FLOOR TILE

LIBRARY STORAGE

VINYL FLOOR TILE MASTIC

TEACHERS' WORK ROOM, AND LIBRARY

SINK UNDERCOATING

WATER HEATER ROOM AND UTILITY CLOSET

BASEBOARD MASTIC

SURFACING MATERIAL

ENTIRE BUILDING

SMOOTH WALL SURFACING

EXTERIOR WALLS, AND OVERHANG OF RESTROOMS

ROUGH WALL

EXTERIOR WALLS, AND OVERHANG OF RESTROOMS

ROUGH WALL SURFACING

CLASSROOMS 501-506 BUILDING (BUILDING 500)

HOMOGENEOUS MATERIALS IN NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

MATERIAL CATEGORY

LOCATION

MATERIAL TYPE

MISCELLANEOUS MATERIAL

CLASSROOMS 501-504 (AND RESTROOMS), AND CLASSROOMS 505 & 506 (AND RESTROOMS)

MORTAR MISCELLANEOUS

CLASSROOMS 501-506

SINK UNDERCOATING

CLASSROOMS 501-506 AND COMPUTER LAB

VINYL WALL COVER MASTIC

ENTIRE BUILDING

CEMENTITIOUS WINDOW PANEL

ENTIRE BUILDING

FIRE DOOR CORE INSULATION

ENTIRE BUILDING (INCLUDING RESTROOMS, STORAGE ROOMS AND UTILITY ROOMS)

SMOOTH WALL
MISCELLANEOUS

EXTERIOR WINDOWS

WINDOW CAULKING

WATER HEATER CLOSET AND STORAGE

BASEBOARD MASTIC

SURFACING MATERIAL

ENTIRE BUILDING INCLUDING RESTROOMS, STORAGE ROOMS AND UTILITY ROOMS

SMOOTH WALL SURFACING

EXTERIOR WALLS, AND OVERHANG OF RESTROOMS

ROUGH WALL SURFACING

EXTERIOR WALLS, AND OVERHANGS OF RESTROOMS

ROUGH WALL

CLASSROOMS 801 PORTABLE BUILDING

MISCELLANEOUS MATERIAL

CLASSROOM 801

PORTABLE BUILDING

DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

MISCELLANEOUS MATERIAL

CLASSROOMS

BASEBOARD MASTIC

CLASSROOMS

SMOOTH WALL
MISCELLANEOUS

CLASSROOMS

SUSPENDED CEILING TILE

CLASSROOMS

VINYL FLOOR TILE

CLASSROOMS

VINYL FLOOR TILE MASTIC

CLASSROOMS

VINYL WALL COVER MASTIC

CLASSROOMS, OFFICE AND STORAGE ROOM

CARPET MASTIC

DAYCARE PORTABLE (600)

SINK UNDERCOATING

ENTIRE BUILDING

FIRE DOOR CORE INSULATION

RESTROOMS (1 EA BOYS' AND GIRLS'), STAFF ROOM, AND CUSTODIAN ROOM

VINYL SHEETING

RESTROOMS (1 EA BOYS' AND GIRLS'), STAFF ROOM, AND CUSTODIAN ROOM

VINYL SHEETING BACKING
PAPER/MASTIC

DAYCARE PORTABLE BUILDING - FED CHILDCARE (BUILDING 900)

MISCELLANEOUS MATERIAL

DAYCARE PORTABLE BUILDING - FED CHILDCARE (BUILDING 900)

PORTABLE BUILDING

DAYCARE PORTABLE BUILDING - SDC (BUILDING 800)

**HOMOGENEOUS MATERIALS IN
NORTHWOOD ELEMENTARY SCHOOL**

BUILDING NAME**MATERIAL CATEGORY****LOCATION****MATERIAL TYPE**

MISCELLANEOUS MATERIAL

PORTABLE DAYCARE - SDC

PORTABLE BUILDING

FAMILY RESOURCE CENTER (BUILDING 700)

MISCELLANEOUS MATERIAL

DAYCARE PORTABLE BUILDING - STATE

PORTABLE BUILDING

METAL STORAGE CONTAINERS (3 EA)

MISCELLANEOUS MATERIAL

METAL STORAGE CONTAINERS (3 EA)

STORAGE CONTAINER

MIDDLE QUAD PATIO

MISCELLANEOUS MATERIAL

MIDDLE QUAD PATIO

PERMANENT BUILDING

PORTABLE NEXT TO P6 (802)

MISCELLANEOUS MATERIAL

PORTABLE NEXT TO P6 (802)

PORTABLE BUILDING

RIGHT AT SCHOOL PORTABLE (CLASSROOM P6) (803)

MISCELLANEOUS MATERIAL

CLASSROOM 6(803)

PERMANENT BUILDING

WOOD STORAGE SHEDS (2 EA)

MISCELLANEOUS MATERIAL

WOOD STORAGE SHEDS (2 EA)

STORAGE BUILDING

End Of Report, Total Of 4 Pages

FRIABLE LOCATIONS IN NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	QTY (APPROXIMATE)	ASBESTOS CONTENT
MATERIAL TYPE			
ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)			
ATTIC / PLENUM	PIPE FITTING INSULATION	(TBD) LF	Assumed
BOOK STORAGE ROOM, CUSTODIAL ROOM, AND PANTRY ROOM	BASEBOARD MASTIC	116 LF	New Material
ENTIRE BUILDING	FIRE DOOR CORE INSULATION	546 SF	Assumed
ENTIRE BUILDING	SMOOTH WALL MISCELLANEOUS	24,500 SF	Greater Than 1%
ENTIRE BUILDING	SMOOTH WALL SURFACING	24,500 SF	Greater Than 1%
KITCHEN PANTRY CLOSET	VINYL FLOOR TILE	60 SF	Assumed
KITCHEN PANTRY CLOSET	VINYL FLOOR TILE MASTIC	60 SF	Assumed
MULTI-PURPOSE ROOM	SUSPENDED CEILING TILE	2,530 SF	Assumed
MULTI-PURPOSE ROOM, OFFICES, AND HALLWAYS	VINYL WALL COVER MASTIC	18,680 SF	Assumed
PTA ROOM	VINYL FLOOR TILE	144 SF	Assumed
PTA ROOM	VINYL FLOOR TILE MASTIC	144 SF	Assumed
BUS LOOP			
EXTERIOR WALL	PAPER TYPE INSULATION	800 SF	Assumed
CLASSROOMS 201-202 BUILDING (BUILDING 200)			
CLASSROOMS 201 AND 202, RESTROOMS, STORAGE ROOMS AND UTILITY ROOMS	SMOOTH WALL MISCELLANEOUS	2,600 SF	Greater Than 1%
CLASSROOMS 201 AND 202, RESTROOMS, STORAGE ROOMS AND UTILITY ROOMS	SMOOTH WALL SURFACING	2,600 SF	Greater Than 1%
ENTIRE BUILDING	FIRE DOOR CORE INSULATION	210 SF	Assumed
EXTERIOR WINDOWS	WINDOW CAULKING	200 LF	Assumed

FRIABLE LOCATIONS IN NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	QTY (APPROXIMATE)	ASBESTOS CONTENT
MATERIAL TYPE			
CLASSROOMS 301-306 BUILDING (BUILDING 300)			
	ENTIRE BUILDING		
	FIRE DOOR CORE INSULATION	672 SF	Assumed
	ENTIRE BUILDING INCLUDING RESTROOMS, UTILITY ROOMS AND STORAGE ROOMS		
	SMOOTH WALL MISCELLANEOUS	37,800 SF	Assumed
	ENTIRE BUILDING INCLUDING RESTROOMS, UTILITY ROOMS AND STORAGE ROOMS		
	SMOOTH WALL SURFACING	37,800 SF	Assumed
	EXTERIOR WINDOWS AND DOORS		
	WINDOW CAULKING	900 LF	Assumed
	WATER HEATER ROOM (NEXT TO RESTROOMS) AND JANITOR CLOSET		
	BASEBOARD MASTIC	15 LF	Assumed
CLASSROOMS 400-406 BUILDING (BUILDING 400)			
	CLASSROOMS, AND LIBRARY		
	VINYL WALL COVER MASTIC	29,880 SF	Assumed
	ENTIRE BUILDING		
	FIRE DOOR CORE INSULATION	399 SF	Assumed
	ENTIRE BUILDING		
	SMOOTH WALL MISCELLANEOUS	38,100 SF	Assumed
	ENTIRE BUILDING		
	SMOOTH WALL SURFACING	38,100 SF	Assumed
	EXTERIOR WALLS, AND OVERHANG OF RESTROOMS		
	ROUGH WALL	7,200 SF	Assumed
	EXTERIOR WALLS, AND OVERHANG OF RESTROOMS		
	ROUGH WALL SURFACING	7,200 SF	Assumed
	EXTERIOR WINDOWS		
	WINDOW CAULKING	900 LF	Assumed
	LIBRARY STORAGE		
	BASEBOARD MASTIC	50 LF	Assumed
	LIBRARY STORAGE		
	VINYL FLOOR TILE	144 SF	Assumed
	LIBRARY STORAGE		
	VINYL FLOOR TILE MASTIC	144 SF	Assumed

FRIABLE LOCATIONS IN NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	QTY (APPROXIMATE)	ASBESTOS CONTENT
MATERIAL TYPE			
CLASSROOMS 501-506 BUILDING (BUILDING 500)			
CLASSROOMS 501-506 AND COMPUTER LAB	VINYL WALL COVER MASTIC	30,000 SF	Assumed
ENTIRE BUILDING	CEMENTITIOUS WINDOW PANEL	50 SF	Assumed
ENTIRE BUILDING	FIRE DOOR CORE INSULATION	651 SF	Assumed
ENTIRE BUILDING (INCLUDING RESTROOMS, STORAGE ROOMS AND UTILITY ROOMS)	SMOOTH WALL MISCELLANEOUS	38,500 SF	Assumed
ENTIRE BUILDING INCLUDING RESTROOMS, STORAGE ROOMS AND UTILITY ROOMS	SMOOTH WALL SURFACING	38,500 SF	Assumed
EXTERIOR WINDOWS	WINDOW CAULKING	900 LF	Assumed
DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)			
CLASSROOMS	SMOOTH WALL MISCELLANEOUS	2,120 SF	Assumed
CLASSROOMS	SUSPENDED CEILING TILE	2,040 SF	Assumed
CLASSROOMS	VINYL FLOOR TILE	960 SF	Assumed
CLASSROOMS	VINYL FLOOR TILE MASTIC	960 SF	Assumed
CLASSROOMS, OFFICE AND STORAGE ROOM	CARPET MASTIC	150 SF	Assumed
ENTIRE BUILDING	FIRE DOOR CORE INSULATION	63 SF	Assumed
RESTROOMS (1 EA BOYS' AND GIRLS'), STAFF ROOM, AND CUSTODIAN ROOM	VINYL SHEETING	140 SF	Assumed
RESTROOMS (1 EA BOYS' AND GIRLS'), STAFF ROOM, AND CUSTODIAN ROOM	VINYL SHEETING BACKING PAPER/MASTIC	140 SF	Assumed
End Of Report, Total Of 3 Pages			

Non- Friable Locations In NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	QTY (APPROXIMATE)	ASBESTOS CONTENT
MATERIAL TYPE			
ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)			
EXTERIOR WALLS, AND ALL PERIMETER WALLS IN BACK OF BUILDING (UTILITY YARD FOR TRASH CAN ROOM WASHING AREA)			
	ROUGH WALL	17,180 SF	Assumed
EXTERIOR WALLS, AND ALL PERIMETER WALLS IN BACK OF BUILDING (UTILITY YARD FOR TRASH CAN ROOM WASHING AREA)			
	ROUGH WALL SURFACING	17,180 SF	Assumed
STAFF RESTROOMS (2), NURSES' RESTROOM, AND KITCHEN RESTROOM			
	MORTAR MISCELLANEOUS	640 SF	Assumed
STAFF RESTROOMS (2), NURSES' RESTROOM, AND KITCHEN RESTROOM			
	MORTAR MISCELLANEOUS	270 SF	Assumed
TEACHER'S LOUNGE AND NURSE'S ROOM			
	SINK UNDERCOATING	8 SF	Assumed
WOMENS RESTROOM			
	MORTAR MISCELLANEOUS	120 SF	Assumed
BUS LOOP			
EXTERIOR WALL			
	ROUGH WALL	800 SF	Assumed
EXTERIOR WALL			
	ROUGH WALL SURFACING	800 SF	Assumed
CLASSROOMS 201-202 BUILDING (BUILDING 200)			
CLASSROOMS 201 AND 202			
	VINYL WALL COVER MASTIC	1,600 SF	Assumed
CUSTODIAN ROOM AND BOILER ROOM			
	BASEBOARD MASTIC	80 LF	Assumed
EXTERIOR WALLS			
	ROUGH WALL	3,200 SF	Assumed
EXTERIOR WALLS			
	ROUGH WALL SURFACING	3,200 SF	Assumed
RESTROOMS			
	MORTAR MISCELLANEOUS	200 SF	Assumed
CLASSROOMS 301-306 BUILDING (BUILDING 300)			
ALL CLASSROOMS AND F.I.S. ROOM			
	VINYL WALL COVER MASTIC	29,000 SF	Assumed
BOYS' AND GIRLS' RESTROOMS AND STORAGE ROOM			
	MORTAR MISCELLANEOUS	350 SF	Assumed
CLASSROOMS 301-308, AND RESTROOMS (2)			
	MORTAR MISCELLANEOUS	700 SF	Assumed
ENTIRE BUILDING			
	CEMENTITIOUS WINDOW PANEL	70 SF	Assumed
EXTERIOR WALLS AND OVERHANG ON RESTROOMS			
	ROUGH WALL	7,200 SF	Assumed

Non- Friable Locations In NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	QTY (APPROXIMATE)	ASBESTOS CONTENT
	MATERIAL TYPE		
	EXTERIOR WALLS AND OVERHANG ON RESTROOMS		
	ROUGH WALL SURFACING	7,200 SF	Assumed
	TEACHERS' WORK ROOM, AND CLASSROOMS 301-308		
	SINK UNDERCOATING	28 SF	Assumed
CLASSROOMS 400-406 BUILDING (BUILDING 400)			
	ENTIRE BUILDING		
	CEMENTITIOUS WINDOW PANEL	50 SF	Assumed
	LIBRARY (400), CLASSROOMS 401-406, AND RESTROOMS		
	MORTAR MISCELLANEOUS	700 SF	Assumed
	TEACHERS' WORK ROOM, AND LIBRARY		
	SINK UNDERCOATING	24 SF	Assumed
	WATER HEATER ROOM AND UTILITY CLOSET		
	BASEBOARD MASTIC	40 LF	Assumed
CLASSROOMS 501-506 BUILDING (BUILDING 500)			
	CLASSROOMS 501-504 (AND RESTROOMS), AND CLASSROOMS 505 & 506 (AND RESTROOMS)		
	MORTAR MISCELLANEOUS	800 SF	Assumed
	CLASSROOMS 501-506		
	SINK UNDERCOATING	20 SF	Assumed
	EXTERIOR WALLS, AND OVERHANG OF RESTROOMS		
	ROUGH WALL SURFACING	7,200 SF	Assumed
	EXTERIOR WALLS, AND OVERHANGS OF RESTROOMS		
	ROUGH WALL	7,200 SF	Assumed
	WATER HEATER CLOSET AND STORAGE		
	BASEBOARD MASTIC	50 LF	Assumed
DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)			
	CLASSROOMS		
	BASEBOARD MASTIC	350 LF	Assumed
	CLASSROOMS		
	VINYL WALL COVER MASTIC	2,100 SF	Assumed
	DAYCARE PORTABLE (600)		
	SINK UNDERCOATING	10 SF	Assumed
METAL STORAGE CONTAINERS (3 EA)			
PORTABLE NEXT TO P6 (802)			
	PORTABLE NEXT TO P6 (802)		
	PORTABLE BUILDING	900 SF	New Material

Non- Friable Locations In
NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME			
LOCATION			
MATERIAL TYPE		QTY (APPROXIMATE)	ASBESTOS CONTENT
RIGHT AT SCHOOL PORTABLE (CLASSROOM P6) (803)			
CLASSROOM 6(803)			
PERMANENT BUILDING		960 SF	New Material
End Of Report, Total Of 3 Pages			

RECOMMENDATIONS FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

ATTIC / PLENUM

PIPE FITTING INSULATION

(TBD) LF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

BOOK STORAGE ROOM, CUSTODIAL ROOM, AND PANTRY ROOM

BASEBOARD MASTIC

116 LF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

ENTIRE BUILDING

FIRE DOOR CORE INSULATION

546 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

ENTIRE BUILDING

SMOOTH WALL MISCELLANEOUS

24,500 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR
NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

ENTIRE BUILDING

SMOOTH WALL SURFACING

24,500 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

EXTERIOR WALLS, AND ALL PERIMETER WALLS IN BACK OF BUILDING (UTILITY YARD FOR TRASH CAN ROOM WASHING AREA)

ROUGH WALL

17,180 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

EXTERIOR WALLS, AND ALL PERIMETER WALLS IN BACK OF BUILDING (UTILITY YARD FOR TRASH CAN ROOM WASHING AREA)

ROUGH WALL SURFACING

17,180 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

KITCHEN PANTRY CLOSET

VINYL FLOOR TILE

60 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR
NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME**LOCATION****MATERIAL TYPE****RECOMMENDATION****QTY****(APPROXIMATE)**

KITCHEN PANTRY CLOSET**VINYL FLOOR TILE MASTIC****60 SF**

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

MULTI-PURPOSE ROOM**SUSPENDED CEILING TILE****2,530 SF**

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

MULTI-PURPOSE ROOM, OFFICES, AND HALLWAYS**VINYL WALL COVER MASTIC****18,680 SF**

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

PTA ROOM**VINYL FLOOR TILE****144 SF**

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.
-

RECOMMENDATIONS FOR
NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

PTA ROOM

VINYL FLOOR TILE MASTIC

144 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

STAFF RESTROOMS (2), NURSES' RESTROOM, AND KITCHEN RESTROOM

MORTAR MISCELLANEOUS

640 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

STAFF RESTROOMS (2), NURSES' RESTROOM, AND KITCHEN RESTROOM

MORTAR MISCELLANEOUS

270 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

TEACHER'S LOUNGE AND NURSE'S ROOM

SINK UNDERCOATING

8 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR
NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME**LOCATION****MATERIAL TYPE****RECOMMENDATION****QTY****(APPROXIMATE)**

WOMENS RESTROOM

MORTAR MISCELLANEOUS

120 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

BUS LOOP

EXTERIOR WALL

PAPER TYPE INSULATION

800 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

EXTERIOR WALL

ROUGH WALL

800 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

EXTERIOR WALL

ROUGH WALL SURFACING

800 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR
NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

CLASSROOMS 201-202 BUILDING (BUILDING 200)

CLASSROOMS 201 AND 202

VINYL WALL COVER MASTIC 1,600 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOMS 201 AND 202, RESTROOMS, STORAGE ROOMS AND UTILITY ROOMS

SMOOTH WALL MISCELLANEOUS 2,600 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOMS 201 AND 202, RESTROOMS, STORAGE ROOMS AND UTILITY ROOMS

SMOOTH WALL SURFACING 2,600 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CUSTODIAN ROOM AND BOILER ROOM

BASEBOARD MASTIC 80 LF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR
NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

ENTIRE BUILDING

FIRE DOOR CORE INSULATION

210 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

EXTERIOR WALLS

ROUGH WALL

3,200 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

EXTERIOR WALLS

ROUGH WALL SURFACING

3,200 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

EXTERIOR WINDOWS

WINDOW CAULKING

200 LF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR
NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

RESTROOMS

MORTAR MISCELLANEOUS

200 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOMS 301-306 BUILDING (BUILDING 300)

ALL CLASSROOMS AND F.I.S. ROOM

VINYL WALL COVER MASTIC

29,000 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

BOYS' AND GIRLS' RESTROOMS AND STORAGE ROOM

MORTAR MISCELLANEOUS

350 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOMS 301-308, AND RESTROOMS (2)

MORTAR MISCELLANEOUS

700 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

ENTIRE BUILDING

CEMENTITIOUS WINDOW PANEL

70 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

ENTIRE BUILDING

FIRE DOOR CORE INSULATION

672 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

ENTIRE BUILDING INCLUDING RESTROOMS, UTILITY ROOMS AND STORAGE ROOMS

SMOOTH WALL MISCELLANEOUS

37,800 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

ENTIRE BUILDING INCLUDING RESTROOMS, UTILITY ROOMS AND STORAGE ROOMS

SMOOTH WALL SURFACING

37,800 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

EXTERIOR WALLS AND OVERHANG ON RESTROOMS

ROUGH WALL

7,200 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

EXTERIOR WALLS AND OVERHANG ON RESTROOMS

ROUGH WALL SURFACING

7,200 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

EXTERIOR WINDOWS AND DOORS

WINDOW CAULKING

900 LF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

TEACHERS' WORK ROOM, AND CLASSROOMS 301-308

SINK UNDERCOATING

28 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR
NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME**LOCATION****MATERIAL TYPE****RECOMMENDATION****QTY****(APPROXIMATE)**

WATER HEATER ROOM (NEXT TO RESTROOMS) AND JANITOR CLOSET

BASEBOARD MASTIC

15 LF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOMS 400-406 BUILDING (BUILDING 400)

CLASSROOMS, AND LIBRARY

VINYL WALL COVER MASTIC

29,880 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

ENTIRE BUILDING

CEMENTITIOUS WINDOW PANEL

50 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

ENTIRE BUILDING

FIRE DOOR CORE INSULATION

399 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

ENTIRE BUILDING

SMOOTH WALL MISCELLANEOUS 38,100 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

ENTIRE BUILDING

SMOOTH WALL SURFACING 38,100 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

EXTERIOR WALLS, AND OVERHANG OF RESTROOMS

ROUGH WALL 7,200 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

EXTERIOR WALLS, AND OVERHANG OF RESTROOMS

ROUGH WALL SURFACING 7,200 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR
NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

EXTERIOR WINDOWS

WINDOW CAULKING

900 LF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

LIBRARY (400), CLASSROOMS 401-406, AND RESTROOMS

MORTAR MISCELLANEOUS

700 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

LIBRARY STORAGE

BASEBOARD MASTIC

50 LF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

LIBRARY STORAGE

VINYL FLOOR TILE

144 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR
NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

LIBRARY STORAGE

VINYL FLOOR TILE MASTIC

144 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

TEACHERS' WORK ROOM, AND LIBRARY

SINK UNDERCOATING

24 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

WATER HEATER ROOM AND UTILITY CLOSET

BASEBOARD MASTIC

40 LF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

CLASSROOMS 501-506 BUILDING (BUILDING 500)

CLASSROOMS 501-504 (AND RESTROOMS), AND CLASSROOMS 505 & 506 (AND RESTROOMS)

MORTAR MISCELLANEOUS

800 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOMS 501-506

SINK UNDERCOATING

20 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOMS 501-506 AND COMPUTER LAB

VINYL WALL COVER MASTIC

30,000 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

ENTIRE BUILDING

CEMENTITIOUS WINDOW PANEL

50 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

ENTIRE BUILDING

FIRE DOOR CORE INSULATION

651 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

ENTIRE BUILDING (INCLUDING RESTROOMS, STORAGE ROOMS AND UTILITY ROOMS)

SMOOTH WALL MISCELLANEOUS

38,500 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

ENTIRE BUILDING INCLUDING RESTROOMS, STORAGE ROOMS AND UTILITY ROOMS

SMOOTH WALL SURFACING

38,500 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

EXTERIOR WALLS, AND OVERHANG OF RESTROOMS

ROUGH WALL SURFACING

7,200 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR
NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

EXTERIOR WALLS, AND OVERHANGS OF RESTROOMS

ROUGH WALL

7,200 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

EXTERIOR WINDOWS

WINDOW CAULKING

900 LF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

WATER HEATER CLOSET AND STORAGE

BASEBOARD MASTIC

50 LF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR
NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

CLASSROOMS 801 PORTABLE BUILDING

CLASSROOM 801

PORTABLE BUILDING

960 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

CLASSROOMS

BASEBOARD MASTIC

350 LF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOMS

SMOOTH WALL MISCELLANEOUS

2,120 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

CLASSROOMS

SUSPENDED CEILING TILE 2,040 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOMS

VINYL FLOOR TILE 960 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOMS

VINYL FLOOR TILE MASTIC 960 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOMS

VINYL WALL COVER MASTIC 2,100 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR
NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME**LOCATION****MATERIAL TYPE****RECOMMENDATION****QTY****(APPROXIMATE)**

CLASSROOMS, OFFICE AND STORAGE ROOM**CARPET MASTIC****150 SF**

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

DAYCARE PORTABLE (600)**SINK UNDERCOATING****10 SF**

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

ENTIRE BUILDING**FIRE DOOR CORE INSULATION****63 SF**

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RESTROOMS (1 EA BOYS' AND GIRLS'), STAFF ROOM, AND CUSTODIAN ROOM**VINYL SHEETING****140 SF**

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

RESTROOMS (1 EA BOYS' AND GIRLS'), STAFF ROOM, AND CUSTODIAN ROOM

VINYL SHEETING BACKING PAPER/MASTIC

140 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

DAYCARE PORTABLE BUILDING - FED CHILDCARE (BUILDING 900)

DAYCARE PORTABLE BUILDING - FED CHILDCARE (BUILDING 900)

PORTABLE BUILDING

960 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

DAYCARE PORTABLE BUILDING - SDC (BUILDING 800)

PORTABLE DAYCARE - SDC

PORTABLE BUILDING

960 SF

- (a) This is a replacement/new material.
- (b) The district should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the district's AHERA records.

RECOMMENDATIONS FOR
NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

FAMILY RESOURCE CENTER (BUILDING 700)

DAYCARE PORTABLE BUILDING - STATE

PORTABLE BUILDING

1,440 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

METAL STORAGE CONTAINERS (3 EA)

METAL STORAGE CONTAINERS (3 EA)

STORAGE CONTAINER

480 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR
NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

MIDDLE QUAD PATIO

MIDDLE QUAD PATIO

PERMANENT BUILDING

1,600 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

PORTABLE NEXT TO P6 (802)

PORTABLE NEXT TO P6 (802)

PORTABLE BUILDING

900 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

RIGHT AT SCHOOL PORTABLE (CLASSROOM P6) (803)

CLASSROOM 6(803)

PERMANENT BUILDING

960 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

RECOMMENDATIONS FOR
NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

WOOD STORAGE SHEDS (2 EA)

WOOD STORAGE SHEDS (2 EA)

STORAGE BUILDING

170 SF

- (a) This is a replacement/new material.
 - (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
 - (c) This documentation is to be maintained with the District's AHERA records.
-

End Of Report, Total Of 24 Pages

SAMPLES REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

ATTIC / PLENUM

PIPE FITTING INSULATION

05-212AAA	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
------------------	-----------	----------	---------	-----------	----

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

BOOK STORAGE ROOM, CUSTODIAL ROOM, AND PANTRY ROOM

BASEBOARD MASTIC

05-212AAA	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
------------------	-----------	----------	---------	-----------	----

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

ENTIRE BUILDING

FIRE DOOR CORE INSULATION

14-198AAA	8/29/2014	Positive	ASSUMED	NO SAMPLE	NS
------------------	-----------	----------	---------	-----------	----

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

ENTIRE BUILDING

SMOOTH WALL MISCELLANEOUS

10-018 NW-69	2/1/2010	Negative	ND	NONE DETECTED	ND
---------------------	----------	----------	----	---------------	----

Joint Tape

10-018 NW-69	2/1/2010	Positive	2	CHRYSTILE	CH
---------------------	----------	----------	---	-----------	----

Joint Compound

10-018 NW-70	2/1/2010	Negative	ND	NONE DETECTED	ND
---------------------	----------	----------	----	---------------	----

Drywall

10-018 NW-73	2/1/2010	Negative	ND	NONE DETECTED	ND
---------------------	----------	----------	----	---------------	----

Joint Tape

10-018 NW-73	2/1/2010	Positive	2	CHRYSTILE	CH
---------------------	----------	----------	---	-----------	----

Joint Compound

10-018 NW-74	2/1/2010	Negative	ND	NONE DETECTED	ND
---------------------	----------	----------	----	---------------	----

Drywall

10-000 A07

Storage 121, Drywall Board.

SAMPLES REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

<u>16-030-A08</u> Storage 121, Joint Mud.	1/28/2016	Positive	5%	CHRYSTILE	CH
---	-----------	----------	----	-----------	----

<u>16-030-A13</u> MP Room by 122 Door, Drywall.	1/28/2016	Negative	ND	NONE DETECTED	ND
---	-----------	----------	----	---------------	----

<u>16-030-A13</u> MP Room by 122 Door, Joint Compound.	1/28/2016	Negative	ND	NONE DETECTED	ND
--	-----------	----------	----	---------------	----

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

ENTIRE BUILDING
SMOOTH WALL SURFACING

<u>10-018 NW-68</u>	2/1/2010	Positive	2	CHRYSTILE	CH
----------------------------	----------	----------	---	-----------	----

<u>10-018 NW-72</u>	2/1/2010	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

<u>16-030-A09</u> Storage 121, Skim Coat -Paint.	1/28/2016	Negative	ND	NONE DETECTED	ND
--	-----------	----------	----	---------------	----

<u>16-030-A12</u> MP Room by 122 Door, Skim Coat and Mud on Drywall.	1/28/2016	Negative	ND	NONE DETECTED	ND
--	-----------	----------	----	---------------	----

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

EXTERIOR WALLS, AND ALL PERIMETER WALLS IN BACK OF BUILDING (UTILITY YARD FOR TRASH CAN ROOM WASHING AREA)
ROUGH WALL

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

<u>16-030-A10</u> Storage 121, Exterior Stucco.	1/28/2016	Positive	2%	CHRYSTILE	CH
---	-----------	----------	----	-----------	----

<u>16-030-A14</u> MP Room Exterior by Door 122, Stucco.	1/28/2016	Negative	ND	NONE DETECTED	ND
---	-----------	----------	----	---------------	----

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

EXTERIOR WALLS, AND ALL PERIMETER WALLS IN BACK OF BUILDING (UTILITY YARD FOR TRASH CAN ROOM WASHING AREA)
ROUGH WALL SURFACING

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

SAMPLES REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

KITCHEN PANTRY CLOSET
VINYL FLOOR TILE

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

KITCHEN PANTRY CLOSET
VINYL FLOOR TILE MASTIC

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

MULTI-PURPOSE ROOM
SUSPENDED CEILING TILE

<u>08-241AAA</u>	10/20/2008	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	------------	----------	---------	-----------	----

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

MULTI-PURPOSE ROOM, OFFICES, AND HALLWAYS
VINYL WALL COVER MASTIC

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

PTA ROOM
VINYL FLOOR TILE

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

PTA ROOM
VINYL FLOOR TILE MASTIC

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

STAFF RESTROOMS (2), NURSES' RESTROOM, AND KITCHEN RESTROOM
MORTAR MISCELLANEOUS

-----	12/1/2011	Positive	ASSUMED	NO SAMPLE	NS
-------	-----------	----------	---------	-----------	----

SAMPLES REPORT FOR
NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE No. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

STAFF RESTROOMS (2), NURSES' RESTROOM, AND KITCHEN RESTROOM

MORTAR MISCELLANEOUS

<u>11-202AAA</u>	12/1/2011	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

TEACHER'S LOUNGE AND NURSE'S ROOM

SINK UNDERCOATING

<u>08-241AAA</u>	10/20/2008	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	------------	----------	---------	-----------	----

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

WOMENS RESTROOM

MORTAR MISCELLANEOUS

<u>15-174AAA</u>	9/18/2015	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

SAMPLES REPORT FOR
NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE No. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

BUS LOOP

BUS LOOP

EXTERIOR WALL

PAPER TYPE INSULATION

<u>09-212AAA</u>	9/8/2009	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

BUS LOOP

EXTERIOR WALL

ROUGH WALL

<u>09-212AAA</u>	9/8/2009	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

BUS LOOP

EXTERIOR WALL

ROUGH WALL SURFACING

<u>09-212AAA</u>	9/8/2009	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

SAMPLES REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

CLASSROOMS 201-202 BUILDING (BUILDING 200)

CLASSROOMS 201-202 BUILDING (BUILDING 200)

CLASSROOMS 201 AND 202

VINYL WALL COVER MASTIC

06-223AAA	8/25/2006	Positive	ASSUMED	NO SAMPLE	NS
------------------	-----------	----------	---------	-----------	----

CLASSROOMS 201-202 BUILDING (BUILDING 200)

CLASSROOMS 201 AND 202, RESTROOMS, STORAGE ROOMS AND UTILITY ROOMS

SMOOTH WALL MISCELLANEOUS

10-018 NW-63	2/1/2010	Negative	ND	NONE DETECTED	ND
---------------------	----------	----------	----	---------------	----

Joint Tape

10-018 NW-63	2/1/2010	Negative	ND	NONE DETECTED	ND
---------------------	----------	----------	----	---------------	----

Joint Compound

10-018 NW-64	2/1/2010	Negative	ND	NONE DETECTED	ND
---------------------	----------	----------	----	---------------	----

Drywall

10-018 NW-66	2/1/2010	Negative	ND	NONE DETECTED	ND
---------------------	----------	----------	----	---------------	----

Joint Tape

10-018 NW-66	2/1/2010	Positive	2	CHRYSTILE	CH
---------------------	----------	----------	---	-----------	----

Joint Compound

10-018 NW-67	2/1/2010	Negative	ND	NONE DETECTED	ND
---------------------	----------	----------	----	---------------	----

Drywall

CLASSROOMS 201-202 BUILDING (BUILDING 200)

CLASSROOMS 201 AND 202, RESTROOMS, STORAGE ROOMS AND UTILITY ROOMS

SMOOTH WALL SURFACING

10-018 NW-65	2/1/2010	Positive	2	CHRYSTILE	CH
---------------------	----------	----------	---	-----------	----

CLASSROOMS 201-202 BUILDING (BUILDING 200)

CUSTODIAN ROOM AND BOILER ROOM

BASEBOARD MASTIC

08-241AAA	10/20/2008	Positive	ASSUMED	NO SAMPLE	NS
------------------	------------	----------	---------	-----------	----

SAMPLES REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE No. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

CLASSROOMS 201-202 BUILDING (BUILDING 200)

ENTIRE BUILDING

FIRE DOOR CORE INSULATION

<u>14-198AAA</u>	8/29/2014	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS 201-202 BUILDING (BUILDING 200)

EXTERIOR WALLS

ROUGH WALL

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

<u>16-030-A18</u>	1/28/2016	Negative	ND	NONE DETECTED	ND
--------------------------	-----------	----------	----	---------------	----

Exterior Wall by Drinking Fountain, Stucco.

CLASSROOMS 201-202 BUILDING (BUILDING 200)

EXTERIOR WALLS

ROUGH WALL SURFACING

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS 201-202 BUILDING (BUILDING 200)

EXTERIOR WINDOWS

WINDOW CAULKING

<u>09-212AAA</u>	9/8/2009	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

CLASSROOMS 201-202 BUILDING (BUILDING 200)

RESTROOMS

MORTAR MISCELLANEOUS

<u>09-098AAA</u>	5/14/2009	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

<u>16-030-A22</u>	1/28/2016	Negative	ND	NONE DETECTED	ND
--------------------------	-----------	----------	----	---------------	----

Classroom 202, Grout for 8"x8" Ceramic Floor Tile.

SAMPLES REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

CLASSROOMS 301-306 BUILDING (BUILDING 300)

CLASSROOMS 301-306 BUILDING (BUILDING 300)

ALL CLASSROOMS AND F.I.S. ROOM
 VINYL WALL COVER MASTIC

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS 301-306 BUILDING (BUILDING 300)

BOYS' AND GIRLS' RESTROOMS AND STORAGE ROOM
 MORTAR MISCELLANEOUS

<u>08-241AAA</u>	10/14/2008	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	------------	----------	---------	-----------	----

CLASSROOMS 301-306 BUILDING (BUILDING 300)

CLASSROOMS 301-308, AND RESTROOMS (2)
 MORTAR MISCELLANEOUS

<u>10-174AAA</u>	9/2/2010	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

<u>16-030-A25</u>	1/28/2016	Negative	ND	NONE DETECTED	ND
--------------------------	-----------	----------	----	---------------	----

Room 310, Grout for 8"x8" Ceramic Floor Tile.

CLASSROOMS 301-306 BUILDING (BUILDING 300)

ENTIRE BUILDING
 CEMENTITIOUS WINDOW PANEL

<u>14-198AAA</u>	8/29/2014	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS 301-306 BUILDING (BUILDING 300)

ENTIRE BUILDING
 FIRE DOOR CORE INSULATION

<u>14-198AAA</u>	8/29/2014	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS 301-306 BUILDING (BUILDING 300)

ENTIRE BUILDING INCLUDING RESTROOMS, UTILITY ROOMS AND STORAGE ROOMS
 SMOOTH WALL MISCELLANEOUS

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

<u>10-018 NW-77</u>	2/1/2010	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

Joint Tape

SAMPLES REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
<u>10-018 NW-77</u> Joint Compound	2/1/2010	Negative	ND	NONE DETECTED	ND
<u>10-018 NW-78</u> Walboard	2/1/2010	Negative	ND	NONE DETECTED	ND
<u>16-030-A31</u> Workroom 304, Wallboard.	1/28/2016	Negative	ND	NONE DETECTED	ND
<u>16-030-A32</u> Workroom 304, Joint Compound.	1/28/2016	Negative	ND	NONE DETECTED	ND
<u>16-030-A35</u> Room 303, Demising Wall, Sheetrock Wall.	1/28/2016	Negative	ND	NONE DETECTED	ND
CLASSROOMS 301-306 BUILDING (BUILDING 300) ENTIRE BUILDING INCLUDING RESTROOMS, UTILITY ROOMS AND STORAGE ROOMS SMOOTH WALL SURFACING					
<u>06-223AAA</u>	8/25/2006	Positive	ASSUMED	NO SAMPLE	NS
<u>10-018 NW-76</u>	2/1/2010	Negative	ND	NONE DETECTED	ND
CLASSROOMS 301-306 BUILDING (BUILDING 300) EXTERIOR WALLS AND OVERHANG ON RESTROOMS ROUGH WALL					
<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
<u>16-030-A33</u> Exterior by Drinking Fountain, Stucco Wall.	1/28/2016	Negative	ND	NONE DETECTED	ND
CLASSROOMS 301-306 BUILDING (BUILDING 300) EXTERIOR WALLS AND OVERHANG ON RESTROOMS ROUGH WALL SURFACING					
<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
CLASSROOMS 301-306 BUILDING (BUILDING 300) EXTERIOR WINDOWS AND DOORS WINDOW CAULKING					
<u>09-212AAA</u>	9/8/2009	Positive	ASSUMED	NO SAMPLE	NS

SAMPLES REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE No. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

<u>16-030-A34</u>	1/28/2016	Negative	ND	NONE DETECTED	ND
Exterior Door by 304, Interior side, Door Frame Caulking.					

CLASSROOMS 301-306 BUILDING (BUILDING 300)

TEACHERS' WORK ROOM, AND CLASSROOMS 301-308
 SINK UNDERCOATING

<u>08-241AAA</u>	10/14/2008	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	------------	----------	---------	-----------	----

<u>16-030-A30</u>	1/28/2016	Negative	ND	NONE DETECTED	ND
Workroom 304, Gray Thermal Undercoating on Sink.					

CLASSROOMS 301-306 BUILDING (BUILDING 300)

WATER HEATER ROOM (NEXT TO RESTROOMS) AND JANITOR CLOSET
 BASEBOARD MASTIC

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

SAMPLES REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

CLASSROOMS 400-406 BUILDING (BUILDING 400)

CLASSROOMS 400-406 BUILDING (BUILDING 400)

CLASSROOMS, AND LIBRARY

VINYL WALL COVER MASTIC

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS 400-406 BUILDING (BUILDING 400)

ENTIRE BUILDING

CEMENTITIOUS WINDOW PANEL

<u>14-18AAA</u>	8/29/2014	Positive	ASSUMED	NO SAMPLE	NS
------------------------	-----------	----------	---------	-----------	----

CLASSROOMS 400-406 BUILDING (BUILDING 400)

ENTIRE BUILDING

FIRE DOOR CORE INSULATION

<u>14-198AAA</u>	8/29/2014	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS 400-406 BUILDING (BUILDING 400)

ENTIRE BUILDING

SMOOTH WALL MISCELLANEOUS

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

<u>10-018 NW-59</u>	2/1/2010	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

Joint Tape

<u>10-018 NW-59</u>	2/1/2010	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

Joint Compound

<u>10-018 NW-60</u>	2/1/2010	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

Drywall

CLASSROOMS 400-406 BUILDING (BUILDING 400)

ENTIRE BUILDING

SMOOTH WALL SURFACING

<u>06-223AAA</u>	8/25/2006	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

SAMPLES REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

CLASSROOMS 400-406 BUILDING (BUILDING 400)

EXTERIOR WALLS, AND OVERHANG OF RESTROOMS
ROUGH WALL

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS 400-406 BUILDING (BUILDING 400)

EXTERIOR WALLS, AND OVERHANG OF RESTROOMS
ROUGH WALL SURFACING

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS 400-406 BUILDING (BUILDING 400)

EXTERIOR WINDOWS
WINDOW CAULKING

<u>09-212AAA</u>	9/8/2009	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

CLASSROOMS 400-406 BUILDING (BUILDING 400)

LIBRARY (400), CLASSROOMS 401-406, AND RESTROOMS
MORTAR MISCELLANEOUS

<u>10-174AAA</u>	9/2/2010	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

<u>16-030-A37</u>	1/28/2016	Negative	ND	NONE DETECTED	ND
--------------------------	-----------	----------	----	---------------	----

Library, Grout for 8"x8" Ceramic Floor Tile.

CLASSROOMS 400-406 BUILDING (BUILDING 400)

LIBRARY STORAGE
BASEBOARD MASTIC

<u>08-241AAA</u>	10/20/2008	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	------------	----------	---------	-----------	----

CLASSROOMS 400-406 BUILDING (BUILDING 400)

LIBRARY STORAGE
VINYL FLOOR TILE

<u>08-241AAA</u>	10/20/2008	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	------------	----------	---------	-----------	----

SAMPLES REPORT FOR
NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE No. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

CLASSROOMS 400-406 BUILDING (BUILDING 400)

LIBRARY STORAGE

VINYL FLOOR TILE MASTIC

<u>08-241AAA</u>	10/20/2008	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	------------	----------	---------	-----------	----

CLASSROOMS 400-406 BUILDING (BUILDING 400)

TEACHERS' WORK ROOM, AND LIBRARY

SINK UNDERCOATING

<u>08-241AAA</u>	10/20/2008	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	------------	----------	---------	-----------	----

CLASSROOMS 400-406 BUILDING (BUILDING 400)

WATER HEATER ROOM AND UTILITY CLOSET

BASEBOARD MASTIC

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

SAMPLES REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

CLASSROOMS 501-506 BUILDING (BUILDING 500)

CLASSROOMS 501-506 BUILDING (BUILDING 500)

CLASSROOMS 501-504 (AND RESTROOMS), AND CLASSROOMS 505 & 506 (AND RESTROOMS)
MORTAR MISCELLANEOUS

<u>10-174AAA</u>	9/2/2010	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

<u>16-030-A43</u>	1/28/2016	Negative	ND	NONE DETECTED	ND
--------------------------	-----------	----------	----	---------------	----

Room 517, Mortar for Red 8"x8" Ceramic Floor Tile.

CLASSROOMS 501-506 BUILDING (BUILDING 500)

CLASSROOMS 501-506
SINK UNDERCOATING

<u>08-241AAA</u>	10/20/2008	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	------------	----------	---------	-----------	----

CLASSROOMS 501-506 BUILDING (BUILDING 500)

CLASSROOMS 501-506 AND COMPUTER LAB
VINYL WALL COVER MASTIC

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS 501-506 BUILDING (BUILDING 500)

ENTIRE BUILDING
CEMENTITIOUS WINDOW PANEL

<u>14-198AAA</u>	8/29/2014	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS 501-506 BUILDING (BUILDING 500)

ENTIRE BUILDING
FIRE DOOR CORE INSULATION

<u>14-198AAA</u>	8/29/2014	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS 501-506 BUILDING (BUILDING 500)

ENTIRE BUILDING (INCLUDING RESTROOMS, STORAGE ROOMS AND UTILITY ROOMS)
SMOOTH WALL MISCELLANEOUS

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

<u>10-018 NW-55</u>	2/1/2010	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

Joint Tape

SAMPLES REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

<u>10-018 NW-55</u> Joint Compound	2/1/2010	Negative	ND	NONE DETECTED	ND
--	----------	----------	----	---------------	----

<u>10-018 NW-56</u> Drywall	2/1/2010	Negative	ND	NONE DETECTED	ND
---------------------------------------	----------	----------	----	---------------	----

CLASSROOMS 501-506 BUILDING (BUILDING 500)

ENTIRE BUILDING INCLUDING RESTROOMS, STORAGE ROOMS AND UTILITY ROOMS
 SMOOTH WALL SURFACING

<u>06-223AAA</u>	8/25/2006	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS 501-506 BUILDING (BUILDING 500)

EXTERIOR WALLS, AND OVERHANG OF RESTROOMS
 ROUGH WALL SURFACING

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS 501-506 BUILDING (BUILDING 500)

EXTERIOR WALLS, AND OVERHANGS OF RESTROOMS
 ROUGH WALL

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS 501-506 BUILDING (BUILDING 500)

EXTERIOR WINDOWS
 WINDOW CAULKING

<u>09-212AAA</u>	9/8/2009	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

CLASSROOMS 501-506 BUILDING (BUILDING 500)

WATER HEATER CLOSET AND STORAGE
 BASEBOARD MASTIC

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

SAMPLES REPORT FOR
NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

CLASSROOMS 801 PORTABLE BUILDING
CLASSROOMS 801 PORTABLE BUILDING

CLASSROOM 801
PORTABLE BUILDING

08-241AAA	10/20/2008	Negative	NEW MATERIAL	NO SAMPLE	NS
New 2008 Construction Relocatable Building per Manufacturer's Tag information.					

SAMPLES REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

CLASSROOMS

BASEBOARD MASTIC

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

CLASSROOMS

SMOOTH WALL MISCELLANEOUS

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

CLASSROOMS

SUSPENDED CEILING TILE

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

CLASSROOMS

VINYL FLOOR TILE

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

CLASSROOMS

VINYL FLOOR TILE MASTIC

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

CLASSROOMS

VINYL WALL COVER MASTIC

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

SAMPLES REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

CLASSROOMS, OFFICE AND STORAGE ROOM

CARPET MASTIC

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

DAYCARE PORTABLE (600)

SINK UNDERCOATING

<u>10-174AAA</u>	9/2/2010	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

ENTIRE BUILDING

FIRE DOOR CORE INSULATION

<u>14-198AAA</u>	8/29/2014	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

RESTROOMS (1 EA BOYS' AND GIRLS'), STAFF ROOM, AND CUSTODIAN ROOM

VINYL SHEETING

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

RESTROOMS (1 EA BOYS' AND GIRLS'), STAFF ROOM, AND CUSTODIAN ROOM

VINYL SHEETING BACKING PAPER/MASTIC

<u>05-212AAA</u>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

SAMPLES REPORT FOR
NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

DAYCARE PORTABLE BUILDING - FED CHILDCARE (BUILDING 900)

DAYCARE PORTABLE BUILDING - FED CHILDCARE (BUILDING 900)

DAYCARE PORTABLE BUILDING - FED CHILDCARE (BUILDING 900)
PORTABLE BUILDING

05-212.NS	9/14/2005	Negative	NEW MATERIAL	NO SAMPLE	NS
------------------	-----------	----------	--------------	-----------	----

SAMPLES REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

DAYCARE PORTABLE BUILDING - SDC (BUILDING 800)

DAYCARE PORTABLE BUILDING - SDC (BUILDING 800)

PORTABLE DAYCARE - SDC

PORTABLE BUILDING

<u>05-212.NS</u>	9/14/2005	Negative	NEW MATERIAL	NO SAMPLE	NS
-------------------------	-----------	----------	--------------	-----------	----

New 1996 Construction Relocatable Building per Manufacturer's Tag information.

<u>05-212.NS</u>	9/14/2005	Negative	NEW MATERIAL	NO SAMPLE	NS
-------------------------	-----------	----------	--------------	-----------	----

New 1996 Construction Relocatable Building per Manufacturer's Tag information.

SAMPLES REPORT FOR
NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE No. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

FAMILY RESOURCE CENTER (BUILDING 700)

FAMILY RESOURCE CENTER (BUILDING 700)

DAYCARE PORTABLE BUILDING - STATE
PORTABLE BUILDING

08-075AAA	4/21/2008	Negative	NEW MATERIAL	NO SAMPLE	NS
New 2007 Construction Relocatable Building per Manufacturer's Tag information.					

SAMPLES REPORT FOR
NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

METAL STORAGE CONTAINERS (3 EA)

METAL STORAGE CONTAINERS (3 EA)

METAL STORAGE CONTAINERS (3 EA)
STORAGE CONTAINER

16-074.NS	3/21/2016	Positive	ASSUMED	NO SAMPLE	NS
Metal Storage Structure.					

SAMPLES REPORT FOR
NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE NO.	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
COMMENTS					

MIDDLE QUAD PATIO

MIDDLE QUAD PATIO

MIDDLE QUAD PATIO

PERMANENT BUILDING

15-174.NS

9/18/2015 Negative

NEW MATERIAL

NO SAMPLE

NS

Apparent New Metal and Concrete Construction Building.

SAMPLES REPORT FOR
NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

PORTABLE NEXT TO P6 (802)

PORTABLE NEXT TO P6 (802)

PORTABLE NEXT TO P6 (802)
PORTABLE BUILDING

<u>19-011AAA</u>	2/8/2019	Negative	NEW MATERIAL	NO SAMPLE	NS
-------------------------	----------	----------	--------------	-----------	----

SAMPLES REPORT FOR
NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

RIGHT AT SCHOOL PORTABLE (CLASSROOM P6) (803)

RIGHT AT SCHOOL PORTABLE (CLASSROOM P6) (803)

CLASSROOM 6(803)
PERMANENT BUILDING

<u>19-011AAA</u>	2/8/2019	Negative	NEW MATERIAL	NO SAMPLE	NS
-------------------------	----------	----------	--------------	-----------	----

SAMPLES REPORT FOR
NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

WOOD STORAGE SHEDS (2 EA)

WOOD STORAGE SHEDS (2 EA)

WOOD STORAGE SHEDS (2 EA)
STORAGE BUILDING

09-098AAA	5/14/2009	Negative	NEW MATERIAL	NO SAMPLE	NS
------------------	-----------	----------	--------------	-----------	----

Wood Construction Structures.

End Of Report, Total Of 26 Pages

DAMAGE REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESSMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	--------------------------	----------	----------------------	---

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

BOOK STORAGE ROOM, CUSTODIAL ROOM, AND PANTRY ROOM

BASEBOARD MASTIC

116 LF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/14/2005	Mastic/Adhesive for 4" Brown Baseboard. This Material is in GOOD condition as of this date.
08/25/2006	Book Storage Room added to Location. 30 LF added to quantity. Location Name changed from CUSTODIAL ROOM, AND PANTRY ROOM to BOOK STORAGE ROOM, CUSTODIAL ROOM, AND PANTRY ROOM. Quantity changed from 86 LF to 116 LF to reflect this fact. No other changes as of this date.
04/03/2017	Damage Observed. <5% Physical Damage - in the form of 1 LF Damage and Missing Baseboard in Book Storage Room. Material condition changed from GOOD to FAIR overall. Friability changed from Non to Low. No other changes as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.
08/19/2022	This Material is unchanged as of this date.
02/17/2023	This Material is unchanged as of this date.
08/18/2023	This Material is unchanged as of this date.
02/16/2024	This Material is unchanged as of this date.
08/16/2024	This Material is unchanged as of this date.
03/03/2025	This Material is unchanged as of this date.
09/19/2025	This Material is unchanged as of this date.

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

ENTIRE BUILDING

SMOOTH WALL MISCELLANEOUS

24,500 SF

P: Less Than 5%

W: <10% Stains or Flaking

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/14/2005	Gypsum Wallboard System. (Material also exists behind Vinyl Covered Wall Panels in some areas). Damage: <5% Physical Damage - in exterior Water Heater Room; <10% Water Damage - in exterior Water Heater Room. Existing Gypsum Wallboard Systems Removed and Replaced with new in-kind in Path-of-Construction. This Material is in FAIR condition overall as of this date.
------------	--

DAMAGE REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME		QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
LOCATION	MATERIAL TYPE		
RISK ASSESMENT CATEGORY			
COMMENTS			
03/09/2007	Damage: <10% Water Damage - approximately 20 SF in Kitchen. Condition changed to reflect this fact. No other changes as of this date.		
11/09/2007	This Material in POOR condition in Water Heater Room. This Material is in FAIR condition overall as of this date.		
04/21/2008	Damage in the Water Heater Room is on all Walls. No other changes as of this date.		
10/20/2008	Exterior Water Heater Room has 3/4 of Ceiling missing. <10% Water Damage. No other changes as of this date.		
09/08/2009	Material remains in <5% Physical Damage and <10% Water Damage. This Material is unchanged as of this date.		
02/01/2010	Samples 10-019 NW-69 (Joint Tape / Compound), NW-70 (Drywall) , NW-73 (Joint Tape / Compound) and NW-74 (Drywall) collected on this date.		
09/18/2015	Additional Damage observed. Pantry by Exhaust has minor cuts and holes. No other change as of this date.		
01/28/2016	Sample 16-030-A07 collected from Storage 121, Drywall Board. Sample 16-030-A08 collected from Storage 121, Joint Mud. Sample 16-030-A13 collected from Multi-purpose Room by 122 Door, Drywall.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	Additional Damage Observed. <5% Physical Damage in the form of 1.5 SF of Missing and Peeling Skimcoat and Mud as well as a 3 LF Water Leak on the Ceiling by West Wall of Mens Staff Restroom. Material remains in FAIR condition overall. No other changes as of this date.		
02/16/2024	This Material is unchanged as of this date.		
08/16/2024	This Material is unchanged as of this date.		
03/03/2025	This Material is unchanged as of this date.		
09/19/2025	This Material is unchanged as of this date.		

DAMAGE REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

ENTIRE BUILDING

SMOOTH WALL SURFACING

24,500 SF

P: Less Than 5%

W: <10% Stains or Flaking

DAMAGED FRIABLE SURFACING ACM

08/25/2006	Skim Coat for Gypsum Wallboard System. (Material also exists behind Vinyl Covered Wall Panels in some areas). Damages noted in exterior Water Heater Room. Existing Gypsum Wallboard Systems Removed and Replaced with new in-kind in Path-of-Construction. This Material is in FAIR condition overall as of this date.
03/09/2007	Damage: <10% Water Damage - approximately 20 SF in in Kitchen. Condition changed to reflect this fact. No other changes as of this date.
11/09/2007	This Material in POOR condition in Water Heater Room. This Material is in FAIR condition overall as of this date.
10/20/2008	Exterior Water Heater Room has 3/4 of Ceiling is missing. <10% Water Damage. No other changes as of this date.
09/08/2009	Material remains in <5% Physical Damage and <10% Water Damage. This Material is unchanged as of this date.
02/01/2010	Samples 10-019 NW-68 and NW-72 collected on this date.
09/18/2015	Additional Damage observed. Pantry by Exhaust has minor cuts and holes. No other change as of this date.
01/28/2016	Sample 16-030-A09 collected from Storage 121, Paint. Sample 16-030-A12 collected from MP Room by 122 Door, Skim Coat and Mud on Drywall.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.
08/19/2022	This Material is unchanged as of this date.
02/17/2023	This Material is unchanged as of this date.
08/18/2023	Additional Damage Observed. <5% Physical Damage in the form of 1.5 SF of Missing and Peeling Skimcoat and Mud as well as a 3 LF Water Leak on the Ceiling by West Wall of Mens Staff Restroom. Material remains in FAIR condition overall. No other changes as of this date.
02/16/2024	This Material is unchanged as of this date.
08/16/2024	This Material is unchanged as of this date.
03/03/2025	This Material is unchanged as of this date.
09/19/2025	This Material is unchanged as of this date.

DAMAGE REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME		QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
LOCATION	MATERIAL TYPE		
RISK ASSESSMENT CATEGORY			
COMMENTS			

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

KITCHEN PANTRY CLOSET

VINYL FLOOR TILE

60 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/14/2005	9"x9" Red Vinyl Floor Tile. This Material is in GOOD condition as of this date.
10/11/2012	Damage: <5% Physical Damage - in the form of 1 Tile is missing, 3 Tiles are broken, and Mastic/Adhesive is exposed. Material condition changed from GOOD to FAIR overall as of this date. Friability changed from Non-Friable to Friable to reflect this change.
03/07/2014	2 additional Tiles are broken and Mastic/Adhesive is exposed. No other changes as of this date.
04/03/2017	Additional Damage Observed. 8 Tiles Broken with Mastic Exposed and 4 Tiles Loose. 2 SF of Water Damage and debris at back of the closet. No other changes as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.
08/19/2022	This Material is unchanged as of this date.
02/17/2023	This Material is unchanged as of this date.
08/18/2023	This Material is unchanged as of this date.
02/16/2024	This Material is unchanged as of this date.
08/16/2024	This Material is unchanged as of this date.
03/03/2025	This Material is unchanged as of this date.
09/19/2025	This Material is unchanged as of this date.

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

KITCHEN PANTRY CLOSET

VINYL FLOOR TILE MASTIC

60 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/14/2005	Mastic/Adhesive for 9"x9" Red Vinyl Floor Tile. This Material is in GOOD condition as of this date.
03/07/2014	6 Tiles are broken and Mastic/Adhesive is exposed. This Material is in FAIR condition. No other changes as of this date.

DAMAGE REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

04/03/2017	Additional Damage Observed. 8 Tiles Broken with Mastic Exposed and 4 Tiles Loose. 2 SF of Water Damage and debris at back of the closet. No other changes as of this date.					
01/31/2020	This Material is unchanged as of this date.					
09/01/2020	This Material is unchanged as of this date.					
02/12/2021	This Material is unchanged as of this date.					
08/13/2021	This Material is unchanged as of this date.					
02/23/2022	This Material is unchanged as of this date.					
08/19/2022	This Material is unchanged as of this date.					
02/17/2023	This Material is unchanged as of this date.					
08/18/2023	This Material is unchanged as of this date.					
02/16/2024	This Material is unchanged as of this date.					
08/16/2024	This Material is unchanged as of this date.					
03/03/2025	This Material is unchanged as of this date.					
09/19/2025	This Material is unchanged as of this date.					

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

MULTI-PURPOSE ROOM

SUSPENDED CEILING TILE	2,530 SF	P: Less Than 5% W: <10% Stains or Flaking
------------------------	----------	--

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

10/20/2008	2'x2' Suspended Ceiling Tile. Tiles are White with a pitted mark form pattern. 10 Tiles have Water Stains. This Material is in FAIR condition as of this date. (Original Entry updated 03/19/15.)					
09/18/2015	Damage Re-Assessed. Damage is currently as follows for the following room: Multipurpose Room has 4 Tiles Water Damaged and 1 Tile Physically Damaged. No other changes as of this date.					
04/03/2017	Additional Damage Observed. Multi-Purpose Room now has 12 Tiles with Water Damage. No other changes as of this date.					
01/31/2020	This Material is unchanged as of this date.					
09/01/2020	This Material is unchanged as of this date.					
02/12/2021	This Material is unchanged as of this date.					
08/13/2021	This Material is unchanged as of this date.					
02/23/2022	This Material is unchanged as of this date.					
08/19/2022	This Material is unchanged as of this date.					
02/17/2023	This Material is unchanged as of this date.					

DAMAGE REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
RISK ASSESMENT CATEGORY	COMMENTS			

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

08/16/2024 This Material is unchanged as of this date.

03/03/2025 This Material is unchanged as of this date.

09/19/2025 This Material is unchanged as of this date.

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

MULTI-PURPOSE ROOM, OFFICES, AND HALLWAYS

VINYL WALL COVER MASTIC

18,680 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/14/2005 Mastic/Adhesive for Vinyl Covered Wall Panels, (over Gypsum Wallboard System). This Material is in GOOD condition as of this date.

08/30/2017 Damage Observed. <5% Physical Damage - in the form of Seveal areas have Scrapes in the Materail. Material condition changed from GOOD to FAIR overall. Friability changed from Non to Low. No other changes as of this date.

01/31/2020 Additional Damage Observed. 1 SF of Loose Peeling Vinyl Floor Wall in Staff Lounge. No other changes as of this date.

09/01/2020 Additional Damage Observed. In Multi-Purpose Room 1 SF of Torn Vinyl Wall Cover on North Wall. 4 SF of Torn Vinyl Wall Cover on South Wall. No other changes as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

08/16/2024 This Material is unchanged as of this date.

03/03/2025 This Material is unchanged as of this date.

09/19/2025 This Material is unchanged as of this date.

DAMAGE REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

PTA ROOM

VINYL FLOOR TILE

144 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/14/2005	12"x12" Off-White Vinyl Floor Tile. This Material is in GOOD condition as of this date.
03/07/2014	Location name changed from CONFERENCE ROOM (OLD CUSTODIAN ROOM) to PTA ROOM. 1 Tile is broken and Mastic/Adhesive is exposed. No other changes as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.
08/19/2022	This Material is unchanged as of this date.
02/17/2023	This Material is unchanged as of this date.
08/18/2023	This Material is unchanged as of this date.
02/16/2024	This Material is unchanged as of this date.
08/16/2024	This Material is unchanged as of this date.
09/19/2025	This Material is unchanged as of this date.

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

PTA ROOM

VINYL FLOOR TILE MASTIC

144 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/14/2005	Mastic/Adhesive for 12"x12" Off-White Vinyl Floor Tile. This Material is in GOOD condition as of this date.
03/07/2014	Location name changed from CONFERENCE ROOM (OLD CUSTODIAN ROOM) to PTA ROOM. 1 Tile is broken and Mastic/Adhesive is exposed. No other changes as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.

DAMAGE REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME		QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
LOCATION	MATERIAL TYPE		
RISK ASSESMENT CATEGORY			
COMMENTS			

08/19/2022	This Material is unchanged as of this date.
02/17/2023	This Material is unchanged as of this date.
08/18/2023	This Material is unchanged as of this date.
02/16/2024	This Material is unchanged as of this date.
08/16/2024	This Material is unchanged as of this date.
03/03/2025	This Material is unchanged as of this date.
09/19/2025	This Material is unchanged as of this date.

DAMAGE REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

CLASSROOMS 201-202 BUILDING (BUILDING 200)

CLASSROOMS 201-202 BUILDING (BUILDING 200)

CLASSROOMS 201 AND 202, RESTROOMS, STORAGE ROOMS AND UTILITY ROOMS

SMOOTH WALL MISCELLANEOUS

2,600 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/14/2005	Gypsum Wallboard System, (with 4'x8' Covered Wall Panels in some areas). Existing Gypsum Wallboard Systems Removed and Replaced with new in-kind in Path-of-Construction. This Material is in GOOD condition as of this date.
05/14/2009	<5% physical damage. 2 SF is Damaged in the Exterior Storage Closets, 1 SF in each, where Exhaust Ducts have been removed. Several holes and cuts observed on the Walls and Ceilings in 2 Storage Closets and the Custodian Room. Material changed from GOOD to FAIR condition as of this date. No other changes as of this date.
02/01/2010	Samples 10-019 NW-63 (Joint Tape / Compound), NW-64 (Drywall), NW-66 (Joint Tape / Compound), and NW-67 (Drywall) collected on this date.
09/18/2015	Additional Damage observed. Exterior Storage Rooms have minor holes and cuts. No other changes as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	Additional Damage Observed. 2 SF of Missing Wall in Storage Room near Classroom 201. No other changes as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.
08/19/2022	This Material is unchanged as of this date.
02/17/2023	This Material is unchanged as of this date.
08/18/2023	This Material is unchanged as of this date.
02/16/2024	This Material is unchanged as of this date.
08/16/2024	This Material is unchanged as of this date.
03/03/2025	This Material is unchanged as of this date.
09/19/2025	This Material is unchanged as of this date.

DAMAGE REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

CLASSROOMS 201-202 BUILDING (BUILDING 200)

CLASSROOMS 201 AND 202, RESTROOMS, STORAGE ROOMS AND UTILITY ROOMS

SMOOTH WALL SURFACING

2,600 SF

P: Less Than 5%

W: No Evidence

DAMAGED FRIABLE SURFACING ACM

08/25/2006	Skim Coat for Gypsum Wallboard System, (with 4'x8' Covered Wall Panels in some areas). Existing Gypsum Wallboard Systems Removed and Replaced with new in-kind in Path-of-Construction. This Material is in GOOD condition as of this date.
05/14/2009	<5% Physical Damage. 2 SF is Damaged in the Exterior Storage Closets, 1 SF in each, where Exhaust Ducts have been removed. Several holes and cuts observed on the Walls and Ceilings in 2 Storage Closets and the Custodian Room. Material changed from GOOD to FAIR condition as of this date. No other changes as of this date.
02/01/2010	Samples 10-019 NW-62 and NW-65 collected on this date.
09/18/2015	Additional Damage observed, Exterior Storage Rooms have minor holes and cuts. No other change as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	Additional Damage Observed. 2 SF of Missing Wall in Storage Room near Classroom 201. No other changes as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.
08/19/2022	This Material is unchanged as of this date.
02/17/2023	This Material is unchanged as of this date.
08/18/2023	This Material is unchanged as of this date.
02/16/2024	This Material is unchanged as of this date.
08/16/2024	This Material is unchanged as of this date.
03/03/2025	This Material is unchanged as of this date.
09/19/2025	This Material is unchanged as of this date.

DAMAGE REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME		QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
LOCATION	MATERIAL TYPE		
RISK ASSESSMENT CATEGORY			
COMMENTS			

CLASSROOMS 201-202 BUILDING (BUILDING 200)

EXTERIOR WINDOWS

WINDOW CAULKING

200 LF

P: Less Than 5%

W: <10% Stains or Flaking

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/08/2009	Caulking on Exterior Windows. Damage: <5% Physical Damage and <10% Water Damage due to existing degradation of heat and moisture factors and missing portion of material in various locations. This Material is in FAIR condition as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.
08/19/2022	This Material is unchanged as of this date.
02/17/2023	This Material is unchanged as of this date.
08/18/2023	This Material is unchanged as of this date.
02/16/2024	This Material is unchanged as of this date.
08/16/2024	This Material is unchanged as of this date.
03/03/2025	This Material is unchanged as of this date.
09/19/2025	This Material is unchanged as of this date.

DAMAGE REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

CLASSROOMS 301-306 BUILDING (BUILDING 300)

CLASSROOMS 301-306 BUILDING (BUILDING 300)

ENTIRE BUILDING INCLUDING RESTROOMS, UTILITY ROOMS AND STORAGE ROOMS

SMOOTH WALL MISCELLANEOUS

37,800 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/14/2005	Gypsum Wallboard system, (with 4'x8' Covered Wall Panels in some areas). Existing Gypsum Wallboard Systems Removed and Replaced with new in-kind in Path-of-Construction. This Material is in GOOD condition as of this date.
02/01/2010	Samples 10-019 NW-77 (Joint Tape / Compound), and NW-78 (Drywall) collected on this date.
12/01/2011	Damage: <5% Physical Damage - in the form of Storage Room, next to Girls Restroom, approximately 20 SF of Dry Wall has been removed. Material condition changed from GOOD to FAIR overall. No other changes as of this date.
01/28/2016	Sample 16-030-A31 collected from Workroom 304, Wallboard. Sample 16-030-A32 collected from Workroom 304, Joint Compound. Sample 16-030-A35 collected from Room 303, Demising Wall, Sheetrock Wall.
09/15/2016	Material Removed in various locations and Replaced with New as part of the Summer 2016 renovation project. Material Quantity changed from 38,200 SF to 37,800 SF. No other changes as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.
08/19/2022	This Material is unchanged as of this date.
02/17/2023	This Material is unchanged as of this date.
08/18/2023	This Material is unchanged as of this date.
02/16/2024	This Material is unchanged as of this date.
08/16/2024	This Material is unchanged as of this date.
03/03/2025	This Material is unchanged as of this date.
09/19/2025	This Material is unchanged as of this date.

DAMAGE REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

CLASSROOMS 301-306 BUILDING (BUILDING 300)

ENTIRE BUILDING INCLUDING RESTROOMS, UTILITY ROOMS AND STORAGE ROOMS

SMOOTH WALL SURFACING

37,800 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

08/25/2006	Skim Coat for Gypsum Wallboard System, (with 4'x8' Covered Wall Panels in some areas). Existing Gypsum Wallboard Systems Removed and Replaced with new in-kind in Path-of-Construction. This Material is in GOOD condition as of this date.
02/01/2010	Sample 10-019 NW-76 collected on this date.
12/01/2011	Damage: <5% Physical Damage - in the form of Storage Room, next to Girls Restroom, approximately 20 SF of Dry Wall has been removed. Material condition changed from GOOD to FAIR overall. No other changes as of this date.
09/15/2016	Material Removed in various locations and Replaced with New as part of the Summer 2016 renovation project. Material Quantity changed from 38,200 SF to 37,800 SF. No other changes as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.
08/19/2022	This Material is unchanged as of this date.
02/17/2023	This Material is unchanged as of this date.
08/18/2023	This Material is unchanged as of this date.
02/16/2024	This Material is unchanged as of this date.
08/16/2024	This Material is unchanged as of this date.
03/03/2025	This Material is unchanged as of this date.
09/19/2025	This Material is unchanged as of this date.

CLASSROOMS 301-306 BUILDING (BUILDING 300)

EXTERIOR WINDOWS AND DOORS

WINDOW CAULKING

900 LF

P: Less Than 5%

W: <10% Stains or Flaking

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/08/2009	Caulking on Exterior Windows and Doors. Damage: <5% Physical Damage and <10% Water Damage due to existing missing sections of material, and heat and moisture degradation factors in various locations. This Material is in FAIR condition as of this date.
------------	---

DAMAGE REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESSMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	--------------------------	----------	----------------------	---

01/28/2016	Sample 16-030-A34 collected from Exterior Door by 304, Interior side, Door Frame Caulking.					
01/31/2020	This Material is unchanged as of this date.					
09/01/2020	This Material is unchanged as of this date.					
02/12/2021	This Material is unchanged as of this date.					
08/13/2021	This Material is unchanged as of this date.					
02/23/2022	This Material is unchanged as of this date.					
08/19/2022	This Material is unchanged as of this date.					
02/17/2023	This Material is unchanged as of this date.					
08/18/2023	This Material is unchanged as of this date.					
02/16/2024	This Material is unchanged as of this date.					
08/16/2024	This Material is unchanged as of this date.					
03/03/2025	This Material is unchanged as of this date.					
09/19/2025	This Material is unchanged as of this date.					

CLASSROOMS 301-306 BUILDING (BUILDING 300)

WATER HEATER ROOM (NEXT TO RESTROOMS) AND JANITOR CLOSET

BASEBOARD MASTIC

15 LF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/14/2005	Mastic/Adhesive for 4" Brown Baseboard. This Material is in GOOD condition as of this date.					
01/31/2020	This Material is unchanged as of this date.					
09/01/2020	This Material is unchanged as of this date.					
02/12/2021	This Material is unchanged as of this date.					
08/13/2021	This Material is unchanged as of this date.					
02/23/2022	This Material is unchanged as of this date.					
08/19/2022	Damage Observed. <5% Physical Damage in the form of 2 LF of Missing Baseboard with Brown Mastic Exposed. Material condition changed from GOOD to FAIR overall. Friability updated from Non-Friable to Friable. No other changes as of this date.					
02/17/2023	This Material is unchanged as of this date.					
08/18/2023	This Material is unchanged as of this date.					
02/16/2024	This Material is unchanged as of this date.					
08/16/2024	This Material is unchanged as of this date.					

DAMAGE REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME					
LOCATION					
MATERIAL TYPE			QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:)	
RISK ASSESMENT CATEGORY				WATER DAMAGE (W:)	
COMMENTS					

03/03/2025	This Material is unchanged as of this date.
09/19/2025	This Material is unchanged as of this date.

DAMAGE REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESSMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P): WATER DAMAGE (W):
---------------	----------	---------------	--------------------------	----------	----------------------	---

CLASSROOMS 400-406 BUILDING (BUILDING 400)

CLASSROOMS 400-406 BUILDING (BUILDING 400)

CLASSROOMS, AND LIBRARY

VINYL WALL COVER MASTIC

29,880 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/14/2005	Mastic/Adhesive for Vinyl Wall Covering on 4'x8' Vinyl Covered Wall Panels. This Material is in GOOD condition as of this date.
09/15/2016	Damage observed. Damage: <5% Physical Damage - in the form of 6" tear in the Vinyl in Classroom 401. Material Condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.
08/19/2022	This Material is unchanged as of this date.
02/17/2023	This Material is unchanged as of this date.
08/18/2023	This Material is unchanged as of this date.
02/16/2024	Additional Damage Observed. Classroom 404 has a 1/2 Foot Teat in Material. No other changes as of this date.
08/16/2024	This Material is unchanged as of this date.
03/03/2025	This Material is unchanged as of this date.
09/19/2025	This Material is unchanged as of this date.

CLASSROOMS 400-406 BUILDING (BUILDING 400)

ENTIRE BUILDING

SMOOTH WALL MISCELLANEOUS

38,100 SF

P: Less Than 5%

W: <10% Stains or Flaking

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/14/2005	Gypsum Wallboard System Walls and Ceilings. (Material assumed to exist under 4'x8' Vinyl Covered Wall Panels. Damage: <5% Physical Damage - in PE Storage Room; Water Damage: <10% - in PE Storage Room. This Material is in FAIR condition overall as of this date.
04/21/2008	50 SF in PE Storage Room Damaged above the Double Entry Doors and 2 SF of debris on Floor. Missing Material with broken edges in the center of the ceiling as of this date.

DAMAGE REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

02/01/2010	Samples 10-019 NW-59 (Joint Tape / Compound), and NW-60 (Drywall) collected on this date.					
09/18/2015	Additional Damage observed. Exterior Storage Closet by Students Restrooms has minor holes and cuts. No other changes as of this date.					
01/31/2020	This Material is unchanged as of this date.					
09/01/2020	Additional Damage Observed. 2 LF Crack in Work Room of Classroom 402. No other changes as of this date.					
02/12/2021	This Material is unchanged as of this date.					
08/13/2021	This Material is unchanged as of this date.					
02/23/2022	This Material is unchanged as of this date.					
08/19/2022	This Material is unchanged as of this date.					
02/17/2023	Additional Damage Observed. <5% Physical Damage in the form of 1 SF of Scuffs and Holes in Work Room of Classroom 406. Material remains in FAIR condition overall. No other changes as of this date.					
08/18/2023	This Material is unchanged as of this date.					
02/16/2024	This Material is unchanged as of this date.					
08/16/2024	This Material is unchanged as of this date.					
03/03/2025	This Material is unchanged as of this date.					
09/19/2025	This Material is unchanged as of this date.					

CLASSROOMS 400-406 BUILDING (BUILDING 400)

ENTIRE BUILDING

SMOOTH WALL SURFACING	38,100 SF	P: Less Than 5% W: <10% Stains or Flaking
-----------------------	-----------	--

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

08/25/2006	Skim Coat for Gypsum Wallboard System Walls and Ceilings. (Material assumed to exist under 4'x8' Vinyl Covered Wall Panels. Damage: <5% Physical Damage - in PE Storage Room; Water Damage: <10% - in PE Storage Room. This Material is in FAIR condition overall as of this date.					
09/18/2015	Additional Damage observed. Exterior Storage Closet by Students Restrooms has minor holes and cuts. No other change as of this date.					
01/31/2020	This Material is unchanged as of this date.					
09/01/2020	Additional Damage Observed. 2 LF Crack in Work Room of Classroom 402. No other changes as of this date.					
02/12/2021	This Material is unchanged as of this date.					
08/13/2021	This Material is unchanged as of this date.					
02/23/2022	This Material is unchanged as of this date.					

DAMAGE REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

08/19/2022	This Material is unchanged as of this date.					
02/17/2023	Additional Damage Observed. <5% Physical Damage in the form of 1 SF of Scuffs and Holes in Work Room of Classroom 406. Material remains in FAIR condition overall. No other changes as of this date.					
08/18/2023	This Material is unchanged as of this date.					
02/16/2024	This Material is unchanged as of this date.					
08/16/2024	This Material is unchanged as of this date.					
03/03/2025	This Material is unchanged as of this date.					
09/19/2025	This Material is unchanged as of this date.					

CLASSROOMS 400-406 BUILDING (BUILDING 400)

EXTERIOR WALLS, AND OVERHANG OF RESTROOMS

ROUGH WALL	7,200 SF	P: Less Than 5% W: No Evidence
------------	----------	-----------------------------------

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/14/2005	Stucco Exterior Walls and Restrooms Overhangs. This Material is in GOOD condition as of this date.					
05/14/2009	This Material has hairline cracks on various surfaces. <5% Physical Damage. Friability changed from Non-Friable to Friable. Material changed from GOOD to FAIR condition. No other changes as of this date.					
01/31/2020	This Material is unchanged as of this date.					
09/01/2020	This Material is unchanged as of this date.					
02/12/2021	This Material is unchanged as of this date.					
08/13/2021	This Material is unchanged as of this date.					
02/23/2022	This Material is unchanged as of this date.					
08/19/2022	This Material is unchanged as of this date.					
02/17/2023	Additional Damage Observed. <5% Physical Damage in the form of 4 SF of Peeling Paint and 10 LF of Cracks on South Wall of Building. Material remains in FAIR condition overall. No other changes as of this date.					
08/18/2023	This Material is unchanged as of this date.					
02/16/2024	This Material is unchanged as of this date.					
08/16/2024	This Material is unchanged as of this date.					
03/03/2025	This Material is unchanged as of this date.					
09/19/2025	This Material is unchanged as of this date.					

DAMAGE REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESSMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	--------------------------	----------	----------------------	---

CLASSROOMS 400-406 BUILDING (BUILDING 400)

EXTERIOR WALLS, AND OVERHANG OF RESTROOMS

ROUGH WALL SURFACING

7,200 SF

P: Less Than 5%

W: No Evidence

DAMAGED FRIABLE SURFACING ACM

09/14/2005	Skim Coat for Stucco on Exterior Walls and Restrooms Overhang. This Material is in GOOD condition as of this date.
05/14/2009	This Material has hairline cracks on various surfaces. <5% Physical Damage. Friability changed from Non-Friable to Friable. Material changed from GOOD to FAIR condition. No other changes as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.
08/19/2022	This Material is unchanged as of this date.
02/17/2023	Additional Damage Observed. <5% Physical Damage in the form of 4 SF of Peeling Paint and 10 LF of Cracks on South Wall of Building. Material remains in FAIR condition overall. No other changes as of this date.
08/18/2023	This Material is unchanged as of this date.
02/16/2024	This Material is unchanged as of this date.
08/16/2024	This Material is unchanged as of this date.
03/03/2025	This Material is unchanged as of this date.
09/19/2025	This Material is unchanged as of this date.

CLASSROOMS 400-406 BUILDING (BUILDING 400)

EXTERIOR WINDOWS

WINDOW CAULKING

900 LF

P: Less Than 5%

W: <10% Stains or Flaking

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/08/2009	Caulking on Exterior Windows. Damage: <5% Physical Damage and <10% Water Damage due to existing missing sections of material, and heat and moisture degradation factors in various locations. This Material is in FAIR condition as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.

DAMAGE REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

02/12/2021	This Material is unchanged as of this date.				
08/13/2021	This Material is unchanged as of this date.				
02/23/2022	This Material is unchanged as of this date.				
08/19/2022	This Material is unchanged as of this date.				
02/17/2023	This Material is unchanged as of this date.				
08/18/2023	This Material is unchanged as of this date.				
02/16/2024	This Material is unchanged as of this date.				
08/16/2024	This Material is unchanged as of this date.				
03/03/2025	This Material is unchanged as of this date.				
09/19/2025	This Material is unchanged as of this date.				

CLASSROOMS 400-406 BUILDING (BUILDING 400)

LIBRARY STORAGE

BASEBOARD MASTIC

50 LF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

10/20/2008	Mastic/Adhesive for 4" Brown Baseboard. This Material is in GOOD condition as of this date.				
09/15/2016	Damage observed. Damage: <5% Physical Damage - in the form of loose Baseboard in 2 locations exposing Mastic/Adhesive. Material condition changed from GOOD to FAIR overall. Friability changed from Non to Low. No other changes as of this date.				
01/31/2020	This Material is unchanged as of this date.				
09/01/2020	This Material is unchanged as of this date.				
02/12/2021	This Material is unchanged as of this date.				
08/13/2021	This Material is unchanged as of this date.				
02/23/2022	This Material is unchanged as of this date.				
08/19/2022	This Material is unchanged as of this date.				
02/17/2023	This Material is unchanged as of this date.				
08/18/2023	This Material is unchanged as of this date.				
02/16/2024	This Material is unchanged as of this date.				
08/16/2024	This Material is unchanged as of this date.				
03/03/2025	This Material is unchanged as of this date.				
09/19/2025	This Material is unchanged as of this date.				

DAMAGE REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS
			QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)

CLASSROOMS 400-406 BUILDING (BUILDING 400)

LIBRARY STORAGE

VINYL FLOOR TILE

144 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

10/20/2008	9"x9" Beige Vinyl Floor Tile. This Material is in GOOD condition as of this date.
09/15/2016	Additional Damage observed. 2 Tiles are missing exposing Mastic/Adhesive. No other changes as of this date.
04/03/2017	Material Re-assessed. Missing Tiles have been replaced however, 1 Tile is Broken with Mastic Exposed. Material remains in FAIR condition. No other changes as of this date.
08/30/2017	Additional Damage Observed. 2 Tiles are Missing Mastic Exposed. No other changes as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.
08/19/2022	This Material is unchanged as of this date.
02/17/2023	This Material is unchanged as of this date.
08/18/2023	This Material is unchanged as of this date.
02/16/2024	This Material is unchanged as of this date.
08/16/2024	This Material is unchanged as of this date.
03/03/2025	This Material is unchanged as of this date.
09/19/2025	This Material is unchanged as of this date.

CLASSROOMS 400-406 BUILDING (BUILDING 400)

LIBRARY STORAGE

VINYL FLOOR TILE MASTIC

144 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

10/20/2008	Mastic/Adhesive for 9"x9" Beige Vinyl Floor Tile. This Material is in GOOD condition as of this date.
09/15/2016	Additional Damage observed. 2 Tiles are missing exposing Mastic/Adhesive. No other changes as of this date.

DAMAGE REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME		QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
LOCATION	MATERIAL TYPE		
RISK ASSESMENT CATEGORY			
COMMENTS			
04/03/2017	Material Re-assessed. Missing Tiles have been replaced however, 1 Tile is Broken with Mastic Exposed. Material remains in FAIR condition. No other changes as of this date.		
08/30/2017	Additional Damage Observed. 2 Tiles are Missing Mastic Exposed. No other changes as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		
08/16/2024	This Material is unchanged as of this date.		
03/03/2025	This Material is unchanged as of this date.		
09/19/2025	This Material is unchanged as of this date.		

DAMAGE REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
RISK ASSESSMENT CATEGORY	COMMENTS			

CLASSROOMS 501-506 BUILDING (BUILDING 500)

CLASSROOMS 501-506 BUILDING (BUILDING 500)

CLASSROOMS 501-506 AND COMPUTER LAB

VINYL WALL COVER MASTIC

30,000 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/14/2005	Mastic/Adhesive for Vinyl Covering on 4'x8' Vinyl Covered Wall Panels. This Material is in GOOD condition as of this date.
09/18/2015	Damage observed. Center Classroom has 1/2 SF of Physical Damage. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/21/2021	Additional Damage Observed. <5% Physical Damage in the form of 1/4 SF of Missing Vinyl Wall Cover on Wall next to RSP Room. Material remains in FAIR condition overall. No other changes as of this date.
02/23/2022	This Material is unchanged as of this date.
08/19/2022	This Material is unchanged as of this date.
02/17/2023	This Material is unchanged as of this date.
08/18/2023	This Material is unchanged as of this date.
02/16/2024	This Material is unchanged as of this date.
08/16/2024	This Material is unchanged as of this date.
08/16/2024	This Material is unchanged as of this date.
03/03/2025	This Material is unchanged as of this date.
09/19/2025	This Material is unchanged as of this date.

CLASSROOMS 501-506 BUILDING (BUILDING 500)

ENTIRE BUILDING

CEMENTITIOUS WINDOW PANEL

50 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

08/29/2014	Exterior A/C Cementitious Window Panel. Replacement on lower and upper Window Panel. Only on Some areas. This Material is in GOOD condition as of this date.
09/15/2016	Damage observed. Damage: <5% Physical Damage - in the form of 1 broken Panel in Room 503. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.

DAMAGE REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME		QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
LOCATION	MATERIAL TYPE		
RISK ASSESMENT CATEGORY			
COMMENTS			

08/15/2018	Material Re-assessed. Partial Repairs made to Broken Panel in Classroom 503. Panel is Partially Covered with Plywood. No other changes as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/21/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		
08/16/2024	This Material is unchanged as of this date.		
03/03/2025	This Material is unchanged as of this date.		
09/19/2025	This Material is unchanged as of this date.		

CLASSROOMS 501-506 BUILDING (BUILDING 500)

ENTIRE BUILDING (INCLUDING RESTROOMS, STORAGE ROOMS AND UTILITY ROOMS)

SMOOTH WALL MISCELLANEOUS

38,500 SF

P: Less Than 5%

W: <10% Stains or Flaking

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/14/2005	Gypsum Wallboard System Walls and Ceilings. Material assumed to exist under 4'x8' Vinyl Covered Wall Panels. This Material is in GOOD condition as of this date.		
02/01/2010	Samples 10-019 NW-55 (Joint Tape / Compound), and NW-56 (Drywall) collected on this date.		
04/12/2012	Damage: <5% Physical Damage - in the form of approximately 1 SF of missing paint on Ceiling, and Joint Tape & Mud is exposed; <10% Water Damage - in the form of Water Damage observed at Main Entrance, between Classrooms 503 & 504. Material condition changed from GOOD to FAIR overall as of this date. No other changes as of this date.		
09/18/2015	Additional Damages observed. Center Classroom has 1/2 SF of Physical Damage, Storage Rooms between Rooms 505 and 506 have minor holes and cuts. No other changes as of this date.		
09/15/2016	Additional Damage observed. Classroom 504 has a small hole, approximately 2"x2". No other changes as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/21/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		

DAMAGE REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

08/16/2024 This Material is unchanged as of this date.

03/03/2025 This Material is unchanged as of this date.

09/19/2025 This Material is unchanged as of this date.

CLASSROOMS 501-506 BUILDING (BUILDING 500)

ENTIRE BUILDING INCLUDING RESTROOMS, STORAGE ROOMS AND UTILITY ROOMS

SMOOTH WALL SURFACING

38,500 SF

P: Less Than 5%

W: <10% Stains or Flaking

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

08/25/2006 Skim Coat for Gypsum Wallboard System Walls and Ceilings. Material Assumed to exist Under 4'X8' Vinyl Covered Wall Panels. This Material is in GOOD condition as of this date.

04/12/2012 Damage: <5% Physical Damage - in the form of approximately 1 SF of missing paint on Ceiling, and Joint Tape & Mud is exposed; <10% Water Damage - in the form of water damage observed at Main Entrance, between Classrooms 503 & 504. Material condition changed from GOOD to FAIR overall as of this date. No other changes as of this date.

09/18/2015 Additional Damages observed. Center Classroom has 1/2 SF of Physical Damage, Storage Rooms between Rooms 505 and 506 have minor holes and cuts. No other changes as of this date.

09/15/2016 Additional Damage observed. Classroom 504 has a small hole, approximately 2"x2". No other changes as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/21/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 This Material is unchanged as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

08/16/2024 This Material is unchanged as of this date.

03/03/2025 This Material is unchanged as of this date.

09/19/2025 This Material is unchanged as of this date.

DAMAGE REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

CLASSROOMS 501-506 BUILDING (BUILDING 500)

EXTERIOR WINDOWS

WINDOW CAULKING

900 LF

P: Less Than 5%

W: <10% Stains or Flaking

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/08/2009	Caulking on Exterior Windows. Damage: <5% Physical Damage and <10% Water Damage due to existing missing and damaged sections of material, and heat and moisture degradation factors in various locations. This Material is in FAIR condition as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/21/2021	Additional Damage Observed. <5% Physical Damage in the form of 3 LF of Cracks on Window of Classroom 503. Material remains in FAIR condition overall. No other changes as of this date.
02/23/2022	This Material is unchanged as of this date.
08/19/2022	This Material is unchanged as of this date.
02/17/2023	This Material is unchanged as of this date.
08/18/2023	This Material is unchanged as of this date.
02/16/2024	This Material is unchanged as of this date.
08/16/2024	This Material is unchanged as of this date.
03/03/2025	This Material is unchanged as of this date.
09/19/2025	This Material is unchanged as of this date.

DAMAGE REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESSMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	--------------------------	----------	----------------------	---

DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

CLASSROOMS

SUSPENDED CEILING TILE	2,040 SF	P: Less Than 5% W: No Evidence
------------------------	----------	-----------------------------------

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/14/2005	2'x4' Vinyl Covered Fiberglass Suspended Ceiling Tile. Tiles are White with a smooth texture on fiberglass panel. This Material is in GOOD condition as of this date. (Original Entry updated 03/19/15.)
11/09/2007	Material re-assessed. Damage: <5% Physical Damage - due to 14 Tiles with minor holes and cuts. Friability changed from Non to Friable. Material condition change from GOOD to FAIR overall.
12/01/2011	Additional Damage - in the form of several Tiles are Damaged. No other changes as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.
08/19/2022	This Material is unchanged as of this date.
02/17/2023	This Material is unchanged as of this date.
08/18/2023	This Material is unchanged as of this date.
02/16/2024	This Material is unchanged as of this date.
08/16/2024	This Material is unchanged as of this date.
03/03/2025	This Material is unchanged as of this date.
09/19/2025	This Material is unchanged as of this date.

DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

CLASSROOMS

VINYL FLOOR TILE	960 SF	P: Less Than 10% W: No Evidence
------------------	--------	------------------------------------

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/14/2005	12"x12" Pink Vinyl Floor Tile. (Material may exist under current 6"x4' Light Brown Wood Design Vinyl Plank Flooring). No other changes as of this date. This Material is in GOOD condition overall as of this date. (Original entry updated 8/19/22)
08/25/2006	Quantity changed from 1,265 SF to 960 SF. No other changes as of this date.
04/03/2017	Additional Damage Observed. 2 Broken Tiles near Restroom area. No other changes as of this date.

DAMAGE REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

01/31/2020	This Material is unchanged as of this date.					
09/01/2020	This Material is unchanged as of this date.					
02/12/2021	This Material is unchanged as of this date.					
08/13/2021	This Material is unchanged as of this date.					
02/23/2022	This Material is unchanged as of this date.					
08/19/2022	Material not observed, Material may exist under current 6"x4' Light Brown Wood Design Vinyl Plank Flooring. No other changes as of this date.					
02/17/2023	This Material is unchanged as of this date.					
08/18/2023	This Material is unchanged as of this date.					
02/16/2024	This Material is unchanged as of this date.					
08/16/2024	This Material is unchanged as of this date.					
03/03/2025	This Material is unchanged as of this date.					
09/19/2025	This Material is unchanged as of this date.					

DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

CLASSROOMS

VINYL FLOOR TILE MASTIC	960 SF	P: Less Than 10% W: No Evidence
-------------------------	--------	--

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/14/2005	Mastic/Adhesive for 12"x12" Pink Vinyl Floor Tile. (Material may exist under current 6"x4' Light Brown Wood Design Vinyl Plank Flooring). No other changes as of this date. This Material is in GOOD condition overall as of this date. (Original entry updated 8/19/22)				
08/25/2006	Material Quantity changed from 1,265 SF to 960 SF. No other changes as of this date.				
04/03/2017	Additional Damage Observed. 2 Broken Tiles near Restroom area. No other changes as of this date.				
01/31/2020	This Material is unchanged as of this date.				
09/01/2020	This Material is unchanged as of this date.				
02/12/2021	This Material is unchanged as of this date.				
08/13/2021	This Material is unchanged as of this date.				
02/23/2022	This Material is unchanged as of this date.				
08/19/2022	Material not observed, Material may exist under current 6"x4' Light Brown Wood Design Vinyl Plank Flooring. No other changes as of this date.				
02/17/2023	This Material is unchanged as of this date.				
08/18/2023	This Material is unchanged as of this date.				

DAMAGE REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

02/16/2024 This Material is unchanged as of this date.

08/16/2024 This Material is unchanged as of this date.

03/03/2025 This Material is unchanged as of this date.

09/19/2025 This Material is unchanged as of this date.

DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

CLASSROOMS, OFFICE AND STORAGE ROOM

CARPET MASTIC

150 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/14/2005 Mastic/Adhesive for Brown and Blue Carpets. (Classroom & Office - 95% Brown - ; Carpet in Storage Room - 5% Blue). This Material is in GOOD condition as of this date.

08/25/2006 Material Quantity changed from 675 SF to 1,000 SF. No other changes as of this date.

12/01/2011 Location Description changed from CLASSROOMS to CLASSROOMS, OFFICE AND STORAGE ROOM. No other changes as of this date.

03/07/2014 1 SF is Damaged. This Material is in FAIR condition. Friability changed from Non-Friable to Friable. No other changes as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08/19/2022 Location Re-Assessed. Material only observed in Storage Room, Material may exist under current Gray Black Carpet. Location Description changed from CLASSROOMS, OFFICE AND STORAGE ROOM to STORAGE ROOM. Material may exist under current Gray Black Carpet. Material Quantity changed from 1,000 SF to 150 SF. No other changes as of this date.

02/17/2023 This Material is unchanged as of this date.

08/18/2023 This Material is unchanged as of this date.

02/16/2024 This Material is unchanged as of this date.

08/16/2024 This Material is unchanged as of this date.

03/03/2025 This Material is unchanged as of this date.

09/19/2025 This Material is unchanged as of this date.

DAMAGE REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESSMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	--------------------------	----------	----------------------	---

DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

RESTROOMS (1 EA BOYS' AND GIRLS'), STAFF ROOM, AND CUSTODIAN ROOM

VINYL SHEETING

140 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/14/2005	Beige Vinyl Sheeting. This Material is in GOOD condition as of this date.
08/25/2006	Material Quantity changed from 100 SF to 140 SF. No other changes as of this date.
12/01/2011	Location Description changed from RESTROOMS (2) to RESTROOMS (1 EA- BOYS' AND GIRLS'), STAFF ROOM, AND CUSTODIAN ROOM. Damage: <5% Physical Damage - in the form of approximately 4 SF is missing in Custodian Room. Material condition changed from GOOD to FAIR overall as of this date.
04/03/2017	Additional Damage Observed. 1 SF of Cracked and Broken Flooring in Both the Boys Restroom and Girls Restroom. No other changes as fo this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.
08/19/2022	This Material is unchanged as of this date.
02/17/2023	This Material is unchanged as of this date.
08/18/2023	This Material is unchanged as of this date.
02/16/2024	This Material is unchanged as of this date.
08/16/2024	This Material is unchanged as of this date.
03/03/2025	This Material is unchanged as of this date.
09/19/2025	This Material is unchanged as of this date.

DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

RESTROOMS (1 EA BOYS' AND GIRLS'), STAFF ROOM, AND CUSTODIAN ROOM

VINYL SHEETING BACKING PAPER/MASTIC

140 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/14/2005	Backing Paper/Adhesive for Beige Vinyl Sheeting. This Material is in GOOD condition as of this date.
08/25/2006	Material Quantity changed from 100 SF to 140 SF. No other changes as of this date.

DAMAGE REPORT FOR

NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME		QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
LOCATION	MATERIAL TYPE		
RISK ASSESMENT CATEGORY			
COMMENTS			
12/01/2011	Location Description changed from RESTROOMS (2) to RESTROOMS (1 EA- BOYS' AND GIRLS'), STAFF ROOM, AND CUSTODIAN ROOM. Damage: <5% Physical Damage - in the form of approximately 4 SF is missing in Custodian Room. Material condition changed from GOOD to FAIR overall as of this date.		
04/03/2017	Additional Damage Observed. 1 SF of Cracked and Broken Flooring in Both the Boys Restroom and Girls Restroom. No other changes as fo this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08/19/2022	This Material is unchanged as of this date.		
02/17/2023	This Material is unchanged as of this date.		
08/18/2023	This Material is unchanged as of this date.		
02/16/2024	This Material is unchanged as of this date.		
08/16/2024	This Material is unchanged as of this date.		
03/03/2025	This Material is unchanged as of this date.		
09/19/2025	This Material is unchanged as of this date.		
End Of Report, Total Of 31 Pages			

Northwood Elementary School

2760 E. Trimble Road
San Jose, CA 95132
(408)923-1940

Field

802 Bldg.
3082

4/5-Vaughn

803 Bldg.
3083

Isolation

Park

Playground

Lakewood Drive

Bus Loop

NORTHWOOD ELEMENTARY SCHOOL
INSPECTED ON: 5-6-92

801 Bldg.
3081
Music-Rocco

800 Bldg.
3080
Music-Amador

900
Bldg.
1846

600
Bldg.
1943
SJB

Pre School
Playground

Parking Lot

404
3044
3-Shem

403
3043
Speech

405
3045

406
3046
Teaching Coach

400 Bldg.

Library
3135

401
3041
3-Walker

402
3042
3-Cheadle

Student Restroom

Flag

508
3058
SW-Stiggall

500 Bldg.

506
3056
1-Santa Cruz

507
3057
RSP

505
3055
K-Lam

504
3054
Watt-Reading tutor

4-Sundaram

501
3051
5-Higashi

502
3052
5-Boyd

503
3053
3/4-Kim

Student Restroom

Lunch
Tables

309
3039
Psych

300 Bldg.

301
3031
2-Orth

302
3032
1-Lee

303
3033
1-Williamson

304
3034
2-Kinney

305
3035
1/2-Huynh

306
3036
2-Shalkh

FIS

Student Restroom

PTA Room

Multi

100 Bldg.

Kitchen
3145

Nurse/CUM
3125

Principal Office
3110

Conf. Rm
3120

Front office
3101-3100

Supply room

Staff Lounge
3130

700
Bldg.
SJB Office

200 Bldg.

202
3022
K-Helfenberger

201
3021
K-Hyarger

Trimble Road

Northwood Elementary School

2760 E. Trimble Road
San Jose, CA 95132
(408)923-1940

801 Bldg.
3081
Music-Rocco

800 Bldg.
3080
Music-Amador

900
Bldg.
1846

600
Bldg.
1943
SJB

**Pre School
Playground**

Parking Lot

802 Bldg.
3082
4/5-Vaughn

Field

803 Bldg.
3083
Isolation

Park

Playground

404
3044
3-Shern
403
3043
Speech
402
3042
3-Cheadle
405
3045
406
3046
Teaching
Coach
400 Bldg.
Library
3135
401
3041
3-Walker
Student
Restroom

Student
Restroom
309
3039
Psych
300 Bldg.
306
3036
2-Shalkh
301
3031
2-Orth
FIS
302
3032
1-Lee
305
3035
1/2-Huynh
303
3033
1-Williamson
2-Kinney

Flag

Lunch
Tables

508
3058
SW-Stiggall
Student
Restroom
500 Bldg.
501
3051
5-Higashi
506
3056
1-Santa Cruz
507
3057
RSP
5-Boyd
505
3055
K-Lam
507
3059
Watt-Reading tutor
503
3053
4-Sundaram
3/4-Kim

700
Bldg.
SJB
Office

PTA
Room
Staff
Lounge
3130
Principal
Office
3110
Multi
Kitchen
3145
Conf. Rm
3120
Nurse/CUM
3125
Front office
3101-3100
Supply
room
100 Bldg.

200 Bldg.
202
3022
K-Helfenberger
201
3021
K-Hybarger

NORTHWOOD ELEMENTARY SCHOOL
INSPECTED ON: 8-3-85

Bus Loop

Lakewood Drive

Trimble Road

Northwood Elementary School

2760 E. Trimble Road
San Jose, CA 95132
(408)923-1940

802 Bldg.
3082
4/5-Vaughn

803 Bldg.
3083
Isolation

Field

Park

Playground

Lakewood Drive

900
Bldg.
1846

801 Bldg.
3081
Music-Rocco

800 Bldg.
3080
Music-Amador

404
3044
3-Shem
403
3043
Speech
402
3042
3-Cheadle
405
3045
406
3046
Teaching
Coach
401
3041
3-Walker
Library
3135
400 Bldg.

Student
Restroom

Flag

Student
Restroom

508
3058
SW-Stiggall
Student
Restroom

506
3056
1-Santa Cruz
507
3057
RSP
K-Lam
504
3054
4-Sundaram
501
3051
5-Higashi
502
3052
5-Boyd
503
3053
Wait-Reading tutor
3/4-Kim

600
Bldg.
1943
SJB

Bus Loop

309
3039
Psych
306
3036
2-Shalkh
301
3031
2-Orth
302
3032
1-Lee
305
3035
1/2-Huynh
303
3033
1-Williamson
2-Kinney
FIS
300 Bldg.

Lunch
Tables

PTA
Room
Staff
Lounge
3130
Principal
Office
3110
Multi
Kitchen
3145
Nurse/CUM
3125
Conf. Rm
3120
Front office
3101-3100
Supply
room
100 Bldg.

700
Bldg.
SJB
Office

200 Bldg.
202
3022
K-Helfenberger
201
3021
K-Hyarger

NORTHWOOD ELEMENTARY SCHOOL
INSPECTED ON: 42-91-8

Pre School
Playground

Parking Lot

Trimble Road

Northwood Elementary School

2760 E. Trimble Road
San Jose, CA 95132
(408)923-1940

Field

Park

Playground

Lakewood Drive

Bus Loop

NORTHWOOD ELEMENTARY SCHOOL
INSPECTED ON: 4-2-91-2

900
Bldg.
1846

801 Bldg.
3081
Music-Rocco

800 Bldg.
3080
Music-Amador

600
Bldg.
1943
SJB

Pre School
Playground

Parking Lot

Trimble Road

802 Bldg.
3082
4/5-Vaughn

803 Bldg.
3083
Isolation

404
3044
3-Shem
403
3043
Speech
402
3042
3-Cheadle
405
3045
400 Bldg.
Library
3135
406
3046
Teaching
Coach
401
3041
3-Walker
Student
Restroom

Flag

508
3058
SW-Stiggall
Student
Restroom
500 Bldg.
501
3051
5-Higashi
506
3056
1-Santa Cruz
507
3057
RSP
5-Boyd
505
3055
K-Lam
504
3054
Wait-Reading tutor
503
3053
4-Sundaram
3/4-Kim

Lunch
Tables

309
3039
Psych
300 Bldg.
306
3036
2-Shalkh
301
3031
2-Orth
302
3032
1-Lee
FIS
305
3035
1/2-Huynh
303
3033
1-Williamson
2-Kinney
304
3034
Student
Restroom

PTA
Room
Staff
Lounge
3130
Principal
Office
3110
Multi
Kitchen
3145
Conf. Rm
3120
Nurse/CUM
3125
Front office
3101-3100
Supply
room
100 Bldg.

700
Bldg.
SJB
Office

200 Bldg.
202
3022
K-Helfenberger
201
3021
K-Hyburger

Northwood Elementary School
2760 E. Trimble Road
San Jose, CA 95132
(408)923-1940

Field

Park

Lakewood Drive

Playground

801 Bldg.
3081
Music-Rocco

800 Bldg.
3080
Music-Amador

900
Bldg.
1846

600
Bldg.
1943
SJB

**Pre School
Playground**

Parking Lot

802 Bldg.
3082
4/5-Vaughn

803 Bldg.
3083
Isolation

404
3044
3-Shem
403
3043
Speech
402
3042
3-Cheadle
405
3045
406
3046
Teaching
Coach
401
3041
3-Walker
Library
3135
400 Bldg.
Student
Restroom

Flag

508
3058
SW-Stiggall
Student
Restroom
500 Bldg.
501
3051
5-Higashi
506
3056
1-Santa Cruz
507
3057
RSP
5-Boyd
505
3055
K-Lam
504
3054
Watt-Reading tutor
503
3053
4-Sundaram
3/4-Kim

500 Bldg.
501
3051
5-Higashi
506
3056
1-Santa Cruz
507
3057
RSP
5-Boyd
505
3055
K-Lam
504
3054
Watt-Reading tutor
503
3053
4-Sundaram
3/4-Kim

700
Bldg.
SJB
Office

PTA
Room
Multi
Supply
room
100 Bldg.
Kitchen
3145
Nurse/CUM
3125
Principal
Office
3110
Conf. Rm
3120
Front office
3101-3100

Trimble Road

Bus Loop

Student
Restroom

309
3039
Psych
300 Bldg.
306
3036
2-Shalkh
301
3031
2-Orth
FIS
302
3032
1-Lee
1/2-Huynh
305
3035
303
3033
1-Williamson
2-Kinney
304
3034

200 Bldg.

202
3022
K-Heffenberger
201
3021
K-Hybarger

NORTHWOOD ELEMENTARY SCHOOL
INSPECTED ON: 8-18-2023

Northwood Elementary School

2760 E. Trimble Road
San Jose, CA 95132
(408)923-1940

Field

802 Bldg.

3082

4/5-Vaughn

803 Bldg.

3083

Isolation

Park

Playground

Lakewood Drive

900

Bldg.
1846

801 Bldg.

3081
Music-Rocco

800 Bldg.

3080
Music-
Amador

404
3044
3-Shem

405
3045

400 Bldg.

406
3046
Teaching
Coach

401
3041
3-Walker

403
3043
Speech 402
3042
3-Cheadle

Library
3135

Student
Restroom

Flag

508
3058
SW-Siggall

500 Bldg.

501
3051
5-Higashi

506
3056
1-Santa Cruz

507
3057
RSP

505
3055
K-Lam

504
3054
Wait-Reading tutor

503
3053
4-Sundaram

502
3052
5-Boyd

507
3059

Student
Restroom

3/4-Kim

600

Bldg.
1943

SJB

Bus Loop

309
3039
Psych

300 Bldg.

301
3031
2-Orth

306
3036
2-Shaikh

FIS

302
3032
1-Lee

305
3035
1/2-Huynh

303
3033
1-Williamson

304
3034
2-Kinney

Student
Restroom

Lunch

Tables

PTA
Room

Multi

100 Bldg.

Supply
room

Staff
Lounge
3130

Kitchen
3145

Nurse/CUM
3125

Principal
Office
3110

Conf. Rm
3120

Front office
3101-3100

700

Bldg.

SJB
Office

200 Bldg.

201

3021

202

3022

K-Helfenberger K-Hyarger

NORTHWOOD ELEMENTARY SCHOOL
INSPECTED ON: 2/13/23

Pre School
Playground

Parking Lot

Trimble Road

Northwood Elementary School

2760 E. Trimble Road
San Jose, CA 95132
(408) 923-1940

Field

Park

Playground

Lakewood Drive

Bus Loop

NORTHWOOD ELEMENTARY SCHOOL
INSPECTED ON: 08-19-2022

801 Bldg.
3081

900 Bldg.
Federal
Pre-School
1846
1846

800 Bldg.
3080

Flag

509 3059
506 3056
507 3057
505 3055
504 3054
501 3051
502 3052
503 3053

Middle
Quad
Patio

301 3031
302 3032
303 3033
304 3034
305 3035
306 3036
307 3038
316 (Speech)
3039

700 Bldg.
State Pre-school
1944

Playground

100 Bldg.
Lounge 3130
Multipurpose Room
Conference Room
Nurse 3125
Front Office 3100 & 3101

202 3022
201 3021
200 Bldg.

Parking Lot

Trimble Road

Northwood Elementary School

2760 E. Trimble Road
San Jose, CA 95132
(408)923-1940

801 Bldg.
3081
Music-Rocco

800 Bldg.
3080
Music-Amador

900
Bldg.
1846

600
Bldg.
1943
SJB

**Pre School
Playground**

700
Bldg.
SJB
Office

Parking Lot

Field

802 Bldg.
3082
4/5-Vaughn

803 Bldg.
3083
Isolation

Park

Playground

404
3044
3-Shem

405
3045

406
3046
Teaching
Coach

400 Bldg.

Library
3135

401
3041
3-Walker

403
3043
Speech 402
3042
3-Cheadle

Student
Restroom

Flag

508
3058
SW-Stiggall

500 Bldg.

501
3051
5-Higashi

506
3056
1-Santa Cruz

507
3057
RSP
K-Lam

505
3055
5-Boyd

502
3052
5-Boyd

504
3054
Walt-Reading tutor
4-Sundaram

503
3053
3/4-Kim

Student
Restroom

Lunch
Tables

Bus Loop

Student
Restroom

309
3039
Psych

300 Bldg.

301
3031
2-Orth

302
3032
1-Lee

303
3033
1-Williamson

304
3034
2-Kinney

305
3035
1/2-Huynh

306
3036
2-Shaikh

FIS

PTA
Room

Multi

Supply
room

100 Bldg.

Staff
Lounge
3130

Kitchen
3145

Nurse/CUM
3125

Principal
Office
3110

Conf. Rm
3120

Front office
3101-3100

Trimble Road

NORTHWOOD ELEMENTARY SCHOOL
INSPECTED ON: 08-19-2022

200 Bldg.

202
3022
K-Helfenberger

201
3021
K-Hybarger

Northwood Elementary School 2760 E. Trimble Road San Jose, CA 95132 (408) 923-1940

Field








Park

Playground



Lakewood Drive

Bus Loop

NORTHWOOD ELEMENTARY SCHOOL
 INSPECTED ON: 2202-32-2022

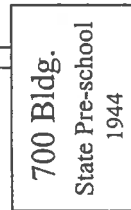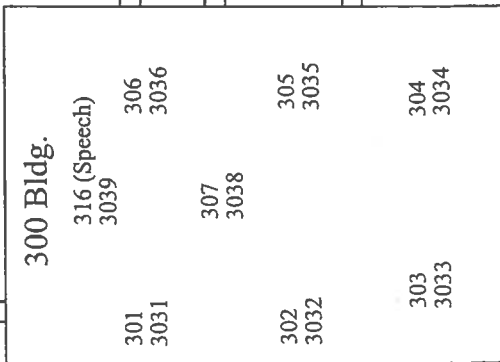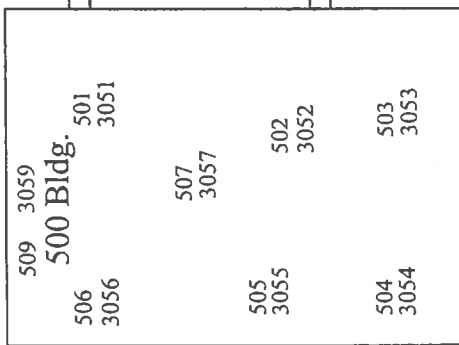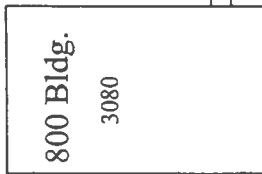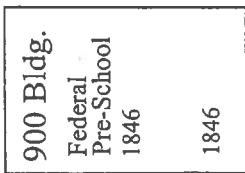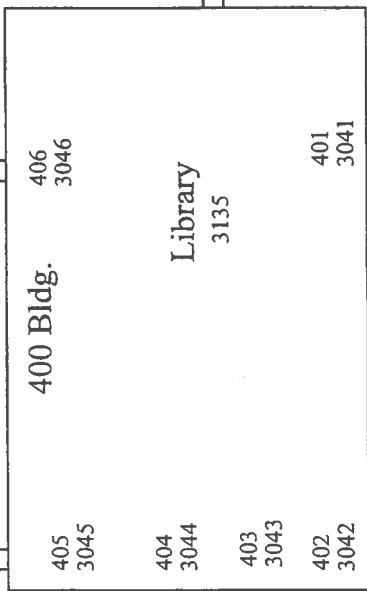

Playground

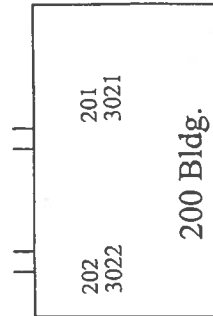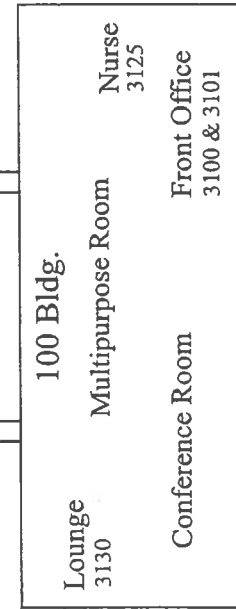

Parking Lot

Trimble Road

Northwood Elementary School

2760 E. Trimble Road
San Jose, CA 95132
(408) 923-1940

Field












Park

Playground

Lakewood Drive

Bus Loop

NORTHWOOD ELEMENTARY SCHOOL
INSPECTED ON: 12/31/8

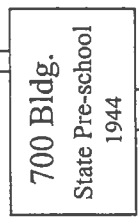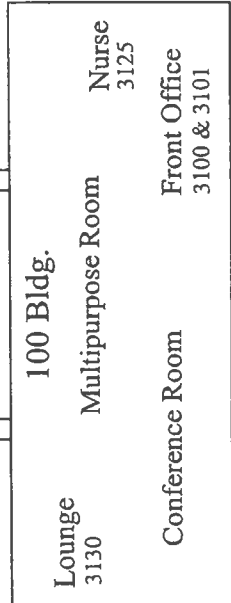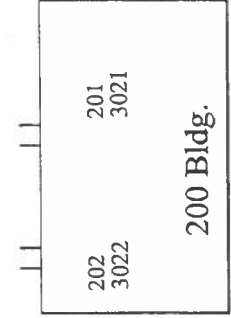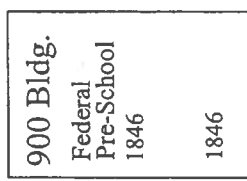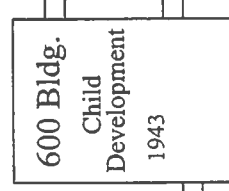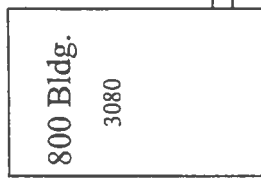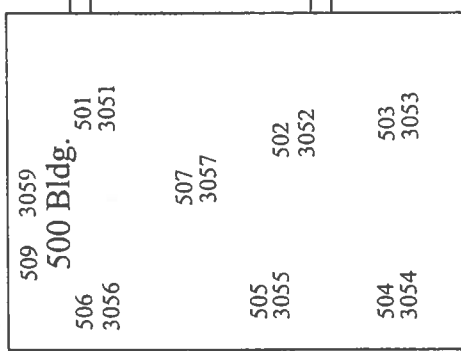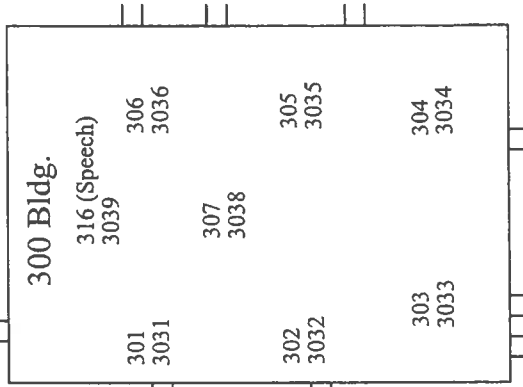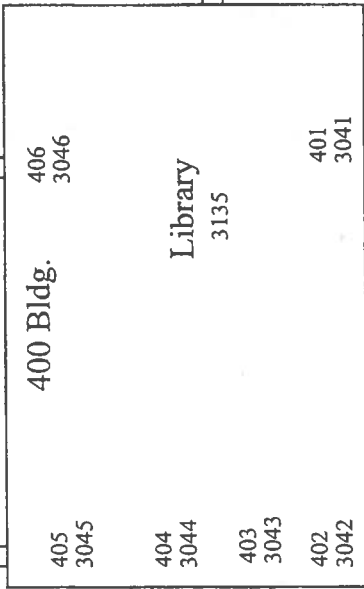

Playground

Parking Lot

Trimble Road

Northwood Elementary School
 2760 E. Trimble Road
 San Jose, CA 95132
 (408) 923-1940

Field












Park

Playground

Lakewood Drive

Bus Loop

NORTHWOOD ELEMENTARY SCHOOL
 INSPECTED ON 1/2/21

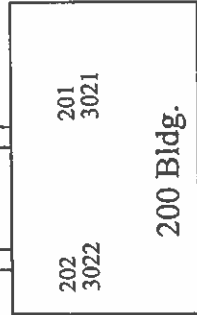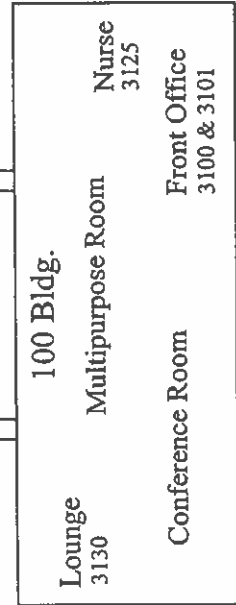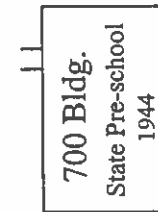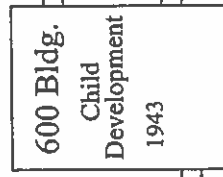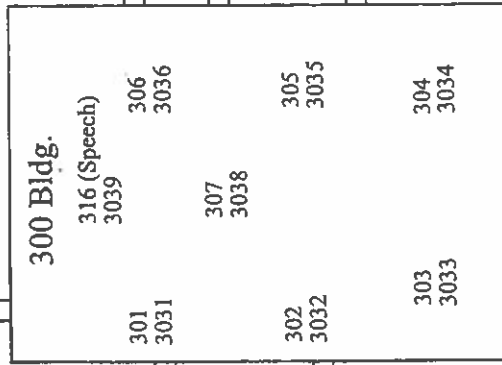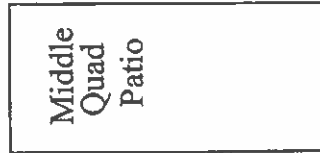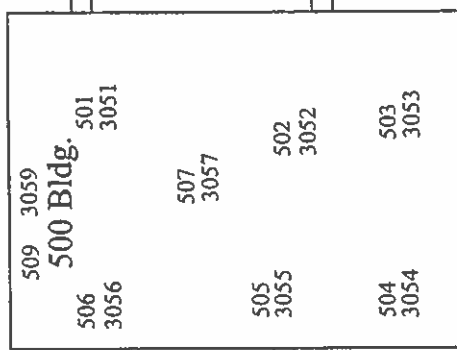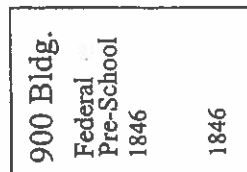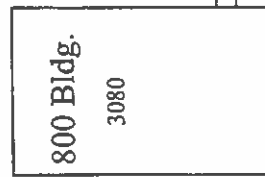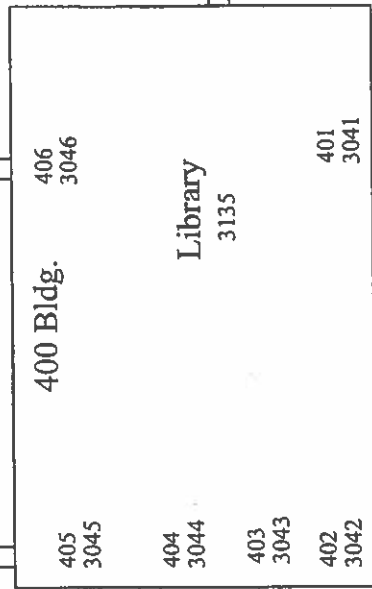

Playground

Parking Lot

Trimble Road

Northwood Elementary School

2760 E. Trimble Road

San Jose, CA 95132

(408) 923-1940

Field










Park

Playground



Lakewood Drive

Bus Loop

NORTHWOOD ELEMENTARY SCHOOL
INSPECTED ON: 02/11/99

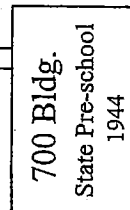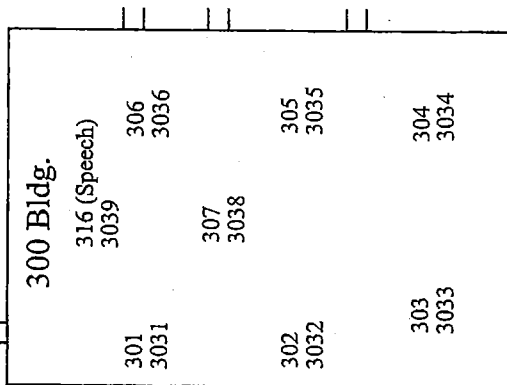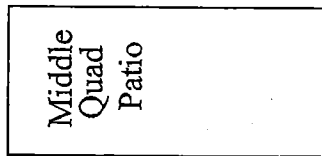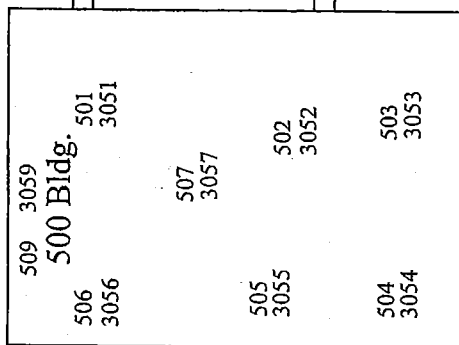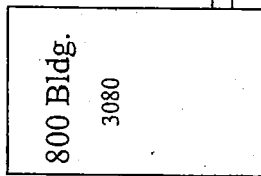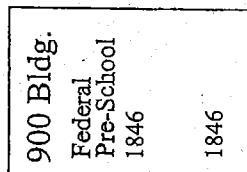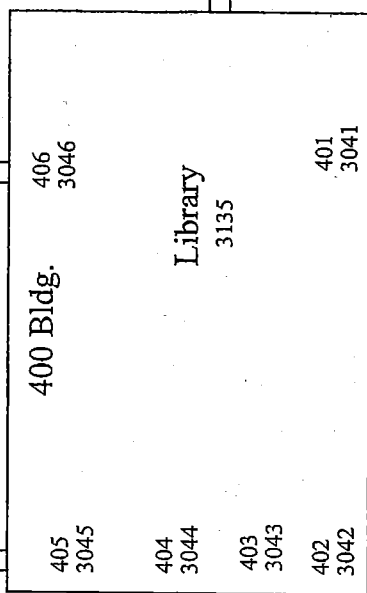

Playground

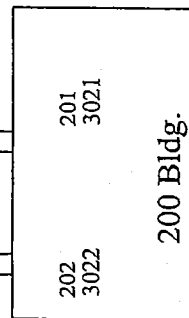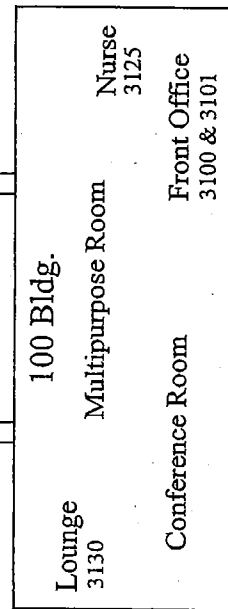

Parking Lot

Trimble Road

Northwood Elementary School

2760 E. Trimble Road
San Jose, CA 95132
(408) 923-1940

Field







Park

Playground






Lakewood Drive

Bus Loop

NORTHWOOD ELEMENTARY SCHOOL
INSPECTED ON: 1-31-2020

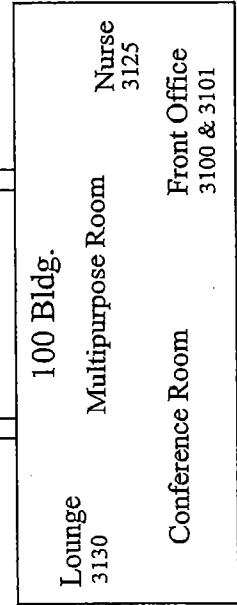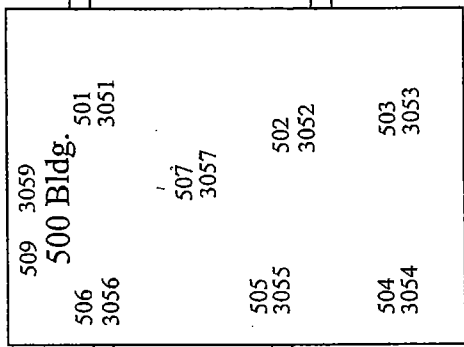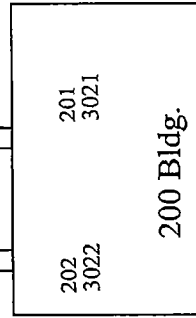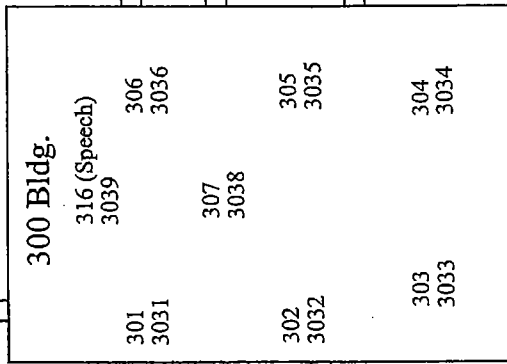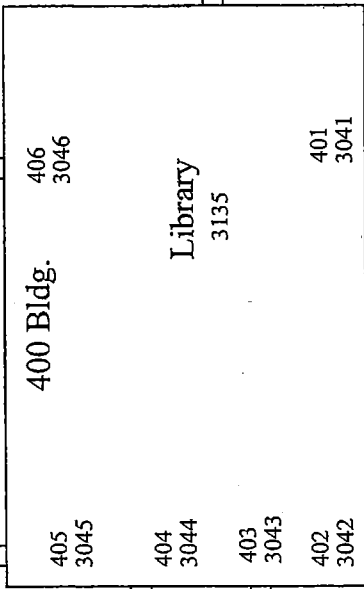

Trimble Road

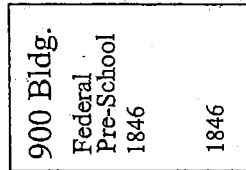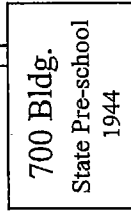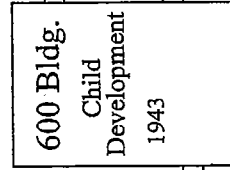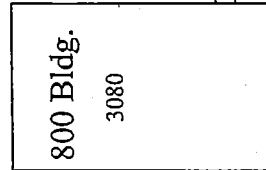

Playground

Parking Lot

Northwood Elementary School
 2760 E. Trimble Road
 San Jose, CA 95132
 (408) 923-1940

Field












Park

Playground

Lakewood Drive

Bus Loop

NORTHWOOD ELEMENTARY SCHOOL
 INSPECTED ON: 5/13/78

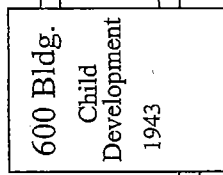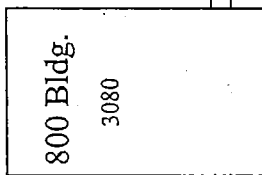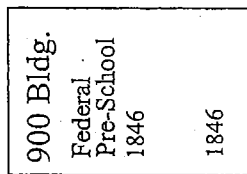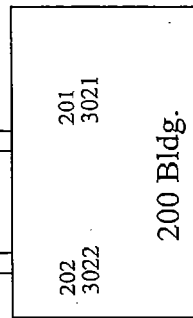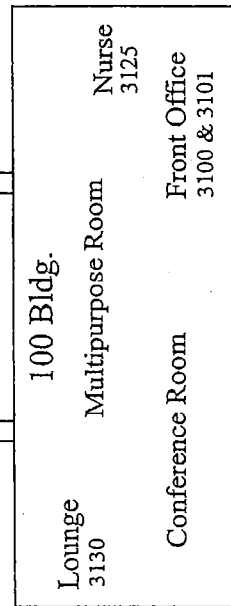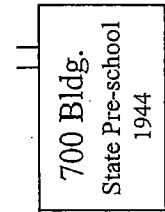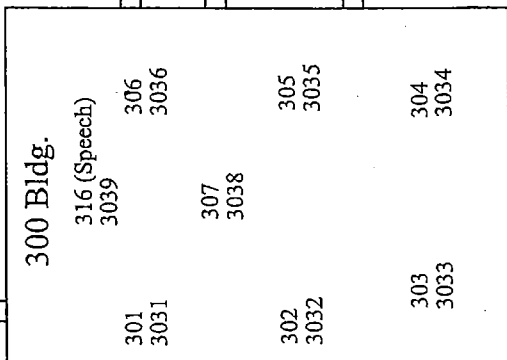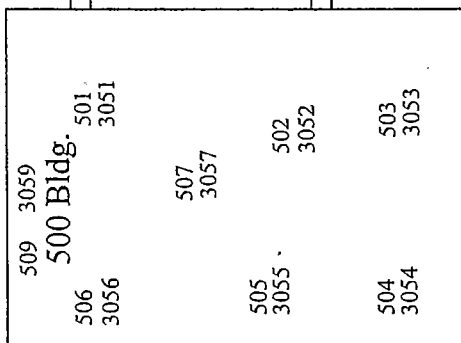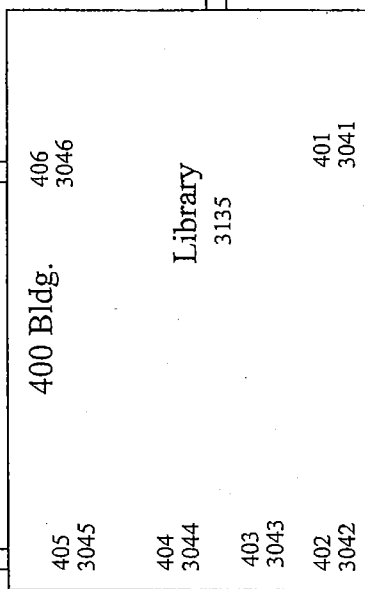

Playground

Parking Lot

Trimble Road

Northwood Elementary School

2760 E. Trimble Road
San Jose, CA 95132
(408) 923-1940

Field













Park

Playground

Lakewood Drive

Bus Loop

NORTHWOOD ELEMENTARY SCHOOL
INSPECTED ON: 6/02-8-02-2019

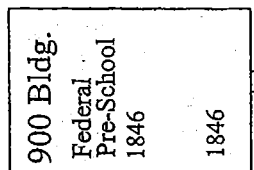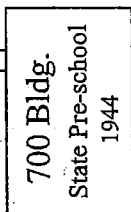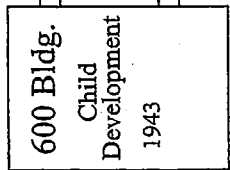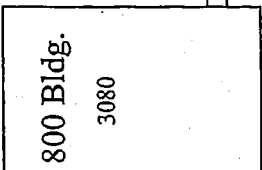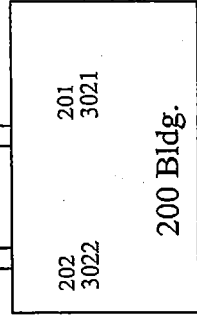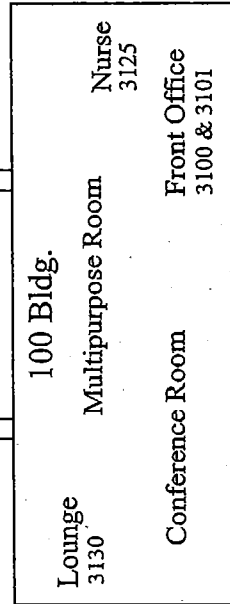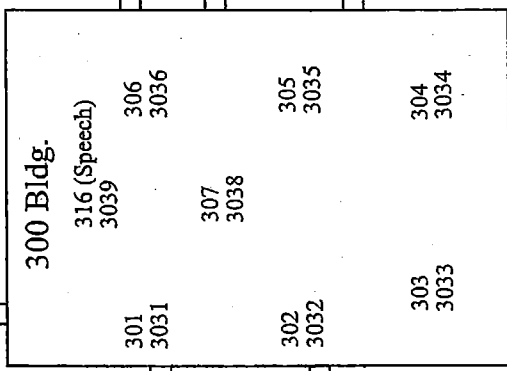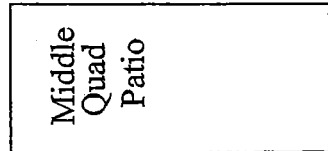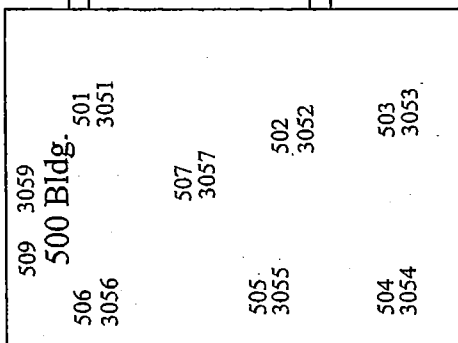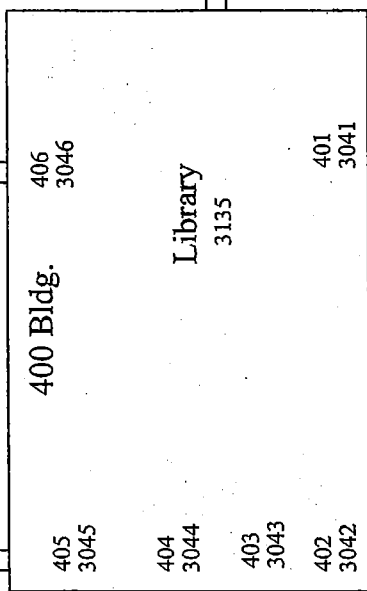

Playground

Parking Lot

Trimble Road

Northwood Elementary School
 2760 E. Trimble Road
 San Jose, CA 95132
 (408) 923-1940

Field

Park

Playground

Lakewood Drive

Bus Loop

NORTHWOOD ELEMENTARY SCHOOL
 INSPECTED ON: 8/15/18

400 Bldg.

405 3045 406 3046

404 3044 403 3043 402 3042

Library 3135

401 3041

Flag

300 Bldg.

301 3031 302 3032 303 3033

316 (Speech) 3039 306 3036 307 3038 305 3035 304 3034

Middle Quad Patio

500 Bldg.

509 3059 506 3056 507 3057 505 3055 504 3054 501 3051 502 3052 503 3053

801 Bldg.

3081

800 Bldg.

3080

600 Bldg.

Child Development 1943

900 Bldg.

Federal Pre-School 1846 1846

200 Bldg.

202 3022 201 3021

100 Bldg.

Lounge 3130 Multipurpose Room 3125 Nurse 3125 Conference Room 3100 & 3101 Front Office

700 Bldg.

State Pre-school 1944

Playground

Parking Lot

Trimble Road

Northwood Elementary School

2760 E. Trimble Road
San Jose, CA 95132
(408) 923-1940

Field







Park

Playground







Lakewood Drive

Bus Loop

NORTHWOOD ELEMENTARY SCHOOL
INSPECTED ON: 8/16/18

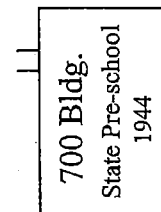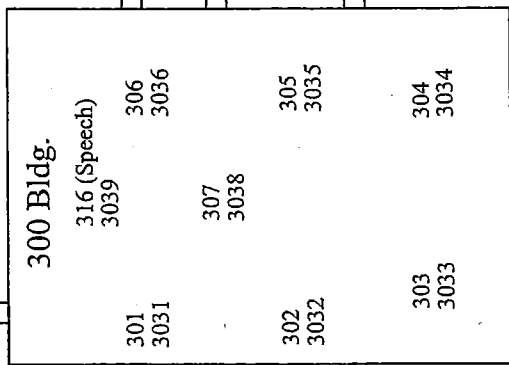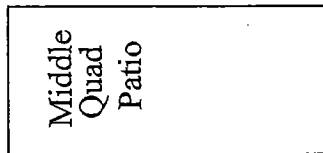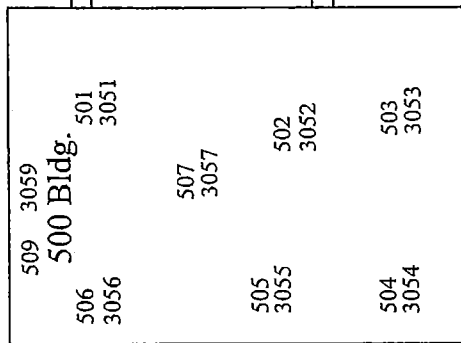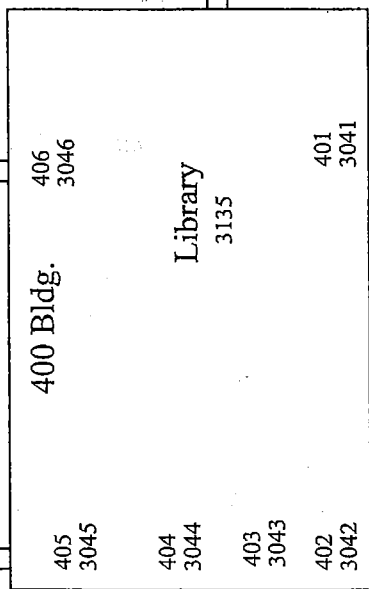

Playground

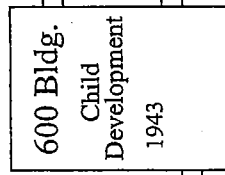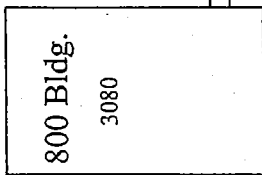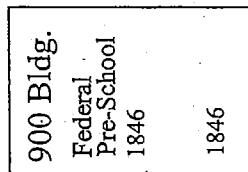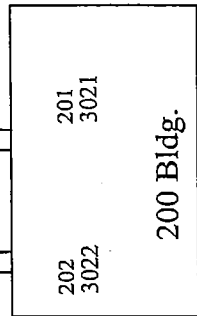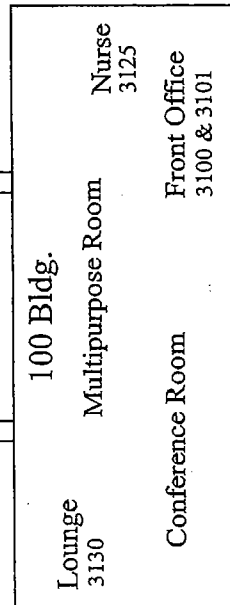

Parking Lot

Trimble Road

Northwood Elementary School

2760 E. Trimble Road
San Jose, CA 95132
(408) 923-1940

Field

Park

Playground

801 Bldg.
3081

900 Bldg.
Federal
Pre-School
1846
1846

800 Bldg.
3080

Flag

509 3059
500 Bldg. 501 3051
506 3056
507 3057
502 3052
505 3055
504 3054
503 3053

Middle
Quad
Patio

300 Bldg.
316 (Speech) 3039
306 3036
307 3038
305 3035
304 3034
303 3033
302 3032
301 3031

Bus Loop

NORTHWOOD ELEMENTARY SCHOOL
INSPECTED ON: 8/10/81

600 Bldg.
Child
Development
1943

700 Bldg.
State Pre-school
1944

Playground

100 Bldg.
Lounge 3130
Multipurpose Room
Nurse 3125
Conference Room
Front Office 3100 & 3101

200 Bldg.
202 3022
201 3021

Parking Lot

Trimble Road

Lakewood Drive

Northwood Elementary School
 2760 E. Trimble Road
 San Jose, CA 95132
 (408) 923-1940

Field












Park

Playground

Lakewood Drive

Bus Loop

NORTHWOOD ELEMENTARY SCHOOL
 INSPECTED ON: 4/3/17

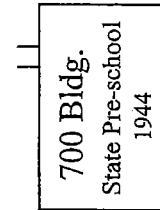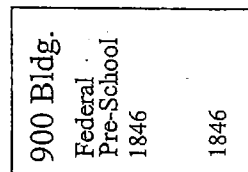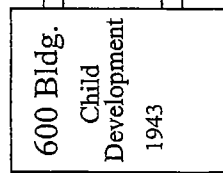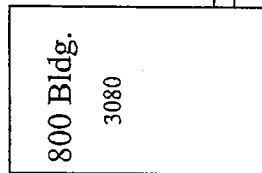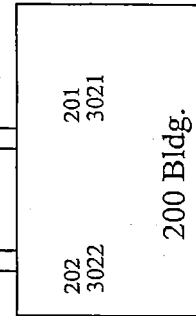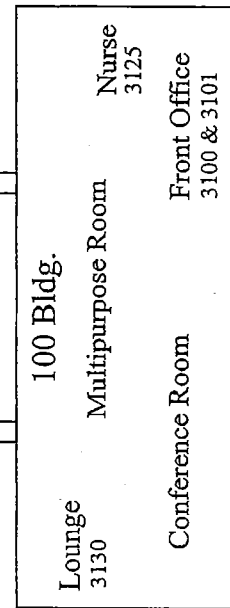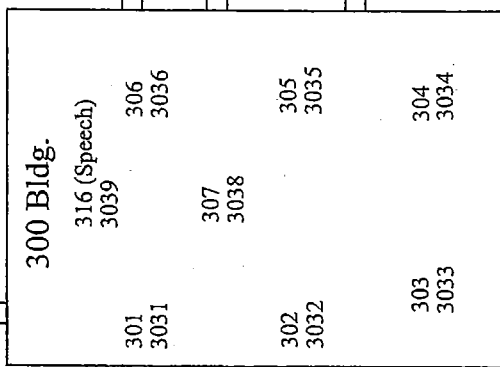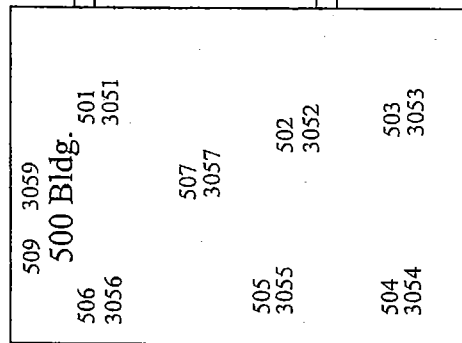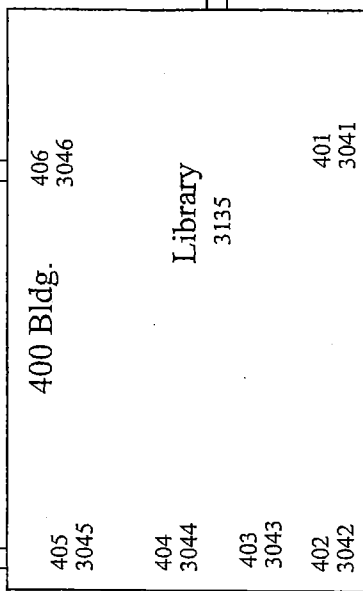

Playground

Parking Lot

Trimble Road

Northwood Elementary School
 2760 E. Trimble Road
 San Jose, CA 95132
 (408) 923-1940

Field

Park

Playground

801 Bldg.
3081

900 Bldg.
Federal
Pre-School
1846
1846

800 Bldg.
3080

Flag

509 3059
500 Bldg. 501 3051
506 3056
507 3057
505 3055
502 3052
503 3053
504 3054

Middle
Quad
Patio

300 Bldg.
316 (Speech)
3039
301 3031
307 3038
305 3035
302 3032
303 3033
306 3036
304 3034

600 Bldg.
Child
Development
1943

700 Bldg.
State Pre-school
1944

Playground

100 Bldg.
Lounge 3130
Multipurpose Room
Nurse 3125
Conference Room
Front Office 3100 & 3101

200 Bldg.
201 3021
202 3022

Parking Lot

Trimble Road

Lakewood Drive

Bus Loop

NORTHWOOD ELEMENTARY SCHOOL
 INSPECTED ON: 9/15/16

Northwood Elementary School

2760 E. Trimble Road
San Jose, CA 95132
(408) 923-1940

Field












Park

Playground

Lakewood Drive

Bus Loop

NORTHWOOD ELEMENTARY SCHOOL
INSPECTED ON: 9/02-12-30

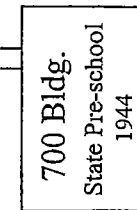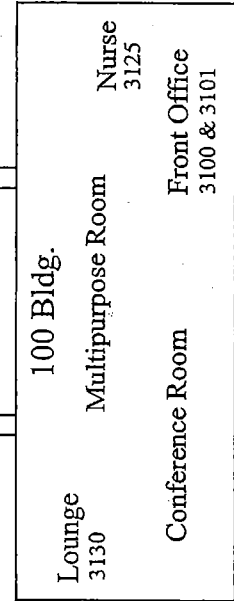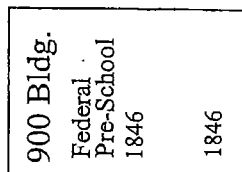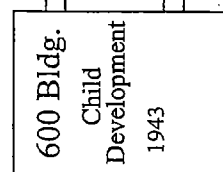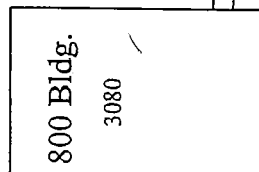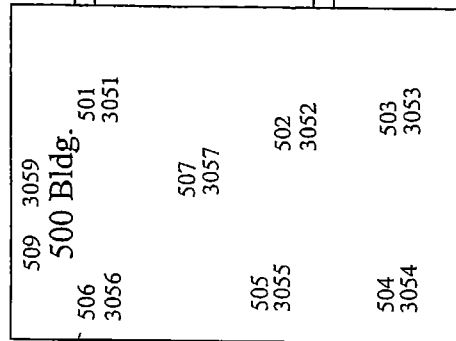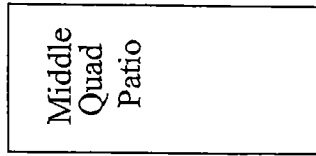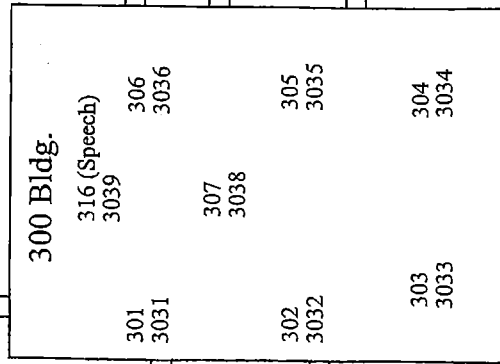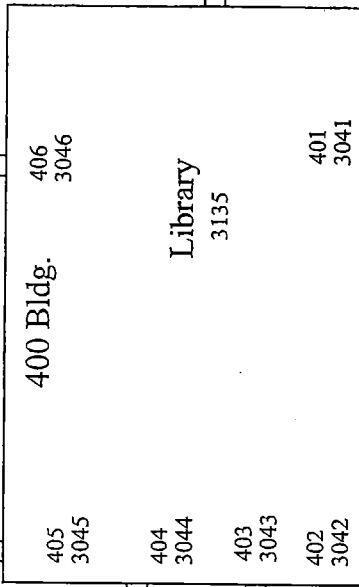

Playground

Parking Lot

Trimble Road

Northwood Elementary School 2760 E. Trimble Road San Jose, CA 95132 (408) 923-1940

Field













Park

Playground

Lakewood Drive

Bus Loop

NORTHWOOD ELEMENTARY SCHOOL
 INSPECTED ON: 9-18-15

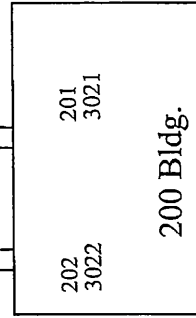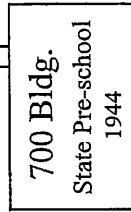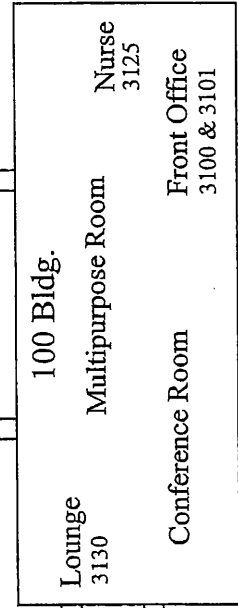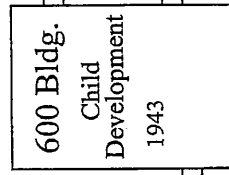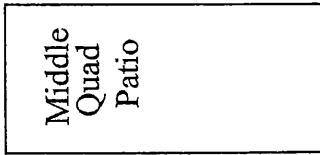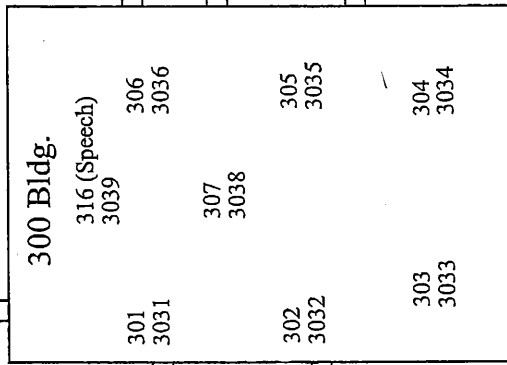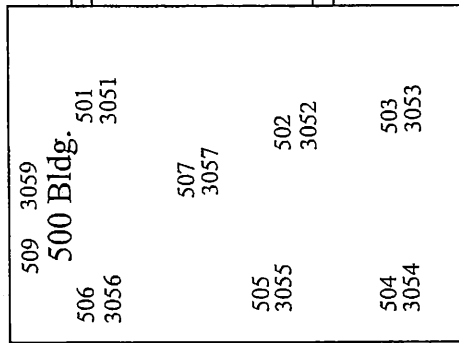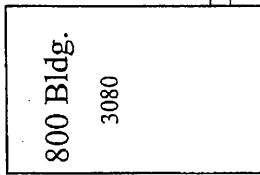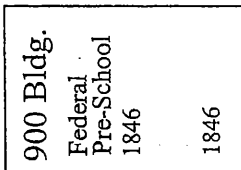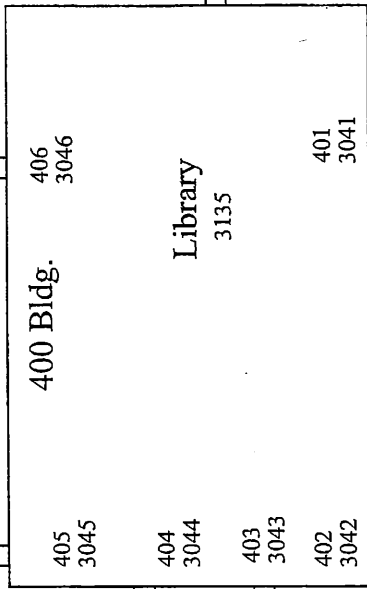

Playground

Parking Lot

Trimble Road

Northwood Elementary School 2760 E. Trimble Road San Jose, CA 95132 (408) 923-1940

Field













Park

Playground

Lakewood Drive

Bus Loop

NORTHWOOD ELEMENTARY SCHOOL
 INSPECTED ON: 03-19-2015

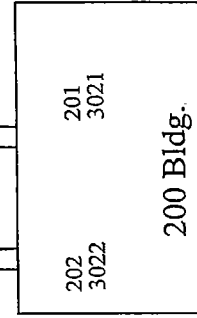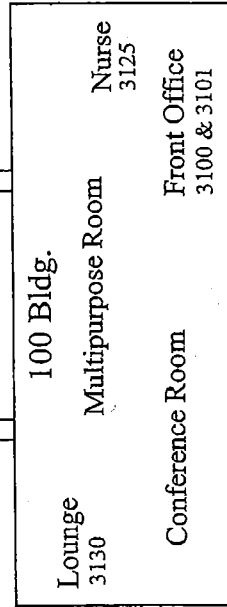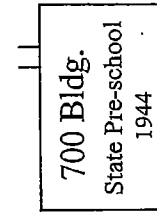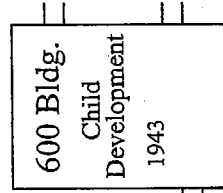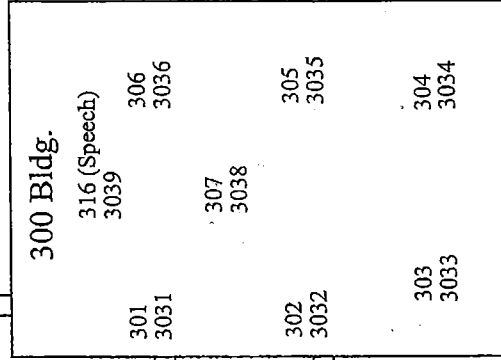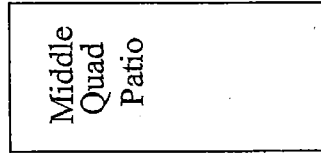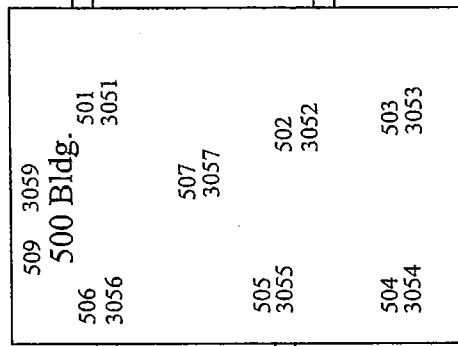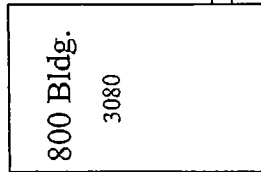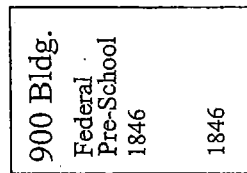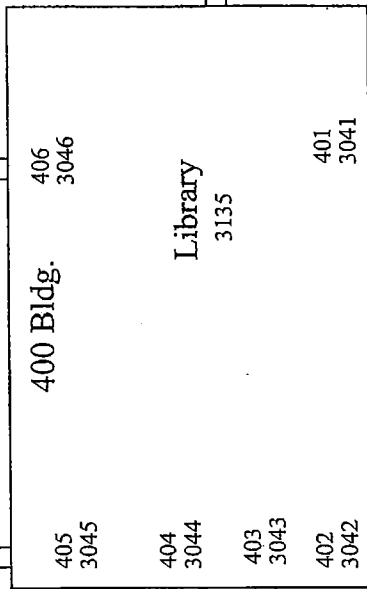

Trimble Road

Parking Lot

Northwood SCHOOL **2760 E. Trimble Road** **San Jose, CA 95132** **(408) 923-1940**

Metal Container

801 Bldg.
Carabal (3)

900 Bldg.

Federal
Pre-School
Winquist,
Radford,
Bala

800 Bldg.

Tanaka (2)

509 Athwal (1)

500 Bldg.

506 Brown (SDC)
Boyd (4)
middle 507

501 Wong (4/5)

220
295

505 Serochi (SDC)

502 Burroughs(5)

504 Kramer(5)

503 Lyle(4)

600 Bldg.

Child
Development

Playground

Metal Containers

700 Bldg.

State Preschool
Wilburn (Pre)

100 Bldg.

Lounge

Multipurpose Room

Conference Room

Front Office

Nurse

Flag

MIDDLE
QUAD
PATIO

300 Bldg.

316 (Speech)

301 Orth (2/3)

306 Fujikawa(1)

307 RSP (middle) - Yee

305 Evans/Lewis(2)

302 Lui (1)

304 Kinney (2)

303 Brum (K)

Bus Loop

Playground

200 Bldg.

202 LaTendresse (K)
201 Green (K)

Parking Lot

Park

Field

Playground

Library (middle 400)

406 Williamson(1)

405 Heiss (1/2)

404 Helfenberger (K)

403 Lewis-Cook (3)

402 Cheadle II (3)

401 Stinson (3)

Wood Shed

NORTHWOOD ELEMENTARY SCHOOL
 INSPECTED ON: 08-29-2014

NORTHWOOD ELEMENTARY SCHOOL
INSPECTED ON: 3-7-14

Bus Loop

Playground

Park

Playground

Field

Wood Shed

400 Bldg.


405 Heiss (1/2) 406 Williamson(1)

404 Helfenberger (K)

403 Lewis-Cook (3) 401 Stinson (3)

402 Cheadle II (3)

Library (middle 400)



300 Bldg.

316 (Speech)

301 Orth (2/3) 306 Fujikawa(1)

307 RSP (middle) - Yee

302 Lui (1) 305 Evans/Lewis(2)

303 Brum (K) 304 Kinney (2)

MIDDLE
QUAD
PATIO

509 Athwal (1)

500 Bldg.

501 Wong (4/5)

506 Brown (SDC) 502 Burroughs(5)

Boyd (4) middle 507

505 Serochi (SDC) 503 Lyle(4)

504 Kramer(5)

100 Bldg.

Lounge Multipurpose Room

Conference Room Front Office

Nurse

700 Bldg.

State Preschool
Wilburn (Pre)

Playground

Metal Containers



Parking Lot

Northwood SCHOOL
2760 E. Trimble Road
San Jose, CA 95132
(408) 923-1940

Metal Container



801 Bldg.

Carabal (3)

800 Bldg.

Tanaka (2)

900 Bldg.

Federal
Pre-School
Winquist,
Radford,
Bala

wood
Screen

600 Bldg.

Child
Development

NORTHWOOD ELEMENTARY SCHOOL
INSPECTED ON: 09-26-2013

Bus Loop

Playground

Park

Field

Playground

Northwood SCHOOL
2760 E. Trimble Road
San Jose, CA 95132
(408) 923-1940

Metal Container

801 Bldg.
Carabal (3)

800 Bldg.
Tanaka (2)

900 Bldg.
Federal
Pre-School
Winquist,
Radford,
Bala

600 Bldg.
Child
Development

Playground

Metal Containers

700 Bldg.
State Preschool
Wilburn (Pre)

Parking Lot

Wood Shed

405 Heiss (1/2)
404 Helfenberger (K)
403 Lewis-Cook (3)
402 Cheadle II (3)

Library (middle 400)

401 Stinson (3)



509 Athwal (1)
506 Brown (SDC)
505 Serochi (SDC)
504 Kramer(5)
501 Wong (4/5)
Boyd (4) middle 507
502 Burroughs(5)
503 Lyle(4)

500 Bldg.

MIDDLE
QUAD
PATIO

301 Orth (2/3)
302 Lui (1)
303 Brum (K)
306 Fujikawa(1)
307 RSP (middle) - Yee
305 Evans/Lewis(2)
304 Kinney (2)
316 (Speech)

300 Bldg.

100 Bldg.

Lounge
Multipurpose Room
Nurse
Conference Room
Front Office

202 LaTendresse (K)
201 Green (K)

200 Bldg.

NORTHWOOD ELEMENTARY SCHOOL
INSPECTED ON: 4/05/13

Bus Loop

Playground

Park

Field

Wood Shed

Playground

405 Heiss (1/2)

406 Williamson(1)

404 Helfenberger (K)

403 Lewis-Cook (3)

402 Cheadle II (3)

401 Stinson (3)

Library (middle 400)

Metal Container

801 Bldg.

Carabal (3)

900 Bldg.

Federal Pre-School
Winquist,
Radford,
Bala

800 Bldg.

Tanaka (2)

509 Athwal (1)

501 Wong (4/5)

506 Brown (SDC)

Boyd (4)
middle 507

505 Serochi (SDC)

502 Burroughs(5)

504 Kramer(5)

503 Lyle(4)

500 Bldg.

Flag

MIDDLE
QUAD
PATIO

301 Orth (2/3)

306 Fujikawa(1)

307 RSP (middle) - Yee

302 Lui (1)

305 Evans/Lewis(2)

303 Brum (K)

304 Kinney (2)

300 Bldg.

600 Bldg.

Child Development

700 Bldg.

State Preschool
Wilburn (Pre)

Lounge

Multipurpose Room

Conference Room

Nurse

Front Office

100 Bldg.

202 LaTendresse (K)

201 Green (K)

200 Bldg.

Playground

Metal Containers

Parking Lot

NORTHWOOD ELEMENTARY SCHOOL
INSPECTED ON: 10-11-12








Bus Loop

Playground

Park




Field

Playground

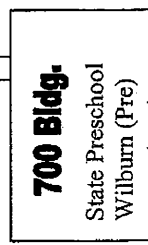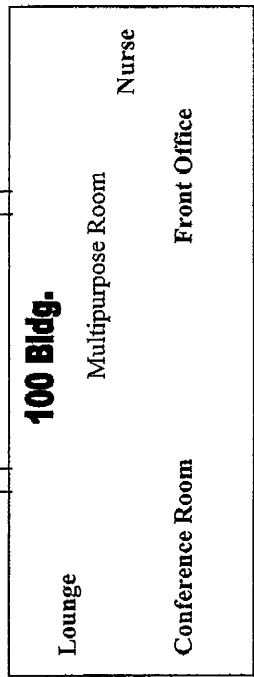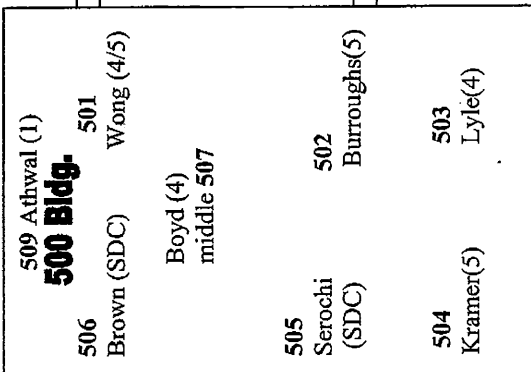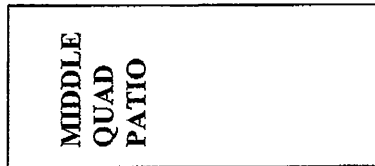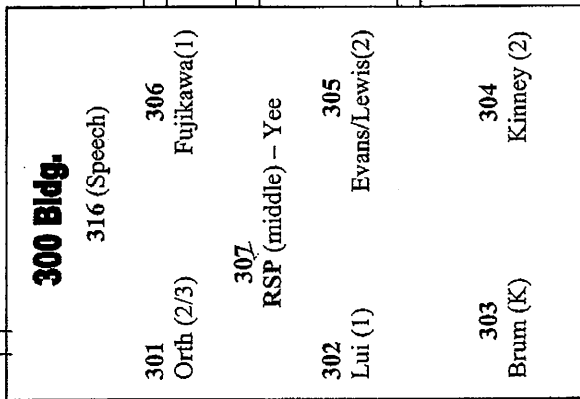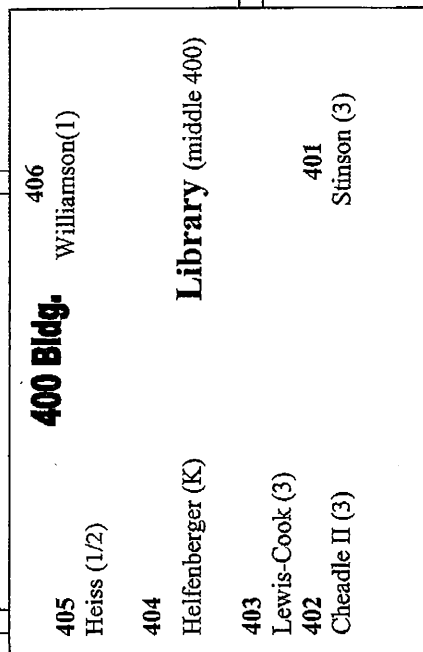

Northwood SCHOOL
2760 E. Trimble Road
San Jose, CA 95132
(408) 923-1940

Metal Container

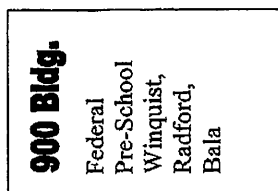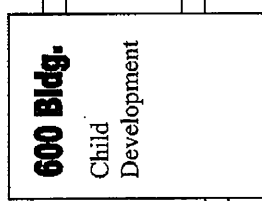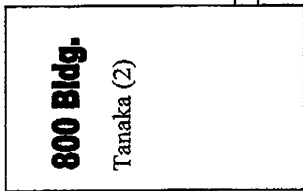

Playground

Metal Containers

Parking Lot

200 Bldg.

202 LaTendresse (K)

201 Green (K)

Northwood SCHOOL
2760 E. Trimble Road
San Jose, CA 95132
(408) 923-1940

NORTHWOOD ELEMENTARY SCHOOL
INSPECTED ON: 04-12-12

Field

Park

Playground

400 Bldg.

405 Heiss (1/2)
404 Helfenberger (K)
403 Lewis-Cook (3)
402 Cheadle II (3)

406 Williamson(1)
Library (middle 400)
401 Stinson (3)

Wood Shed

Metal Container

801 Bldg.
Carabal (3)

900 Bldg.
Federal
Pre-School
Winquist,
Radford,
Bala

800 Bldg.
Tanaka (2)

500 Bldg.

509 Athwal (1)
501 Wong (4/5)
506 Brown (SDC)
Boyd (4)
middle 507

505 Serochi (SDC)
502 Burroughs(5)
503 Lyle(4)
504 Kramer(5)



MIDDLE
QUAD
PATIO

300 Bldg.

316 (Speech)
306 Fujikawa(1)
307 RSP (middle) - Yee
305 Evans/Lewis(2)
304 Kinney (2)
303 Brum (K)
302 Lui (1)
301 Orth (2/3)

Bus Loop

Playground

Metal Containers

700 Bldg.
State Preschool
Wilburn (Pre)

100 Bldg.

Lounge
Conference Room
Multipurpose Room
Nurse
Front Office

200 Bldg.

202 LaTendresse (K)
201 Green (K)

Playground

Parking Lot

Northwood SCHOOL

2760 E. Trimble Road
San Jose, CA 95132
(408) 923-1940

NORTHWOOD ELEMENTARY SCHOOL
INSPECTED ON: 12-1-11

Field

Park

Metal Container

Playground

Bus Loop

Playground

Parking Lot

801 Bldg.
Carabal (3)

900 Bldg.
Federal
Pre-School
Winquist,
Radford,
Bala

800 Bldg.
Tanaka (2)

500 Bldg.
509 Athwal (1)
506 Brown (SDC)
501 Wong (4/5)
Boyd (4)
middle 507
502 Burroughs(5)
503 Lyle(4)
505 Serochi (SDC)
504 Kramer(5)

Flag

MIDDLE
QUAD
PATIO

300 Bldg.
316 (Speech)
301 Orth (2/3)
306 Fujikawa(1)
307 RSP (middle) - Yee
305 Evans/Lewis(2)
302 Lui (1)
303 Brum (K)
304 Kinney (2)

Playground

Metal Containers

700 Bldg.
State Preschool
Wilburn (Pre)

100 Bldg.

Lounge
Multipurpose Room
Nurse
Conference Room
Front Office

200 Bldg.

202 LaTendresse (K)
201 Green (K)

Northwood SCHOOL
2760 E. Trimble Road
San Jose, CA 95132
(408) 923-1940

NORTHWOOD ELEMENTARY SCHOOL
INSPECTED ON: 9/2-3/10

Field

Park

Playground


405 Heiss (1/2)
404 Helfenberger (K)
403 Lewis-Cook (3)
402 Cheadle II (3)
406 Williamson(1)
Library (middle 400)
401 Stinson (3)

801 Bldg.
Carabal (3)

900 Bldg.
Federal
Pre-School
Winquist,
Radford,
Bala

800 Bldg.
Tanaka (2)

509 Athwal (1)
500 Bldg.
506 Brown (SDC)
Boyd (4)
middle 507
505 Serochi (SDC)
502 Burroughs(5)
503 Lyle(4)
504 Kramer(5)



MIDDLE
QUAD
PATIO

300 Bldg.
301 Orth (2/3)
306 Fujikawa(1)
307 RSP (middle) - Yee
302 Lui (1)
305 Evans/Lewis(2)
303 Brum (K)
304 Kinney (2)

Bus Loop

Drop

Playground

700 Bldg.
State Preschool
Wilburn (Pre)

100 Bldg.
Lounge
Multipurpose Room
Nurse
Conference Room
Front Office

200 Bldg.
202 LaTendresse (K)
201 Green (K)

W 3 1/2

Parking Lot

Northwood SCHOOL
2760 E. Trimble Road
San Jose, CA 95132
(408) 923-1940

Field

Park

NORTHWOOD ELEMENTARY SCHOOL
 INSPECTED ON: 3/11/10

Playground

400 Bldg.

405 Heiss (1/2) 406 Williamson(1)

404 Helfenberger (K)

403 Lewis-Cook (3)

402 Cheadle II (3)

401 Stinson (3)

Library (middle 400)

801 Bldg.
 Carabal (3)

900 Bldg.
 Federal
 Pre-School
 Winquist,
 Radford,
 Bala

800 Bldg.
 Tanaka (2)

500 Bldg.

509 Athwal (1)

506 Brown (SDC)

505 Serochi (SDC)


504 Kramer(5)

501 Wong (4/5)

Boyd (4)
 middle 507

502 Burroughs(5)

503 Lyle(4)



**MIDDLE
 QUAD
 PATIO**

300 Bldg.

316 (Speech)

301 Orth (2/3)

307 RSP (middle) - Yee

302 Lui (1)

305 Evans/Lewis(2)

304 Kinney (2)

303 Brum (K)

306 Fujikawa(1)

Bus Loop

Playground

700 Bldg.
 State Preschool
 Wilburn (Pre)

100 Bldg.

Lounge

Multipurpose Room

Conference Room

Nurse

Front Office

200 Bldg.

202 LaTendresse (K)

201 Green (K)

Playground

Parking Lot

Northwood SCHOOL

2760 E. Trimble Road
San Jose, CA 95132
(408) 923-1940

NORTHWOOD ELEMENTARY SCHOOL
INSPECTED ON: 09-08-09

Park

Field

Playground

Playground

Bus Loop

wood storage

metal storage


400 Bldg.

405 Heiss (1/2) 406 Williamson(1)

404 Helfenberger (K) Library (middle 400)

403 Lewis-Cook (3) 401 Stinson (3)

402 Cheadle II (3)



300 Bldg.

301 Orth (2/3) 306 Fujikawa(1)

307 RSP (middle) - Yee 305 Evans/Lewis(2)

302 Lui (1) 304 Kinney (2)

303 Brum (K)

MIDDLE
QUAD
PATIO

500 Bldg.

509 Athwal (1) 501 Wong (4/5)

506 Brown (SDC) Boyd (4) middle 507

505 Serochi (SDC) 502 Burroughs(5)

504 Kramer(5) 503 Lyle(4)

100 Bldg.

Lounge Multipurpose Room Nurse

Conference Room Front Office

700 Bldg.

State Preschool
Wilburn (Pre)

801 Bldg.

Carabal (3)

800 Bldg.

Tanaka (2)

600 Bldg.

Child Development

900 Bldg.

Federal Pre-School
Winquist, Radford, Bala

Parking Lot

NORTHWOOD ELEMENTARY SCHOOL
INSPECTED ON: 5/14/09

Bus Loop

Playground

Park

Field

Playground

400 Bldg.

406 Williamson(1)

405 Heiss (1/2)


404 Helfenberger (K)

403 Lewis-Cook (3)

402 Cheadle II (3)

401 Stinson (3)

Library (middle 400)



300 Bldg.

316 (Speech)

306 Fujikawa(1)

307 RSP (middle) - Yee

305 Evans/Lewis(2)

304 Kinney (2)

303 Brum (K)

302 Lui (1)

301 Orth (2/3)

**MIDDLE
QUAD
PATIO**

500 Bldg.

509 Athwal (1)

501 Wong (4/5)

506 Brown (SDC)

Boyd (4)
middle 507

502 Burroughs(5)

503 Lyle(4)

505 Serochi (SDC)

504 Kramer(5)

100 Bldg.

Lounge

Multipurpose Room

Nurse

Conference Room

Front Office

700 Bldg.

State Preschool
Wilburn (Pre)

801 Bldg.

Carabal (3)

800 Bldg.

Tanaka (2)

600 Bldg.

Child
Development

900 Bldg.

Federal
Pre-School
Winquist,
Radford,
Bala

Playground

Parking Lot

Northwood School












2760 E. Trimble Road
San Jose, CA 95132
(408) 923-1940

VIEW

VIEW

Playground

Playground

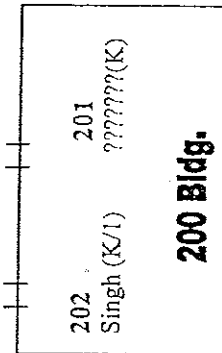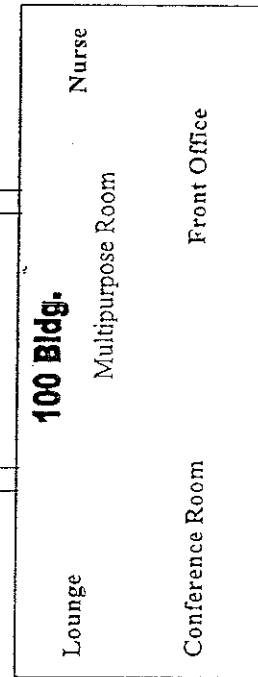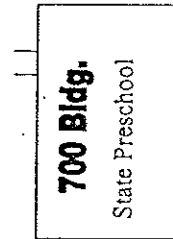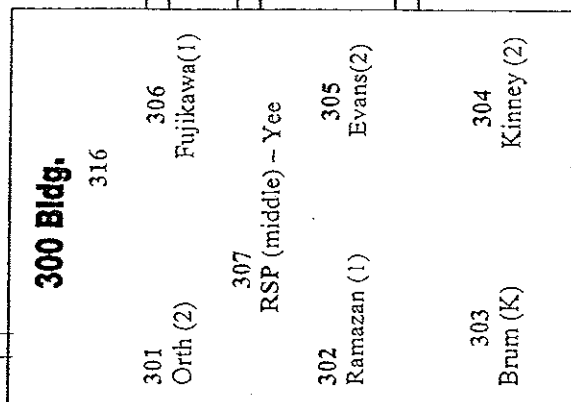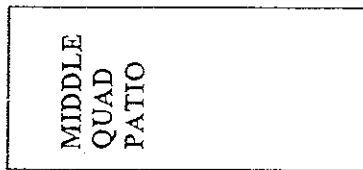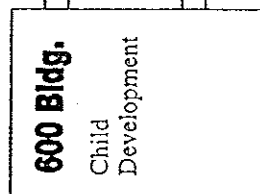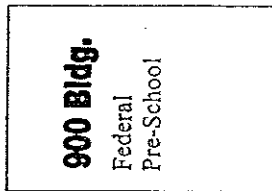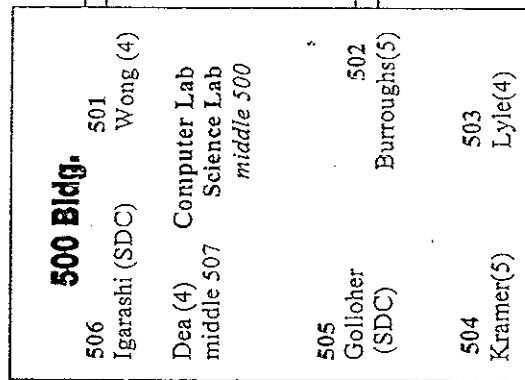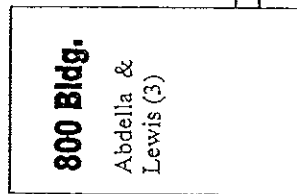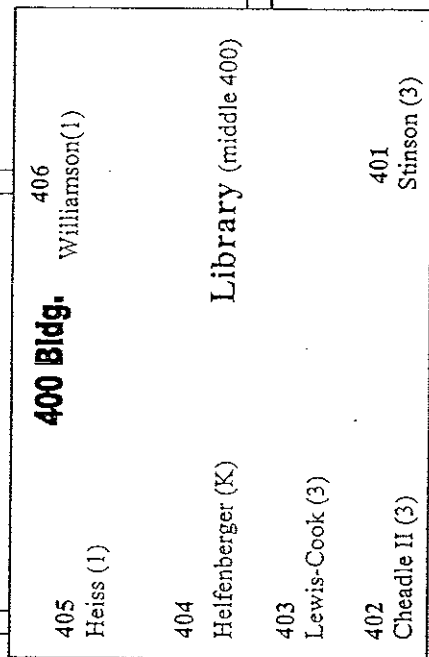

Bus Loop

NORTHWOOD ELEMENTARY SCHOOL
INSPECTED ON: 10/20/80

Parking Lot

Northwood SCHOOL **2760 E. Trimble Road** **San Jose, CA 95132** **(408) 923-1940**

NORTHWOOD ELEMENTARY SCHOOL
 INSPECTED ON: 4-21-08


Bus Loop

Playground

Playground

400 Bldg.

405 Heiss (1)	406 Williamson(1)
Library (middle 400)	
404 Helfenberger (K)	
403 Lewis-Cook (3)	
402 Cheadle II (3)	401 Stinson (3)



300 Bldg.

301 Orth (2)	306 Fujikawa(1)
302 Ramazan (1)	305 Evans(2)
303 Brum (K)	304 Kinney (2)
307 RSP (middle) - Yee	
316	

MIDDLE
 QUAD
 PATIO

500 Bldg.

506 Igarashi (SDC)	501 Wong (4)
505 Golloher (SDC)	502 Burroughs(5)
504 Kramer(5)	503 Lyle(4)
507 Dea (4) Computer Lab middle 507 Science Lab middle 500	

800 Bldg.

Abdella &
 Lewis (3)

600 Bldg.

Child
 Development

900 Bldg.

Federal
 Pre-School

100 Bldg.

Lounge	Nurse
Conference Room	Multipurpose Room
	Front Office

700 Bldg.

State Preschool

200 Bldg.

202 Singh (K/1)	201 ??????(K)
--------------------	------------------

Playground

Parking Lot

Northwood SCHOOL
2760 E. Trimble Road
San Jose, CA 95132
(408) 923-1940

NORTHWOOD ELEMENTARY SCHOOL
INSPECTED ON: 11-09-07

Bus Loop

Playground


Playground

Parking Lot

400 Bldg.

405 Heiss (1)	406 Williamson(1)
404 Helfenberger (K)	
403 Lewis-Cook (3)	
402 Cheadle II (3)	401 Stinson (3)

Library (middle 400)



500 Bldg.

506 Igarashi (SDC)	501 Wong (4)
505 Golloher (SDC)	502 Burroughs(5)
504 Kramer(5)	503 Lyle(4)

**Computer Lab
Science Lab
middle 500**

**MIDDLE
QUAD
PATIO**

300 Bldg.

301 Orth (2)	306 Fujikawa(1)
302 Ramazan (1)	305 Evans(2)
303 Brum (K)	304 Kinney (2)
	307 RSP (middle) - Yee

100 Bldg.

Lounge	Nurse
Conference Room	Multipurpose Room
	Front Office

700 Bldg.
 State Preschool

Playground

200 Bldg.

202 Singh (K/1)	201 ??????(K)
--------------------	------------------

900 Bldg.
 Federal
 Pre-School

800 Bldg.
 Abdella &
 Lewis (3)

600 Bldg.
 Child
 Development

FIRE ESCAPE MAP

NORTHWOOD SCHOOL

2760 E. TRIMBLE ROAD
SAN JOSE, CA 95132
(408) 923-1940

NORTHWOOD ELEMENTARY SCHOOL
INSPECTED ON: 03/09/07


Bus Loop

Playground

Park

Playground

Field

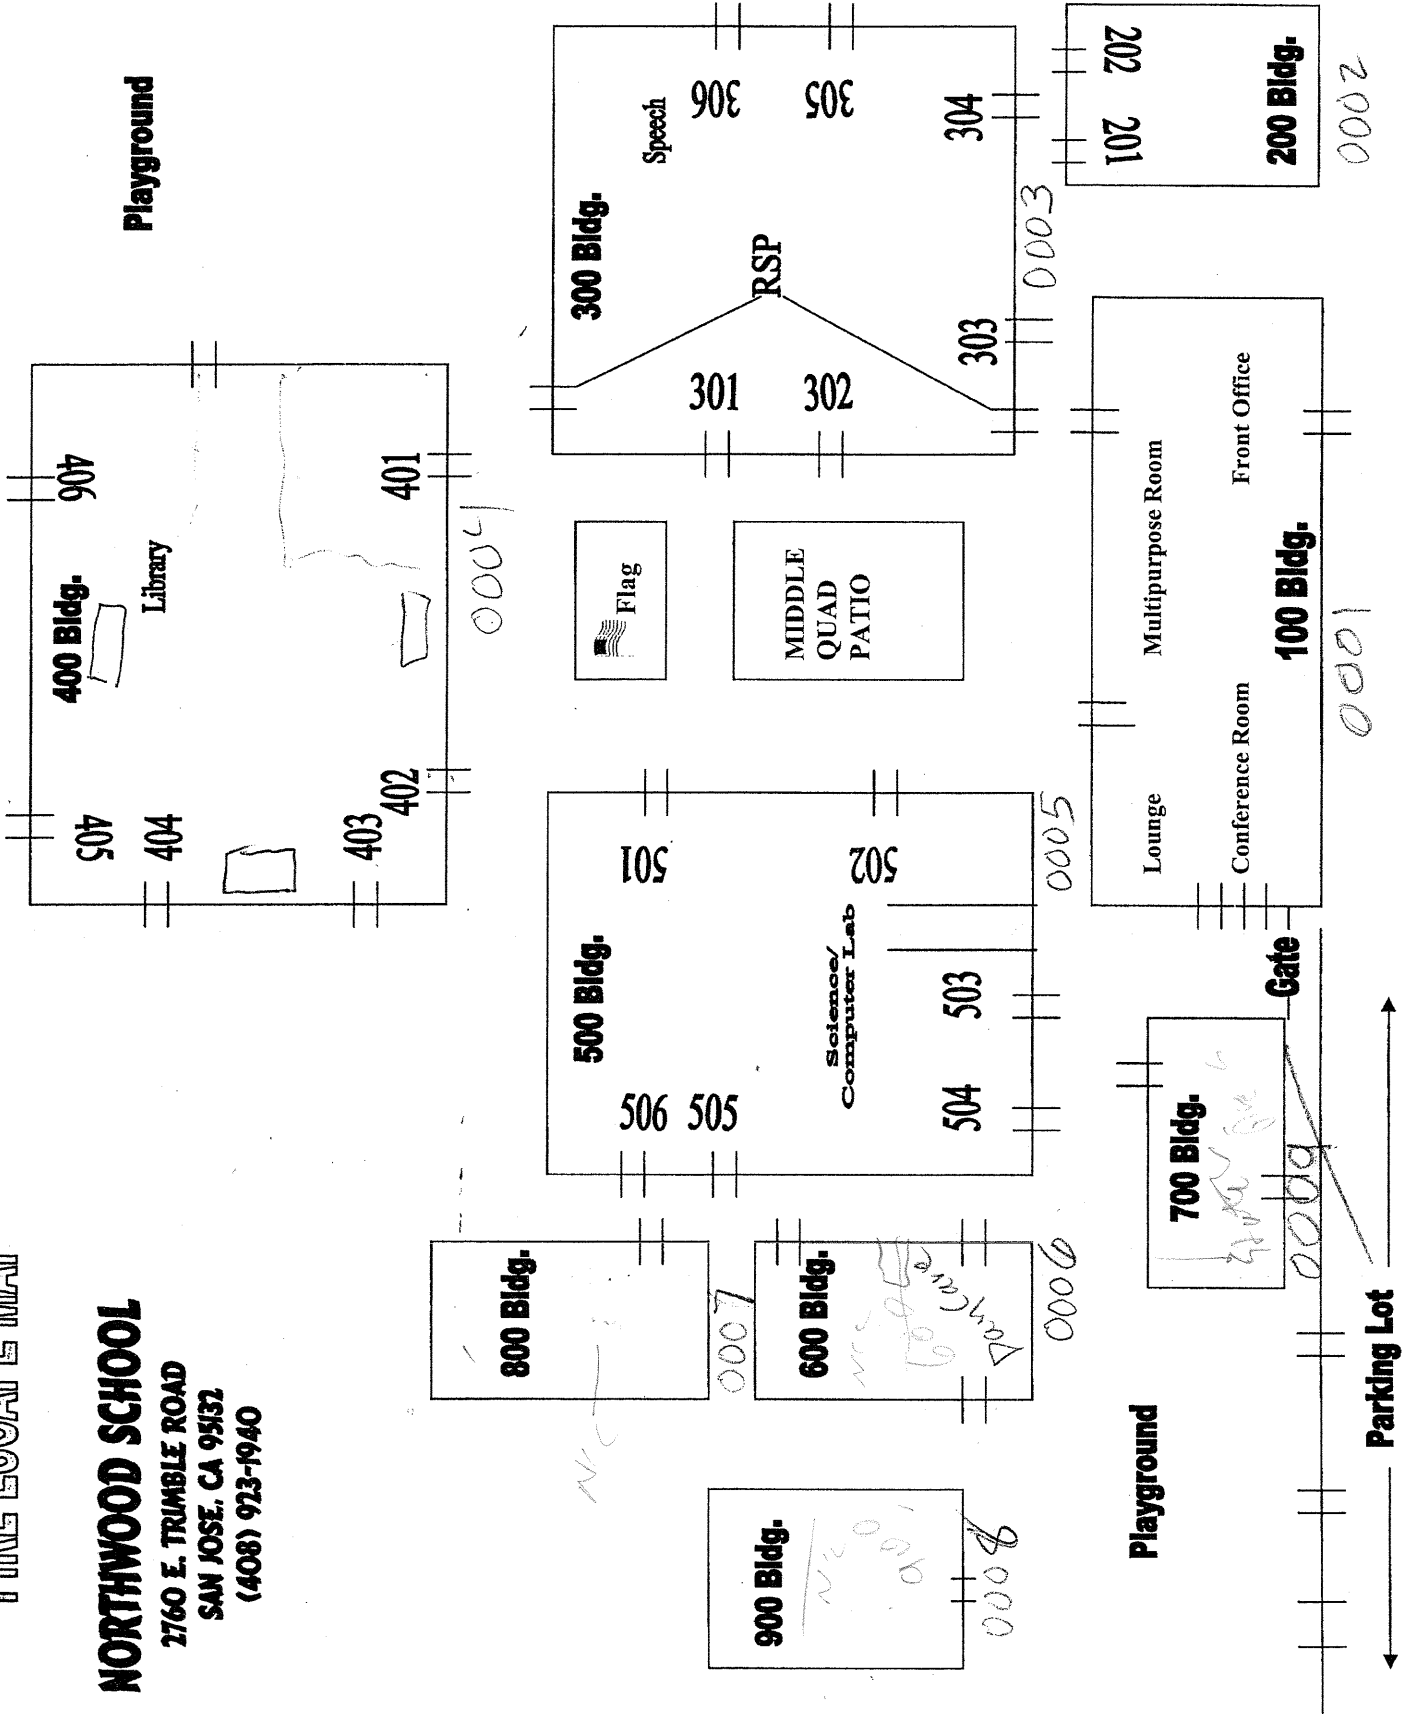

FIRE ESCAPE MAP

NORTHWOOD SCHOOL

2760 E. TRIMBLE ROAD
SAN JOSE, CA 95132
(408) 923-1940

NORTHWOOD ELEMENTARY SCHOOL
INSPECTED ON: 08-25-06



Park

Playground

Field

Bus Loop

Playground

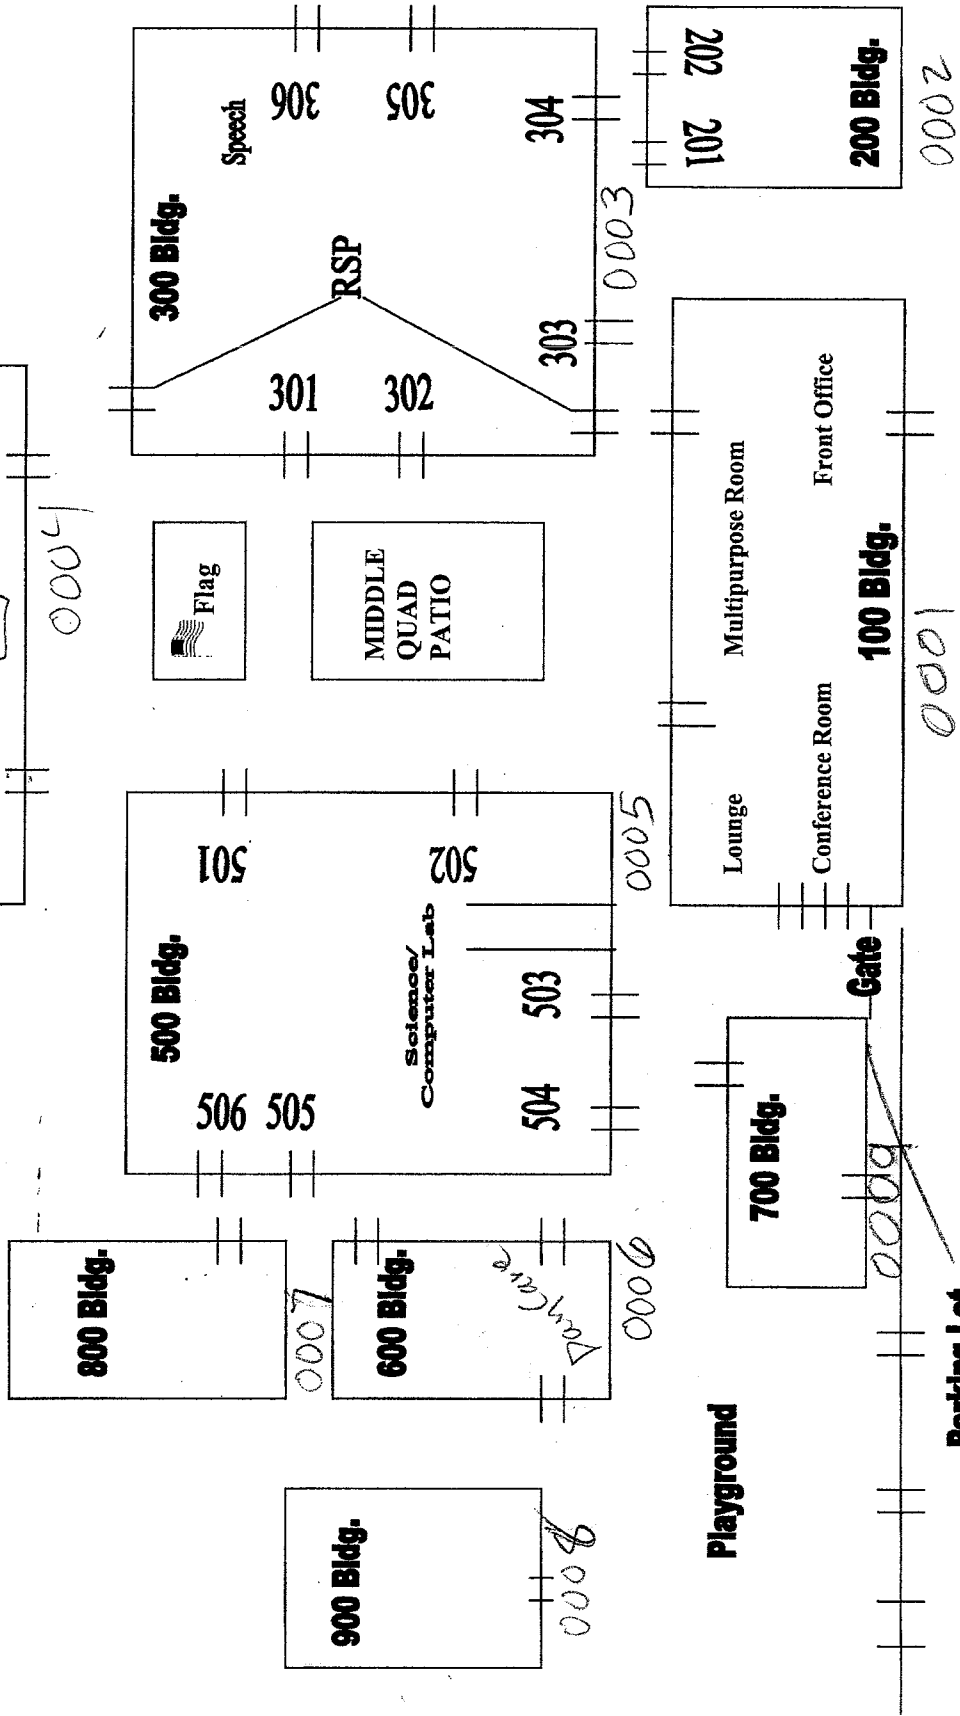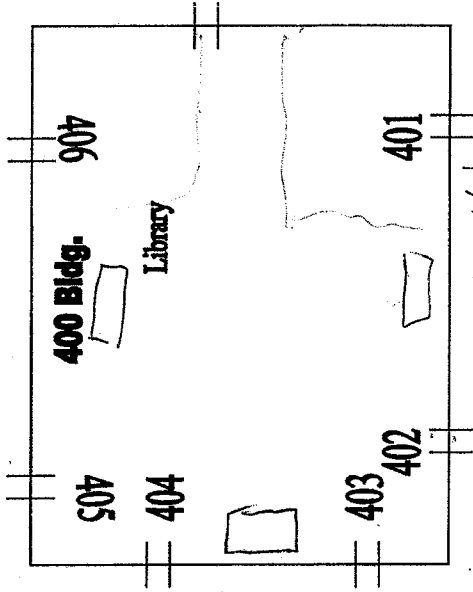

Bus Loop

Playground

Park


Playground

Field

FIRE ESCAPE MAP

NORTHWOOD SCHOOL

2760 E. TRIMBLE ROAD
SAN JOSE, CA 95132
(408) 923-1940

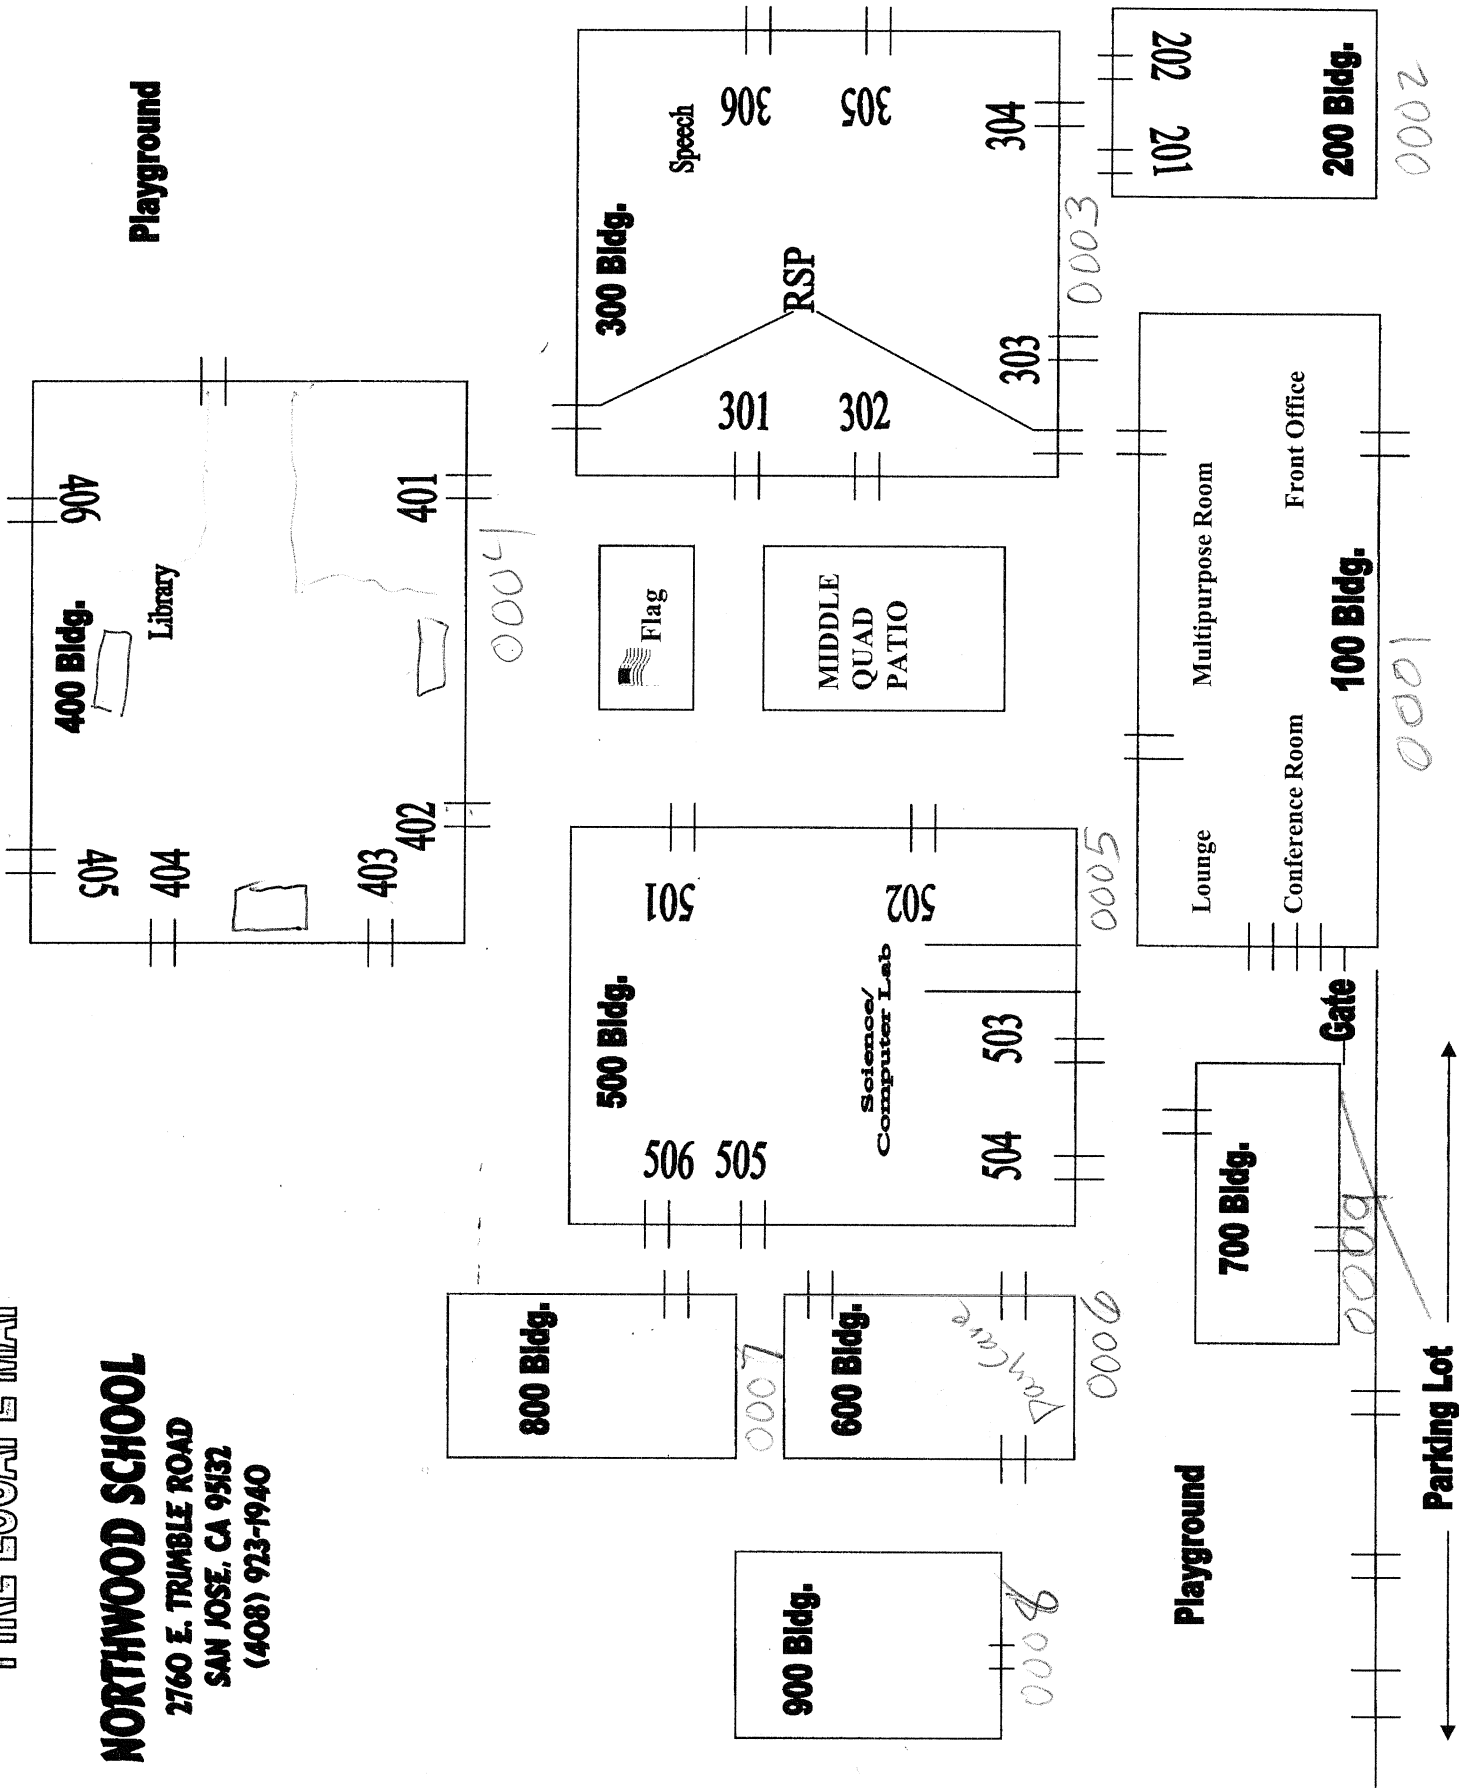

Bus Loop

Playground

Park

Playground

Field

FIRE ESCAPE MAP

NORTHWOOD SCHOOL

2760 E. TRIMBLE ROAD
SAN JOSE, CA 95132
(408) 923-1940

