

SIX-MONTH SURVEILLANCE AHERA REPORT

**SIERRAMONT MIDDLE SCHOOL
3155 KIMLEE DRIVE
SAN JOSE, CA 95132**

**PREPARED FOR:
BERRYESSA UNION ELEMENTARY SCHOOL DISTRICT
981 RIDDER PARK DRIVE SAN JOSE, CA 95131
SAN JOSE, CA 95132**

**INSPECTED ON:
FEBRUARY 14, 2024**

HAZMAT DOC PROJECT #24-016


**PREPARED BY:
HAZMAT DOC
3080 OLCOTT STREET • SUITE D135
SANTA CLARA, CA 95054
Tel: 408.748.0055**

BERRYESSA UNION ELEMENTARY SCHOOL DISTRICT

SIERRAMONT MIDDLE SCHOOL


**INSPECTED ON:
FEBRUARY 14, 2024**

INSPECTED BY:

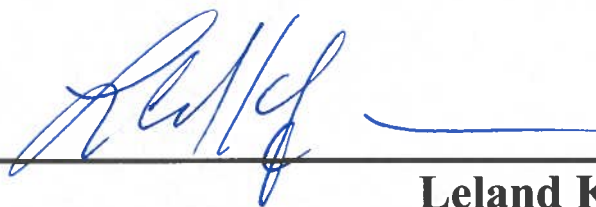

**Leland Kafeyan
Cal/OSHA Certified Site Surveillance Technician
Certification Number 06-4110**

REPORTED BY:

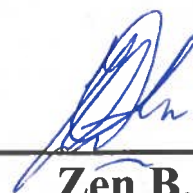

**Zen B. Doctor
Cal/OSHA Certified Asbestos Consultant
Certification Number 02-3166**

CONTENTS

PART - I

LEGEND AND GLOSSARY OF TERMS

PART – II

AHERA REPORT A – LIST OF BUILDINGS

PART – III

AHERA REPORT B – SURVEY REPORT

PART – IV

HOMOGENEOUS MATERIALS REPORT

PART – V

FRIABLE LOCATIONS REPORT

PART – VI

NON-FRIABLE LOCATIONS REPORT

PART – VII

RECOMMENDATIONS REPORT

PART – VIII

SAMPLES REPORT

PART – IX

DAMAGE REPORT

PART - X

SITE MAPS

LEGEND

THE FOLLOWING IS A LIST OF ABBREVIATIONS USED IN THIS REPORT:

Asbestos Sample Types

AC	=	ACTINOLITE
AM	=	AMOSITE
AN	=	ANTHOPHYLLITE
CH	=	CHRYSTOTILE
CR	=	CROCIDOLITE
TR	=	TREMOLITE
ND	=	NONE DETECTED
NS	=	NO SAMPLE

Measurements

APPROX.	=	APPROXIMATELY
EA	=	EACH
I	=	INCHES
LF	=	LINEAR FEET
N	=	NUMBER
O.D.	=	OUTSIDE DIAMETER
SF	=	SQUARE FEET
TBD	=	TO BE DETERMINED

LIST OF BUILDINGS AT

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME BUILDING USED AS (#FLOORS) CONSTRUCTION	BUILDING AREA (APPROXIMATE)
BOILER ROOM	
Boiler Room (1) Concrete Slab and Plaster Walls	1,530 SF
CLASSROOM 40 PORTABLE BUILDING	
Classroom (1) Wood, Metal, and Pre-formed Walls	960 SF
CLASSROOM 41 PORTABLE BUILDING	
Classroom (1) Wood and Metal Portable	960 SF
CLASSROOM 42 PORTABLE BUILDING	
Classroom (1) Wood and Metal Portable	960 SF
CLASSROOM 43 PORTABLE BUILDING (REMOVED)	
Classroom (1) Wood and Metal	0 SF
CLASSROOM 44 PORTABLE BUILDING (REMOVED)	
Classroom (1) Wood and Metal	0 SF
CLASSROOM 45 PORTABLE BUILDING	
Classroom (1) Wood and Metal	960 SF
CLASSROOM 46 PORTABLE BUILDING	
Classroom (1) Wood and Metal	960 SF
MAIN BUILDING	
Offices, Classrooms, Library, Storage Rooms, Restrooms, Utility Rooms (1) Wood, Metal, Plaster, Gypsum Wallboard System, Concrete	36,600 SF
METAL STORAGE CONTAINERS (4 EA)	
Storage (1) Metal	1,420 SF
MULTI-PURPOSE BUILDING	
Gym, Classrooms, Locker Rooms (1) Wood, Metal, Plaster, Gypsum Wallboard System, Concrete	25,600 SF
Total Number Of Buildings : <u>11</u>	(Approximate) Total Sq Ft. : <u>69,950</u>
End Of Report, Total Of 1 Pages	

SURVEY REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

COMMENTS

QTY (APPROXIMATE)

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

BOILER ROOM

BOILER ROOM

BOILER ROOM

ROUGH WALL

1,800 SF

09/12/2005 Stucco Exterior Walls. This Material is in GOOD condition as of this date.

03/06/2007 Material Description changed from 'Stucco Walls.' to 'Stucco Exterior Walls.' No other changes as of this date.

04/16/2008 This Material has a hard Cementitious Surface. No other changes as of this date.

02/06/2019 This Material is unchanged as of this date.

08/14/2019 This Material is unchanged as of this date.

02/03/2020 This Material is unchanged as of this date.

02/10/2021 This Material is unchanged as of this date.

08/11/2021 This Material is unchanged as of this date.

02/18/2022 This Material is unchanged as of this date.

08/17/2022 This Material is unchanged as of this date.

02/15/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

BOILER ROOM

BOILER ROOM

ROUGH WALL SURFACING

1,800 SF

09/12/2005 Skim Coat for Stucco Exterior Walls. This Material is in GOOD condition as of this date.

03/06/2007 Material Description changed from 'Skim Coat for Stucco Walls.' to 'Skim Coat for Stucco Exterior Walls.' No other changes as of this date.

04/16/2008 This Material has a hard Cementitious Surface. No other changes as of this date.

02/06/2019 This Material is unchanged as of this date.

08/14/2019 This Material is unchanged as of this date.

SURVEY REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
02/03/2020	This Material is unchanged as of this date.		
02/10/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	This Material is unchanged as of this date.		
02/15/2023	This Material is unchanged as of this date.		
08/16/2023	This Material is unchanged as of this date.		
05-212AAA	ASSUMED	NO SAMPLE	(NS)

SURVEY REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

CLASSROOM 40 PORTABLE BUILDING

CLASSROOM 40 PORTABLE BUILDING

03/06/2007	BUILDING NOTES:
03/06/2007	Manufacturer's Tag Info: By: American Modular Systems; Date 10-06; Serial #s 06-222-011A & B. This entry for informational and tracking purposes.
10/16/2008	Building Name changed from CLASSROOM 42 PORTABLE BUILDING to CLASSROOM 40 PORTABLE BUILDING.

CLASSROOM 40 PORTABLE BUILDING

CLASSROOM PORTABLE 40

BASEBOARD MASTIC

50 SF

02/08/2016	Mastic/Adhesive for 4" Black Baseboard (Original Entry Updated 8/17/22).
02/06/2019	This Material is unchanged as of this date.
08/14/2019	This Material is unchanged as of this date.
08/28/2020	This Material is unchanged as of this date.
02/10/2021	This Material is unchanged as of this date.
08/11/2021	This Material is unchanged as of this date.
02/18/2022	This Material is unchanged as of this date.
08/17/2022	Material Re-Assessed. Material not observed, Material may exist behind current 4" Black Baseboard. No other changes as of this date.
02/15/2023	Damage Observed. <5% Physical Damage - in the form of 1 LF of Baseboard Detached on North Wall, Beige Mastic Exposed. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.
08/16/2023	This Material is unchanged as of this date.
02/14/2024	This Material is unchanged as of this date.

16-031AAA	ASSUMED	NO SAMPLE	(NS)
16-031-042	ND	NONE DETECTED	(ND)

SURVEY REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME	
LOCATION	
MATERIAL TYPE	QTY (APPROXIMATE)
COMMENTS	

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

CLASSROOM 40 PORTABLE BUILDING

CLASSROOM PORTABLE 40

CARPET MASTIC

960 SF

02/08/2016	Mastic/Adhesive for Gray Black Carpet (Original Entry Updated 8/17/22).
02/06/2019	This Material is unchanged as of this date.
08/14/2019	This Material is unchanged as of this date.
08/28/2020	This Material is unchanged as of this date.
02/10/2021	This Material is unchanged as of this date.
08/11/2021	This Material is unchanged as of this date.
02/18/2022	This Material is unchanged as of this date.
08/17/2022	Material Re-Assessed. Material not observed, Material may exist under current Gray Black Carpet. No other changes as of this date.
02/15/2023	This Material is unchanged as of this date.
08/16/2023	This Material is unchanged as of this date.
02/14/2024	This Material is unchanged as of this date.

16-031AAA	ASSUMED	NO SAMPLE	(NS)
16-031-041	ND	NONE DETECTED	(ND)

CLASSROOM 40 PORTABLE BUILDING

PORTABLE 40

PORTABLE BUILDING

960 SF

03/06/2007	New 2006 Construction Relocatable Building per Manufacturer's Tag information.
02/06/2019	This Material is unchanged as of this date.
08/14/2019	This Material is unchanged as of this date.
08/28/2020	This Material is unchanged as of this date.
02/10/2021	This Material is unchanged as of this date.
08/11/2021	This Material is unchanged as of this date.
02/18/2022	This Material is unchanged as of this date.

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

08/17/2022 This Material is unchanged as of this date.

02/15/2023 This Material is unchanged as of this date.

08/16/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

05-212.NS	NEW	NO SAMPLE	(NS)
-----------	-----	-----------	--------

SURVEY REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

CLASSROOM 41 PORTABLE BUILDING

CLASSROOM 41 PORTABLE BUILDING

09/12/2005	BUILDING NOTES:
09/12/2005	Manufacturer's Tag Info: BY DESIGNED MOBILE SYSTEM; DATE: 03/91; OSA# 55824; SERIAL# 2632-1, 2632-2. This entry for informational and tracking purposes.
03/06/2007	Building Name changed from PORTABLE 40 to CLASSROOM 40 PORTABLE BUILDING.
10/16/2008	Building Name changed from CLASSROOM 40 PORTABLE BUILDING to CLASSROOM 41 PORTABLE BUILDING.

CLASSROOM 41 PORTABLE BUILDING

CLASSROOM 41 PORTABLE BUILDING

BASEBOARD MASTIC

50 SF

02/08/2016	Mastic/Adhesive for 4" Black Baseboard (Original Entry Updated 8/17/22).
02/06/2019	This Material is unchanged as of this date.
08/14/2019	This Material is unchanged as of this date.
02/03/2020	This Material is unchanged as of this date.
08/28/2020	This Material is unchanged as of this date.
02/10/2021	This Material is unchanged as of this date.
08/11/2021	This Material is unchanged as of this date.
02/18/2022	This Material is unchanged as of this date.
08/17/2022	Material Re-Assessed. Material not observed, Material may exist behind current 4" Black Baseboard. No other changes as of this date.
02/15/2023	This Material is unchanged as of this date.
08/16/2023	This Material is unchanged as of this date.
02/14/2024	This Material is unchanged as of this date.

16-031AAA	ASSUMED	NO SAMPLE	(NS)
16-031-040	ND	NONE DETECTED	(ND)

SURVEY REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

CLASSROOM 41 PORTABLE BUILDING

CLASSROOM 41 PORTABLE BUILDING

CARPET MASTIC

960 SF

02/08/2016	Mastic/Adhesive for Gray Black Carpet (Original Entry Updated 8/17/22).		
02/06/2019	This Material is unchanged as of this date.		
08/14/2019	This Material is unchanged as of this date.		
02/03/2020	This Material is unchanged as of this date.		
08/28/2020	This Material is unchanged as of this date.		
08/11/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	Material Re-Assessed. Material not observed, Material may exist under current Gray Black Carpet. No other changes as of this date.		
02/15/2023	This Material is unchanged as of this date.		
08/16/2023	This Material is unchanged as of this date.		
02/14/2024	This Material is unchanged as of this date.		

16-031AAA	ASSUMED	NO SAMPLE	(NS)
16-031-039	ND	NONE DETECTED	(ND)

CLASSROOM 41 PORTABLE BUILDING

PORTABLE 41

PORTABLE BUILDING

960 SF

09/12/2005	New 1991 Construction Relocatable Building per Manufacturer's Tag information.		
02/06/2019	This Material is unchanged as of this date.		
08/14/2019	This Material is unchanged as of this date.		
02/03/2020	This Material is unchanged as of this date.		
08/28/2020	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	This Material is unchanged as of this date.		

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/15/2023 This Material is unchanged as of this date.

08/16/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

05-212.NS	NEW	NO SAMPLE	(NS)
-----------	-----	-----------	--------

SURVEY REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

CLASSROOM 42 PORTABLE BUILDING

CLASSROOM 42 PORTABLE BUILDING

09/12/2005	BUILDING NOTES:
09/12/2005	Manufacturer's Tag Info: BY AMERICAN MODULAR SYS; DATE: 05/99; SERIAL# 99-R320-657A, 99-R320-657B. This entry for informational and tracking purposes.
03/06/2007	Building Name changed from PORTABLE 41 to CLASSROOM 41 PORTABLE BUILDING.
10/16/2008	Building Name changed from CLASSROOM 41 PORTABLE BUILDING to CLASSROOM 42 PORTABLE BUILDING.

CLASSROOM 42 PORTABLE BUILDING

CLASSROOM 42 PORTABLE BUILDING

BASEBOARD MASTIC

50 SF

02/08/2016	Mastic/Adhesive for 6" Black Baseboard (Original Entry Updated 8/17/22).
02/06/2019	This Material is unchanged as of this date.
08/14/2019	This Material is unchanged as of this date.
02/03/2020	This Material is unchanged as of this date.
08/28/2020	This Material is unchanged as of this date.
02/10/2021	This Material is unchanged as of this date.
08/11/2021	This Material is unchanged as of this date.
02/18/2022	This Material is unchanged as of this date.
08/17/2022	Material Re-Assessed. Material not observed, Material may exist behind current 6" Black Baseboard. No other changes as of this date.
08/16/2023	This Material is unchanged as of this date.
02/14/2024	This Material is unchanged as of this date.

16-031AAA	ASSUMED	NO SAMPLE	(NS)
16-031-038	ND	NONE DETECTED	(ND)

SURVEY REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME	
LOCATION	
MATERIAL TYPE	QTY (APPROXIMATE)
COMMENTS	

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

CLASSROOM 42 PORTABLE BUILDING

CLASSROOM 42 PORTABLE BUILDING

CARPET MASTIC

960 SF

02/08/2016	Mastic/Adhesive for Gray Black Carpet (Original Entry Updated 8/17/22).
02/06/2019	This Material is unchanged as of this date.
08/14/2019	This Material is unchanged as of this date.
02/03/2020	This Material is unchanged as of this date.
08/28/2020	This Material is unchanged as of this date.
02/10/2021	This Material is unchanged as of this date.
08/11/2021	This Material is unchanged as of this date.
02/18/2022	This Material is unchanged as of this date.
08/17/2022	Material Re-Assessed. Material not observed, Material may exist under current Gray Black Carpet. No other changes as of this date.
08/16/2023	This Material is unchanged as of this date.
02/14/2024	This Material is unchanged as of this date.

16-031AAA	ASSUMED	NO SAMPLE	(NS)
16-031-037	ND	NONE DETECTED	(ND)

CLASSROOM 42 PORTABLE BUILDING

PORTABLE 42

PORTABLE BUILDING

960 SF

09/12/2005	New 1999 Construction Relocatable building per Manufacturer's Tag information.
02/06/2019	This Material is unchanged as of this date.
08/14/2019	This Material is unchanged as of this date.
02/03/2020	This Material is unchanged as of this date.
08/28/2020	This Material is unchanged as of this date.
02/10/2021	This Material is unchanged as of this date.
08/11/2021	This Material is unchanged as of this date.

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	This Material is unchanged as of this date.		
08/16/2023	This Material is unchanged as of this date.		
02/14/2024	This Material is unchanged as of this date.		
05-212.NS	NEW	NO SAMPLE	(NS)

SURVEY REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

CLASSROOM 43 PORTABLE BUILDING (REMOVED)

CLASSROOM 43 PORTABLE BUILDING (REMOVED)

03/07/2017 BUILDING INFORMATION:

03/07/2017 Manufacturer's Tag Info:
By American Modular Systems; Date 06-12; DSA 01-107065; Serial #'s 12-825-001A, 12-825-001B, 12-825-001C.
This entry for informational and tracking purposes.

CLASSROOM 43 PORTABLE BUILDING (REMOVED)

CLASSROOM 43 PORTABLE BUILDING

BASEBOARD MASTIC

0 SF

02/08/2016 White Mastic/Adhesive for 4" Light Blue Baseboard. Sample 16-031-44 collected from Classroom 43, White Mastic/Adhesive for Light Blue Baseboard.

02/06/2019 This Material is unchanged as of this date.

08/14/2019 This Material is unchanged as of this date.

08/28/2020 This Material is unchanged as of this date.

02/10/2021 This Material is unchanged as of this date.

08/11/2021 This Material is unchanged as of this date.

02/18/2022 This Material is unchanged as of this date.

08/18/2022 Building Removed. Material Quantity changed from 50 SF to 0 SF. Recommendation updated to reflect this. No other changes as of this date.

16-031AAA	ASSUMED	NO SAMPLE	(NS)
16-031-44	ND	NONE DETECTED	(ND)
22-093REM	REMOVED	NO SAMPLE	(NS)

CLASSROOM 43 PORTABLE BUILDING (REMOVED)

CLASSROOM 43 PORTABLE BUILDING

CARPET MASTIC

0 SF

02/08/2016 Yellow Mastic/Adhesive for Blue-Gray Carpet on Wood. Sample 16-031-43 collected from Classroom 43, Yellow Mastic/Adhesive for Blue-Gray Carpet.

SURVEY REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/06/2019	This Material is unchanged as of this date.		
08/14/2019	This Material is unchanged as of this date.		
08/28/2020	This Material is unchanged as of this date.		
02/10/2021	This Material is unchanged as of this date.		
08/11/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/18/2022	Building Removed. Material Quantity changed from 960 SF to 0 SF. Recommendation updated to reflect this. No other changes as of this date.		

16-031AAA	ASSUMED	NO SAMPLE	(NS)
16-031-043	ND	NONE DETECTED	(ND)
20-093REM	REMOVED	NO SAMPLE	(NS)

CLASSROOM 43 PORTABLE BUILDING (REMOVED)

PORTABLE 43

PORTABLE BUILDING

0 SF

10/11/2012	New 2012 Construction Relocatable Building per Manufacturer's Tag information.		
02/06/2019	This Material is unchanged as of this date.		
08/14/2019	This Material is unchanged as of this date.		
08/28/2020	This Material is unchanged as of this date.		
02/10/2021	This Material is unchanged as of this date.		
08/11/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/18/2022	Building Removed. Material Quantity changed from 960 SF to 0 SF. Recommendation updated to reflect this. No other changes as of this date.		

12-185.NS	NEW	NO SAMPLE	(NS)
22-093REM	REMOVED	NO SAMPLE	(NS)

SURVEY REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

CLASSROOM 44 PORTABLE BUILDING (REMOVED)

CLASSROOM 44 PORTABLE BUILDING (REMOVED)

03/07/2017 BUILDING INFORMATION:

03/07/2017 Manufacturer's Tag Info:
By American Modular Systems; Date 06-12; DSA 01-112697; Serial #'s 12-825-001A, 12-825-001B.
This entry for informational and tracking purposes.

CLASSROOM 44 PORTABLE BUILDING (REMOVED)

CLASSROOM 44

PORTABLE BUILDING

0 SF

10/11/2012 New 2012 Construction Relocatable Building per Manufacturer's Tag information.

02/06/2019 This Material is unchanged as of this date.

08/14/2019 This Material is unchanged as of this date.

08/28/2020 This Material is unchanged as of this date.

02/10/2021 This Material is unchanged as of this date.

08/11/2021 This Material is unchanged as of this date.

02/18/2022 This Material is unchanged as of this date.

08/17/2022 Building Removed. Material Quantity changed from 960 SF to 0 SF. Recommendation updated to reflect this. No other changes as of this date.

12-185.NS	NEW	NO SAMPLE	(NS)
22-093REM	REMOVED	NO SAMPLE	(NS)

CLASSROOM 44 PORTABLE BUILDING (REMOVED)

CLASSROOM 44 PORTABLE BUILDING

BASEBOARD MASTIC

0 SF

02/08/2016 White Mastic/Adhesive for 4" Black Baseboard. Sample 16-031-046 collected from Classroom 44, White Mastic/Adhesive for 4" Black Baseboard.

02/06/2019 This Material is unchanged as of this date.

08/14/2019 This Material is unchanged as of this date.

SF= Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

08/28/2020	This Material is unchanged as of this date.		
02/10/2021	Material Re-assessed. Quantity changed from 960 SF to 50 SF. No other changes as of this date.		
08/11/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	Building Removed. Material Quantity changed from 50 SF to 0 SF. Recommendation updated to reflect this. No other changes as of this date.		

16-031AAA	ASSUMED	NO SAMPLE	(NS)
16-031-046	ND	NONE DETECTED	(ND)
22-094REM	REMOVED	NO SAMPLE	(NS)

CLASSROOM 44 PORTABLE BUILDING (REMOVED)

CLASSROOM 44 PORTABLE BUILDING

CARPET MASTIC

0 SF

02/08/2016	Yellow Mastic/Adhesive for Blue Carpet on Wood. Sample 16-031-045 collected from Classroom 44, Yellow Mastic/Adhesive for Blue Carpet.		
02/06/2019	This Material is unchanged as of this date.		
08/14/2019	This Material is unchanged as of this date.		
08/28/2020	This Material is unchanged as of this date.		
02/10/2021	This Material is unchanged as of this date.		
08/11/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	Building Removed. Material Quantity changed from 960 SF to 0 SF. Recommendation updated to reflect this. No other changes as of this date.		

16-031-045	ND	NONE DETECTED	(ND)
16-031AAA	ASSUMED	NO SAMPLE	(NS)
22-093REM	REMOVED	NO SAMPLE	(NS)

SURVEY REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

CLASSROOM 45 PORTABLE BUILDING

CLASSROOM 45 PORTABLE BUILDING

03/07/2017 BUILDING INFORMATION:

03/07/2017 Manufacturer's Tag Info:
By American Modular Systems; Date 06-12; DSA # 01-112697; Serial #'s 12-825-002A, 12-825-002B.
This entry for informational and tracking purposes.

CLASSROOM 45 PORTABLE BUILDING

CLASSROOM 45 PORTABLE BUILDING

BASEBOARD MASTIC

50 SF

02/08/2016 Mastic/Adhesive for 4" Black Baseboard (Original Entry Updated 8/17/22).

02/06/2019 This Material is unchanged as of this date.

08/14/2019 This Material is unchanged as of this date.

02/03/2020 This Material is unchanged as of this date.

08/28/2020 This Material is unchanged as of this date.

02/10/2021 This Material is unchanged as of this date.

08/11/2021 This Material is unchanged as of this date.

02/18/2022 This Material is unchanged as of this date.

08/17/2022 Material Re-Assessed. Material not observed, Material may exist behind current 4" Black Baseboard. No other changes as of this date.

02/15/2023 This Material is unchanged as of this date.

08/16/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

16-031AAA	ASSUMED	NO SAMPLE	(NS)
16-031-050	ND	NONE DETECTED	(ND)

SURVEY REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

CLASSROOM 45 PORTABLE BUILDING

CLASSROOM 45 PORTABLE BUILDING

CARPET MASTIC

960 SF

02/08/2016	Mastic/Adhesive for Gray Black Carpet (Original Entry Updated 8/17/22).
02/06/2019	This Material is unchanged as of this date.
08/14/2019	This Material is unchanged as of this date.
02/03/2020	This Material is unchanged as of this date.
08/28/2020	This Material is unchanged as of this date.
02/10/2021	This Material is unchanged as of this date.
08/11/2021	This Material is unchanged as of this date.
02/18/2022	This Material is unchanged as of this date.
08/17/2022	Material Re-Assessed. Material not observed, Material may exist under current Gray Black Carpet. No other changes as of this date.
02/15/2023	This Material is unchanged as of this date.
08/16/2023	This Material is unchanged as of this date.
02/14/2024	This Material is unchanged as of this date.

16-031AAA	ASSUMED	NO SAMPLE	(NS)
16-031-049	ND	NONE DETECTED	(ND)

CLASSROOM 45 PORTABLE BUILDING

PORTABLE 45

PORTABLE BUILDING

960 SF

10/11/2012	New 2012 Construction Relocatable Building per Manufacturer's Tag information.
02/06/2019	This Material is unchanged as of this date.
08/14/2019	This Material is unchanged as of this date.
02/03/2020	This Material is unchanged as of this date.
08/28/2020	This Material is unchanged as of this date.
02/10/2021	This Material is unchanged as of this date.

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

HazMat Doc

AHERA Report B - Survey

SURVEY REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
08/11/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	This Material is unchanged as of this date.		
02/15/2023	This Material is unchanged as of this date.		
08/16/2023	This Material is unchanged as of this date.		
02/14/2024	This Material is unchanged as of this date.		
12-185.NS	NEW	NO SAMPLE	(NS)

SURVEY REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

CLASSROOM 46 PORTABLE BUILDING

CLASSROOM 46 PORTABLE BUILDING

03/07/2017 BUILDING INFORMATION:

03/07/2017 Manufacturer's Tag Info:
By American Modular Systems; Date 03-99; Serial #'s 99-R-320-655A, 94-R-320-655B.
This entry for informational and tracking purposes.

CLASSROOM 46 PORTABLE BUILDING

CLASSROOM 46

PORTABLE BUILDING

960 SF

10/11/2012 New 1999 Construction Relocatable Building per Manufacturer's Tag information.

02/06/2019 This Material is unchanged as of this date.

08/14/2019 This Material is unchanged as of this date.

08/28/2020 This Material is unchanged as of this date.

02/10/2021 This Material is unchanged as of this date.

08/11/2021 This Material is unchanged as of this date.

02/18/2022 This Material is unchanged as of this date.

08/17/2022 This Material is unchanged as of this date.

02/15/2023 This Material is unchanged as of this date.

08/16/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

12-185.NS	NEW	NO SAMPLE	(NS)
-----------	-----	-----------	--------

CLASSROOM 46 PORTABLE BUILDING

CLASSROOM 46 PORTABLE BUILDING

BASEBOARD MASTIC

50 SF

02/08/2016 White Mastic/Adhesive for 4" Dark Brown Baseboard. Sample 16-031-048 collected from Classroom 46,
White Mastic/Adhesive for 4" Dark Brown Baseboard.

SURVEY REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/06/2019 This Material is unchanged as of this date.

08/14/2019 This Material is unchanged as of this date.

08/28/2020 This Material is unchanged as of this date.

02/10/2021 This Material is unchanged as of this date.

08/11/2021 This Material is unchanged as of this date.

02/18/2022 This Material is unchanged as of this date.

08/17/2022 This Material is unchanged as of this date.

02/15/2023 This Material is unchanged as of this date.

08/16/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

16-031AAA	ASSUMED	NO SAMPLE	(NS)
16-031-048	ND	NONE DETECTED	(ND)

CLASSROOM 46 PORTABLE BUILDING

CLASSROOM 46 PORTABLE BUILDING

CARPET MASTIC

960 SF

02/08/2016 Mastic/Adhesive for Gray Black Carpet (Original Entry Updated 8/17/22).

02/06/2019 This Material is unchanged as of this date.

08/14/2019 This Material is unchanged as of this date.

08/28/2020 This Material is unchanged as of this date.

02/10/2021 This Material is unchanged as of this date.

08/11/2021 This Material is unchanged as of this date.

02/18/2022 This Material is unchanged as of this date.

08/17/2022 Material Re-Assessed. Material not observed, Material may exist under current Gray Black Carpet. No other changes as of this date.

02/15/2023 This Material is unchanged as of this date.

08/16/2023 This Material is unchanged as of this date.

SURVEY REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/14/2024 This Material is unchanged as of this date.

16-031-047	ND	NONE DETECTED	(ND)
16-031AAA	ASSUMED	NO SAMPLE	(NS)

SURVEY REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

COMMENTS

QTY (APPROXIMATE)

SAMPLE NO.

ASBESTOS CONTENT

ASBESTOS NAME

ASBESTOS CODE

MAIN BUILDING

MAIN BUILDING

ALL ADMIN OFFICES, UTILITY ROOMS, STORAGE ROOMS, CUSTODIAL ROOM, CLASSROOMS 24, 26, 28, 29, DARK ROOM, COMPUTER CLERK ROOM, AND PREP ROOMS

FIRE DOOR CORE INSULATION

693 SF

09/12/2005 Fire Door Core Insulation. (33 EA Doors). This Material is in GOOD condition as of this date.

02/06/2019 This Material is unchanged as of this date.

08/14/2019 This Material is unchanged as of this date.

02/03/2020 This Material is unchanged as of this date.

08/28/2020 This Material is unchanged as of this date.

02/10/2021 This Material is unchanged as of this date.

08/11/2021 This Material is unchanged as of this date.

02/18/2022 This Material is unchanged as of this date.

08/17/2022 This Material is unchanged as of this date.

02/15/2023 This Material is unchanged as of this date.

08/16/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

05-212AAA

ASSUMED

NO SAMPLE

(NS)

MAIN BUILDING

ALL CLASSROOMS, LOUNGE, AND PREP AREAS

PRESSED WOOD WALL PANEL

14,630 SF

03/06/2007 4'x10' Pressed Wood Wall Panel with Vinyl Wall Cover, (over Gypsum Wallboard System). This Material is in GOOD condition as of this date.

04/04/2013 Damage Observed. <5% Physical Damage - in the form of several holes, cuts, gouging and separation of seams in various locations. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.

09/01/2017 Repairs Observed. All the previous Damages have been Repaired. Damages Observed. Classrooms 1A, 1B and 3B have Small Holes by the Door Knobs. All of the Classrooms, Lounge and Prep Areas have 1 SF of loose Vinyl. No other changes as this date.

SURVEY REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
02/06/2019	This Material is unchanged as of this date.		
08/14/2019	This Material is unchanged as of this date.		
02/03/2020	This Material is unchanged as of this date.		
08/28/2020	This Material is unchanged as of this date.		
02/10/2021	This Material is unchanged as of this date.		
08/11/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	This Material is unchanged as of this date.		
02/15/2023	This Material is unchanged as of this date.		
08/16/2023	This Material is unchanged as of this date.		
02/14/2024	This Material is unchanged as of this date.		
05-212AAA	ASSUMED	NO SAMPLE	(NS)

MAIN BUILDING

ALL CLASSROOMS, LOUNGE, AND PREP AREAS

PRESSED WOOD WALL PANEL MASTIC

14,630 SF

03/06/2007	Mastic/Adhesive for 4'x10' Pressed Wood Wall Panel with Vinyl Wall Cover, (over Gypsum Wallboard System). This Material is in GOOD condition as of this date.
04/04/2013	Damage Observed. <5% Physical Damage - in the form of several holes, cuts, gouging and separation of seams in various locations. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.
09/01/2017	Repairs Observed. All the previous Damages have been Repaired. Damages Observed. Classrooms 1A, 1B and 3B have Small Holes by the Door Knobs. All of the Classrooms, Lounge and Prep Areas have 1 SF of loose Vinyl. No other changes as this date.
02/06/2019	This Material is unchanged as of this date.
08/14/2019	This Material is unchanged as of this date.
02/03/2020	This Material is unchanged as of this date.
08/28/2020	This Material is unchanged as of this date.
02/10/2021	This Material is unchanged as of this date.

SURVEY REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
08/11/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	This Material is unchanged as of this date.		
02/15/2023	This Material is unchanged as of this date.		
08/16/2023	This Material is unchanged as of this date.		
02/14/2024	This Material is unchanged as of this date.		
05-212AAA	ASSUMED	NO SAMPLE	(NS)

MAIN BUILDING

ALL CLASSROOMS, LOUNGE, AND PREP AREAS

VINYL WALL COVER

14,630 SF

09/12/2005	4'X10' Vinyl Covered Pressed Wood Walls. This Material is in GOOD condition as of this date.		
03/06/2007	Material Description changed from ' 4'x10' Vinyl Covered Pressed Wood Walls ' to ' Vinyl Wall Cover, (on 4'x10' Pressed Wood Wall Panel over Gypsum Wallboard System). ' Pressed Wood Wall Panel entry added to reflect this fact. No other changes as of this date.		
10/16/2008	This Material is unchanged as of this date		
04/04/2013	Damage Observed. <5% Physical Damage - in the form of several holes, cuts, gouging and separation of seams in various locations. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.		
09/01/2017	Repairs Observed. All the previous Damages have been Repaired. Damages Observed. Classrooms 1A, 1B and 3B have Small Holes by the Door Knobs. All of the Classrooms, Lounge and Prep Areas have 1 SF of loose Vinyl. No other changes as this date.		
09/01/2017	Repairs Observed. All the previous Damages have been Repaired. Damages Observed. Classrooms 1A, 1B and 3B have Small Holes by the Door Knobs. All of the Classrooms, Lounge and Prep Areas have 1 SF of loose Vinyl. No other changes as this date.		
02/06/2019	This Material is unchanged as of this date.		
08/14/2019	This Material is unchanged as of this date.		
02/03/2020	This Material is unchanged as of this date.		
08/28/2020	This Material is unchanged as of this date.		
02/10/2021	This Material is unchanged as of this date.		

SURVEY REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
08/11/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	This Material is unchanged as of this date.		
02/15/2023	This Material is unchanged as of this date.		
08/16/2023	This Material is unchanged as of this date.		
02/14/2024	This Material is unchanged as of this date.		
05-212AAA	ASSUMED	NO SAMPLE	(NS)

MAIN BUILDING

ALL CLASSROOMS, LOUNGE, AND PREP AREAS

VINYL WALL COVER MASTIC

14,630 SF

09/12/2005	Mastiv/Adhesive for Vinyl Covering oo 4'X10' Vinyl Covered Pressed Wood Walls. This Material is in GOOD condition as of this date.
03/06/2007	Material Description changed from ' Mastic/Adhesive for Vinyl Covering on 4'x10' Vinyl Covered Pressed Wood Walls. ' to ' Mastic/Adhesive for Vinyl Wall Cover, (on 4'x10' Pressed Wood Wall Panel over Gypsum Wallboard System). ' Pressed Wood Wall Panel entry added to reflect this fact. No other changes as of this date.
04/04/2013	Damage: <5% Physical Damage - in the form of several holes, cuts, gouging and separation of seams in various locations. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.
09/01/2017	Repairs Observed. All the previous Damages have been Repaired. Damages Observed. Classrooms 1A, 1B and 3B have Small Holes by the Door Knobs. All of the Classrooms, Lounge and Prep Areas have 1 SF of loose Vinyl. No other changes as this date.
02/06/2019	This Material is unchanged as of this date.
08/14/2019	This Material is unchanged as of this date.
02/03/2020	This Material is unchanged as of this date.
08/28/2020	This Material is unchanged as of this date.
02/10/2021	This Material is unchanged as of this date.
08/11/2021	This Material is unchanged as of this date.
02/18/2022	This Material is unchanged as of this date.

SURVEY REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

08/17/2022 This Material is unchanged as of this date.

02/15/2023 This Material is unchanged as of this date.

08/16/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

MAIN BUILDING

ATTIC / PLENUM

DUCT WRAP TAPE

1,000 LF

09/12/2005 Duct Wrap Tape. This Material is in GOOD condition as of this date.

02/06/2019 This Material is unchanged as of this date.

08/14/2019 This Material is unchanged as of this date.

02/03/2020 This Material is unchanged as of this date.

08/28/2020 This Material is unchanged as of this date.

02/10/2021 This Material is unchanged as of this date.

08/11/2021 This Material is unchanged as of this date.

02/18/2022 This Material is unchanged as of this date.

08/17/2022 This Material is unchanged as of this date.

02/15/2023 This Material is unchanged as of this date.

08/16/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

MAIN BUILDING

CLASSROOM 27 STORAGE ROOM

KILN INSULATION

60 SF

03/22/2016 Kiln Unit Brick Insulation. This Material is in GOOD condition as of this date.

SURVEY REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
02/06/2019	This Material is unchanged as of this date.		
08/14/2019	This Material is unchanged as of this date.		
02/03/2020	This Material is unchanged as of this date.		
08/28/2020	This Material is unchanged as of this date.		
02/10/2021	This Material is unchanged as of this date.		
08/11/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	This Material is unchanged as of this date.		
02/15/2023	This Material is unchanged as of this date.		
08/16/2023	This Material is unchanged as of this date.		
02/14/2024	This Material is unchanged as of this date.		
16-074AAA	ASSUMED	NO SAMPLE	(NS)

MAIN BUILDING

CLASSROOMS

SUSPENDED CEILING TILE

17,100 SF

09/12/2005	2'x4' with a 2'x2' pattern Suspended Ceiling Tile. This Material is in GOOD condition as of this date.
10/16/2008	This Material is unchanged as of this date
05/14/2009	5 Tiles are Water Damaged in Classroom 'Place1'. 2 Tiles are Water Damaged in the Library, next to the book return counter. 2 Tiles are Water Damaged in Pod 2 Atrium. 3 Tiles are Water Damaged in Classrooms Pod 2B. 1 Tile is broken in Classroom 2B. Friability changed from Moderate to High. This Material is in FAIR condition as of this date.
09/04/2009	Material remains in <5% Physical Damage and <10% Water Damage. This Material is unchanged as of this date.
03/11/2010	Additional Damage observed in Pod 2B with 3 broken Tiles. Also, 1 broken Tile observed in Classroom 20. No other changes as of this date.
08/31/2010	Additional Damage in the form of 1 Tile is broken in Pod 1B. No other changes as of this date.
03/05/2014	Tiles are 2'x4' with a 2'x2' pattern. 2 Tiles Water Damaged in rooms 2B, 2C. Quantity changed from 18,500 SF to 17,150 SF. Location changed from ALL CLASSROOMS AND POD AREAS to CLASSROOMS. Original entry updated. No other changes as of this date.

SURVEY REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
01/29/2016	Sample 16-031-014 collected from Science Classroom 29, 2'x4' Suspended Ceiling Tile. Sample 16-031-008 collected from S.G.I. #3, 2'x4' Suspended Ceiling Tile.		
02/08/2016	Sample 16-031-064 collected from Science Classroom 19, 2'x4' Suspended Ceiling Tile.		
09/13/2016	Additional Damage Observed. <5% Physical Damage - in the form of 1 Tile missing in Classroom 4B and 1 Tile missing in Classroom 6B. No othe changes as of this date.		
09/01/2017	Partial Repairs Observed. All the Tiles with Water Damage in the Classrooms have been Painted Over. All the Missing Tiles in Classrooms 4B and 6B have been Replaced. Material remains in FAIR condition as of this date.		
02/14/2018	Additional Damage Observed. Place1 has 4 Tiles with Water Damgae, 1 Tile was Replaced. No other chagnes as of this date.		
02/06/2019	This Material is unchanged as of this date.		
08/14/2019	Additional Damage Observed. <5% Physical Damage in the form of 1 Tiles with Stains in Classroom 5C. There are 3 Tiles with Stains in Classroom 1B. Material Condition remains in FAIR condition overall. No other changes as of this date.		
02/03/2020	This Material is unchanged as of this date.		
08/28/2020	This Material is unchanged as of this date.		
02/10/2021	Additional Damage Observed. 1 Tile with Broken Edges in Classroom 1C. No other changes as of this date.		
08/11/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	Additional Damage Observed. <5% Physical Damage in the form of 2 SF Water Stain in Classroom 2B. Material remains in FAIR condition overall. No other changes as of this date.		
02/15/2023	This Material is unchanged as of this date.		
08/16/2023	Additional Damage Observed. <5% Physical Damage in the form of 4 Tiles with 3 SF of Stains and 1 Tile with 6" of Cracks and Missing Pieces in Work Room between Classroom 1A and 1B. 2 Tiles with a total of 4 SF of Stains in Classroom 4B. 3 Tiles with a total of 4 SF of Stains in Classroom 19. Material remains in FAIR condition overall. No other changes as of this date.		
02/14/2024	This Material is unchanged as of this date.		
05-212AAA	ASSUMED	NO SAMPLE	(NS)
16-031-014	ND	NONE DETECTED	(ND)
16-031-008	ND	NONE DETECTED	(ND)
16-031-064	ND	NONE DETECTED	(ND)

SURVEY REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

MAIN BUILDING

CLASSROOMS 19, 21, 23, 26, 28, PREP ROOM 3, COMPUTER ROOM, CUSTODIAN ROOM, LOUNGE ROOM, COUNSELOR OFFICE, BOOK STORAGE ROOM, OFFICES, PLACE 1, PLACE 2 AND TWO COORIDORS

SUSPENDED CEILING TILE

10,150 SF

09/12/2005	2'X4' Suspended Ceiling Tile. Approximatly 50 SF is damaged and missing. This Material is in FAIR condition overall as of this date.
03/06/2007	Material reassessed. Damage Observed < 5%; in the form of approximately 50 SF located in the Supply/Electrical Room. Damage Condition changed from FAIR condition to FAIR condition overall. No other changes as of this date.
04/16/2008	In the Supply/Electrical Room several Tiles are broken and >50% are missing or loose. The remainder of this Material is unchanged as of this date.
10/16/2008	Classroom 28 has 4 Tiles water stained. No other changes as of this date.
05/14/2009	Additional Material identified. Location changed from CLASSROOMS 19, 21, 23, 26, 28, PREP ROOM 3, COMPUTER ROOM, CUSTODIAN ROOM, LOUNGE ROOM, COUNSELOR OFFICE, AND MEDIA CENTER to CLASSROOMS 19, 21, 23, 26, 28, PREP ROOM 3, COMPUTER ROOM, CUSTODIAN ROOM, LOUNGE ROOM, COUNSELOR OFFICE, MEDIA CENTER AND BOOK STORAGE ROOM. Quantity changed from 9,950 SF to 10,150 SF. Missing Tiles in the Supply / Electrical Room have been replaced. Now, 1 Tile is missing in this area. Additional Damage observed. 2 Tiles are water damaged in the Electrical Room and 3 Tiles are water damaged in the Book Storage Room. This Material is unchanged as of this date.
09/04/2009	Damage reassessed. 2 Tiles water damaged previously observed in Electrical Room is now changed to 4 Tiles. Material remains in <5% physical damage and <10% water damage. No other changes as of this date.
08/31/2010	Additional damage observed in the form of 6 Tiles are water damaged in Classroom 21. No other changes as of this date.
12/01/2011	Additional damage - in the form of Lounge Room has 1 broken Ceiling Tile. No other changes as of this date.
03/05/2014	Location changed from CLASSROOMS 19, 21, 23, 26, 28, PREP ROOM 3, COMPUTER ROOM, CUSTODIAN ROOM, LOUNGE ROOM, COUNSELOR OFFICE, MEDIA CENTER AND BOOK STORAGE ROOM to CLASSROOMS 19, 21, 23, 26, 28, PREP ROOM 3, COMPUTER ROOM, CUSTODIAN ROOM, LOUNGE ROOM, COUNSELOR OFFICE, BOOK STORAGE ROOM, OFFICES, PLACE 1, PLACE 2. No other changes as of this date.
09/18/2015	Additional damage observed and location reassessed. Location description changed from 'CLASSROOMS 19, 21, 23, 26, 28, PREP ROOM 3, COMPUTER ROOM, CUSTODIAN ROOM, LOUNGE ROOM, COUNSELOR OFFICE, BOOK STORAGE ROOM, OFFICES, PLACE 1, PLACE 2' to 'CLASSROOMS 19, 21, 23, 26, 28, PREP ROOM 3, COMPUTER ROOM, CUSTODIAN ROOM, LOUNGE ROOM, COUNSELOR OFFICE, BOOK STORAGE ROOM, OFFICES, PLACE 1, PLACE 2 AND TWO COORIDORS'. Cooridor of Pod-1 and Pod-2 has 2 Tiles missing. No other change as of this date.
01/29/2016	Sample 16-031-013 collected from Staff Lounge, 2'x4' Suspended Ceiling Tile.

SURVEY REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
09/13/2016	Additional Damage Observed. <10% Water Damage - in the form of 1 Tile with Water Damage in Place 1.		
03/30/2017	Additional Damage Observed. 1 Tile with Water Damage in Secretary's Office. 2 Tiles with Water Damage in Social Worker's Office. 3 Tiles with Water Damage 4 Tiles Broken and 1 Tile Missing in Custodian Room's. 2 Tiles with Water Damage in Place 1. No other changes as of this date.		
09/01/2017	Additional Damage Observed. North Corridor now has 2 Tiles with Physical Damage. Secretary's Office now has 3 Tiles with Water Damage. No other changes as of this date.		
02/14/2018	Additional Damage Observed. Water Damage in Secretary's Office has been Painted over. Material Remains in FAIR condition. No other changes as of this date.		
08/15/2018	Additional Damage Observed. Corridors have 20 Tiles in Scattered Locations with Small Holes and Cipped Corners. No other changes as of this date.		
02/06/2019	This Material is unchanged as of this date.		
08/14/2019	This Material is unchanged as of this date.		
02/03/2020	This Material is unchanged as of this date.		
08/28/2020	Additional Damage Observed. <5% Physical Damage in the form of 2 Tiles with Surface Damage in Hallway near Staff Lounge. Material remains in FAIR condition overall. No other changes as of this date.		
02/10/2021	This Material is unchanged as of this date.		
08/11/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	This Material is unchanged as of this date.		
02/15/2023	This Material is unchanged as of this date.		
08/16/2023	This Material is unchanged as of this date.		
02/14/2024	This Material is unchanged as of this date.		
05-212AAA	ASSUMED	NO SAMPLE	(NS)
16-031-013	ND	NONE DETECTED	(ND)

MAIN BUILDING

CLASSROOMS 19-24, NURES' OFFICE, PODS 1-6, COPY ROOM AND ENTRY PALCE 3

VINYL FLOOR TILE

10,400 SF

09/13/2016 New 12"x12" Beige Yellow and Blue Vinyl Floor Tiles, installed during Summer 2016 Modernization Project. This Material is in GOOD condition as of this date.

SURVEY REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
02/14/2018	Damage Observed. <5% Physical Damage - in the form o f 2 Tiles Starting to Crack in Pod 6 Entry. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.		
08/15/2018	Additional Damage Observed. 1 Tile is Broken and 2 Tiles have Holes with Mastic Exposed in Copy Room. No other changes as of this date.		
02/06/2019	This Material is unchanged as of this date.		
08/14/2019	This Material is unchanged as of this date.		
02/03/2020	This Material is unchanged as of this date.		
08/28/2020	This Material is unchanged as of this date.		
02/10/2021	This Material is unchanged as of this date.		
08/11/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	This Material is unchanged as of this date.		
02/15/2023	This Material is unchanged as of this date.		
08/16/2023	This Material is unchanged as of this date.		
02/14/2024	This Material is unchanged as of this date.		

16-213AAA

NEW

NO SAMPLE

(NS)

MAIN BUILDING

CLASSROOMS 19-24, NURES' OFFICE, PODS 1-6, COPY ROOM AND ENTRY PALCE 3

VINYL FLOOR TILE MASTIC

10,400 SF

09/13/2016	New 12"x12" Beige Yellow and Blue Vinyl Floor Tiles, installed during Summer 2016 Modernization Project. This Material is in GOOD condition as of this date.		
02/14/2018	Damage Observed. <5% Physical Damage - in the form o f 2 Tiles Starting to Crack in Pod 6 Entry. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.		
08/15/2018	Additional Damage Observed. 1 Tile is Broken and 2 Tiles have Holes with Mastic Exposed in Copy Room. No other changes as of this date.		
02/06/2019	This Material is unchanged as of this date.		
08/14/2019	This Material is unchanged as of this date.		

SURVEY REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
02/03/2020	This Material is unchanged as of this date.		
08/28/2020	This Material is unchanged as of this date.		
02/10/2021	This Material is unchanged as of this date.		
08/11/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	This Material is unchanged as of this date.		
02/15/2023	This Material is unchanged as of this date.		
08/16/2023	This Material is unchanged as of this date.		
02/14/2024	This Material is unchanged as of this date.		
16-213AAA	NEW	NO SAMPLE	(NS)

MAIN BUILDING

ENTIRE BUILDING

SMOOTH WALL MISCELLANEOUS

76,000 SF

09/12/2005	Gypsum Wallboard System Walls and Ceilings. Approximatly 10 SF Water Damaged in Ceiling of South Hallway. This Material is in FAIR condition as of this date.
03/06/2007	Material Description changed from ' Gypsum Wallboard System Walls and Ceilings. ' to ' Gypsum Wallboard System, (under 4'x10' Pressed Wood Wall Panel with Vinyl Wall Cover in some areas). All known Damages Repaired. Material Condition changed from FAIR to GOOD. Friability changed from Moderate to Low. No other changes as of this date.
05/14/2009	Holes, gouges and cuts observed on the walls in the Electrical Panel and Telephone Panel Room and to the ceiling of the Electrical Panel Room next to the Staff Work Room. 10 SF is Water Damaged in the Electrical Closet in Pod 1, on the Lower Walls around the Sink. This Material is in FAIR condition as of this date.
09/04/2009	Material remains in <5% Physical Damage and <10% Water Damage. This Material is unchanged as of this date.
01/29/2016	Sample 16-031-019 collected from Corridor 18C, Gypsum Board. Sample 16-031-020 collected from Corridor 18C, Joint Compound for Drywall Board. Sample 16-031-023 collected from Custodian #7, Gypsum Board. Sample 16-031-024 collected from Custodian #7, Joint Compound for Drywall Board. Sample 16-031-026 collected from Corridor 6, Drywall Board. Sample 16-031-027 Corridor 6, Joint Compound for Drywall.
02/08/2016	Sample 16-031-053 collected from Main Lobby by Drinking Fountain, Wallboard. Sample 16-031-055 collected from Main Lobby by Drinking Fountain, Joint Compound on Wallboard.

SURVEY REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
09/13/2016	Material Re-assessed. Some Material Removed as part of the Summer 2016 Modernization Project. No other changes as of this date.		
02/06/2019	This Material is unchanged as of this date.		
08/14/2019	This Material is unchanged as of this date.		
02/03/2020	Repairs Observed. All Damage Repaired. Material Condition changed from FAIR to GOOD. Friability updated from Friable to Non-Friable. No other changes as of this date.		
08/28/2020	This Material is unchanged as of this date.		
02/10/2021	This Material is unchanged as of this date.		
08/11/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	This Material is unchanged as of this date.		
02/15/2023	This Material is unchanged as of this date.		
08/16/2023	This Material is unchanged as of this date.		
02/14/2024	This Material is unchanged as of this date.		

05-212AAA	ASSUMED	NO SAMPLE	(NS)
16-031-019	ND	NONE DETECTED	(ND)
16-031-020	ND	NONE DETECTED	(ND)
16-031-023	ND	NONE DETECTED	(ND)
16-031-024	ND	NONE DETECTED	(ND)
16-031-026	ND	NONE DETECTED	(ND)
16-031-027	2%	CHRYSTILE	(CH)
16-031-053	ND	NONE DETECTED	(ND)
16-031-055	ND	NONE DETECTED	(ND)

MAIN BUILDING

ENTIRE BUILDING

SMOOTH WALL SURFACING

76,000 SF

08/24/2006 Skim Coat for Gypsum Wallboard System Walls and Ceilings. Approximatly 10 SF Water Damaged in Ceiling of South Hallway. This Material is in FAIR condition as of this date.

SURVEY REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
03/06/2007	Material Description changed from 'Skim Coat for Gypsum Wallboard System Walls and Ceilings' to ' Skim Coat for Gypsum Wallboard System, (under 4'x10' Pressed Wood Wall Panel with Vinyl Wall Cover in some areas). All known Damages Repaired. Material Condition changed from FAIR to GOOD. Friability changed from MODERATE to LOW. No other changes as of this date.		
05/14/2009	Holes, gouges and cuts observed on the walls in the Electrical Panel and Telephone Panel Room and to the ceiling of the Electrical Panel Room next to the Staff Work Room. 10 SF is Water Damaged in the Electrical Closet in Pod 1, on the Lower Walls around the Sink. Friability changed from Low to Moderate. This Material is in FAIR condition as of this date.		
09/04/2009	Material remains in <5% Physical Damage and <10% Water Damage. This Material is unchanged as of this date.		
01/29/2016	Sample 16-031-021 collected from Corridor 18C, Skim Coat and Paint for Gypsum Board. Sample 16-031-025 collected from Custodian #7, Skim Coat and Paint for Gypsum Board. Sample 16-031-028 collected from Corridor 6, Skim Coat and Paint for Drywall Board.		
02/08/2016	Sample 16-031-054 collected from Main Lobby by Drinking Fountain, Skim Coat on Wallboard.		
09/13/2016	Material Re-assessed. Some Material Remvoed as part of the Summer 2016 Modernization Project. No other changes as of this date.		
09/01/2017	Partial Repairs Observed. 10 SF of Water Damage have been Repaired in the Ceiling of South Hallway.		
02/06/2019	This Material is unchanged as of this date.		
08/14/2019	This Material is unchanged as of this date.		
02/03/2020	Repairs Observed. All Damage Repaired. Material Condition changed from FAIR to GOOD. Friability updated from Friable to Non-Friable. No other changes as of this date.		
08/28/2020	This Material is unchanged as of this date.		
02/10/2021	This Material is unchanged as of this date.		
08/11/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	This Material is unchanged as of this date.		
02/15/2023	This Material is unchanged as of this date.		
08/16/2023	This Material is unchanged as of this date.		
02/14/2024	This Material is unchanged as of this date.		

06-223AAA	ASSUMED	NO SAMPLE	(NS)
16-031-021	ND	NONE DETECTED	(ND)
16-031-021	<1	CHRYSTOLE	(CH)

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
16-031-025	ND	NONE DETECTED	(ND)
16-031-028	ND	NONE DETECTED	(ND)
16-031-028	2%	CHRYSTILE	(CH)
16-031-054	ND	NONE DETECTED	(ND)

MAIN BUILDING

ENTRY FOYERS AND CLASSROOM WINDOWS

ASBESTOS CEMENT WALL PANEL

286 SF

09/12/2005	Asbestos Cement Window Panels. This Material is in GOOD condition as of this date.
02/06/2019	This Material is unchanged as of this date.
08/14/2019	This Material is unchanged as of this date.
02/03/2020	This Material is unchanged as of this date.
08/28/2020	This Material is unchanged as of this date.
02/10/2021	This Material is unchanged as of this date.
08/11/2021	This Material is unchanged as of this date.
02/18/2022	This Material is unchanged as of this date.
08/17/2022	This Material is unchanged as of this date.
02/15/2023	This Material is unchanged as of this date.
08/16/2023	This Material is unchanged as of this date.
02/14/2024	This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

MAIN BUILDING

HALLWAY, MEDIA CENTER, NORTH OFFICE, AND MAIN OFFICE

CEILING MASTIC

6,000 SF

09/12/2005	Mastic/Adhesive for 1'X1' Ceiling Tile. Approximately 10 SF Water Damage in Ceiling of South Hallway, next to Room 28. This Material is in FAIR condition as of this date.
03/06/2007	Approximate 10 SF Water Damage on Ceiling of Hallway, next to Room 28 Repaired. New Damage: < 5% Physical Damage - in Entry Area (next to RSP Room) in the form of approximately 80 SF of gouging and holes. No other changes as of this date.

SURVEY REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
09/04/2009	Material remains in <5% physical damage and <10% water damage. This Material is unchanged as of this date.		
12/01/2011	Additional damage - in the form of Media Center has 1 Tile broken and 2 Tiles are water stained. No other changes as of this date.		
01/29/2016	Sample 16-031-002 collected from Lobby Area, Brown Mastic/Adhesive for 1'x1' Ceiling Tile.		
03/30/2017	Additional Damage Observed. 4 Tiles with Cracks in RSP Room. No other changes as of this date.		
02/14/2018	Additional Damage Observed. 25 Tiles have Physical Damage gouging and holes in them in RSP Room. Media Center Damages have been Repaired. No other changes as of this date.		
02/06/2019	This Material is unchanged as of this date.		
08/14/2019	This Material is unchanged as of this date.		
02/03/2020	This Material is unchanged as of this date.		
08/28/2020	This Material is unchanged as of this date.		
02/10/2021	This Material is unchanged as of this date.		
08/11/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	This Material is unchanged as of this date.		
02/15/2023	This Material is unchanged as of this date.		
08/16/2023	This Material is unchanged as of this date.		
02/14/2024	This Material is unchanged as of this date.		
05-212AAA	ASSUMED	NO SAMPLE	(NS)
16-031-002	ND	NONE DETECTED	(ND)

MAIN BUILDING

HALLWAY, MEDIA CENTER, NORTH OFFICE, AND MAIN OFFICE

CEILING TILE

6,000 SF

09/12/2005	1'X1' Ceiling Tile. Approximately 10 SF Water Damage in Ceiling of South Hallway, next to Room 28. This Material is in FAIR condition as of this date.
03/06/2007	Approximate 10 SF Water Damage on Ceiling of Hallway, next to Room 28 Repaired. New Damage:
05/14/2009	Additional Damaged observed. 18 Tiles are gouged or have holes. No other changes as of this date.

SF= Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
09/04/2009	Material remains in <5% physical damage and <10% water damage. Previously noted damages are in several locations. This Material is unchanged as of this date.		
12/01/2011	Additional damage - in the form of Media Center has 1 Tile broken and 2 Tiles are water stained. No other changes as of this date.		
01/29/2016	Sample 16-031-001 collected from Lobby Area, 1'x1' Glue on Ceiling Tile.		
03/06/2017	< 5% Physical Damage - in Entry Area (next to RSP Room) in the form of approximately 80 SF of gouging and holes. No other changes as of this date.		
03/30/2017	Additional Damage Observed. 4 Tiles with Cracks in RSP Room. No other changes as of this date.		
02/14/2018	Additional Damage Observed. 25 Tiles have Physical Damage gouging and holes in them in RSP Room. Media Center Damages have been Repaired. No other changes as of this date.		
02/06/2019	This Material is unchanged as of this date.		
08/14/2019	This Material is unchanged as of this date.		
02/03/2020	This Material is unchanged as of this date.		
08/28/2020	This Material is unchanged as of this date.		
02/10/2021	This Material is unchanged as of this date.		
08/11/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	This Material is unchanged as of this date.		
02/15/2023	This Material is unchanged as of this date.		
08/16/2023	This Material is unchanged as of this date.		
02/14/2024	This Material is unchanged as of this date.		
05-212AAA	ASSUMED	NO SAMPLE	(NS)
16-031-001	ND	NONE DETECTED	(ND)

MAIN BUILDING

HALLWAYS, OFFICES, MEDIA CENTER, PREP AREA, STORAGE ROOM, UTILITY ROOMS, ALL CLASSROOMS

BASEBOARD MASTIC

11,000 LF

09/13/2016 New 4" and 6" Dark Brown Baseboards, installed during Summer 2016 Modernization Project. This Material is in GOOD condition as of this date.

SURVEY REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
02/06/2019	This Material is unchanged as of this date.		
08/14/2019	This Material is unchanged as of this date.		
02/03/2020	This Material is unchanged as of this date.		
08/28/2020	This Material is unchanged as of this date.		
02/10/2021	This Material is unchanged as of this date.		
08/11/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	This Material is unchanged as of this date.		
02/15/2023	This Material is unchanged as of this date.		
08/16/2023	This Material is unchanged as of this date.		
02/14/2024	This Material is unchanged as of this date.		
16-213AAA	NEW	NO SAMPLE	(NS)

MAIN BUILDING

HALLWAYS TO PODS, AND LIBRARY (BOOK AREA AND BOOK RETURN AREA)

SUSPENDED CEILING TILE

1,350 SF

03/05/2014	2'x2' Suspended Ceiling Tiles. 2 Tiles have Water Damage and 1 Tile has a Hole in the Library. This Material is in FAIR condition as of this date.
01/29/2016	Sample 16-031-003 collected from Hallway 18C, 2'x2' Suspended Ceiling Tile.
03/22/2016	Additional Damage observed. Library has 1 Tile missing. No other changes as of this date.
09/01/2017	Partial Repairs Observed. All Missing Tiles in the Library have been Replaced. Material remains in FAIR condition.
02/14/2018	Additional Damage Observed. All Hallways have Several Tiles with Holes and Chipped Corners. No other changes as of this date.
02/06/2019	This Material is unchanged as of this date.
08/14/2019	This Material is unchanged as of this date.
02/03/2020	This Material is unchanged as of this date.

SURVEY REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
08/28/2020	Additional Damage Observed. <5% Physical Damage in the form of 4 Tiles with Holes in Hallway to Pods 1 and 2. Material remains in FAIR condition overall. No other changes as of this date.		
02/10/2021	This Material is unchanged as of this date.		
08/11/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	This Material is unchanged as of this date.		
02/15/2023	This Material is unchanged as of this date.		
08/16/2023	This Material is unchanged as of this date.		
02/14/2024	This Material is unchanged as of this date.		
14-051AAA	ASSUMED	NO SAMPLE	(NS)
16-031-003	ND	NONE DETECTED	(ND)

MAIN BUILDING

NURSES' OFFICE AND LOBBY

BASEBOARD MASTIC

180 LF

09/13/2016	New 6" Dark Brown Baseboards, installed during Summer 2016 Modernization Project. Material is in GOOD condition as of this date.		
02/06/2019	This Material is unchanged as of this date.		
08/14/2019	This Material is unchanged as of this date.		
02/03/2020	This Material is unchanged as of this date.		
08/28/2020	This Material is unchanged as of this date.		
02/10/2021	This Material is unchanged as of this date.		
08/11/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	This Material is unchanged as of this date.		
02/15/2023	This Material is unchanged as of this date.		
08/16/2023	This Material is unchanged as of this date.		

SURVEY REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/14/2024 This Material is unchanged as of this date.

16-213AAA	NEW	NO SAMPLE	(NS)
-----------	-----	-----------	--------

MAIN BUILDING

OFFICES, LOBBIES, HALLWAYS, MEDIA CENTER, CLASSROOMS POD 1-6, AND CLASSROOMS 25 AND 26

CARPET MASTIC

18,000 SF

09/13/2016 Mastic/Adhesive for Multi Colored Carpet (Original Entry Updated 8/17/22). This Material is in GOOD condition as of this date.

02/06/2019 This Material is unchanged as of this date.

08/14/2019 This Material is unchanged as of this date.

02/03/2020 This Material is unchanged as of this date.

08/28/2020 This Material is unchanged as of this date.

02/10/2021 This Material is unchanged as of this date.

08/11/2021 This Material is unchanged as of this date.

02/18/2022 This Material is unchanged as of this date.

08/17/2022 Material Re-Assessed. Material not observed, Material may exist under current Multi Colored Carpet. No other changes as of this date.

02/15/2023 This Material is unchanged as of this date.

08/16/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

16-213AAA	NEW	NO SAMPLE	(NS)
-----------	-----	-----------	--------

MAIN BUILDING

STAFF AND ALL STUDENT RESTROOMS

MORTAR MISCELLANEOUS

2,800 SF

10/16/2008 Grout/Mortar for 4"x4" Multi-Colored Ceramic Wall Tiles. This Material is in GOOD condition as of this date.

05/14/2009 This Material is unchanged as of this date. (Apparent New Material identified by the AHERA accredited Inspector.)

SURVEY REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
02/08/2016	Sample 16-031-052 collected from Main Lobby by Drinking Fountain, Mortar for 4"x4" Grey Ceramic Wall Tile.		
02/06/2019	This Material is unchanged as of this date.		
08/14/2019	This Material is unchanged as of this date.		
02/03/2020	This Material is unchanged as of this date.		
08/28/2020	Damage Observed. <5% Physical Damage in the form of 7 Tiles with Holes in Boys Restroom near Pod 1. 4 Tiles with Holes in Girls Restroom near Pod 1. Material condition changed from GOOD to FAIR overall. Friability updated from Non-Friable to Friable. No other changes as of this date.		
02/10/2021	This Material is unchanged as of this date.		
08/11/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	This Material is unchanged as of this date.		
02/15/2023	This Material is unchanged as of this date.		
08/16/2023	This Material is unchanged as of this date.		
02/14/2024	This Material is unchanged as of this date.		

08-241AAA	ASSUMED	NO SAMPLE	(NS)
16-031-052	ND	NONE DETECTED	(ND)

MAIN BUILDING

STAFF LOUNGE ROOM, STAFF WORK ROOM, 1 IN EACH POD ENTRY (6 PODS), CLASSROOMS 21, 26, 27, 29, AND STORAGE

SINK UNDERCOATING

114 SF

04/16/2008	Gray, Black and Beige Thermal Undercoating on Sink (2 EA Sinks). This Material is in GOOD condition as of this date (Original Entry updated on 04/11/12).
03/11/2010	Location Description changed from STAFF LOUNGE ROOM AND STAFF WORK ROOM to STAFF LOUNGE ROOM, STAFF WORK ROOM, AND 1 IN EACH POD ENTRY (6 PODS). Quantity changed from 10 SF to 40 SF. Material Description changed from 'Thermal Undercoating on Sink. (2 EA Sinks).' to 'Thermal Undercoating on Sink. (8 EA Sinks).' No other changes as of this date.
08/31/2010	Location Description changed from STAFF LOUNGE ROOM, STAFF WORK ROOM, AND 1 IN EACH POD ENTRY (6 PODS) to STAFF LOUNGE ROOM, STAFF WORK ROOM, 1 IN EACH POD ENTRY (6 PODS), CLASSROOMS 21, 26, 27, 29, AND STORAGE. Quantity changed from 40 SF to 114 SF. No other changes as of this date.

SURVEY REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
04/11/2012	Undercoating is Gray, Black and Beige. Original entry updated. No other changes as of this date.		
02/06/2019	This Material is unchanged as of this date.		
08/14/2019	This Material is unchanged as of this date.		
02/03/2020	This Material is unchanged as of this date.		
08/28/2020	This Material is unchanged as of this date.		
02/10/2021	This Material is unchanged as of this date.		
08/11/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	This Material is unchanged as of this date.		
02/15/2023	This Material is unchanged as of this date.		
08/16/2023	This Material is unchanged as of this date.		
02/14/2024	This Material is unchanged as of this date.		
08-075AAA	ASSUMED	NO SAMPLE	(NS)

MAIN BUILDING

STAFF RESTROOMS (2), STUDENT RESTROOMS (6), AND HEALTH OFFICE RESTROOM

MORTAR MISCELLANEOUS

1,500 SF

03/11/2010	Grout/Mortar for 12"x12" Ceramic Floor Tiles, and 8" Baseboard Tiles. (Gray in Students' Restroom, and Tan in Staffs' Restroom). (Apparent New Floor and Wall Material identified by the AHERA accredited Inspector). This Material is in GOOD condition as of this date.		
02/06/2019	This Material is unchanged as of this date.		
08/14/2019	This Material is unchanged as of this date.		
02/03/2020	This Material is unchanged as of this date.		
08/28/2020	This Material is unchanged as of this date.		
02/10/2021	This Material is unchanged as of this date.		
08/11/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		

SURVEY REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
08/17/2022	This Material is unchanged as of this date.		
02/15/2023	This Material is unchanged as of this date.		
08/16/2023	This Material is unchanged as of this date.		
02/14/2024	This Material is unchanged as of this date.		
10-052AAA	ASSUMED	NO SAMPLE	(NS)

MAIN BUILDING

THREE ELECTRICAL ROOMS, PREP ROOM, THREE STORAGE ROOMS, AND DARK ROOM

VINYL FLOOR TILE

1,340 SF

09/12/2005	12"X12" beige VINYL FLOOR TILE. This Material is in GOOD condition as of this date.		
03/06/2007	Damage Observed.<5% Physical Damage - in the form of 3 chipped Tiles and 1 missing Tile in center of Staff Workroom. Material Condition changed from GOOD to FAIR overall. No other changes as of this date.		
11/07/2007	All Damages repaired and replaced with New Material. This Material is in GOOD condition as of this date.		
10/11/2012	Damage Observed. <5% Physical Damage - in the form of Electrical Room, next to Pod A, has 1 Tile missing and 1 Tile is loose. Material condition changed from GOOD to FAIR overall. No other changes as of this date.		
08/15/2018	Additional Damage Observed. 2 SF of Water Damage with Seeping Mastic and 1 Broken Tile by Men's Restroom. No other changes as of this date.		
02/06/2019	This Material is unchanged as of this date.		
08/14/2019	This Material is unchanged as of this date.		
02/03/2020	This Material is unchanged as of this date.		
08/28/2020	This Material is unchanged as of this date.		
02/10/2021	This Material is unchanged as of this date.		
08/11/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	This Material is unchanged as of this date.		
02/15/2023	This Material is unchanged as of this date.		
08/16/2023	This Material is unchanged as of this date.		

SURVEY REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/14/2024 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

MAIN BUILDING

THREE ELECTRICAL ROOMS, PREP ROOM, THREE STORAGE ROOMS, AND DARK ROOM

VINYL FLOOR TILE MASTIC

1,340 SF

09/12/2005 Mastic/Adhesive for 12"X12" beige VINYL FLOOR TILE. This Material is in GOOD condition as of this date.

03/06/2007 Damage Observed. <5% Physical Damage - in the form of 3 chipped Tiles and 1 missing Tile in center of Staff Workroom. Damage Condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.

11/07/2007 All Damages Repaired and Replaced with New Material. Friability changed from Moderate to Low. This Material is in GOOD condition as of this date.

10/11/2012 Damage Observed. <5% Physical Damage - in the form of Electrical Room, next to Pod A, has 1 Tile missing and 1 Tile is loose. Material condition changed from GOOD to FAIR overall. No other changes as of this date.

08/15/2018 Additional Damage Observed. 2 SF of Water Damage with Seeping Mastic and 1 Broken Tile by Men's Restroom. No other changes as of this date.

02/06/2019 This Material is unchanged as of this date.

08/14/2019 This Material is unchanged as of this date.

02/03/2020 This Material is unchanged as of this date.

08/28/2020 This Material is unchanged as of this date.

02/10/2021 This Material is unchanged as of this date.

08/11/2021 This Material is unchanged as of this date.

02/18/2022 This Material is unchanged as of this date.

08/17/2022 This Material is unchanged as of this date.

02/15/2023 This Material is unchanged as of this date.

08/16/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

SURVEY REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

METAL STORAGE CONTAINERS (4 EA)

METAL STORAGE CONTAINERS (4 EA)

05/14/2009	BUILDING NOTES:		
05/14/2009	Metal Storage Containers (2 EA).		
09/04/2009	Building Name changed from METAL STORAGE CONTAINERS (2 EA) to METAL STORAGE CONTAINERS (3 EA). (2 are located in the Shop's Storage Yard next to Classrooms 22-25. 1 is located on West side of the Locker Rooms Building next to Multipurpose Room).		
08/31/2010	Building Name changed from METAL STORAGE CONTAINERS (3 EA) to METAL STORAGE CONTAINERS (4 EA). Area changed from 920 SF to 1,420 SF.		

METAL STORAGE CONTAINERS (4 EA)

METAL STORAGE CONTAINERS (4 EA)

STORAGE CONTAINER

1,420 SF

03/22/2016	Metal Storage Structures. 4 EA, Approximately 355 SF EA.		
02/06/2019	This Material is unchanged as of this date.		
08/14/2019	This Material is unchanged as of this date.		
02/03/2020	This Material is unchanged as of this date.		
08/28/2020	This Material is unchanged as of this date.		
02/10/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	This Material is unchanged as of this date.		
02/15/2023	This Material is unchanged as of this date.		
02/14/2024	This Material is unchanged as of this date.		

16-074.NS	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

SURVEY REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

MULTI-PURPOSE BUILDING

MULTI-PURPOSE BUILDING

03/06/2007 BUILDING NOTES:

03/06/2007 Building Name changed from GYM, LOCKER ROOMS, AND MUSIC ROOMS to MULTI-PURPOSE BUILDING. No other changes as of this date.

MULTI-PURPOSE BUILDING

ASSEMBLY ROOM OF MULTI-PURPOSE ROOM

VINYL WALL COVER

500 SF

03/11/2010 Vinyl Cover on Accordion Wall Partition. Damage Observed. <5% Physical Damage - in the form of existing cuts and holes observed. Mastic is not present. This Material is in FAIR condition as of this date.

03/05/2014 This Material is unchanged as of this date.

08/27/2014 This Material is unchanged as of this date.

09/01/2017 Repairs Observed. Original Vinyl has been Replaced with Replacement Material. No Holes or Cuts are present. Material Condition changed from FAIR to GOOD. Friability changed from Friable to Non-Friable. No other changes as of this date.

02/06/2019 This Material is unchanged as of this date.

08/14/2019 This Material is unchanged as of this date.

02/03/2020 This Material is unchanged as of this date.

08/28/2020 This Material is unchanged as of this date.

02/10/2021 This Material is unchanged as of this date.

02/18/2022 This Material is unchanged as of this date.

08/17/2022 This Material is unchanged as of this date.

02/15/2023 This Material is unchanged as of this date.

08/16/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

10-052AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

SURVEY REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

MULTI-PURPOSE BUILDING

BOILER ROOM NEXT TO GIRLS LOCKER ROOM

DUCT WRAP TAPE

20 SF

09/12/2005 Duct Wrap Tape. This Material is in GOOD condition as of this date.

09/26/2013 This Material is unchanged as of this date.

03/05/2014 This Material is unchanged as of this date.

08/27/2014 This Material is unchanged as of this date.

09/01/2017 This Material is unchanged as of this date.

02/06/2019 This Material is unchanged as of this date.

08/14/2019 This Material is unchanged as of this date.

02/03/2020 This Material is unchanged as of this date.

08/28/2020 This Material is unchanged as of this date.

02/10/2021 This Material is unchanged as of this date.

02/18/2022 This Material is unchanged as of this date.

08/17/2022 This Material is unchanged as of this date.

02/15/2023 This Material is unchanged as of this date.

08/16/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

MULTI-PURPOSE BUILDING

BOYS AND GIRLS, LOCKER ROOMS, COACHES OFFICES, MUSIC ROOM

BASEBOARD MASTIC

500 LF

09/13/2016 Mastic/Adhesive for New 6" Baseboard installed during the Summer 2016 Floor Project. This Material is in GOOD condition as of this date.

02/06/2019 This Material is unchanged as of this date.

08/14/2019 This Material is unchanged as of this date.

SURVEY REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
02/03/2020	This Material is unchanged as of this date.		
08/28/2020	This Material is unchanged as of this date.		
02/10/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	This Material is unchanged as of this date.		
02/15/2023	This Material is unchanged as of this date.		
08/16/2023	This Material is unchanged as of this date.		
02/14/2024	This Material is unchanged as of this date.		
16-213AAA	NEW	NO SAMPLE	(NS)

MULTI-PURPOSE BUILDING

BOYS AND GIRLS RESTROOMS, KITCHEN RESTROOM, LOCKER ROOMS, AND BOYS' AND GIRLS' COACHES' RESTROOM

MORTAR MISCELLANEOUS

2,050 SF

10/16/2008	Grout for 4"x4" and 6"x6" Multi-Colored Ceramic Wall Tiles (Original Entry Updated 8/17/22). This Material is in GOOD condition as of this date.
03/11/2010	Location Description changed from BOYS AND GIRLS RESTROOMS, KITCHEN RESTROOM to BOYS AND GIRLS RESTROOMS, KITCHEN RESTROOM, AND LOCKER ROOMS. Quantity changed from 1,100 SF to 1,700 SF. No other changes as of this date.
12/01/2011	Location Description changed from BOYS AND GIRLS RESTROOMS, KITCHEN RESTROOM, AND LOCKER ROOMS to BOYS AND GIRLS RESTROOMS, KITCHEN RESTROOM, LOCKER ROOMS, AND BOYS' AND GIRLS' COACHES' RESTROOM. Quantity changed from 1,700 SF to 2,050 SF. No other changes as of this date.
03/05/2014	This Material is unchanged as of this date.
08/27/2014	This Material is unchanged as of this date.
09/01/2017	Damage Observed. <5% Physical Damage - in the form of 2 Cracked Tiles in the Girls Locker Room. Material Condition changed from GOOD to FAIR. Friability changed from Non-Friable to Friable. No other changes as of this date.
02/06/2019	This Material is unchanged as of this date.
08/14/2019	This Material is unchanged as of this date.
02/03/2020	This Material is unchanged as of this date.

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
08/28/2020	Additional Damage Observed. <5% Physical Damage in the form of 7 Tiles with Holes in Boys Restroom near Boys Locker Room Entry. Material remains in FAIR condition overall. No other changes as of this date.		
02/10/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	This Material is unchanged as of this date.		
02/15/2023	This Material is unchanged as of this date.		
08/16/2023	This Material is unchanged as of this date.		
02/14/2024	This Material is unchanged as of this date.		
08-241AAA	ASSUMED	NO SAMPLE	(NS)

MULTI-PURPOSE BUILDING

ENTIRE BUILDING

SMOOTH WALL MISCELLANEOUS

18,000 SF

09/12/2005	Gypsum Wallboard System Walls and Ceilings. This Material is in GOOD condition as of this date.		
03/06/2007	Material Description changed from 'Gypsum Wallboard System Walls and Ceilings.' to 'Gypsum Wallboard System, (under 4'x10' Pressed Wood Wall Panel with Vinyl Wall Cover in some areas).' No other changes as of this date.		
05/14/2009	5 SF is Damaged in the PE Storage Room with scratches and holes. Holes present in the Electrical Panel Room. 20 SF is Damaged in the Boiler Room behind the Boiler and the Boiler Room has several holes and cuts. This Material is in FAIR condition as of this date.		
09/04/2009	Material remains in <5% Physical Damage and <10% Water Damage. This Material is unchanged as of this date.		
03/11/2010	Additional Damage observed in the form of several holes, cuts and gouging on various surfaces of Walls in Multi-Purpose Room. Friability changed from Low to Moderate to reflect this change.		
12/01/2011	Additional Damage - in the form of hole observed on Wall of Boys Coaches Office. No other changes as of this date.		
08/27/2014	This Material is unchanged as of this date.		
02/08/2016	Sample 16-031-075 collected from Multi-Use 92, Drywall.		
03/22/2016	Additional Damage observed. Boys Locker Room has a 6 SQ" hole on Wall. Stage has 2 SF of missing Paint, and Skimcoat. White Gypsum Board Paper Cover is exposed due to 6 SQ" of cracks and missing Skimcoat. No other changes as of this date.		

SURVEY REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
09/13/2016	Repairs Observed. Damages repaired as of this date. Material Condition changed from FAIR to GOOD. No other changes as of this date.		
02/06/2019	This Material is unchanged as of this date.		
08/14/2019	This Material is unchanged as of this date.		
02/03/2020	This Material is unchanged as of this date.		
08/28/2020	This Material is unchanged as of this date.		
02/10/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	This Material is unchanged as of this date.		
02/15/2023	This Material is unchanged as of this date.		
08/16/2023	This Material is unchanged as of this date.		
02/14/2024	This Material is unchanged as of this date.		
05-212AAA	ASSUMED	NO SAMPLE	(NS)
16-031-075	ND	NONE DETECTED	(ND)

MULTI-PURPOSE BUILDING

ENTIRE BUILDING

SMOOTH WALL SURFACING

18,000 SF

08/24/2006	Skim Coat for Gypsum Wallboard System Walls and Ceilings. This Material is in GOOD condition as of this date.
03/06/2007	Material Description changed from ' Skim Coat for Gypsum Wallboard System Walls and Ceilings. ' to ' Skim Coat for Gypsum Wallboard System Walls and Ceilings, (under 4'x10' Pressed Wood Wall Panel with Vinyl Wall Cover in some areas). ' No other changes as of this date.
05/14/2009	5 SF is Damaged in the PE Storage Room with scratches and holes. Holes present in the Electrical Panel Room. 20 SF is Damaged in the Boiler Room behind the Boiler and the Boiler Room has several holes and cuts. This Material is in FAIR condition as of this date.
09/04/2009	Material remains in <5% Physical Damage and <10% Water Damage. This Material is unchanged as of this date.
03/11/2010	Additional Damage observed in the form of several holes, cuts and gouging on various surfaces of Walls in Multi-Purpose Room. Friability changed from Low to Moderate to reflect this change.

SURVEY REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
12/01/2011	Additional Damage - in the form of hole observed on Wall of Boys' Coaches' Office. No other changes as of this date.		
03/05/2014	This Material is unchanged as of this date.		
08/27/2014	This Material is unchanged as of this date.		
03/22/2016	Additional Damage observed. Boys Locker Room has a 6 SQ" hole on Wall. Stage has 2 SF of missing paint, and Skimcoat. White Gypsum Board Paper Cover is exposed due to 6 SQ" of cracks and missing Skimcoat. No other changes as of this date.		
09/13/2016	Repairs Observed. Damages repaired as of this date. Material Condition changed from FAIR to GOOD. No other changes as of this date.		
02/06/2019	This Material is unchanged as of this date.		
08/14/2019	This Material is unchanged as of this date.		
02/03/2020	This Material is unchanged as of this date.		
08/28/2020	This Material is unchanged as of this date.		
02/10/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	This Material is unchanged as of this date.		
02/15/2023	This Material is unchanged as of this date.		
08/16/2023	This Material is unchanged as of this date.		
02/14/2024	This Material is unchanged as of this date.		

06-223AAA

ASSUMED

NO SAMPLE

(NS)

MULTI-PURPOSE BUILDING

EXTERIOR WALLS AND OVERHANG

ROUGH WALL

14,360 SF

09/12/2005	Stucco Walls and Overhang. This Material is in GOOD condition as of this date.
03/06/2007	Location Description changed from EXTERIOR WALLS AND OVERHANG to EXTERIOR WALLS AND OVERHANGS. Material Description changed from 'Stucco Walls and Overhang' to ' Stucco Exterior Walls and Overhangs'. No other changes as of this date.
03/05/2014	This Material is unchanged as of this date.

SURVEY REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
08/27/2014	This Material is unchanged as of this date.		
02/06/2019	This Material is unchanged as of this date.		
08/14/2019	This Material is unchanged as of this date.		
02/03/2020	This Material is unchanged as of this date.		
08/28/2020	This Material is unchanged as of this date.		
02/10/2021	Damage Observed. <5% Physical Damage - in the form of 2 LF of Cracks in Food Serving Area. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	This Material is unchanged as of this date.		
02/15/2023	This Material is unchanged as of this date.		
08/16/2023	This Material is unchanged as of this date.		
02/14/2024	This Material is unchanged as of this date.		
05-212AAA	ASSUMED	NO SAMPLE	(NS)

MULTI-PURPOSE BUILDING

EXTERIOR WALLS AND OVERHANG

ROUGH WALL SURFACING

14,360 SF

09/12/2005	Skim Coat for Stucco Walls and Overhang. This Material is in GOOD condition as of this date.		
03/06/2007	Location Description changed from EXTERIOR WALLS AND OVERHANG to EXTERIOR WALLS AND OVERHANGS. Material Description changed from 'Skim Coat for Stucco Walls and Overhang' to ' Skim Coat for Stucco Exterior Walls and Overhangs'. No other changes as of this date.		
03/05/2014	This Material is unchanged as of this date.		
08/27/2014	This Material is unchanged as of this date.		
02/06/2019	This Material is unchanged as of this date.		
08/14/2019	This Material is unchanged as of this date.		
02/03/2020	This Material is unchanged as of this date.		
08/28/2020	This Material is unchanged as of this date.		

SURVEY REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/10/2021 Damage Observed. <5% Physical Damage - in the form of 2 LF of Cracks in Food Serving Area. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.

02/18/2022 This Material is unchanged as of this date.

08/17/2022 This Material is unchanged as of this date.

02/15/2023 This Material is unchanged as of this date.

08/16/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

MULTI-PURPOSE BUILDING

KITCHEN

SEALANT

1,200 LF

05/14/2009 Sealant/Caulking for freezer walls and ceiling. This Material is in GOOD condition as of this date.

09/26/2013 Friability changed from Low to Non. No other changes as of this date.

03/05/2014 This Material is unchanged as of this date.

08/27/2014 This Material is unchanged as of this date.

02/06/2019 This Material is unchanged as of this date.

08/14/2019 This Material is unchanged as of this date.

02/03/2020 This Material is unchanged as of this date.

08/28/2020 This Material is unchanged as of this date.

02/10/2021 This Material is unchanged as of this date.

02/18/2022 This Material is unchanged as of this date.

08/17/2022 This Material is unchanged as of this date.

02/15/2023 This Material is unchanged as of this date.

08/16/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
09-098AAA	ASSUMED	NO SAMPLE	(NS)

MULTI-PURPOSE BUILDING

KITCHEN

VINYL SHEETING

1,400 SF

10/16/2008 Grey Vinyl Sheeting. This Material is in GOOD condition as of this date.

09/26/2013 Friability changed from LOW to NON. No other changes as of this date.

03/05/2014 This Material is unchanged as of this date.

08/27/2014 This Material is unchanged as of this date.

02/06/2019 This Material is unchanged as of this date.

08/14/2019 This Material is unchanged as of this date.

02/03/2020 This Material is unchanged as of this date.

08/28/2020 This Material is unchanged as of this date.

02/10/2021 This Material is unchanged as of this date.

02/18/2022 This Material is unchanged as of this date.

08/17/2022 This Material is unchanged as of this date.

02/15/2023 This Material is unchanged as of this date.

08/16/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

08-241AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

MULTI-PURPOSE BUILDING

KITCHEN

VINYL SHEETING BACKING PAPER/MASTIC

1,400 SF

10/16/2008 Backing Paper for Vinyl Sheeting. This Material is in GOOD condition as of this date.

08/27/2014 This Material is unchanged as of this date.

02/06/2019 This Material is unchanged as of this date.

08/14/2019 This Material is unchanged as of this date.

SURVEY REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
02/03/2020	This Material is unchanged as of this date.		
08/28/2020	This Material is unchanged as of this date.		
02/10/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	This Material is unchanged as of this date.		
02/15/2023	This Material is unchanged as of this date.		
08/16/2023	This Material is unchanged as of this date.		
02/14/2024	This Material is unchanged as of this date.		
08-241AAA	ASSUMED	NO SAMPLE	(NS)

MULTI-PURPOSE BUILDING

KITCHEN EXTERIOR STOARGE (CAGED AREA) AND EXTERIOR WALL CAVITIES

PIPE FITTING INSULATION

6 LF

09/12/2005	Pipe Fitting Insulation, 2 Fittings/4 Muddled Joints. This Material is in GOOD condition as of this date.		
05/14/2009	Additional Material may also exist in Attic, Plenums, Wall/Ceiling cavities and other inaccessible locations. No other changes as of this date.		
03/05/2014	This Material is unchanged as of this date.		
08/27/2014	This Material is unchanged as of this date.		
02/06/2019	This Material is unchanged as of this date.		
08/14/2019	This Material is unchanged as of this date.		
02/03/2020	This Material is unchanged as of this date.		
08/28/2020	This Material is unchanged as of this date.		
02/10/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	This Material is unchanged as of this date.		
02/15/2023	This Material is unchanged as of this date.		

SURVEY REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

08/16/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

MULTI-PURPOSE BUILDING

KITCHEN, STORAGE, ELECTRICAL ROOM, RESTROOM, TABLE STORAGE ROOM, LOCKERS AREA, AND LANDING TO STAGE MULTI-PURPOSE ROOM

FIRE DOOR CORE INSULATION

360 SF

09/12/2005 Fire Door Core Insulation (8 EA DOORS). This Material is in GOOD condition as of this date.

03/06/2007 Friability changed from Low to High. No other changes as of this date.

10/16/2008 Location Description changed from KITCHEN, STORAGE, ELECTRICAL ROOM, RESTROOM, AND TABLE STORAGE ROOM to KITCHEN, STORAGE, ELECTRICAL ROOM, RESTROOM, TABLE STORAGE ROOM, LOCKERS AREA, AND LANDING TO STAGE MULTI-PURPOSE ROOM. Material Quantity changed from 168 SF to 360 SF to reflect this fact. Material Description changed from ' FIRE DOOR CORE INSULATION, (8 EA DOORS). ' to ' FIRE DOOR CORE INSULATION, (17 EA DOORS). ' Damage in Chair Storage. No other changes as of this date.

03/05/2014 This Material is unchanged as of this date.

08/27/2014 This Material is unchanged as of this date.

02/06/2019 This Material is unchanged as of this date.

08/14/2019 This Material is unchanged as of this date.

02/03/2020 This Material is unchanged as of this date.

08/28/2020 This Material is unchanged as of this date.

02/10/2021 This Material is unchanged as of this date.

02/18/2022 This Material is unchanged as of this date.

08/17/2022 This Material is unchanged as of this date.

02/15/2023 This Material is unchanged as of this date.

08/16/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

SURVEY REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

MULTI-PURPOSE BUILDING

MULTI-PURPOSE ROOM

MASTIC/ADHESIVE

5,000 SF

09/13/2016	New Mastic/Adhesive for Vinyl Floor Sheeting with Hardwood Floor Patern installed Summer 2016 Modernization Project. Material is in GOOD condition as of this date.		
02/06/2019	This Material is unchanged as of this date.		
08/14/2019	This Material is unchanged as of this date.		
02/03/2020	This Material is unchanged as of this date.		
08/28/2020	This Material is unchanged as of this date.		
02/10/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	This Material is unchanged as of this date.		
02/15/2023	This Material is unchanged as of this date.		
08/16/2023	This Material is unchanged as of this date.		
02/14/2024	This Material is unchanged as of this date.		

16-213AAA	NEW	NO SAMPLE	(NS)
-----------	-----	-----------	--------

MULTI-PURPOSE BUILDING

MULTI-PURPOSE ROOM

VINYL SHEETING

5,000 SF

09/13/2016	New Vinyl Floor Sheeting with Hardwood Floor Patern installed Summer 2016 Modernization Project. Material is in GOOD condition as of this date.		
02/06/2019	This Material is unchanged as of this date.		
08/14/2019	This Material is unchanged as of this date.		
02/03/2020	This Material is unchanged as of this date.		
08/28/2020	This Material is unchanged as of this date.		
02/10/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		

SURVEY REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

08/17/2022 This Material is unchanged as of this date.

02/15/2023 This Material is unchanged as of this date.

08/16/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

16-213AAA	NEW	NO SAMPLE	(NS)
-----------	-----	-----------	--------

MULTI-PURPOSE BUILDING

MULTI-PURPOSE ROOM, COACH'S OFFICE, STORAGE KITCHEN, AND STORAGE

VINYL FLOOR TILE

75 SF

10/16/2008 12"x12" Beige Vinyl Floor Tile. This Material is in GOOD condition as of this date.

05/14/2009 This Material is unchanged as of this date. (Apparent New Material identified by the AHERA accredited Inspector.)

12/01/2011 Location Description changed from MULTI-PURPOSE ROOM, COACH'S OFFICE, AND STORAGE KITCHEN to MULTI-PURPOSE ROOM, COACH'S OFFICE, STORAGE KITCHEN, AND STORAGE. Quantity changed from 7,500 SF to 7,600 SF. Damage: <5% Physical Damage - in the form of 2 Tiles are broken next to Back Entry Door of Multipurpose Room and Mastic/Adhesive is exposed. Material condition changed from GOOD to FAIR overall as of this date. Friability changed from Non to Low to reflect this change.

03/05/2014 This Material is unchanged as of this date.

08/27/2014 This Material is unchanged as of this date.

09/13/2016 Material Re-assessed. Removed all except for Kitchen Storage. Material Quantitiy changed from 7,600 SF to 75 SF. Material is in GOOD condition overall . No other changes as of this date.

02/06/2019 This Material is unchanged as of this date.

08/14/2019 This Material is unchanged as of this date.

02/03/2020 This Material is unchanged as of this date.

08/28/2020 This Material is unchanged as of this date.

02/10/2021 This Material is unchanged as of this date.

02/18/2022 This Material is unchanged as of this date.

08/17/2022 This Material is unchanged as of this date.

SURVEY REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/15/2023 This Material is unchanged as of this date.

08/16/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

08-241AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

MULTI-PURPOSE BUILDING

MULTI-PURPOSE ROOM, COACH'S OFFICE, STORAGE KITCHEN, AND STORAGE

VINYL FLOOR TILE MASTIC

75 SF

10/16/2008 Mastic/Adhesive for 12"x12" Beige Vinyl Floor Tile. This Material is in GOOD condition as of this date.

05/14/2009 This Material is unchanged as of this date. (Apparent New Material identified by the AHERA accredited Inspector.)

12/01/2011 Location Description changed from MULTI-PURPOSE ROOM, COACH'S OFFICE, AND STORAGE KITCHEN to MULTI-PURPOSE ROOM, COACH'S OFFICE, STORAGE KITCHEN, AND STORAGE. Quantity changed from 7,500 SF to 7,600 SF. Damage: <5% Physical Damage - in the form of 2 Tiles are broken next to back entry door of Multipurpose Room and Mastic is exposed. Material condition changed from GOOD to FAIR overall as of this date. Friability changed from Non to Low to reflect this change.

03/05/2014 This Material is unchanged as of this date.

08/27/2014 This Material is unchanged as of this date.

09/13/2016 Material Re-assessed. Removed all except for Kitchen Storage. Material Quantitiy changed from 7,600 SF to 75 SF. Material is in GOOD condition overall . No other changes as of this date.

02/06/2019 This Material is unchanged as of this date.

08/14/2019 This Material is unchanged as of this date.

02/03/2020 This Material is unchanged as of this date.

08/28/2020 This Material is unchanged as of this date.

02/10/2021 This Material is unchanged as of this date.

02/18/2022 This Material is unchanged as of this date.

08/17/2022 This Material is unchanged as of this date.

02/15/2023 This Material is unchanged as of this date.

08/16/2023 This Material is unchanged as of this date.

SURVEY REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/14/2024 This Material is unchanged as of this date.

08-241AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

MULTI-PURPOSE BUILDING

MUSIC ROOM, MUSIC OFFICE, PRACTICE ROOMS, STAGE AND STAGE STORAGE ROOM

CARPET MASTIC

3,800 SF

09/13/2016 Mastic/Adhesive for Gray Black Carpet (Original Entry Updated 8/17/22). Material is in GOOD condition as of this date.

02/06/2019 This Material is unchanged as of this date.

08/14/2019 This Material is unchanged as of this date.

02/03/2020 This Material is unchanged as of this date.

08/28/2020 This Material is unchanged as of this date.

02/10/2021 This Material is unchanged as of this date.

02/18/2022 This Material is unchanged as of this date.

08/17/2022 Material Re-Assessed. Material not observed, Material may exist under current Gray Black Carpet. No other changes as of this date.

02/15/2023 This Material is unchanged as of this date.

08/16/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

16-213AAA	NEW	NO SAMPLE	(NS)
-----------	-----	-----------	--------

MULTI-PURPOSE BUILDING

MUSIC ROOM, PRACTICE ROOMS (2), AND STAGE

WALL TILE

1,410 SF

10/16/2008 1'x1' Wall Tile. This Material is in GOOD condition as of this date.

03/11/2010 Location Description changed from MUSIC ROOM to MUSIC ROOM, AND PRACTICE ROOMS (3). Quantity changed from 410 SF to 890 SF. No other changes as of this date.

SURVEY REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
12/01/2011	Location Description changed from MUSIC ROOM, AND PRACTICE ROOMS (3) to MUSIC ROOM, PRACTICE ROOMS (2), AND STAGE. Quantity changed from 890 SF to 1,410 SF. Damage: <5% Physical Damage - in the form of Stage area has 1 Tile missing and Mastic is exposed. Material condition changed from GOOD to FAIR overall as of this date. Friability changed from Moderate to High to reflect this change.		
03/05/2014	This Material is unchanged as of this date.		
08/27/2014	This Material is unchanged as of this date.		
03/22/2016	Partial Repair made and Additional Damage observed. Missing Wall Tile of Stage Area has been Replaced. Lower level of the Wall Tile has 60 SF of Tiles with small holes, and cuts. No other changes as of this date.		
03/30/2017	Additional Damage Observed. 2 Tiles Missing Mastic Exposed Stage. No other changes as of this date.		
02/06/2019	This Material is unchanged as of this date.		
08/14/2019	This Material is unchanged as of this date.		
02/03/2020	This Material is unchanged as of this date.		
08/28/2020	Additional Damage Observed. <5% Physical Damage in the form of 6 Tiles with Holes in Music Room. 3 Tiles with Holes in Practice Room 1. 2 Tiles with Scuffs in Practice Room 2. Material remains in FAIR condition overall. No other changes as of this date.		
02/10/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	Additional Damage Observed. <5% Physical Damage in the form of 1 Missing Tile with Brown Mastic Exposed on North Wall of Stage. Material remains in FAIR condition overall. No other changes as of this date.		
02/15/2023	This Material is unchanged as of this date.		
08/16/2023	This Material is unchanged as of this date.		
02/14/2024	This Material is unchanged as of this date.		
08-241AAA	ASSUMED	NO SAMPLE	(NS)

MULTI-PURPOSE BUILDING

MUSIC ROOM, PRACTICE ROOMS (2), AND STAGE

WALL TILE MASTIC

1,410 SF

10/16/2008 Mastic/Adhesive for 1'x1' Wall Tile. This Material is in GOOD condition as of this date.

SURVEY REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
03/11/2010	Location Description changed from MUSIC ROOM to MUSIC ROOM, AND PRACTICE ROOMS (3). Quantity changed from 410 SF to 890 SF. No other changes as of this date.		
12/01/2011	Location Description changed from MUSIC ROOM, AND PRACTICE ROOMS (3) to MUSIC ROOM, PRACTICE ROOMS (2), AND STAGE. Quantity changed from 890 SF to 1,410 SF. Damage: <5% Physical Damage - in the form of Stage area has 1 Tile missing and Mastic is exposed. Material condition changed from GOOD to FAIR overall as of this date. Friability changed from Non to Low to reflect this change.		
03/05/2014	This Material is unchanged as of this date.		
03/22/2016	Partial Repair made and Additional Damage observed. Missing Wall Tile of Stage Area has been Replaced. Lower level of the Wall Tile has 60 SF of Tiles with small holes, and cuts. No other changes as of this date.		
03/30/2017	Additional Damage Observed. 2 Tiles Missing Mastic Exposed by Stage. No other changes as of this date.		
02/06/2019	This Material is unchanged as of this date.		
08/14/2019	This Material is unchanged as of this date.		
02/03/2020	This Material is unchanged as of this date.		
08/28/2020	Additional Damage Observed. <5% Physical Damage in the form of 6 Tiles with Holes in Music Room. 3 Tiles with Holes in Practice Room 1. 2 Tiles with Scuffs in Practice Room 2. Material remains in FAIR condition overall. No other changes as of this date.		
02/10/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	Additional Damage Observed. <5% Physical Damage in the form of 1 Missing Tile with Brown Mastic Exposed on North Wall of Stage. Material remains in FAIR condition overall. No other changes as of this date.		
02/15/2023	This Material is unchanged as of this date.		
08/16/2023	This Material is unchanged as of this date.		
02/14/2024	This Material is unchanged as of this date.		

08-241AAA

ASSUMED

NO SAMPLE

(NS)

MULTI-PURPOSE BUILDING

OLD RESTROOM NEXT TO PE STORAGE ROOM, AND RESTROOM LOCATED BEHIND CLASSROOM 33

TERRAZZO FLOOR

600 SF

05/14/2009 Gray Epoxy Floor (Original Entry Updated 8/17/22). This Material is in GOOD condition as of this date.

SURVEY REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
12/01/2011	Location Description changed from RESTROOM NEXT TO PE STORAGE ROOM to OLD RESTROOM NEXT TO PE STORAGE ROOM, AND RESTROOM LOCATED BEHIND CLASSROOM 33. Quantity changed from 300 SF to 600 SF. No other changes as of this date.		
03/05/2014	This Material is unchanged as of this date.		
08/27/2014	This Material is unchanged as of this date.		
02/06/2019	This Material is unchanged as of this date.		
08/14/2019	This Material is unchanged as of this date.		
02/03/2020	This Material is unchanged as of this date.		
08/28/2020	This Material is unchanged as of this date.		
02/10/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	Material Re-Assessed. Material not observed, Material may exist under current Gray Epoxy Floor. No other changes as of this date.		
02/15/2023	This Material is unchanged as of this date.		
08/16/2023	This Material is unchanged as of this date.		
02/14/2024	This Material is unchanged as of this date.		
09-098AAA	ASSUMED	NO SAMPLE	(NS)

MULTI-PURPOSE BUILDING

PRACTICE ROOM, AND BAND ROOM OFFICE

PRESSED WOOD WALL PANEL

2,960 SF

12/01/2011	Location Description changed from PRACTICE ROOM, MULTI-PURPOSE ROOM, AND BAND ROOM OFFICE to PRACTICE ROOM, AND BAND ROOM OFFICE. No other changes as of this date.		
03/05/2014	This Material is unchanged as of this date.		
08/27/2014	This Material is unchanged as of this date.		
03/06/2017	4'x8' Pressed Wood Wall Panel with Vinyl Wall Cover, (over Gypsum Wallboard System). This Material is in GOOD condition as of this date.		
02/06/2019	This Material is unchanged as of this date.		
08/14/2019	This Material is unchanged as of this date.		

SURVEY REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
02/03/2020	This Material is unchanged as of this date.		
08/28/2020	This Material is unchanged as of this date.		
02/10/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	This Material is unchanged as of this date.		
02/15/2023	This Material is unchanged as of this date.		
08/16/2023	This Material is unchanged as of this date.		
02/14/2024	This Material is unchanged as of this date.		
05-212AAA	ASSUMED	NO SAMPLE	(NS)

MULTI-PURPOSE BUILDING

PRACTICE ROOM, AND BAND ROOM OFFICE

PRESSED WOOD WALL PANEL MASTIC

2,960 SF

12/01/2011	Location Description changed from PRACTICE ROOM, MULTI-PURPOSE ROOM, AND BAND ROOM OFFICE to PRACTICE ROOM, AND BAND ROOM OFFICE. No other changes as of this date.		
03/05/2014	This Material is unchanged as of this date.		
08/27/2014	This Material is unchanged as of this date.		
03/06/2017	Mastic/Adhesive for 4'x8' Pressed Wood Wall Panel with Vinyl Wall Cover, (over Gypsum Wallboard System). This Material is in GOOD condition as of this date.		
02/06/2019	This Material is unchanged as of this date.		
08/14/2019	This Material is unchanged as of this date.		
02/03/2020	This Material is unchanged as of this date.		
08/28/2020	This Material is unchanged as of this date.		
02/10/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	This Material is unchanged as of this date.		
02/15/2023	This Material is unchanged as of this date.		

SURVEY REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

08/16/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

MULTI-PURPOSE BUILDING

PRACTICE ROOM, AND BAND ROOM OFFICE

VINYL WALL COVER

2,960 SF

09/12/2005 Vinyl Wall Cover, (on 4'x8' Pressed Wood Wall Panel over Gypsum Wallboard System. This Material is in GOOD condition as of this date.

03/06/2007 Material Description changed from ' 4'x8' Vinyl Covered Pressed Wood Walls. ' to ' Vinyl Wall Cover, (on 4'x8' Pressed Wood Wall Panel over Gypsum Wallboard System). This Material is in GOOD condition as of this date. No other changes as of this date.

12/01/2011 Location Description changed from PRACTICE ROOM, MULTI-PURPOSE ROOM, AND BAND ROOM OFFICE to PRACTICE ROOM, AND BAND ROOM OFFICE. No other changes as of this date.

09/26/2013 Friability changed from Low to Non. No other changes as of this date.

03/05/2014 This Material is unchanged as of this date.

08/27/2014 This Material is unchanged as of this date.

02/06/2019 This Material is unchanged as of this date.

08/14/2019 This Material is unchanged as of this date.

02/03/2020 This Material is unchanged as of this date.

08/28/2020 Damage Observed. <5% Physical Damage in the form of 1 SF of Torn and Missing Wall Cover around wall Outlet, on the West Wall in the Band Room. Material condition changed from GOOD to FAIR overall. Friability updated from Non-Friable to Friable. No other changes as of this date.

02/10/2021 This Material is unchanged as of this date.

02/18/2022 This Material is unchanged as of this date.

08/17/2022 This Material is unchanged as of this date.

02/15/2023 This Material is unchanged as of this date.

08/16/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

65

HazMat Doc

AHERA Report B - Survey

SURVEY REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

MULTI-PURPOSE BUILDING

PRACTICE ROOM, AND BAND ROOM OFFICE

VINYL WALL COVER MASTIC

2,960 SF

09/12/2005	Mastic/Adhesive for Vinyl Wall Cover, (on 4'x8' Pressed Wood Wall Panel over Gypsum Wallboard System). This Material is in GOOD condition as of this date.
03/06/2007	Material Description changed from ' Mastic/Adhesive for Vinyl Covering on 4'x8' Vinyl Covered Pressed Wood Walls. ' to ' Mastic/Adhesive for Vinyl Wall Cover, (on 4'x8' Pressed Wood Wall Panel over Gypsum Wallboard System). ' This Material is in GOOD condition as of this date.
12/01/2011	Location Description changed from PRACTICE ROOM, MULTI-PURPOSE ROOM, AND BAND ROOM OFFICE to PRACTICE ROOM, AND BAND ROOM OFFICE. No other changes as of this date.
03/05/2014	This Material is unchanged as of this date.
08/27/2014	This Material is unchanged as of this date.
02/06/2019	This Material is unchanged as of this date.
08/14/2019	This Material is unchanged as of this date.
02/03/2020	This Material is unchanged as of this date.
08/28/2020	Damage Observed. <5% Physical Damage in the form of 1 SF of Torn and Missing Wall Cover around wall Outlet, on the West Wall in the Band Room. Material condition changed from GOOD to FAIR overall. Friability updated from Non-Friable to Friable. No other changes as of this date.
02/10/2021	This Material is unchanged as of this date.
02/18/2022	This Material is unchanged as of this date.
08/17/2022	This Material is unchanged as of this date.
02/15/2023	This Material is unchanged as of this date.
08/16/2023	This Material is unchanged as of this date.
02/14/2024	This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

MULTI-PURPOSE BUILDING

SPORT EQUIPMENT ROOM

BASEBOARD MASTIC

162 LF

10/16/2008	Mastic/Adhesive for 4" Blue Baseboard. This Material is in GOOD condition as of this date.
------------	--

SF= Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

66

HazMat Doc

AHERA Report B - Survey

SURVEY REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
03/05/2014	This Material is unchanged as of this date.		
08/27/2014	This Material is unchanged as of this date.		
02/06/2019	This Material is unchanged as of this date.		
08/14/2019	This Material is unchanged as of this date.		
02/03/2020	This Material is unchanged as of this date.		
08/28/2020	This Material is unchanged as of this date.		
02/10/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	This Material is unchanged as of this date.		
02/15/2023	This Material is unchanged as of this date.		
08/16/2023	This Material is unchanged as of this date.		
02/14/2024	This Material is unchanged as of this date.		
08-241AAA	ASSUMED	NO SAMPLE	(NS)

MULTI-PURPOSE BUILDING

STAGE, 2 STORAGE IN STAGE AREA, AND MULTI-PURPOSE ROOM

BASEBOARD MASTIC

920 LF

09/13/2016	New Mastic/Adhesive for 6" Black Baseboard (Original Entry Updated 8/17/22). Material is in GOOD condition as of this date.
02/06/2019	This Material is unchanged as of this date.
08/14/2019	This Material is unchanged as of this date.
02/03/2020	This Material is unchanged as of this date.
08/28/2020	This Material is unchanged as of this date.
02/10/2021	This Material is unchanged as of this date.
02/18/2022	This Material is unchanged as of this date.
08/17/2022	This Material is unchanged as of this date.
02/15/2023	This Material is unchanged as of this date.

SURVEY REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

COMMENTS

QTY (APPROXIMATE)

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

08/16/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

MULTI-PURPOSE BUILDING

STAGE, BAND ROOM, MULTI-PURPOSE ROOM, AND PRACTICE ROOM

CEILING MASTIC

8,500 SF

09/12/2005 Mastic/Adhesive for 1'x1' Ceiling Tile. This Material is in GOOD condition as of this date.

10/16/2008 Location Description changed from STAGE, BAND ROOM, AND MULTI-PURPOSE ROOM to BAND ROOM, AND MULTI-PURPOSE ROOM. 2 missing Tiles and Mastic exposed in Cafeteria. No other changes as of this date.

05/14/2009 Location changed from BAND ROOM, AND MULTI-PURPOSE ROOM to STAGE, BAND ROOM, AND MULTI-PURPOSE ROOM. No other changes as of this date.

09/04/2009 Material remains in <5% physical damage. This Material is unchanged as of this date.

03/11/2010 Material reassessed. Missing Tiles and exposed Mastic in Cafeteria have been replaced. Additional damage observed in the form of small holes in assembly area, next to accordion wall of Multi-Purpose room. No other changes as of this date.

08/31/2010 Additional damage observed in the form of 3 Tiles are water damaged in Multi-Purpose Room. No other changes as of this date.

12/01/2011 Location Description changed from STAGE, BAND ROOM, AND MULTI-PURPOSE ROOM to STAGE, BAND ROOM, MULTI-PURPOSE ROOM, AND PRACTICE ROOM. No other changes as of this date.

09/26/2013 Material Re-Assessed. Material changed from GOOD to FAIR condition. No other changes as of this date.

03/05/2014 This Material is unchanged as of this date.

08/27/2014 This Material is unchanged as of this date.

02/06/2019 This Material is unchanged as of this date.

08/14/2019 This Material is unchanged as of this date.

02/03/2020 Repairs Observed. All Damage Repaired. Material Condition changed from FAIR to GOOD. Friability updated from Friable to Non-Friable. No other changes as of this date.

08/28/2020 This Material is unchanged as of this date.

02/10/2021 This Material is unchanged as of this date.

02/18/2022 This Material is unchanged as of this date.

SURVEY REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

08/17/2022 This Material is unchanged as of this date.

02/15/2023 This Material is unchanged as of this date.

08/16/2023 Damage Observed. <5% Physical Damage in the form of 5 EA Tiles with Water Stains, 1.5 EA Tiles missing with Brown Mastic Exposed, 1 EA Tile is Loose and 1 SF of Black Mold in Multi-purpose Room. Material condition changed from GOOD to FAIR overall. No other changes as of this date.

02/14/2024 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

MULTI-PURPOSE BUILDING

STAGE, BAND ROOM, MULTI-PURPOSE ROOM, AND PRACTICE ROOM

CEILING TILE

8,500 SF

09/12/2005 1'x1' Ceiling Tile. This Material is in GOOD condition as of this date.

10/16/2008 Two Tiles missing and Mastic exposed in Multi-Purpose room. No other changes as of this date.

09/04/2009 Material remains in <5% Physical Damage. This Material is unchanged as of this date.

03/11/2010 Material Re-Assessed. Missing Tiles and exposed Mastic in Cafeteria have been replaced. Additional Damage observed in the form of small holes in Assembly Area, next to Accordion Wall of Multi-Purpose room. No other changes as of this date.

08/31/2010 Additional Damage observed in the form of 3 Tiles are Water Damaged in Multi-Purpose Room. No other changes as of this date.

12/01/2011 Location Description changed from STAGE, BAND ROOM, AND MULTI-PURPOSE ROOM to STAGE, BAND ROOM, MULTI-PURPOSE ROOM, AND PRACTICE ROOM. No other changes as of this date.

09/26/2013 Material Re-Assessed. Material changed from GOOD to FAIR condition. No other changes as of this date.

03/05/2014 This Material is unchanged as of this date.

08/27/2014 This Material is unchanged as of this date.

02/08/2016 Sample 16-031-068 collected from Vestibule 91, 1'x1' Ceiling Tile.

02/06/2019 This Material is unchanged as of this date.

08/14/2019 This Material is unchanged as of this date.

02/03/2020 Repairs Observed. All Damage Repaired. Material Condition changed from FAIR to GOOD. Friability updated from Friable to Non-Friable. No other changes as of this date.

08/28/2020 This Material is unchanged as of this date.

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
02/10/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	This Material is unchanged as of this date.		
02/15/2023	This Material is unchanged as of this date.		
08/16/2023	Damage Observed. <5% Physical Damage in the form of 5 EA Tiles with Water Stains, 1.5 EA Tiles missing with Brown Mastic Exposed, 1 EA Tile is Loose and 1 SF of Black Mold in Multi-purpose Room. Material condition changed from GOOD to FAIR overall. No other changes as of this date.		
02/14/2024	This Material is unchanged as of this date.		

05-212AAA	ASSUMED	NO SAMPLE	(NS)
16-031-068	ND	NONE DETECTED	(ND)

MULTI-PURPOSE BUILDING

STAGE STORAGE ROOMS, MULTI-PURPOSE ROOM CLASSROOM, ENTRIES TO MULTI-PURPOSE ROOM

VINYL FLOOR TILE

2,050 SF

09/13/2016	12"x12" Beige, Yellow and Blue Vinyl Floor Tiles. New Material installed during Summer 2016 Floor Project. This Material is in GOOD condition as of this date.		
02/06/2019	This Material is unchanged as of this date.		
08/14/2019	This Material is unchanged as of this date.		
02/03/2020	This Material is unchanged as of this date.		
08/28/2020	This Material is unchanged as of this date.		
02/10/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	This Material is unchanged as of this date.		
02/15/2023	This Material is unchanged as of this date.		
08/16/2023	This Material is unchanged as of this date.		
02/14/2024	This Material is unchanged as of this date.		

16-213AAA	NEW	NO SAMPLE	(NS)
-----------	-----	-----------	--------

SURVEY REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

MULTI-PURPOSE BUILDING

STAGE STORAGE ROOMS, MULTI-PURPOSE ROOM CLASSROOM, ENTRIES TO MULTI-PURPOSE ROOM

VINYL FLOOR TILE MASTIC

2,050 SF

09/13/2016	New Mastic/Adhesive for 12"x12" Begie, Yellow and Blue Vinyl Floor Tiles installed in Summer 2016 Floor Project. Material is in GOOD condition as of this date.
02/06/2019	This Material is unchanged as of this date.
08/14/2019	This Material is unchanged as of this date.
02/03/2020	This Material is unchanged as of this date.
08/28/2020	This Material is unchanged as of this date.
02/10/2021	This Material is unchanged as of this date.
02/18/2022	This Material is unchanged as of this date.
08/17/2022	This Material is unchanged as of this date.
02/15/2023	This Material is unchanged as of this date.
08/16/2023	This Material is unchanged as of this date.
02/14/2024	This Material is unchanged as of this date.

16-213AAA	NEW	NO SAMPLE	(NS)
-----------	-----	-----------	--------

MULTI-PURPOSE BUILDING

STORAGE, CHAIR STORAGE, ELECTRICAL ROOM AND BOILER ROOM

BASEBOARD MASTIC

180 LF

10/16/2008	Mastic/Adhesive for 4" Brown Baseboard. This Material is in GOOD condition as of this date.
05/14/2009	Additional Material identified. Location changed from STORAGE, CHAIR STORAGE AND ELECTRICAL ROOM to STORAGE, CHAIR STORAGE, ELECTRICAL ROOM AND BOILER ROOM. Quantity changed from 140 LF to 180 LF. 6 LF of Baseboard is missing in the Boiler Room, exposing the Mastic/Adhesive. Friability changed from Non to Low. This Material is in FAIR condition as of this date.
03/05/2014	This Material is unchanged as of this date.
08/27/2014	This Material is unchanged as of this date.
03/17/2015	Exterior Storage Room, 1 LF of Baseboard is missing by the Door, exposing the Brown Mastic/Adhesive. No other changes as of this date.

SURVEY REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/06/2019 This Material is unchanged as of this date.

08/14/2019 This Material is unchanged as of this date.

02/03/2020 This Material is unchanged as of this date.

08/28/2020 This Material is unchanged as of this date.

02/10/2021 This Material is unchanged as of this date.

02/18/2022 This Material is unchanged as of this date.

08/17/2022 This Material is unchanged as of this date.

02/15/2023 This Material is unchanged as of this date.

08/16/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

08-241AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

MULTI-PURPOSE BUILDING

STORAGE EQUIPMENT ROOM

CARPET MASTIC

110 SF

10/16/2008 Mastic/Adhesive for Blue Carpet. This Material is in GOOD condition as of this date.

03/05/2014 This Material is unchanged as of this date.

08/27/2014 This Material is unchanged as of this date.

02/06/2019 Material Re-assessed. Carpet Removed Yellow Mastic Exposed. Friability changed from Non-Friable to Friable. No other changes as of this date.

08/14/2019 This Material is unchanged as of this date.

02/03/2020 This Material is unchanged as of this date.

08/28/2020 This Material is unchanged as of this date.

02/10/2021 This Material is unchanged as of this date.

02/18/2022 This Material is unchanged as of this date.

08/17/2022 This Material is unchanged as of this date.

02/15/2023 This Material is unchanged as of this date.

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

72

HazMat Doc

AHERA Report B - Survey

SURVEY REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

08/16/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

08-241AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

MULTI-PURPOSE BUILDING

STUDENT RESTROOMS (2), BOYS AND GIRLS LOCKER ROOM RESTROOMS, AND KITCHEN STAFF RESTROOM

MORTAR MISCELLANEOUS

1,060 SF

03/11/2010 Grout/Mortar for 12"x12" Gray Ceramic Floor and Baseboard Tiles. (Apparent New Material identified by the AHERA accredited Inspector). This Material is in GOOD condition as of this date.

12/01/2011 Quantity reassessed and changed from 750 SF to 1,060 SF. No other changes as of this date.

03/05/2014 This Material is unchanged as of this date.

08/27/2014 This Material is unchanged as of this date.

02/06/2019 This Material is unchanged as of this date.

08/14/2019 This Material is unchanged as of this date.

08/14/2019 This Material is unchanged as of this date.

02/03/2020 This Material is unchanged as of this date.

08/28/2020 This Material is unchanged as of this date.

02/10/2021 This Material is unchanged as of this date.

02/18/2022 This Material is unchanged as of this date.

08/17/2022 This Material is unchanged as of this date.

02/15/2023 This Material is unchanged as of this date.

08/16/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

10-052AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

End Of Report, Total Of 73 Pages

HOMOGENEOUS MATERIALS IN SIERRAMONT MIDDLE SCHOOL

BUILDING NAME**MATERIAL CATEGORY****LOCATION****MATERIAL TYPE****BOILER ROOM****SURFACING MATERIAL**

BOILER ROOM

ROUGH WALL

BOILER ROOM

ROUGH WALL SURFACING

CLASSROOM 40 PORTABLE BUILDING**MISCELLANEOUS MATERIAL**

CLASSROOM PORTABLE 40

BASEBOARD MASTIC

CLASSROOM PORTABLE 40

CARPET MASTIC

PORTABLE 40

PORTABLE BUILDING

CLASSROOM 41 PORTABLE BUILDING**MISCELLANEOUS MATERIAL**

CLASSROOM 41 PORTABLE BUILDING

BASEBOARD MASTIC

CLASSROOM 41 PORTABLE BUILDING

CARPET MASTIC

PORTABLE 41

PORTABLE BUILDING

CLASSROOM 42 PORTABLE BUILDING**MISCELLANEOUS MATERIAL**

CLASSROOM 42 PORTABLE BUILDING

BASEBOARD MASTIC

CLASSROOM 42 PORTABLE BUILDING

CARPET MASTIC

PORTABLE 42

PORTABLE BUILDING

CLASSROOM 43 PORTABLE BUILDING (REMOVED)**MISCELLANEOUS MATERIAL**

CLASSROOM 43 PORTABLE BUILDING

BASEBOARD MASTIC

CLASSROOM 43 PORTABLE BUILDING

CARPET MASTIC

PORTABLE 43

PORTABLE BUILDING

CLASSROOM 44 PORTABLE BUILDING (REMOVED)**MISCELLANEOUS MATERIAL**

CLASSROOM 44

PORTABLE BUILDING

CLASSROOM 44 PORTABLE BUILDING

BASEBOARD MASTIC

CLASSROOM 44 PORTABLE BUILDING

CARPET MASTIC

CLASSROOM 45 PORTABLE BUILDING

HOMOGENEOUS MATERIALS IN SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

MATERIAL CATEGORY

LOCATION

MATERIAL TYPE

MISCELLANEOUS MATERIAL

CLASSROOM 45 PORTABLE BUILDING
CLASSROOM 45 PORTABLE BUILDING
PORTABLE 45

BASEBOARD MASTIC
CARPET MASTIC
PORTABLE BUILDING

CLASSROOM 46 PORTABLE BUILDING

MISCELLANEOUS MATERIAL

CLASSROOM 46
CLASSROOM 46 PORTABLE BUILDING
CLASSROOM 46 PORTABLE BUILDING

PORTABLE BUILDING
BASEBOARD MASTIC
CARPET MASTIC

MAIN BUILDING

MISCELLANEOUS MATERIAL

ALL ADMIN OFFICES, UTILITY ROOMS, STORAGE ROOMS, CUSTODIAL ROOM,
CLASSROOMS 24, 26, 28, 29, DARK ROOM, COMPUTER CLERK ROOM, AND PREP
ROOMS
ALL CLASSROOMS, LOUNGE, AND PREP AREAS
ALL CLASSROOMS, LOUNGE, AND PREP AREAS

ALL CLASSROOMS, LOUNGE, AND PREP AREAS
ALL CLASSROOMS, LOUNGE, AND PREP AREAS
CLASSROOM 27 STORAGE ROOM
CLASSROOMS
CLASSROOMS 19, 21, 23, 26, 28, PREP ROOM 3, COMPUTER ROOM, CUSTODIAN
ROOM, LOUNGE ROOM, COUNSELOR OFFICE, BOOK STORAGE ROOM, OFFICES,
PLACE 1, PLACE 2 AND TWO COORIDORS
CLASSROOMS 19-24, NURES' OFFICE, PODS 1-6, COPY ROOM AND ENTRY PALCE
3
CLASSROOMS 19-24, NURES' OFFICE, PODS 1-6, COPY ROOM AND ENTRY PALCE
3
ENTIRE BUILDING

ENTRY FOYERS AND CLASSROOM WINDOWS

HALLWAY, MEDIA CENTER, NORTH OFFICE, AND MAIN OFFICE
HALLWAY, MEDIA CENTER, NORTH OFFICE, AND MAIN OFFICE
HALLWAYS, OFFICES, MEDIA CENTER, PREP AREA, STORAGE ROOM, UTILITY
ROOMS, ALL CLASSROOMS
HALLWAYS TO PODS, AND LIBRARY (BOOK AREA AND BOOK RETURN AREA)
NURSES' OFFICE AND LOBBY
OFFICES, LOBBIES, HALLWAYS, MEDIA CENTER, CLASSROOMS POD 1-6, AND
CLASSROOMS 25 AND 26
STAFF AND ALL STUDENT RESTROOMS
STAFF LOUNGE ROOM, STAFF WORK ROOM, 1 IN EACH POD ENTRY (6 PODS),
CLASSROOMS 21, 26, 27, 29, AND STORAGE
STAFF RESTROOMS (2), STUDENT RESTROOMS (6), AND HEALTH OFFICE
RESTROOM
THREE ELECTRICAL ROOMS, PREP ROOM, THREE STORAGE ROOMS, AND DARK
ROOM
THREE ELECTRICAL ROOMS, PREP ROOM, THREE STORAGE ROOMS, AND DARK
ROOM

FIRE DOOR CORE INSULATION

PRESSED WOOD WALL PANEL
PRESSED WOOD WALL PANEL
MASTIC
VINYL WALL COVER
VINYL WALL COVER MASTIC
KILN INSULATION
SUSPENDED CEILING TILE
SUSPENDED CEILING TILE

VINYL FLOOR TILE
VINYL FLOOR TILE MASTIC

SMOOTH WALL
MISCELLANEOUS
ASBESTOS CEMENT WALL
PANEL
CEILING MASTIC
CEILING TILE
BASEBOARD MASTIC

SUSPENDED CEILING TILE
BASEBOARD MASTIC
CARPET MASTIC

MORTAR MISCELLANEOUS
SINK UNDERCOATING

MORTAR MISCELLANEOUS

VINYL FLOOR TILE
VINYL FLOOR TILE MASTIC

HOMOGENEOUS MATERIALS IN SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

MATERIAL CATEGORY

LOCATION

MATERIAL TYPE

SURFACING MATERIAL

ENTIRE BUILDING

SMOOTH WALL SURFACING

THERMAL SYSTEM INSULATION

ATTIC / PLENUM

DUCT WRAP TAPE

METAL STORAGE CONTAINERS (4 EA)

MISCELLANEOUS MATERIAL

METAL STORAGE CONTAINERS (4 EA)

STORAGE CONTAINER

MULTI-PURPOSE BUILDING

MISCELLANEOUS MATERIAL

ASSEMBLY ROOM OF MULTI-PURPOSE ROOM

VINYL WALL COVER

BOYS AND GIRLS, LOCKER ROOMS, COACHES OFFICES, MUSIC ROOM

BASEBOARD MASTIC

BOYS AND GIRLS RESTROOMS, KITCHEN RESTROOM, LOCKER ROOMS, AND
BOYS' AND GIRLS' COACHES' RESTROOM

MORTAR MISCELLANEOUS

ENTIRE BUILDING

SMOOTH WALL
MISCELLANEOUS

KITCHEN

SEALANT

KITCHEN

VINYL SHEETING

KITCHEN

VINYL SHEETING BACKING
PAPER/MASTIC

KITCHEN, STORAGE, ELECTRICAL ROOM, RESTROOM, TABLE STORAGE ROOM,
LOCKERS AREA, AND LANDING TO STAGE MULTI-PURPOSE ROOM

FIRE DOOR CORE INSULATION

MULTI-PURPOSE ROOM

MASTIC/ADHESIVE

MULTI-PURPOSE ROOM

VINYL SHEETING

MULTI-PURPOSE ROOM, COACH'S OFFICE, STORAGE KITCHEN, AND STORAGE

VINYL FLOOR TILE

MULTI-PURPOSE ROOM, COACH'S OFFICE, STORAGE KITCHEN, AND STORAGE

VINYL FLOOR TILE MASTIC

MUSIC ROOM, MUSIC OFFICE, PRACTICE ROOMS, STAGE AND STAGE STORAGE
ROOM

CARPET MASTIC

MUSIC ROOM, PRACTICE ROOMS (2), AND STAGE

WALL TILE

MUSIC ROOM, PRACTICE ROOMS (2), AND STAGE

WALL TILE MASTIC

OLD RESTROOM NEXT TO PE STORAGE ROOM, AND RESTROOM LOCATED
BEHIND CLASSROOM 33

TERRAZZO FLOOR

PRACTICE ROOM, AND BAND ROOM OFFICE

PRESSED WOOD WALL PANEL

PRACTICE ROOM, AND BAND ROOM OFFICE

PRESSED WOOD WALL PANEL
MASTIC

PRACTICE ROOM, AND BAND ROOM OFFICE

VINYL WALL COVER

PRACTICE ROOM, AND BAND ROOM OFFICE

VINYL WALL COVER MASTIC

SPORT EQUIPMENT ROOM

BASEBOARD MASTIC

STAGE, 2 STORAGE IN STAGE AREA, AND MULTI-PURPOSE ROOM

BASEBOARD MASTIC

STAGE, BAND ROOM, MULTI-PURPOSE ROOM, AND PRACTICE ROOM

CEILING MASTIC

STAGE, BAND ROOM, MULTI-PURPOSE ROOM, AND PRACTICE ROOM

CEILING TILE

STAGE STORAGE ROOMS, MULTI-PURPOSE ROOM CLASSROOM, ENTRIES TO
MULTI-PURPOSE ROOM

VINYL FLOOR TILE

STAGE STORAGE ROOMS, MULTI-PURPOSE ROOM CLASSROOM, ENTRIES TO
MULTI-PURPOSE ROOM

VINYL FLOOR TILE MASTIC

STORAGE, CHAIR STORAGE, ELECTRICAL ROOM AND BOILER ROOM

BASEBOARD MASTIC

STORAGE EQUIPMENT ROOM

CARPET MASTIC

HOMOGENEOUS MATERIALS IN

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME**MATERIAL CATEGORY****LOCATION****MATERIAL TYPE**

STUDENT RESTROOMS (2), BOYS AND GIRLS LOCKER ROOM RESTROOMS, AND
KITCHEN STAFF RESTROOM

MORTAR MISCELLANEOUS

SURFACING MATERIAL

ENTIRE BUILDING

SMOOTH WALL SURFACING

EXTERIOR WALLS AND OVERHANG

ROUGH WALL

EXTERIOR WALLS AND OVERHANG

ROUGH WALL SURFACING

THERMAL SYSTEM INSULATION

BOILER ROOM NEXT TO GIRLS LOCKER ROOM

DUCT WRAP TAPE

KITCHEN EXTERIOR STOARGE (CAGED AREA) AND EXTERIOR WALL CAVITIES

PIPE FITTING INSULATION

End Of Report, Total Of 4 Pages

FRIABLE LOCATIONS IN SIERRAMONT MIDDLE SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	QTY (APPROXIMATE)	ASBESTOS CONTENT
MAIN BUILDING				
	ALL ADMIN OFFICES, UTILITY ROOMS, STORAGE ROOMS, CUSTODIAL ROOM, CLASSROOMS 24, 26, 28, 29, DARK ROOM, COMPUTER CLERK ROOM, AND PREP ROOMS			
		FIRE DOOR CORE INSULATION	693 SF	Assumed
	ALL CLASSROOMS, LOUNGE, AND PREP AREAS			
		PRESSED WOOD WALL PANEL	14,630 SF	Assumed
	ALL CLASSROOMS, LOUNGE, AND PREP AREAS			
		PRESSED WOOD WALL PANEL MASTIC	14,630 SF	Assumed
	ALL CLASSROOMS, LOUNGE, AND PREP AREAS			
		VINYL WALL COVER	14,630 SF	Assumed
	ALL CLASSROOMS, LOUNGE, AND PREP AREAS			
		VINYL WALL COVER MASTIC	14,630 SF	Assumed
	ATTIC / PLENUM			
		DUCT WRAP TAPE	1,000 LF	Assumed
	CLASSROOM 27 STORAGE ROOM			
		KILN INSULATION	60 SF	Assumed
	CLASSROOMS			
		SUSPENDED CEILING TILE	17,100 SF	Assumed
	CLASSROOMS 19, 21, 23, 26, 28, PREP ROOM 3, COMPUTER ROOM, CUSTODIAN ROOM, LOUNGE ROOM, COUNSELOR OFFICE, BOOK STORAGE ROOM, OFFICES, PLACE 1, PLACE 2 AND TWO COORIDORS			
		SUSPENDED CEILING TILE	10,150 SF	Assumed
	CLASSROOMS 19-24, NURES' OFFICE, PODS 1-6, COPY ROOM AND ENTRY PALCE 3			
		VINYL FLOOR TILE	10,400 SF	Assumed
	CLASSROOMS 19-24, NURES' OFFICE, PODS 1-6, COPY ROOM AND ENTRY PALCE 3			
		VINYL FLOOR TILE MASTIC	10,400 SF	Assumed
	HALLWAY, MEDIA CENTER, NORTH OFFICE, AND MAIN OFFICE			
		CEILING MASTIC	6,000 SF	Assumed
	HALLWAY, MEDIA CENTER, NORTH OFFICE, AND MAIN OFFICE			
		CEILING TILE	6,000 SF	Assumed
	HALLWAYS TO PODS, AND LIBRARY (BOOK AREA AND BOOK RETURN AREA)			
		SUSPENDED CEILING TILE	1,350 SF	Assumed
	STAFF AND ALL STUDENT RESTROOMS			
		MORTAR MISCELLANEOUS	2,800 SF	Assumed
	THREE ELECTRICAL ROOMS, PREP ROOM, THREE STORAGE ROOMS, AND DARK ROOM			
		VINYL FLOOR TILE	1,340 SF	Assumed

FRIABLE LOCATIONS IN SIERRAMONT MIDDLE SCHOOL

BUILDING NAME			
LOCATION		QTY	ASBESTOS
MATERIAL TYPE		(APPROXIMATE)	CONTENT
THREE ELECTRICAL ROOMS, PREP ROOM, THREE STORAGE ROOMS, AND DARK ROOM			
VINYL FLOOR TILE MASTIC		1,340 SF	Assumed
MULTI-PURPOSE BUILDING			
BOILER ROOM NEXT TO GIRLS LOCKER ROOM			
DUCT WRAP TAPE		20 SF	Assumed
BOYS AND GIRLS RESTROOMS, KITCHEN RESTROOM, LOCKER ROOMS, AND BOYS' AND GIRLS' COACHES' RESTROOM			
MORTAR MISCELLANEOUS		2,050 SF	Assumed
ENTIRE BUILDING			
SMOOTH WALL MISCELLANEOUS		18,000 SF	Assumed
ENTIRE BUILDING			
SMOOTH WALL SURFACING		18,000 SF	Assumed
EXTERIOR WALLS AND OVERHANG			
ROUGH WALL		14,360 SF	Assumed
EXTERIOR WALLS AND OVERHANG			
ROUGH WALL SURFACING		14,360 SF	Assumed
KITCHEN			
VINYL SHEETING BACKING PAPER/MASTIC		1,400 SF	Assumed
KITCHEN EXTERIOR STOARGE (CAGED AREA) AND EXTERIOR WALL CAVITIES			
PIPE FITTING INSULATION		6 LF	Assumed
KITCHEN, STORAGE, ELECTRICAL ROOM, RESTROOM, TABLE STORAGE ROOM, LOCKERS AREA, AND LANDING TO STAGE MULTI-PURPOSE ROOM			
FIRE DOOR CORE INSULATION		360 SF	Assumed
MUSIC ROOM, PRACTICE ROOMS (2), AND STAGE			
WALL TILE		1,410 SF	Assumed
MUSIC ROOM, PRACTICE ROOMS (2), AND STAGE			
WALL TILE MASTIC		1,410 SF	Assumed
PRACTICE ROOM, AND BAND ROOM OFFICE			
PRESSED WOOD WALL PANEL		2,960 SF	Assumed
PRACTICE ROOM, AND BAND ROOM OFFICE			
VINYL WALL COVER		2,960 SF	Assumed
PRACTICE ROOM, AND BAND ROOM OFFICE			
VINYL WALL COVER MASTIC		2,960 SF	Assumed
STAGE, BAND ROOM, MULTI-PURPOSE ROOM, AND PRACTICE ROOM			
CEILING MASTIC		8,500 SF	Assumed

**FRIABLE LOCATIONS IN
SIERRAMONT MIDDLE SCHOOL**

BUILDING NAME		
LOCATION	QTY (APPROXIMATE)	ASBESTOS CONTENT
MATERIAL TYPE		
STAGE, BAND ROOM, MULTI-PURPOSE ROOM, AND PRACTICE ROOM		
CEILING TILE	8,500 SF	Assumed
STORAGE, CHAIR STORAGE, ELECTRICAL ROOM AND BOILER ROOM		
BASEBOARD MASTIC	180 LF	Assumed
STORAGE EQUIPMENT ROOM		
CARPET MASTIC	110 SF	Assumed
End Of Report, Total Of 3 Pages		

Non- Friable Locations In SIERRAMONT MIDDLE SCHOOL

BUILDING NAME	LOCATION	QTY (APPROXIMATE)	ASBESTOS CONTENT
MATERIAL TYPE			
BOILER ROOM			
BOILER ROOM	ROUGH WALL	1,800 SF	Assumed
BOILER ROOM	ROUGH WALL SURFACING	1,800 SF	Assumed
CLASSROOM 40 PORTABLE BUILDING			
CLASSROOM PORTABLE 40	BASEBOARD MASTIC	50 SF	Assumed
CLASSROOM PORTABLE 40	CARPET MASTIC	960 SF	Assumed
CLASSROOM 41 PORTABLE BUILDING			
CLASSROOM 41 PORTABLE BUILDING	BASEBOARD MASTIC	50 SF	Assumed
CLASSROOM 41 PORTABLE BUILDING	CARPET MASTIC	960 SF	Assumed
CLASSROOM 42 PORTABLE BUILDING			
CLASSROOM 42 PORTABLE BUILDING	BASEBOARD MASTIC	50 SF	Assumed
CLASSROOM 42 PORTABLE BUILDING	CARPET MASTIC	960 SF	Assumed
CLASSROOM 43 PORTABLE BUILDING (REMOVED)			
CLASSROOM 43 PORTABLE BUILDING	BASEBOARD MASTIC	0 SF	Assumed
CLASSROOM 43 PORTABLE BUILDING	CARPET MASTIC	0 SF	Assumed
CLASSROOM 44 PORTABLE BUILDING (REMOVED)			
CLASSROOM 44 PORTABLE BUILDING	BASEBOARD MASTIC	0 SF	Assumed
CLASSROOM 44 PORTABLE BUILDING	CARPET MASTIC	0 SF	Assumed
CLASSROOM 45 PORTABLE BUILDING			
CLASSROOM 45 PORTABLE BUILDING	BASEBOARD MASTIC	50 SF	Assumed
CLASSROOM 45 PORTABLE BUILDING	CARPET MASTIC	960 SF	Assumed
CLASSROOM 46 PORTABLE BUILDING			
CLASSROOM 46 PORTABLE BUILDING	BASEBOARD MASTIC	50 SF	Assumed
CLASSROOM 46 PORTABLE BUILDING	CARPET MASTIC	960 SF	Assumed

Non- Friable Locations In Sierramont Middle School

BUILDING NAME			
LOCATION		QTY	ASBESTOS
MATERIAL TYPE		(APPROXIMATE)	CONTENT
MAIN BUILDING			
ENTIRE BUILDING			
SMOOTH WALL MISCELLANEOUS		76,000 SF	Assumed
ENTIRE BUILDING			
SMOOTH WALL SURFACING		76,000 SF	Assumed
ENTRY FOYERS AND CLASSROOM WINDOWS			
ASBESTOS CEMENT WALL PANEL		286 SF	Assumed
HALLWAYS, OFFICES, MEDIA CENTER, PREP AREA, STORAGE ROOM, UTILITY ROOMS, ALL CLASSROOMS			
BASEBOARD MASTIC		11,000 LF	New Material
NURSES' OFFICE AND LOBBY			
BASEBOARD MASTIC		180 LF	New Material
OFFICES, LOBBIES, HALLWAYS, MEDIA CENTER, CLASSROOMS POD 1-6, AND CLASSROOMS 25 AND 26			
CARPET MASTIC		18,000 SF	Assumed
STAFF LOUNGE ROOM, STAFF WORK ROOM, 1 IN EACH POD ENTRY (6 PODS), CLASSROOMS 21, 26, 27, 29, AND STORAGE			
SINK UNDERCOATING		114 SF	Assumed
STAFF RESTROOMS (2), STUDENT RESTROOMS (6), AND HEALTH OFFICE RESTROOM			
MORTAR MISCELLANEOUS		1,500 SF	Assumed
METAL STORAGE CONTAINERS (4 EA)			
MULTI-PURPOSE BUILDING			
ASSEMBLY ROOM OF MULTI-PURPOSE ROOM			
VINYL WALL COVER		500 SF	Assumed
BOYS AND GIRLS, LOCKER ROOMS, COACHES OFFICES, MUSIC ROOM			
BASEBOARD MASTIC		500 LF	New Material
KITCHEN			
SEALANT		1,200 LF	Assumed
KITCHEN			
VINYL SHEETING		1,400 SF	Assumed
MULTI-PURPOSE ROOM			
MASTIC/ADHESIVE		5,000 SF	Assumed
MULTI-PURPOSE ROOM			
VINYL SHEETING		5,000 SF	New Material
MULTI-PURPOSE ROOM, COACH'S OFFICE, STORAGE KITCHEN, AND STORAGE			
VINYL FLOOR TILE		75 SF	Assumed
MULTI-PURPOSE ROOM, COACH'S OFFICE, STORAGE KITCHEN, AND STORAGE			
VINYL FLOOR TILE MASTIC		75 SF	Assumed
MUSIC ROOM, MUSIC OFFICE, PRACTICE ROOMS, STAGE AND STAGE STORAGE ROOM			
CARPET MASTIC		3,800 SF	Assumed
OLD RESTROOM NEXT TO PE STORAGE ROOM, AND RESTROOM LOCATED BEHIND CLASSROOM 33			
TERRAZZO FLOOR		600 SF	Assumed

Non- Friable Locations In SIERRAMONT MIDDLE SCHOOL

BUILDING NAME			
LOCATION		QTY	ASBESTOS
MATERIAL TYPE		(APPROXIMATE)	CONTENT
PRACTICE ROOM, AND BAND ROOM OFFICE			
PRESSED WOOD WALL PANEL MASTIC		2,960 SF	Assumed
SPORT EQUIPMENT ROOM			
BASEBOARD MASTIC		162 LF	Assumed
STAGE, 2 STORAGE IN STAGE AREA, AND MULTI-PURPOSE ROOM			
BASEBOARD MASTIC		920 LF	Assumed
STAGE STORAGE ROOMS, MULTI-PURPOSE ROOM CLASSROOM, ENTRIES TO MULTI-PURPOSE ROOM			
VINYL FLOOR TILE		2,050 SF	Assumed
STAGE STORAGE ROOMS, MULTI-PURPOSE ROOM CLASSROOM, ENTRIES TO MULTI-PURPOSE ROOM			
VINYL FLOOR TILE MASTIC		2,050 SF	Assumed
STUDENT RESTROOMS (2), BOYS AND GIRLS LOCKER ROOM RESTROOMS, AND KITCHEN STAFF RESTROOM			
MORTAR MISCELLANEOUS		1,060 SF	Assumed
End Of Report, Total Of 3 Pages			

RECOMMENDATIONS FOR
SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

BOILER ROOM

BOILER ROOM

ROUGH WALL

1,800 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

BOILER ROOM

ROUGH WALL SURFACING

1,800 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOM 40 PORTABLE BUILDING

CLASSROOM PORTABLE 40

BASEBOARD MASTIC

50 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR
SIERRAMONT MIDDLE SCHOOL

BUILDING NAME**LOCATION****MATERIAL TYPE****RECOMMENDATION****QTY****(APPROXIMATE)**

CLASSROOM PORTABLE 40**CARPET MASTIC****960 SF**

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

PORTABLE 40**PORTABLE BUILDING****960 SF**

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

CLASSROOM 41 PORTABLE BUILDING

CLASSROOM 41 PORTABLE BUILDING**BASEBOARD MASTIC****50 SF**

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOM 41 PORTABLE BUILDING**CARPET MASTIC****960 SF**

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.
-

RECOMMENDATIONS FOR
SIERRAMONT MIDDLE SCHOOL

BUILDING NAME**LOCATION****MATERIAL TYPE****RECOMMENDATION****QTY****(APPROXIMATE)**

PORTABLE 41

PORTABLE BUILDING

960 SF

- (a) This is a replacement/new material.
- (b) The district should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the district's AHERA records.

CLASSROOM 42 PORTABLE BUILDING

CLASSROOM 42 PORTABLE BUILDING

BASEBOARD MASTIC

50 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOM 42 PORTABLE BUILDING

CARPET MASTIC

960 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

PORTABLE 42

PORTABLE BUILDING

960 SF

- (a) This is a replacement/new material.
 - (b) The district should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
 - (c) This documentation is to be maintained with the district's AHERA records.
-

RECOMMENDATIONS FOR SIERRAMONT MIDDLE SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RECOMMENDATION	QTY (APPROXIMATE)
---------------	----------	---------------	----------------	----------------------

CLASSROOM 43 PORTABLE BUILDING (REMOVED)

CLASSROOM 43 PORTABLE BUILDING

BASEBOARD MASTIC 0 SF

The material has been removed. No further recommendation is required.

CLASSROOM 43 PORTABLE BUILDING

CARPET MASTIC 0 SF

The material has been removed. No further recommendation is required.

PORTABLE 43

PORTABLE BUILDING 0 SF

The material has been removed. No further recommendation is required.

CLASSROOM 44 PORTABLE BUILDING (REMOVED)

CLASSROOM 44

PORTABLE BUILDING 0 SF

The material has been removed. No further recommendation is required.

CLASSROOM 44 PORTABLE BUILDING

BASEBOARD MASTIC 0 SF

The material has been removed. No further recommendation is required.

CLASSROOM 44 PORTABLE BUILDING

CARPET MASTIC 0 SF

The material has been removed. No further recommendation is required.

RECOMMENDATIONS FOR
SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

CLASSROOM 45 PORTABLE BUILDING

CLASSROOM 45 PORTABLE BUILDING

BASEBOARD MASTIC

50 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOM 45 PORTABLE BUILDING

CARPET MASTIC

960 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

PORTABLE 45

PORTABLE BUILDING

960 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

RECOMMENDATIONS FOR
SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

CLASSROOM 46 PORTABLE BUILDING

CLASSROOM 46

PORTABLE BUILDING

960 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

CLASSROOM 46 PORTABLE BUILDING

BASEBOARD MASTIC

50 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOM 46 PORTABLE BUILDING

CARPET MASTIC

960 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

MAIN BUILDING

ALL ADMIN OFFICES, UTILITY ROOMS, STORAGE ROOMS, CUSTODIAL ROOM, CLASSROOMS 24, 26, 28, 29, DARK ROOM, COMPUTER CLERK ROOM, AND PREP ROOMS

FIRE DOOR CORE INSULATION

693 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

ALL CLASSROOMS, LOUNGE, AND PREP AREAS

PRESSED WOOD WALL PANEL

14,630 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

ALL CLASSROOMS, LOUNGE, AND PREP AREAS

PRESSED WOOD WALL PANEL MASTIC

14,630 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

ALL CLASSROOMS, LOUNGE, AND PREP AREAS

VINYL WALL COVER

14,630 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR
SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

ALL CLASSROOMS, LOUNGE, AND PREP AREAS

VINYL WALL COVER MASTIC

14,630 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

ATTIC / PLENUM

DUCT WRAP TAPE

1,000 LF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOM 27 STORAGE ROOM

KILN INSULATION

60 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOMS

SUSPENDED CEILING TILE

17,100 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

CLASSROOMS 19, 21, 23, 26, 28, PREP ROOM 3, COMPUTER ROOM, CUSTODIAN ROOM, LOUNGE ROOM, COUNSELOR OFFICE, BOOK STORAGE ROOM, OFFICES, PLACE 1, PLACE 2 AND TWO COORIDORS

SUSPENDED CEILING TILE

10,150 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOMS 19-24, NURES' OFFICE, PODS 1-6, COPY ROOM AND ENTRY PALCE 3

VINYL FLOOR TILE

10,400 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOMS 19-24, NURES' OFFICE, PODS 1-6, COPY ROOM AND ENTRY PALCE 3

VINYL FLOOR TILE MASTIC

10,400 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

ENTIRE BUILDING

SMOOTH WALL MISCELLANEOUS

76,000 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR
SIERRAMONT MIDDLE SCHOOL

BUILDING NAME**LOCATION****MATERIAL TYPE****RECOMMENDATION****QTY****(APPROXIMATE)**

ENTIRE BUILDING

SMOOTH WALL SURFACING 76,000 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

ENTRY FOYERS AND CLASSROOM WINDOWS

ASBESTOS CEMENT WALL PANEL 286 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

HALLWAY, MEDIA CENTER, NORTH OFFICE, AND MAIN OFFICE

CEILING MASTIC 6,000 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

HALLWAY, MEDIA CENTER, NORTH OFFICE, AND MAIN OFFICE

CEILING TILE 6,000 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.
-

RECOMMENDATIONS FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

HALLWAYS, OFFICES, MEDIA CENTER, PREP AREA, STORAGE ROOM, UTILITY ROOMS, ALL CLASSROOMS

BASEBOARD MASTIC

11,000 LF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

HALLWAYS TO PODS, AND LIBRARY (BOOK AREA AND BOOK RETURN AREA)

SUSPENDED CEILING TILE

1,350 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

NURSES' OFFICE AND LOBBY

BASEBOARD MASTIC

180 LF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

OFFICES, LOBBIES, HALLWAYS, MEDIA CENTER, CLASSROOMS POD 1-6, AND CLASSROOMS 25 AND 26

CARPET MASTIC

18,000 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

STAFF AND ALL STUDENT RESTROOMS

MORTAR MISCELLANEOUS

2,800 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

STAFF LOUNGE ROOM, STAFF WORK ROOM, 1 IN EACH POD ENTRY (6 PODS), CLASSROOMS 21, 26, 27, 29, AND STORAGE

SINK UNDERCOATING 114 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

STAFF RESTROOMS (2), STUDENT RESTROOMS (6), AND HEALTH OFFICE RESTROOM

MORTAR MISCELLANEOUS 1,500 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

THREE ELECTRICAL ROOMS, PREP ROOM, THREE STORAGE ROOMS, AND DARK ROOM

VINYL FLOOR TILE 1,340 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

THREE ELECTRICAL ROOMS, PREP ROOM, THREE STORAGE ROOMS, AND DARK ROOM

VINYL FLOOR TILE MASTIC 1,340 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR
SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

METAL STORAGE CONTAINERS (4 EA)

METAL STORAGE CONTAINERS (4 EA)

STORAGE CONTAINER

1,420 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

MULTI-PURPOSE BUILDING

ASSEMBLY ROOM OF MULTI-PURPOSE ROOM

VINYL WALL COVER

500 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

BOILER ROOM NEXT TO GIRLS LOCKER ROOM

DUCT WRAP TAPE

20 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR
SIERRAMONT MIDDLE SCHOOL

BUILDING NAME**LOCATION****MATERIAL TYPE****RECOMMENDATION****QTY****(APPROXIMATE)**

BOYS AND GIRLS, LOCKER ROOMS, COACHES OFFICES, MUSIC ROOM**BASEBOARD MASTIC****500 LF**

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

BOYS AND GIRLS RESTROOMS, KITCHEN RESTROOM, LOCKER ROOMS, AND BOYS' AND GIRLS' COACHES' RESTROOM**MORTAR MISCELLANEOUS****2,050 SF**

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

ENTIRE BUILDING**SMOOTH WALL MISCELLANEOUS****18,000 SF**

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

ENTIRE BUILDING**SMOOTH WALL SURFACING****18,000 SF**

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

EXTERIOR WALLS AND OVERHANG

ROUGH WALL

14,360 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

EXTERIOR WALLS AND OVERHANG

ROUGH WALL SURFACING

14,360 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

KITCHEN

SEALANT

1,200 LF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

KITCHEN

VINYL SHEETING

1,400 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR
SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

KITCHEN

VINYL SHEETING BACKING PAPER/MASTIC

1,400 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

KITCHEN EXTERIOR STOARGE (CAGED AREA) AND EXTERIOR WALL CAVITIES

PIPE FITTING INSULATION

6 LF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

KITCHEN, STORAGE, ELECTRICAL ROOM, RESTROOM, TABLE STORAGE ROOM, LOCKERS AREA, AND LANDING TO STAGE MULTI-PURPOSE ROOM

FIRE DOOR CORE INSULATION

360 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

MULTI-PURPOSE ROOM

MASTIC/ADHESIVE

5,000 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

RECOMMENDATIONS FOR
SIERRAMONT MIDDLE SCHOOL

BUILDING NAME**LOCATION****MATERIAL TYPE****RECOMMENDATION****QTY****(APPROXIMATE)**

MULTI-PURPOSE ROOM**VINYL SHEETING****5,000 SF**

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

MULTI-PURPOSE ROOM, COACH'S OFFICE, STORAGE KITCHEN, AND STORAGE**VINYL FLOOR TILE****75 SF**

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

MULTI-PURPOSE ROOM, COACH'S OFFICE, STORAGE KITCHEN, AND STORAGE**VINYL FLOOR TILE MASTIC****75 SF**

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

MUSIC ROOM, MUSIC OFFICE, PRACTICE ROOMS, STAGE AND STAGE STORAGE ROOM**CARPET MASTIC****3,800 SF**

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

MUSIC ROOM, PRACTICE ROOMS (2), AND STAGE**WALL TILE****1,410 SF**

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

MUSIC ROOM, PRACTICE ROOMS (2), AND STAGE

WALL TILE MASTIC

1,410 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

OLD RESTROOM NEXT TO PE STORAGE ROOM, AND RESTROOM LOCATED BEHIND CLASSROOM 33

TERRAZZO FLOOR

600 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

PRACTICE ROOM, AND BAND ROOM OFFICE

PRESSED WOOD WALL PANEL

2,960 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

PRACTICE ROOM, AND BAND ROOM OFFICE

PRESSED WOOD WALL PANEL MASTIC

2,960 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR
SIERRAMONT MIDDLE SCHOOL

BUILDING NAME**LOCATION****MATERIAL TYPE****RECOMMENDATION****QTY****(APPROXIMATE)**

PRACTICE ROOM, AND BAND ROOM OFFICE**VINYL WALL COVER****2,960 SF**

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

PRACTICE ROOM, AND BAND ROOM OFFICE**VINYL WALL COVER MASTIC****2,960 SF**

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

SPORT EQUIPMENT ROOM**BASEBOARD MASTIC****162 LF**

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

STAGE, 2 STORAGE IN STAGE AREA, AND MULTI-PURPOSE ROOM**BASEBOARD MASTIC****920 LF**

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

RECOMMENDATIONS FOR
SIERRAMONT MIDDLE SCHOOL

BUILDING NAME**LOCATION****MATERIAL TYPE****RECOMMENDATION****QTY****(APPROXIMATE)**

STAGE, BAND ROOM, MULTI-PURPOSE ROOM, AND PRACTICE ROOM**CEILING MASTIC****8,500 SF**

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

STAGE, BAND ROOM, MULTI-PURPOSE ROOM, AND PRACTICE ROOM**CEILING TILE****8,500 SF**

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

STAGE STORAGE ROOMS, MULTI-PURPOSE ROOM CLASSROOM, ENTRIES TO MULTI-PURPOSE ROOM**VINYL FLOOR TILE****2,050 SF**

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

STAGE STORAGE ROOMS, MULTI-PURPOSE ROOM CLASSROOM, ENTRIES TO MULTI-PURPOSE ROOM**VINYL FLOOR TILE MASTIC****2,050 SF**

- (a) This is a replacement/new material.
 - (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
 - (c) This documentation is to be maintained with the District's AHERA records.
-

RECOMMENDATIONS FOR
SIERRAMONT MIDDLE SCHOOL

BUILDING NAME**LOCATION****MATERIAL TYPE****RECOMMENDATION****QTY****(APPROXIMATE)**

STORAGE, CHAIR STORAGE, ELECTRICAL ROOM AND BOILER ROOM**BASEBOARD MASTIC****180 LF**

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

STORAGE EQUIPMENT ROOM**CARPET MASTIC****110 SF**

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

STUDENT RESTROOMS (2), BOYS AND GIRLS LOCKER ROOM RESTROOMS, AND KITCHEN STAFF RESTROOM**MORTAR MISCELLANEOUS****1,060 SF**

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

End Of Report, Total Of 21 Pages

SAMPLES REPORT FOR
SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

BOILER ROOM

BOILER ROOM

BOILER ROOM

ROUGH WALL

05-212AAA

9/12/2005

Positive

ASSUMED

NO SAMPLE

NS

BOILER ROOM

BOILER ROOM

ROUGH WALL SURFACING

05-212AAA

9/12/2005

Positive

ASSUMED

NO SAMPLE

NS

SAMPLES REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE No. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

CLASSROOM 40 PORTABLE BUILDING

CLASSROOM 40 PORTABLE BUILDING

CLASSROOM PORTABLE 40
 BASEBOARD MASTIC

<u>16-031-042</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
--------------------------	----------	----------	----	---------------	----

Classroom 40, White Mastic/Adhesive for 4" Light Blue Baseboard.

<u>16-031AAA</u>	2/8/2016	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

CLASSROOM 40 PORTABLE BUILDING

CLASSROOM PORTABLE 40
 CARPET MASTIC

<u>16-031-041</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
--------------------------	----------	----------	----	---------------	----

Classroom 40, Yellow Mastic/Adhesive for Blue-Gray Carpet on Wood.

<u>16-031AAA</u>	2/8/2016	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

CLASSROOM 40 PORTABLE BUILDING

PORTABLE 40
 PORTABLE BUILDING

<u>05-212.NS</u>	3/6/2007	Negative	NEW MATERIAL	NO SAMPLE	NS
-------------------------	----------	----------	--------------	-----------	----

New 2006 Construction Relocatable Building per Manufacturer's Tag information.

SAMPLES REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE No. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

CLASSROOM 41 PORTABLE BUILDING

CLASSROOM 41 PORTABLE BUILDING

CLASSROOM 41 PORTABLE BUILDING
 BASEBOARD MASTIC

<u>16-031-040</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
Classroom 41, White Mastic/Adhesive for 4" Gray Baseboard.					

<u>16-031AAA</u>	2/8/2016	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

CLASSROOM 41 PORTABLE BUILDING

CLASSROOM 41 PORTABLE BUILDING
 CARPET MASTIC

<u>16-031-039</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
Classroom 41, Yellow Mastic/Adhesive for Blue-Gray Carpet on Wood.					

<u>16-031AAA</u>	2/8/2016	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

CLASSROOM 41 PORTABLE BUILDING

PORTABLE 41
 PORTABLE BUILDING

<u>05-212.NS</u>	9/12/2005	Negative	NEW MATERIAL	NO SAMPLE	NS
New 1991 Construction Relocatable Building per Manufacturer's Tag information.					

SAMPLES REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE No. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

CLASSROOM 42 PORTABLE BUILDING

CLASSROOM 42 PORTABLE BUILDING

CLASSROOM 42 PORTABLE BUILDING
 BASEBOARD MASTIC

<u>16-031-038</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
Classroom 42, White Mastic/Adhesive for 6" Blue Baseboard.					

<u>16-031AAA</u>	2/8/2016	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

CLASSROOM 42 PORTABLE BUILDING

CLASSROOM 42 PORTABLE BUILDING
 CARPET MASTIC

<u>16-031-037</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
Classroom 42, Yellow Mastic/Adhesive for Blue Carpet on Wood.					

<u>16-031AAA</u>	2/8/2016	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

CLASSROOM 42 PORTABLE BUILDING

PORTABLE 42
 PORTABLE BUILDING

<u>05-212.NS</u>	9/12/2005	Negative	NEW MATERIAL	NO SAMPLE	NS
New 1999 Construction Relocatable Building per Manufacturer's Tag information.					

SAMPLES REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

CLASSROOM 43 PORTABLE BUILDING (REMOVED)

CLASSROOM 43 PORTABLE BUILDING (REMOVED)

CLASSROOM 43 PORTABLE BUILDING
 BASEBOARD MASTIC

<u>16-031-44</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
-------------------------	----------	----------	----	---------------	----

Classroom 43, White Mastic/Adhesive for 4" Light Blue Baseboard.

<u>16-031AAA</u>	2/8/2016	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

<u>22-093REM</u>	8/17/2022	Negative	REMOVED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOM 43 PORTABLE BUILDING (REMOVED)

CLASSROOM 43 PORTABLE BUILDING
 CARPET MASTIC

<u>16-031-043</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
--------------------------	----------	----------	----	---------------	----

Classroom 43, Yellow Mastic/Adhesive for Blue-Gray Carpet on Wood.

<u>16-031AAA</u>	2/8/2016	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

<u>20-093REM</u>	8/17/2022	Negative	REMOVED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOM 43 PORTABLE BUILDING (REMOVED)

PORTABLE 43
 PORTABLE BUILDING

<u>12-185.NS</u>	10/11/2012	Negative	NEW MATERIAL	NO SAMPLE	NS
-------------------------	------------	----------	--------------	-----------	----

New 2012 Construction Relocatable Building per Manufacturer's Tag information.

<u>22-093REM</u>	8/17/2022	Negative	REMOVED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

SAMPLES REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

CLASSROOM 44 PORTABLE BUILDING (REMOVED)

CLASSROOM 44 PORTABLE BUILDING (REMOVED)

CLASSROOM 44
PORTABLE BUILDING

<u>12-185.NS</u>	10/11/2012	Negative	NEW MATERIAL	NO SAMPLE	NS
New 2012 Construction Relocatable Building per Manufacturer's Tag information.					

<u>22-093REM</u>	8/17/2022	Negative	REMOVED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOM 44 PORTABLE BUILDING (REMOVED)

CLASSROOM 44 PORTABLE BUILDING
BASEBOARD MASTIC

<u>16-031-046</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
Classroom 44, White Mastic/Adhesive for 4" Black Baseboard.					

<u>16-031AAA</u>	2/8/2016	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

<u>22-094REM</u>	8/17/2022	Negative	REMOVED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOM 44 PORTABLE BUILDING (REMOVED)

CLASSROOM 44 PORTABLE BUILDING
CARPET MASTIC

<u>16-031-045</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
Classroom 44, Yellow Mastic/Adhesive for Blue Carpet.					

<u>16-031AAA</u>	2/8/2016	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

<u>22-093REM</u>	8/17/2022	Negative	REMOVED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

SAMPLES REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

CLASSROOM 45 PORTABLE BUILDING

CLASSROOM 45 PORTABLE BUILDING

CLASSROOM 45 PORTABLE BUILDING
 BASEBOARD MASTIC

<u>16-031-050</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
--------------------------	----------	----------	----	---------------	----

Classroom 45, White Mastic/Adhesive for 4" Brown Baseboard.

<u>16-031AAA</u>	2/8/2016	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

CLASSROOM 45 PORTABLE BUILDING

CLASSROOM 45 PORTABLE BUILDING
 CARPET MASTIC

<u>16-031-049</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
--------------------------	----------	----------	----	---------------	----

Classroom 45, Yellow Mastic/Adhesive for Carpet on Wood.

<u>16-031AAA</u>	2/8/2016	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

CLASSROOM 45 PORTABLE BUILDING

PORTABLE 45
 PORTABLE BUILDING

<u>12-185.NS</u>	10/11/2012	Negative	NEW MATERIAL	NO SAMPLE	NS
-------------------------	------------	----------	--------------	-----------	----

New 2012 Construction Relocatable Building per Manufacturer's Tag information.

SAMPLES REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

CLASSROOM 46 PORTABLE BUILDING

CLASSROOM 46 PORTABLE BUILDING

CLASSROOM 46
 PORTABLE BUILDING

<u>12-185.NS</u>	10/11/2012	Negative	NEW MATERIAL	NO SAMPLE	NS
New 1999 Construction Relocatable Building per Manufacturer's Tag information.					

CLASSROOM 46 PORTABLE BUILDING

CLASSROOM 46 PORTABLE BUILDING
 BASEBOARD MASTIC

<u>16-031-048</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
Classroom 46, White Mastic/Adhesive for 4" Dark Brown Baseboard.					

<u>16-031AAA</u>	2/8/2016	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

CLASSROOM 46 PORTABLE BUILDING

CLASSROOM 46 PORTABLE BUILDING
 CARPET MASTIC

<u>16-031-047</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
Classroom 46, Yellow Mastic/Adhesive for Blue-Gray Carpet.					

<u>16-031AAA</u>	2/8/2016	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

SAMPLES REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

MAIN BUILDING

MAIN BUILDING

ALL ADMIN OFFICES, UTILITY ROOMS, STORAGE ROOMS, CUSTODIAL ROOM, CLASSROOMS 24, 26, 28, 29, DARK ROOM, COMPUTER CLERK ROOM, AND PREP ROOMS

FIRE DOOR CORE INSULATION

<u>05-212AAA</u>	9/12/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

MAIN BUILDING

ALL CLASSROOMS, LOUNGE, AND PREP AREAS

PRESSED WOOD WALL PANEL

<u>05-212AAA</u>	3/6/2007	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

MAIN BUILDING

ALL CLASSROOMS, LOUNGE, AND PREP AREAS

PRESSED WOOD WALL PANEL MASTIC

<u>05-212AAA</u>	3/6/2007	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

MAIN BUILDING

ALL CLASSROOMS, LOUNGE, AND PREP AREAS

VINYL WALL COVER

<u>05-212AAA</u>	9/12/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

MAIN BUILDING

ALL CLASSROOMS, LOUNGE, AND PREP AREAS

VINYL WALL COVER MASTIC

<u>05-212AAA</u>	9/12/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

MAIN BUILDING

ATTIC / PLENUM

DUCT WRAP TAPE

<u>05-212AAA</u>	9/12/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

MAIN BUILDING

CLASSROOM 27 STORAGE ROOM

KILN INSULATION

<u>05-212AAA</u>	3/22/2016	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

SAMPLES REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

MAIN BUILDING

CLASSROOMS

SUSPENDED CEILING TILE

<u>05-212AAA</u>	9/12/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

<u>16-031-008</u>	1/29/2016	Negative	ND	NONE DETECTED	ND
--------------------------	-----------	----------	----	---------------	----

S.G.I. #3, 2'x4' Suspended Ceiling Tile.

<u>16-031-014</u>	1/29/2016	Negative	ND	NONE DETECTED	ND
--------------------------	-----------	----------	----	---------------	----

Science Classroom 29, 2'x4' Suspended Ceiling Tile.

<u>16-031-064</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
--------------------------	----------	----------	----	---------------	----

Science Classroom 19, 2'x4' Suspended Ceiling Tile.

MAIN BUILDING

CLASSROOMS 19, 21, 23, 26, 28, PREP ROOM 3, COMPUTER ROOM, CUSTODIAN ROOM, LOUNGE ROOM, COUNSELOR OFFICE, BOOK STORAGE ROOM, OFFICES, PLACE 1, PLACE 2 AND TWO COORIDORS

SUSPENDED CEILING TILE

<u>05-212AAA</u>	9/12/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

<u>16-031-013</u>	1/29/2016	Negative	ND	NONE DETECTED	ND
--------------------------	-----------	----------	----	---------------	----

Staff Lounge, 2'x4' Suspended Ceiling Tile.

MAIN BUILDING

CLASSROOMS 19-24, NURES' OFFICE, PODS 1-6, COPY ROOM AND ENTRY PALCE 3

VINYL FLOOR TILE

<u>16-213AAA</u>	9/13/2016	Negative	NEW MATERIAL	NO SAMPLE	NS
-------------------------	-----------	----------	--------------	-----------	----

MAIN BUILDING

CLASSROOMS 19-24, NURES' OFFICE, PODS 1-6, COPY ROOM AND ENTRY PALCE 3

VINYL FLOOR TILE MASTIC

<u>16-213AAA</u>	9/13/2016	Negative	NEW MATERIAL	NO SAMPLE	NS
-------------------------	-----------	----------	--------------	-----------	----

MAIN BUILDING

ENTIRE BUILDING

SMOOTH WALL MISCELLANEOUS

<u>05-212AAA</u>	9/12/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

SAMPLES REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
<u>16-031-019</u> Corridor 18C, Drywall Board.	1/29/2016	Negative	ND	NONE DETECTED	ND
<u>16-031-020</u> Corridor 18C, Joint Compound for Drywall Board.	1/29/2016	Negative	ND	NONE DETECTED	ND
<u>16-031-023</u> Custodian #7, Drywall Board.	1/29/2016	Negative	ND	NONE DETECTED	ND
<u>16-031-024</u> Custodian #7, Joint Compound for Drywall Board.	1/29/2016	Negative	ND	NONE DETECTED	ND
<u>16-031-026</u> Corridor 6, Drywall Board.	1/29/2016	Negative	ND	NONE DETECTED	ND
<u>16-031-027</u> Corridor 6, Joint Compound for Drywall Board.	1/29/2016	Positive	2%	CHRYSTILE	CH
<u>16-031-053</u> Main Lobby by Drinking Fountain, Wallboard.	2/8/2016	Negative	ND	NONE DETECTED	ND
<u>16-031-055</u> Main Lobby by Drinking Fountain, Joint Compound on Wallboard.	2/8/2016	Negative	ND	NONE DETECTED	ND
MAIN BUILDING					
ENTIRE BUILDING					
SMOOTH WALL SURFACING					
<u>06-223AAA</u>	8/24/2006	Positive	ASSUMED	NO SAMPLE	NS
<u>16-031-021</u> Corridor 18C, Paint.	1/29/2016	Negative	ND	NONE DETECTED	ND
<u>16-031-021</u> Corridor 18C, Skim Coat.	1/29/2016	Positive	<1	CHRYSTILE	CH
<u>16-031-025</u> Custodian #7, Skim Coat.	1/29/2016	Negative	ND	NONE DETECTED	ND
<u>16-031-028</u> Corridor 6, Paint.	1/29/2016	Negative	ND	NONE DETECTED	ND

SAMPLES REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

<u>16-031-028</u> Corridor 6, Skim Coat.	1/29/2016	Positive	2%	CHRYSTILE	CH
--	-----------	----------	----	-----------	----

<u>16-031-054</u> Main Lobby by Drinking Fountain, Skim Coat on Wallboard.	2/8/2016	Negative	ND	NONE DETECTED	ND
--	----------	----------	----	---------------	----

MAIN BUILDING

ENTRY FOYERS AND CLASSROOM WINDOWS
ASBESTOS CEMENT WALL PANEL

<u>05-212AAA</u>	9/12/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

MAIN BUILDING

HALLWAY, MEDIA CENTER, NORTH OFFICE, AND MAIN OFFICE
CEILING MASTIC

<u>05-212AAA</u>	9/12/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

<u>16-031-002</u> Lobby Area, Brown Mastic.	1/29/2016	Negative	ND	NONE DETECTED	ND
---	-----------	----------	----	---------------	----

MAIN BUILDING

HALLWAY, MEDIA CENTER, NORTH OFFICE, AND MAIN OFFICE
CEILING TILE

<u>05-212AAA</u>	9/12/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

<u>16-031-001</u> Lobby Area.	1/29/2016	Negative	ND	NONE DETECTED	ND
---	-----------	----------	----	---------------	----

MAIN BUILDING

HALLWAYS, OFFICES, MEDIA CENTER, PREP AREA, STORAGE ROOM, UTILITY ROOMS, ALL CLASSROOMS
BASEBOARD MASTIC

<u>16-213AAA</u>	9/13/2016	Negative	NEW MATERIAL	NO SAMPLE	NS
-------------------------	-----------	----------	--------------	-----------	----

MAIN BUILDING

HALLWAYS TO PODS, AND LIBRARY (BOOK AREA AND BOOK RETURN AREA)
SUSPENDED CEILING TILE

<u>14-051AAA</u>	3/5/2014	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

SAMPLES REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

<u>16-031-003</u>	1/29/2016	Negative	ND	NONE DETECTED	ND
Hallway 18C, 2'x2' Suspended Ceiling Tile.					

MAIN BUILDING

NURSES' OFFICE AND LOBBY
BASEBOARD MASTIC

<u>16-213AAA</u>	9/13/2016	Negative	NEW MATERIAL	NO SAMPLE	NS
-------------------------	-----------	----------	--------------	-----------	----

MAIN BUILDING

OFFICES, LOBBIES, HALLWAYS, MEDIA CENTER, CLASSROOMS POD 1-6, AND CLASSROOMS 25 AND 26
CARPET MASTIC

<u>16-213AAA</u>	9/13/2016	Negative	NEW MATERIAL	NO SAMPLE	NS
-------------------------	-----------	----------	--------------	-----------	----

MAIN BUILDING

STAFF AND ALL STUDENT RESTROOMS
MORTAR MISCELLANEOUS

<u>08-241AAA</u>	10/20/2008	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	------------	----------	---------	-----------	----

<u>16-031-052</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
Main Lobby by Drinking Fountain, Mortar for 4"x4" Grey Ceramic Wall Tile.					

MAIN BUILDING

STAFF LOUNGE ROOM, STAFF WORK ROOM, 1 IN EACH POD ENTRY (6 PODS), CLASSROOMS 21, 26, 27, 29, AND STORAGE
SINK UNDERCOATING

<u>08-075AAA</u>	3/6/2007	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

MAIN BUILDING

STAFF RESTROOMS (2), STUDENT RESTROOMS (6), AND HEALTH OFFICE RESTROOM
MORTAR MISCELLANEOUS

<u>10-052AAA</u>	3/10/2010	Positive	ASSUMED	NO SAMPLE	NS
Apparent New Material as of this date.					

MAIN BUILDING

THREE ELECTRICAL ROOMS, PREP ROOM, THREE STORAGE ROOMS, AND DARK ROOM
VINYL FLOOR TILE

<u>05-212AAA</u>	9/12/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

SAMPLES REPORT FOR
SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE NO.	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
COMMENTS					

MAIN BUILDING

THREE ELECTRICAL ROOMS, PREP ROOM, THREE STORAGE ROOMS, AND DARK ROOM

VINYL FLOOR TILE MASTIC

<u>05-212AAA</u>	9/12/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

SAMPLES REPORT FOR
SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE NO.	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
COMMENTS					

METAL STORAGE CONTAINERS (4 EA)

METAL STORAGE CONTAINERS (4 EA)

METAL STORAGE CONTAINERS (4 EA)

STORAGE CONTAINER

16-074.NS

3/22/2016

Positive

ASSUMED

NO SAMPLE

NS

Metal Storage Structure.

SAMPLES REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

MULTI-PURPOSE BUILDING

MULTI-PURPOSE BUILDING

ASSEMBLY ROOM OF MULTI-PURPOSE ROOM
VINYL WALL COVER

<u>10-052AAA</u>	3/10/2010	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

MULTI-PURPOSE BUILDING

BOILER ROOM NEXT TO GIRLS LOCKER ROOM
DUCT WRAP TAPE

<u>05-212AAA</u>	9/12/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

MULTI-PURPOSE BUILDING

BOYS AND GIRLS, LOCKER ROOMS, COACHES OFFICES, MUSIC ROOM
BASEBOARD MASTIC

<u>16-213AAA</u>	9/13/2016	Negative	NEW MATERIAL	NO SAMPLE	NS
-------------------------	-----------	----------	--------------	-----------	----

MULTI-PURPOSE BUILDING

BOYS AND GIRLS RESTROOMS, KITCHEN RESTROOM, LOCKER ROOMS, AND BOYS' AND GIRLS' COACHES' RESTROOM
MORTAR MISCELLANEOUS

<u>08-241AAA</u>	10/16/2008	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	------------	----------	---------	-----------	----

MULTI-PURPOSE BUILDING

ENTIRE BUILDING
SMOOTH WALL MISCELLANEOUS

<u>05-212AAA</u>	9/12/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

<u>16-031-075</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
--------------------------	----------	----------	----	---------------	----

Multi-use 92, Drywall.

MULTI-PURPOSE BUILDING

ENTIRE BUILDING
SMOOTH WALL SURFACING

<u>06-223AAA</u>	8/24/2006	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

SAMPLES REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

MULTI-PURPOSE BUILDING

EXTERIOR WALLS AND OVERHANG

ROUGH WALL

<u>05-212AAA</u>	9/12/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

MULTI-PURPOSE BUILDING

EXTERIOR WALLS AND OVERHANG

ROUGH WALL SURFACING

<u>05-212AAA</u>	9/12/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

MULTI-PURPOSE BUILDING

KITCHEN

SEALANT

<u>09-098AAA</u>	5/14/2009	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

MULTI-PURPOSE BUILDING

KITCHEN

VINYL SHEETING

<u>08-241AAA</u>	10/16/2008	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	------------	----------	---------	-----------	----

MULTI-PURPOSE BUILDING

KITCHEN

VINYL SHEETING BACKING PAPER/MASTIC

<u>08-241AAA</u>	10/16/2008	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	------------	----------	---------	-----------	----

MULTI-PURPOSE BUILDING

KITCHEN EXTERIOR STOARGE (CAGED AREA) AND EXTERIOR WALL CAVITIES

PIPE FITTING INSULATION

<u>05-212AAA</u>	9/12/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

MULTI-PURPOSE BUILDING

KITCHEN, STORAGE, ELECTRICAL ROOM, RESTROOM, TABLE STORAGE ROOM, LOCKERS AREA, AND LANDING TO STAGE MULTI-PURPOSE ROOM

FIRE DOOR CORE INSULATION

<u>05-212AAA</u>	9/12/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

SAMPLES REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

MULTI-PURPOSE BUILDING

MULTI-PURPOSE ROOM
MASTIC/ADHESIVE

<u>16-213AAA</u>	9/13/2016	Negative	NEW MATERIAL	NO SAMPLE	NS
-------------------------	-----------	----------	--------------	-----------	----

MULTI-PURPOSE BUILDING

MULTI-PURPOSE ROOM
VINYL SHEETING

<u>16-213AAA</u>	9/13/2016	Negative	NEW MATERIAL	NO SAMPLE	NS
-------------------------	-----------	----------	--------------	-----------	----

MULTI-PURPOSE BUILDING

MULTI-PURPOSE ROOM, COACH'S OFFICE, STORAGE KITCHEN, AND STORAGE
VINYL FLOOR TILE

<u>08-241AAA</u>	10/16/2008	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	------------	----------	---------	-----------	----

MULTI-PURPOSE BUILDING

MULTI-PURPOSE ROOM, COACH'S OFFICE, STORAGE KITCHEN, AND STORAGE
VINYL FLOOR TILE MASTIC

<u>08-241AAA</u>	10/16/2008	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	------------	----------	---------	-----------	----

MULTI-PURPOSE BUILDING

MUSIC ROOM, MUSIC OFFICE, PRACTICE ROOMS, STAGE AND STAGE STORAGE ROOM
CARPET MASTIC

<u>16-213AAA</u>	9/13/2016	Negative	NEW MATERIAL	NO SAMPLE	NS
-------------------------	-----------	----------	--------------	-----------	----

MULTI-PURPOSE BUILDING

MUSIC ROOM, PRACTICE ROOMS (2), AND STAGE
WALL TILE

<u>08-241AAA</u>	10/16/2008	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	------------	----------	---------	-----------	----

MULTI-PURPOSE BUILDING

MUSIC ROOM, PRACTICE ROOMS (2), AND STAGE
WALL TILE MASTIC

<u>08-241AAA</u>	10/16/2008	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	------------	----------	---------	-----------	----

SAMPLES REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

MULTI-PURPOSE BUILDING

OLD RESTROOM NEXT TO PE STORAGE ROOM, AND RESTROOM LOCATED BEHIND CLASSROOM 33
TERRAZZO FLOOR

<u>09-098AAA</u>	5/14/2009	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

MULTI-PURPOSE BUILDING

PRACTICE ROOM, AND BAND ROOM OFFICE
PRESSED WOOD WALL PANEL

<u>05-212AAA</u>	3/6/2007	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

MULTI-PURPOSE BUILDING

PRACTICE ROOM, AND BAND ROOM OFFICE
PRESSED WOOD WALL PANEL MASTIC

<u>05-212AAA</u>	3/6/2007	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

MULTI-PURPOSE BUILDING

PRACTICE ROOM, AND BAND ROOM OFFICE
VINYL WALL COVER

<u>05-212AAA</u>	9/12/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

MULTI-PURPOSE BUILDING

PRACTICE ROOM, AND BAND ROOM OFFICE
VINYL WALL COVER MASTIC

<u>05-212AAA</u>	9/12/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

MULTI-PURPOSE BUILDING

SPORT EQUIPMENT ROOM
BASEBOARD MASTIC

<u>08-241AAA</u>	10/16/2008	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	------------	----------	---------	-----------	----

MULTI-PURPOSE BUILDING

STAGE, BAND ROOM, MULTI-PURPOSE ROOM, AND PRACTICE ROOM
CEILING MASTIC

<u>05-212AAA</u>	9/12/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

SAMPLES REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

MULTI-PURPOSE BUILDING

STAGE, BAND ROOM, MULTI-PURPOSE ROOM, AND PRACTICE ROOM

CEILING TILE

<u>05-212AAA</u>	9/12/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

<u>16-031-068</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
--------------------------	----------	----------	----	---------------	----

Vestibule 91, 1'x1' Ceiling Tile.

MULTI-PURPOSE BUILDING

STAGE STORAGE ROOMS, MULTI-PURPOSE ROOM CLASSROOM, ENTRIES TO MULTI-PURPOSE ROOM

VINYL FLOOR TILE

<u>16-213AAA</u>	9/13/2016	Negative	NEW MATERIAL	NO SAMPLE	NS
-------------------------	-----------	----------	--------------	-----------	----

MULTI-PURPOSE BUILDING

STAGE STORAGE ROOMS, MULTI-PURPOSE ROOM CLASSROOM, ENTRIES TO MULTI-PURPOSE ROOM

VINYL FLOOR TILE MASTIC

<u>16-213AAA</u>	9/13/2016	Negative	NEW MATERIAL	NO SAMPLE	NS
-------------------------	-----------	----------	--------------	-----------	----

MULTI-PURPOSE BUILDING

STORAGE, CHAIR STORAGE, ELECTRICAL ROOM AND BOILER ROOM

BASEBOARD MASTIC

<u>08-241AAA</u>	10/16/2008	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	------------	----------	---------	-----------	----

MULTI-PURPOSE BUILDING

STORAGE EQUIPMENT ROOM

CARPET MASTIC

<u>08-241AAA</u>	10/16/2008	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	------------	----------	---------	-----------	----

MULTI-PURPOSE BUILDING

STUDENT RESTROOMS (2), BOYS AND GIRLS LOCKER ROOM RESTROOMS, AND KITCHEN STAFF RESTROOM

MORTAR MISCELLANEOUS

<u>10-052AAA</u>	3/10/2010	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

Apparent New Material as of this date.

End Of Report, Total Of 20 Pages

DAMAGE REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
RISK ASSESSMENT CATEGORY	COMMENTS			

MAIN BUILDING

MAIN BUILDING

ALL CLASSROOMS, LOUNGE, AND PREP AREAS

PRESSED WOOD WALL PANEL

14,630 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

03/06/2007	4'x10' Pressed Wood Wall Panel with Vinyl Wall Cover, (over Gypsum Wallboard System). This Material is in GOOD condition as of this date.
04/04/2013	Damage Observed. <5% Physical Damage - in the form of several holes, cuts, gouging and separation of seams in various locations. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.
09/01/2017	Repairs Observed. All the previous Damages have been Repaired. Damages Observed. Classrooms 1A, 1B and 3B have Small Holes by the Door Knobs. All of the Classrooms, Lounge and Prep Areas have 1 SF of loose Vinyl. No other changes as of this date.
02/06/2019	This Material is unchanged as of this date.
08/14/2019	This Material is unchanged as of this date.
02/03/2020	This Material is unchanged as of this date.
08/28/2020	This Material is unchanged as of this date.
02/10/2021	This Material is unchanged as of this date.
08/11/2021	This Material is unchanged as of this date.
02/18/2022	This Material is unchanged as of this date.
08/17/2022	This Material is unchanged as of this date.
02/15/2023	This Material is unchanged as of this date.
08/16/2023	This Material is unchanged as of this date.
02/14/2024	This Material is unchanged as of this date.

MAIN BUILDING

ALL CLASSROOMS, LOUNGE, AND PREP AREAS

PRESSED WOOD WALL PANEL MASTIC

14,630 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

03/06/2007	Mastic/Adhesive for 4'x10' Pressed Wood Wall Panel with Vinyl Wall Cover, (over Gypsum Wallboard System). This Material is in GOOD condition as of this date.
------------	---

DAMAGE REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RISK ASSESSMENT CATEGORY

COMMENTS

QTY
(APPROXIMATE)

PHYSICAL DAMAGE (P:)
WATER DAMAGE (W:)

04/04/2013	Damage Observed. <5% Physical Damage - in the form of several holes, cuts, gouging and separation of seams in various locations. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.
09/01/2017	Repairs Observed. All the previous Damages have been Repaired. Damages Observed. Classrooms 1A, 1B and 3B have Small Holes by the Door Knobs. All of the Classrooms, Lounge and Prep Areas have 1 SF of loose Vinyl. No other changes as this date.
02/06/2019	This Material is unchanged as of this date.
08/14/2019	This Material is unchanged as of this date.
02/03/2020	This Material is unchanged as of this date.
08/28/2020	This Material is unchanged as of this date.
02/10/2021	This Material is unchanged as of this date.
08/11/2021	This Material is unchanged as of this date.
02/18/2022	This Material is unchanged as of this date.
08/17/2022	This Material is unchanged as of this date.
02/15/2023	This Material is unchanged as of this date.
08/16/2023	This Material is unchanged as of this date.
02/14/2024	This Material is unchanged as of this date.

MAIN BUILDING

ALL CLASSROOMS, LOUNGE, AND PREP AREAS

VINYL WALL COVER

14,630 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/12/2005	4'X10' Vinyl Covered Pressed Wood Walls. This Material is in GOOD condition as of this date.
03/06/2007	Material Description changed from ' 4'x10' Vinyl Covered Pressed Wood Walls ' to ' Vinyl Wall Cover, (on 4'x10' Pressed Wood Wall Panel over Gypsum Wallboard System). ' Pressed Wood Wall Panel entry added to reflect this fact. No other changes as of this date.
10/16/2008	This Material is unchanged as of this date
04/04/2013	Damage Observed. <5% Physical Damage - in the form of several holes, cuts, gouging and separation of seams in various locations. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.
09/01/2017	Repairs Observed. All the previous Damages have been Repaired. Damages Observed. Classrooms 1A, 1B and 3B have Small Holes by the Door Knobs. All of the Classrooms, Lounge and Prep Areas have 1 SF of loose Vinyl. No other changes as this date.

DAMAGE REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESSMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	--------------------------	----------	----------------------	---

09/01/2017	Repairs Observed. All the previous Damages have been Repaired. Damages Observed. Classrooms 1A, 1B and 3B have Small Holes by the Door Knobs. All of the Classrooms, Lounge and Prep Areas have 1 SF of loose Vinyl. No other changes as this date.					
02/06/2019	This Material is unchanged as of this date.					
08/14/2019	This Material is unchanged as of this date.					
02/03/2020	This Material is unchanged as of this date.					
08/28/2020	This Material is unchanged as of this date.					
02/10/2021	This Material is unchanged as of this date.					
08/11/2021	This Material is unchanged as of this date.					
02/18/2022	This Material is unchanged as of this date.					
08/17/2022	This Material is unchanged as of this date.					
02/15/2023	This Material is unchanged as of this date.					
08/16/2023	This Material is unchanged as of this date.					
02/14/2024	This Material is unchanged as of this date.					

MAIN BUILDING

ALL CLASSROOMS, LOUNGE, AND PREP AREAS

VINYL WALL COVER MASTIC

14,630 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/12/2005	Mastiv/Adhesive for Vinyl Covering oo 4'X10' Vinyl Covered Pressed Wood Walls. This Material is in GOOD condition as of this date.					
03/06/2007	Material Description changed from ' Mastic/Adhesive for Vinyl Covering on 4'x10' Vinyl Covered Pressed Wood Walls. ' to ' Mastic/Adhesive for Vinyl Wall Cover, (on 4'x10' Pressed Wood Wall Panel over Gypsum Wallboard System). ' Pressed Wood Wall Panel entry added to reflect this fact. No other changes as of this date.					
04/04/2013	Damage: <5% Physical Damage - in the form of several holes, cuts, gouging and separation of seams in various locations. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.					
09/01/2017	Repairs Observed. All the previous Damages have been Repaired. Damages Observed. Classrooms 1A, 1B and 3B have Small Holes by the Door Knobs. All of the Classrooms, Lounge and Prep Areas have 1 SF of loose Vinyl. No other changes as this date.					
02/06/2019	This Material is unchanged as of this date.					
08/14/2019	This Material is unchanged as of this date.					
02/03/2020	This Material is unchanged as of this date.					

DAMAGE REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

08/28/2020	This Material is unchanged as of this date.				
02/10/2021	This Material is unchanged as of this date.				
08/11/2021	This Material is unchanged as of this date.				
02/18/2022	This Material is unchanged as of this date.				
08/17/2022	This Material is unchanged as of this date.				
02/15/2023	This Material is unchanged as of this date.				
08/16/2023	This Material is unchanged as of this date.				
02/14/2024	This Material is unchanged as of this date.				

MAIN BUILDING

CLASSROOMS

SUSPENDED CEILING TILE	17,100 SF	P: Less Than 5% W: <10% Stains or Flaking
------------------------	-----------	--

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/12/2005	2'x4' with a 2'x2' pattern Suspended Ceiling Tile. This Material is in GOOD condition as of this date.				
10/16/2008	This Material is unchanged as of this date				
05/14/2009	5 Tiles are Water Damaged in Classroom 'Place1'. 2 Tiles are Water Damaged in the Library, next to the book return counter. 2 Tiles are Water Damaged in Pod 2 Atrium. 3 Tiles are Water Damaged in Classrooms Pod 2B. 1 Tile is broken in Classroom 2B. Friability changed from Moderate to High. This Material is in FAIR condition as of this date.				
09/04/2009	Material remains in <5% Physical Damage and <10% Water Damage. This Material is unchanged as of this date.				
03/11/2010	Additional Damage observed in Pod 2B with 3 broken Tiles. Also, 1 broken Tile observed in Classroom 20. No other changes as of this date.				
08/31/2010	Additional Damage in the form of 1 Tile is broken in Pod 1B. No other changes as of this date.				
03/05/2014	Tiles are 2'x4' with a 2'x2' pattern. 2 Tiles Water Damaged in rooms 2B, 2C. Quantity changed from 18,500 SF to 17,150 SF. Location changed from ALL CLASSROOMS AND POD AREAS to CLASSROOMS. Original entry updated. No other changes as of this date.				
01/29/2016	Sample 16-031-014 collected from Science Classroom 29, 2'x4' Suspended Ceiling Tile. Sample 16-031-008 collected from S.G.I. #3, 2'x4' Suspended Ceiling Tile.				
02/08/2016	Sample 16-031-064 collected from Science Classroom 19, 2'x4' Suspended Ceiling Tile.				
09/13/2016	Additional Damage Observed. <5% Physical Damage - in the form of 1 Tile missing in Classroom 4B and 1 Tile missing in Classroom 6B. No othe changes as of this date.				
09/01/2017	Partial Repairs Observed. All the Tiles with Water Damage in the Classrooms have been Painted Over. All the Missing Tiles in Classrooms 4B and 6B have been Replaced. Material remains in FAIR condition as of this date.				

DAMAGE REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME		QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
LOCATION	MATERIAL TYPE		
RISK ASSESMENT CATEGORY			
COMMENTS			
02/14/2018	Additional Damage Observed. Place1 has 4 Tiles with Water Damgae, 1 Tile was Replaced. No other chagnes as of this date.		
02/06/2019	This Material is unchanged as of this date.		
08/14/2019	Additional Damage Observed. <5% Physical Damage in the form of 1 Tiles with Stains in Classroom 5C. There are 3 Tiles with Stains in Classroom 1B. Material Condition remains in FAIR condition overall. No other changes as of this date.		
02/03/2020	This Material is unchanged as of this date.		
08/28/2020	This Material is unchanged as of this date.		
02/10/2021	Additional Damage Observed. 1 Tile with Broken Edges in Classroom 1C. No other changes as of this date.		
08/11/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	Additional Damage Observed. <5% Physical Damage in the form of 2 SF Water Stain in Classroom 2B. Material remains in FAIR condition overall. No other changes as of this date.		
02/15/2023	This Material is unchanged as of this date.		
08/16/2023	Additional Damage Observed. <5% Physical Damage in the form of 4 Tiles with 3 SF of Stains and 1 Tile with 6" of Cracks and Missing Pieces in Work Room between Classroom 1A and 1B. 2 Tiles with a total of 4 SF of Stains in Classroom 4B. 3 Tiles with a total of 4 SF of Stains in Classroom 19. Material remains in FAIR condition overall. No other changes as of this date.		
02/14/2024	This Material is unchanged as of this date.		

MAIN BUILDING

CLASSROOMS 19, 21, 23, 26, 28, PREP ROOM 3, COMPUTER ROOM, CUSTODIAN ROOM, LOUNGE ROOM, COUNSELOR OFFICE, BOOK STORAGE ROOM, OFFICES, PLACE 1, PLACE 2 AND TWO COORIDORS

SUSPENDED CEILING TILE

10,150 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/12/2005	2'X4' Suspended Ceiling Tile. Approximatly 50 SF is damaged and missing. This Material is in FAIR condition overall as of this date.
03/06/2007	Material reassessed. Damage Observed < 5%; in the form of approximately 50 SF located in the Supply/Electrical Room. Damage Condition changed from FAIR condition to FAIR condition overall. No other changes as of this date.
04/16/2008	In the Supply/Electrical Room several Tiles are broken and >50% are missing or loose. The remainder of this Material is unchanged as of this date.
10/16/2008	Classroom 28 has 4 Tiles water stained. No other changes as of this date.

DAMAGE REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME		QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
LOCATION	MATERIAL TYPE		
RISK ASSESMENT CATEGORY			
COMMENTS			
05/14/2009	Additional Material identified. Location changed from CLASSROOMS 19, 21, 23, 26, 28, PREP ROOM 3, COMPUTER ROOM, CUSTODIAN ROOM, LOUNGE ROOM, COUNSELOR OFFICE, AND MEDIA CENTER to CLASSROOMS 19, 21, 23, 26, 28, PREP ROOM 3, COMPUTER ROOM, CUSTODIAN ROOM, LOUNGE ROOM, COUNSELOR OFFICE, MEDIA CENTER AND BOOK STORAGE ROOM. Quantity changed from 9,950 SF to 10,150 SF. Missing Tiles in the Supply / Electrical Room have been replaced. Now, 1 Tile is missing in this area. Additional Damage observed. 2 Tiles are water damaged in the Electrical Room and 3 Tiles are water damaged in the Book Storage Room. This Material is unchanged as of this date		
09/04/2009	Damage reassessed. 2 Tiles water damaged previously observed in Electrical Room is now changed to 4 Tiles. Material remains in <5% physical damage and <10% water damage. No other changes as of this date.		
08/31/2010	Additional damage observed in the form of 6 Tiles are water damaged in Classroom 21. No other changes as of this date.		
12/01/2011	Additional damage - in the form of Lounge Room has 1 broken Ceiling Tile. No other changes as of this date.		
03/05/2014	Location changed from CLASSROOMS 19, 21, 23, 26, 28, PREP ROOM 3, COMPUTER ROOM, CUSTODIAN ROOM, LOUNGE ROOM, COUNSELOR OFFICE, MEDIA CENTER AND BOOK STORAGE ROOM to CLASSROOMS 19, 21, 23, 26, 28, PREP ROOM 3, COMPUTER ROOM, CUSTODIAN ROOM, LOUNGE ROOM, COUNSELOR OFFICE, BOOK STORAGE ROOM, OFFICES, PLACE 1, PLACE 2. No other changes as of this date.		
09/18/2015	Additional damage observed and location reassessed. Location description changed from 'CLASSROOMS 19, 21, 23, 26, 28, PREP ROOM 3, COMPUTER ROOM, CUSTODIAN ROOM, LOUNGE ROOM, COUNSELOR OFFICE, BOOK STORAGE ROOM, OFFICES, PLACE 1, PLACE 2' to 'CLASSROOMS 19, 21, 23, 26, 28, PREP ROOM 3, COMPUTER ROOM, CUSTODIAN ROOM, LOUNGE ROOM, COUNSELOR OFFICE, BOOK STORAGE ROOM, OFFICES, PLACE 1, PLACE 2 AND TWO COORIDORS'. Cooridor of Pod-1 and Pod-2 has 2 Tiles missing. No other change as of this date.		
01/29/2016	Sample 16-031-013 collected from Staff Lounge, 2'x4' Suspended Ceiling Tile.		
09/13/2016	Additional Damage Observed. <10% Water Damage - in the form of 1 Tile with Water Damage in Place 1.		
03/30/2017	Additional Damage Observed. 1 Tile with Water Damage in Secratary's Office. 2 Tiles with Water Damage in Social Worker's Office. 3 Tiles with Water Damage 4 Tiles Broken and 1 Tile Missing in Custodian Room's. 2 Tiles with Water Damage in Place 1. No other changes as of this date.		
09/01/2017	Additional Damage Observed. North Corridor now has 2 Tiles with Physical Damage. Secretary's Office now has 3 Tiles with Water Damage. No other changes as of this date.		
02/14/2018	Additional Damage Observed. Water Damage in Secrtarys Office has been Painted over. Material Remains in FAIR condition. No other changes as of this date.		
08/15/2018	Additional Damage Observed. Corridors have 20 Tiles in Scattered Locations with Small Holes and Cipped Corners. No other changes a of this date.		
02/06/2019	This Material is unchanged as of this date.		
08/14/2019	This Material is unchanged as of this date.		
02/03/2020	This Material is unchanged as of this date.		

DAMAGE REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

08/28/2020	Additional Damage Observed. <5% Physical Damage in the form of 2 Tiles with Surface Damage in Hallway near Staff Lounge. Material remains in FAIR condition overall. No other changes as of this date.					
02/10/2021	This Material is unchanged as of this date.					
08/11/2021	This Material is unchanged as of this date.					
02/18/2022	This Material is unchanged as of this date.					
08/17/2022	This Material is unchanged as of this date.					
02/15/2023	This Material is unchanged as of this date.					
08/16/2023	This Material is unchanged as of this date.					
02/14/2024	This Material is unchanged as of this date.					

MAIN BUILDING

CLASSROOMS 19-24, NURES' OFFICE, PODS 1-6, COPY ROOM AND ENTRY PALCE 3

VINYL FLOOR TILE

10,400 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/13/2016	New 12"x12" Beige Yellow and Blue Vinyl Floor Tiles, installed during Summer 2016 Modernization Project. This Material is in GOOD condition as of this date.					
02/14/2018	Damage Observed. <5% Physical Damage - in the form o f 2 Tiles Starting to Crack in Pod 6 Entry. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.					
08/15/2018	Additional Damage Observed. 1 Tile is Broken and 2 Tiles have Holes with Mastic Exposed in Copy Room. No other changes as of this date.					
02/06/2019	This Material is unchanged as of this date.					
08/14/2019	This Material is unchanged as of this date.					
02/03/2020	This Material is unchanged as of this date.					
08/28/2020	This Material is unchanged as of this date.					
02/10/2021	This Material is unchanged as of this date.					
08/11/2021	This Material is unchanged as of this date.					
02/18/2022	This Material is unchanged as of this date.					
08/17/2022	This Material is unchanged as of this date.					
02/15/2023	This Material is unchanged as of this date.					
08/16/2023	This Material is unchanged as of this date.					
02/14/2024	This Material is unchanged as of this date.					

DAMAGE REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESSMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	--------------------------	----------	----------------------	---

MAIN BUILDING

CLASSROOMS 19-24, NURES' OFFICE, PODS 1-6, COPY ROOM AND ENTRY PALCE 3

VINYL FLOOR TILE MASTIC

10,400 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/13/2016	New 12"x12" Beige Yellow and Blue Vinyl Floor Tiles, installed during Summer 2016 Modernization Project. This Material is in GOOD condition as of this date.
02/14/2018	Damage Observed. <5% Physical Damage - in the form o f 2 Tiles Starting to Crack in Pod 6 Entry. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.
08/15/2018	Additional Damage Observed. 1 Tile is Broken and 2 Tiles have Holes with Mastic Exposed in Copy Room. No other changes as of this date.
02/06/2019	This Material is unchanged as of this date.
08/14/2019	This Material is unchanged as of this date.
02/03/2020	This Material is unchanged as of this date.
08/28/2020	This Material is unchanged as of this date.
02/10/2021	This Material is unchanged as of this date.
08/11/2021	This Material is unchanged as of this date.
02/18/2022	This Material is unchanged as of this date.
08/17/2022	This Material is unchanged as of this date.
02/15/2023	This Material is unchanged as of this date.
08/16/2023	This Material is unchanged as of this date.
02/14/2024	This Material is unchanged as of this date.

MAIN BUILDING

HALLWAY, MEDIA CENTER, NORTH OFFICE, AND MAIN OFFICE

CEILING MASTIC

6,000 SF

P: Less Than 5%

W: <10% Stains or Flaking

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/12/2005	Mastic/Adhesive for 1'X1' Ceiling Tile. Approximately 10 SF Water Damage in Ceiling of South Hallway, next to Room 28. This Material is in FAIR condition as of this date.
03/06/2007	Approximate 10 SF Water Damage on Ceiling of Hallway, next to Room 28 Repaired. New Damage: < 5% Physical Damage - in Entry Area (next to RSP Room) in the form of approximately 80 SF of gouging and holes. No other changes as of this date.

DAMAGE REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME		QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
LOCATION	MATERIAL TYPE		
RISK ASSESMENT CATEGORY			
COMMENTS			

09/04/2009	Material remains in <5% physical damage and <10% water damage. This Material is unchanged as of this date.
12/01/2011	Additional damage - in the form of Media Center has 1 Tile broken and 2 Tiles are water stained. No other changes as of this date.
01/29/2016	Sample 16-031-002 collected from Lobby Area, Brown Mastic/Adhesive for 1'x1' Ceiling Tile.
03/30/2017	Additional Damage Observed. 4 Tiles with Cracks in RSP Room. No other changes as of this date.
02/14/2018	Additional Damage Observed. 25 Tiles have Physical Damage gouging and holes in them in RSP Room. Media Center Damages have been Repaired. No other changes as of this date.
02/06/2019	This Material is unchanged as of this date.
08/14/2019	This Material is unchanged as of this date.
02/03/2020	This Material is unchanged as of this date.
08/28/2020	This Material is unchanged as of this date.
02/10/2021	This Material is unchanged as of this date.
08/11/2021	This Material is unchanged as of this date.
02/18/2022	This Material is unchanged as of this date.
08/17/2022	This Material is unchanged as of this date.
02/15/2023	This Material is unchanged as of this date.
08/16/2023	This Material is unchanged as of this date.
02/14/2024	This Material is unchanged as of this date.

MAIN BUILDING

HALLWAY, MEDIA CENTER, NORTH OFFICE, AND MAIN OFFICE

CEILING TILE

6,000 SF

P: Less Than 5%

W: <10% Stains or Flaking

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/12/2005	1'X1' Ceiling Tile. Approximately 10 SF Water Damage in Ceiling of South Hallway, next to Room 28. This Material is in FAIR condition as of this date.
03/06/2007	Approximate 10 SF Water Damage on Ceiling of Hallway, next to Room 28 Repaired. New Damage:
05/14/2009	Additional Damaged observed. 18 Tiles are gouged or have holes. No other changes as of this date.
09/04/2009	Material remains in <5% physical damage and <10% water damage. Previously noted damages are in several locations. This Material is unchanged as of this date.
12/01/2011	Additional damage - in the form of Media Center has 1 Tile broken and 2 Tiles are water stained. No other changes as of this date.
01/29/2016	Sample 16-031-001 collected from Lobby Area, 1'x1' Glue on Ceiling Tile.

DAMAGE REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME		QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
LOCATION	MATERIAL TYPE		
RISK ASSESMENT CATEGORY			
COMMENTS			

03/06/2017	< 5% Physical Damage - in Entry Area (next to RSP Room) in the form of approximately 80 SF of gouging and holes. No other changes as of this date.		
03/30/2017	Additional Damage Observed. 4 Tiles with Cracks in RSP Room. No other changes as of this date.		
02/14/2018	Additional Damage Observed. 25 Tiles have Physical Damage gouging and holes in them in RSP Room. Media Center Damages have been Repaired. No other changes as of this date.		
02/06/2019	This Material is unchanged as of this date.		
08/14/2019	This Material is unchanged as of this date.		
02/03/2020	This Material is unchanged as of this date.		
08/28/2020	This Material is unchanged as of this date.		
02/10/2021	This Material is unchanged as of this date.		
08/11/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	This Material is unchanged as of this date.		
02/15/2023	This Material is unchanged as of this date.		
08/16/2023	This Material is unchanged as of this date.		
02/14/2024	This Material is unchanged as of this date.		

MAIN BUILDING

HALLWAYS TO PODS, AND LIBRARY (BOOK AREA AND BOOK RETURN AREA)

SUSPENDED CEILING TILE

1,350 SF

P: Less Than 5%

W: <10% Stains or Flaking

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

03/05/2014	2'x2' Suspended Ceiling Tiles. 2 Tiles have Water Damage and 1 Tile has a Hole in the Library. This Material is in FAIR condition as of this date.		
01/29/2016	Sample 16-031-003 collected from Hallway 18C, 2'x2' Suspended Ceiling Tile.		
03/22/2016	Additional Damage observed. Library has 1 Tile missing. No other changes as of this date.		
09/01/2017	Partial Repairs Observed. All Missing Tiles in the Library have been Replaced. Material remains in FAIR condition.		
02/14/2018	Additional Damage Observed. All Hallways have Several Tiles with Holes and Chipped Corners. No other changes as of this date.		
02/06/2019	This Material is unchanged as of this date.		
08/14/2019	This Material is unchanged as of this date.		
02/03/2020	This Material is unchanged as of this date.		

DAMAGE REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

08/28/2020	Additional Damage Observed. <5% Physical Damage in the form of 4 Tiles with Holes in Hallway to Pods 1 and 2. Material remains in FAIR condition overall. No other changes as of this date.					
02/10/2021	This Material is unchanged as of this date.					
08/11/2021	This Material is unchanged as of this date.					
02/18/2022	This Material is unchanged as of this date.					
08/17/2022	This Material is unchanged as of this date.					
02/15/2023	This Material is unchanged as of this date.					
08/16/2023	This Material is unchanged as of this date.					
02/14/2024	This Material is unchanged as of this date.					

MAIN BUILDING

STAFF AND ALL STUDENT RESTROOMS

MORTAR MISCELLANEOUS	2,800 SF	P: Less Than 5% W: No Evidence
----------------------	----------	-----------------------------------

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

10/16/2008	Grout/Mortar for 4"x4" Multi-Colored Ceramic Wall Tiles. This Material is in GOOD condition as of this date.					
05/14/2009	This Material is unchanged as of this date. (Apparent New Material identified by the AHERA accredited Inspector.)					
02/08/2016	Sample 16-031-052 collected from Main Lobby by Drinking Fountain, Mortar for 4"x4" Grey Ceramic Wall Tile.					
02/06/2019	This Material is unchanged as of this date.					
08/14/2019	This Material is unchanged as of this date.					
02/03/2020	This Material is unchanged as of this date.					
08/28/2020	Damage Observed. <5% Physical Damage in the form of 7 Tiles with Holes in Boys Restroom near Pod 1. 4 Tiles with Holes in Girls Restroom near Pod 1. Material condition changed from GOOD to FAIR overall. Friability updated from Non-Friable to Friable. No other changes as of this date.					
02/10/2021	This Material is unchanged as of this date.					
08/11/2021	This Material is unchanged as of this date.					
02/18/2022	This Material is unchanged as of this date.					
08/17/2022	This Material is unchanged as of this date.					
02/15/2023	This Material is unchanged as of this date.					
08/16/2023	This Material is unchanged as of this date.					
02/14/2024	This Material is unchanged as of this date.					

DAMAGE REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)	COMMENTS
---------------	----------	---------------	-------------------------	----------------------	---	----------

MAIN BUILDING

THREE ELECTRICAL ROOMS, PREP ROOM, THREE STORAGE ROOMS, AND DARK ROOM

VINYL FLOOR TILE	1,340 SF	P: Less Than 5% W: <10% Stains or Flaking
------------------	----------	--

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/12/2005	12"X12" beige VINYL FLOOR TILE. This Material is in GOOD condition as of this date.
03/06/2007	Damage Observed. <5% Physical Damage - in the form of 3 chipped Tiles and 1 missing Tile in center of Staff Workroom. Material Condition changed from GOOD to FAIR overall. No other changes as of this date.
11/07/2007	All Damages repaired and replaced with New Material. This Material is in GOOD condition as of this date.
10/11/2012	Damage Observed. <5% Physical Damage - in the form of Electrical Room, next to Pod A, has 1 Tile missing and 1 Tile is loose. Material condition changed from GOOD to FAIR overall. No other changes as of this date.
08/15/2018	Additional Damage Observed. 2 SF of Water Damage with Seaping Mastic and 1 Broken Tile by Men's Restroom. No other changes as of this date.
02/06/2019	This Material is unchanged as of this date.
08/14/2019	This Material is unchanged as of this date.
02/03/2020	This Material is unchanged as of this date.
08/28/2020	This Material is unchanged as of this date.
02/10/2021	This Material is unchanged as of this date.
08/11/2021	This Material is unchanged as of this date.
02/18/2022	This Material is unchanged as of this date.
08/17/2022	This Material is unchanged as of this date.
02/15/2023	This Material is unchanged as of this date.
08/16/2023	This Material is unchanged as of this date.
02/14/2024	This Material is unchanged as of this date.

MAIN BUILDING

THREE ELECTRICAL ROOMS, PREP ROOM, THREE STORAGE ROOMS, AND DARK ROOM

VINYL FLOOR TILE MASTIC	1,340 SF	P: Less Than 5% W: <10% Stains or Flaking
-------------------------	----------	--

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/12/2005	Mastic/Adhesive fOR 12"X12" beige VINYL FLOOR TILE. This Material is in GOOD condition as of this date.
------------	---

DAMAGE REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME		QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
LOCATION	MATERIAL TYPE		
RISK ASSESMENT CATEGORY			
COMMENTS			
03/06/2007	Damage Observed. <5% Physical Damage - in the form of 3 chipped Tiles and 1 missing Tile in center of Staff Workroom. Damage Condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.		
11/07/2007	All Damages Repaired and Replaced with New Material. Friability changed from Moderate to Low. This Material is in GOOD condition as of this date.		
10/11/2012	Damage Observed. <5% Physical Damage - in the form of Electrical Room, next to Pod A, has 1 Tile missing and 1 Tile is loose. Material condition changed from GOOD to FAIR overall. No other changes as of this date.		
08/15/2018	Additional Damage Observed. 2 SF of Water Damage with Seeping Mastic and 1 Broken Tile by Men's Restroom. No other changes as of this date.		
02/06/2019	This Material is unchanged as of this date.		
08/14/2019	This Material is unchanged as of this date.		
02/03/2020	This Material is unchanged as of this date.		
08/28/2020	This Material is unchanged as of this date.		
02/10/2021	This Material is unchanged as of this date.		
08/11/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	This Material is unchanged as of this date.		
02/15/2023	This Material is unchanged as of this date.		
08/16/2023	This Material is unchanged as of this date.		
02/14/2024	This Material is unchanged as of this date.		

DAMAGE REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESSMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	--------------------------	----------	----------------------	---

MULTI-PURPOSE BUILDING

MULTI-PURPOSE BUILDING

BOYS AND GIRLS RESTROOMS, KITCHEN RESTROOM, LOCKER ROOMS, AND BOYS' AND GIRLS' COACHES' RESTROOM

MORTAR MISCELLANEOUS

2,050 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

10/16/2008	Grout for 4"x4" and 6"x6" Multi-Colored Ceramic Wall Tiles (Original Entry Updated 8/17/22). This Material is in GOOD condition as of this date.
03/11/2010	Location Description changed from BOYS AND GIRLS RESTROOMS, KITCHEN RESTROOM to BOYS AND GIRLS RESTROOMS, KITCHEN RESTROOM, AND LOCKER ROOMS. Quantity changed from 1,100 SF to 1,700 SF. No other changes as of this date.
12/01/2011	Location Description changed from BOYS AND GIRLS RESTROOMS, KITCHEN RESTROOM, AND LOCKER ROOMS to BOYS AND GIRLS RESTROOMS, KITCHEN RESTROOM, LOCKER ROOMS, AND BOYS' AND GIRLS' COACHES' RESTROOM. Quantity changed from 1,700 SF to 2,050 SF. No other changes as of this date.
03/05/2014	This Material is unchanged as of this date.
08/27/2014	This Material is unchanged as of this date.
09/01/2017	Damage Observed. <5% Physical Damage - in the form of 2 Cracked Tiles in the Girls Locker Room. Material Condition changed from GOOD to FAIR. Friability changed from Non-Friable to Friable. No other changes as of this date.
02/06/2019	This Material is unchanged as of this date.
08/14/2019	This Material is unchanged as of this date.
02/03/2020	This Material is unchanged as of this date.
08/28/2020	Additional Damage Observed. <5% Physical Damage in the form of 7 Tiles with Holes in Boys Restroom near Boys Locker Room Entry. Material remains in FAIR condition overall. No other changes as of this date.
02/10/2021	This Material is unchanged as of this date.
02/18/2022	This Material is unchanged as of this date.
08/17/2022	This Material is unchanged as of this date.
02/15/2023	This Material is unchanged as of this date.
08/16/2023	This Material is unchanged as of this date.
02/14/2024	This Material is unchanged as of this date.

DAMAGE REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESSMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	--------------------------	----------	----------------------	---

MULTI-PURPOSE BUILDING

ENTIRE BUILDING

SMOOTH WALL MISCELLANEOUS

18,000 SF

P: No Visible Damage

W: <10% Stains or Flaking

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/12/2005	Gypsum Wallboard System Walls and Ceilings. This Material is in GOOD condition as of this date.
03/06/2007	Material Description changed from 'Gypsum Wallboard System Walls and Ceilings.' to 'Gypsum Wallboard System, (under 4'x10' Pressed Wood Wall Panel with Vinyl Wall Cover in some areas).' No other changes as of this date.
05/14/2009	5 SF is Damaged in the PE Storage Room with scratches and holes. Holes present in the Electrical Panel Room. 20 SF is Damaged in the Boiler Room behind the Boiler and the Boiler Room has several holes and cuts. This Material is in FAIR condition as of this date.
09/04/2009	Material remains in <5% Physical Damage and <10% Water Damage. This Material is unchanged as of this date.
03/11/2010	Additional Damage observed in the form of several holes, cuts and gouging on various surfaces of Walls in Multi-Purpose Room. Friability changed from Low to Moderate to reflect this change.
12/01/2011	Additional Damage - in the form of hole observed on Wall of Boys Coaches Office. No other changes as of this date.
08/27/2014	This Material is unchanged as of this date.
02/08/2016	Sample 16-031-075 collected from Multi-Use 92, Drywall.
03/22/2016	Additional Damage observed. Boys Locker Room has a 6 SQ" hole on Wall. Stage has 2 SF of missing Paint, and Skimcoat. White Gypsum Board Paper Cover is exposed due to 6 SQ" of cracks and missing Skimcoat. No other changes as of this date.
09/13/2016	Repairs Observed. Damages repaired as of this date. Material Condition changed from FAIR to GOOD. No other changes as of this date.
02/06/2019	This Material is unchanged as of this date.
08/14/2019	This Material is unchanged as of this date.
02/03/2020	This Material is unchanged as of this date.
08/28/2020	This Material is unchanged as of this date.
02/10/2021	This Material is unchanged as of this date.
02/18/2022	This Material is unchanged as of this date.
08/17/2022	This Material is unchanged as of this date.
02/15/2023	This Material is unchanged as of this date.
08/16/2023	This Material is unchanged as of this date.
02/14/2024	This Material is unchanged as of this date.

DAMAGE REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

MULTI-PURPOSE BUILDING

EXTERIOR WALLS AND OVERHANG

ROUGH WALL	14,360 SF	P: Less Than 5% W: No Evidence
------------	-----------	-----------------------------------

DAMAGED FRIABLE SURFACING ACM

09/12/2005	Stucco Walls and Overhang. This Material is in GOOD condition as of this date.
03/06/2007	Location Description changed from EXTERIOR WALLS AND OVERHANG to EXTERIOR WALLS AND OVERHANGS. Material Description changed from 'Stucco Walls and Overhang' to ' Stucco Exterior Walls and Overhangs'. No other changes as of this date.
03/05/2014	This Material is unchanged as of this date.
08/27/2014	This Material is unchanged as of this date.
02/06/2019	This Material is unchanged as of this date.
08/14/2019	This Material is unchanged as of this date.
02/03/2020	This Material is unchanged as of this date.
08/28/2020	This Material is unchanged as of this date.
02/10/2021	Damage Observed. <5% Physical Damage - in the form of 2 LF of Cracks in Food Serving Area. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.
02/18/2022	This Material is unchanged as of this date.
08/17/2022	This Material is unchanged as of this date.
02/15/2023	This Material is unchanged as of this date.
08/16/2023	This Material is unchanged as of this date.
02/14/2024	This Material is unchanged as of this date.

MULTI-PURPOSE BUILDING

EXTERIOR WALLS AND OVERHANG

ROUGH WALL SURFACING	14,360 SF	P: Less Than 5% W: No Evidence
----------------------	-----------	-----------------------------------

DAMAGED FRIABLE SURFACING ACM

09/12/2005	Skim Coat for Stucco Walls and Overhang. This Material is in GOOD condition as of this date.
03/06/2007	Location Description changed from EXTERIOR WALLS AND OVERHANG to EXTERIOR WALLS AND OVERHANGS. Material Description changed from 'Skim Coat for Stucco Walls and Overhang' to ' Skim Coat for Stucco Exterior Walls and Overhangs'. No other changes as of this date.
03/05/2014	This Material is unchanged as of this date.

DAMAGE REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

08/27/2014	This Material is unchanged as of this date.					
02/06/2019	This Material is unchanged as of this date.					
08/14/2019	This Material is unchanged as of this date.					
02/03/2020	This Material is unchanged as of this date.					
08/28/2020	This Material is unchanged as of this date.					
02/10/2021	Damage Observed. <5% Physical Damage - in the form of 2 LF of Cracks in Food Serving Area. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.					
02/18/2022	This Material is unchanged as of this date.					
08/17/2022	This Material is unchanged as of this date.					
02/15/2023	This Material is unchanged as of this date.					
08/16/2023	This Material is unchanged as of this date.					
02/14/2024	This Material is unchanged as of this date.					

MULTI-PURPOSE BUILDING

MULTI-PURPOSE ROOM, COACH'S OFFICE, STORAGE KITCHEN, AND STORAGE

VINYL FLOOR TILE

75 SF

P: No Visible Damage

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

10/16/2008	12"x12" Beige Vinyl Floor Tile. This Material is in GOOD condition as of this date.					
05/14/2009	This Material is unchanged as of this date. (Apparent New Material identified by the AHERA accredited Inspector.)					
12/01/2011	Location Description changed from MULTI-PURPOSE ROOM, COACH'S OFFICE, AND STORAGE KITCHEN to MULTI-PURPOSE ROOM, COACH'S OFFICE, STORAGE KITCHEN, AND STORAGE. Quantity changed from 7,500 SF to 7,600 SF. Damage: <5% Physical Damage - in the form of 2 Tiles are broken next to Back Entry Door of Multipurpose Room and Mastic/Adhesive is exposed. Material condition changed from GOOD to FAIR overall as of this date. Friability changed from Non to Low to reflect this change.					
03/05/2014	This Material is unchanged as of this date.					
08/27/2014	This Material is unchanged as of this date.					
09/13/2016	Material Re-assessed. Removed all except for Kitchen Storage. Material Quantitiy changed from 7,600 SF to 75 SF. Material is in GOOD condition overall . No other changes as of this date.					
02/06/2019	This Material is unchanged as of this date.					
08/14/2019	This Material is unchanged as of this date.					
02/03/2020	This Material is unchanged as of this date.					

DAMAGE REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME		QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
LOCATION	MATERIAL TYPE		
RISK ASSESMENT CATEGORY			
COMMENTS			

08/28/2020	This Material is unchanged as of this date.
02/10/2021	This Material is unchanged as of this date.
02/18/2022	This Material is unchanged as of this date.
08/17/2022	This Material is unchanged as of this date.
02/15/2023	This Material is unchanged as of this date.
08/16/2023	This Material is unchanged as of this date.
02/14/2024	This Material is unchanged as of this date.

MULTI-PURPOSE BUILDING

MULTI-PURPOSE ROOM, COACH'S OFFICE, STORAGE KITCHEN, AND STORAGE

VINYL FLOOR TILE MASTIC

75 SF

P: No Visible Damage

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

10/16/2008	Mastic/Adhesive for 12"x12" Beige Vinyl Floor Tile. This Material is in GOOD condition as of this date.
05/14/2009	This Material is unchanged as of this date. (Apparent New Material identified by the AHERA accredited Inspector.)
12/01/2011	Location Description changed from MULTI-PURPOSE ROOM, COACH'S OFFICE, AND STORAGE KITCHEN to MULTI-PURPOSE ROOM, COACH'S OFFICE, STORAGE KITCHEN, AND STORAGE. Quantity changed from 7,500 SF to 7,600 SF. Damage: <5% Physical Damage - in the form of 2 Tiles are broken next to back entry door of Multipurpose Room and Mastic is exposed. Material condition changed from GOOD to FAIR overall as of this date. Friability changed from Non to Low to reflect this change.
03/05/2014	This Material is unchanged as of this date.
08/27/2014	This Material is unchanged as of this date.
09/13/2016	Material Re-assessed. Removed all except for Kitchen Storage. Material Quantitiy changed from 7,600 SF to 75 SF. Material is in GOOD condition overall . No other changes as of this date.
02/06/2019	This Material is unchanged as of this date.
08/14/2019	This Material is unchanged as of this date.
02/03/2020	This Material is unchanged as of this date.
08/28/2020	This Material is unchanged as of this date.
02/10/2021	This Material is unchanged as of this date.
02/18/2022	This Material is unchanged as of this date.
08/17/2022	This Material is unchanged as of this date.
02/15/2023	This Material is unchanged as of this date.
08/16/2023	This Material is unchanged as of this date.

DAMAGE REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESSMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	--------------------------	----------	----------------------	---

02/14/2024 This Material is unchanged as of this date.

MULTI-PURPOSE BUILDING

MUSIC ROOM, PRACTICE ROOMS (2), AND STAGE

WALL TILE

1,410 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

10/16/2008 1'x1' Wall Tile. This Material is in GOOD condition as of this date.

03/11/2010 Location Description changed from MUSIC ROOM to MUSIC ROOM, AND PRACTICE ROOMS (3). Quantity changed from 410 SF to 890 SF. No other changes as of this date.

12/01/2011 Location Description changed from MUSIC ROOM, AND PRACTICE ROOMS (3) to MUSIC ROOM, PRACTICE ROOMS (2), AND STAGE. Quantity changed from 890 SF to 1,410 SF. Damage: <5% Physical Damage - in the form of Stage area has 1 Tile missing and Mastic is exposed. Material condition changed from GOOD to FAIR overall as of this date. Friability changed from Moderate to High to reflect this change.

03/05/2014 This Material is unchanged as of this date.

08/27/2014 This Material is unchanged as of this date.

03/22/2016 Partial Repair made and Additional Damage observed. Missing Wall Tile of Stage Area has been Replaced. Lower level of the Wall Tile has 60 SF of Tiles with small holes, and cuts. No other changes as of this date.

03/30/2017 Additional Damage Observed. 2 Tiles Missing Mastic Exposed Stage. No other changes as of this date.

02/06/2019 This Material is unchanged as of this date.

08/14/2019 This Material is unchanged as of this date.

02/03/2020 This Material is unchanged as of this date.

08/28/2020 Additional Damage Observed. <5% Physical Damage in the form of 6 Tiles with Holes in Music Room. 3 Tiles with Holes in Practice Room 1. 2 Tiles with Scuffs in Practice Room 2. Material remains in FAIR condition overall. No other changes as of this date.

02/10/2021 This Material is unchanged as of this date.

02/18/2022 This Material is unchanged as of this date.

08/17/2022 Additional Damage Observed. <5% Physical Damage in the form of 1 Missing Tile with Brown Mastic Exposed on North Wall of Stage. Material remains in FAIR condition overall. No other changes as of this date.

02/15/2023 This Material is unchanged as of this date.

08/16/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

DAMAGE REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

MULTI-PURPOSE BUILDING

MUSIC ROOM, PRACTICE ROOMS (2), AND STAGE

WALL TILE MASTIC

1,410 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

10/16/2008	Mastic/Adhesive for 1'x1' Wall Tile. This Material is in GOOD condition as of this date.
03/11/2010	Location Description changed from MUSIC ROOM to MUSIC ROOM, AND PRACTICE ROOMS (3). Quantity changed from 410 SF to 890 SF. No other changes as of this date.
12/01/2011	Location Description changed from MUSIC ROOM, AND PRACTICE ROOMS (3) to MUSIC ROOM, PRACTICE ROOMS (2), AND STAGE. Quantity changed from 890 SF to 1,410 SF. Damage: <5% Physical Damage - in the form of Stage area has 1 Tile missing and Mastic is exposed. Material condition changed from GOOD to FAIR overall as of this date. Friability changed from Non to Low to reflect this change.
03/05/2014	This Material is unchanged as of this date.
03/22/2016	Partial Repair made and Additional Damage observed. Missing Wall Tile of Stage Area has been Replaced. Lower level of the Wall Tile has 60 SF of Tiles with small holes, and cuts. No other changes as of this date.
03/30/2017	Additional Damage Observed. 2 Tiles Missing Mastic Exposed by Stage. No other changes as of this date.
02/06/2019	This Material is unchanged as of this date.
08/14/2019	This Material is unchanged as of this date.
02/03/2020	This Material is unchanged as of this date.
08/28/2020	Additional Damage Observed. <5% Physical Damage in the form of 6 Tiles with Holes in Music Room. 3 Tiles with Holes in Practice Room 1. 2 Tiles with Scuffs in Practice Room 2. Material remains in FAIR condition overall. No other changes as of this date.
02/10/2021	This Material is unchanged as of this date.
02/18/2022	This Material is unchanged as of this date.
08/17/2022	Additional Damage Observed. <5% Physical Damage in the form of 1 Missing Tile with Brown Mastic Exposed on North Wall of Stage. Material remains in FAIR condition overall. No other changes as of this date.
02/15/2023	This Material is unchanged as of this date.
08/16/2023	This Material is unchanged as of this date.
02/14/2024	This Material is unchanged as of this date.

DAMAGE REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESSMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	--------------------------	----------	----------------------	---

MULTI-PURPOSE BUILDING

PRACTICE ROOM, AND BAND ROOM OFFICE

VINYL WALL COVER

2,960 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/12/2005	Vinyl Wall Cover, (on 4'x8' Pressed Wood Wall Panel over Gypsum Wallboard System. This Material is in GOOD condition as of this date.
03/06/2007	Material Description changed from ' 4'x8' Vinyl Covered Pressed Wood Walls. ' to ' Vinyl Wall Cover, (on 4'x8' Pressed Wood Wall Panel over Gypsum Wallboard System). This Material is in GOOD condition as of this date. No other changes as of this date.
12/01/2011	Location Description changed from PRACTICE ROOM, MULTI-PURPOSE ROOM, AND BAND ROOM OFFICE to PRACTICE ROOM, AND BAND ROOM OFFICE. No other changes as of this date.
09/26/2013	Friability changed from Low to Non. No other changes as of this date.
03/05/2014	This Material is unchanged as of this date.
08/27/2014	This Material is unchanged as of this date.
02/06/2019	This Material is unchanged as of this date.
08/14/2019	This Material is unchanged as of this date.
02/03/2020	This Material is unchanged as of this date.
08/28/2020	Damage Observed. <5% Physical Damage in the form of 1 SF of Torn and Missing Wall Cover around wall Outlet, on the West Wall in the Band Room. Material condition changed from GOOD to FAIR overall. Friability updated from Non-Friable to Friable. No other changes as of this date.
02/10/2021	This Material is unchanged as of this date.
02/18/2022	This Material is unchanged as of this date.
08/17/2022	This Material is unchanged as of this date.
02/15/2023	This Material is unchanged as of this date.
08/16/2023	This Material is unchanged as of this date.
02/14/2024	This Material is unchanged as of this date.

MULTI-PURPOSE BUILDING

PRACTICE ROOM, AND BAND ROOM OFFICE

VINYL WALL COVER MASTIC

2,960 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/12/2005	Mastic/Adhesive for Vinyl Wall Cover, (on 4'x8' Pressed Wood Wall Panel over Gypsum Wallboard System). This Material is in GOOD condition as of this date.
------------	--

DAMAGE REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

03/06/2007	Material Description changed from ' Mastic/Adhesive for Vinyl Covering on 4'x8' Vinyl Covered Pressed Wood Walls. ' to ' Mastic/Adhesive for Vinyl Wall Cover, (on 4'x8' Pressed Wood Wall Panel over Gypsum Wallboard System). ' This Material is in GOOD condition as of this date.					
12/01/2011	Location Description changed from PRACTICE ROOM, MULTI-PURPOSE ROOM, AND BAND ROOM OFFICE to PRACTICE ROOM, AND BAND ROOM OFFICE. No other changes as of this date.					
03/05/2014	This Material is unchanged as of this date.					
08/27/2014	This Material is unchanged as of this date.					
02/06/2019	This Material is unchanged as of this date.					
08/14/2019	This Material is unchanged as of this date.					
02/03/2020	This Material is unchanged as of this date.					
08/28/2020	Damage Observed. <5% Physical Damage in the form of 1 SF of Torn and Missing Wall Cover around wall Outlet, on the West Wall in the Band Room. Material condition changed from GOOD to FAIR overall. Friability updated from Non-Friable to Friable. No other changes as of this date.					
02/10/2021	This Material is unchanged as of this date.					
02/18/2022	This Material is unchanged as of this date.					
08/17/2022	This Material is unchanged as of this date.					
02/15/2023	This Material is unchanged as of this date.					
08/16/2023	This Material is unchanged as of this date.					
02/14/2024	This Material is unchanged as of this date.					

MULTI-PURPOSE BUILDING

STAGE, BAND ROOM, MULTI-PURPOSE ROOM, AND PRACTICE ROOM

CEILING MASTIC

8,500 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/12/2005	Mastic/Adhesive for 1'x1' Ceiling Tile. This Material is in GOOD condition as of this date.					
10/16/2008	Location Description changed from STAGE, BAND ROOM, AND MULTI-PURPOSE ROOM to BAND ROOM, AND MULTI-PURPOSE ROOM. 2 missing Tiles and Mastic exposed in Cafeteria. No other changes as of this date.					
05/14/2009	Location changed from BAND ROOM, AND MULTI-PURPOSE ROOM to STAGE, BAND ROOM, AND MULTI-PURPOSE ROOM. No other changes as of this date.					
09/04/2009	Material remains in <5% physical damage. This Material is unchanged as of this date.					
03/11/2010	Material reassessed. Missing Tiles and exposed Mastic in Cafeteria have been replaced. Additional damage observed in the form of small holes in assembly area, next to accordion wall of Multi-Purpose room. No other changes as of this date.					

DAMAGE REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME		QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
LOCATION	MATERIAL TYPE		
RISK ASSESSMENT CATEGORY			
COMMENTS			
08/31/2010	Additional damage observed in the form of 3 Tiles are water damaged in Multi-Purpose Room. No other changes as of this date.		
12/01/2011	Location Description changed from STAGE, BAND ROOM, AND MULTI-PURPOSE ROOM to STAGE, BAND ROOM, MULTI-PURPOSE ROOM, AND PRACTICE ROOM. No other changes as of this date.		
09/26/2013	Material Re-Assessed. Material changed from GOOD to FAIR condition. No other changes as of this date.		
03/05/2014	This Material is unchanged as of this date.		
08/27/2014	This Material is unchanged as of this date.		
02/06/2019	This Material is unchanged as of this date.		
08/14/2019	This Material is unchanged as of this date.		
02/03/2020	Repairs Observed. All Damage Repaired. Material Condition changed from FAIR to GOOD. Friability updated from Friable to Non-Friable. No other changes as of this date.		
08/28/2020	This Material is unchanged as of this date.		
02/10/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	This Material is unchanged as of this date.		
02/15/2023	This Material is unchanged as of this date.		
08/16/2023	Damage Observed. <5% Physical Damage in the form of 5 EA Tiles with Water Stains, 1.5 EA Tiles missing with Brown Mastic Exposed, 1 EA Tile is Loose and 1 SF of Black Mold in Multi-purpose Room. Material condition changed from GOOD to FAIR overall. No other changes as of this date.		
02/14/2024	This Material is unchanged as of this date.		

MULTI-PURPOSE BUILDING

STAGE, BAND ROOM, MULTI-PURPOSE ROOM, AND PRACTICE ROOM

CEILING TILE

8,500 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/12/2005	1'x1' Ceiling Tile. This Material is in GOOD condition as of this date.
10/16/2008	Two Tiles missing and Mastic exposed in Multi-Purpose room. No other changes as of this date.
09/04/2009	Material remains in <5% Physical Damage. This Material is unchanged as of this date.
03/11/2010	Material Re-Assessed. Missing Tiles and exposed Mastic in Cafeteria have been replaced. Additional Damage observed in the form of small holes in Assembly Area, next to Accordion Wall of Multi-Purpose room. No other changes as of this date.
08/31/2010	Additional Damage observed in the form of 3 Tiles are Water Damaged in Multi-Purpose Room. No other changes as of this date.

DAMAGE REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

12/01/2011	Location Description changed from STAGE, BAND ROOM, AND MULTI-PURPOSE ROOM to STAGE, BAND ROOM, MULTI-PURPOSE ROOM, AND PRACTICE ROOM. No other changes as of this date.					
09/26/2013	Material Re-Assessed. Material changed from GOOD to FAIR condition. No other changes as of this date.					
03/05/2014	This Material is unchanged as of this date.					
08/27/2014	This Material is unchanged as of this date.					
02/08/2016	Sample 16-031-068 collected from Vestibule 91, 1'x1' Ceiling Tile.					
02/06/2019	This Material is unchanged as of this date.					
08/14/2019	This Material is unchanged as of this date.					
02/03/2020	Repairs Observed. All Damage Repaired. Material Condition changed from FAIR to GOOD. Friability updated from Friable to Non-Friable. No other changes as of this date.					
08/28/2020	This Material is unchanged as of this date.					
02/10/2021	This Material is unchanged as of this date.					
02/18/2022	This Material is unchanged as of this date.					
08/17/2022	This Material is unchanged as of this date.					
02/15/2023	This Material is unchanged as of this date.					
08/16/2023	Damage Observed. <5% Physical Damage in the form of 5 EA Tiles with Water Stains, 1.5 EA Tiles missing with Brown Mastic Exposed, 1 EA Tile is Loose and 1 SF of Black Mold in Multi-purpose Room. Material condition changed from GOOD to FAIR overall. No other changes as of this date.					
02/14/2024	This Material is unchanged as of this date.					

MULTI-PURPOSE BUILDING

STORAGE, CHAIR STORAGE, ELECTRICAL ROOM AND BOILER ROOM

BASEBOARD MASTIC

180 LF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

10/16/2008	Mastic/Adhesive for 4" Brown Baseboard. This Material is in GOOD condition as of this date.					
05/14/2009	Additional Material identified. Location changed from STORAGE, CHAIR STORAGE AND ELECTRICAL ROOM to STORAGE, CHAIR STORAGE, ELECTRICAL ROOM AND BOILER ROOM. Quantity changed from 140 LF to 180 LF. 6 LF of Baseboard is missing in the Boiler Room, exposing the Mastic/Adhesive. Friability changed from Non to Low. This Material is in FAIR condition as of this date.					
03/05/2014	This Material is unchanged as of this date.					
08/27/2014	This Material is unchanged as of this date.					
03/17/2015	Exterior Storage Room, 1 LF of Baseboard is missing by the Door, exposing the Brown Mastic/Adhesive. No other changes as of this date.					
02/06/2019	This Material is unchanged as of this date.					

DAMAGE REPORT FOR

SIERRAMONT MIDDLE SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
COMMENTS					

08/14/2019	This Material is unchanged as of this date.
02/03/2020	This Material is unchanged as of this date.
08/28/2020	This Material is unchanged as of this date.
02/10/2021	This Material is unchanged as of this date.
02/18/2022	This Material is unchanged as of this date.
08/17/2022	This Material is unchanged as of this date.
02/15/2023	This Material is unchanged as of this date.
08/16/2023	This Material is unchanged as of this date.
02/14/2024	This Material is unchanged as of this date.

MULTI-PURPOSE BUILDING

STORAGE EQUIPMENT ROOM

CARPET MASTIC

110 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM


10/16/2008	Mastic/Adhesive for Blue Carpet. This Material is in GOOD condition as of this date.
03/05/2014	This Material is unchanged as of this date.
08/27/2014	This Material is unchanged as of this date.
02/06/2019	Material Re-assessed. Carpet Removed Yellow Mastic Exposed. Friability changed from Non-Friable to Friable. No other changes as of this date.
08/14/2019	This Material is unchanged as of this date.
02/03/2020	This Material is unchanged as of this date.
08/28/2020	This Material is unchanged as of this date.
02/10/2021	This Material is unchanged as of this date.
02/18/2022	This Material is unchanged as of this date.
08/17/2022	This Material is unchanged as of this date.
02/15/2023	This Material is unchanged as of this date.
08/16/2023	This Material is unchanged as of this date.
02/14/2024	This Material is unchanged as of this date.

End Of Report, Total Of 25 Pages

Sierramont

Middle School
3155 Kimlee Dr, San Jose


Supply Containers

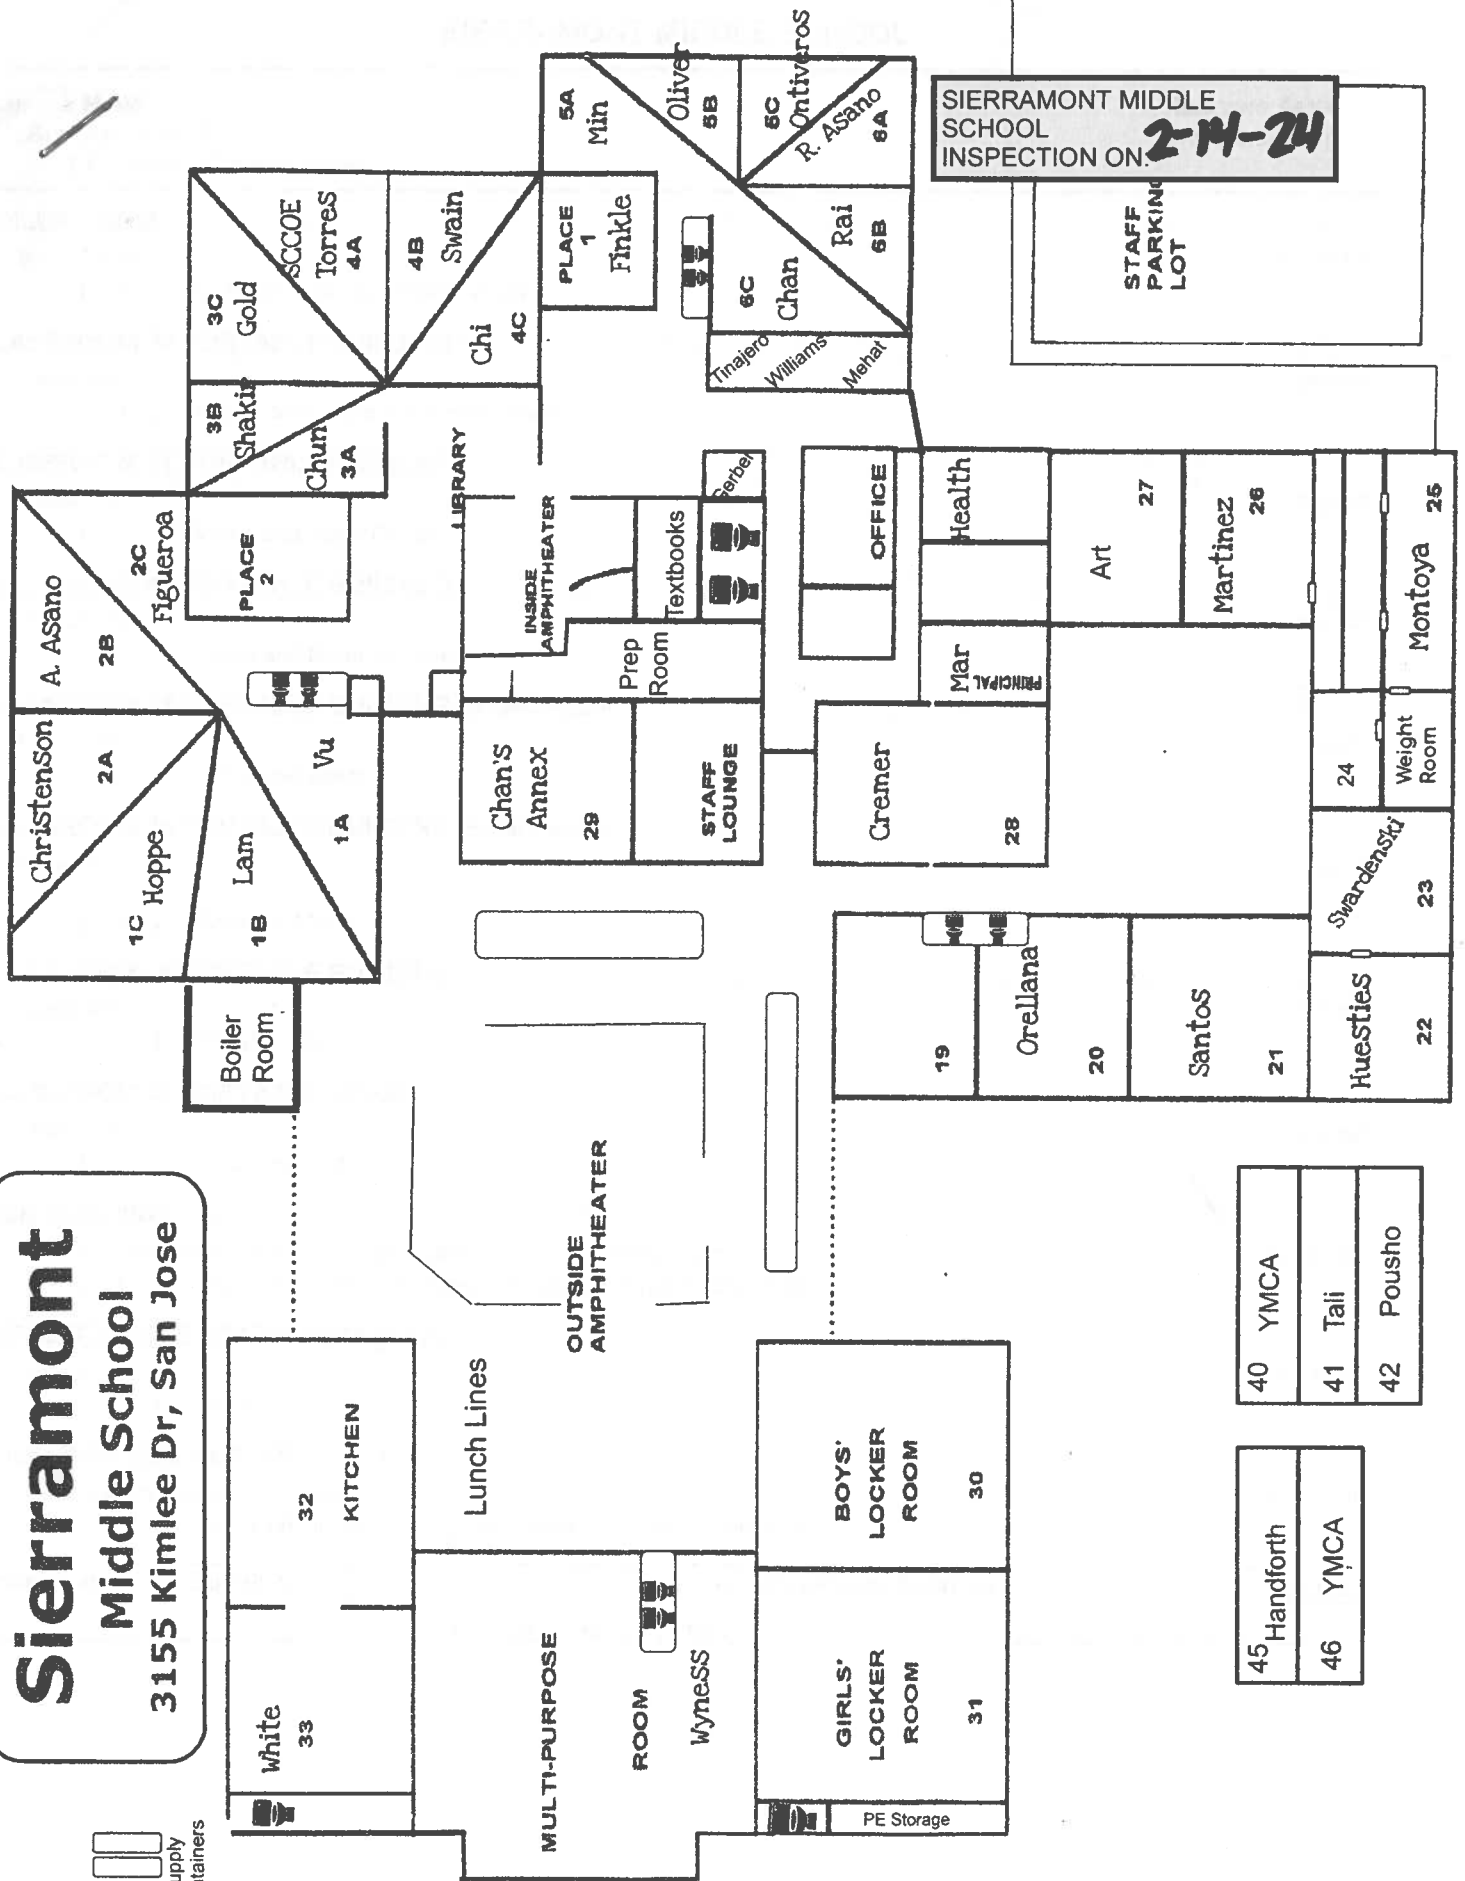

SIERRAMONT MIDDLE SCHOOL
INSPECTION ON: 2-14-24

STAFF PARKING LOT

SIERRAMONT
MIDDLE SCHOOL
 3155 KIMLEE DR. SJ 95132
 2013-14

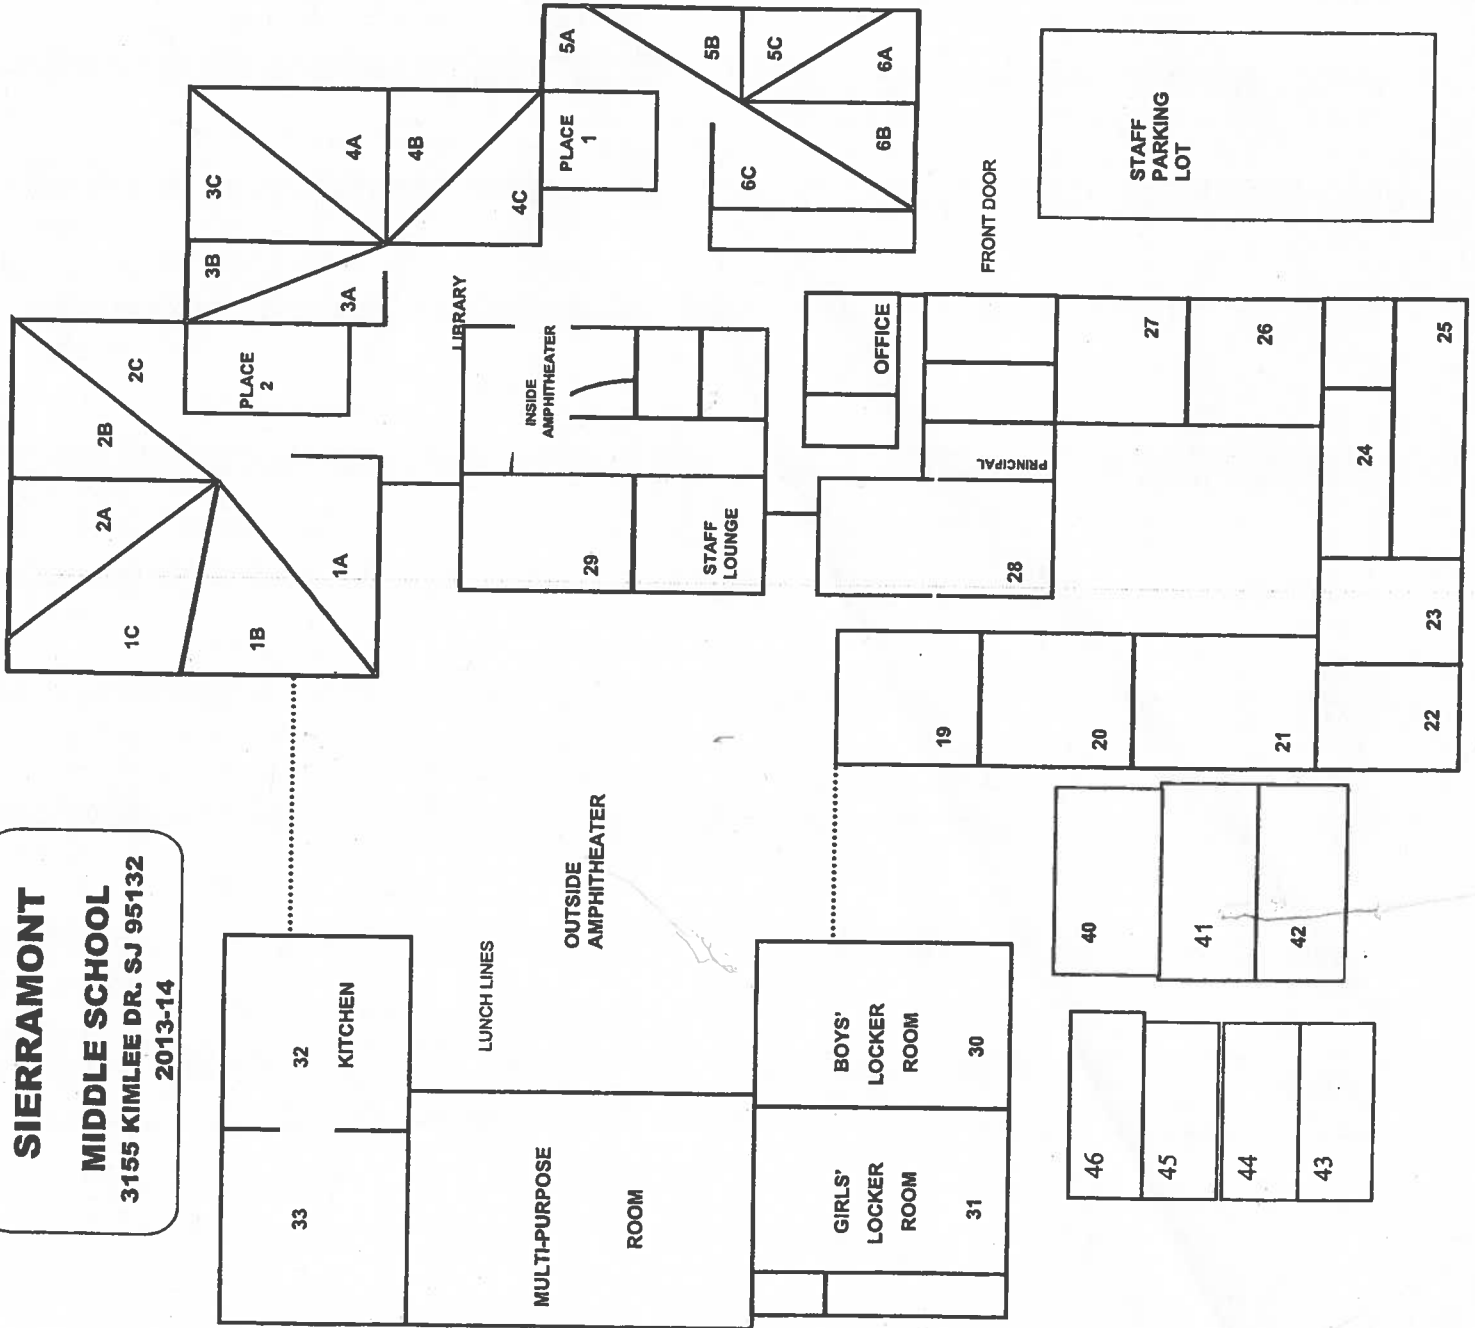

Room	Teacher
1A	Vu
1B	Gairaud
1C	Hoppe
2A	Christensen
2B	Ross
2C	Raisch
Place 2	Ridley
3A	Chun
3B	Shakir
3C	Gold
4A	Parodi
4B	Da Silva
4C	Chi
Place 1	Asano
5A	Liu
5B	Palla
5C	Ontiveros
6A	Perry
6B	Rai
6C	Johnson
19	Pfeiffer
20	Edens
21	Wiebe
22	Huesties
23	Singh
25	Mahal
26	Hurley
27	Lashbrook
28	Cremer
29	Arensberg
30	Boy PE
31	Girls PE
33	McVeigh
40	Figueroa
41	Sen
42	Pousho
43	Davis
44	Lam
45	Chan
46	Balsbaugh

SIERRAMONT MIDDLE SCHOOL
 INSPECTED ON 08-16-2023


SIERRAMONT

MIDDLE SCHOOL

3155 KIMLEE DR. SJ 95132

2013-14

SIERRAMONT MIDDLE SCHOOL
INSPECTED ON: 2/15/23

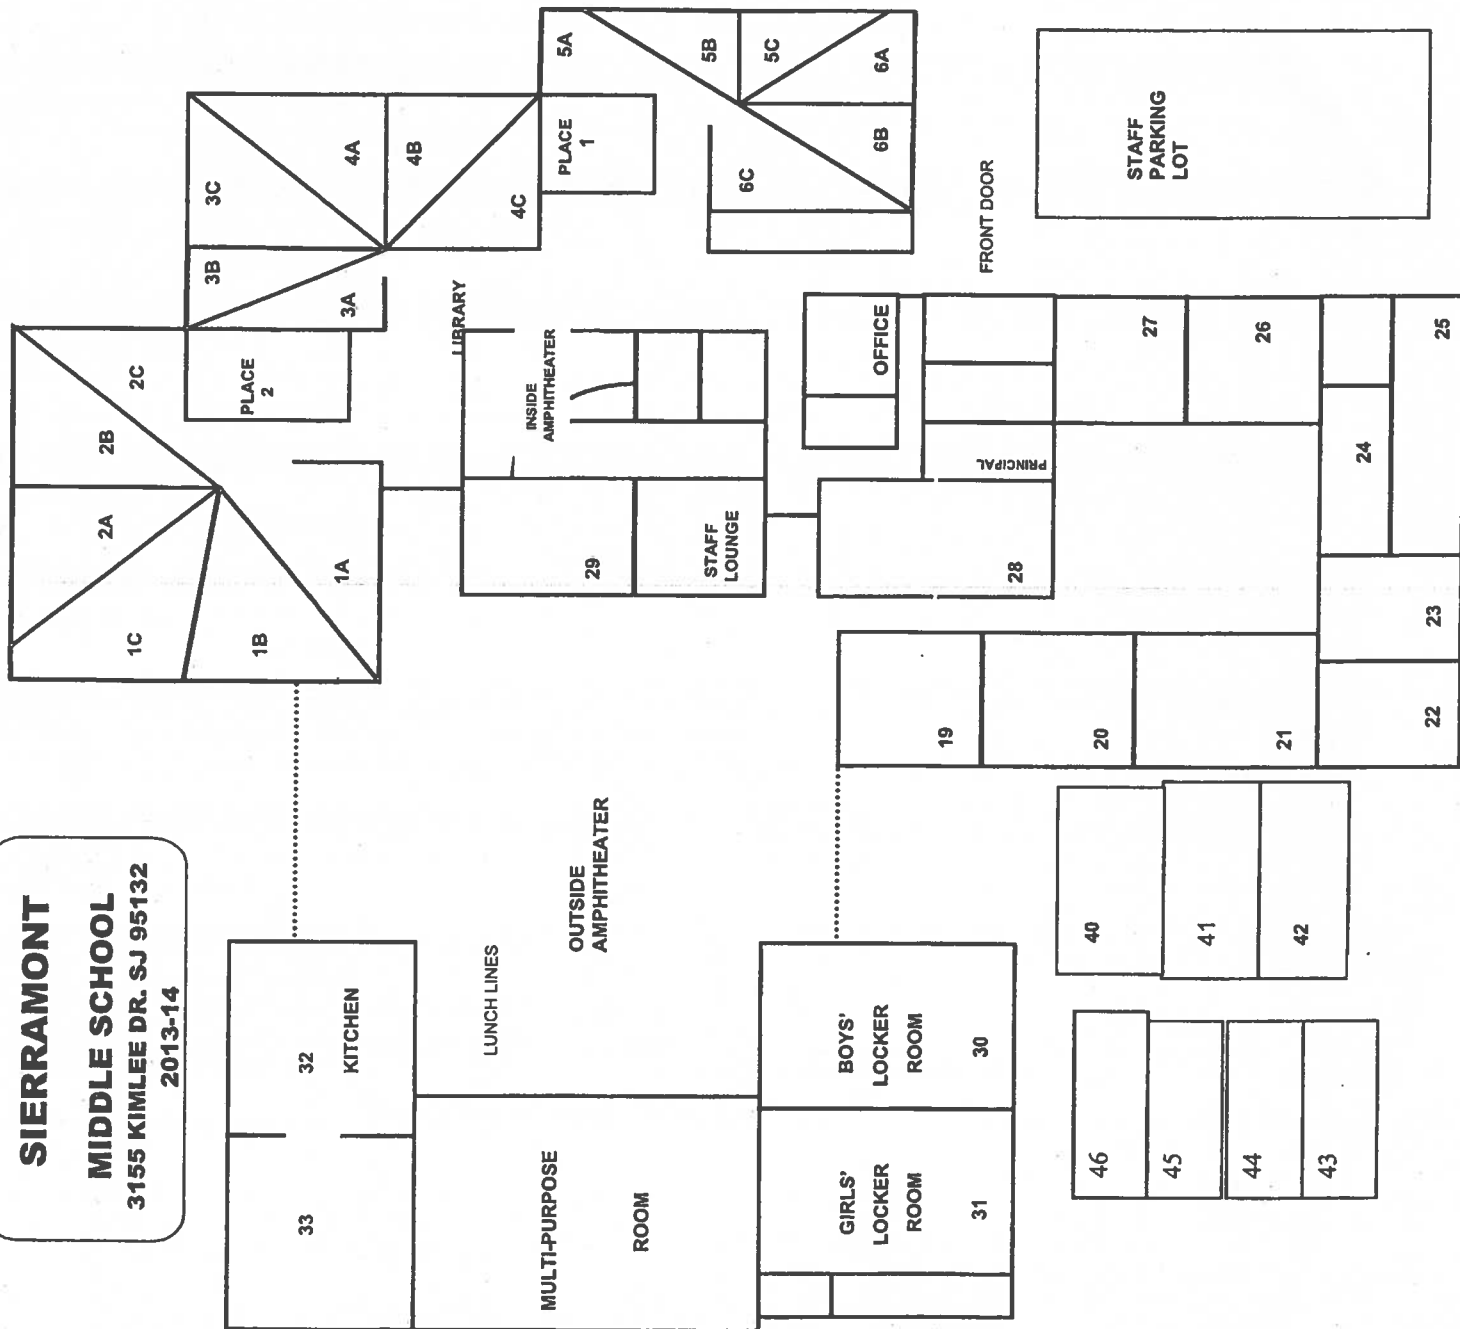


Room	Teacher
1A	Vu
1B	Gairaud
1C	Hoppe
2A	Christensen
2B	Ross
2C	Raisch
Place 2	Ridley
3A	Chun
3B	Shakir
3C	Gold
4A	Parodi
4B	Da Silva
4C	Chi
Place 1	Asano
5A	Liu
5B	Palla
5C	Ontiveros
6A	Perry
6B	Rai
6C	Johnson
19	Pfeiffer
20	Edens
21	Wiebe
22	Huesties
23	Singh
25	Mahal
26	Hurley
27	Lashbrook
28	Cremer
29	Arensberg
30	Boy PE
31	Girls PE
33	McVeigh
40	Figueroa
41	Sen
42	Pousho
43	Davis
44	Lam
45	Chan
46	Balsbaugh

SIERRAMONT

MIDDLE SCHOOL

3155 KIMLEE DR. SJ 95132

2013-14

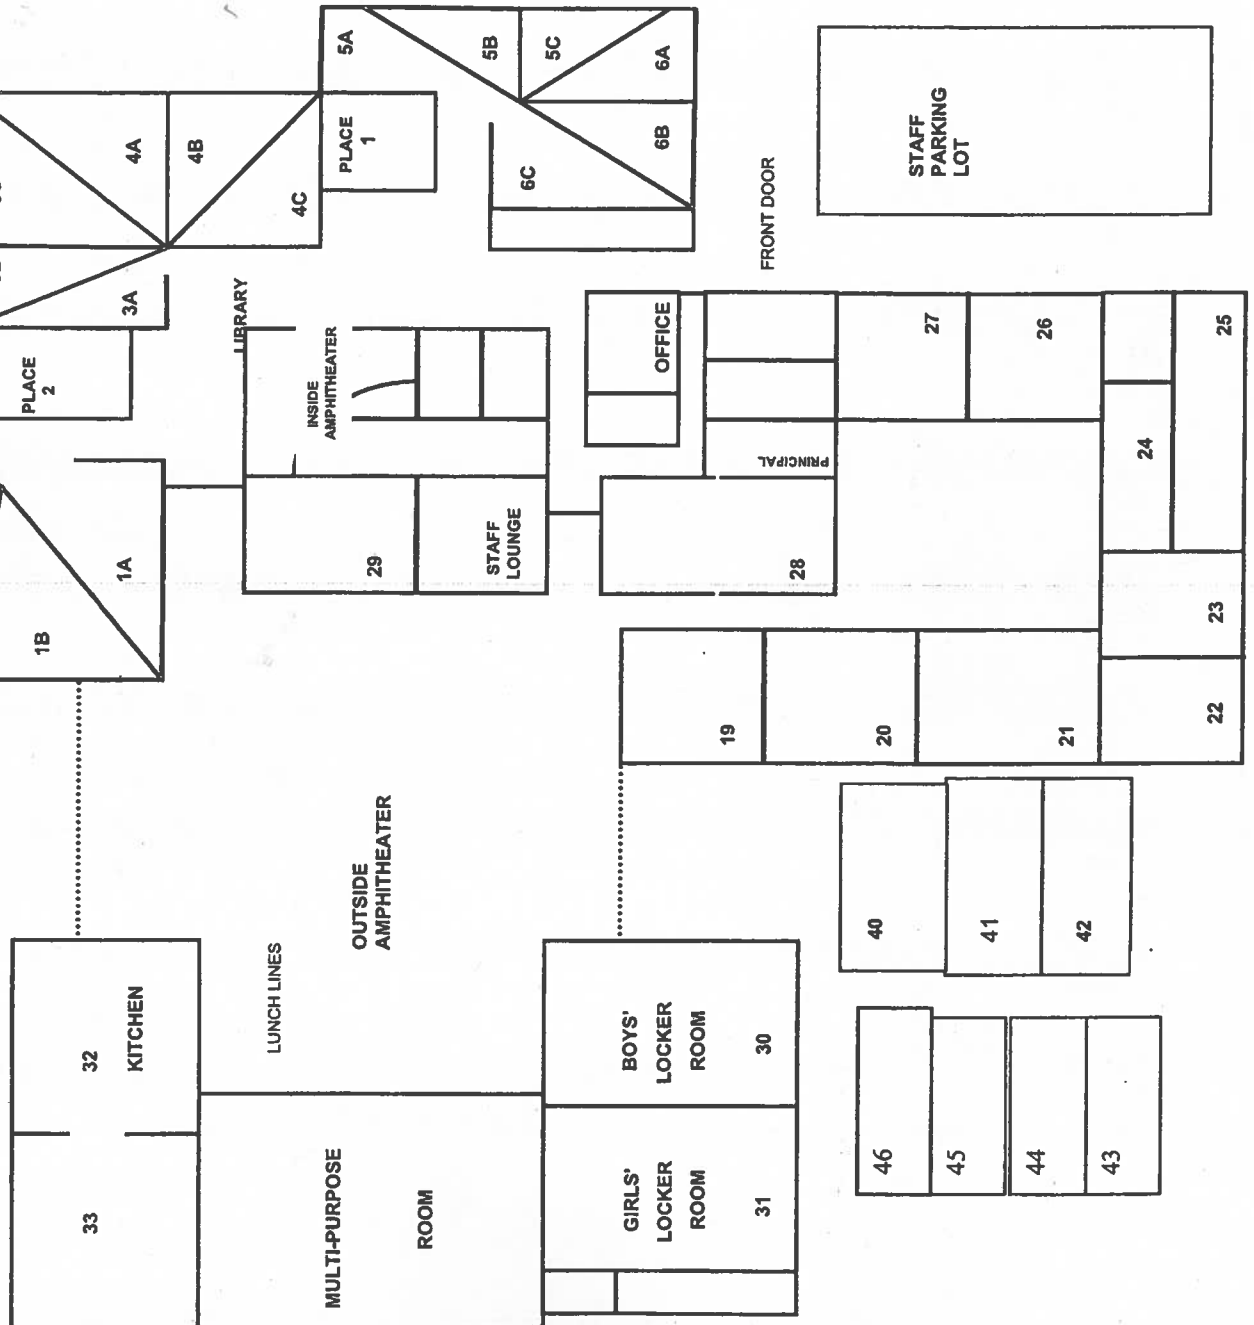

Room	Teacher
1A	Vu
1B	Gairaud
1C	Hoppe
2A	Christensen
2B	Ross
2C	Raisch
Place 2	Ridley
3A	Chun
3B	Shakir
3C	Gold
4A	Parodi
4B	Da Silva
4C	Chi
Place 1	Asano
5A	Liu
5B	Palla
5C	Ontiveros
6A	Perry
6B	Rai
6C	Johnson
19	Pfeiffer
20	Edens
21	Wiebe
22	Huesties
23	Singh
25	Mahal
26	Hurley
27	Lashbrook
28	Cremer
29	Arensberg
30	Boy PE
31	Girls PE
33	McVeigh
40	Figueroa
41	Sen
42	Pousho
43	Davis
44	Lam
45	Chan
46	Balsbaugh


SIERRAMONT MIDDLE SCHOOL
INSPECTED ON: 08-17-2022

SIERRAMONT

MIDDLE SCHOOL

3155 KIMLEE DR. SJ 95132

2013-14

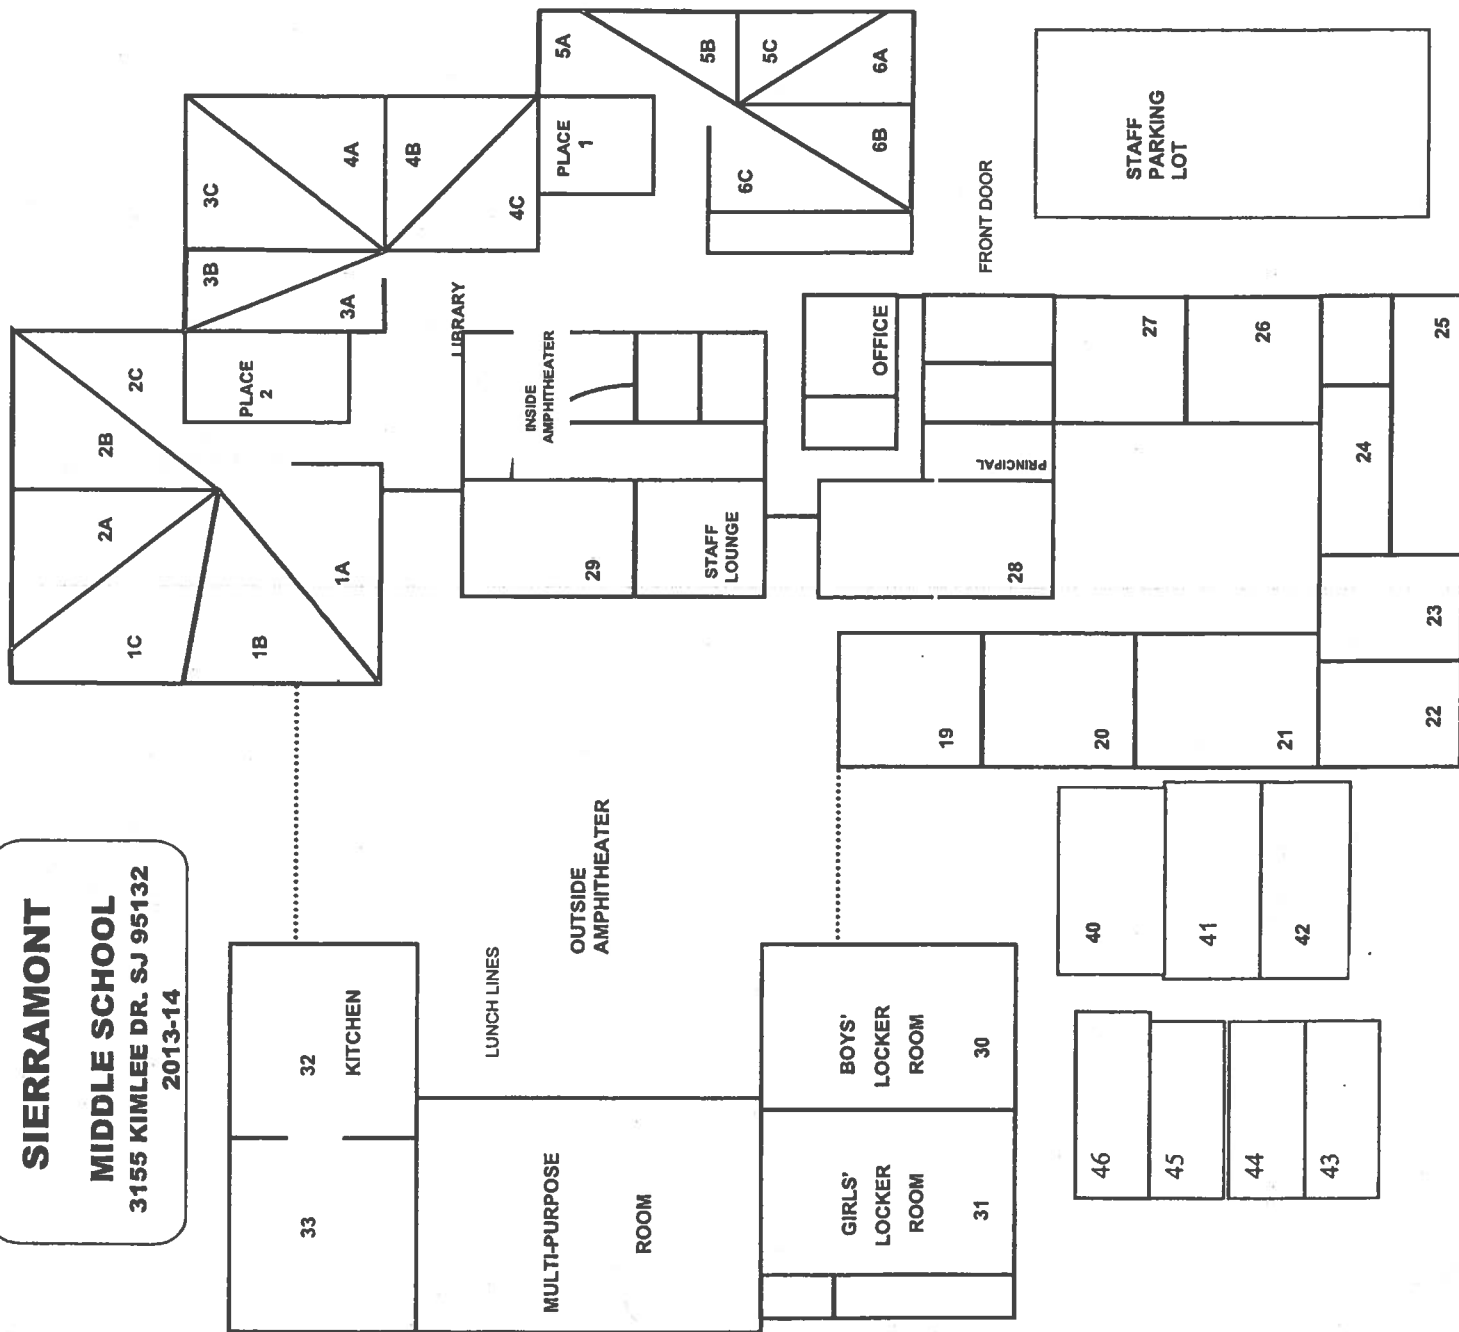

SIERRAMONT MIDDLE SCHOOL

INSPECTED ON: 02-18-2022


Room	Teacher
1A	Vu
1B	Gairaud
1C	Hoppe
2A	Christensen
2B	Ross
2C	Raisch
Place 2	Ridley
3A	Chun
3B	Shakir
3C	Gold
4A	Parodi
4B	Da Silva
4C	Chi
Place 1	Asano
5A	Liu
5B	Palla
5C	Ontiveros
6A	Perry
6B	Rai
6C	Johnson
19	Pfeiffer
20	Edens
21	Wiebe
22	Huesties
23	Singh
25	Mahal
26	Hurley
27	Lashbrook
28	Cremer
29	Arensberg
30	Boy PE
31	Girls PE
33	McVeigh
40	Figueroa
41	Sen
42	Pousho
43	Davis
44	Lam
45	Chan
46	Balsbaugh

SIERRAMONT

MIDDLE SCHOOL

3155 KIMLEE DR. SJ 95132

2013-14

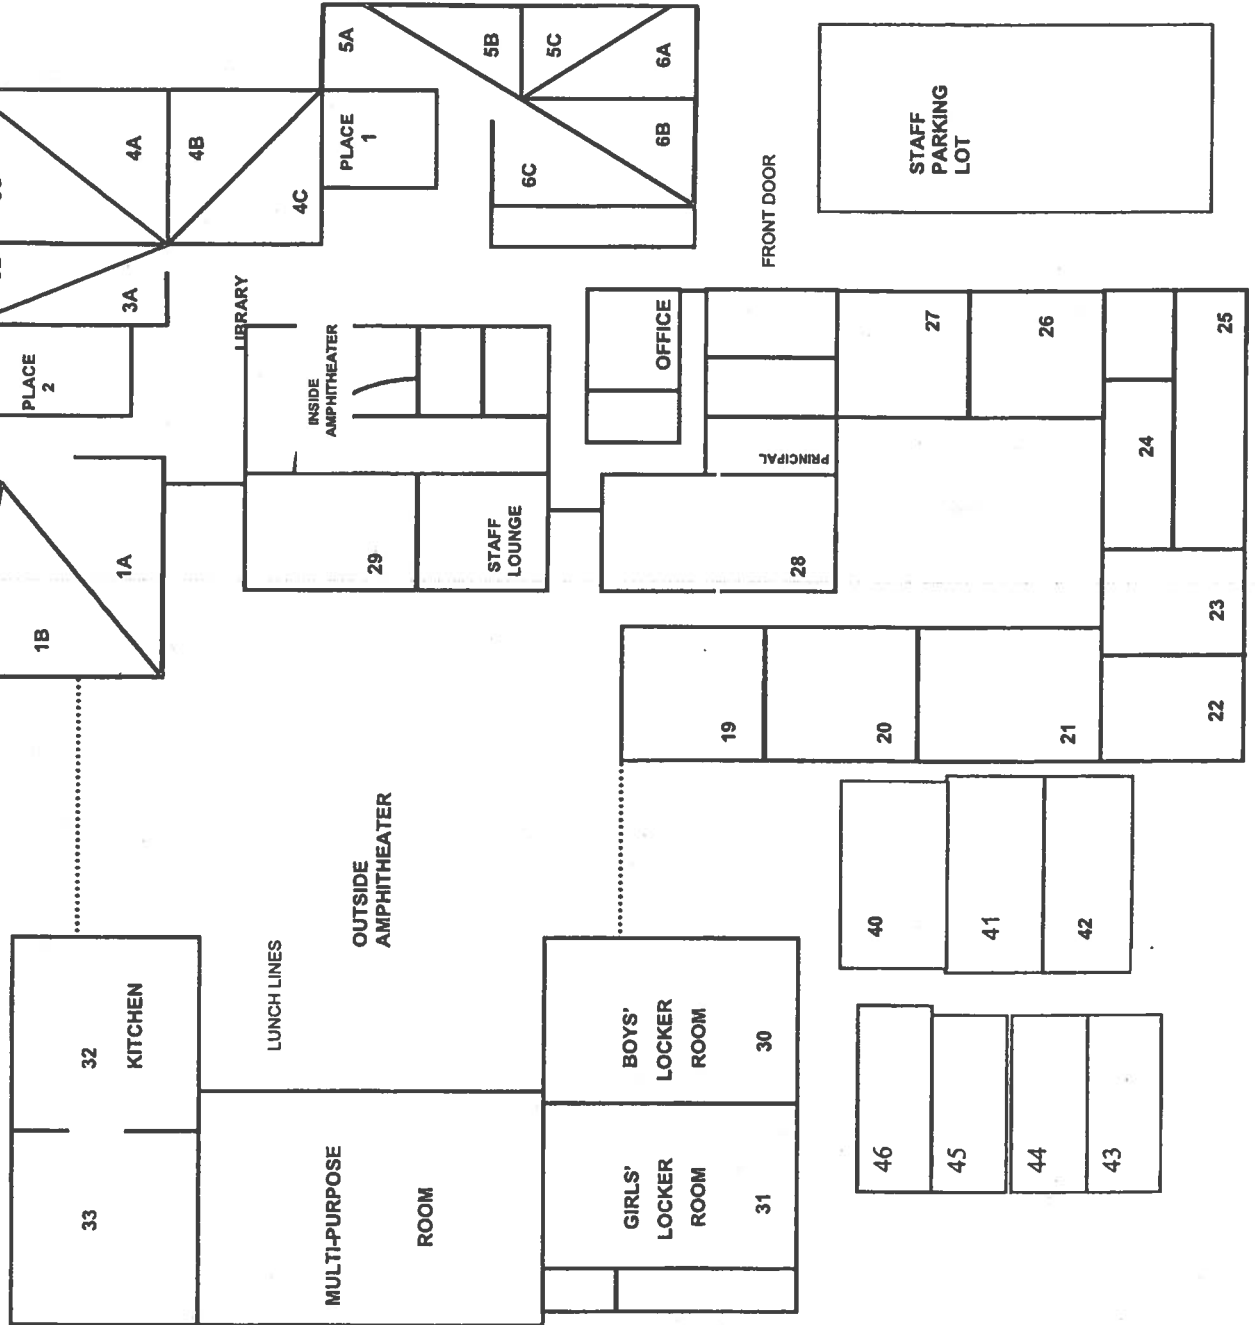

Room	Teacher
1A	Vu
1B	Gairaud
1C	Hoppe
2A	Christensen
2B	Ross
2C	Raisch
Place 2	Ridley
3A	Chun
3B	Shakir
3C	Gold
4A	Parodi
4B	Da Silva
4C	Chi
Place 1	Asano
5A	Liu
5B	Palla
5C	Ontiveros
6A	Perry
6B	Rai
6C	Johnson
19	Pfeiffer
20	Edens
21	Wiebe
22	Huesties
23	Singh
25	Mahal
26	Hurley
27	Lashbrook
28	Cremer
29	Arensberg
30	Boy PE
31	Girls PE
33	McVeigh
40	Figueroa
41	Sen
42	Pousho
43	Davis
44	Lam
45	Chan
46	Balsbaugh


SIERRAMONT MIDDLE SCHOOL
INSPECTED ON: 8/11/21

SIERRAMONT

MIDDLE SCHOOL

3155 KIMLEE DR. SJ 95132

2013-14

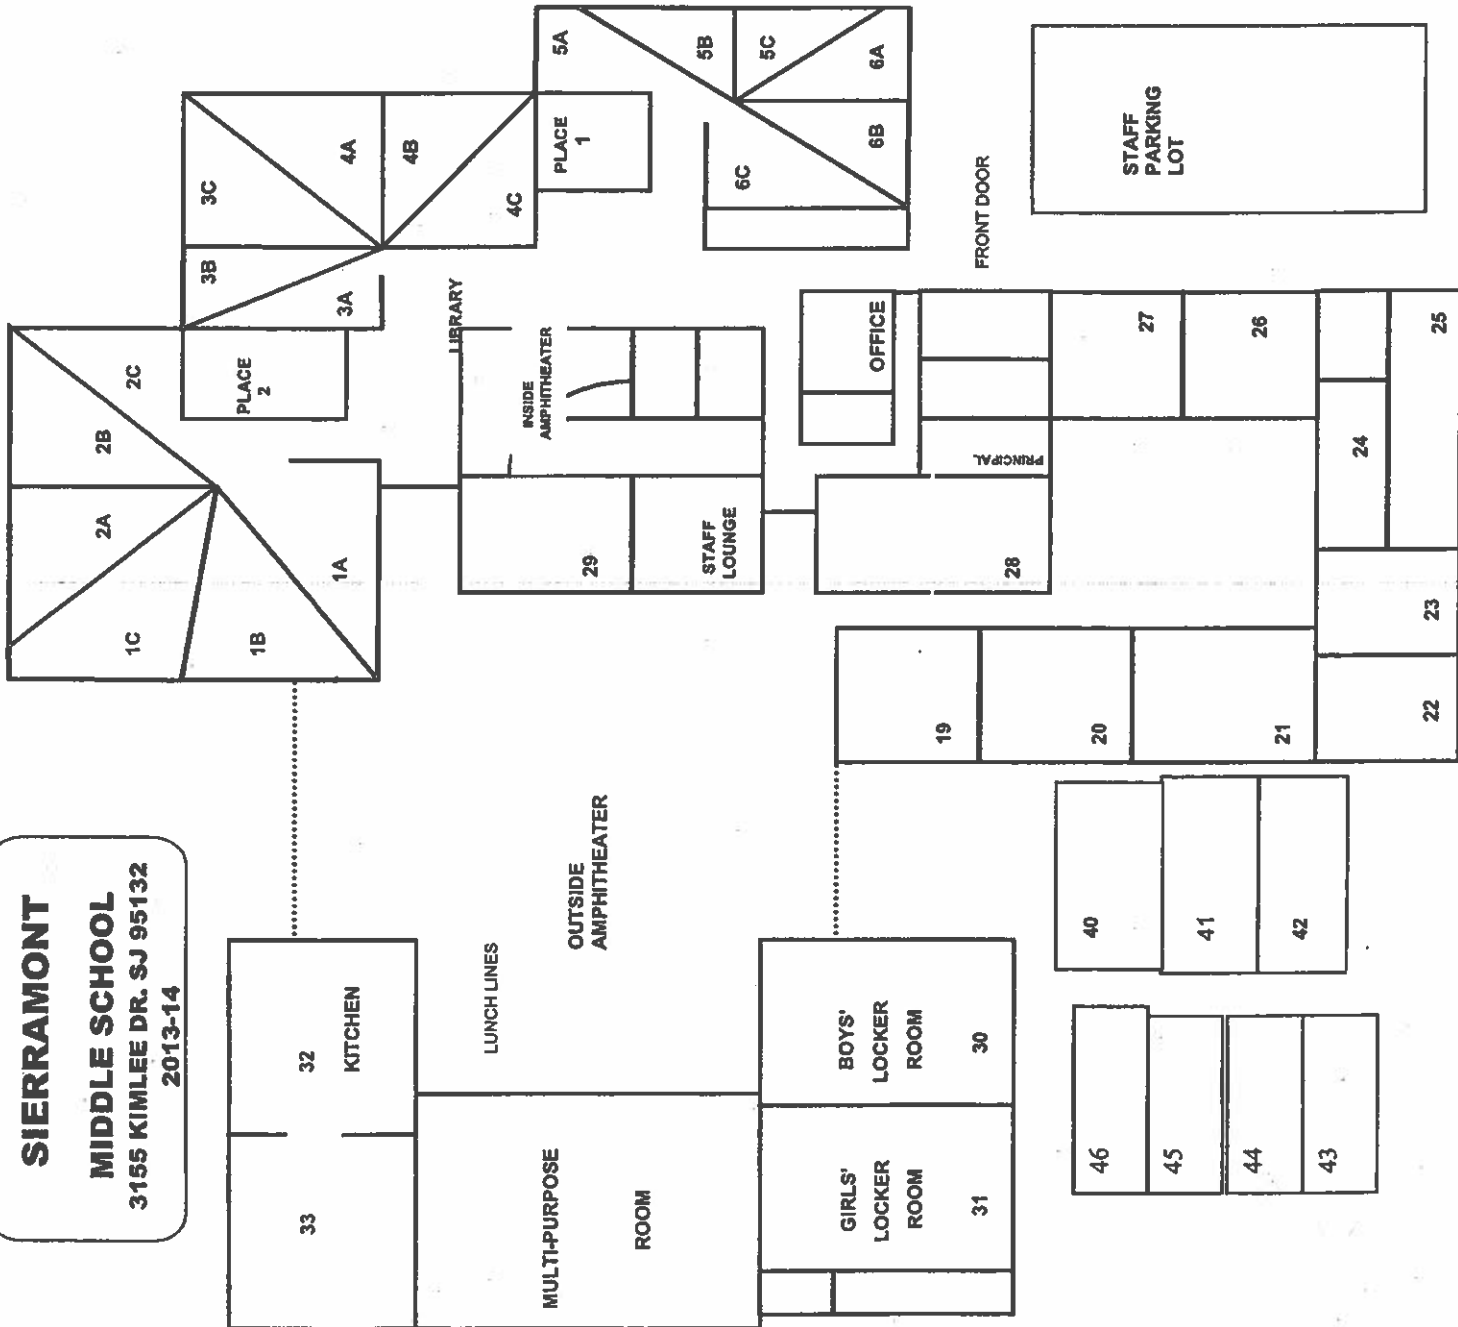


Room	Teacher
1A	Vu
1B	Gairaud
1C	Hoppe
2A	Christensen
2B	Ross
2C	Raisch
Place 2	Ridley
3A	Chun
3B	Shakir
3C	Gold
4A	Parodi
4B	Da Silva
4C	Chi
Place 1	Asano
5A	Liu
5B	Palla
5C	Ontiveros
6A	Perry
6B	Rai
6C	Johnson
19	Pfeiffer
20	Edens
21	Wiebe
22	Huesties
23	Singh
25	Mahal
26	Hurley
27	Lashbrook
28	Cremer
29	Arensberg
30	Boy PE
31	Girls PE
33	McVeigh
40	Figueroa
41	Sen
42	Pousho
43	Davis
44	Lam
45	Chan
46	Balsbaugh

SIERRAMONT MIDDLE SCHOOL

INSPECTED ON: 2/10/21

SIERRAMONT
MIDDLE SCHOOL
 3155 KIMLEE DR. SJ 95132
 2013-14

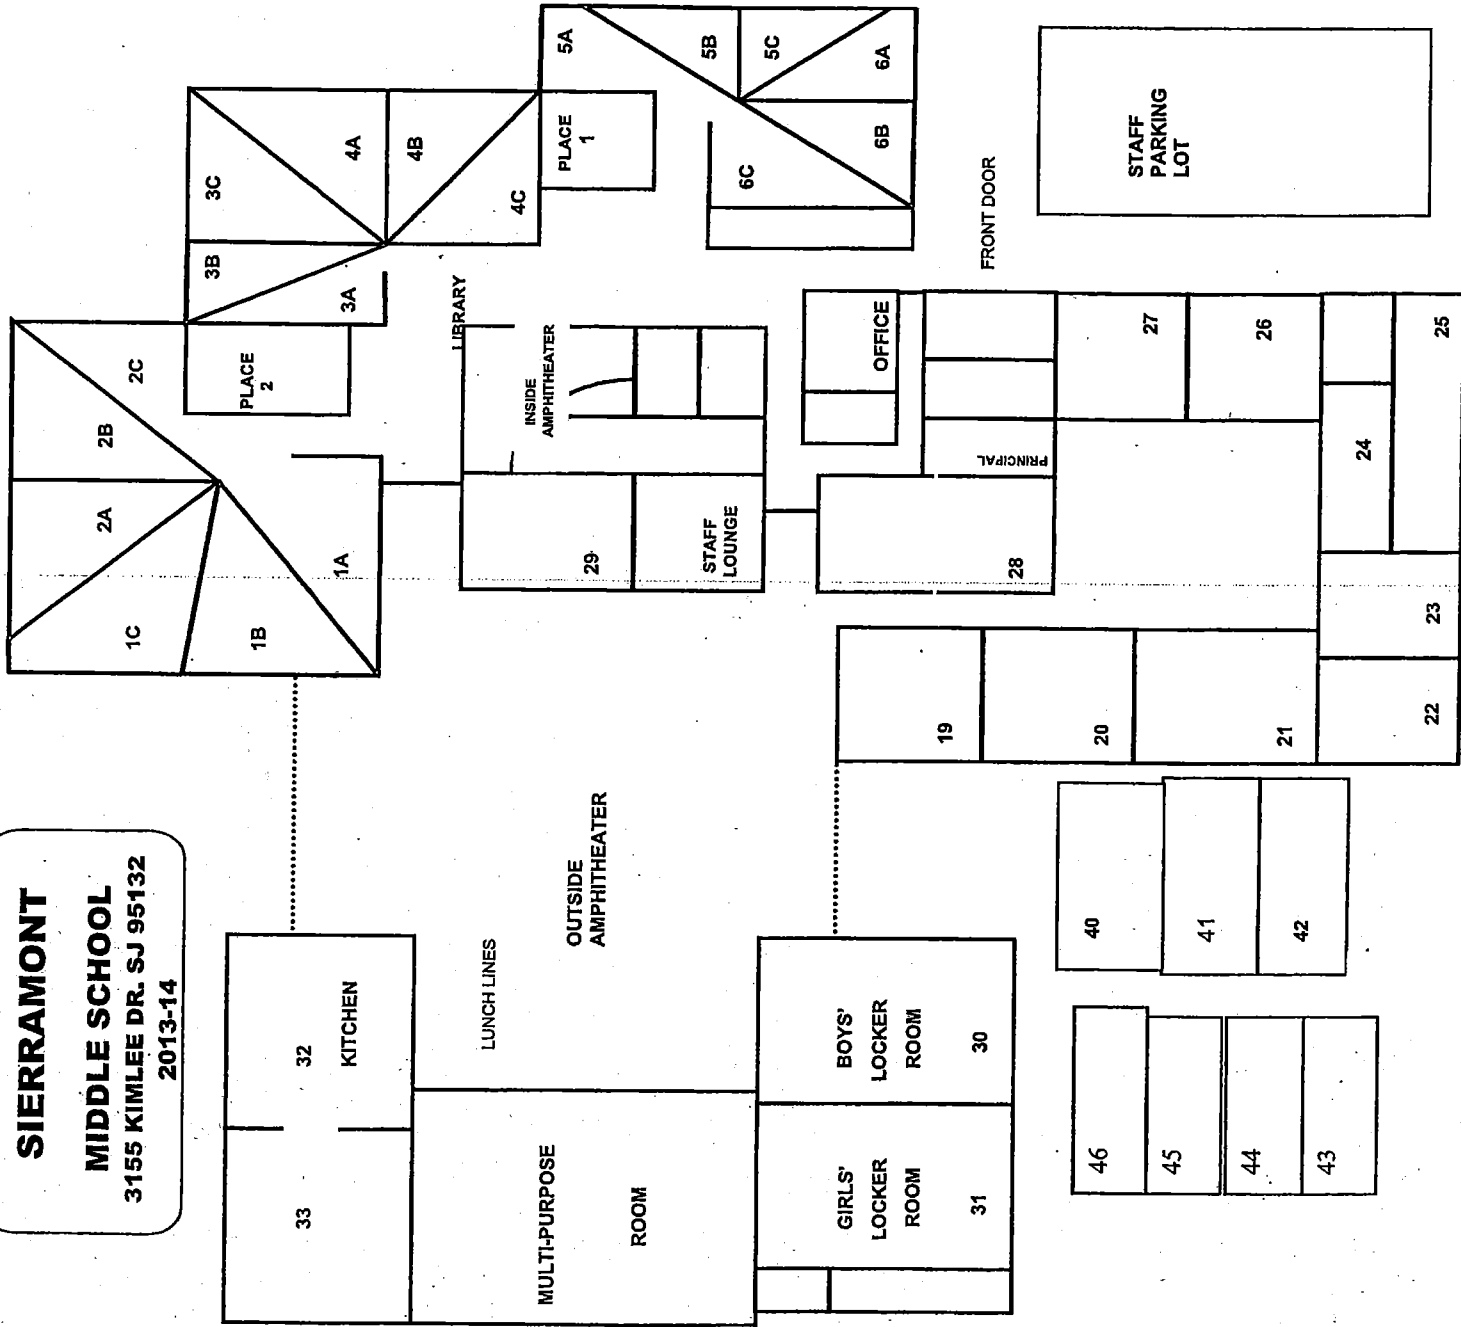

Room	Teacher
1A	Vu
1B	Gairaud
1C	Hoppe
2A	Christensen
2B	Ross
2C	Raisch
Place 2	Ridley
3A	Chun
3B	Shakir
3C	Gold
4A	Parodi
4B	Da Silva
4C	Chi
Place 1	Asano
5A	Liu
5B	Palla
5C	Ontiveros
6A	Perry
6B	Rai
6C	Johnson
19	Pfeiffer
20	Edens
21	Wiebe
22	Huesties
23	Singh
25	Mahal
26	Hurley
27	Lashbrook
28	Cremer
29	Arensberg
30	Boy PE
31	Girls PE
33	McVeigh
40	Figueroa
41	Sen
42	Pousho
43	Davis
44	Lam
45	Chan
46	Balsbaugh

SIERRAMONT MIDDLE SCHOOL
 INSPECTED ON: 8/28/20

SIERRAMONT

MIDDLE SCHOOL

3155 KIMLEE DR. SJ 95132


2013-14

SIERRAMONT MIDDLE SCHOOL

INSPECTED ON:

2.3.2020

Room	Teacher
1A	Vu
1B	Gairaud
1C	Hoppe
2A	Christensen
2B	Ross
2C	Raisch
Place 2	Ridley
3A	Chun
3B	Shakir
3C	Gold
4A	Parodi
4B	Da Silva
4C	Chi
Place 1	Asano
5A	Liu
5B	Palla
5C	Ontiveros
6A	Perry
6B	Rai
6C	Johnson
19	Pfeiffer
20	Edens
21	Wiebe
22	Huesties
23	Singh
25	Mahal
26	Hurley
27	Lashbrook
28	Cremer
29	Arensberg
30	Boy PE
31	Girls PE
33	McVeigh
40	Figueroa
41	Sen
42	Pousho
43	Davis
44	Lam
45	Chan
46	Balsbaugh

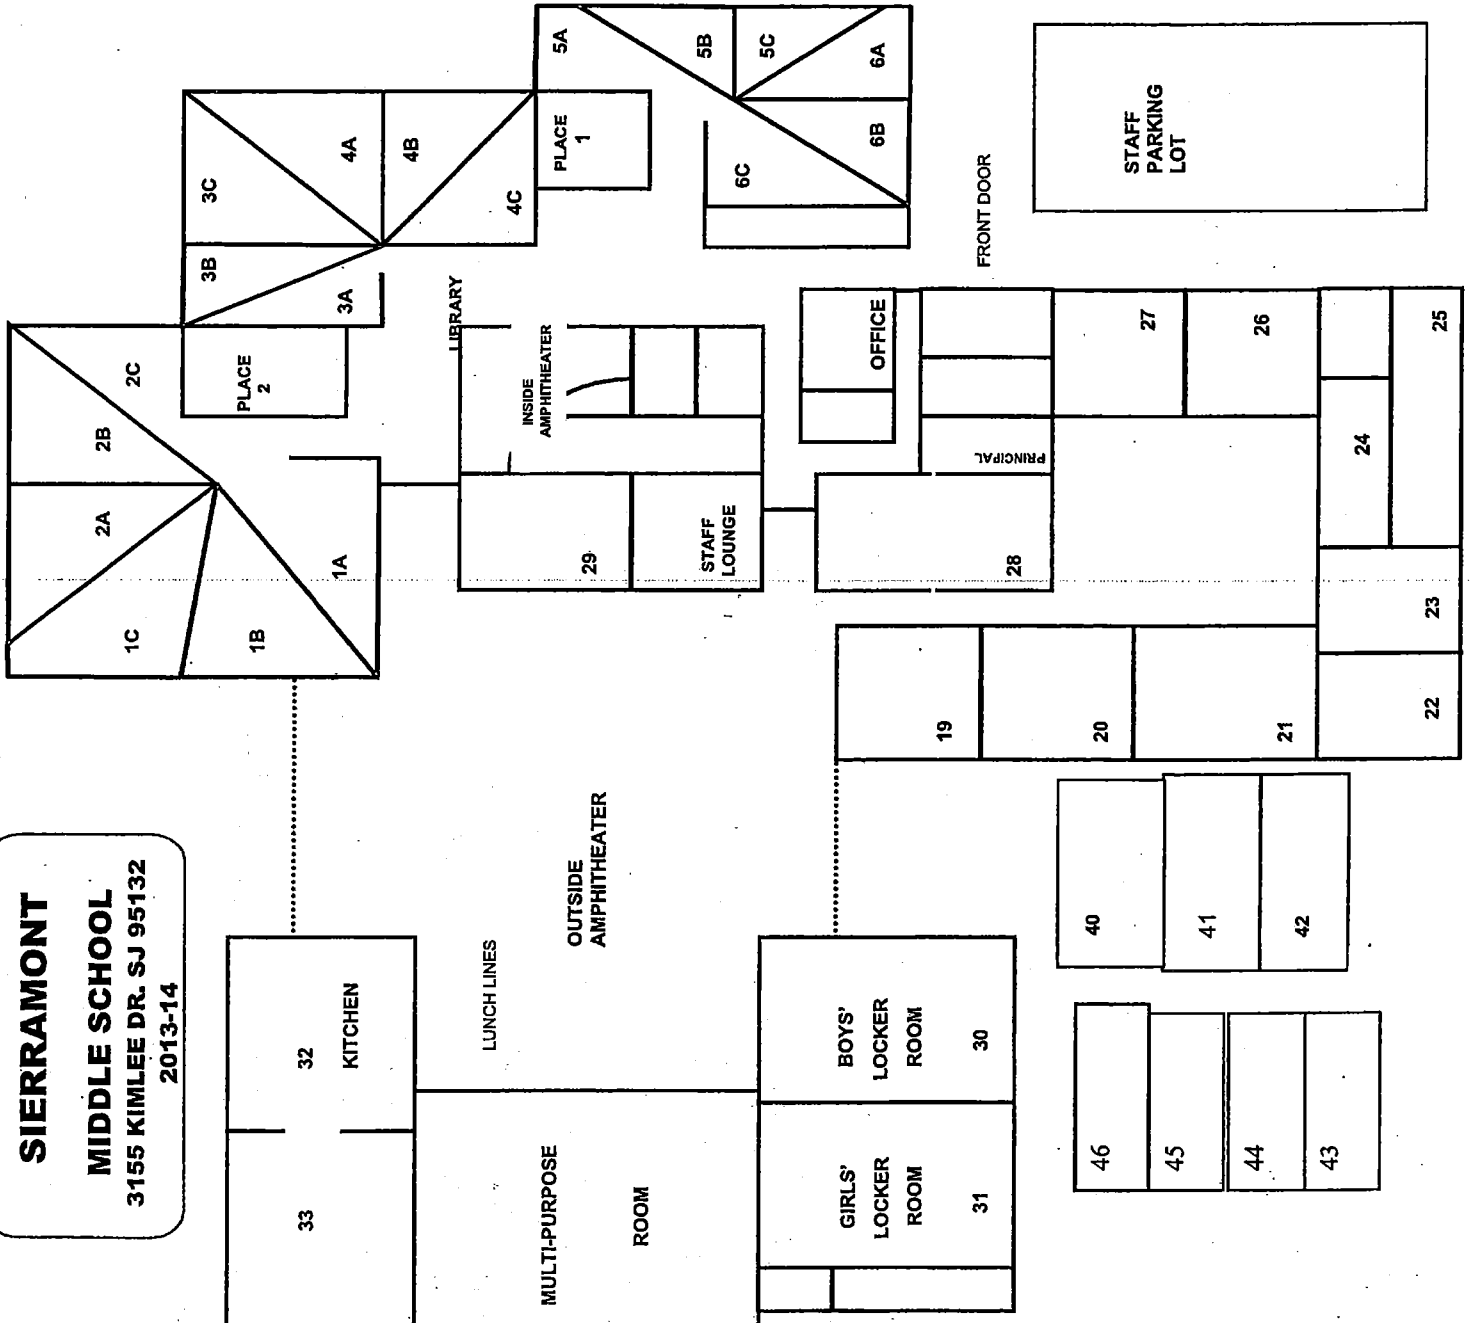


SIERRAMONT

MIDDLE SCHOOL

3155 KIMLEE DR. SJ 95132

2013-14

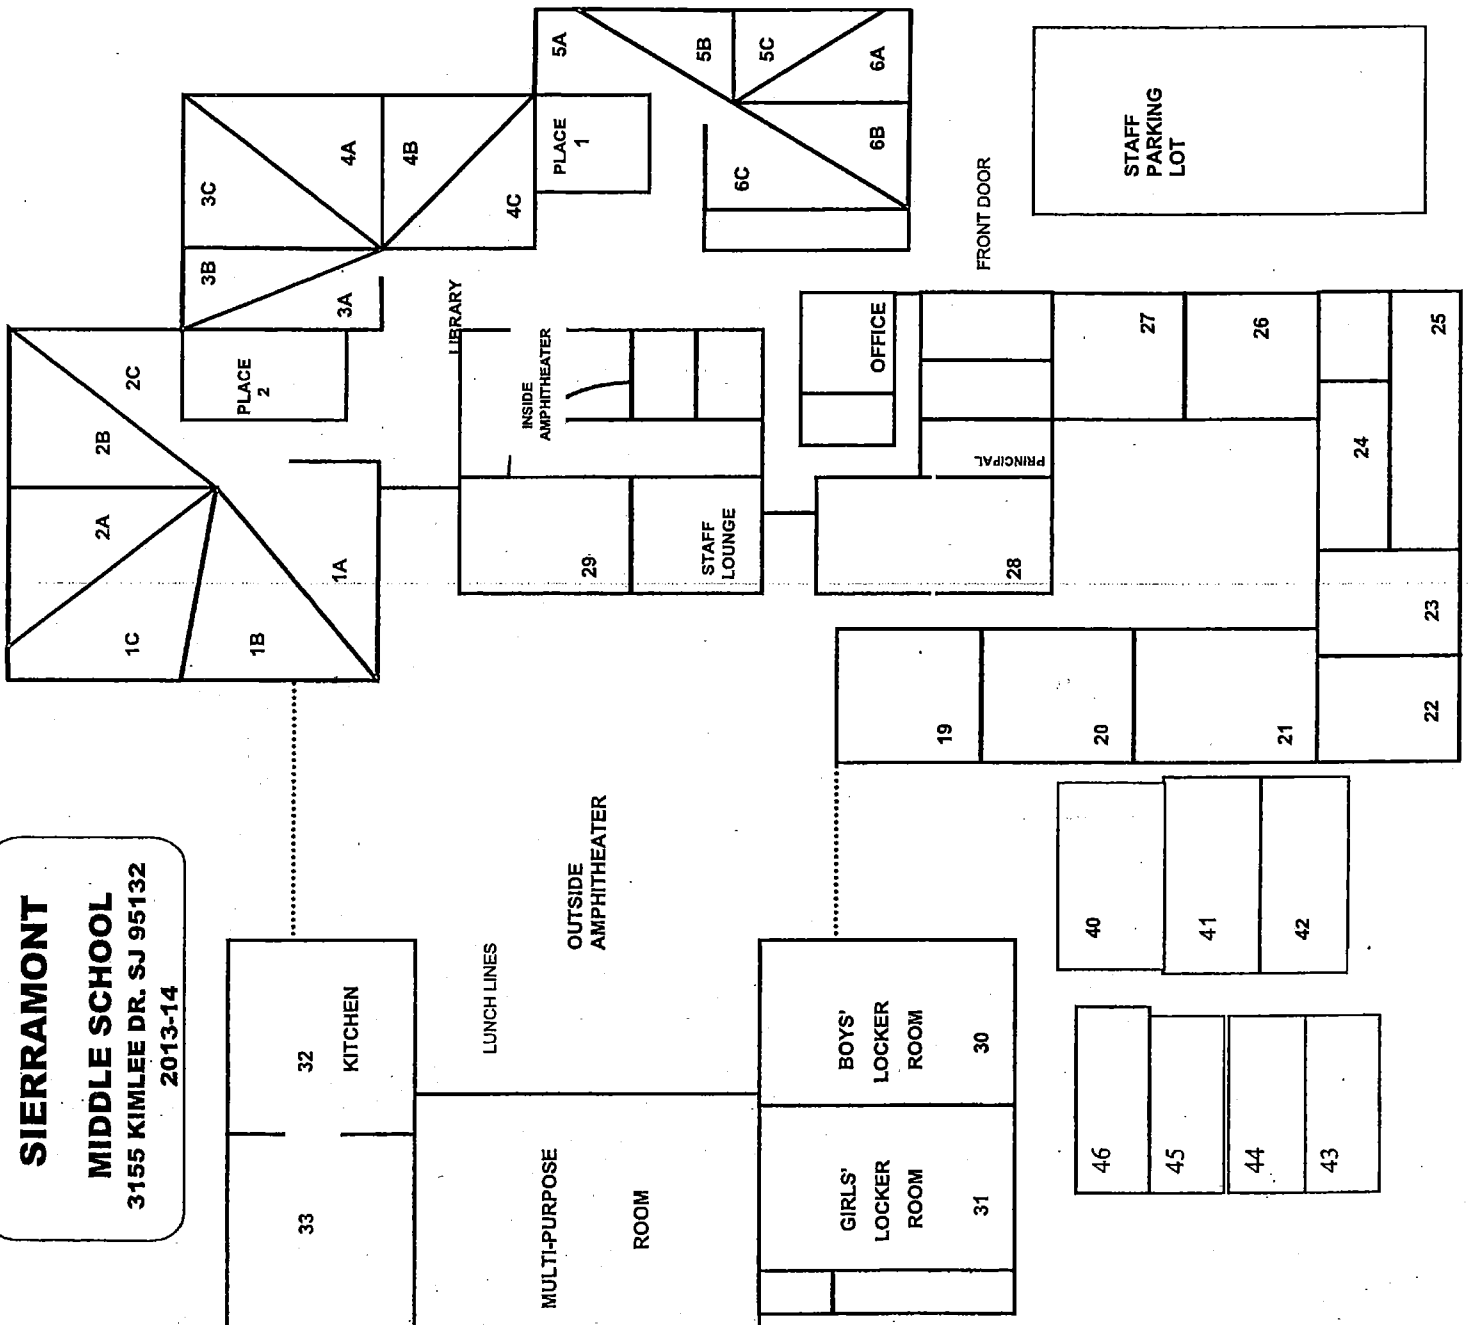

SIERRAMONT MIDDLE SCHOOL

INSPECTED ON: 8-14-19


Room	Teacher
1A	Vu
1B	Gairaud
1C	Hoppe
2A	Christensen
2B	Ross
2C	Raisch
Place 2	Ridley
3A	Chun
3B	Shakir
3C	Gold
4A	Parodi
4B	Da Silva
4C	Chi
Place 1	Asano
5A	Liu
5B	Palla
5C	Ontiveros
6A	Perry
6B	Rai
6C	Johnson
19	Pfeiffer
20	Edens
21	Wiebe
22	Huesties
23	Singh
25	Mahal
26	Hurley
27	Lashbrook
28	Cremer
29	Arensberg
30	Boy PE
31	Girls PE
33	McVeigh
40	Figueroa
41	Sen
42	Pousho
43	Davis
44	Lam
45	Chan
46	Balsbaugh

SIERRAMONT

MIDDLE SCHOOL

3155 KIMLEE DR. SJ 95132

2013-14

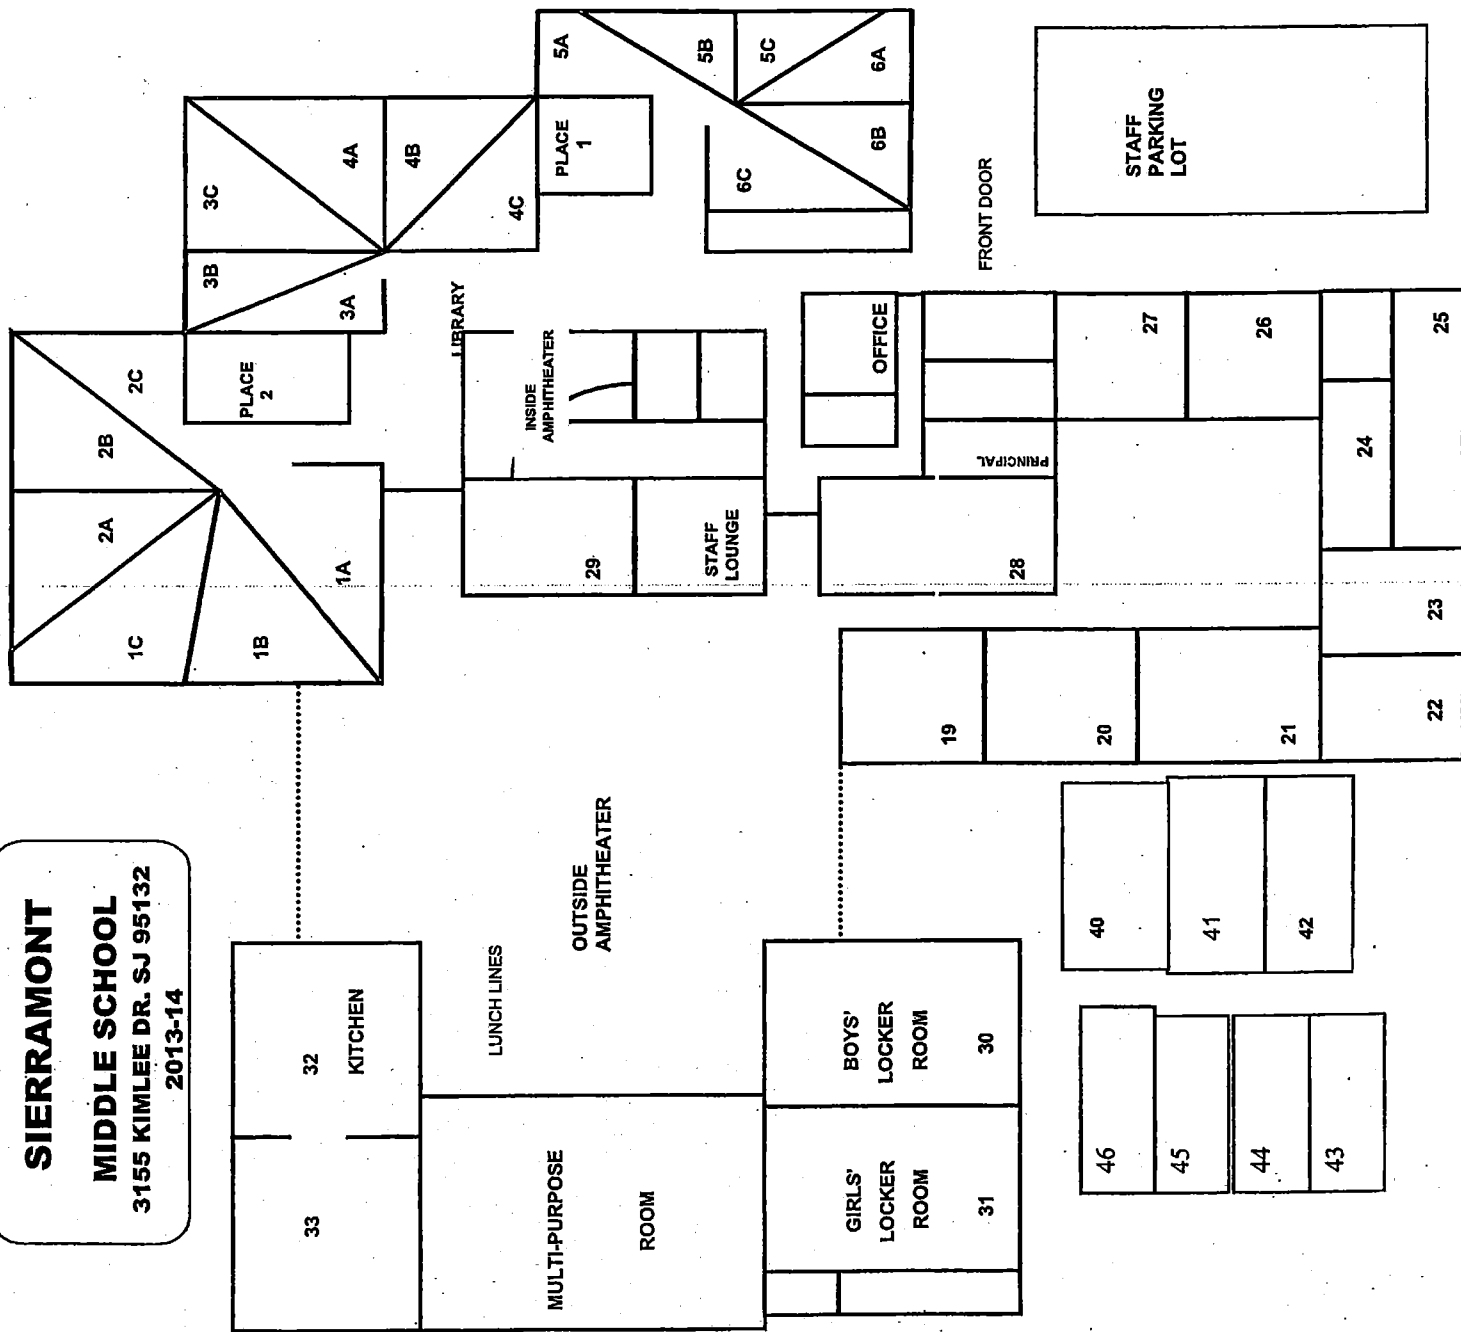

Room	Teacher
1A	Vu
1B	Gairaud
1C	Hoppe
2A	Christensen
2B	Ross
2C	Raisch
Place 2	Ridley
3A	Chun
3B	Shakir
3C	Gold
4A	Parodi
4B	Da Silva
4C	Chi
Place 1	Asano
5A	Liu
5B	Palla
5C	Ontiveros
6A	Perry
6B	Rai
6C	Johnson
19	Pfeiffer
20	Edens
21	Wiebe
22	Huesties
23	Singh
25	Mahal
26	Hurley
27	Lashbrook
28	Cremer
29	Arensberg
30	Boy PE
31	Girls PE
33	McVeigh
40	Figueroa
41	Sen
42	Pousho
43	Davis
44	Lam
45	Chan
46	Balsbaugh


SIERRAMONT MIDDLE SCHOOL
INSPECTED ON: 02-06-2019

SIERRAMONT

MIDDLE SCHOOL

3155 KIMLEE DR. SJ 95132

2013-14

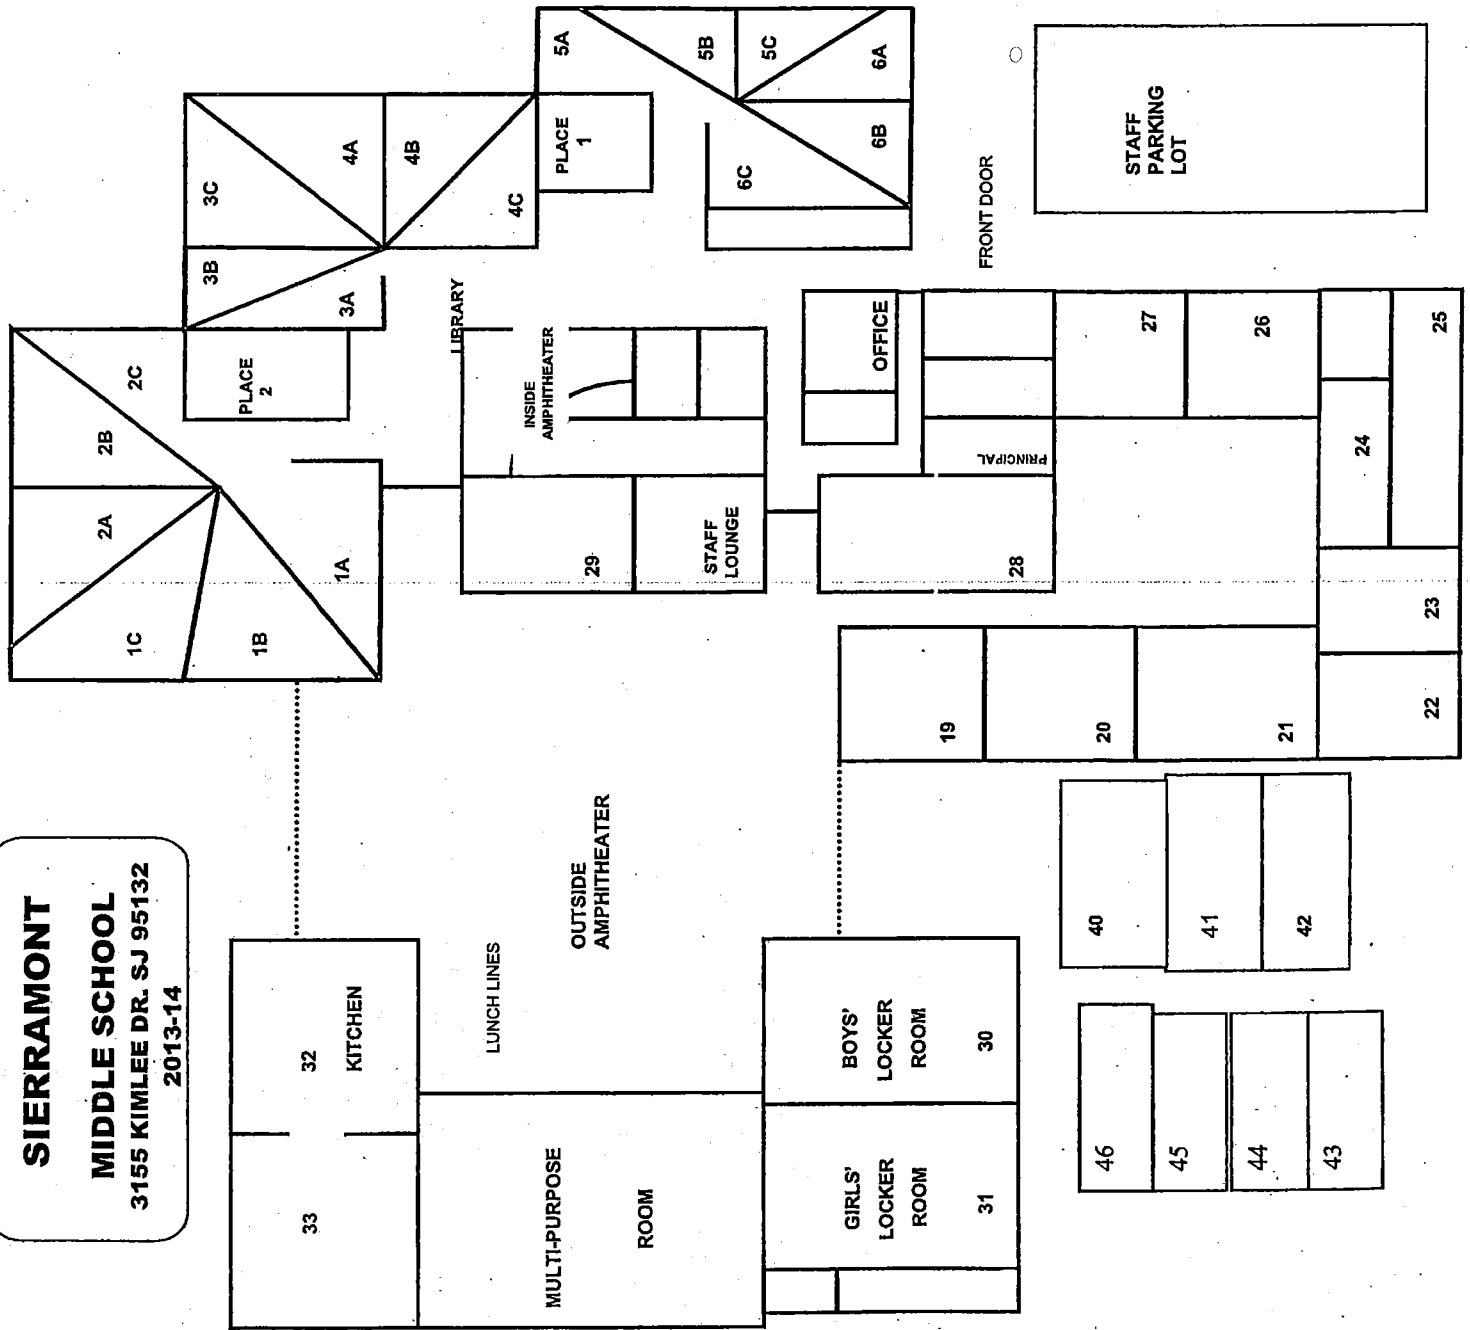


SIERRAMONT MIDDLE SCHOOL	
INSPECTED ON: 8/15/18	
Room	Teacher
1A	Vu
1B	Gairaud
1C	Hoppe
2A	Christensen
2B	Ross
2C	Raisch
Place 2	Ridley
3A	Chun
3B	Shakir
3C	Gold
4A	Parodi
4B	Da Silva
4C	Chi
Place 1	Asano
5A	Liu
5B	Palla
5C	Ontiveros
6A	Perry
6B	Rai
6C	Johnson
19	Pfeiffer
20	Edens
21	Wiebe
22	Huesties
23	Singh
25	Mahal
26	Hurley
27	Lashbrook
28	Cremer
29	Arensberg
30	Boy PE
31	Girls PE
33	McVeigh
40	Figueroa
41	Sen
42	Pousho
43	Davis
44	Lam
45	Chan
46	Balsbaugh

SIERRAMONT

MIDDLE SCHOOL

3155 KIMLEE DR. SJ 95132

2013-14

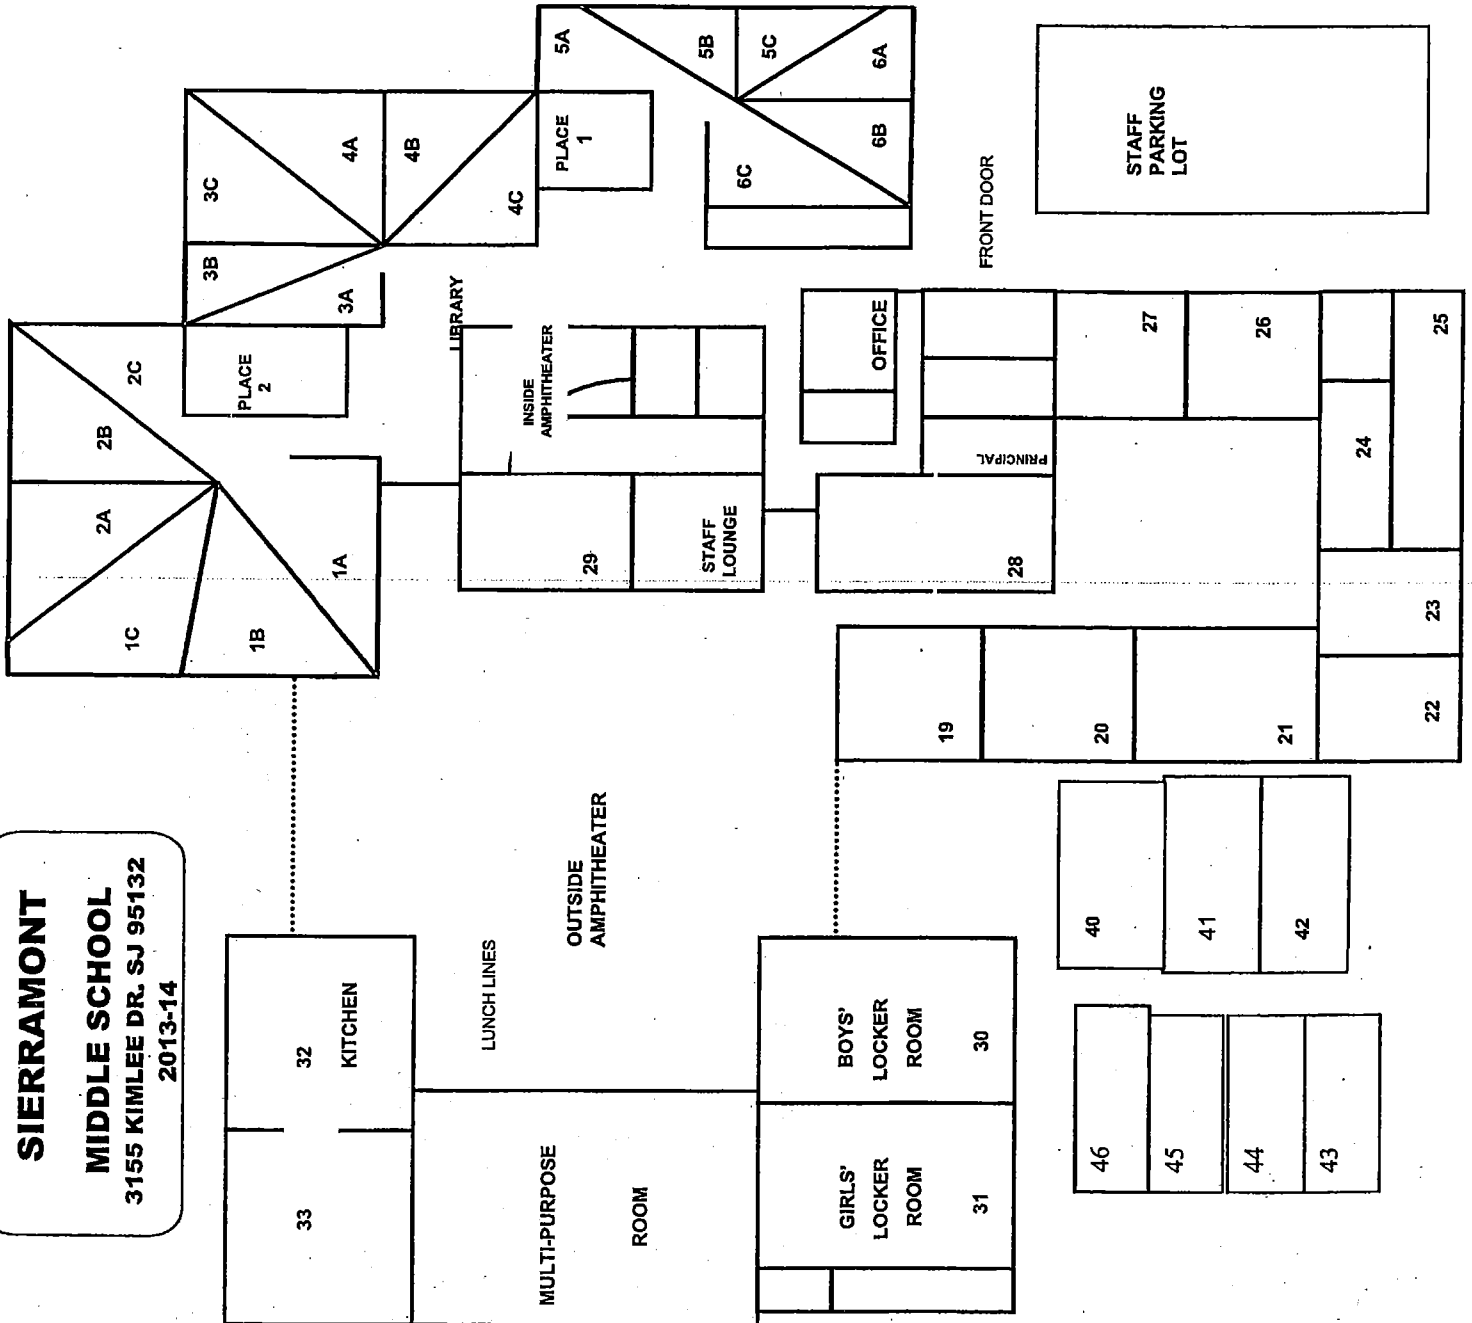

Room	Teacher
1A	Vu
1B	Gairaud
1C	Hoppe
2A	Christensen
2B	Ross
2C	Raisch
Place 2	Ridley
3A	Chun
3B	Shakir
3C	Gold
4A	Parodi
4B	Da Silva
4C	Chi
Place 1	Asano
5A	Liu
5B	Palla
5C	Ontiveros
6A	Perry
6B	Rai
6C	Johnson
19	Pfeiffer
20	Edens
21	Wiebe
22	Huesties
23	Singh
25	Mahal
26	Hurley
27	Lashbrook
28	Cremer
29	Arensberg
30	Boy PE
31	Girls PE
33	McVeigh
40	Figueroa
41	Sen
42	Pousho
43	Davis
44	Lam
45	Chan
46	Balsbaugh

SIERRAMONT MIDDLE SCHOOL


INSPECTED ON: 2/4/14

SIERRAMONT

MIDDLE SCHOOL

3155 KIMLEE DR. SJ 95132

2013-14

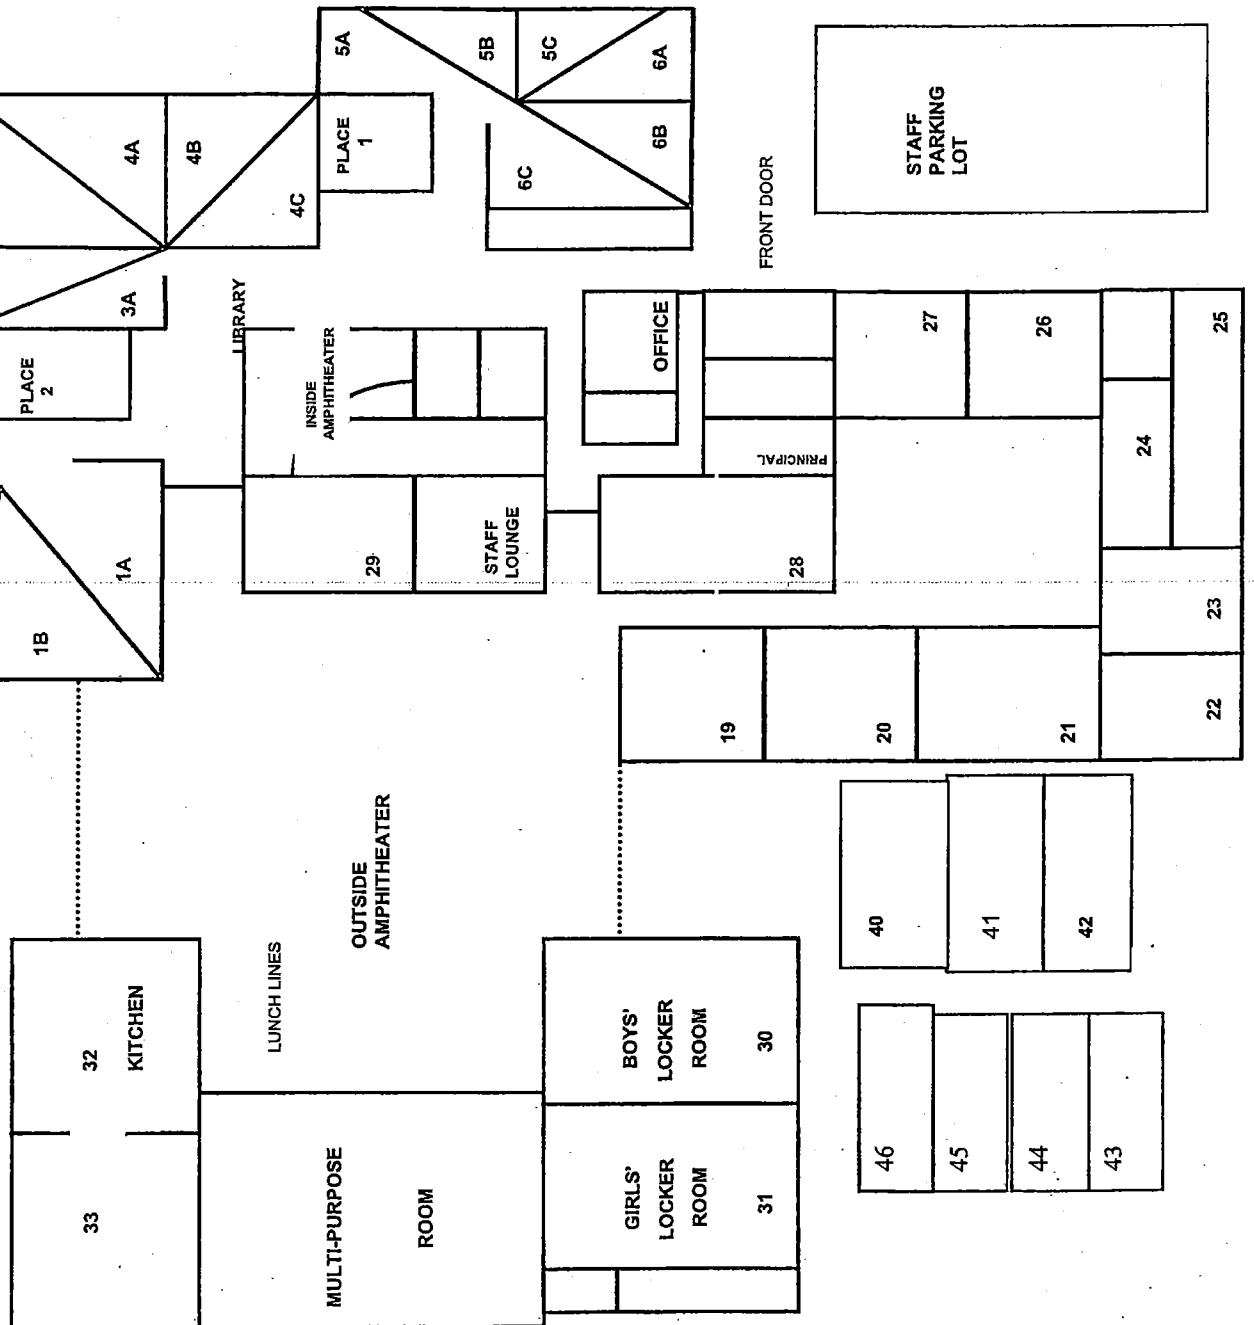

Room	Teacher
1A	Vu
1B	Gairaud
1C	Hoppe
2A	Christensen
2B	Ross
2C	Raisch
Place 2	Ridley
3A	Chun
3B	Shakir
3C	Gold
4A	Parodi
4B	Da Silva
4C	Chi
Place 1	Asano
5A	Liu
5B	Palla
5C	Ontiveros
6A	Perry
6B	Rai
6C	Johnson
19	Pfeiffer
20	Edens
21	Wiebe
22	Huesties
23	Singh
25	Mahal
26	Hurley
27	Lashbrook
28	Cramer
29	Arensberg
30	Boy PE
31	Girls PE
33	McVeigh
40	Figueroa
41	Sen
42	Pousho
43	Davis
44	Lam
45	Chan
46	Balsbaugh

SIERRAMONT MIDDLE SCHOOL
INSPECTED ON: 9/1/17


SIERRAMONT

MIDDLE SCHOOL

3155 KIMLEE DR. SJ 95132

2013-14

22

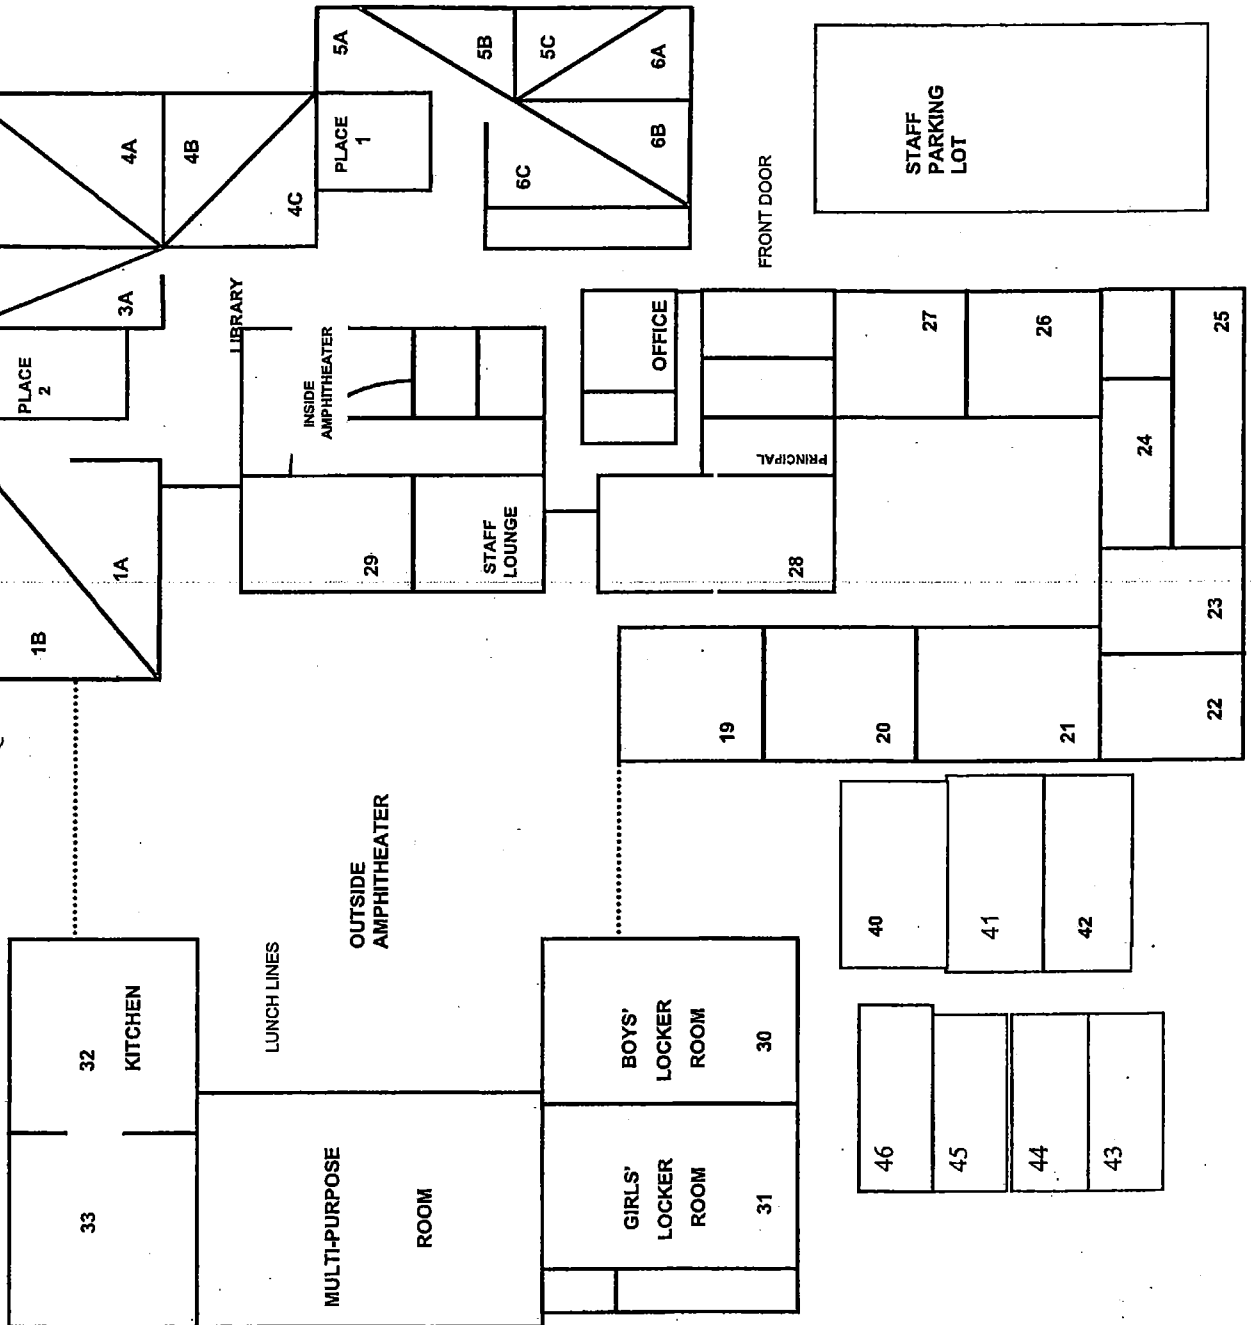

Room	Teacher
1A	Vu
1B	Gairaud
1C	Hoppe
2A	Christensen
2B	Ross
2C	Raisch
Place 2	Ridley
3A	Chun
3B	Shakir
3C	Gold
4A	Parodi
4B	Da Silva
4C	Chi
Place 1	Asano
5A	Liu
5B	Palla
5C	Ontiveros
6A	Perry
6B	Rai
6C	Johnson
19	Pfeiffer
20	Edens
21	Wiebe
22	Huesties
23	Singh
25	Mahal
26	Hurley
27	Lashbrook
28	Cremmer
29	Arensberg
30	Boy PE
31	Girls PE
33	McVeigh
40	Figueroa
41	Sen
42	Pousho
43	Davis
44	Lam
45	Chan
46	Balsbaugh


SIERRAMONT MIDDLE SCHOOL
INSPECTED ON: 3/30/17

SIERRAMONT

MIDDLE SCHOOL

3155 KIMLEE DR. SJ 95132

2013-14

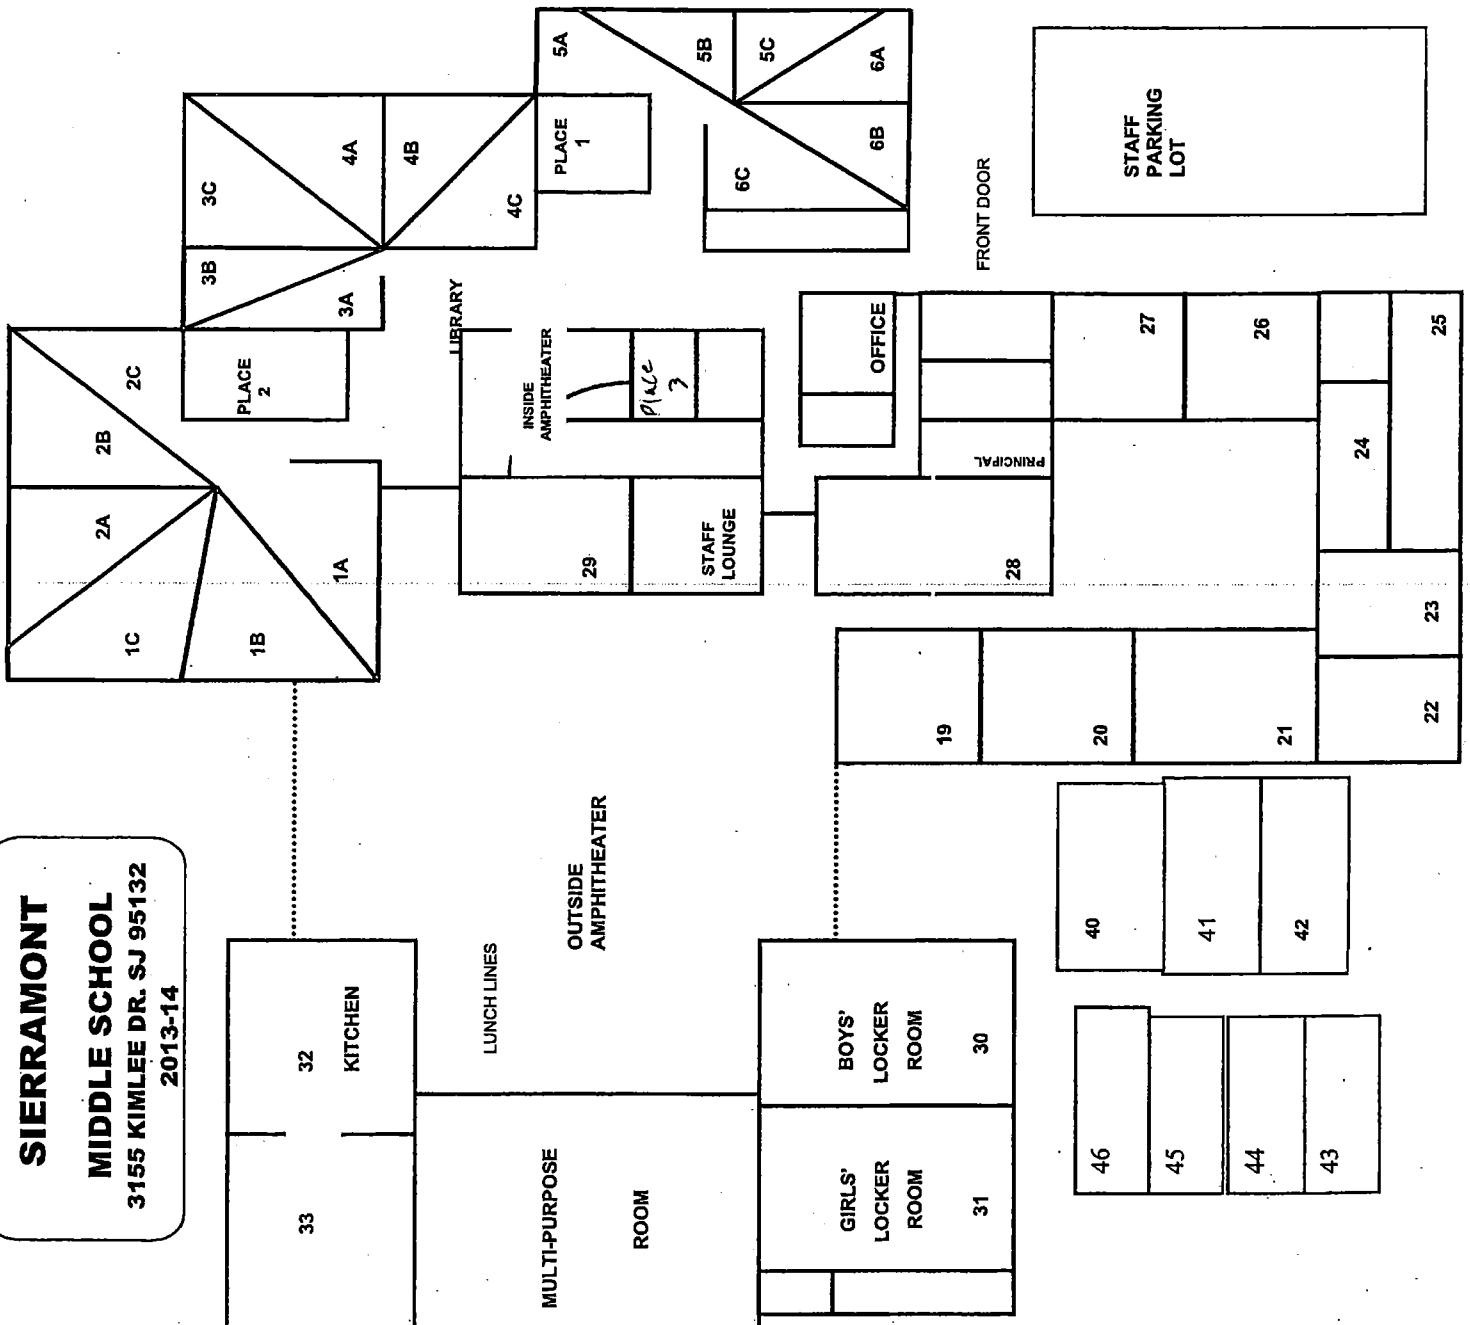


SIERRAMONT

MIDDLE SCHOOL

3155 KIMLEE DR. SJ 95132

2013-14

SIERRAMONT MIDDLE SCHOOL
INSPECTED ON: 03-22-2016

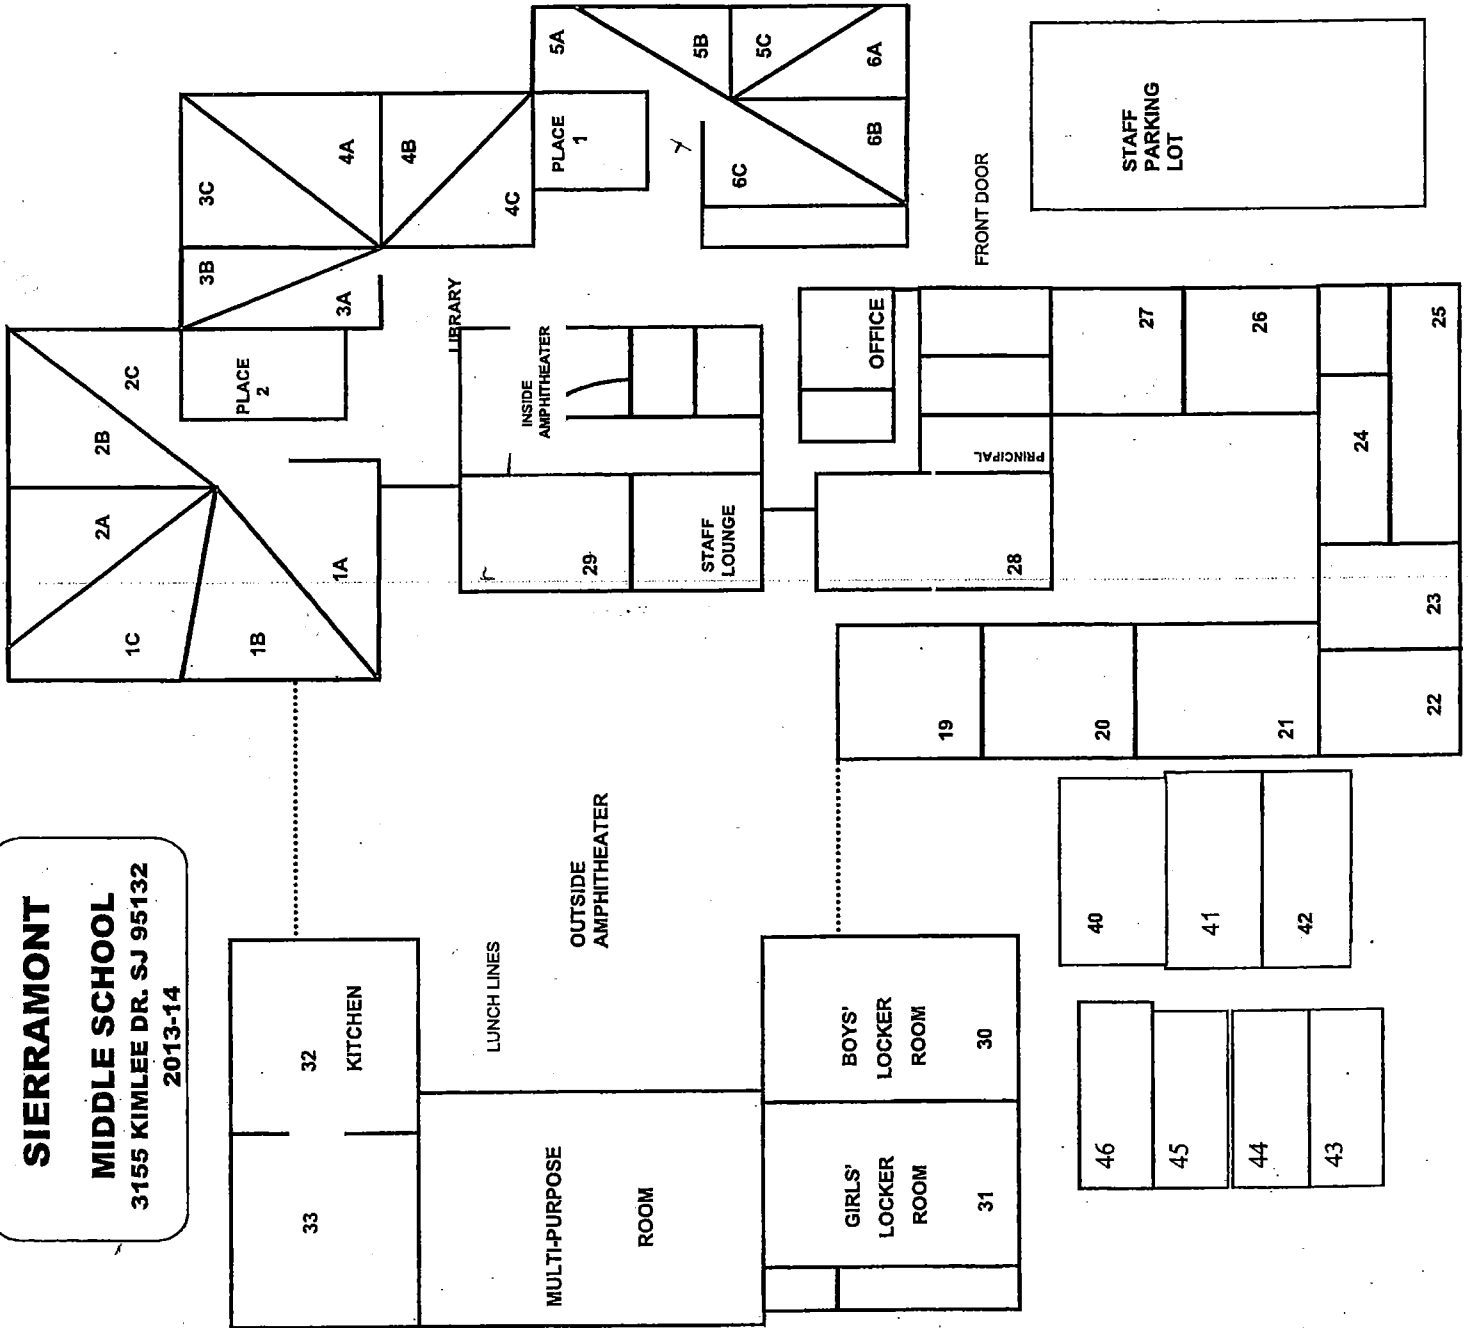


SIERRAMONT


MIDDLE SCHOOL

3155 KIMLEE DR. SJ 95132


2013-14

SIERRAMONT MIDDLE SCHOOL
INSPECTED ON: 9/18/15

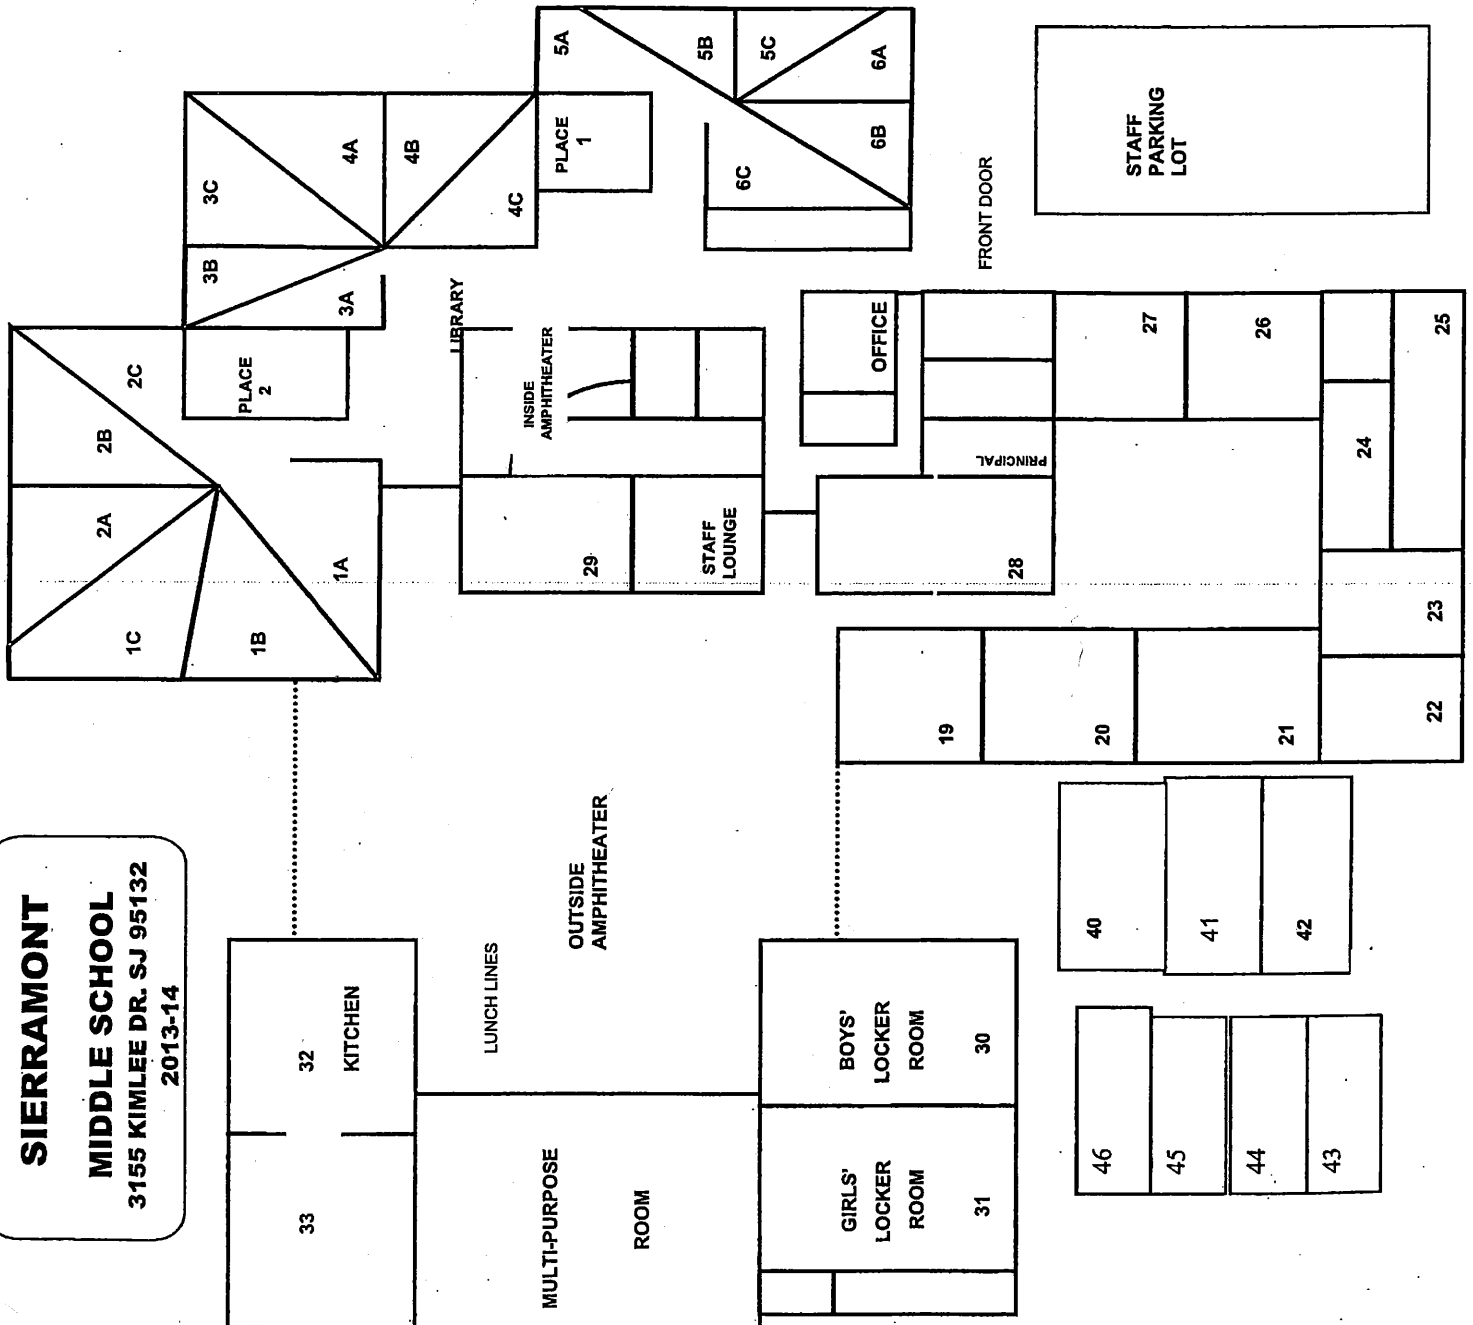

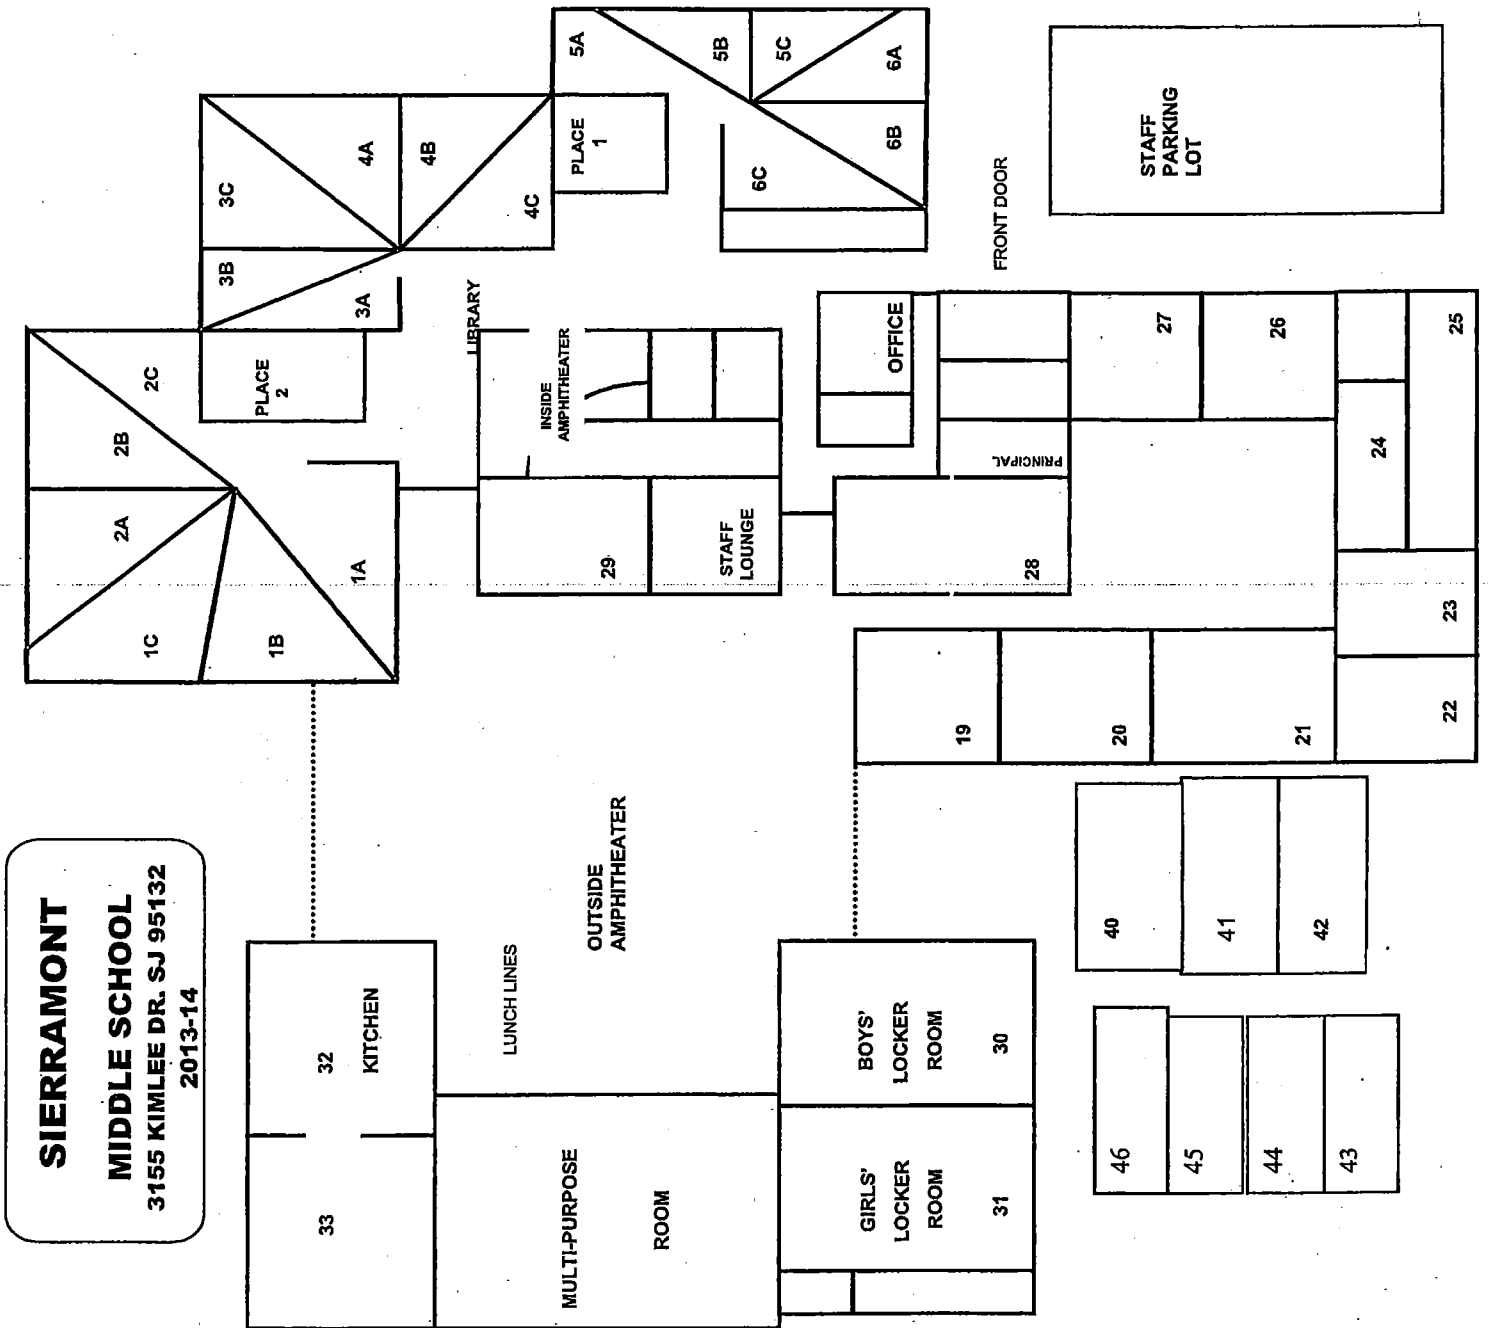

SIERRAMONT
MIDDLE SCHOOL
3155 KIMLEE DR. SJ 95132
2013-14

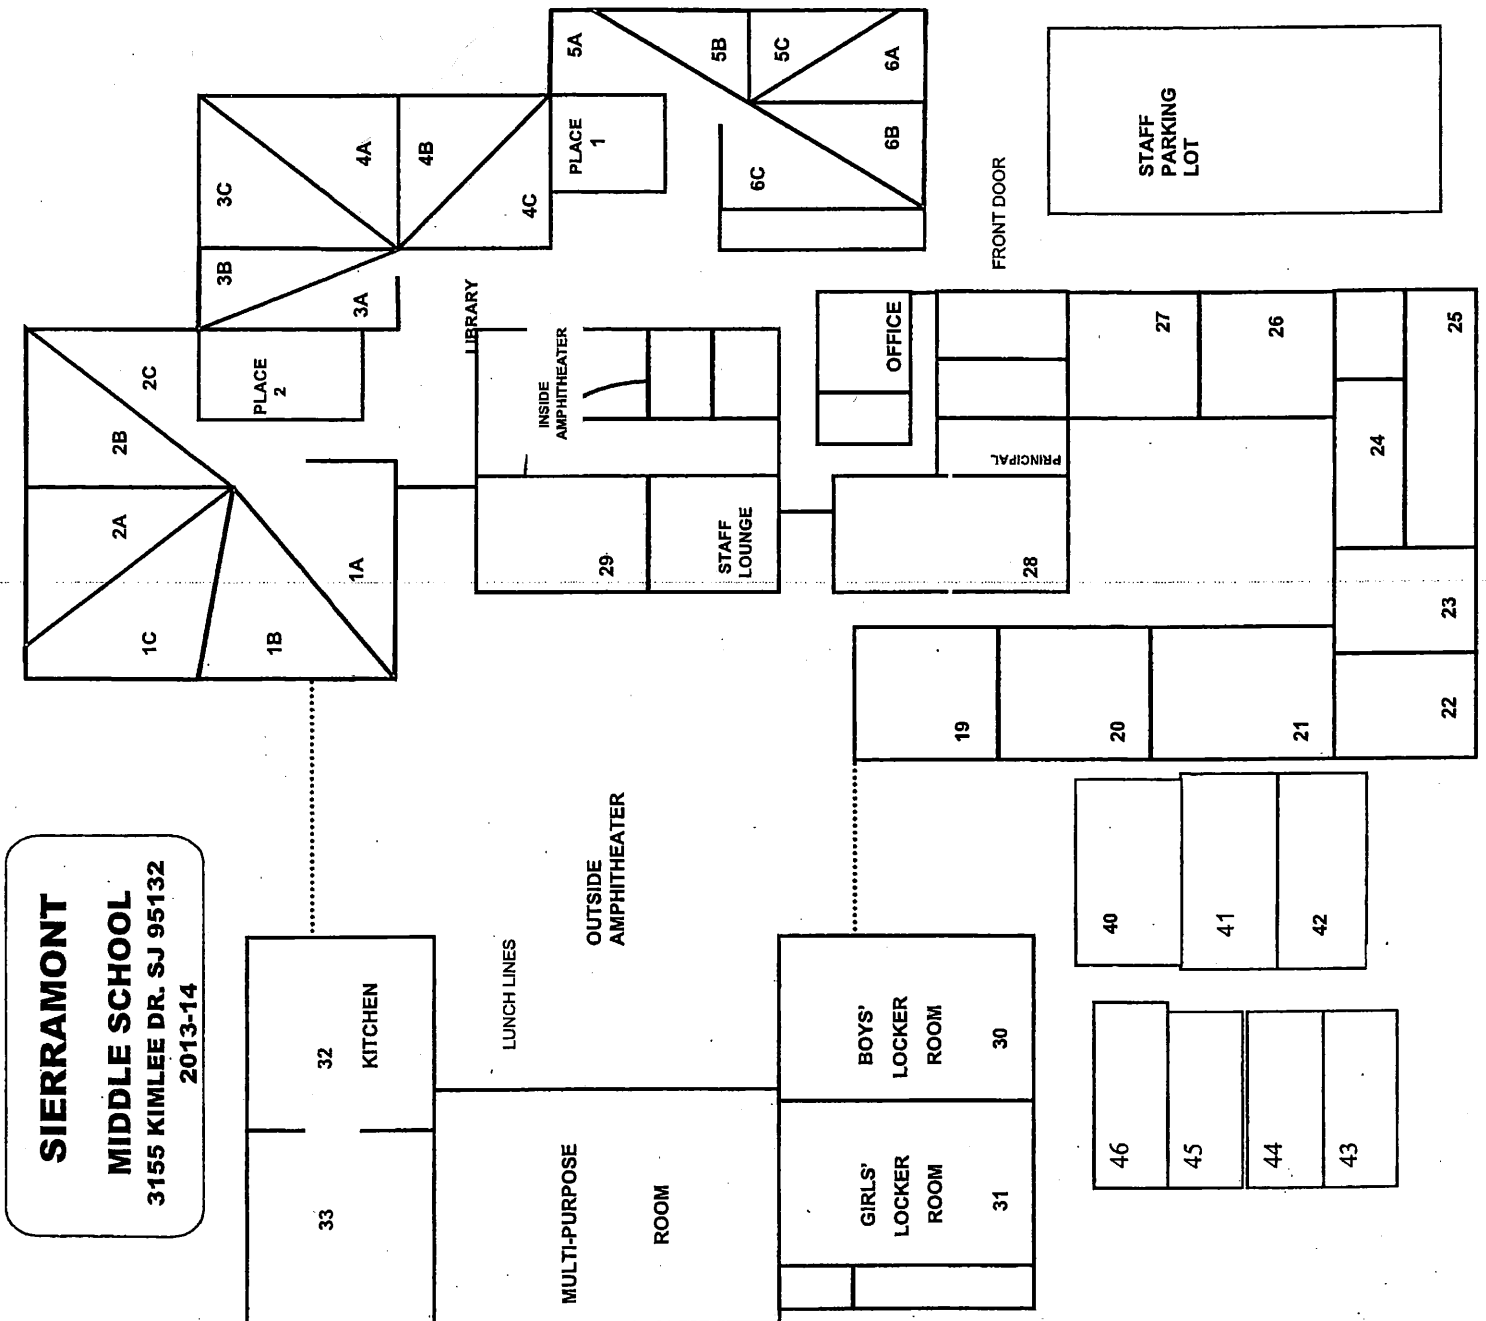

SIERRAMONT

MIDDLE SCHOOL

3155 KIMLEE DR. SJ 95132

2013-14


SIERRAMONT


MIDDLE SCHOOL

3155 KIMLEE DR. SJ 95132

2013-14

SIERRAMONT MIDDLE SCHOOL
INSPECTED ON: 3-5-14

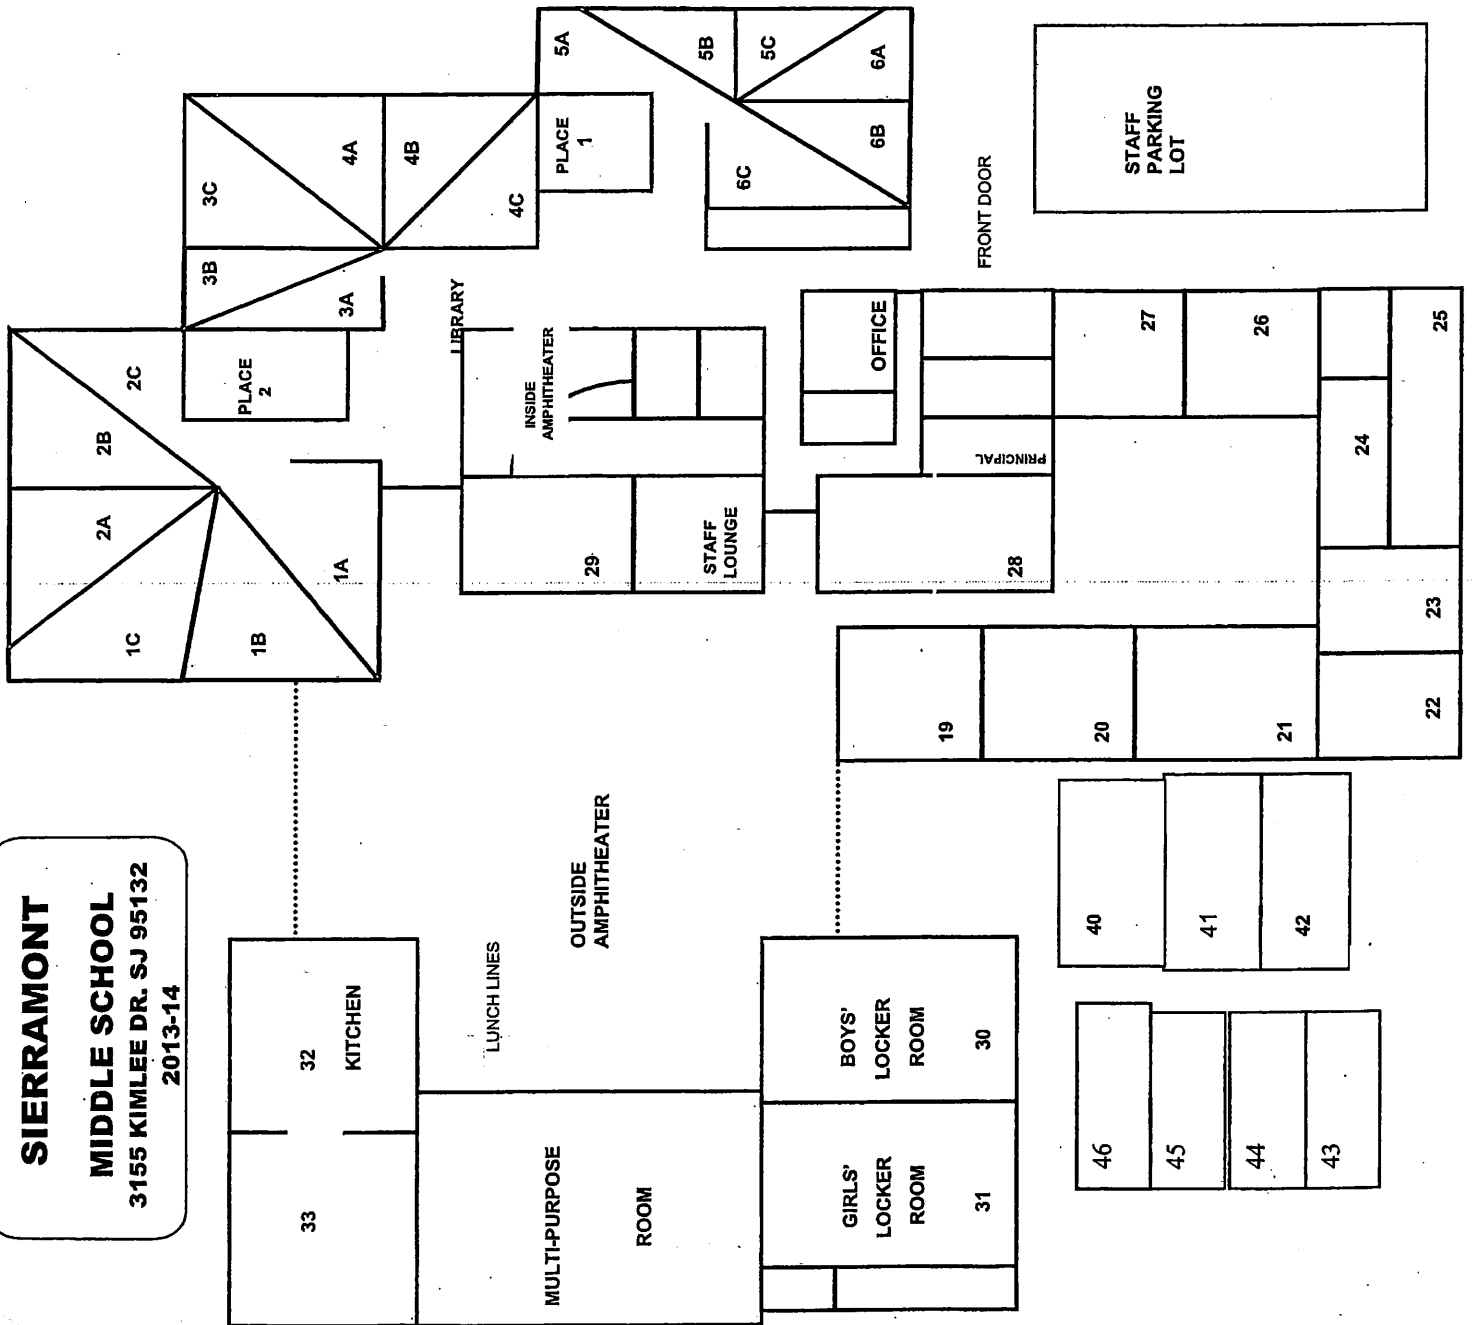


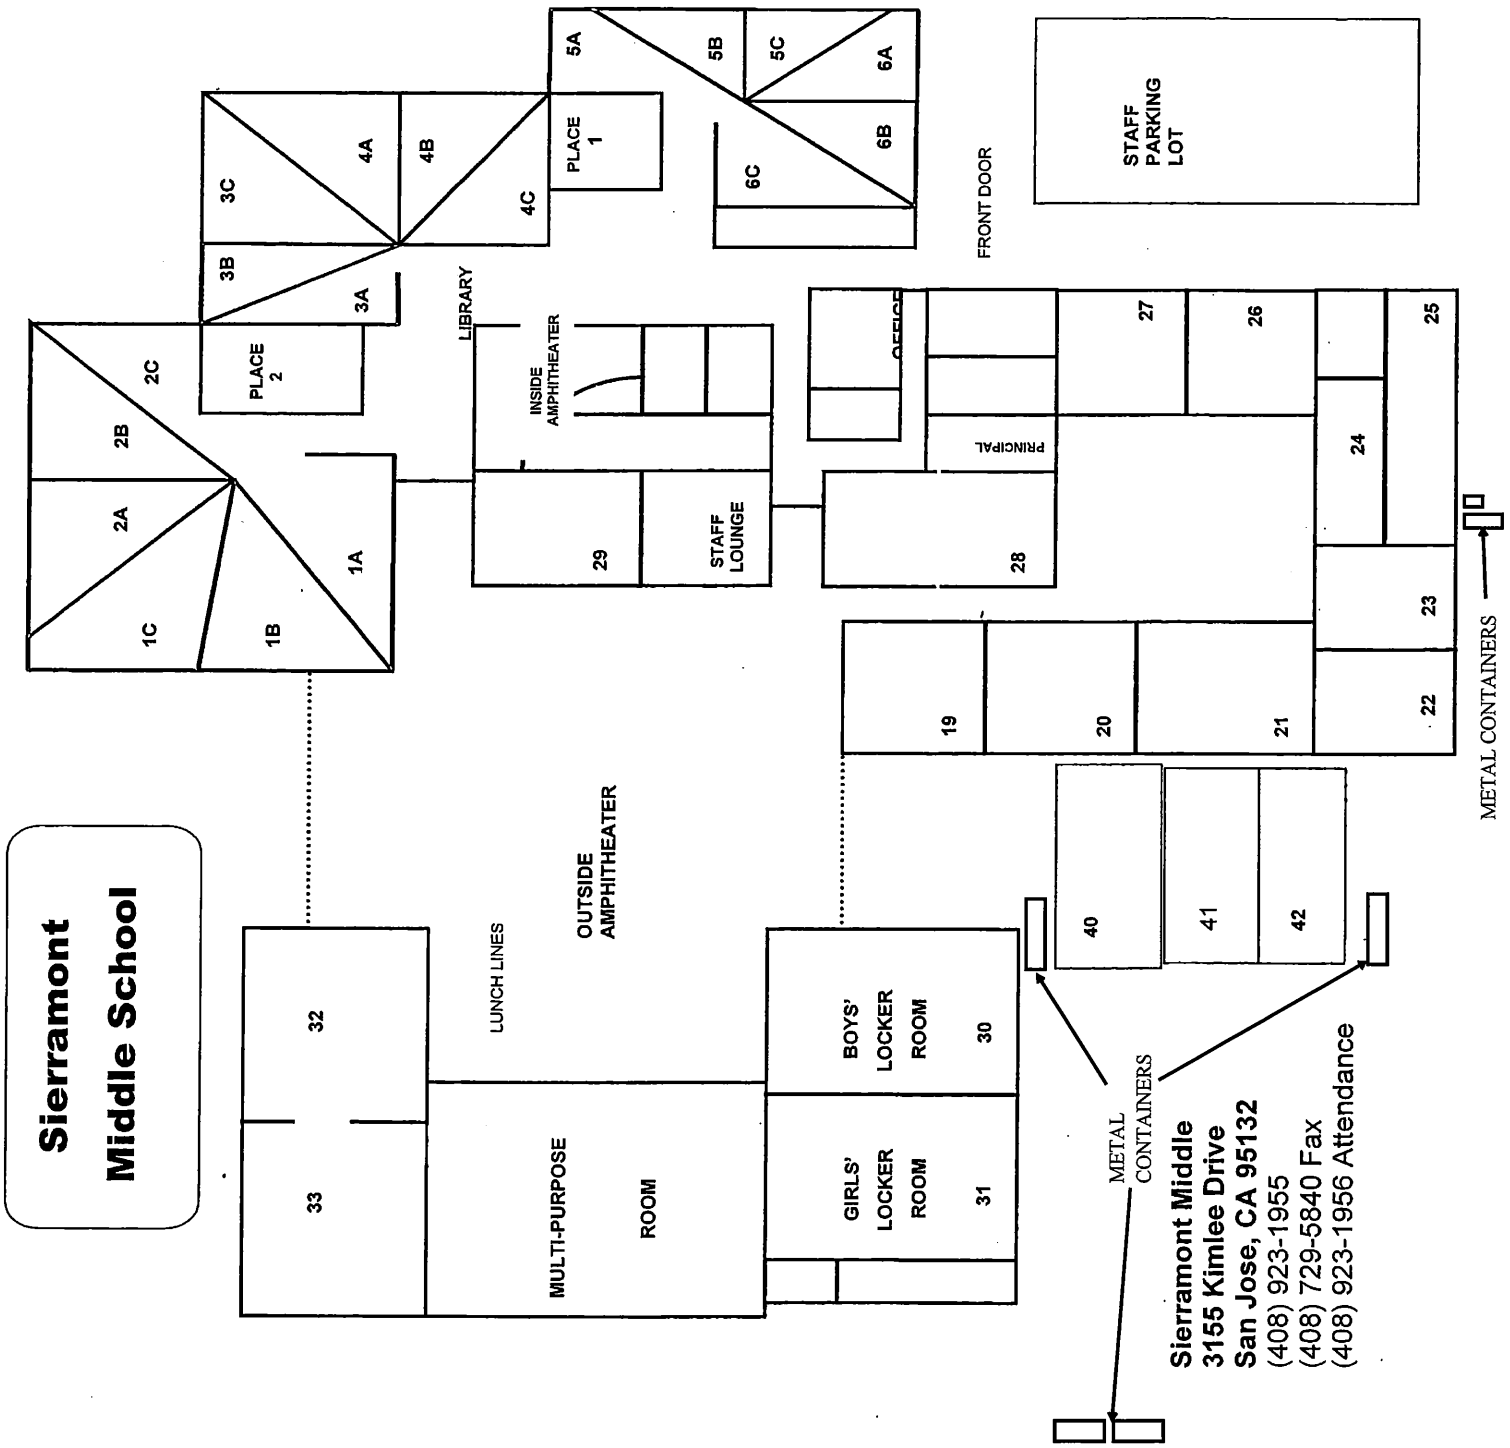

**Sierramont
Middle School**

Sierramont Middle
3155 Kimlee Drive
San Jose, CA 95132
(408) 923-1955
(408) 729-5840 Fax
(408) 923-1956 Attendance

SIERRAMONT MIDDLE SCHOOL
INSPECTED ON: 4-4-13

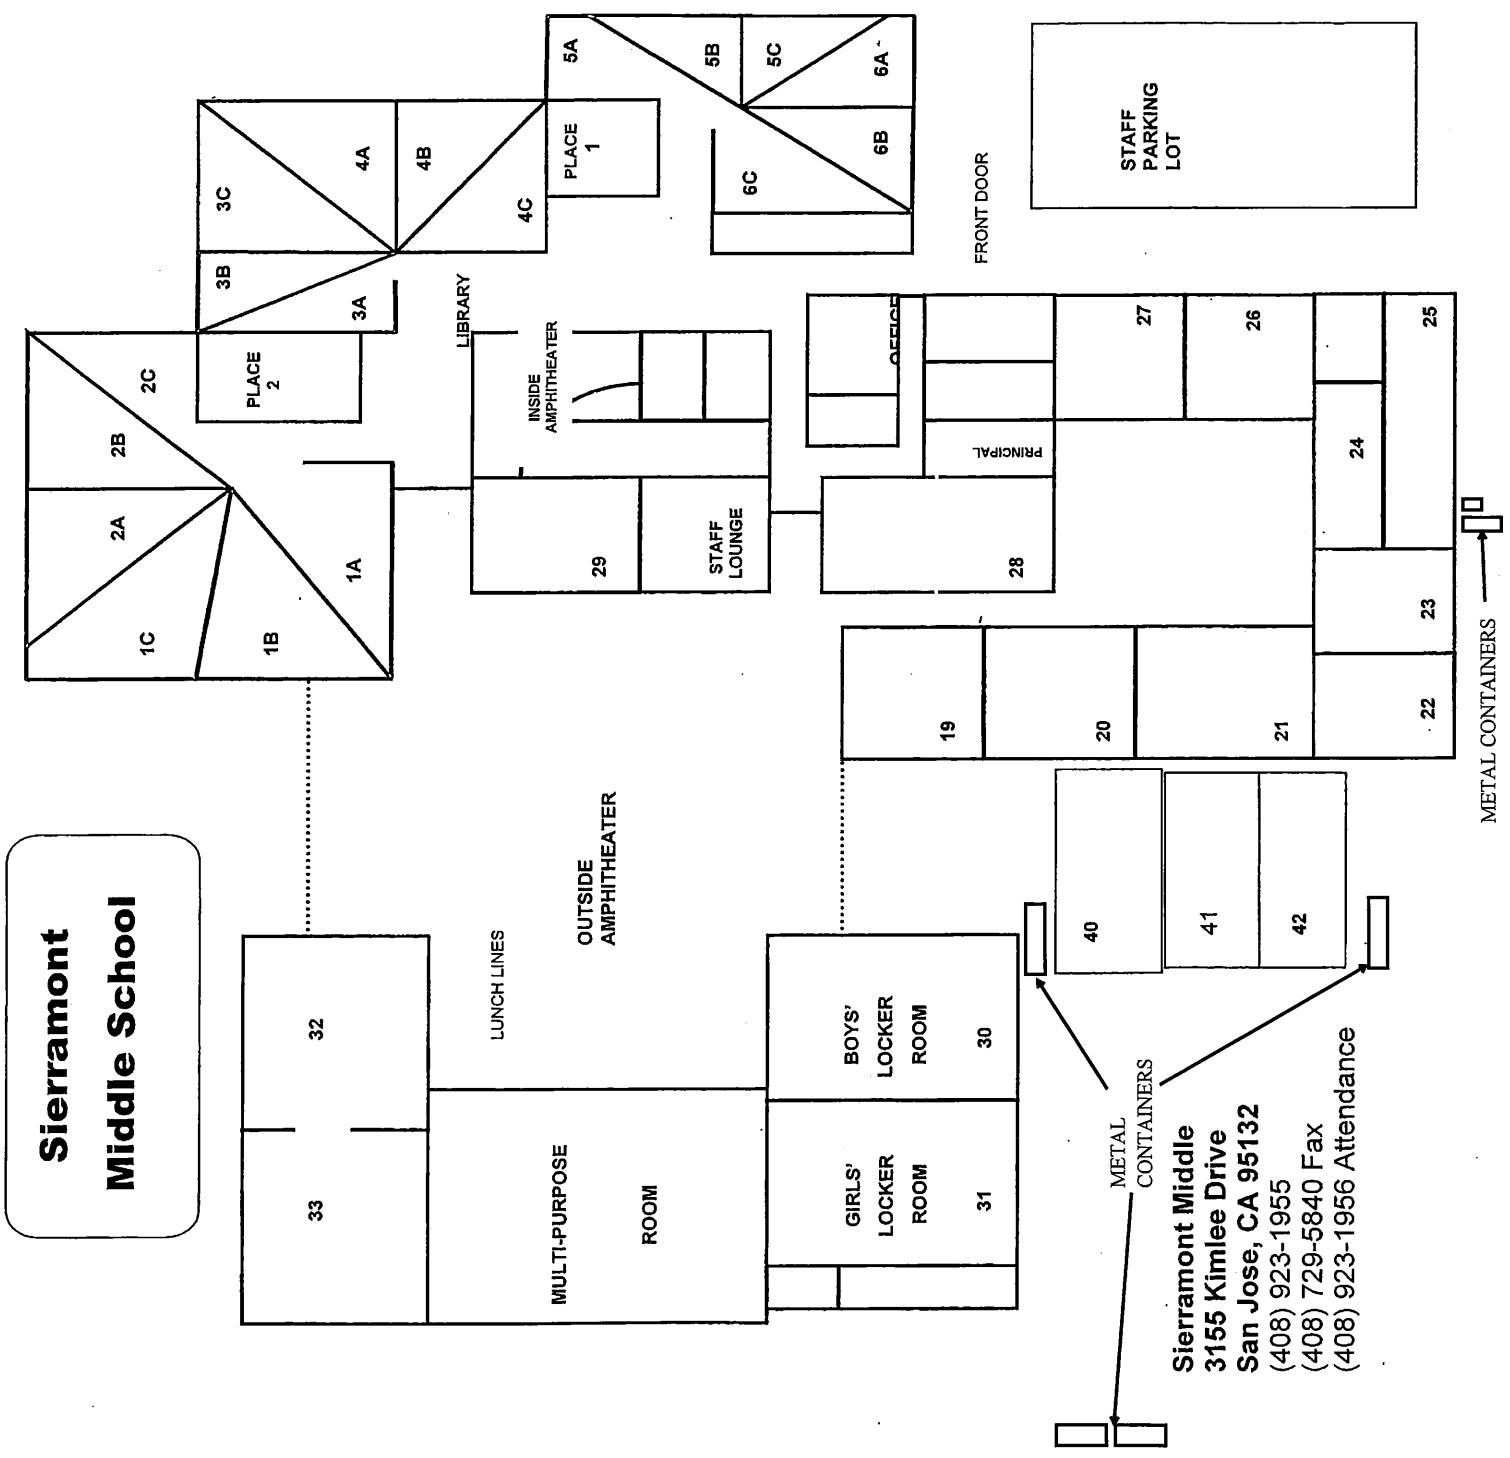



**Sierramont
Middle School**

Sierramont Middle
3155 Kimlee Drive
San Jose, CA 95132
(408) 923-1955
(408) 729-5840 Fax
(408) 923-1956 Attendance

Sierramont Middle School


SIERRAMONT MIDDLE SCHOOL
INSPECTED ON: 10-11-12

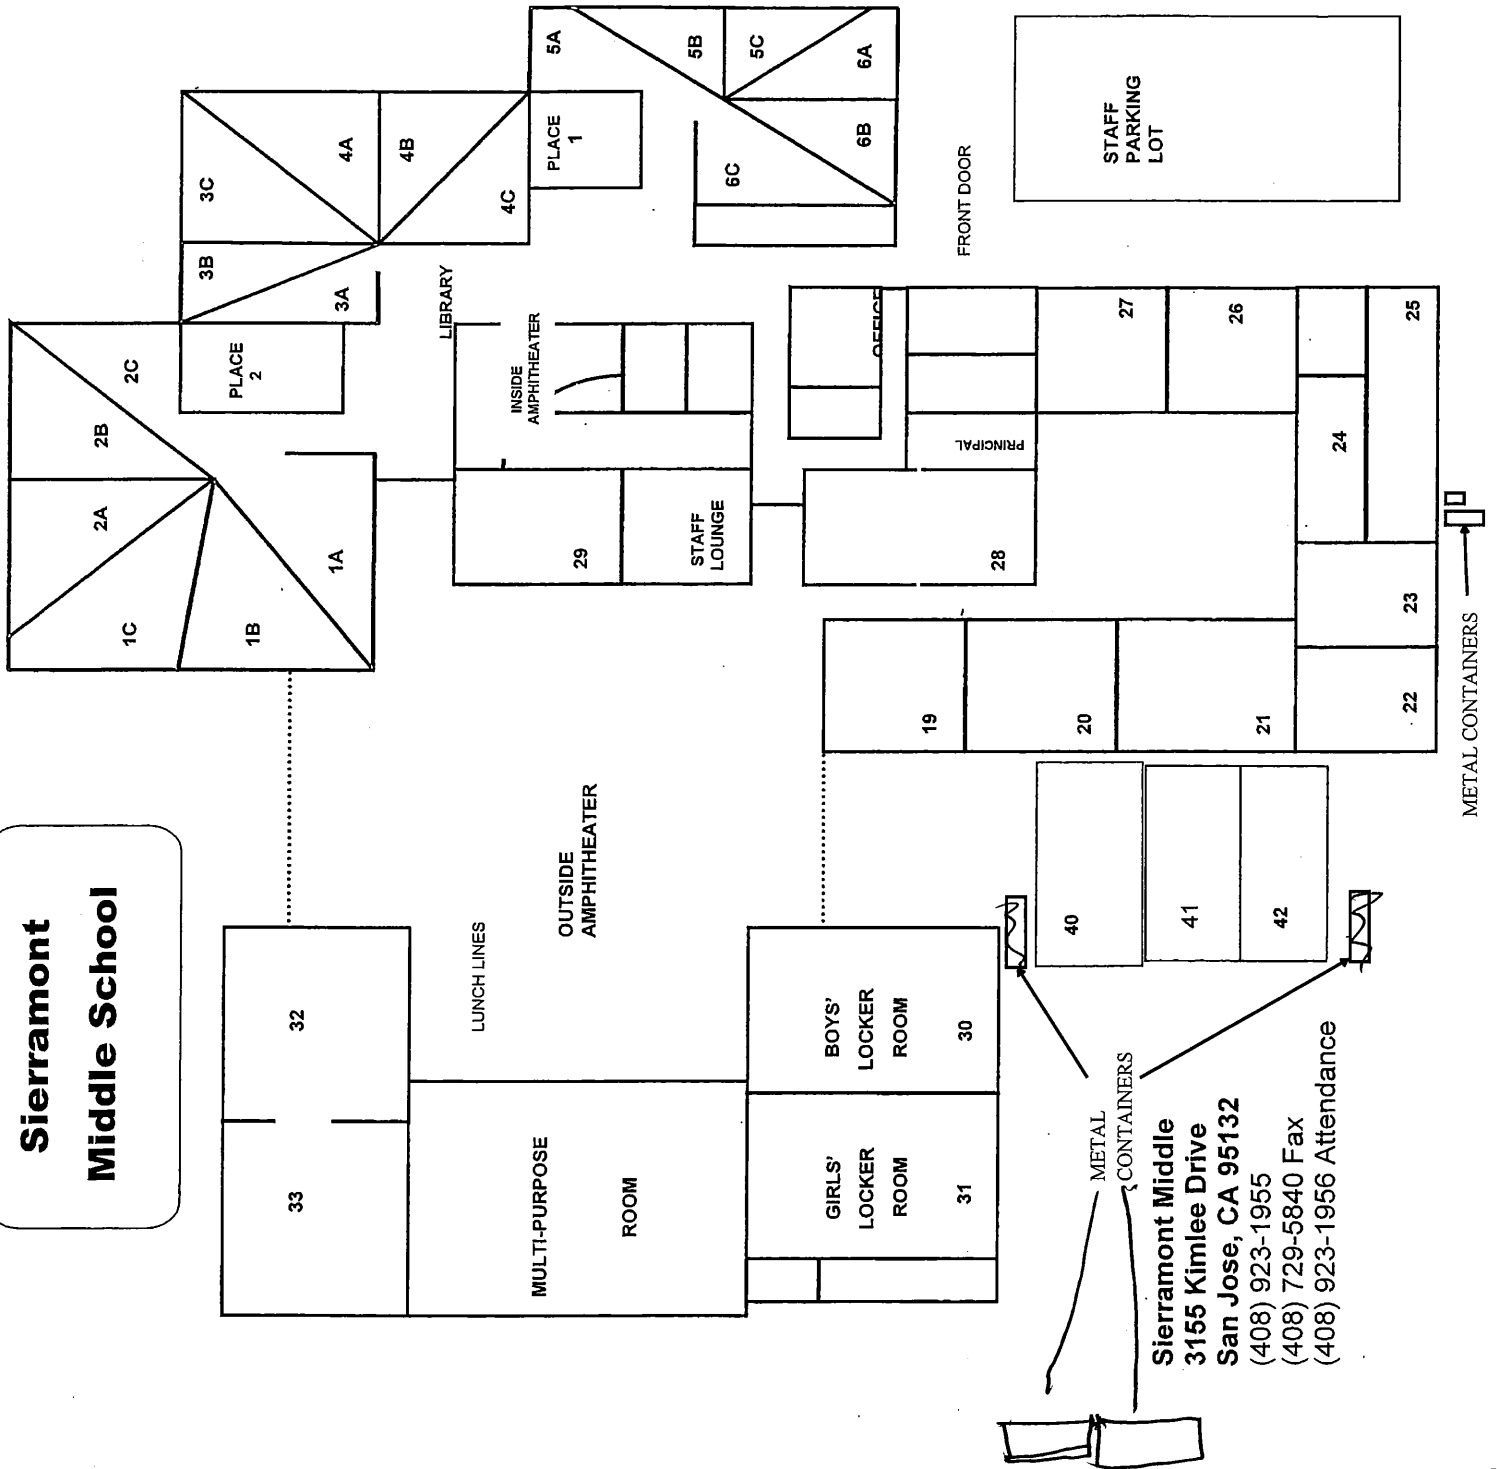

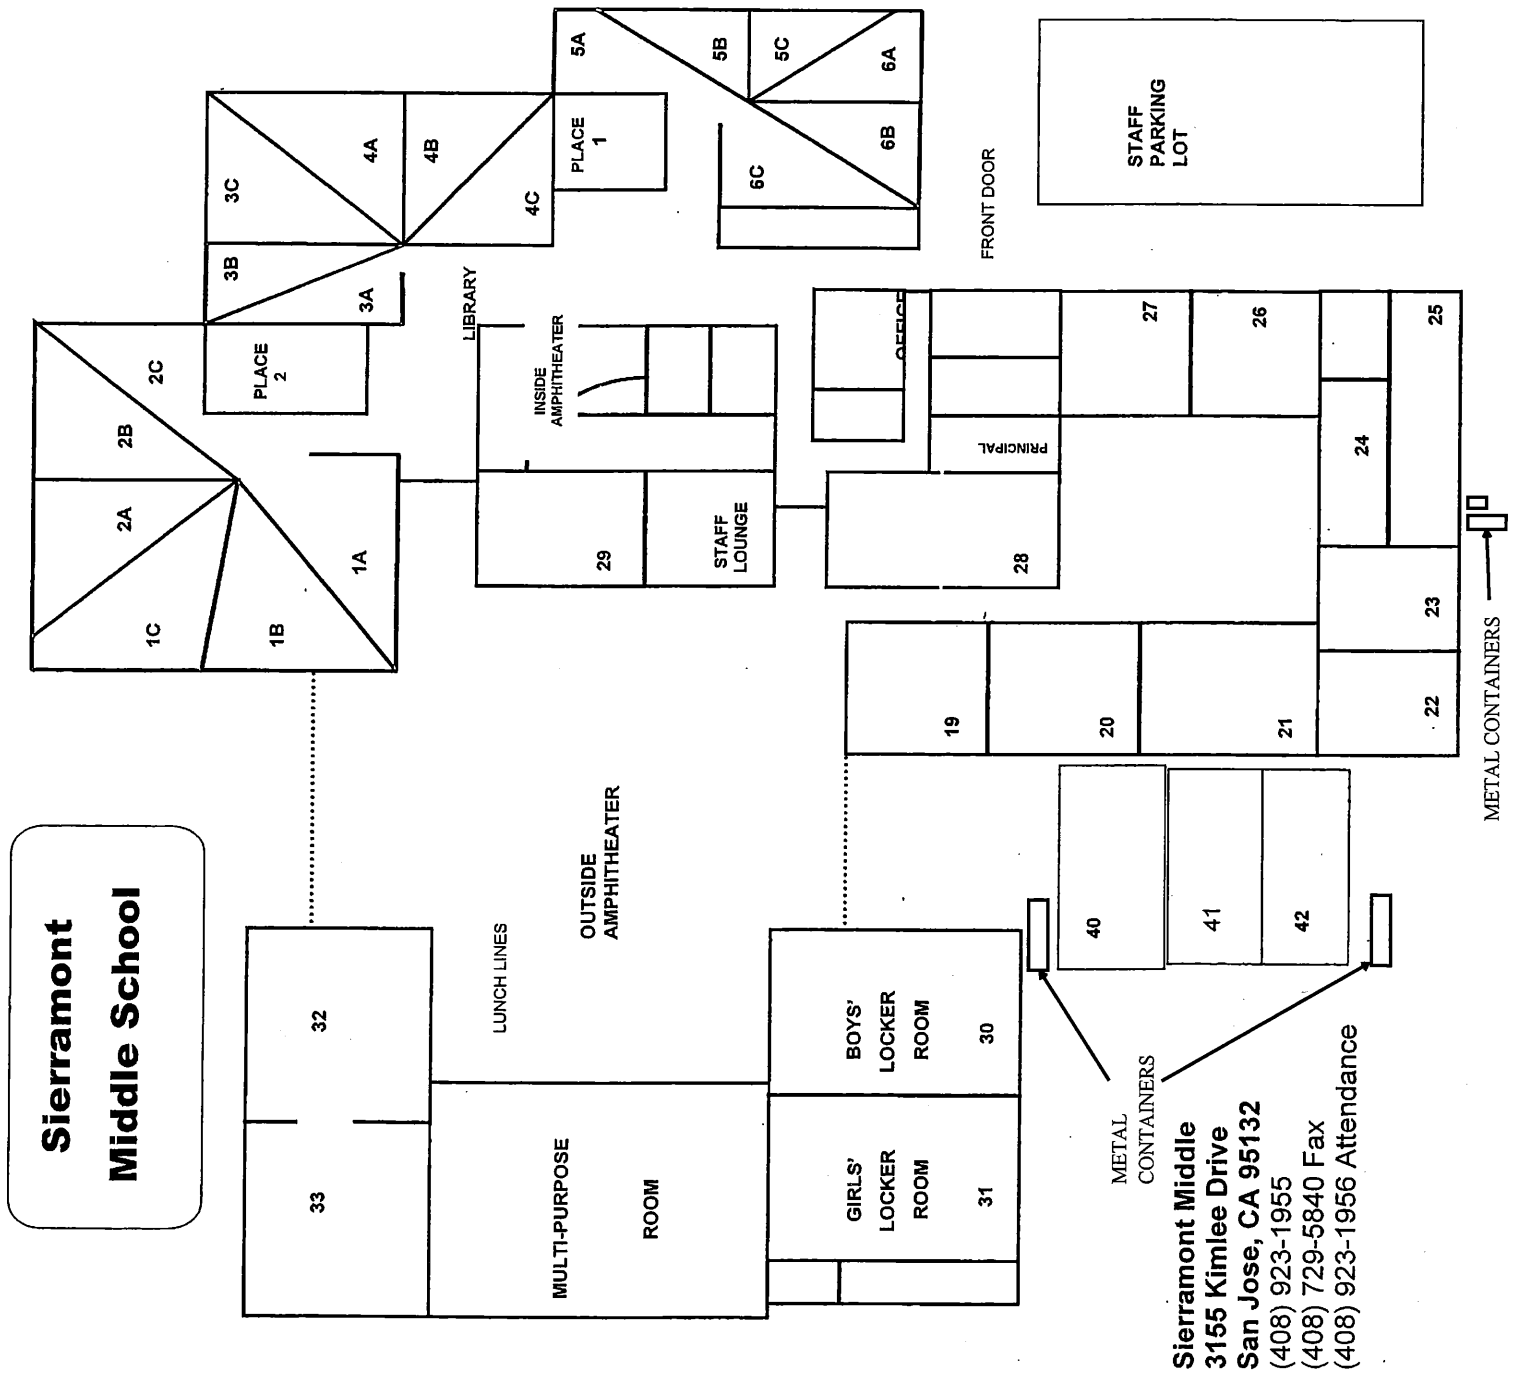


Sierramont Middle
 3155 Kimlee Drive
 San Jose, CA 95132
 (408) 923-1955
 (408) 729-5840 Fax
 (408) 923-1956 Attendance

SIERRAMONT MIDDLE SCHOOL
 INSPECTED ON: 12-1-11

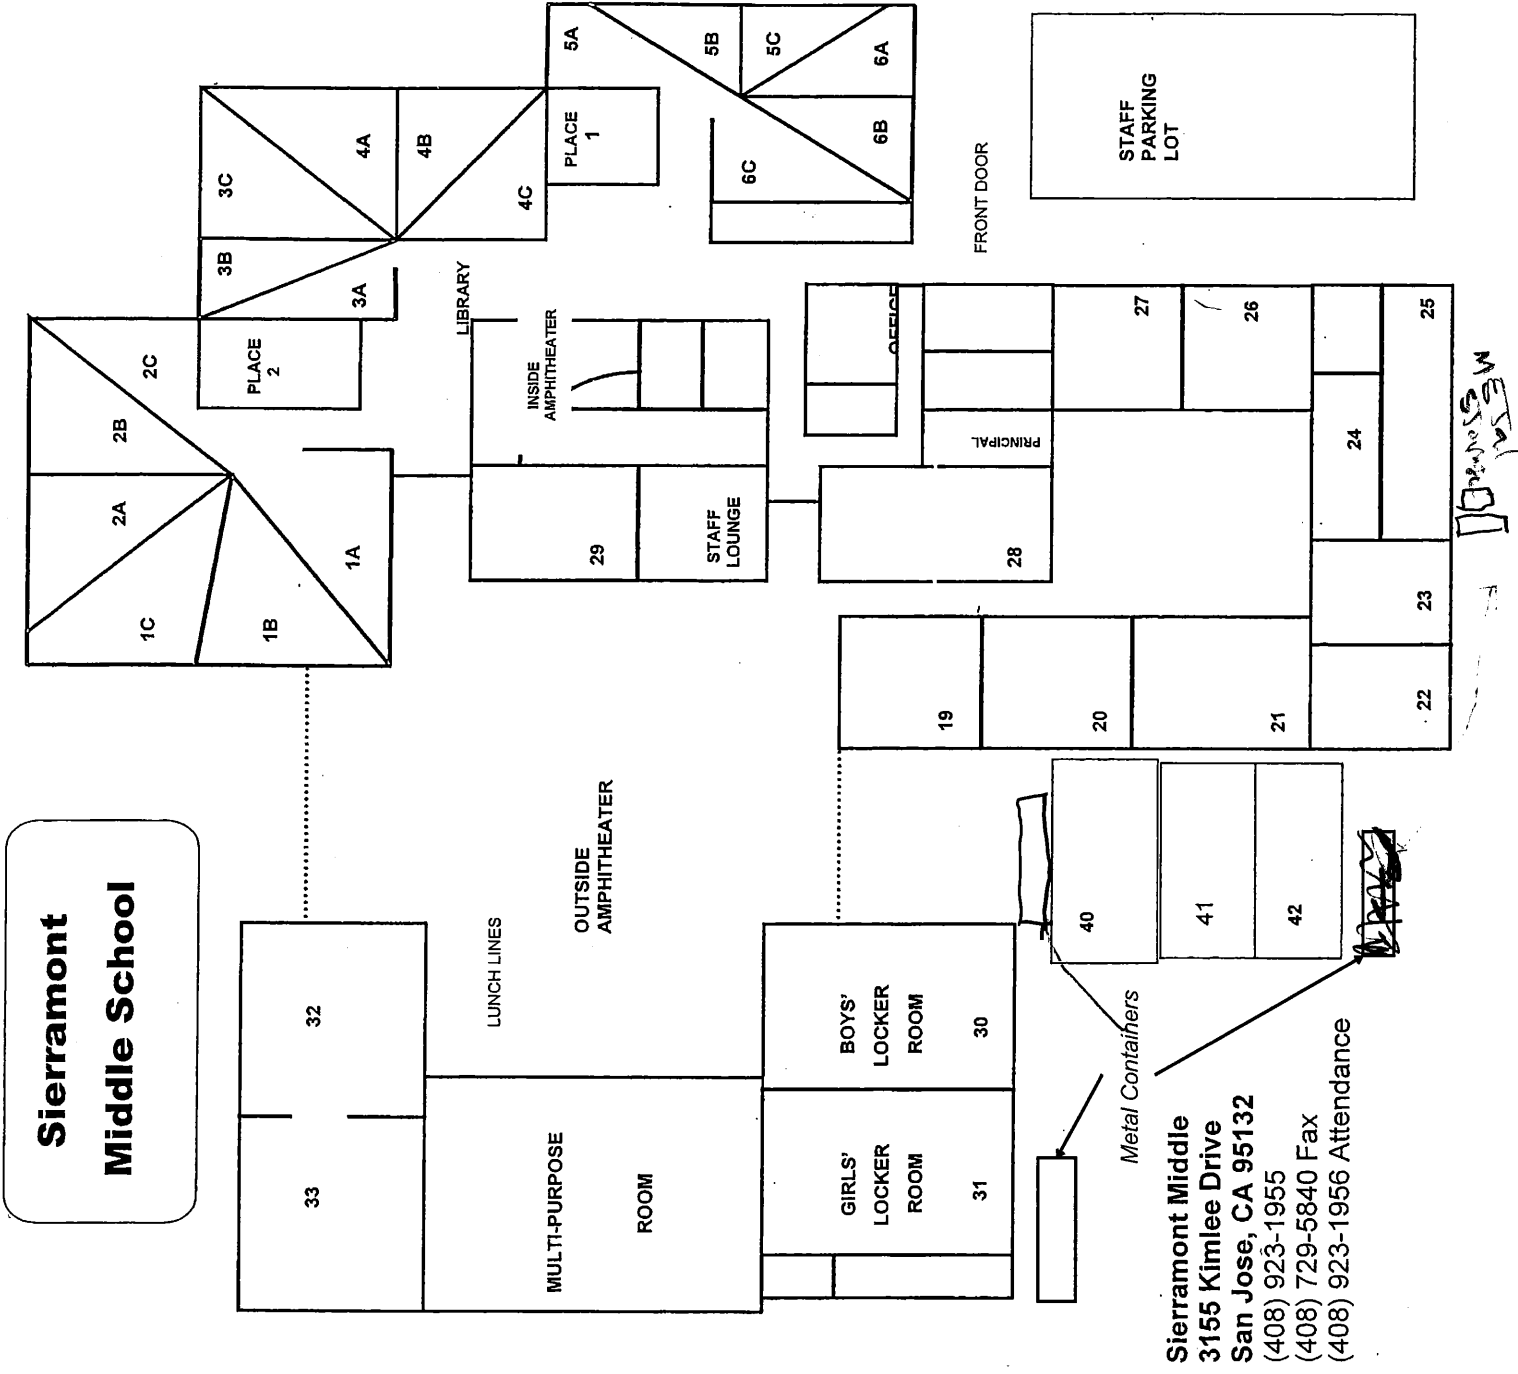

Sierramont Middle
 3155 Kimlee Drive
 San Jose, CA 95132
 (408) 923-1955
 (408) 729-5840 Fax
 (408) 923-1956 Attendance

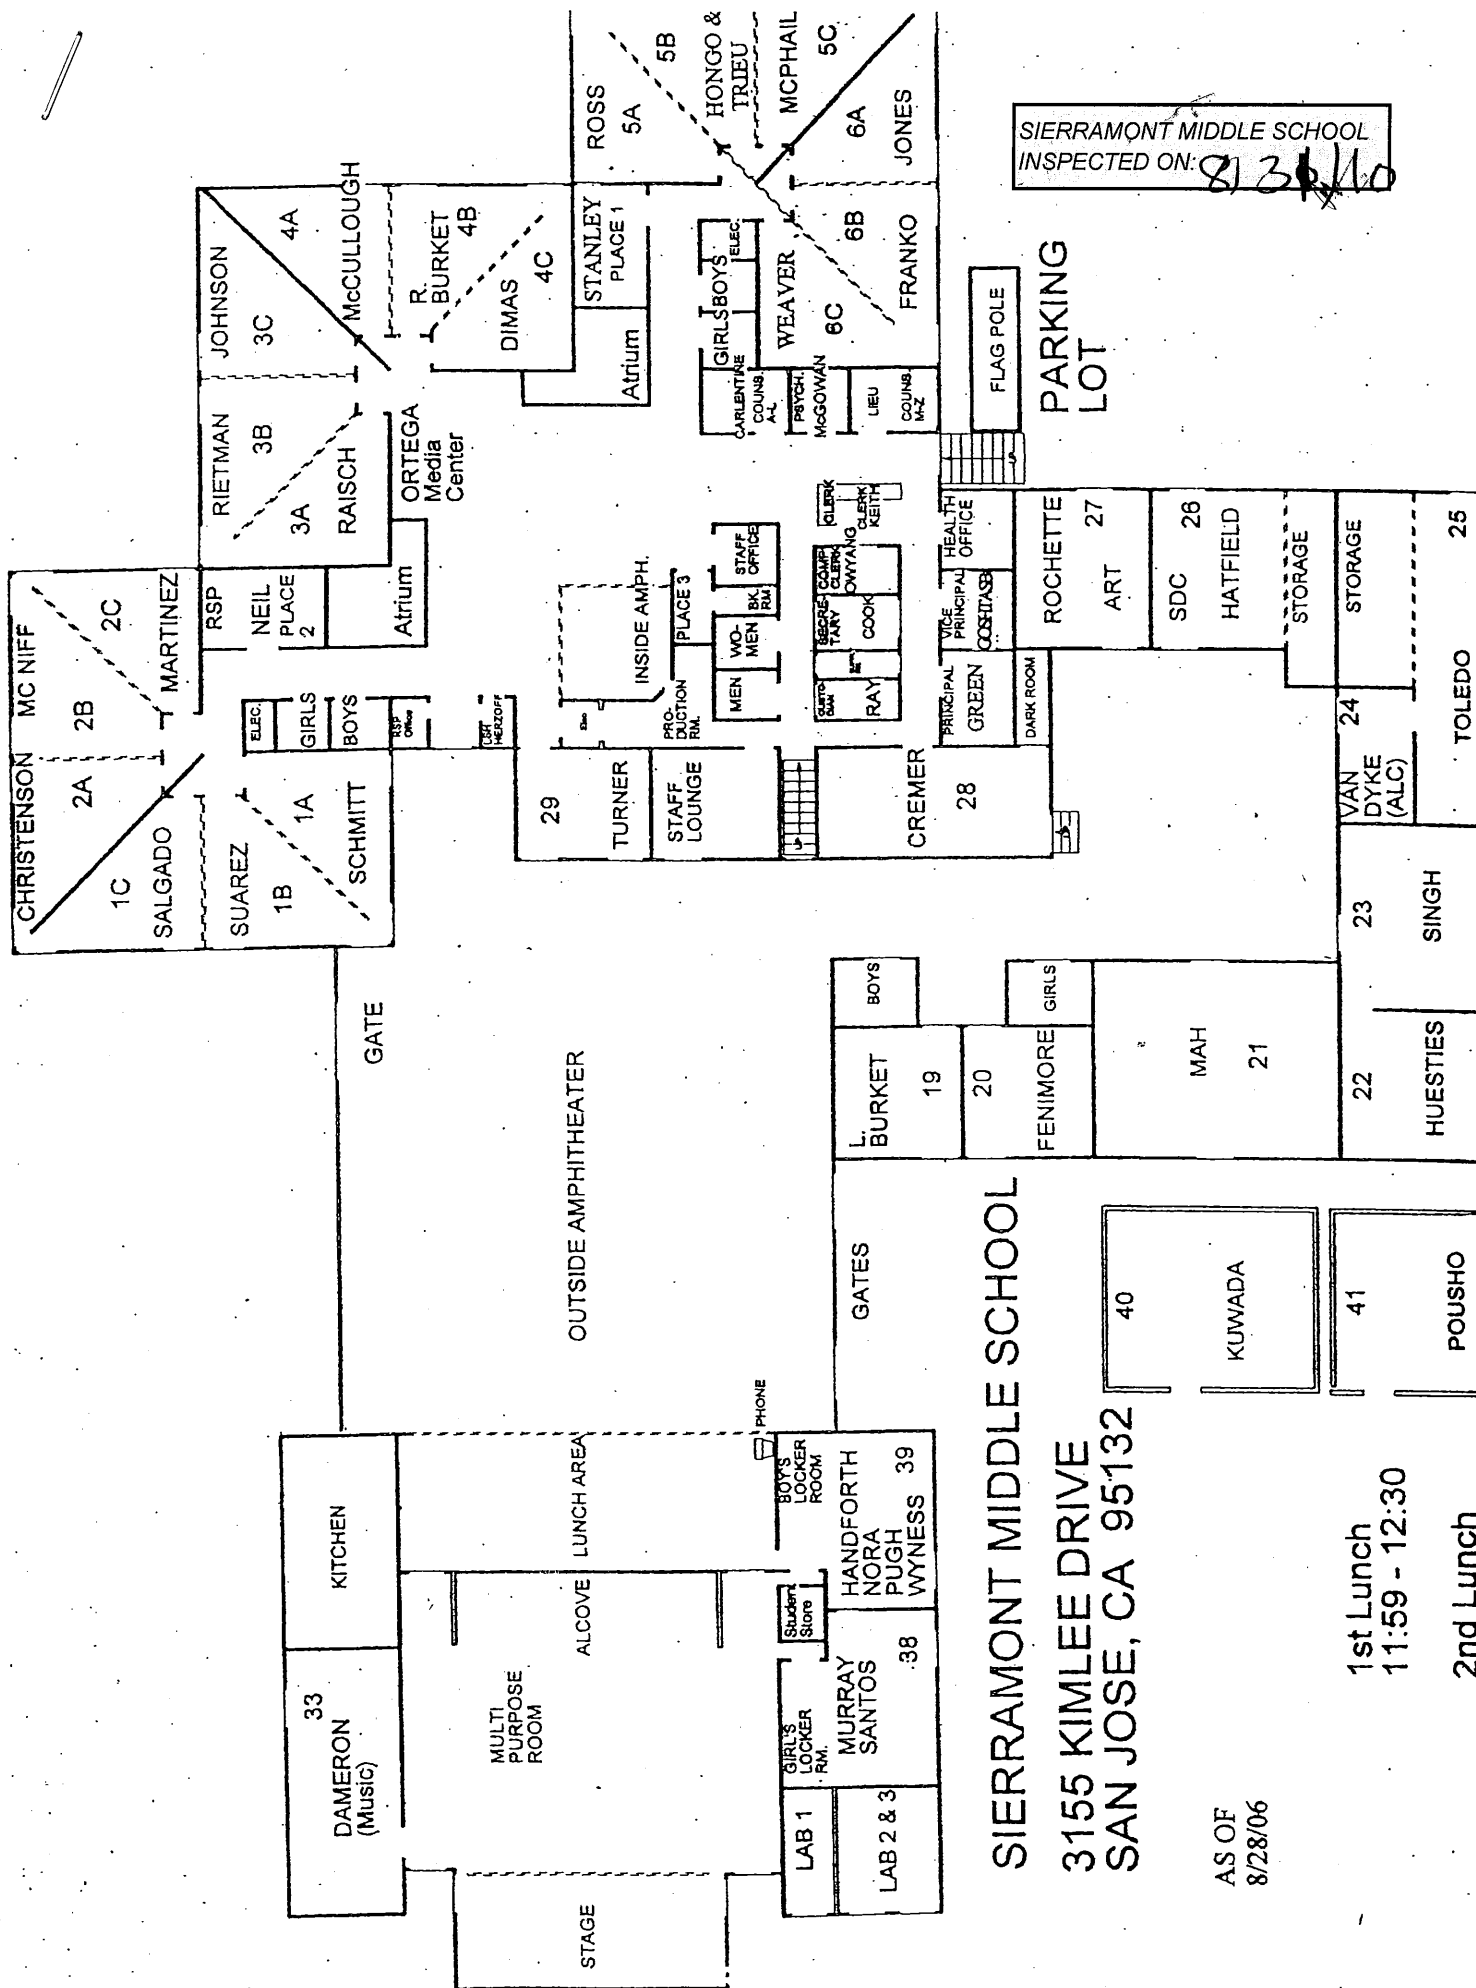


SIERRAMONT MIDDLE SCHOOL
INSPECTED ON: 8/30/10

SIERRAMONT MIDDLE SCHOOL
3155 KIMLEE DRIVE
SAN JOSE, CA 95132

AS OF
8/28/06

1st Lunch
11:59 - 12:30
2nd Lunch

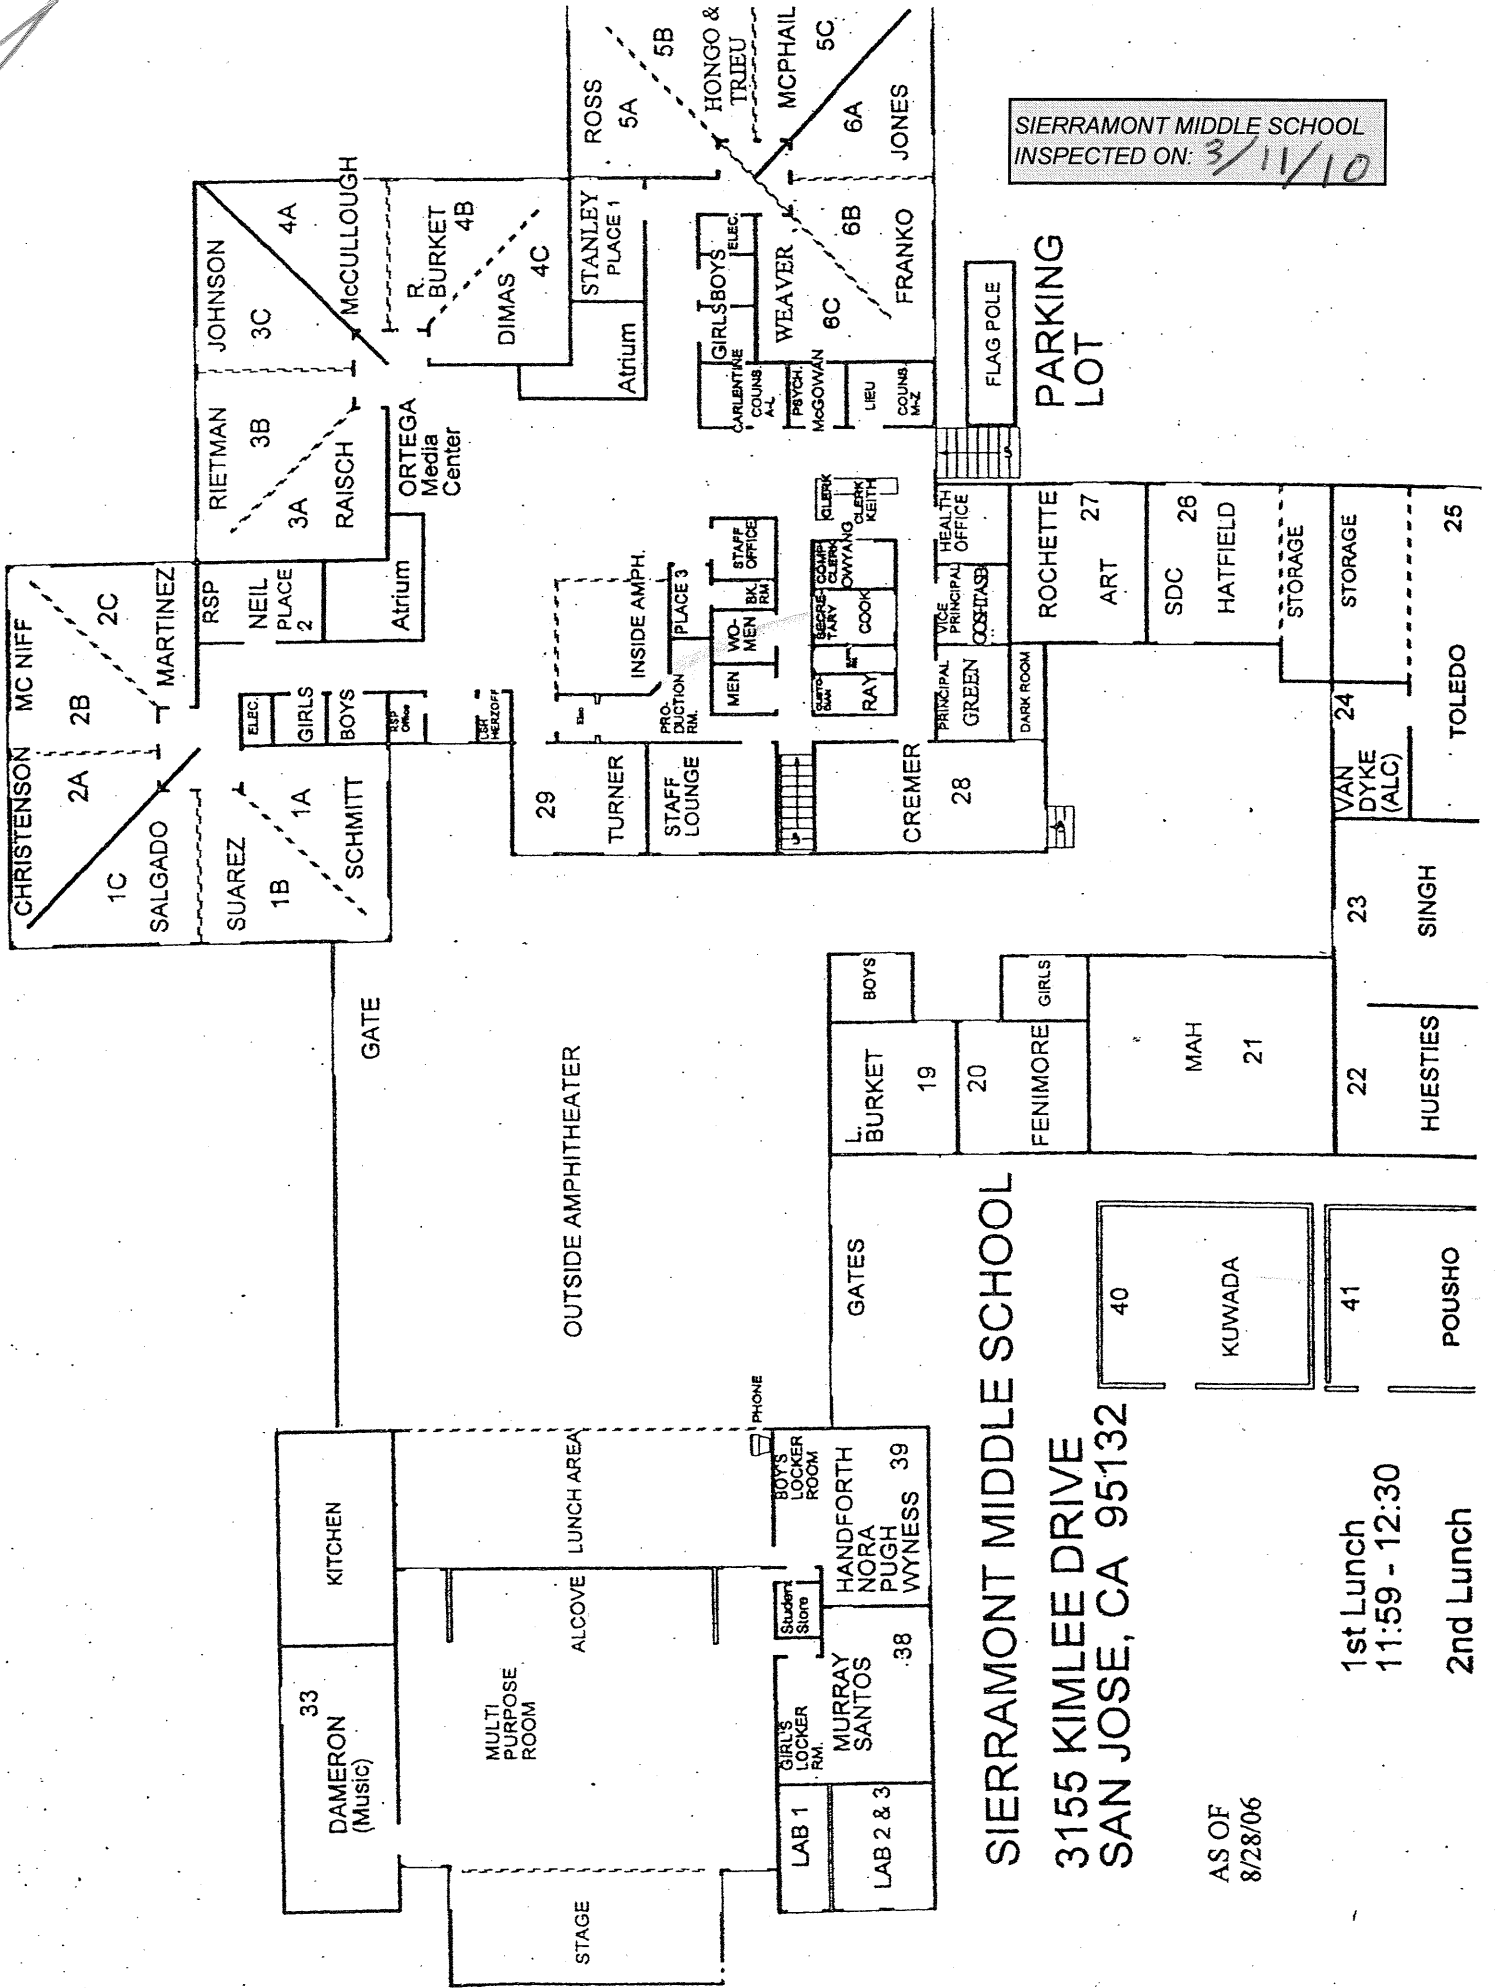


SIERRAMONT MIDDLE SCHOOL

3155 KIMLEE DRIVE
SAN JOSE, CA 95132

AS OF
8/28/06

1st Lunch
11:59 - 12:30

2nd Lunch

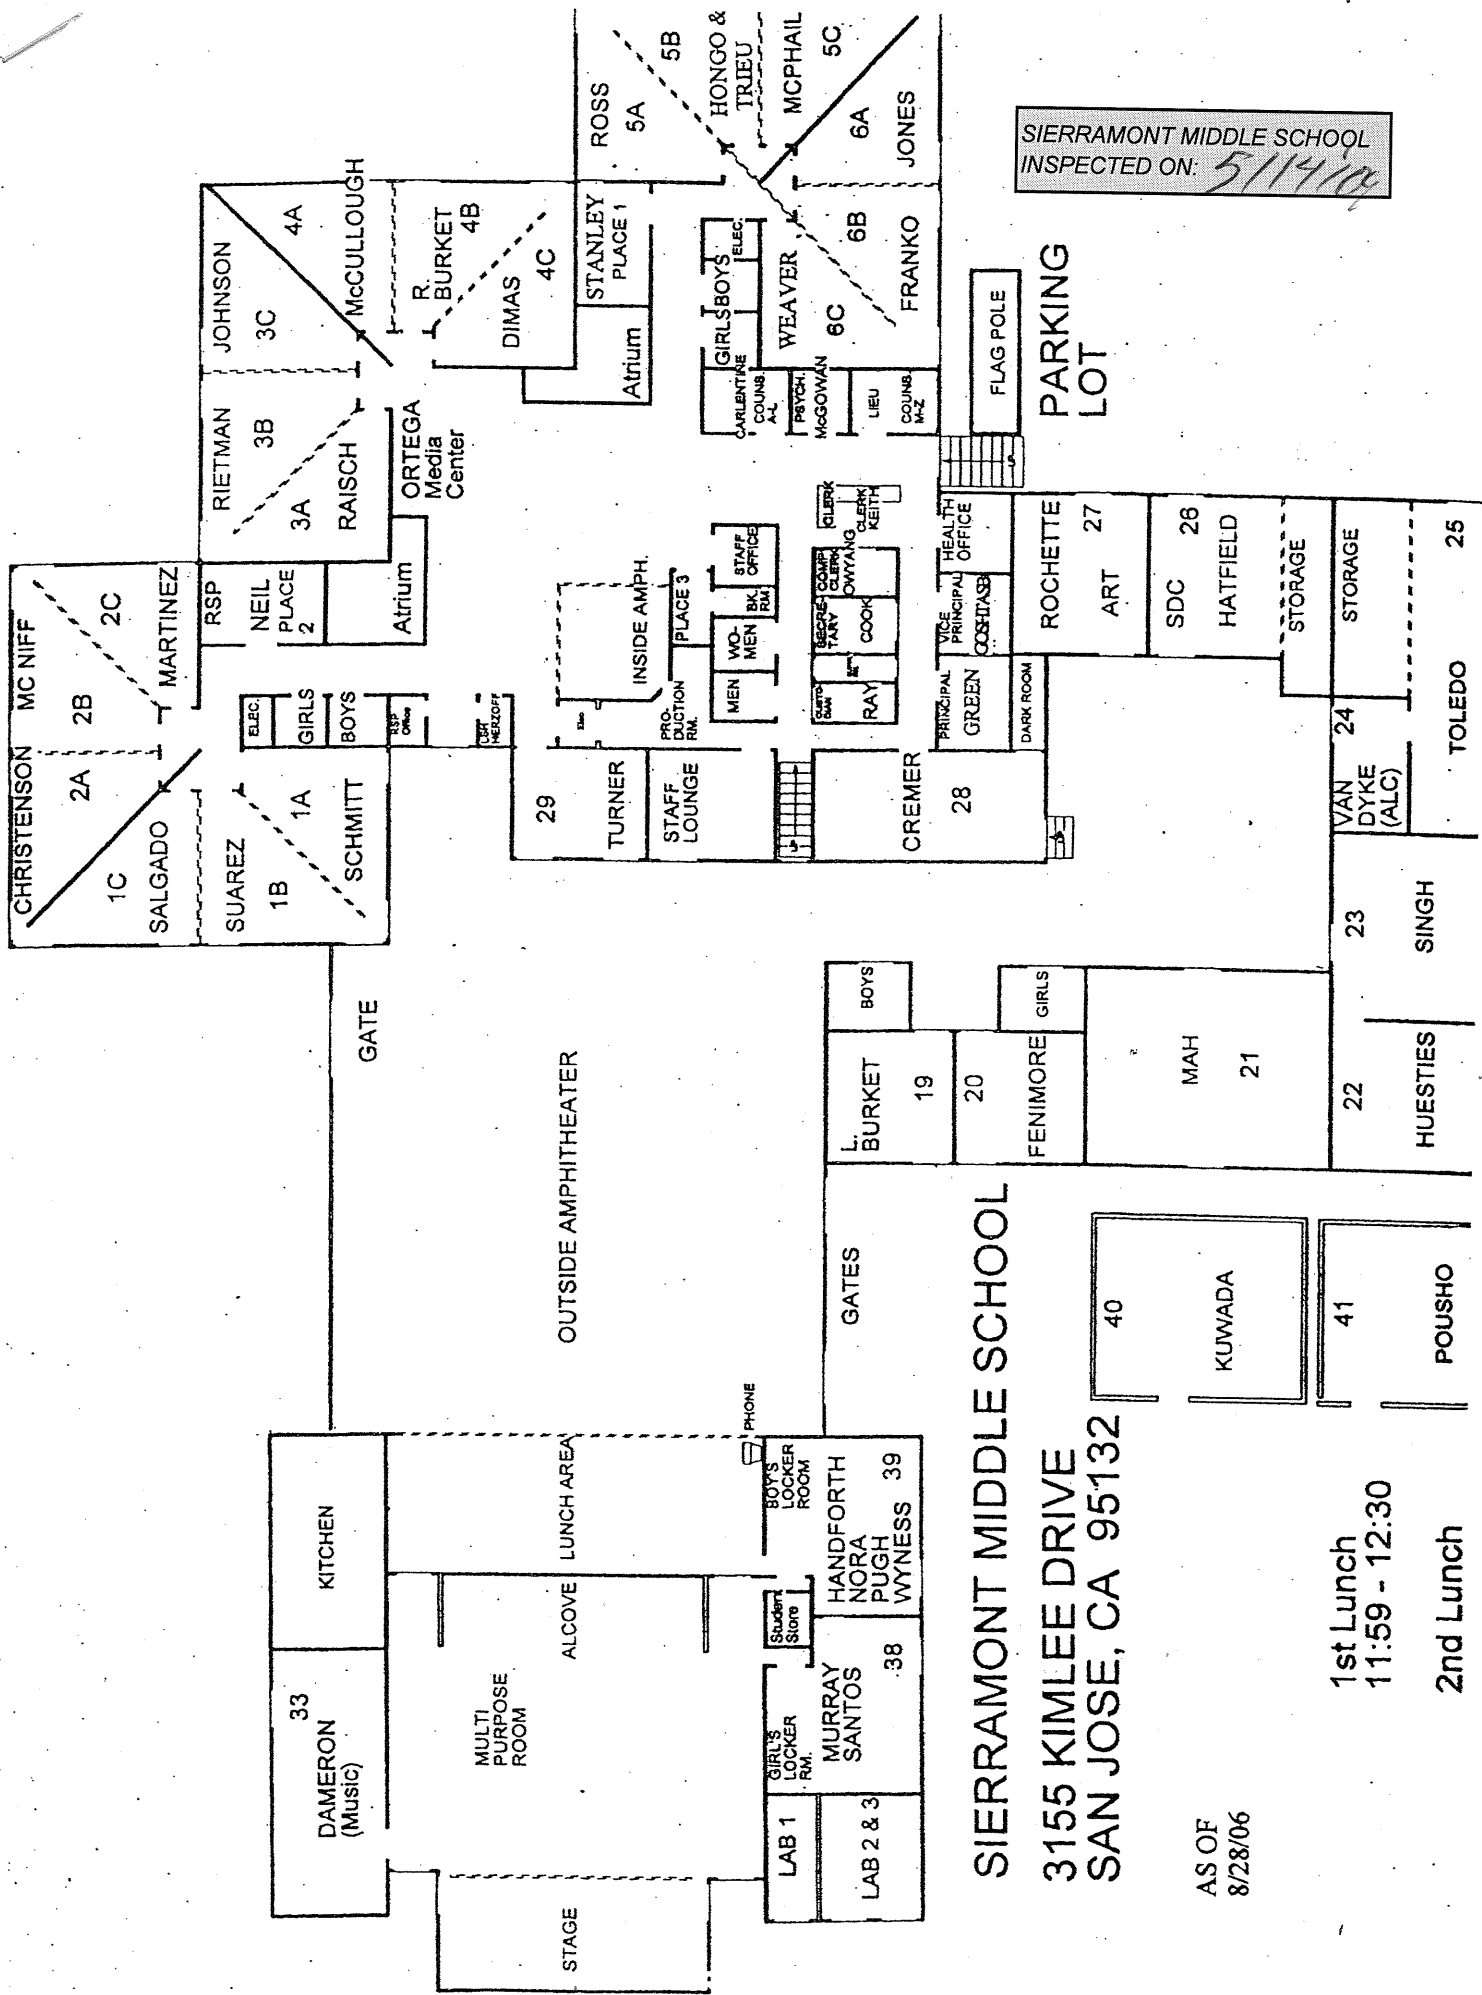


SIERRAMONT MIDDLE SCHOOL
INSPECTED ON: 5/14/06

SIERRAMONT MIDDLE SCHOOL
3155 KIMLEE DRIVE
SAN JOSE, CA 95132

AS OF
8/28/06

1st Lunch
11:59 - 12:30
2nd Lunch

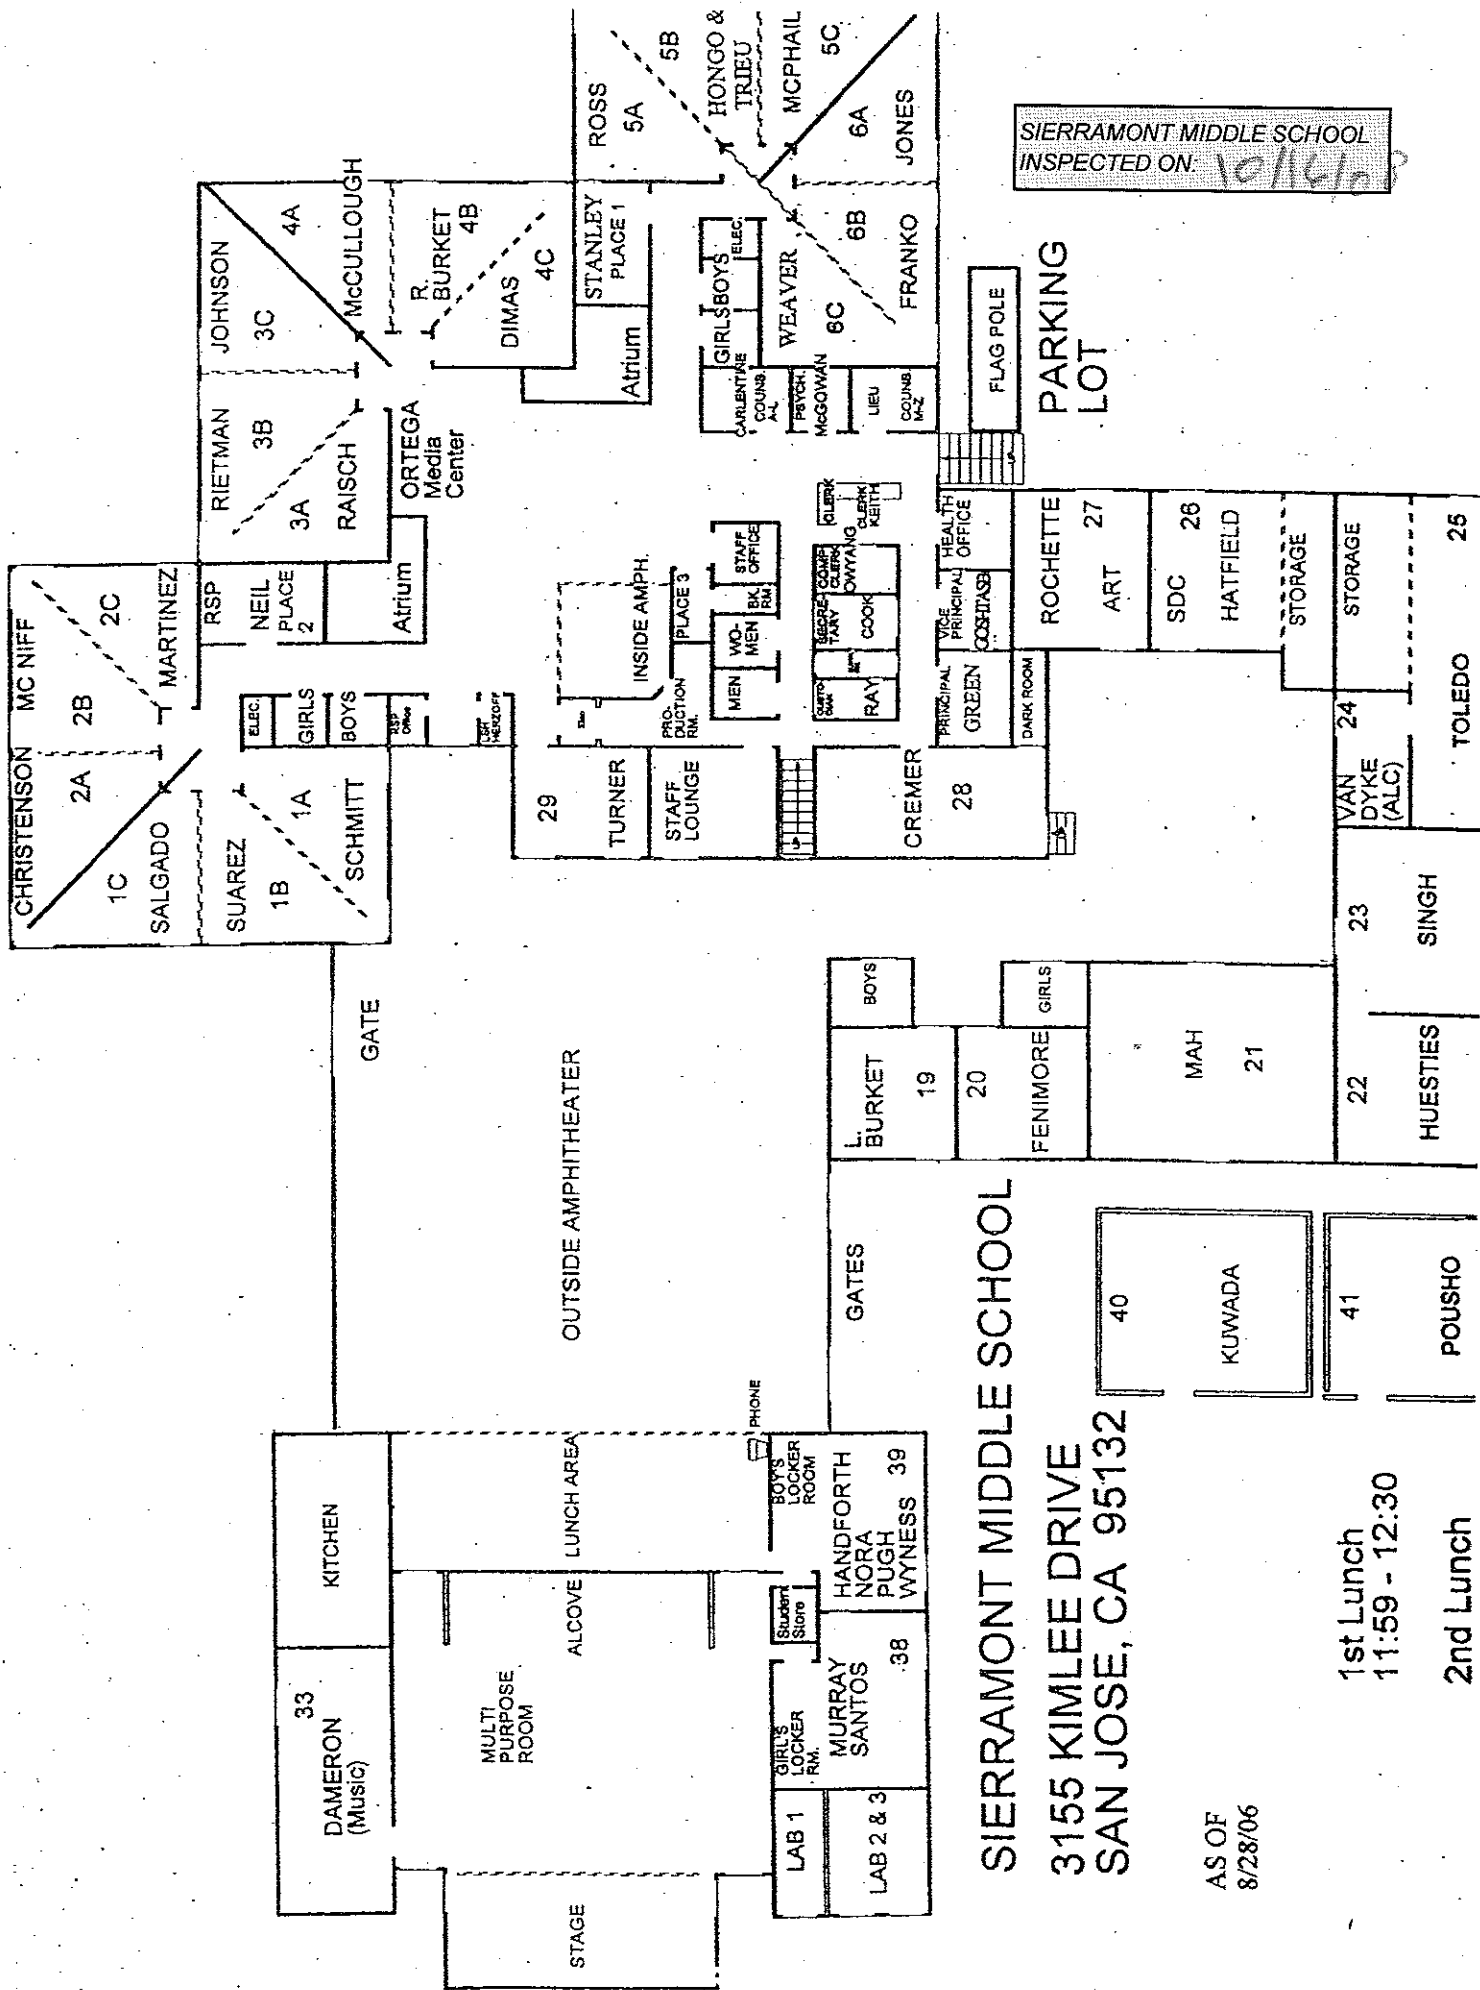


SIERRAMONT MIDDLE SCHOOL
INSPECTED ON 10/16/08

SIERRAMONT MIDDLE SCHOOL
3155 KIMLEE DRIVE
SAN JOSE, CA 95132

AS OF
8/28/06

1st Lunch
11:59 - 12:30

2nd Lunch

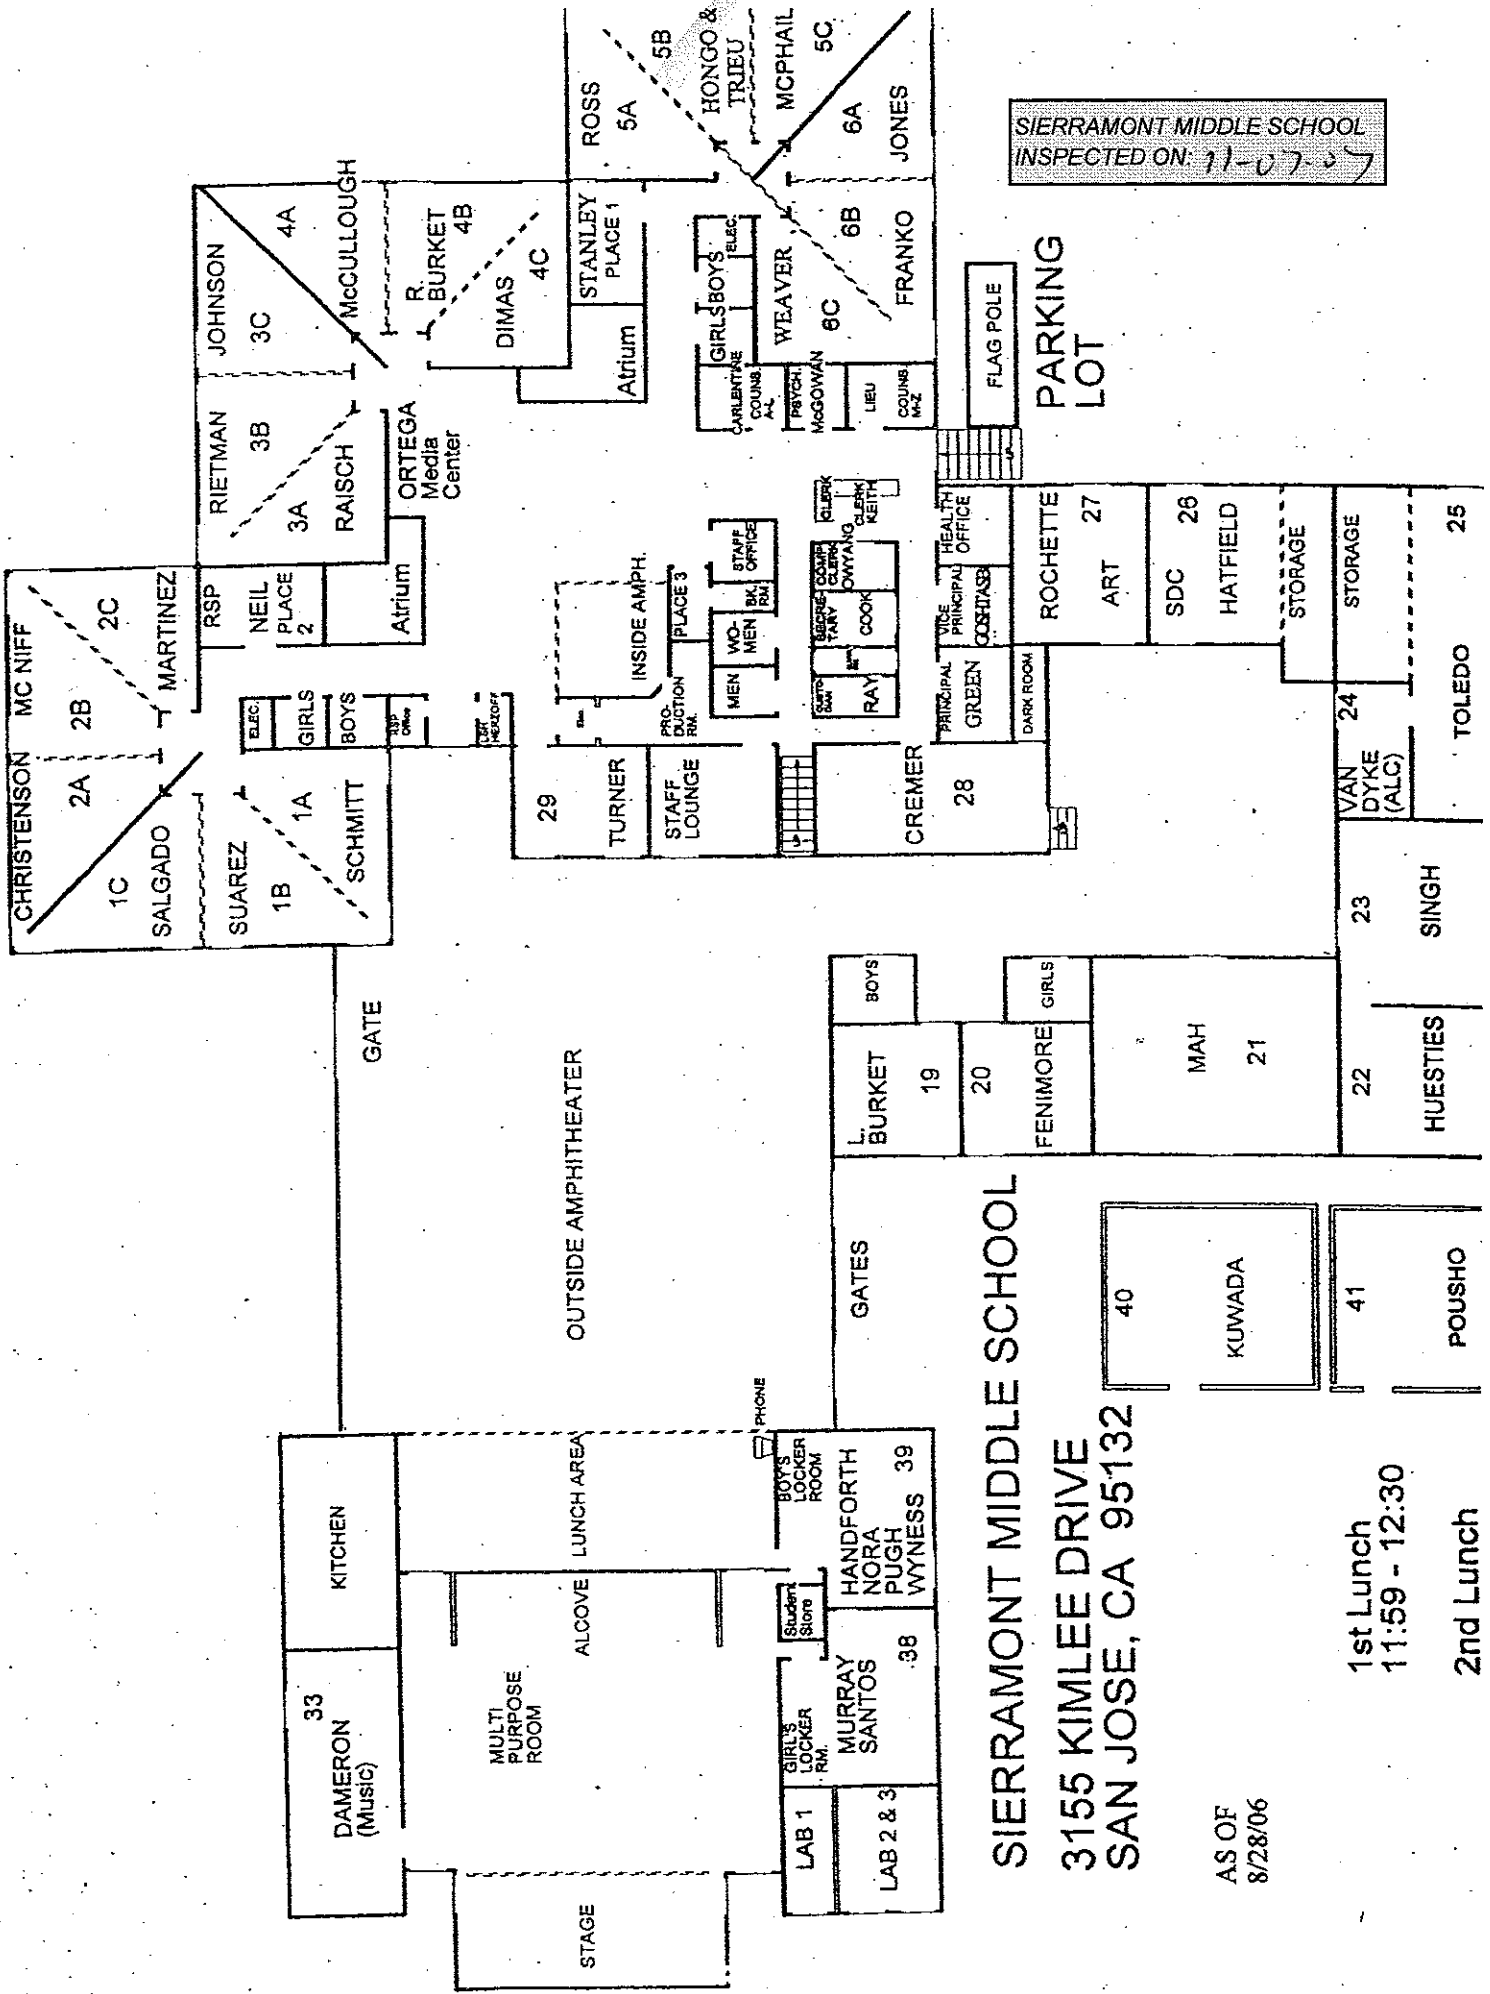


SIERRAMONT MIDDLE SCHOOL
INSPECTED ON 11-07-07

SIERRAMONT MIDDLE SCHOOL
3155 KIMLEE DRIVE
SAN JOSE, CA 95132

AS OF
8/28/06

1st Lunch
11:59 - 12:30
2nd Lunch

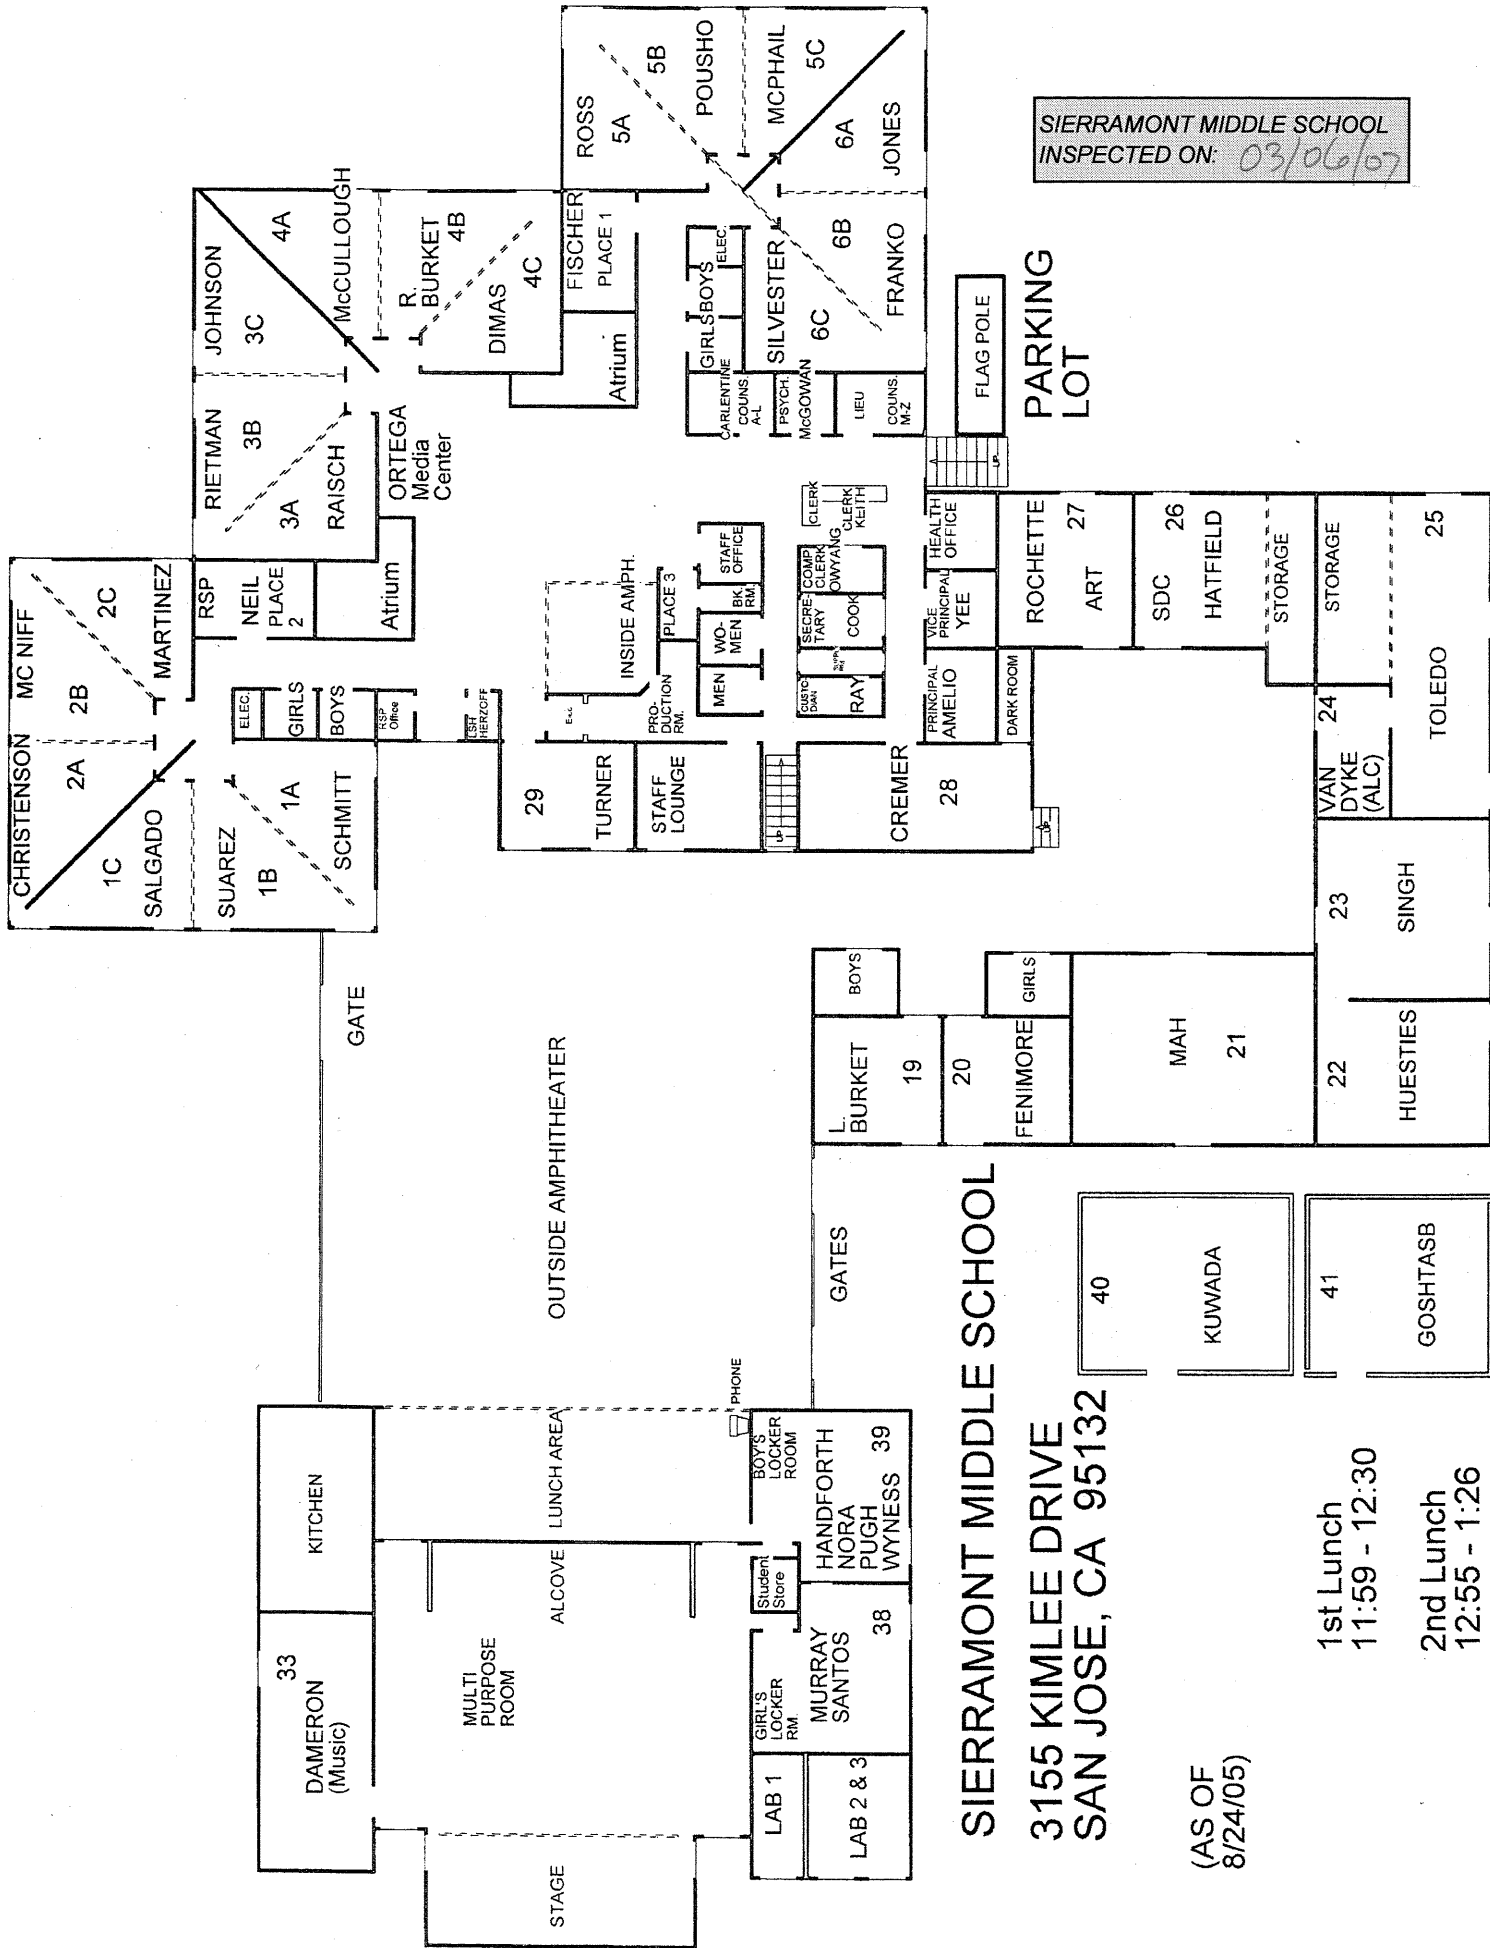

SIERRAMONT MIDDLE SCHOOL
INSPECTED ON: 03/06/07


SIERRAMONT MIDDLE SCHOOL

3155 KIMLEE DRIVE
SAN JOSE, CA 95132

(AS OF
8/24/05)

1st Lunch
11:59 - 12:30

2nd Lunch
12:55 - 1:26

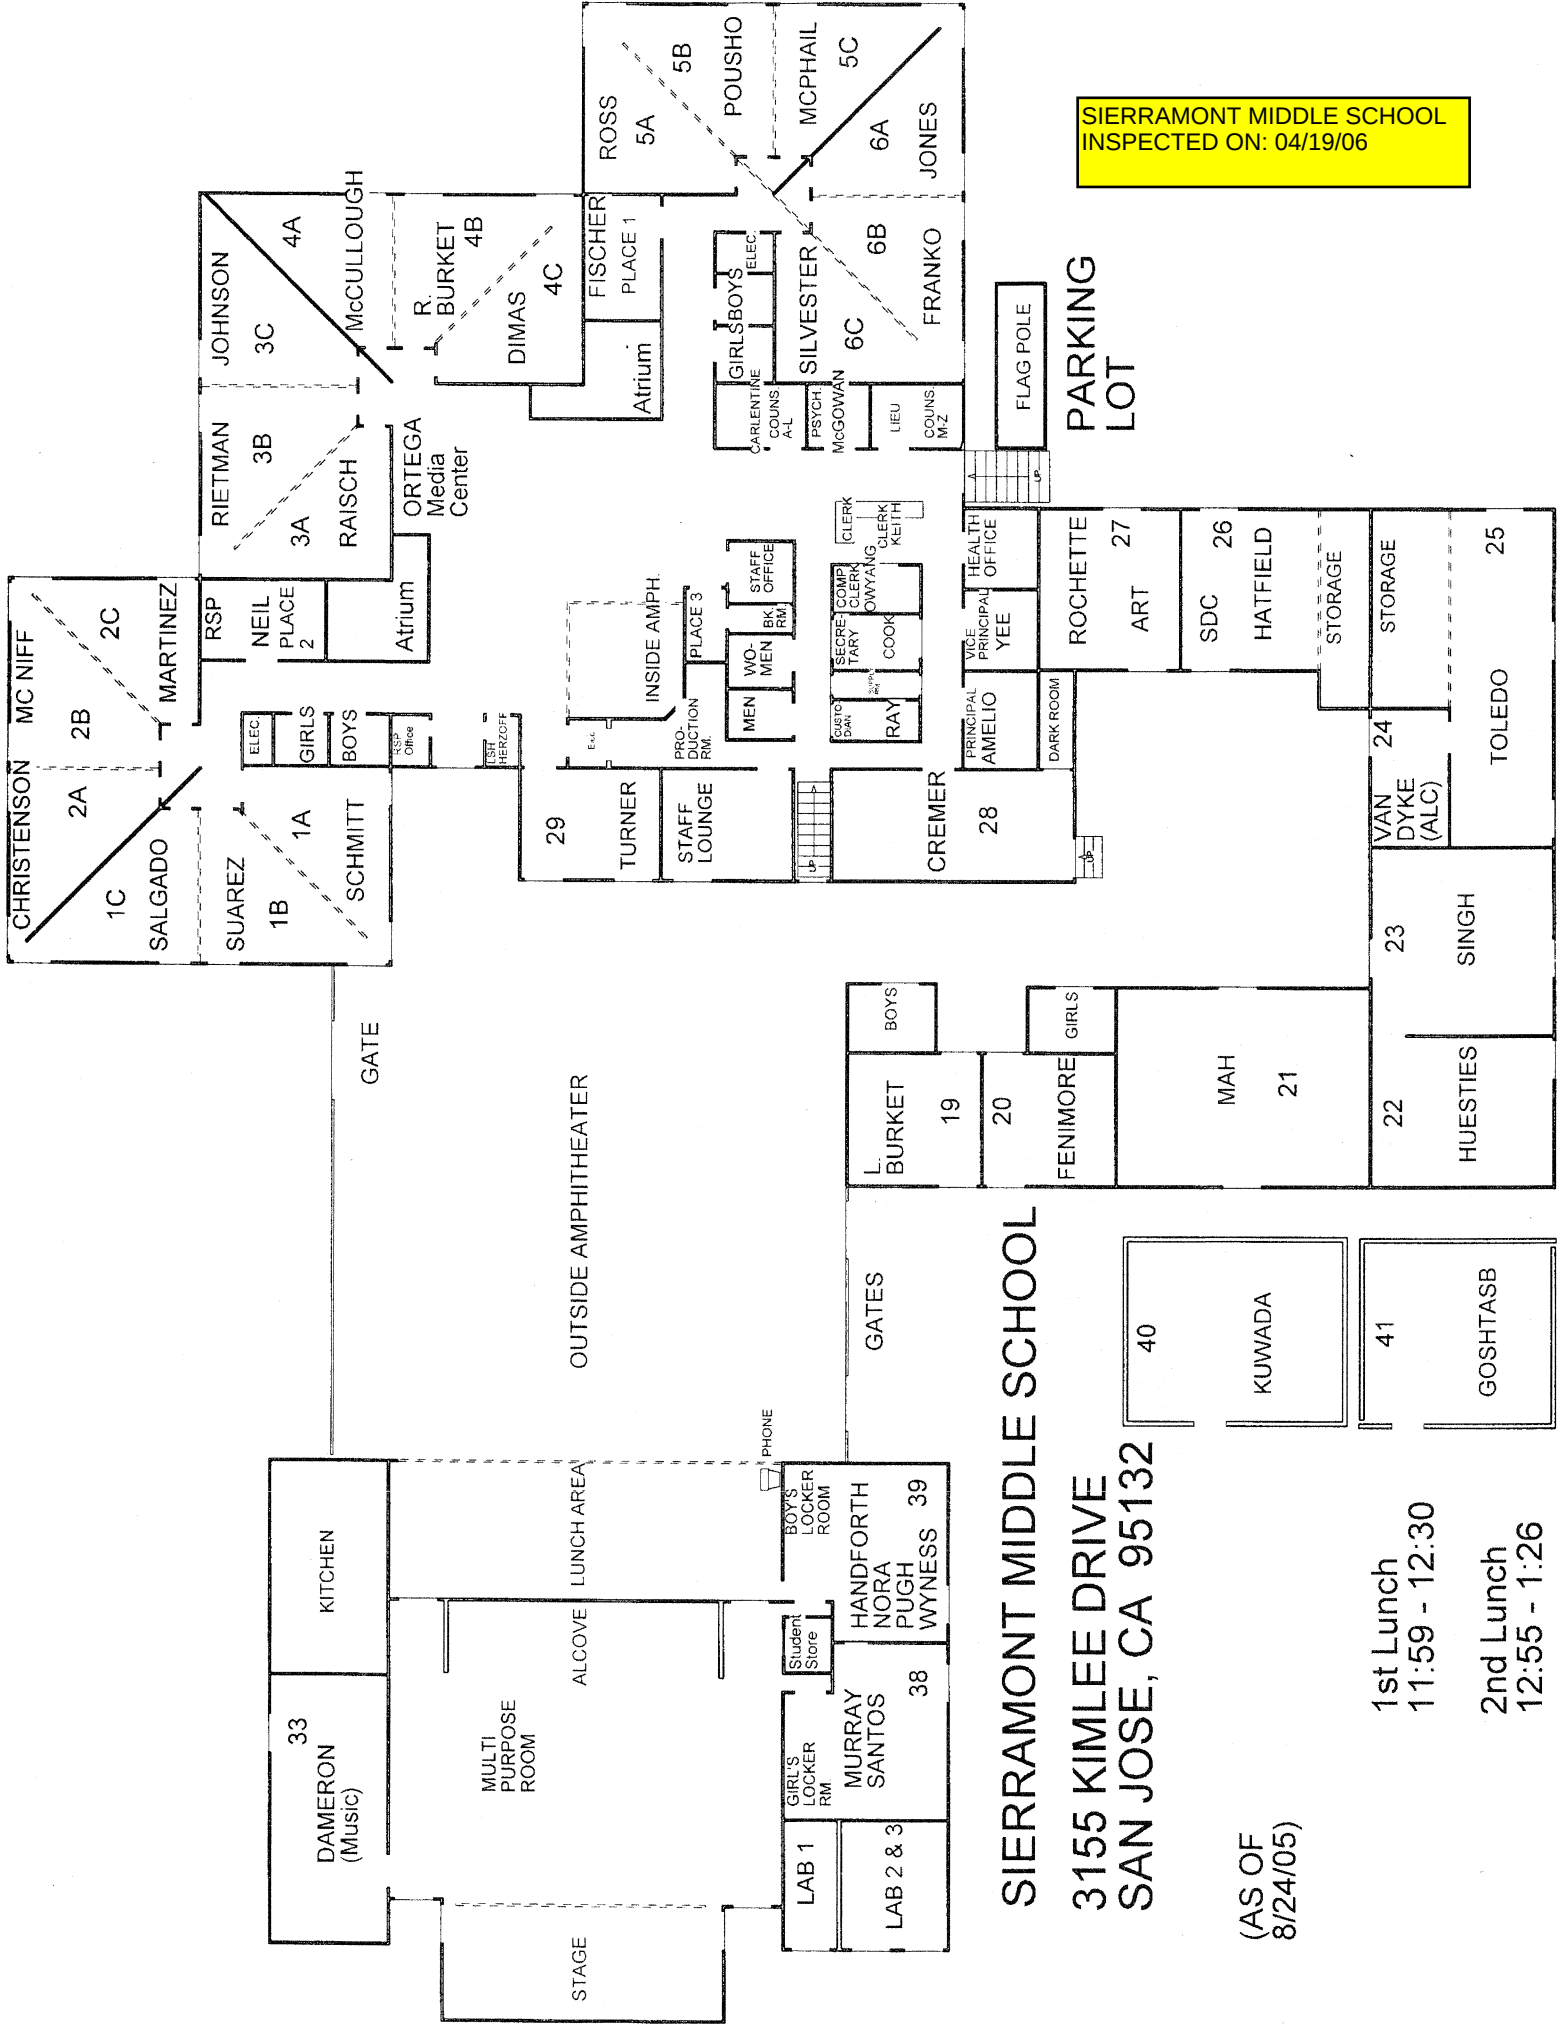

SIERRAMONT MIDDLE SCHOOL
INSPECTED ON: 04/19/06

SIERRAMONT MIDDLE SCHOOL
3155 KIMLEE DRIVE
SAN JOSE, CA 95132

(AS OF
8/24/05)

1st Lunch
11:59 - 12:30
2nd Lunch
12:55 - 1:26

