

SIX-MONTH SURVEILLANCE AHERA REPORT

**MORRILL MIDDLE SCHOOL
1970 MORRILL AVENUE
SAN JOSE, CA 95132**

**PREPARED FOR:
BERRYESSA UNION ELEMENTARY SCHOOL DISTRICT
981 RIDDER PARK DRIVE
SAN JOSE, CA 95131**

**INSPECTED ON:
SEPTEMBER 18, 2025**

HAZMAT DOC PROJECT #25-101

**PREPARED BY:
HAZMAT DOC
3080 OLCOTT STREET • SUITE D135
SANTA CLARA, CA 95054
Tel: 408.748.0055**

BERRYESSA UNION ELEMENTARY SCHOOL DISTRICT
MORRILL MIDDLE SCHOOL

INSPECTED ON:
SEPTEMBER 18, 2025

INSPECTED BY:



Leland Kafeyan
Cal/OSHA Certified Site Surveillance Technician
Certification Number 06-4110

REPORTED BY:

Maheen B. Doctor

Maheen B. Doctor
Cal/OSHA Certified Asbestos Consultant
Certification Number 95-1798

CONTENTS

PART - I

LEGEND AND GLOSSARY OF TERMS

PART – II

AHERA REPORT A – LIST OF BUILDINGS

PART – III

AHERA REPORT B – SURVEY REPORT

PART – IV

HOMOGENEOUS MATERIALS REPORT

PART – V

FRIABLE LOCATIONS REPORT

PART – VI

NON-FRIABLE LOCATIONS REPORT

PART – VII

RECOMMENDATIONS REPORT

PART – VIII

SAMPLES REPORT

PART – IX

DAMAGE REPORT

PART - X

SITE MAPS

LEGEND

THE FOLLOWING IS A LIST OF ABBREVIATIONS USED IN THIS REPORT:

Asbestos Sample Types

AC	=	ACTINOLITE
AM	=	AMOSITE
AN	=	ANTHOPHYLLITE
CH	=	CHRYSOTILE
CR	=	CROCIDOLITE
TR	=	TREMOLITE
ND	=	NONE DETECTED
NS	=	NO SAMPLE

Measurements

APPROX.	=	APPROXIMATELY
EA	=	EACH
I	=	INCHES
LF	=	LINEAR FEET
N	=	NUMBER
O.D.	=	OUTSIDE DIAMETER
SF	=	SQUARE FEET
TBD	=	TO BE DETERMINED

LIST OF BUILDINGS AT

MORRILL MIDDLE SCHOOL

BUILDING NAME BUILDING USED AS (#FLOORS) CONSTRUCTION		BUILDING AREA (APPROXIMATE)
ADMINISTRATION AND LIBRARY PODS BUILDING - "MAIN BUILDING"		
Offices, Library, Hallways, Restrooms, Custodial Room, Storage Rooms (2) Wood, Metal, Plaster, Gypsum Wallboard System		13,000 SF
CLASSROOMS A1-A12, B1-B9, C1-C11 PODS BUILDING - "MAIN BUILDING"		
Classrooms, Workrooms (1) Wood, Metal, Plaster, Gypsum Wallboard System		31,000 SF
CLASSROOMS D1-D8 BUILDING		
Classrooms, Shops (1) Wood, Metal, Plaster, Gypsum Wallboard System		12,850 SF
CLASSROOMS P1-P2 PORTABLES BUILDING		
Classrooms (1) Wood, Metal, Plaster, Gypsum Wallboard System		1,440 SF
METAL STORAGE CONTAINERS		
Storage (1) Metal		384 SF
MULTI-PURPOSE, BOYS' & GIRLS' LOCKER ROOMS, AND MUSIC ROOM BUILDING		
Gym, Multi-Purpose Room, Kitchen, Coaches Offices, Restrooms, Classrooms (1) Wood, Metal, Plaster, Gypsum Wallboard System		13,500 SF
YOUTH CENTER BUILDING		
Youth Center (1) Wood, Metal, Plaster, Gypsum Wallboard System		27,500 SF
Total Number Of Buildings : 7		(Approximate) Total Sq Ft. : 99,674
End Of Report, Total Of 1 Pages		

SURVEY REPORT FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME	
LOCATION	
MATERIAL TYPE	QTY (APPROXIMATE)
COMMENTS	

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
-------------------	-------------------------	----------------------	----------------------

ADMINISTRATION AND LIBRARY PODS BUILDING - "MAIN BUILDING"

ADMINISTRATION AND LIBRARY PODS BUILDING - "MAIN BUILDING"

09/09/2005	BUILDING NOTES:
09/09/2005	Existing Gypsum Wallboard Systems Removed and Replaced with new in-kind in Path-of-Construction. Existing Plaster Systems Removed and Replaced with new in-kind in Path-of-Construction. New Flooring Finishes per information received from the BUESD. New Suspended Ceiling Tiles installed.
03/09/2007	Building Name changed from MAIN BUILDING to ADMINISTRATION AND LIBRARY PODS BUILDING - "MAIN BUILDING".
03/09/2010	New Ceramic Wall and Floor Tiles installed in Staff Restrooms, Student Restrooms, in Health Office Restroom, and on Drinking Fountain Walls per information received from BUESD.
08/09/2018	New Flooring Finishes installed Summer 2018 per information received from the BUESD. New Suspended Ceiling Tiles installed.

ADMINISTRATION AND LIBRARY PODS BUILDING - "MAIN BUILDING"

COMPUTER CLERK ROOM

CEMENTITIOUS WALL PANEL

40 SF

09/09/2005	Cementitious Wall Panels. This Material is in GOOD condition as of this date.
10/16/2008	Damage Observed. <5% Physical Damage - in the form of One Panel with 1 hole. This Material is in FAIR condition overall. No other changes as of this date.
01/30/2020	This Material is unchanged as of this date.
08/31/2020	This Material is unchanged as of this date.
02/11/2021	This Material is unchanged as of this date.
08/12/2021	This Material is unchanged as of this date.
02/24/2022	This Material is unchanged as of this date.
08/18/2022	This Material is unchanged as of this date.
02/16/2023	This Material is unchanged as of this date.
08/17/2023	This Material is unchanged as of this date.
02/15/2024	This Material is unchanged as of this date.
08/15/2024	This Material is unchanged as of this date.

SURVEY REPORT FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/28/2025 This Material is unchanged as of this date.

09/18/2025 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

ADMINISTRATION AND LIBRARY PODS BUILDING - "MAIN BUILDING"

ENTIRE BUILDING

FIRE DOOR CORE INSULATION

735 SF

02/24/2022 Fire Door Core Insulation. (35 EA Doors). This Material is in GOOD condition as of this date35

08/18/2022 This Material is unchanged as of this date.

02/16/2023 This Material is unchanged as of this date.

08/17/2023 This Material is unchanged as of this date.

02/15/2024 This Material is unchanged as of this date.

08/15/2024 This Material is unchanged as of this date.

02/28/2025 This Material is unchanged as of this date.

09/18/2025 This Material is unchanged as of this date.

22-025AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

ADMINISTRATION AND LIBRARY PODS BUILDING - "MAIN BUILDING"

ENTIRE BUILDING

SMOOTH WALL MISCELLANEOUS

43,600 SF

09/09/2005 Gypsum Wallboard System, Walls and Ceilings. Material exists above Suspended Ceiling Tile. Existing Gypsum Wallboard Systems Removed and Replaced with new in-kind in Path-of-Construction. This Material is in GOOD condition as of this date.

08/09/2017 Sample Collected 17-172-A02, Area A, Boy's Restroom A112, Drywall Board. Sample Collected 17-172-B03, Area B, Mezzanine Level, Electrical Room, Drywall Board. Sample Collected 17-172-B05-Joint Tape, Area B, Mezzanine, Level Roof Access, Joint Tape and Mud for Drywall Board System. Sample Collected 17-172-B05-Mud, Area B, Mezzanine, Level Roof Access, Joint Tape and Mud for Drywall Board System. Sample Collected 17-172-B06, Area B, Mezzanine Level, Electrical Room, Drywall Board. Sample Collected 17-172-B23-Mud, Area B, Storage Room B125, Joint Tape and Mud for Drywall Board. Sample Collected 17-172-B24, Area B, Storage Room B125, Drywall Board.

08/30/2017 <5% Physical Damage Observed. Corner of the Wall in the Custodial Office has 2 SF of Physical Damage. No other Damages as of this date.

SURVEY REPORT FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
01/30/2020	This Material is unchanged as of this date.		
08/31/2020	This Material is unchanged as of this date.		
02/11/2021	This Material is unchanged as of this date.		
08/12/2021	This Material is unchanged as of this date.		
02/24/2022	This Material is unchanged as of this date.		
08/18/2022	This Material is unchanged as of this date.		
02/16/2023	This Material is unchanged as of this date.		
08/17/2023	This Material is unchanged as of this date.		
02/15/2024	This Material is unchanged as of this date.		
08/15/2024	This Material is unchanged as of this date.		
02/28/2025	This Material is unchanged as of this date.		
09/18/2025	This Material is unchanged as of this date.		

17-172-A02	ND	NONE DETECTED	(ND)
17-172-B03	ND	NONE DETECTED	(ND)
17-172-B05-Joint	ND	NONE DETECTED	(ND)
17-172-B05-Mud	ND	NONE DETECTED	(ND)
17-172-B06	ND	NONE DETECTED	(ND)
17-172-B23-Mud	2	CHRYSTILE	(CH)
17-172-B24	ND	NONE DETECTED	(ND)

ADMINISTRATION AND LIBRARY PODS BUILDING - "MAIN BUILDING"

ENTIRE BUILDING

SMOOTH WALL SURFACING

43,600 SF

09/09/2005 Skim Coat for Gypsum Wallboard System, Walls and Ceilings. Material exists above Suspended Ceiling Tile. Existing Gypsum Wallboard Systems Removed and Replaced with new in-kind in Path-of-Construction. This Material is in GOOD condition as of this date.

SURVEY REPORT FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

COMMENTS

QTY (APPROXIMATE)

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
08/09/2017	Sample Collected 17-172-A01-Skim Coat, Area A, Boy's Restroom A112, Skim Coat and Joint Mud for Drywall Board. Sample Collected 17-172-B01, Area B, Mezzanine, Level Electrical Room, Skim Coat Paint for Drywall Board System. Sample Collected 17-172-B02-Joint Tape, Area B, Mezzanine, Level Electrical Room, Joint Tape for Drywall Board System. Sample Collected 17-172-B02-Mud, Area B, Mezzanine, Level Electrical Room, Mud for Drywall Board System. Sample Collected 17-172-B04, Area B, Mezzanine, Level Roof Access, Skim Coat Paint for Drywall Board System. Sample Collected 17-172-B22, Area B, Storage Room B125, Skim Coat Paint for Drywall Board System.		
08/30/2017	<5% Physical Damage Observed. Corner of the Wall in the Custodial Office has 2 SF of Physical Damage. No other Damages as of this date.		
01/30/2020	This Material is unchanged as of this date.		
08/31/2020	This Material is unchanged as of this date.		
02/11/2021	This Material is unchanged as of this date.		
08/12/2021	This Material is unchanged as of this date.		
02/24/2022	This Material is unchanged as of this date.		
08/18/2022	This Material is unchanged as of this date.		
02/16/2023	This Material is unchanged as of this date.		
08/17/2023	This Material is unchanged as of this date.		
02/15/2024	This Material is unchanged as of this date.		
08/15/2024	This Material is unchanged as of this date.		
02/28/2025	This Material is unchanged as of this date.		
09/18/2025	This Material is unchanged as of this date.		

17-172-A01-Skim	ND	NONE DETECTED	(ND)
17-172-B01	ND	NONE DETECTED	(ND)
17-172-B02-Joint	ND	NONE DETECTED	(ND)
17-172-B02-Mud	2	CHRYBOTILE	(CH)
17-172-B04	ND	NONE DETECTED	(ND)
17-172-B22	2	CHRYBOTILE	(CH)

SURVEY REPORT FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME	
LOCATION	
MATERIAL TYPE	QTY (APPROXIMATE)
COMMENTS	

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

ADMINISTRATION AND LIBRARY PODS BUILDING - "MAIN BUILDING"

EXTERIOR RESTROOM WALLS (STUDENT RESTROOMS)

FELT/PAPER LINER

350 SF

05/12/2009	Paper Material under Stucco on Exterior Walls. This Material is in GOOD condition as of this date.
01/30/2020	This Material is unchanged as of this date.
08/31/2020	This Material is unchanged as of this date.
02/11/2021	This Material is unchanged as of this date.
08/12/2021	This Material is unchanged as of this date.
02/24/2022	This Material is unchanged as of this date.
08/18/2022	This Material is unchanged as of this date.
02/16/2023	This Material is unchanged as of this date.
08/17/2023	This Material is unchanged as of this date.
02/15/2024	This Material is unchanged as of this date.
08/15/2024	This Material is unchanged as of this date.
02/28/2025	This Material is unchanged as of this date.
09/18/2025	This Material is unchanged as of this date.

09-098AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

ADMINISTRATION AND LIBRARY PODS BUILDING - "MAIN BUILDING"

EXTERIOR RESTROOM WALLS (STUDENT RESTROOMS)

ROUGH WALL

350 SF

05/12/2009	Stucco on Exterior Walls. This Material is in GOOD condition as of this date.
01/30/2020	This Material is unchanged as of this date.
08/31/2020	This Material is unchanged as of this date.
02/11/2021	This Material is unchanged as of this date.
08/12/2021	This Material is unchanged as of this date.
02/24/2022	This Material is unchanged as of this date.

SF= Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

08/18/2022 This Material is unchanged as of this date.

02/16/2023 This Material is unchanged as of this date.

08/17/2023 This Material is unchanged as of this date.

02/15/2024 This Material is unchanged as of this date.

08/15/2024 This Material is unchanged as of this date.

02/28/2025 This Material is unchanged as of this date.

09/18/2025 This Material is unchanged as of this date.

09-098AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

ADMINISTRATION AND LIBRARY PODS BUILDING - "MAIN BUILDING"

EXTERIOR RESTROOM WALLS (STUDENT RESTROOMS)

ROUGH WALL SURFACING

350 SF

05/12/2009 Skim Coat for Stucco on Exterior Walls. This Material is in GOOD condition as of this date.

08/09/2017 Sample Collected 17-172-A01-Skim Coat, Area A, Boy's Restroom A112, Skim Coat and Joint Mud for Drywall Board.

01/30/2020 This Material is unchanged as of this date.

08/31/2020 This Material is unchanged as of this date.

02/11/2021 This Material is unchanged as of this date.

08/12/2021 This Material is unchanged as of this date.

02/24/2022 This Material is unchanged as of this date.

08/18/2022 This Material is unchanged as of this date.

02/16/2023 This Material is unchanged as of this date.

08/17/2023 This Material is unchanged as of this date.

02/15/2024 This Material is unchanged as of this date.

08/15/2024 This Material is unchanged as of this date.

02/28/2025 This Material is unchanged as of this date.

09/18/2025 This Material is unchanged as of this date.

SURVEY REPORT FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
09-098AAA	ASSUMED	NO SAMPLE	(NS)
17-172-A01-Skim	ND	NONE DETECTED	(ND)

ADMINISTRATION AND LIBRARY PODS BUILDING - "MAIN BUILDING"

EXTERIOR WALKWAYS AND OVERHANGS

FELT/PAPER LINER

2,500 SF

05/12/2009	Paper Material under Stucco on Exterior Walkways and Overhangs. This Material is in GOOD condition as of this date.
01/30/2020	This Material is unchanged as of this date.
08/31/2020	This Material is unchanged as of this date.
02/11/2021	This Material is unchanged as of this date.
08/12/2021	This Material is unchanged as of this date.
02/24/2022	This Material is unchanged as of this date.
08/18/2022	This Material is unchanged as of this date.
02/16/2023	This Material is unchanged as of this date.
08/17/2023	This Material is unchanged as of this date.
02/15/2024	This Material is unchanged as of this date.
08/15/2024	This Material is unchanged as of this date.
02/28/2025	This Material is unchanged as of this date.
09/18/2025	This Material is unchanged as of this date.

09-098AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

ADMINISTRATION AND LIBRARY PODS BUILDING - "MAIN BUILDING"

EXTERIOR WALKWAYS AND OVERHANGS

ROUGH WALL

2,500 SF

05/12/2009	Stucco on Exterior Walkways and Overhangs. This Material is in GOOD condition as of this date.
01/30/2020	This Material is unchanged as of this date.
08/31/2020	This Material is unchanged as of this date.

SURVEY REPORT FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/11/2021 This Material is unchanged as of this date.

08/12/2021 This Material is unchanged as of this date.

02/24/2022 This Material is unchanged as of this date.

08/18/2022 This Material is unchanged as of this date.

02/16/2023 This Material is unchanged as of this date.

08/17/2023 This Material is unchanged as of this date.

02/15/2024 This Material is unchanged as of this date.

08/15/2024 This Material is unchanged as of this date.

02/28/2025 This Material is unchanged as of this date.

09/18/2025 This Material is unchanged as of this date.

09-098AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

ADMINISTRATION AND LIBRARY PODS BUILDING - "MAIN BUILDING"

EXTERIOR WALKWAYS AND OVERHANGS

ROUGH WALL SURFACING

2,500 SF

05/12/2009 Skim Coat for Stucco on Exterior Walkways and Overhangs. This Material is in GOOD condition as of this date.

01/30/2020 This Material is unchanged as of this date.

08/31/2020 This Material is unchanged as of this date.

02/11/2021 This Material is unchanged as of this date.

08/12/2021 This Material is unchanged as of this date.

02/24/2022 This Material is unchanged as of this date.

08/18/2022 This Material is unchanged as of this date.

02/16/2023 This Material is unchanged as of this date.

08/17/2023 This Material is unchanged as of this date.

02/15/2024 This Material is unchanged as of this date.

08/15/2024 This Material is unchanged as of this date.

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/28/2025 This Material is unchanged as of this date.

09/18/2025 This Material is unchanged as of this date.

09-098AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

ADMINISTRATION AND LIBRARY PODS BUILDING - "MAIN BUILDING"

EXTERIOR WINDOWS

WINDOW SEALANT

800 LF

10/16/2008 Sealant/Caulking on Exterior side of Exterior Windows. This Material is in GOOD condition as of this date.

01/30/2020 This Material is unchanged as of this date.

08/31/2020 This Material is unchanged as of this date.

02/11/2021 This Material is unchanged as of this date.

08/12/2021 This Material is unchanged as of this date.

02/24/2022 This Material is unchanged as of this date.

08/18/2022 This Material is unchanged as of this date.

02/16/2023 This Material is unchanged as of this date.

08/17/2023 This Material is unchanged as of this date.

02/15/2024 This Material is unchanged as of this date.

08/15/2024 This Material is unchanged as of this date.

02/28/2025 This Material is unchanged as of this date.

09/18/2025 This Material is unchanged as of this date.

08-241AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

SURVEY REPORT FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

ADMINISTRATION AND LIBRARY PODS BUILDING - "MAIN BUILDING"

EXTERIOR WINDOWS

WINDOW SEALANT

800 LF

08/09/2017	Putty/Sealant on Interior side of Exterior Windows. Sample Collected 17-172-A11, Area A, Office A101, (North) Window Sealant. Sample Collected 17-172-A12, Area A, Office A105 (West), Window Sealant. Sample Collected 17-172-B43, Area B, Library B120 (East Entryway), Window Sealant. Sample Collected 17-172-B44, Area B, Library B120 (North Entryway), Window Sealant. Sample Collected 17-172-B45, Area B, Office B121A, Window Sealant. Sample Collected 17-172-B46, Area B, Production Room, Window Sealant.
01/30/2020	This Material is unchanged as of this date.
08/31/2020	This Material is unchanged as of this date.
02/11/2021	This Material is unchanged as of this date.
08/12/2021	This Material is unchanged as of this date.
02/24/2022	This Material is unchanged as of this date.
08/18/2022	This Material is unchanged as of this date.
02/16/2023	This Material is unchanged as of this date.
08/17/2023	This Material is unchanged as of this date.
02/15/2024	This Material is unchanged as of this date.
08/15/2024	This Material is unchanged as of this date.
02/28/2025	This Material is unchanged as of this date.
09/18/2025	This Material is unchanged as of this date.

17-172-A11	ND	NONE DETECTED	(ND)
17-172-A12	ND	NONE DETECTED	(ND)
17-172-B43	ND	NONE DETECTED	(ND)
17-172-B44	ND	NONE DETECTED	(ND)
17-172-B45	ND	NONE DETECTED	(ND)
17-172-B46	ND	NONE DETECTED	(ND)

SURVEY REPORT FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

ADMINISTRATION AND LIBRARY PODS BUILDING - "MAIN BUILDING"

FOUR OFFICES, STORAGE ROOM OF LIBRARY, AND LIBRARY

PRESSED WOOD WALL PANEL

2,700 SF

03/09/2007	4'x8' Pressed Wood Wall Panel, (with Vinyl Wall Cover). This Material is in GOOD condition as of this date.		
08/07/2017	Sample Collected 17-172-B28, Area B, Storage B120B, Paint Texture on Wood Demising Walls.		
01/30/2020	This Material is unchanged as of this date.		
08/31/2020	This Material is unchanged as of this date.		
02/11/2021	This Material is unchanged as of this date.		
08/12/2021	This Material is unchanged as of this date.		
02/24/2022	This Material is unchanged as of this date.		
08/18/2022	This Material is unchanged as of this date.		
02/16/2023	This Material is unchanged as of this date.		
08/17/2023	This Material is unchanged as of this date.		
02/15/2024	This Material is unchanged as of this date.		
08/15/2024	This Material is unchanged as of this date.		
02/28/2025	This Material is unchanged as of this date.		
09/18/2025	This Material is unchanged as of this date.		

17-172-B28	ND	NONE DETECTED	(ND)
07-041AAA	ASSUMED	NO SAMPLE	(NS)

ADMINISTRATION AND LIBRARY PODS BUILDING - "MAIN BUILDING"

FOUR OFFICES, STORAGE ROOM OF LIBRARY, AND LIBRARY

PRESSED WOOD WALL PANEL MASTIC

2,700 SF

03/09/2007	Mastic/Adhesive for 4'x8' Pressed Wood Wall Panel, (with Vinyl Wall Cover). This Material is in GOOD condition as of this date.		
01/30/2020	This Material is unchanged as of this date.		
08/31/2020	This Material is unchanged as of this date.		
02/11/2021	This Material is unchanged as of this date.		

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
08/12/2021	This Material is unchanged as of this date.		
02/24/2022	This Material is unchanged as of this date.		
08/18/2022	This Material is unchanged as of this date.		
02/16/2023	This Material is unchanged as of this date.		
08/17/2023	This Material is unchanged as of this date.		
02/15/2024	This Material is unchanged as of this date.		
08/15/2024	This Material is unchanged as of this date.		
02/28/2025	This Material is unchanged as of this date.		
09/18/2025	This Material is unchanged as of this date.		
70-041AAA	ASSUMED	NO SAMPLE	(NS)

ADMINISTRATION AND LIBRARY PODS BUILDING - "MAIN BUILDING"

FOUR OFFICES, STORAGE ROOM OF LIBRARY, AND LIBRARY

VINYL WALL COVER MASTIC

2,700 SF

09/09/2005	Mastic/Adhesive for Vinyl Wall Cover, (on 4'x10' Pressed Wood Wall Panel). This Material is in GOOD condition as of this date.		
08/07/2017	Sample Collected 17-172-B26, Area B, Library B120, Adhesive for Vinyl Wall Cover.		
01/30/2020	This Material is unchanged as of this date.		
08/31/2020	This Material is unchanged as of this date.		
02/11/2021	Damage Observed. <5% Physical Damage in the form of 2 SF of Vinyl Wall Cover Peeling and becoming Loose on West end of Library. Material condition changed from GOOD to FAIR overall. Friability updated from Non-Friable to Friable. No other changes as of this date.		
08/12/2021	This Material is unchanged as of this date.		
02/24/2022	This Material is unchanged as of this date.		
08/18/2022	This Material is unchanged as of this date.		
02/16/2023	This Material is unchanged as of this date.		
08/17/2023	This Material is unchanged as of this date.		

SURVEY REPORT FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/15/2024 This Material is unchanged as of this date.

08/15/2024 This Material is unchanged as of this date.

02/28/2025 This Material is unchanged as of this date.

09/18/2025 This Material is unchanged as of this date.

17-172-B26	ND	NONE DETECTED	(ND)
05-212AAA	ASSUMED	NO SAMPLE	(NS)

ADMINISTRATION AND LIBRARY PODS BUILDING - "MAIN BUILDING"

HEALTH OFFICE, 2ND FLOOR STAFF'S LOUNGE ROOM, WORK ROOM, AND ADMINISTRATIVE ASSISTANT AREA

SINK UNDERCOATING

15 SF

05/12/2009 Thermal Undercoating on Sink (3 EA Sinks). (Black in Health Office, and Grey in Work Room, Staff Lounge, and Administrative Assistant Area.) This Material is in GOOD condition as of this date.

01/30/2020 This Material is unchanged as of this date.

08/31/2020 This Material is unchanged as of this date.

02/11/2021 This Material is unchanged as of this date.

08/12/2021 This Material is unchanged as of this date.

02/24/2022 This Material is unchanged as of this date.

08/18/2022 This Material is unchanged as of this date.

02/16/2023 This Material is unchanged as of this date.

08/17/2023 This Material is unchanged as of this date.

02/15/2024 This Material is unchanged as of this date.

08/15/2024 This Material is unchanged as of this date.

02/28/2025 This Material is unchanged as of this date.

09/18/2025 This Material is unchanged as of this date.

09-098AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

SURVEY REPORT FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

ADMINISTRATION AND LIBRARY PODS BUILDING - "MAIN BUILDING"

LIBRARY, OFFICE OF LIBRARY, WORK ROOM, TEMP OFFICE, STORAGE ROOM, AND CORRIDOR BETWEEN ADMINISTRATION OFFICES AND LIBRARY

SPRAY ON CEILING

8,400 SF

09/09/2005	Spray-on Ceiling Texture. This Material is in GOOD condition as of this date.
03/09/2007	Damage Observed. <5% Physical Damage - in the form of minor flaking condition observed in Main Corridor of Library and Main Office, and above Counselor's Office, in Book Storage Room, next to I-Beam above Work Room. This Material is in FAIR condition overall. No other changes as of this date.
03/09/2010	Location Description changed from LIBRARY, OFFICE OF LIBRARY, WORK ROOM, TEMP OFFICE, AND ONE STORAGE ROOM to LIBRARY, OFFICE OF LIBRARY, WORK ROOM, TEMP OFFICE, STORAGE ROOM, AND CORRIDOR BETWEEN ADMINISTRATION OFFICES AND LIBRARY. Quantity changed from 6,400 SF to 8,400 SF. No other changes as of this date.
01/30/2020	This Material is unchanged as of this date.
08/31/2020	This Material is unchanged as of this date.
02/11/2021	This Material is unchanged as of this date.
08/12/2021	This Material is unchanged as of this date.
02/24/2022	This Material is unchanged as of this date.
08/18/2022	This Material is unchanged as of this date.
02/16/2023	This Material is unchanged as of this date.
08/17/2023	This Material is unchanged as of this date.
02/15/2024	This Material is unchanged as of this date.
08/15/2024	This Material is unchanged as of this date.
02/28/2025	This Material is unchanged as of this date.
09/18/2025	This Material is unchanged as of this date.

05-212AAA

ASSUMED

NO SAMPLE

(NS)

SURVEY REPORT FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

ADMINISTRATION AND LIBRARY PODS BUILDING - "MAIN BUILDING"

LIBRARY STORAGE ROOM

DUCT INSULATION

TBD

03/09/2007	Duct Wrap Tape on Joints. Sample Collected 17-172-B29-Tape, Area B, Storage B120B, Sub Ceiling (Soffit) Tape Materials on Fiberglass Duct Insulation. Sample Collected 17-172-B29-Insulation, Area B, Storage B120B, Sub Ceiling (Soffit) Tape Materials on Fiberglass Duct Insulation.
01/30/2020	This Material is unchanged as of this date.
08/31/2020	This Material is unchanged as of this date.
02/11/2021	This Material is unchanged as of this date.
08/12/2021	This Material is unchanged as of this date.
02/24/2022	This Material is unchanged as of this date.
08/18/2022	This Material is unchanged as of this date.
02/16/2023	This Material is unchanged as of this date.
08/17/2023	This Material is unchanged as of this date.
02/15/2024	This Material is unchanged as of this date.
08/15/2024	This Material is unchanged as of this date.
02/28/2025	This Material is unchanged as of this date.
09/18/2025	This Material is unchanged as of this date.

17-172-B29-Tape	3	CHRYSTILE	(CH)
17-172-B29-Insulation	ND	NONE DETECTED	(ND)

ADMINISTRATION AND LIBRARY PODS BUILDING - "MAIN BUILDING"

SECOND FLOOR STAFF LOUNGE ROOM PLENUM

SMOOTH WALL MISCELLANEOUS

2,500 SF

08/25/2006	Gypsum Wallboard System Ceiling, (with exposed Joint Tape and Mud, above the 2'x4' Suspended Ceiling Tile). This Material is in GOOD condition as of this date.
08/09/2017	Sample Collected 17-172-B19, Area B, Production Room B123, Acoustical Ceiling Texture. Sample Collected 17-172-B20, Area B, Production Room B123, Acoustical Ceiling Texture. Sample Collected 17-172-B21, Area B, Storage Room B125, Acoustical Ceiling Texture.
01/30/2020	This Material is unchanged as of this date.

SURVEY REPORT FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
08/31/2020	This Material is unchanged as of this date.		
02/11/2021	This Material is unchanged as of this date.		
08/12/2021	This Material is unchanged as of this date.		
02/24/2022	This Material is unchanged as of this date.		
08/18/2022	This Material is unchanged as of this date.		
02/16/2023	This Material is unchanged as of this date.		
08/17/2023	This Material is unchanged as of this date.		
02/15/2024	This Material is unchanged as of this date.		
08/15/2024	This Material is unchanged as of this date.		
02/28/2025	This Material is unchanged as of this date.		
09/18/2025	This Material is unchanged as of this date.		
17-172-B19	ND	NONE DETECTED	(ND)
17-172-B20	ND	NONE DETECTED	(ND)
17-172-B21	ND	NONE DETECTED	(ND)

SURVEY REPORT FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

CLASSROOMS A1-A12, B1-B9, C1-C11 PODS BUILDING - "MAIN BUILDING"

CLASSROOMS A1-A12, B1-B9, C1-C11 PODS BUILDING - "MAIN BUILDING"

09/09/2005	BUILDING NOTES:
09/09/2005	Existing Gypsum Wallboard Systems Removed and Replaced with new in-kind in Path-of-Construction. Existing Plaster Systems Removed and Replaced with new in-kind in Path-of-Construction. New Flooring Finishes per information received from the BUESD. New Suspended Ceiling Tiles installed.
03/09/2007	Building Name changed from PODS A, B, AND C to CLASSROOMS A1-12, B1-B9, C1-C11 PODS BUILDING - "MAIN BUILDING".
08/09/2018	New Flooring Finishes installed Summer 2018 per information received from the BUESD. New Suspended Ceiling Tiles installed.

CLASSROOMS A1-A12, B1-B9, C1-C11 PODS BUILDING - "MAIN BUILDING"

ALL ROOMS

SMOOTH WALL SURFACING

12,000 SF

09/08/2009	Skim Coat for Gypsum Wallboard System Walls (only on Interior Walls). Existing Gypsum Wallboard Systems Removed and Replaced with new in-kind in Path-of-Construction. This Material is in GOOD condition as of this date.
08/09/2018	Wall Between Classrooms C2 and C3 is New Material. No other changes as of this date.
01/30/2020	This Material is unchanged as of this date.
08/31/2020	This Material is unchanged as of this date.
02/11/2021	This Material is unchanged as of this date.
08/12/2021	This Material is unchanged as of this date.
02/24/2022	This Material is unchanged as of this date.
08/18/2022	This Material is unchanged as of this date.
08/17/2023	This Material is unchanged as of this date.
02/15/2024	This Material is unchanged as of this date.
08/15/2024	This Material is unchanged as of this date.
02/28/2025	This Material is unchanged as of this date.
09/18/2025	This Material is unchanged as of this date.

SF= Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

17

HazMat Doc

AHERA Report B - Survey

SURVEY REPORT FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
09-212AAA	ASSUMED	NO SAMPLE	(NS)

CLASSROOMS A1-A12, B1-B9, C1-C11 PODS BUILDING - "MAIN BUILDING"

ALL ROOMS, INCLUDING UPPER WALLS AND CEILING IN THE PLENUM (NO SKIM COAT)

SMOOTH WALL MISCELLANEOUS

41,410 SF

09/09/2005	Gypsum Wallboard System, Walls and Ceiling, (including Plenums, and Ceilings only in Storage Rooms). Existing Gypsum Wallboard Systems Removed and Replaced with new in-kind in Path-of-Construction. This Material is in GOOD condition as of this date.
09/08/2009	Location Description changed from ALL ROOMS to ALL ROOMS, INCLUDING UPPER WALLS AND CEILING IN THE PLENUM (NO SKIM COAT). Quantity changed from 31,410 SF to 41,410 SF. No other changes as of this date.
01/30/2020	This Material is unchanged as of this date.
08/31/2020	This Material is unchanged as of this date.
02/11/2021	This Material is unchanged as of this date.
08/12/2021	This Material is unchanged as of this date.
02/24/2022	This Material is unchanged as of this date.
08/18/2022	This Material is unchanged as of this date.
02/16/2023	This Material is unchanged as of this date.
08/17/2023	This Material is unchanged as of this date.
02/15/2024	This Material is unchanged as of this date.
08/15/2024	This Material is unchanged as of this date.
02/28/2025	This Material is unchanged as of this date.
09/18/2025	This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS A1-A12, B1-B9, C1-C11 PODS BUILDING - "MAIN BUILDING"

CLASSROOM C-6

CEMENTITIOUS WALL PANEL

68 SF

05/12/2009	Green Cementitious Chalkboard, framed not glued. (1 EA). This Material is in GOOD condition as of this date.
------------	--

SURVEY REPORT FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
01/30/2020	This Material is unchanged as of this date.		
08/31/2020	This Material is unchanged as of this date.		
02/11/2021	This Material is unchanged as of this date.		
08/12/2021	This Material is unchanged as of this date.		
02/24/2022	This Material is unchanged as of this date.		
08/18/2022	This Material is unchanged as of this date.		
02/16/2023	This Material is unchanged as of this date.		
08/17/2023	This Material is unchanged as of this date.		
02/15/2024	This Material is unchanged as of this date.		
08/15/2024	This Material is unchanged as of this date.		
02/28/2025	This Material is unchanged as of this date.		
09/18/2025	This Material is unchanged as of this date.		
09-098AAA	ASSUMED	NO SAMPLE	(NS)

CLASSROOMS A1-A12, B1-B9, C1-C11 PODS BUILDING - "MAIN BUILDING"

CLASSROOMS A4, A9, A11, B1, B5, B7, C3, C6 AND C9

WINDOW SEALANT

TBD

08/09/2017	Putty/Sealant on Interior side of Exterior Windows. Sample Collected 17-172-A28, Area A, Classroom A4, Window Glazing Sealant. Sample Collected 17-172-A29, Area A, Classroom A9, Window Glazing Sealant. Sample Collected 17-172-A30, Area A, Classroom A1, Window Glazing Sealant. Sample Collected 17-172-B47, Area B, Classroom B1, Window Glazing Sealant. Sample Collected 17-172-B48, Area B, Classroom B5, Window Glazing Sealant. Sample Collected 17-172-B49, Area B, Classroom B7, Window Glazing Sealant. Sample Collected 17-172-C15, Area C, Classroom C3, Window Glazing Sealant. Sample Collected 17-172-C16, Area C, Classroom C6, Window Glazing Sealant. Sample Collected 17-172-C17, Area C, Classroom C9, Window Glazing Sealant.		
01/30/2020	This Material is unchanged as of this date.		
08/31/2020	This Material is unchanged as of this date.		
02/11/2021	This Material is unchanged as of this date.		
08/12/2021	This Material is unchanged as of this date.		
02/24/2022	This Material is unchanged as of this date.		

SURVEY REPORT FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

08/18/2022 This Material is unchanged as of this date.

02/16/2023 This Material is unchanged as of this date.

08/17/2023 This Material is unchanged as of this date.

02/15/2024 This Material is unchanged as of this date.

08/15/2024 This Material is unchanged as of this date.

02/28/2025 This Material is unchanged as of this date.

09/18/2025 This Material is unchanged as of this date.

17-172-A28	ND	NONE DETECTED	(ND)
17-172-A29	ND	NONE DETECTED	(ND)
17-172-A30	ND	NONE DETECTED	(ND)
17-172-B47	ND	NONE DETECTED	(ND)
17-172-B48	ND	NONE DETECTED	(ND)
17-172-B49	ND	NONE DETECTED	(ND)
17-172-C15	ND	NONE DETECTED	(ND)
17-172-C16	ND	NONE DETECTED	(ND)
17-172-C17	ND	NONE DETECTED	(ND)

CLASSROOMS A1-A12, B1-B9, C1-C11 PODS BUILDING - "MAIN BUILDING"

EXTERIOR OVERHANGS

FELT/PAPER LINER

1,500 SF

05/12/2009 Paper Material under Stucco on Exterior Overhangs. This Material is in GOOD condition as of this date.

01/30/2020 This Material is unchanged as of this date.

08/31/2020 This Material is unchanged as of this date.

02/11/2021 This Material is unchanged as of this date.

08/12/2021 This Material is unchanged as of this date.

02/24/2022 This Material is unchanged as of this date.

08/18/2022 This Material is unchanged as of this date.

08/17/2023 This Material is unchanged as of this date.

02/15/2024 This Material is unchanged as of this date.

SURVEY REPORT FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

08/15/2024 This Material is unchanged as of this date.

02/28/2025 This Material is unchanged as of this date.

09/18/2025 This Material is unchanged as of this date.

09-098AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS A1-A12, B1-B9, C1-C11 PODS BUILDING - "MAIN BUILDING"

EXTERIOR OVERHANGS

ROUGH WALL

1,500 SF

05/12/2009 Stucco on Exterior Overhangs. This Material is in GOOD condition as of this date.

01/30/2020 This Material is unchanged as of this date.

08/31/2020 This Material is unchanged as of this date.

02/11/2021 This Material is unchanged as of this date.

08/12/2021 This Material is unchanged as of this date.

02/24/2022 This Material is unchanged as of this date.

08/18/2022 This Material is unchanged as of this date.

08/17/2023 This Material is unchanged as of this date.

02/15/2024 This Material is unchanged as of this date.

08/15/2024 This Material is unchanged as of this date.

02/28/2025 This Material is unchanged as of this date.

09/18/2025 This Material is unchanged as of this date.

09-098AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS A1-A12, B1-B9, C1-C11 PODS BUILDING - "MAIN BUILDING"

EXTERIOR OVERHANGS

ROUGH WALL SURFACING

1,500 SF

05/12/2009 Skim Coat for Stucco on Exterior Overhangs. This Material is in GOOD condition as of this date.

03/06/2014 This Material is unchanged as of this date.

SURVEY REPORT FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

08/28/2014	This Material is unchanged as of this date.
01/30/2020	This Material is unchanged as of this date.
08/31/2020	This Material is unchanged as of this date.
02/11/2021	This Material is unchanged as of this date.
08/12/2021	This Material is unchanged as of this date.
02/24/2022	This Material is unchanged as of this date.
08/18/2022	This Material is unchanged as of this date.
02/16/2023	This Material is unchanged as of this date.
08/17/2023	This Material is unchanged as of this date.
02/15/2024	This Material is unchanged as of this date.
08/15/2024	This Material is unchanged as of this date.
02/28/2025	This Material is unchanged as of this date.
09/18/2025	This Material is unchanged as of this date.

09-098AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS A1-A12, B1-B9, C1-C11 PODS BUILDING - "MAIN BUILDING"

PODS A, B, AND C

FIRE DOOR CORE INSULATION

798 SF

03/18/2022	Fire Door Core Insulation. (38 EA Doors). This Material is in GOOD condition as of this date
08/18/2022	This Material is unchanged as of this date.
02/16/2023	This Material is unchanged as of this date.
08/17/2023	This Material is unchanged as of this date.
02/15/2024	This Material is unchanged as of this date.
08/15/2024	This Material is unchanged as of this date.
02/28/2025	This Material is unchanged as of this date.
09/18/2025	This Material is unchanged as of this date.

09-098AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
22-024.NS	ASSUMED	NO SAMPLE	(NS)

CLASSROOMS A1-A12, B1-B9, C1-C11 PODS BUILDING - "MAIN BUILDING"

PODS A, B, AND C

SINK UNDERCOATING

65 SF

05/12/2009	Black and Grey Thermal Undercoating on Sink (13 EA Sink). 1 EA Sink is located in the Kitchenette of Classroom A-2. The remaining Sinks are located, 1 EA Sink, in the following locations: Classroom A-5 thru A-9; B-1, B-2, B-5, and B-6; C-3, C-7, and C-8. This Material is in GOOD condition as of this date (Original Entry updated on 11/29/11).
01/30/2020	This Material is unchanged as of this date.
08/31/2020	This Material is unchanged as of this date.
02/11/2021	This Material is unchanged as of this date.
08/12/2021	This Material is unchanged as of this date.
02/24/2022	This Material is unchanged as of this date.
08/18/2022	This Material is unchanged as of this date.
02/16/2023	This Material is unchanged as of this date.
08/17/2023	This Material is unchanged as of this date.
02/15/2024	This Material is unchanged as of this date.
08/15/2024	This Material is unchanged as of this date.
02/28/2025	This Material is unchanged as of this date.
09/18/2025	This Material is unchanged as of this date.

09-098AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

SURVEY REPORT FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME	
LOCATION	
MATERIAL TYPE	QTY (APPROXIMATE)
COMMENTS	

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
-------------------	-------------------------	----------------------	----------------------

CLASSROOMS D1-D8 BUILDING

CLASSROOMS D1-D8 BUILDING

09/09/2005	BUILDING NOTES:
09/09/2005	Existing Gypsum Wallboard Systems Removed and Replaced with new in-kind in Path-of-Construction. Existing Plaster Systems Removed and Replaced with new in-kind in Path-of-Construction. New Flooring Finishes per information received from the BUESD. New Suspended Ceiling Tiles installed.
03/09/2007	Building Name changed from BUILDING D to CLASSROOMS D1-D8 BUILDING.
10/09/2012	New 2'x 4' Soundboard Foam, Wall Tiles, and Vinyl Covered Pressedwood Wall Panels installed in Classroom D-8.
08/09/2018	New Flooring Finishes installed Summer 2018 per information received from the BUESD. New Suspended Ceiling Tiles installed.

CLASSROOMS D1-D8 BUILDING

2 RESTROOMS AND ALL DRINKING FOUNTAINS

MORTAR MISCELLANEOUS

300 SF

10/16/2008	Grout/Mortar for 4"x4" Multi-Colored Wall Tiles. This Material is in GOOD condition as of this date.
01/30/2020	This Material is unchanged as of this date.
08/31/2020	This Material is unchanged as of this date.
02/11/2021	This Material is unchanged as of this date.
08/12/2021	This Material is unchanged as of this date.
02/24/2022	This Material is unchanged as of this date.
08/18/2022	This Material is unchanged as of this date.
02/16/2023	This Material is unchanged as of this date.
08/17/2023	This Material is unchanged as of this date.
02/15/2024	This Material is unchanged as of this date.
08/15/2024	This Material is unchanged as of this date.
02/28/2025	This Material is unchanged as of this date.

SURVEY REPORT FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

09/18/2025 This Material is unchanged as of this date.

08-241AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS D1-D8 BUILDING

CLASSROOM D-2

CEMENTITIOUS WALL PANEL

20 SF

05/12/2009 Green Cementitious Chalkboard (1 EA). This Material is in GOOD condition as of this date.

01/30/2020 This Material is unchanged as of this date.

08/31/2020 This Material is unchanged as of this date.

02/11/2021 This Material is unchanged as of this date.

08/12/2021 This Material is unchanged as of this date.

02/24/2022 This Material is unchanged as of this date.

08/18/2022 This Material is unchanged as of this date.

02/16/2023 This Material is unchanged as of this date.

08/17/2023 This Material is unchanged as of this date.

02/15/2024 This Material is unchanged as of this date.

08/15/2024 This Material is unchanged as of this date.

02/28/2025 This Material is unchanged as of this date.

09/18/2025 This Material is unchanged as of this date.

09-098AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS D1-D8 BUILDING

CLASSROOM D-2

CEMENTITIOUS WALL PANEL MASTIC

20 SF

05/12/2009 Mastic/Adhesive for Green Cementitious Chalkboard (1 EA). This Material is in GOOD condition as of this date.

01/30/2020 This Material is unchanged as of this date.

08/31/2020 This Material is unchanged as of this date.

SURVEY REPORT FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/11/2021 This Material is unchanged as of this date.

08/12/2021 This Material is unchanged as of this date.

02/24/2022 This Material is unchanged as of this date.

08/18/2022 This Material is unchanged as of this date.

02/16/2023 This Material is unchanged as of this date.

08/17/2023 This Material is unchanged as of this date.

02/15/2024 This Material is unchanged as of this date.

08/15/2024 This Material is unchanged as of this date.

02/28/2025 This Material is unchanged as of this date.

09/18/2025 This Material is unchanged as of this date.

09-098AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS D1-D8 BUILDING

CLASSROOM D1

CEMENTITIOUS WALL PANEL

60 SF

09/09/2005 Cementitious Wall Panels. Material may exist behind Writing Board or new Wallboard Panel. This Material is in GOOD condition as of this date.

01/30/2020 This Material is unchanged as of this date.

08/31/2020 This Material is unchanged as of this date.

02/11/2021 This Material is unchanged as of this date.

08/12/2021 This Material is unchanged as of this date.

02/24/2022 This Material is unchanged as of this date.

08/18/2022 This Material is unchanged as of this date.

02/16/2023 This Material is unchanged as of this date.

08/17/2023 This Material is unchanged as of this date.

02/15/2024 This Material is unchanged as of this date.

08/15/2024 This Material is unchanged as of this date.

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
02/28/2025	This Material is unchanged as of this date.		
09/18/2025	This Material is unchanged as of this date.		
05-212AAA	ASSUMED	NO SAMPLE	(NS)

CLASSROOMS D1-D8 BUILDING

CLASSROOMS D1, D2 AND D7

WINDOW SEALANT

TBD

TBD

10/09/2012	Putty/Sealant on Interior side of Exterior Windows. Sample Collected 17-172-D19, Area D, Classroom D1, Window Glazing Sealant. Sample Collected 17-172-D20, Area D, Classroom D2, Window Glazing Sealant. Sample Collected 17-172-D21, Area D, Classroom D7, Window Glazing Sealant.		
01/30/2020	This Material is unchanged as of this date.		
08/31/2020	This Material is unchanged as of this date.		
02/11/2021	This Material is unchanged as of this date.		
08/12/2021	This Material is unchanged as of this date.		
02/24/2022	This Material is unchanged as of this date.		
08/18/2022	This Material is unchanged as of this date.		
02/16/2023	Damage Observed. <5% Physical Damage - in the form of 2 LF of Cracks on both Windows of Classroom D7 4 LF in total. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.		
08/17/2023	This Material is unchanged as of this date.		
02/15/2024	This Material is unchanged as of this date.		
08/15/2024	This Material is unchanged as of this date.		
02/28/2025	This Material is unchanged as of this date.		
09/18/2025	This Material is unchanged as of this date.		

17-172-D19	ND	NONE DETECTED	(ND)
17-172-D20	ND	NONE DETECTED	(ND)
17-172-D21	ND	NONE DETECTED	(ND)

SURVEY REPORT FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

CLASSROOMS D1-D8 BUILDING

CLASSROOMS D1, D2, AND D8

SINK UNDERCOATING

21 SF

09/02/2010	Black, Grey and Beige Thermal Undercoating on Sink (8 EA Sinks). This Material is in GOOD condition as of this date (Original entry updated 11/29/11).
11/29/2011	Location Description changed from CLASSROOMS D1 AND D2 to CLASSROOMS D1, D2, AND D8. Material Description changed from ' Thermal Undercoating on Sink (6 EA Sinks). ' to ' Black, Grey and Beige Thermal Undercoating on Sink. (8 EA Sinks)'. No other changes as of this date.
01/30/2020	This Material is unchanged as of this date.
08/31/2020	This Material is unchanged as of this date.
02/11/2021	This Material is unchanged as of this date.
08/12/2021	This Material is unchanged as of this date.
02/24/2022	This Material is unchanged as of this date.
08/18/2022	This Material is unchanged as of this date.
02/16/2023	This Material is unchanged as of this date.
08/17/2023	This Material is unchanged as of this date.
02/15/2024	This Material is unchanged as of this date.
08/15/2024	This Material is unchanged as of this date.
02/28/2025	This Material is unchanged as of this date.
09/18/2025	This Material is unchanged as of this date.

10-174AAA

ASSUMED

NO SAMPLE

(NS)

CLASSROOMS D1-D8 BUILDING

ENTIRE BUILDING

FIRE DOOR CORE INSULATION

525 SF

02/24/2022	Fire Door Core Insulation. (25 EA Doors). This Material is in GOOD condition as of this date
08/18/2022	This Material is unchanged as of this date.
02/16/2023	This Material is unchanged as of this date.

SURVEY REPORT FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

08/17/2023 This Material is unchanged as of this date.

02/15/2024 This Material is unchanged as of this date.

08/15/2024 This Material is unchanged as of this date.

02/28/2025 This Material is unchanged as of this date.

09/18/2025 This Material is unchanged as of this date.

22-024.NS	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS D1-D8 BUILDING

ENTIRE BUILDING (EXCEPT CLASSROOM D1, D8, RESTROOMS AND WATER HEATER CLOSET)

CEMENTITIOUS COUNTERTOP PANEL 390 SF

08/18/2022 Black Cementitious Countertop and Sink. This Material is in GOOD condition as of this date.

02/16/2023 This Material is unchanged as of this date.

08/17/2023 This Material is unchanged as of this date.

02/15/2024 This Material is unchanged as of this date.

08/15/2024 This Material is unchanged as of this date.

02/28/2025 This Material is unchanged as of this date.

09/18/2025 This Material is unchanged as of this date.

22-093AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS D1-D8 BUILDING

ENTIRE BUILDING (INCLUDING OFFICES, STORAGE ROOMS, RESTROOMS, UTILITY ROOMS, AND HALLWAY)

SMOOTH WALL MISCELLANEOUS 10,740 SF

09/09/2005 Gypsum Wallboard System, Walls and Ceilings. Existing Gypsum Wallboard Systems Removed and Replaced with new in-kind in Path-of-Construction. This Material is in GOOD condition as of this date.

04/18/2008 Water Heater Closet <10% Water Damage and <5% Physical Damage in the form of 5 SF of Water Damage behind the Water Heater, 2 SF is Damaged next to Ceiling flue opening, and several holes and cuts in various locations. This Material is in FAIR condition overall as of this date.

09/16/2015 Additional Damage observed, Room D1 has 1 SF of Physical Damage, Exterior Boys' Restroom has small holes on ceiling and Small Storage Room by D3 has minor holes. No other changes as of this date.

SURVEY REPORT FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
08/09/2017	Sample Collected 17-172-D14, Area D, Science Storage D12, Joint Mud for Water Damaged Drywall Board Ceiling. Sample Collected 17-172-D15, Area D, Science Storage D12, Water Damaged Drywall Board Ceiling.		
08/09/2018	Additional Damage Observed. 5 Small holes in Ceiling conduit in Classroom D8. No other changes as of this date.		
01/30/2020	This Material is unchanged as of this date.		
08/31/2020	This Material is unchanged as of this date.		
02/11/2021	This Material is unchanged as of this date.		
08/12/2021	This Material is unchanged as of this date.		
02/24/2022	This Material is unchanged as of this date.		
08/18/2022	This Material is unchanged as of this date.		
02/16/2023	This Material is unchanged as of this date.		
08/17/2023	This Material is unchanged as of this date.		
02/15/2024	This Material is unchanged as of this date.		
08/15/2024	This Material is unchanged as of this date.		
02/28/2025	This Material is unchanged as of this date.		
09/18/2025	This Material is unchanged as of this date.		

17-172-D14	ND	NONE DETECTED	(ND)
17-172-D15	ND	NONE DETECTED	(ND)
05-212AAA	ASSUMED	NO SAMPLE	(NS)

CLASSROOMS D1-D8 BUILDING

ENTIRE BUILDING INCLUDING OFFICES, STORAGE ROOMS, RESTROOMS, UTILITY ROOMS, AND HALLWAY

SMOOTH WALL SURFACING

10,740 SF

08/25/2006	Skim Coat for Gypsum Wallboard System, Walls and Ceilings. Existing Gypsum Wallboard Systems Removed and Replaced with new in-kind in Path-of-Construction. This Material is in GOOD condition as of this date.
04/18/2008	Water Heater Closet <10% Water Damage and <5% Physical Damage in the form of 5 SF of Water Damage behind the Water Heater, 2 SF is Damaged next to Ceiling flue opening, and several holes and cuts in various locations. This Material is in FAIR condition overall as of this date.

SURVEY REPORT FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
09/16/2015	Additional Damage observed, Room D1 has 1 SF of Physical Damage, Exterior Boys' Restroom has small holes on ceiling and Small Storage Room by D3 has minor holes. No other changes as of this date.		
08/09/2017	Sample Collected 17-172-D13, Area D, Science Storage D12, Skim Coat (Paint) for Water Damaged Drywall Board Ceiling.		
08/09/2018	Additional Damage Observed. 5 Small holes in Ceiling conduit in Classroom D8. No other changes as of this date.		
01/30/2020	This Material is unchanged as of this date.		
08/31/2020	This Material is unchanged as of this date.		
02/11/2021	This Material is unchanged as of this date.		
08/12/2021	This Material is unchanged as of this date.		
02/24/2022	This Material is unchanged as of this date.		
08/18/2022	This Material is unchanged as of this date.		
02/16/2023	This Material is unchanged as of this date.		
08/17/2023	This Material is unchanged as of this date.		
02/15/2024	This Material is unchanged as of this date.		
08/15/2024	This Material is unchanged as of this date.		
02/28/2025	This Material is unchanged as of this date.		
09/18/2025	This Material is unchanged as of this date.		

17-172-D13	ND	NONE DETECTED	(ND)
06-223AAA	ASSUMED	NO SAMPLE	(NS)

CLASSROOMS D1-D8 BUILDING

PLENUM / ATTIC OF CLASSROOMS D1-D7

SPRAY-ON CEILING TEXTURE

TBD

04/18/2008	Overspray Acoustic Material on Walls above 2'x4' Suspended Ceiling Tiles, Pipes, Wiring and other surfaces. This Material is visible through the Access Door to the Plenum in the Work Room of Classroom D4. This Material is in GOOD condition as of this date.		
01/30/2020	This Material is unchanged as of this date.		
08/31/2020	This Material is unchanged as of this date.		

SURVEY REPORT FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/11/2021 This Material is unchanged as of this date.

08/12/2021 This Material is unchanged as of this date.

02/24/2022 This Material is unchanged as of this date.

08/18/2022 This Material is unchanged as of this date.

02/16/2023 This Material is unchanged as of this date.

08/17/2023 This Material is unchanged as of this date.

02/15/2024 This Material is unchanged as of this date.

08/15/2024 This Material is unchanged as of this date.

02/28/2025 This Material is unchanged as of this date.

09/18/2025 This Material is unchanged as of this date.

08-075AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS D1-D8 BUILDING

WATER HEATER CLOSET

BASEBOARD MASTIC

30 LF

08/25/2006 Mastic/Adhesive for 4" Brown Baseboard. This Material is in GOOD condition as of this date.

09/16/2015 Damage observed, 100% of Baseboard is missing and Mastic/Adhesive is exposed. Material condition changed from GOOD to POOR. Friability changed from Non-Friable to Friable. No other changes as of this date.

01/30/2020 This Material is unchanged as of this date.

08/31/2020 This Material is unchanged as of this date.

02/11/2021 This Material is unchanged as of this date.

08/12/2021 This Material is unchanged as of this date.

02/24/2022 This Material is unchanged as of this date.

08/18/2022 This Material is unchanged as of this date.

02/16/2023 This Material is unchanged as of this date.

08/17/2023 This Material is unchanged as of this date.

SURVEY REPORT FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
02/15/2024	This Material is unchanged as of this date.		
08/15/2024	This Material is unchanged as of this date.		
02/28/2025	This Material is unchanged as of this date.		
09/18/2025	This Material is unchanged as of this date.		
06-223AAA	ASSUMED	NO SAMPLE	(NS)

SURVEY REPORT FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

CLASSROOMS P1-P2 PORTABLES BUILDING

CLASSROOMS P1-P2 PORTABLES BUILDING

09/09/2005 BUILDING NOTES:

09/09/2005 Manufacturer's TAG Info:
BY ENVIROPLEX INC; DATE: 2002; JOB# 02-021; OSA# 02-10413; Serial #'s 6074, 6075, 6076.
This entry for informational and tracking purposes.

CLASSROOMS P1-P2 PORTABLES BUILDING

PORTABLE CLASSROOMS P1-P2

PORTABLE BUILDING

1,440 SF

09/09/2005 New 2002 Construction Relocatable building per Manufacturer's Tag information.

01/30/2020 This Material is unchanged as of this date.

01/30/2020 This Material is unchanged as of this date.

02/11/2021 This Material is unchanged as of this date.

08/12/2021 This Material is unchanged as of this date.

02/24/2022 This Material is unchanged as of this date.

08/18/2022 This Material is unchanged as of this date.

02/16/2023 This Material is unchanged as of this date.

08/17/2023 This Material is unchanged as of this date.

02/15/2024 This Material is unchanged as of this date.

08/15/2024 This Material is unchanged as of this date.

02/28/2025 This Material is unchanged as of this date.

09/18/2025 This Material is unchanged as of this date.

05-212.NS	NEW	NO SAMPLE	(NS)
-----------	-----	-----------	--------

SURVEY REPORT FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.

ASBESTOS CONTENT

ASBESTOS NAME

ASBESTOS CODE

METAL STORAGE CONTAINERS

METAL STORAGE CONTAINERS

05/12/2009 BUILDING NOTES:

05/12/2009 Metal Storage Containers (3 EA Containers). Located next to Kitchen Entry Area.

METAL STORAGE CONTAINERS

METAL STORAGE CONTAINER (3 EA)

STORAGE CONTAINER

384 SF

03/18/2016 Metal Storage Containers. 3 EA, approximately 128 SF EA.

01/30/2020 This Material is unchanged as of this date.

08/31/2020 This Material is unchanged as of this date.

02/11/2021 This Material is unchanged as of this date.

08/12/2021 This Material is unchanged as of this date.

02/24/2022 This Material is unchanged as of this date.

08/18/2022 This Material is unchanged as of this date.

02/16/2023 This Material is unchanged as of this date.

08/17/2023 This Material is unchanged as of this date.

02/15/2024 This Material is unchanged as of this date.

02/28/2025 This Material is unchanged as of this date.

09/18/2025 This Material is unchanged as of this date.

16-074.NS

NEW

NO SAMPLE

(NS)

SURVEY REPORT FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

MULTI-PURPOSE, BOYS' & GIRLS' LOCKER ROOMS, AND MUSIC ROOM BUILDING

MULTI-PURPOSE, BOYS' & GIRLS' LOCKER ROOMS, AND MUSIC ROOM BUILDING

09/09/2005	BUILDING NOTES:
09/09/2005	Existing Gypsum Wallboard Systems Removed and Replaced with new in-kind in Path-of-Construction. Existing Plaster Systems Removed and Replaced with new in-kind in Path-of-Construction. New Flooring Finishes per information received from the BUESD. New Suspended Ceiling Tiles installed.
03/09/2010	New Ceramic Wall and Floor Tiles installed in Staff Restrooms, Student Restrooms, Coaches' Office Restroom, Kitchen Restroom, and Drinking Fountain Walls per information received from BUESD.
09/02/2010	Building Name changed from MULTI-PURPOSE BUILDING to MULTI-PURPOSE, BOYS' & GIRLS' LOCKER ROOMS, AND MUSIC ROOM BUILDING.
08/09/2018	New Flooring Finishes installed Summer 2018 per information received from the BUESD.

MULTI-PURPOSE, BOYS' & GIRLS' LOCKER ROOMS, AND MUSIC ROOM BUILDING

BOYS' AND GIRLS' RESTROOMS IN LOCKER ROOM AREA (OLD RESTROOMS)

CEMENTITIOUS WALL PANEL

420 SF

09/02/2010	Cementitious Wall Panel. This Material is in GOOD condition as of this date.
01/30/2020	This Material is unchanged as of this date.
08/31/2020	This Material is unchanged as of this date.
02/11/2021	This Material is unchanged as of this date.
08/12/2021	This Material is unchanged as of this date.
02/24/2022	This Material is unchanged as of this date.
08/18/2022	This Material is unchanged as of this date.
02/16/2023	This Material is unchanged as of this date.
08/17/2023	This Material is unchanged as of this date.
02/15/2024	This Material is unchanged as of this date.
08/15/2024	This Material is unchanged as of this date.
02/28/2025	This Material is unchanged as of this date.

SURVEY REPORT FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

09/18/2025 This Material is unchanged as of this date.

10-174AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

MULTI-PURPOSE, BOYS' & GIRLS' LOCKER ROOMS, AND MUSIC ROOM BUILDING

BOYS' AND GIRLS' RESTROOMS IN LOCKER ROOM AREA (OLD RESTROOMS)

CEMENTITIOUS WALL PANEL MASTIC

420 SF

09/02/2010 Mastic/Adhesive behind Cementitious Wall Panel. This Material is in GOOD condition as of this date.

01/30/2020 This Material is unchanged as of this date.

08/31/2020 This Material is unchanged as of this date.

02/11/2021 This Material is unchanged as of this date.

08/12/2021 This Material is unchanged as of this date.

02/24/2022 This Material is unchanged as of this date.

08/18/2022 This Material is unchanged as of this date.

02/16/2023 This Material is unchanged as of this date.

08/17/2023 This Material is unchanged as of this date.

02/15/2024 This Material is unchanged as of this date.

08/15/2024 This Material is unchanged as of this date.

02/28/2025 This Material is unchanged as of this date.

09/18/2025 This Material is unchanged as of this date.

10-174AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

MULTI-PURPOSE, BOYS' & GIRLS' LOCKER ROOMS, AND MUSIC ROOM BUILDING

CLASSROOMS E1 AND E2

SINK UNDERCOATING

8 SF

09/02/2010 Grey Thermal Undercoating on Sink (2 EA Sinks). This Material is in GOOD condition as of this date.

01/30/2020 This Material is unchanged as of this date.

08/31/2020 This Material is unchanged as of this date.

SURVEY REPORT FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/11/2021 This Material is unchanged as of this date.

08/12/2021 This Material is unchanged as of this date.

02/24/2022 This Material is unchanged as of this date.

08/18/2022 This Material is unchanged as of this date.

02/16/2023 This Material is unchanged as of this date.

08/17/2023 This Material is unchanged as of this date.

02/15/2024 This Material is unchanged as of this date.

08/15/2024 This Material is unchanged as of this date.

02/28/2025 This Material is unchanged as of this date.

09/18/2025 This Material is unchanged as of this date.

10-174AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

MULTI-PURPOSE, BOYS' & GIRLS' LOCKER ROOMS, AND MUSIC ROOM BUILDING

ENTIRE BUILDING

SMOOTH WALL MISCELLANEOUS

46,600 SF

09/09/2005 Gypsum Wallboard System, Walls and Ceilings. This Material is in GOOD condition as of this date.

08/09/2017 Sample Collected 17-172-E22-Joint Tape, Area E, Mech Room, Joint Tape and Mud for Drywall Board.
Sample Collected 17-172-E22-Joint Mud, Area E, Mech Room, Joint Tape and Mud for Drywall Board.
Sample Collected 17-172-E23, Area E, Mech Room, Drywall Board.

01/30/2020 This Material is unchanged as of this date.

08/31/2020 This Material is unchanged as of this date.

02/11/2021 This Material is unchanged as of this date.

08/12/2021 This Material is unchanged as of this date.

02/24/2022 This Material is unchanged as of this date.

08/18/2022 Damages Observed. <5% Physical Damage in the form of 2 SF of Cuts and Holes on Walls and Ceiling of Mechanical/Electrical Room. Material condition changed from GOOD to FAIR overall. No other changes as of this date.

02/16/2023 This Material is unchanged as of this date.

SURVEY REPORT FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

08/17/2023 This Material is unchanged as of this date.

02/15/2024 This Material is unchanged as of this date.

08/15/2024 This Material is unchanged as of this date.

02/28/2025 This Material is unchanged as of this date.

09/18/2025 This Material is unchanged as of this date.

17-172-E22-Joint	ND	NONE DETECTED	(ND)
17-172-E22-Mud	2	CHRYSTOLE	(CH)
17-172-E23	ND	NONE DETECTED	(ND)

MULTI-PURPOSE, BOYS' & GIRLS' LOCKER ROOMS, AND MUSIC ROOM BUILDING

ENTIRE BUILDING

SMOOTH WALL SURFACING

46,600 SF

08/25/2006 Skim Coat for Gypsum Wallboard System Walls and Ceilings. This Material is in GOOD condition as of this date.

01/30/2020 This Material is unchanged as of this date.

08/31/2020 This Material is unchanged as of this date.

02/11/2021 This Material is unchanged as of this date.

08/12/2021 This Material is unchanged as of this date.

02/24/2022 This Material is unchanged as of this date.

08/18/2022 Damages Observed. <5% Physical Damage in the form of 2 SF of Cuts and Holes on Walls and Ceiling of Mechanical/Electrical Room. Material condition changed from GOOD to FAIR overall. No other changes as of this date.

02/16/2023 This Material is unchanged as of this date.

08/17/2023 This Material is unchanged as of this date.

02/15/2024 This Material is unchanged as of this date.

08/15/2024 This Material is unchanged as of this date.

02/28/2025 This Material is unchanged as of this date.

09/18/2025 This Material is unchanged as of this date.

06-223AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

MULTI-PURPOSE, BOYS' & GIRLS' LOCKER ROOMS, AND MUSIC ROOM BUILDING

EXTERIOR ENTRY TO MULTI-PURPOSE ROOM, KITCHEN, AND 2 SOFFITS (OF LOCKER ROOM)

ROUGH CEILING

1,130 SF

09/09/2005 Stucco Overhang. This Material is in GOOD condition as of this date.

01/30/2020 This Material is unchanged as of this date.

08/31/2020 This Material is unchanged as of this date.

02/11/2021 This Material is unchanged as of this date.

08/12/2021 This Material is unchanged as of this date.

02/24/2022 This Material is unchanged as of this date.

08/18/2022 This Material is unchanged as of this date.

02/16/2023 This Material is unchanged as of this date.

08/17/2023 This Material is unchanged as of this date.

02/15/2024 This Material is unchanged as of this date.

08/15/2024 This Material is unchanged as of this date.

02/28/2025 This Material is unchanged as of this date.

09/18/2025 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

MULTI-PURPOSE, BOYS' & GIRLS' LOCKER ROOMS, AND MUSIC ROOM BUILDING

EXTERIOR ENTRY TO MULTI-PURPOSE ROOM, KITCHEN, AND 2 SOFFITS (OF LOCKER ROOM)

ROUGH CEILING SURFACING

1,130 SF

09/09/2005 Skim Coat for Stucco Overhang. This Material is in good condition as of this date.

01/30/2020 This Material is unchanged as of this date.

08/31/2020 This Material is unchanged as of this date.

02/11/2021 This Material is unchanged as of this date.

08/12/2021 This Material is unchanged as of this date.

SURVEY REPORT FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
02/24/2022	This Material is unchanged as of this date.		
08/18/2022	This Material is unchanged as of this date.		
02/16/2023	This Material is unchanged as of this date.		
08/17/2023	This Material is unchanged as of this date.		
02/15/2024	This Material is unchanged as of this date.		
08/15/2024	This Material is unchanged as of this date.		
02/28/2025	This Material is unchanged as of this date.		
09/18/2025	This Material is unchanged as of this date.		
05-212AAA	ASSUMED	NO SAMPLE	(NS)

MULTI-PURPOSE, BOYS' & GIRLS' LOCKER ROOMS, AND MUSIC ROOM BUILDING

GIRLS AND BOYS LOCKER ROOM

WINDOW SEALANT

TBD

TBD

08/09/2017	Putty/Sealant on Interior side of Exterior Windows. Sample Collected 17-172-E24, Area E, Girls Locker Room, Window Glazing Sealant. Sample Collected 17-172-E25, Area E, Boys Locker Room, Window Glazing Sealant.		
01/30/2020	This Material is unchanged as of this date.		
02/11/2021	This Material is unchanged as of this date.		
08/12/2021	This Material is unchanged as of this date.		
02/24/2022	This Material is unchanged as of this date.		
08/18/2022	This Material is unchanged as of this date.		
02/16/2023	This Material is unchanged as of this date.		
08/17/2023	This Material is unchanged as of this date.		
02/15/2024	This Material is unchanged as of this date.		
08/15/2024	This Material is unchanged as of this date.		
02/28/2025	This Material is unchanged as of this date.		
09/18/2025	This Material is unchanged as of this date.		

SURVEY REPORT FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
17-172-E24	ND	NONE DETECTED	(ND)
17-172-E25	ND	NONE DETECTED	(ND)

MULTI-PURPOSE, BOYS' & GIRLS' LOCKER ROOMS, AND MUSIC ROOM BUILDING

HALLWAY TO KITCHEN, PLENUMS, AND OTHER INACCESSIBLE AREAS

PIPE FITTING INSULATION

TBD

03/09/2007	Thermal System Insulation on Pipe Fittings, (visible on overhead area, additional material may exist in Plenums and Wall/Ceiling cavities). This Material is in GOOD condition as of this date.
01/30/2020	This Material is unchanged as of this date.
08/31/2020	This Material is unchanged as of this date.
02/11/2021	This Material is unchanged as of this date.
08/12/2021	This Material is unchanged as of this date.
02/24/2022	This Material is unchanged as of this date.
08/18/2022	This Material is unchanged as of this date.
02/16/2023	This Material is unchanged as of this date.
08/17/2023	This Material is unchanged as of this date.
02/15/2024	This Material is unchanged as of this date.
08/15/2024	This Material is unchanged as of this date.
02/28/2025	This Material is unchanged as of this date.
09/18/2025	This Material is unchanged as of this date.

06-223AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

MULTI-PURPOSE, BOYS' & GIRLS' LOCKER ROOMS, AND MUSIC ROOM BUILDING

HALLWAY TO KITCHEN, PLENUMS, AND OTHER INACCESSIBLE AREAS

PIPE RUN INSULATION

20 LF

03/09/2007	Thermal System Insulation Wrap on Pipe Runs, (visible on overhead area, additional material may exist in Plenums and Wall/Ceiling cavities). This Material is in GOOD condition as of this date.
01/30/2020	This Material is unchanged as of this date.
08/31/2020	This Material is unchanged as of this date.

SURVEY REPORT FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/11/2021	This Material is unchanged as of this date.
08/12/2021	This Material is unchanged as of this date.
02/24/2022	This Material is unchanged as of this date.
08/18/2022	This Material is unchanged as of this date.
02/16/2023	This Material is unchanged as of this date.
08/17/2023	This Material is unchanged as of this date.
02/15/2024	This Material is unchanged as of this date.
08/15/2024	This Material is unchanged as of this date.
02/28/2025	This Material is unchanged as of this date.
09/18/2025	This Material is unchanged as of this date.

06-223AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

MULTI-PURPOSE, BOYS' & GIRLS' LOCKER ROOMS, AND MUSIC ROOM BUILDING

KITCHEN FREEZER

CAULKING

800 LF

05/12/2009	Freezer Wall and Ceiling Caulking. This Material is in GOOD condition as of this date.
01/30/2020	This Material is unchanged as of this date.
08/31/2020	This Material is unchanged as of this date.
02/11/2021	This Material is unchanged as of this date.
08/12/2021	This Material is unchanged as of this date.
02/24/2022	This Material is unchanged as of this date.
08/18/2022	This Material is unchanged as of this date.
02/16/2023	This Material is unchanged as of this date.
08/17/2023	This Material is unchanged as of this date.
02/15/2024	This Material is unchanged as of this date.
08/15/2024	This Material is unchanged as of this date.

SURVEY REPORT FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/28/2025 This Material is unchanged as of this date.

09/18/2025 This Material is unchanged as of this date.

09-098AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

MULTI-PURPOSE, BOYS' & GIRLS' LOCKER ROOMS, AND MUSIC ROOM BUILDING

MULTI-PURPOSE ROOM

ROUGH WALL SURFACING

200 SF

09/09/2005 Stucco on Cinder Blocks. This Material is in good condition as of this date.

03/31/2017 Damage Observed. <5% Physical Damage - in the form of 20 LF surface damage around Kitchen Roll-Up Door. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.

01/30/2020 This Material is unchanged as of this date.

08/31/2020 This Material is unchanged as of this date.

02/11/2021 This Material is unchanged as of this date.

08/12/2021 This Material is unchanged as of this date.

02/24/2022 This Material is unchanged as of this date.

08/18/2022 This Material is unchanged as of this date.

02/16/2023 This Material is unchanged as of this date.

08/17/2023 This Material is unchanged as of this date.

02/15/2024 This Material is unchanged as of this date.

08/15/2024 This Material is unchanged as of this date.

02/28/2025 This Material is unchanged as of this date.

09/18/2025 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

SURVEY REPORT FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

MULTI-PURPOSE, BOYS' & GIRLS' LOCKER ROOMS, AND MUSIC ROOM BUILDING

MUSIC ROOM E2

PRESSED WOOD WALL PANEL

1,200 SF

08/25/2006	4'x8' Glued-On Wall Panels (with Vinyl Wall Cover with Acoustic Paint/Finish Texture). This Material is in GOOD condition as of this date.
08/25/2006	This Material is unchanged as of this date.
01/30/2020	This Material is unchanged as of this date.
08/31/2020	Damage Observed. <5% Physical Damage in the form of 2 Panels Detaching from Wall. Material condition changed from GOOD to FAIR overall. Friability updated from Non-Friable to Friable. No other changes as of this date.
02/11/2021	This Material is unchanged as of this date.
08/12/2021	This Material is unchanged as of this date.
02/24/2022	This Material is unchanged as of this date.
08/18/2022	This Material is unchanged as of this date.
02/16/2023	This Material is unchanged as of this date.
08/17/2023	This Material is unchanged as of this date.
02/15/2024	This Material is unchanged as of this date.
08/15/2024	This Material is unchanged as of this date.
02/28/2025	This Material is unchanged as of this date.

06-223AAA

ASSUMED

NO SAMPLE

(NS)

MULTI-PURPOSE, BOYS' & GIRLS' LOCKER ROOMS, AND MUSIC ROOM BUILDING

MUSIC ROOM E2

PRESSED WOOD WALL PANEL MASTIC

1,200 SF

08/25/2006	Mastic/Adhesive for 4'x8' Glued-On Wall Panels (with Vinyl Wall Cover with Acoustic Paint/Finish Texture). This Material is in GOOD condition as of this date.
08/25/2006	This Material is unchanged as of this date.
01/30/2020	This Material is unchanged as of this date.

SURVEY REPORT FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
08/31/2020	Damage Observed. <5% Physical Damage in the form of 2 Panels Detaching from Wall. Material condition changed from GOOD to FAIR overall. Friability updated from Non-Friable to Friable. No other changes as of this date.		
02/11/2021	This Material is unchanged as of this date.		
08/12/2021	This Material is unchanged as of this date.		
02/24/2022	This Material is unchanged as of this date.		
08/18/2022	This Material is unchanged as of this date.		
02/16/2023	This Material is unchanged as of this date.		
08/17/2023	This Material is unchanged as of this date.		
02/15/2024	This Material is unchanged as of this date.		
08/15/2024	This Material is unchanged as of this date.		
02/28/2025	This Material is unchanged as of this date.		
06-223AAA	ASSUMED	NO SAMPLE	(NS)

MULTI-PURPOSE, BOYS' & GIRLS' LOCKER ROOMS, AND MUSIC ROOM BUILDING

MUSIC ROOM E2

SMOOTH WALL SURFACING

1,200 SF

08/25/2006	Acoustic Paint/Finish Texture on 4'x8' Glued-On Vinyl Covered Wall Panels. This Material is in GOOD condition as of this date (Original entry updated 04/18/08).		
08/25/2006	This Material is unchanged as of this date.		
01/30/2020	This Material is unchanged as of this date.		
08/31/2020	This Material is unchanged as of this date.		
02/11/2021	This Material is unchanged as of this date.		
08/12/2021	This Material is unchanged as of this date.		
02/24/2022	This Material is unchanged as of this date.		
08/18/2022	This Material is unchanged as of this date.		
02/16/2023	This Material is unchanged as of this date.		

SURVEY REPORT FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

08/17/2023 This Material is unchanged as of this date.

02/15/2024 This Material is unchanged as of this date.

08/15/2024 This Material is unchanged as of this date.

02/28/2025 This Material is unchanged as of this date.

06-223AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

MULTI-PURPOSE, BOYS' & GIRLS' LOCKER ROOMS, AND MUSIC ROOM BUILDING

MUSIC ROOM E2

VINYL WALL COVER MASTIC

1,200 SF

08/25/2006 Mastic/Adhesive for Vinyl Wall Cover with Acoustic Paint/Finish Texture on 4'x8' Glued-On Wall Panels .
This Material is in GOOD condition as of this date.

08/25/2006 This Material is unchanged as of this date.

03/31/2017 Damage Observed. <5% Physical Damage - in the form of 2 LF Acoustic Material is peeling from the wall.
Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No
other changes as of this date.

08/09/2018 Repairs observed. Damages repaired as of this date. Material Condition changed from FAIR to GOOD. No
other changes as of this date.

01/30/2020 This Material is unchanged as of this date.

08/31/2020 Damage Observed. <5% Physical Damage in the form of 2 Panels Detaching from Wall. Material condition
changed from GOOD to FAIR overall. Friability updated from Non-Friable to Friable. No other changes as of
this date.

02/11/2021 This Material is unchanged as of this date.

08/12/2021 This Material is unchanged as of this date.

02/24/2022 This Material is unchanged as of this date.

08/18/2022 This Material is unchanged as of this date.

02/16/2023 This Material is unchanged as of this date.

08/17/2023 This Material is unchanged as of this date.

02/15/2024 This Material is unchanged as of this date.

08/15/2024 This Material is unchanged as of this date.

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/28/2025 This Material is unchanged as of this date.

06-223AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

MULTI-PURPOSE, BOYS' & GIRLS' LOCKER ROOMS, AND MUSIC ROOM BUILDING

MUSIC ROOM LIBRARY (OFFICE)

FIRE DOOR CORE INSULATION

210 SF

09/09/2005 Fire Door Core Insulation (1 EA Fire Door). This Material is in GOOD condition as of this date.

08/25/2006 This Material is unchanged as of this date.

10/16/2008 Material Description changed from ' FIRE DOOR CORE INSULATION (1 EA FIRE DOOR)' to ' FIRE DOOR CORE INSULATION (7 EA FIRE DOOR)'. Material Quantity changed from 21 SF to 147 SF to reflect this fact. No other changes as of this date.

05/12/2009 Material Re-Assessed. Material Description changed from ' FIRE DOOR CORE INSULATION (7 EA FIRE DOOR)' to ' FIRE DOOR CORE INSULATION (10 EA FIRE DOOR)'. 1 EA in the following locations: Kitchen, Kitchen Storage Room, Kitchen Restroom, Classroom E-1, and Staff's Restroom. 2 EA located in Weight Room, and 3 EA in Classroom E-2, (Band/Music Room). Quantity changed from 147 SF to 210 SF. No other changes as of this date.

01/30/2020 This Material is unchanged as of this date.

08/31/2020 This Material is unchanged as of this date.

02/11/2021 This Material is unchanged as of this date.

08/12/2021 This Material is unchanged as of this date.

02/24/2022 This Material is unchanged as of this date.

08/18/2022 This Material is unchanged as of this date.

02/16/2023 This Material is unchanged as of this date.

08/17/2023 This Material is unchanged as of this date.

02/15/2024 This Material is unchanged as of this date.

08/15/2024 This Material is unchanged as of this date.

02/28/2025 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

SURVEY REPORT FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

MULTI-PURPOSE, BOYS' & GIRLS' LOCKER ROOMS, AND MUSIC ROOM BUILDING

UTILITY ROOM LOCATED IN P.E. STORAGE ROOM

TANK (HIGH TEMP) INSULATION

120 SF

09/09/2005	Tank (High Temp) Insulation. This Material is in GOOD condition as of this date.
08/25/2006	Location changed from Exterior Utility Room to Utility Room located in PE Storage Room. The insulation is painted an Orange Color. Quantity Changed from 20 SF to 120 SF to reflect this fact. No other changes as of this date.
08/25/2006	This Material is unchanged as of this date.
01/30/2020	This Material is unchanged as of this date.
08/31/2020	This Material is unchanged as of this date.
02/11/2021	This Material is unchanged as of this date.
08/12/2021	This Material is unchanged as of this date.
02/24/2022	This Material is unchanged as of this date.
08/18/2022	This Material is unchanged as of this date.
02/16/2023	This Material is unchanged as of this date.
08/17/2023	This Material is unchanged as of this date.
02/15/2024	This Material is unchanged as of this date.
08/15/2024	This Material is unchanged as of this date.
02/28/2025	This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

MULTI-PURPOSE, BOYS' & GIRLS' LOCKER ROOMS, AND MUSIC ROOM BUILDING

WEIGHT ROOM, AND ROOM E1

CEMENTITIOUS WALL PANEL

80 SF

08/25/2006	This Material is unchanged as of this date.
05/12/2009	Brown and Green Cementitious Chalkboards, (Framed not Glued). (2 EA). This Material is in GOOD condition as of this date.
09/02/2010	Location Description changed from WEIGHT ROOM, AND ROOM E1. Quantity changed from 24 SF to 80 SF. No other changes as of this date.

SURVEY REPORT FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
01/30/2020	This Material is unchanged as of this date.		
08/31/2020	This Material is unchanged as of this date.		
02/11/2021	This Material is unchanged as of this date.		
08/12/2021	This Material is unchanged as of this date.		
02/24/2022	This Material is unchanged as of this date.		
08/18/2022	This Material is unchanged as of this date.		
02/16/2023	This Material is unchanged as of this date.		
08/17/2023	This Material is unchanged as of this date.		
02/15/2024	This Material is unchanged as of this date.		
08/15/2024	This Material is unchanged as of this date.		
02/28/2025	This Material is unchanged as of this date.		
09-098AAA	ASSUMED	NO SAMPLE	(NS)

MULTI-PURPOSE, BOYS' & GIRLS' LOCKER ROOMS, AND MUSIC ROOM BUILDING

WEIGHT ROOM, MULTI-PURPOSE ROOM, AND ROOM E1

SPRAY-ON CEILING TEXTURE

6,400 SF

09/09/2005	Spray-On Ceiling Texture. This Material is in GOOD condition as of this date.		
08/25/2006	This Material is unchanged as of this date.		
01/30/2020	This Material is unchanged as of this date.		
08/31/2020	This Material is unchanged as of this date.		
02/11/2021	This Material is unchanged as of this date.		
08/12/2021	This Material is unchanged as of this date.		
02/24/2022	This Material is unchanged as of this date.		
08/18/2022	This Material is unchanged as of this date.		
02/16/2023	This Material is unchanged as of this date.		
08/17/2023	This Material is unchanged as of this date.		

SURVEY REPORT FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
02/15/2024	This Material is unchanged as of this date.		
08/15/2024	This Material is unchanged as of this date.		
02/28/2025	Damage Observed. <5% Physical Damage - in the form of 2 SF of Missing Spray-on Ceiling and 3 LF of Cracks with Skim Coat Exposed on Ceiling of Multi-Purpose Room 1. Material Condition changed from GOOD to FAIR overall. No other changes as of this date.		
09/18/2025	This Material is unchanged as of this date.		
05-212AAA	ASSUMED	NO SAMPLE	(NS)

SURVEY REPORT FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.

ASBESTOS CONTENT

ASBESTOS NAME

ASBESTOS CODE

YOUTH CENTER BUILDING

YOUTH CENTER BUILDING

09/09/2005 BUILDING NOTES:

09/09/2005 New Construction Building per information received from BUESD.

YOUTH CENTER BUILDING

YOUTH CENTER

PERMANENT BUILDING

27,500 SF

09/09/2005 New Construction Building per information received from BUESD.

01/30/2020 This Material is unchanged as of this date.

02/11/2021 This Material is unchanged as of this date.

08/12/2021 This Material is unchanged as of this date.

08/18/2022 This Material is unchanged as of this date.

02/16/2023 This Material is unchanged as of this date.

08/17/2023 This Material is unchanged as of this date.

02/15/2024 This Material is unchanged as of this date.

08/15/2024 This Material is unchanged as of this date.

02/28/2025 This Material is unchanged as of this date.

09/18/2025 This Material is unchanged as of this date.

05-212.NS

NEW

NO SAMPLE

(NS)

End Of Report, Total Of 52 Pages

HOMOGENEOUS MATERIALS IN

MORRILL MIDDLE SCHOOL

BUILDING NAME	MATERIAL CATEGORY	LOCATION	MATERIAL TYPE
---------------	-------------------	----------	---------------

ADMINISTRATION AND LIBRARY PODS BUILDING - "MAIN BUILDING"

MISCELLANEOUS MATERIAL

COMPUTER CLERK ROOM	CEMENTITIOUS WALL PANEL
ENTIRE BUILDING	FIRE DOOR CORE INSULATION
ENTIRE BUILDING	SMOOTH WALL
	MISCELLANEOUS
EXTERIOR RESTROOM WALLS (STUDENT RESTROOMS)	FELT/PAPER LINER
EXTERIOR WALKWAYS AND OVERHANGS	FELT/PAPER LINER
EXTERIOR WINDOWS	WINDOW SEALANT
EXTERIOR WINDOWS	WINDOW SEALANT
FOUR OFFICES, STORAGE ROOM OF LIBRARY, AND LIBRARY	PRESSED WOOD WALL PANEL
FOUR OFFICES, STORAGE ROOM OF LIBRARY, AND LIBRARY	PRESSED WOOD WALL PANEL
	MASTIC
FOUR OFFICES, STORAGE ROOM OF LIBRARY, AND LIBRARY	VINYL WALL COVER MASTIC
HEALTH OFFICE, 2ND FLOOR STAFF'S LOUNGE ROOM, WORK ROOM, AND ADMINISTRATIVE ASSISTANT AREA	SINK UNDERCOATING
SECOND FLOOR STAFF LOUNGE ROOM PLENUM	SMOOTH WALL
	MISCELLANEOUS

SURFACING MATERIAL

ENTIRE BUILDING	SMOOTH WALL SURFACING
EXTERIOR RESTROOM WALLS (STUDENT RESTROOMS)	ROUGH WALL
EXTERIOR RESTROOM WALLS (STUDENT RESTROOMS)	ROUGH WALL SURFACING
EXTERIOR WALKWAYS AND OVERHANGS	ROUGH WALL
EXTERIOR WALKWAYS AND OVERHANGS	ROUGH WALL SURFACING
LIBRARY, OFFICE OF LIBRARY, WORK ROOM, TEMP OFFICE, STORAGE ROOM, AND CORRIDOR BETWEEN ADMINISTRATION OFFICES AND LIBRARY	SPRAY ON CEILING

THERMAL SYSTEM INSULATION

LIBRARY STORAGE ROOM	DUCT INSULATION
----------------------	-----------------

CLASSROOMS A1-A12, B1-B9, C1-C11 PODS BUILDING - "MAIN BUILDING"

MISCELLANEOUS MATERIAL

ALL ROOMS, INCLUDING UPPER WALLS AND CEILING IN THE PLENUM (NO SKIM COAT)	SMOOTH WALL
CLASSROOM C-6	MISCELLANEOUS
CLASSROOMS A4, A9, A11, B1, B5, B7, C3, C6 AND C9	CEMENTITIOUS WALL PANEL
EXTERIOR OVERHANGS	WINDOW SEALANT
PODS A, B, AND C	FELT/PAPER LINER
PODS A, B, AND C	FIRE DOOR CORE INSULATION
	SINK UNDERCOATING

SURFACING MATERIAL

ALL ROOMS	SMOOTH WALL SURFACING
EXTERIOR OVERHANGS	ROUGH WALL
EXTERIOR OVERHANGS	ROUGH WALL SURFACING

CLASSROOMS D1-D8 BUILDING

HOMOGENEOUS MATERIALS IN

MORRILL MIDDLE SCHOOL

BUILDING NAME	MATERIAL CATEGORY	LOCATION	MATERIAL TYPE
---------------	-------------------	----------	---------------

MISCELLANEOUS MATERIAL

2 RESTROOMS AND ALL DRINKING FOUNTAINS
CLASSROOM D-2
CLASSROOM D-2

CLASSROOM D1

CLASSROOMS D1, D2 AND D7

CLASSROOMS D1, D2, AND D8

ENTIRE BUILDING

ENTIRE BUILDING (EXCEPT CLASSROOM D1, D8, RESTROOMS AND WATER HEATER CLOSET)

ENTIRE BUILDING (INCLUDING OFFICES, STORAGE ROOMS, RESTROOMS, UTILITY ROOMS, AND HALLWAY)

WATER HEATER CLOSET

MORTAR MISCELLANEOUS

CEMENTITIOUS WALL PANEL

CEMENTITIOUS WALL PANEL
MASTIC

CEMENTITIOUS WALL PANEL

WINDOW SEALANT

SINK UNDERCOATING

FIRE DOOR CORE INSULATION

CEMENTITIOUS COUNTERTOP
PANEL

SMOOTH WALL
MISCELLANEOUS

BASEBOARD MASTIC

SURFACING MATERIAL

ENTIRE BUILDING INCLUDING OFFICES, STORAGE ROOMS, RESTROOMS, UTILITY ROOMS, AND HALLWAY

PLENUM / ATTIC OF CLASSROOMS D1-D7

SMOOTH WALL SURFACING

SPRAY-ON CEILING TEXTURE

CLASSROOMS P1-P2 PORTABLES BUILDING

MISCELLANEOUS MATERIAL

PORTABLE CLASSROOMS P1-P2

PORTABLE BUILDING

METAL STORAGE CONTAINERS

MISCELLANEOUS MATERIAL

METAL STORAGE CONTAINER (3 EA)

STORAGE CONTAINER

MULTI-PURPOSE, BOYS' & GIRLS' LOCKER ROOMS, AND MUSIC ROOM BUILDING

MISCELLANEOUS MATERIAL

BOYS' AND GIRLS' RESTROOMS IN LOCKER ROOM AREA (OLD RESTROOMS)
BOYS' AND GIRLS' RESTROOMS IN LOCKER ROOM AREA (OLD RESTROOMS)

CLASSROOMS E1 AND E2

ENTIRE BUILDING

GIRLS AND BOYS LOCKER ROOM

KITCHEN FREEZER

MUSIC ROOM E2

MUSIC ROOM E2

MUSIC ROOM E2

MUSIC ROOM LIBRARY (OFFICE)

WEIGHT ROOM, AND ROOM E1

CEMENTITIOUS WALL PANEL

CEMENTITIOUS WALL PANEL
MASTIC

SINK UNDERCOATING

SMOOTH WALL
MISCELLANEOUS

WINDOW SEALANT

CAULKING

PRESSED WOOD WALL PANEL

PRESSED WOOD WALL PANEL
MASTIC

VINYL WALL COVER MASTIC

FIRE DOOR CORE INSULATION

CEMENTITIOUS WALL PANEL

HOMOGENEOUS MATERIALS IN

MORRILL MIDDLE SCHOOL

BUILDING NAME

MATERIAL CATEGORY

LOCATION

MATERIAL TYPE

SURFACING MATERIAL

ENTIRE BUILDING

SMOOTH WALL SURFACING

EXTERIOR ENTRY TO MULTI-PURPOSE ROOM, KITCHEN, AND 2 SOFFITS (OF LOCKER ROOM)

ROUGH CEILING

EXTERIOR ENTRY TO MULTI-PURPOSE ROOM, KITCHEN, AND 2 SOFFITS (OF LOCKER ROOM)

ROUGH CEILING SURFACING

MULTI-PURPOSE ROOM

ROUGH WALL SURFACING

MUSIC ROOM E2

SMOOTH WALL SURFACING

WEIGHT ROOM, MULTI-PURPOSE ROOM, AND ROOM E1

SPRAY-ON CEILING TEXTURE

THERMAL SYSTEM INSULATION

HALLWAY TO KITCHEN, PLENUMS, AND OTHER INACCESSIBLE AREAS

PIPE FITTING INSULATION

HALLWAY TO KITCHEN, PLENUMS, AND OTHER INACCESSIBLE AREAS

PIPE RUN INSULATION

UTILITY ROOM LOCATED IN P.E. STORAGE ROOM

TANK (HIGH TEMP) INSULATION

YOUTH CENTER BUILDING

MISCELLANEOUS MATERIAL

YOUTH CENTER

PERMANENT BUILDING

End Of Report, Total Of 3 Pages

FRIABLE LOCATIONS IN MORRILL MIDDLE SCHOOL

BUILDING NAME	LOCATION	QTY (APPROXIMATE)	ASBESTOS CONTENT
	MATERIAL TYPE		
ADMINISTRATION AND LIBRARY PODS BUILDING - "MAIN BUILDING"			
	COMPUTER CLERK ROOM		
	CEMENTITIOUS WALL PANEL	40 SF	Assumed
	ENTIRE BUILDING		
	FIRE DOOR CORE INSULATION	735 SF	Assumed
	ENTIRE BUILDING		
	SMOOTH WALL MISCELLANEOUS	43,600 SF	Greater Than 1%
	ENTIRE BUILDING		
	SMOOTH WALL SURFACING	43,600 SF	Greater Than 1%
	EXTERIOR RESTROOM WALLS (STUDENT RESTROOMS)		
	FELT/PAPER LINER	350 SF	Assumed
	EXTERIOR WALKWAYS AND OVERHANGS		
	FELT/PAPER LINER	2,500 SF	Assumed
	FOUR OFFICES, STORAGE ROOM OF LIBRARY, AND LIBRARY		
	PRESSED WOOD WALL PANEL	2,700 SF	Non Detected
	FOUR OFFICES, STORAGE ROOM OF LIBRARY, AND LIBRARY		
	VINYL WALL COVER MASTIC	2,700 SF	Assumed
	LIBRARY, OFFICE OF LIBRARY, WORK ROOM, TEMP OFFICE, STORAGE ROOM, AND CORRIDOR BETWEEN ADMINISTRATION OFFICES AND LIBRARY		
	SPRAY ON CEILING	8,400 SF	Assumed
	LIBRARY STORAGE ROOM		
	DUCT INSULATION	TBD	Greater Than 1%
	SECOND FLOOR STAFF LOUNGE ROOM PLENUM		
	SMOOTH WALL MISCELLANEOUS	2,500 SF	Non Detected
CLASSROOMS A1-A12, B1-B9, C1-C11 PODS BUILDING - "MAIN BUILDING"			
	ALL ROOMS		
	SMOOTH WALL SURFACING	12,000 SF	Assumed
	ALL ROOMS, INCLUDING UPPER WALLS AND CEILING IN THE PLENUM (NO SKIM COAT)		
	SMOOTH WALL MISCELLANEOUS	41,410 SF	Assumed
	EXTERIOR OVERHANGS		
	FELT/PAPER LINER	1,500 SF	Assumed
	PODS A, B, AND C		
	FIRE DOOR CORE INSULATION	798 SF	Assumed

FRIABLE LOCATIONS IN MORRILL MIDDLE SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	QTY (APPROXIMATE)	ASBESTOS CONTENT
CLASSROOMS D1-D8 BUILDING				
	CLASSROOMS D1, D2 AND D7			
	WINDOW SEALANT		TBD TBD	Non Detected
	ENTIRE BUILDING			
	FIRE DOOR CORE INSULATION		525 SF	Assumed
	ENTIRE BUILDING (INCLUDING OFFICES, STORAGE ROOMS, RESTROOMS, UTILITY ROOMS, AND HALLWAY)			
	SMOOTH WALL MISCELLANEOUS		10,740 SF	Non Detected
	ENTIRE BUILDING INCLUDING OFFICES, STORAGE ROOMS, RESTROOMS, UTILITY ROOMS, AND HALLWAY			
	SMOOTH WALL SURFACING		10,740 SF	Non Detected
	PLENUM / ATTIC OF CLASSROOMS D1-D7			
	SPRAY-ON CEILING TEXTURE		TBD	Assumed
	WATER HEATER CLOSET			
	BASEBOARD MASTIC		30 LF	Assumed
MULTI-PURPOSE, BOYS' & GIRLS' LOCKER ROOMS, AND MUSIC ROOM BUILDING				
	ENTIRE BUILDING			
	SMOOTH WALL MISCELLANEOUS		46,600 SF	Greater Than 1%
	ENTIRE BUILDING			
	SMOOTH WALL SURFACING		46,600 SF	Assumed
	HALLWAY TO KITCHEN, PLENUMS, AND OTHER INACCESSIBLE AREAS			
	PIPE FITTING INSULATION		TBD	Assumed
	HALLWAY TO KITCHEN, PLENUMS, AND OTHER INACCESSIBLE AREAS			
	PIPE RUN INSULATION		20 LF	Assumed
	MULTI-PURPOSE ROOM			
	ROUGH WALL SURFACING		200 SF	Assumed
	MUSIC ROOM E2			
	PRESSED WOOD WALL PANEL		1,200 SF	Assumed
	MUSIC ROOM E2			
	PRESSED WOOD WALL PANEL MASTIC		1,200 SF	Assumed
	MUSIC ROOM E2			
	VINYL WALL COVER MASTIC		1,200 SF	Assumed
	MUSIC ROOM LIBRARY (OFFICE)			
	FIRE DOOR CORE INSULATION		210 SF	Assumed
	WEIGHT ROOM, MULTI-PURPOSE ROOM, AND ROOM E1			
	SPRAY-ON CEILING TEXTURE		6,400 SF	Assumed

End Of Report, Total Of 2 Pages

Non- Friable Locations In Morrill Middle School

BUILDING NAME	LOCATION	QTY (APPROXIMATE)	ASBESTOS CONTENT
MATERIAL TYPE			
ADMINISTRATION AND LIBRARY PODS BUILDING - "MAIN BUILDING"			
	EXTERIOR RESTROOM WALLS (STUDENT RESTROOMS)		
	ROUGH WALL	350 SF	Assumed
	EXTERIOR RESTROOM WALLS (STUDENT RESTROOMS)		
	ROUGH WALL SURFACING	350 SF	Non Detected
	EXTERIOR WALKWAYS AND OVERHANGS		
	ROUGH WALL	2,500 SF	Assumed
	EXTERIOR WALKWAYS AND OVERHANGS		
	ROUGH WALL SURFACING	2,500 SF	Assumed
	EXTERIOR WINDOWS		
	WINDOW SEALANT	800 LF	Assumed
	EXTERIOR WINDOWS		
	WINDOW SEALANT	800 LF	Non Detected
	FOUR OFFICES, STORAGE ROOM OF LIBRARY, AND LIBRARY		
	PRESSED WOOD WALL PANEL MASTIC	2,700 SF	Assumed
	HEALTH OFFICE, 2ND FLOOR STAFF'S LOUNGE ROOM, WORK ROOM, AND ADMINISTRATIVE ASSISTANT AREA		
	SINK UNDERCOATING	15 SF	Assumed
CLASSROOMS A1-A12, B1-B9, C1-C11 PODS BUILDING - "MAIN BUILDING"			
	CLASSROOM C-6		
	CEMENTITIOUS WALL PANEL	68 SF	Assumed
	CLASSROOMS A4, A9, A11, B1, B5, B7, C3, C6 AND C9		
	WINDOW SEALANT	TBD	Non Detected
	EXTERIOR OVERHANGS		
	ROUGH WALL	1,500 SF	Assumed
	EXTERIOR OVERHANGS		
	ROUGH WALL SURFACING	1,500 SF	Assumed
	PODS A, B, AND C		
	SINK UNDERCOATING	65 SF	Assumed
CLASSROOMS D1-D8 BUILDING			
	2 RESTROOMS AND ALL DRINKING FOUNTAINS		
	MORTAR MISCELLANEOUS	300 SF	Assumed
	CLASSROOM D-2		
	CEMENTITIOUS WALL PANEL	20 SF	Assumed
	CLASSROOM D-2		
	CEMENTITIOUS WALL PANEL MASTIC	20 SF	Assumed
	CLASSROOM D1		
	CEMENTITIOUS WALL PANEL	60 SF	Assumed
	CLASSROOMS D1, D2, AND D8		
	SINK UNDERCOATING	21 SF	Assumed
	ENTIRE BUILDING (EXCEPT CLASSROOM D1, D8, RESTROOMS AND WATER HEATER CLOSET)		
	CEMENTITIOUS COUNTERTOP PANEL	390 SF	Assumed

Non- Friable Locations In MORRILL MIDDLE SCHOOL

BUILDING NAME		QTY (APPROXIMATE)	ASBESTOS CONTENT
LOCATION	MATERIAL TYPE		
MULTI-PURPOSE, BOYS' & GIRLS' LOCKER ROOMS, AND MUSIC ROOM BUILDING			
BOYS' AND GIRLS' RESTROOMS IN LOCKER ROOM AREA (OLD RESTROOMS)			
CEMENTITIOUS WALL PANEL	420 SF	Assumed	
BOYS' AND GIRLS' RESTROOMS IN LOCKER ROOM AREA (OLD RESTROOMS)			
CEMENTITIOUS WALL PANEL MASTIC	420 SF	Assumed	
CLASSROOMS E1 AND E2			
SINK UNDERCOATING	8 SF	Assumed	
EXTERIOR ENTRY TO MULTI-PURPOSE ROOM, KITCHEN, AND 2 SOFFITS (OF LOCKER ROOM)			
ROUGH CEILING	1,130 SF	Assumed	
EXTERIOR ENTRY TO MULTI-PURPOSE ROOM, KITCHEN, AND 2 SOFFITS (OF LOCKER ROOM)			
ROUGH CEILING SURFACING	1,130 SF	Assumed	
GIRLS AND BOYS LOCKER ROOM			
WINDOW SEALANT	TBD TBD	Non Detected	
KITCHEN FREEZER			
CAULKING	800 LF	Assumed	
MUSIC ROOM E2			
SMOOTH WALL SURFACING	1,200 SF	Assumed	
UTILITY ROOM LOCATED IN P.E. STORAGE ROOM			
TANK (HIGH TEMP) INSULATION	120 SF	Assumed	
WEIGHT ROOM, AND ROOM E1			
CEMENTITIOUS WALL PANEL	80 SF	Assumed	
End Of Report, Total Of 2 Pages			

RECOMMENDATIONS FOR
MORRILL MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

ADMINISTRATION AND LIBRARY PODS BUILDING - "MAIN BUILDING"

COMPUTER CLERK ROOM

CEMENTITIOUS WALL PANEL

40 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

ENTIRE BUILDING

FIRE DOOR CORE INSULATION

735 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

ENTIRE BUILDING

SMOOTH WALL MISCELLANEOUS

43,600 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

ENTIRE BUILDING

SMOOTH WALL SURFACING

43,600 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

EXTERIOR RESTROOM WALLS (STUDENT RESTROOMS)

FELT/PAPER LINER 350 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

EXTERIOR RESTROOM WALLS (STUDENT RESTROOMS)

ROUGH WALL 350 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

EXTERIOR RESTROOM WALLS (STUDENT RESTROOMS)

ROUGH WALL SURFACING 350 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

EXTERIOR WALKWAYS AND OVERHANGS

FELT/PAPER LINER 2,500 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

EXTERIOR WALKWAYS AND OVERHANGS

ROUGH WALL

2,500 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

EXTERIOR WALKWAYS AND OVERHANGS

ROUGH WALL SURFACING

2,500 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

EXTERIOR WINDOWS

WINDOW SEALANT

800 LF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

EXTERIOR WINDOWS

WINDOW SEALANT

800 LF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

FOUR OFFICES, STORAGE ROOM OF LIBRARY, AND LIBRARY

PRESSED WOOD WALL PANEL

2,700 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

FOUR OFFICES, STORAGE ROOM OF LIBRARY, AND LIBRARY

PRESSED WOOD WALL PANEL MASTIC

2,700 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

FOUR OFFICES, STORAGE ROOM OF LIBRARY, AND LIBRARY

VINYL WALL COVER MASTIC

2,700 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

HEALTH OFFICE, 2ND FLOOR STAFF'S LOUNGE ROOM, WORK ROOM, AND ADMINISTRATIVE ASSISTANT AREA

SINK UNDERCOATING

15 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME**LOCATION****MATERIAL TYPE****RECOMMENDATION****QTY****(APPROXIMATE)**

LIBRARY, OFFICE OF LIBRARY, WORK ROOM, TEMP OFFICE, STORAGE ROOM, AND CORRIDOR BETWEEN ADMINISTRATION OFFICES AND LIBRARY

SPRAY ON CEILING

8,400 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

LIBRARY STORAGE ROOM

DUCT INSULATION

TBD

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

SECOND FLOOR STAFF LOUNGE ROOM PLENUM

SMOOTH WALL MISCELLANEOUS

2,500 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

CLASSROOMS A1-A12, B1-B9, C1-C11 PODS BUILDING - "MAIN BUILDING"

ALL ROOMS

SMOOTH WALL SURFACING 12,000 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

ALL ROOMS, INCLUDING UPPER WALLS AND CEILING IN THE PLENUM (NO SKIM COAT)

SMOOTH WALL MISCELLANEOUS 41,410 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOM C-6

CEMENTITIOUS WALL PANEL 68 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOMS A4, A9, A11, B1, B5, B7, C3, C6 AND C9

WINDOW SEALANT TBD

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR
MORRILL MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

EXTERIOR OVERHANGS

FELT/PAPER LINER 1,500 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

EXTERIOR OVERHANGS

ROUGH WALL 1,500 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

EXTERIOR OVERHANGS

ROUGH WALL SURFACING 1,500 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

PODS A, B, AND C

FIRE DOOR CORE INSULATION 798 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR
MORRILL MIDDLE SCHOOL

BUILDING NAME**LOCATION****MATERIAL TYPE****RECOMMENDATION****QTY****(APPROXIMATE)**

PODS A, B, AND C**SINK UNDERCOATING****65 SF**

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOMS D1-D8 BUILDING

2 RESTROOMS AND ALL DRINKING FOUNTAINS**MORTAR MISCELLANEOUS****300 SF**

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOM D-2**CEMENTITIOUS WALL PANEL****20 SF**

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOM D-2**CEMENTITIOUS WALL PANEL MASTIC****20 SF**

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

CLASSROOM D1

CEMENTITIOUS WALL PANEL

60 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOMS D1, D2 AND D7

WINDOW SEALANT

TBD TBD

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOMS D1, D2, AND D8

SINK UNDERCOATING

21 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

ENTIRE BUILDING

FIRE DOOR CORE INSULATION

525 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

ENTIRE BUILDING (EXCEPT CLASSROOM D1, D8, RESTROOMS AND WATER HEATER CLOSET)

CEMENTITIOUS COUNTERTOP PANEL

390 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

ENTIRE BUILDING (INCLUDING OFFICES, STORAGE ROOMS, RESTROOMS, UTILITY ROOMS, AND HALLWAY)

SMOOTH WALL MISCELLANEOUS

10,740 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

ENTIRE BUILDING INCLUDING OFFICES, STORAGE ROOMS, RESTROOMS, UTILITY ROOMS, AND HALLWAY

SMOOTH WALL SURFACING

10,740 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

PLENUM / ATTIC OF CLASSROOMS D1-D7

SPRAY-ON CEILING TEXTURE

TBD

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME**LOCATION****MATERIAL TYPE****RECOMMENDATION****QTY****(APPROXIMATE)**

WATER HEATER CLOSET**BASEBOARD MASTIC****30 LF**

- (a) Sample the material. If ACM include this material in the Operations and Maintenance (O & M) manual. Maintain the material in an intact and undamaged condition
- (b) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

CLASSROOMS P1-P2 PORTABLES BUILDING

PORTABLE CLASSROOMS P1-P2**PORTABLE BUILDING****1,440 SF**

- (a) This is a replacement/new material.
- (b) The district should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the district's AHERA records.

METAL STORAGE CONTAINERS

METAL STORAGE CONTAINER (3 EA)**STORAGE CONTAINER****384 SF**

- (a) This is a replacement/new material.
 - (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
 - (c) This documentation is to be maintained with the District's AHERA records.
-

RECOMMENDATIONS FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

MULTI-PURPOSE, BOYS' & GIRLS' LOCKER ROOMS, AND MUSIC ROOM BUILDING

BOYS' AND GIRLS' RESTROOMS IN LOCKER ROOM AREA (OLD RESTROOMS)

CEMENTITIOUS WALL PANEL 420 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

BOYS' AND GIRLS' RESTROOMS IN LOCKER ROOM AREA (OLD RESTROOMS)

CEMENTITIOUS WALL PANEL MASTIC 420 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOMS E1 AND E2

SINK UNDERCOATING 8 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

ENTIRE BUILDING

SMOOTH WALL MISCELLANEOUS 46,600 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

ENTIRE BUILDING

SMOOTH WALL SURFACING 46,600 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

EXTERIOR ENTRY TO MULTI-PURPOSE ROOM, KITCHEN, AND 2 SOFFITS (OF LOCKER ROOM)

ROUGH CEILING 1,130 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

EXTERIOR ENTRY TO MULTI-PURPOSE ROOM, KITCHEN, AND 2 SOFFITS (OF LOCKER ROOM)

ROUGH CEILING SURFACING 1,130 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

GIRLS AND BOYS LOCKER ROOM

WINDOW SEALANT TBD TBD

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

HALLWAY TO KITCHEN, PLENUMS, AND OTHER INACCESSIBLE AREAS

PIPE FITTING INSULATION

TBD

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

HALLWAY TO KITCHEN, PLENUMS, AND OTHER INACCESSIBLE AREAS

PIPE RUN INSULATION

20 LF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

KITCHEN FREEZER

CAULKING

800 LF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

MULTI-PURPOSE ROOM

ROUGH WALL SURFACING

200 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

MUSIC ROOM E2

PRESSED WOOD WALL PANEL 1,200 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

MUSIC ROOM E2

PRESSED WOOD WALL PANEL MASTIC 1,200 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

MUSIC ROOM E2

SMOOTH WALL SURFACING 1,200 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

MUSIC ROOM E2

VINYL WALL COVER MASTIC 1,200 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

MUSIC ROOM LIBRARY (OFFICE)

FIRE DOOR CORE INSULATION

210 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

UTILITY ROOM LOCATED IN P.E. STORAGE ROOM

TANK (HIGH TEMP) INSULATION

120 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

WEIGHT ROOM, AND ROOM E1

CEMENTITIOUS WALL PANEL

80 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

WEIGHT ROOM, MULTI-PURPOSE ROOM, AND ROOM E1

SPRAY-ON CEILING TEXTURE

6,400 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR
MORRILL MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

YOUTH CENTER BUILDING

YOUTH CENTER

PERMANENT BUILDING

27,500 SF

- (a) This is a replacement/new material.
 - (b) The district should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
 - (c) This documentation is to be maintained with the district's AHERA records.
-

End Of Report, Total Of 17 Pages

SAMPLES REPORT FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

ADMINISTRATION AND LIBRARY PODS BUILDING - "MAIN BUILDING"

ADMINISTRATION AND LIBRARY PODS BUILDING - "MAIN BUILDING"

COMPUTER CLERK ROOM
CEMENTITIOUS WALL PANEL

<u>05-212AAA</u>	9/9/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

ADMINISTRATION AND LIBRARY PODS BUILDING - "MAIN BUILDING"

ENTIRE BUILDING
FIRE DOOR CORE INSULATION

<u>22-025AAA</u>	2/24/2022	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

ADMINISTRATION AND LIBRARY PODS BUILDING - "MAIN BUILDING"

ENTIRE BUILDING
SMOOTH WALL MISCELLANEOUS

<u>17-172-A02</u>	8/9/2017	Negative	ND	NONE DETECTED	ND
--------------------------	----------	----------	----	---------------	----

Sample Collected 17-172-A02, Area A, Boy's Restroom A112, Drywall Board.

<u>17-172-B03</u>	8/9/2017	Negative	ND	NONE DETECTED	ND
--------------------------	----------	----------	----	---------------	----

Sample Collected 17-172-B03, Area B, Mezzanine Level, Electrical Room, Drywall Board.

<u>17-172-B05-Joint</u>	8/9/2017	Negative	ND	NONE DETECTED	ND
--------------------------------	----------	----------	----	---------------	----

Sample Collected 17-172-B05-Joint Tape, Area B, Mezzanine, Level Roof Access, Joint Tape and Mud for Drywall Board System.

<u>17-172-B05-Mud</u>	8/9/2017	Negative	ND	NONE DETECTED	ND
------------------------------	----------	----------	----	---------------	----

Sample Collected 17-172-B05-Mud, Area B, Mezzanine, Level Roof Access, Joint Tape and Mud for Drywall Board System.

<u>17-172-B06</u>	8/9/2017	Negative	ND	NONE DETECTED	ND
--------------------------	----------	----------	----	---------------	----

Sample Collected 17-172-B06, Area B, Mezzanine Level, Electrical Room, Drywall Board.

<u>17-172-B23-Mud</u>	8/9/2017	Positive	2	CHRYSTILE	CH
------------------------------	----------	----------	---	-----------	----

Sample Collected 17-172-B23-Mud, Area B, Storage Room B125, Joint Tape and Mud for Drywall Board.

<u>17-172-B24</u>	8/9/2017	Negative	ND	NONE DETECTED	ND
--------------------------	----------	----------	----	---------------	----

Sample Collected 17-172-B24, Area B, Storage Room B125, Drywall Board.

SAMPLES REPORT FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

ADMINISTRATION AND LIBRARY PODS BUILDING - "MAIN BUILDING"

ENTIRE BUILDING

SMOOTH WALL SURFACING

<u>17-172-A01-Skim</u>	8/9/2017	Negative	ND	NONE DETECTED	ND
-------------------------------	----------	----------	----	---------------	----

Sample Collected 17-172-A01-Skim Coat, Area A, Boy's Restroom A112, Skim Coat and Joint Mud for Drywall Board.

<u>17-172-B01</u>	8/9/2017	Negative	ND	NONE DETECTED	ND
--------------------------	----------	----------	----	---------------	----

Sample Collected 17-172-B01, Area B, Mezzanine, Level Electrical Room, Skim Coat Paint for Drywall Board System

<u>17-172-B02-Joint</u>	8/9/2017	Negative	ND	NONE DETECTED	ND
--------------------------------	----------	----------	----	---------------	----

Sample Collected 17-172-B02-Joint Tape, Area B, Mezzanine, Level Electrical Room, Joint Tape for Drywall Board System.

<u>17-172-B02-Mud</u>	8/9/2017	Positive	2	CHRYSTILE	CH
------------------------------	----------	----------	---	-----------	----

Sample Collected 17-172-B02-Mud, Area B, Mezzanine, Level Electrical Room, Mud for Drywall Board System.

<u>17-172-B04</u>	8/9/2017	Negative	ND	NONE DETECTED	ND
--------------------------	----------	----------	----	---------------	----

Sample Collected 17-172-B04, Area B, Mezzanine, Level Roof Access, Skim Coat Paint for Drywall Board System.

<u>17-172-B22</u>	8/9/2017	Positive	2	CHRYSTILE	CH
--------------------------	----------	----------	---	-----------	----

Sample Collected 17-172-B22, Area B, Storage Room B125, Skim Coat Paint for Drywall Board System.

ADMINISTRATION AND LIBRARY PODS BUILDING - "MAIN BUILDING"

EXTERIOR RESTROOM WALLS (STUDENT RESTROOMS)

FELT/PAPER LINER

<u>09-098AAA</u>	5/12/2009	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

ADMINISTRATION AND LIBRARY PODS BUILDING - "MAIN BUILDING"

EXTERIOR RESTROOM WALLS (STUDENT RESTROOMS)

ROUGH WALL

<u>09-098AAA</u>	5/12/2009	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

ADMINISTRATION AND LIBRARY PODS BUILDING - "MAIN BUILDING"

EXTERIOR RESTROOM WALLS (STUDENT RESTROOMS)

ROUGH WALL SURFACING

<u>09-098AAA</u>	5/12/2009	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

<u>17-172-A01-Skim</u>	8/9/2017	Negative	ND	NONE DETECTED	ND
-------------------------------	----------	----------	----	---------------	----

Sample Collected 17-172-A01-Skim Coat, Area A, Boy's Restroom A112, Skim Coat and Joint Mud for Drywall Board.

SAMPLES REPORT FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

ADMINISTRATION AND LIBRARY PODS BUILDING - "MAIN BUILDING"

EXTERIOR WALKWAYS AND OVERHANGS

FELT/PAPER LINER

<u>09-098AAA</u>	5/12/2009	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

ADMINISTRATION AND LIBRARY PODS BUILDING - "MAIN BUILDING"

EXTERIOR WALKWAYS AND OVERHANGS

ROUGH WALL

<u>09-098AAA</u>	5/12/2009	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

ADMINISTRATION AND LIBRARY PODS BUILDING - "MAIN BUILDING"

EXTERIOR WALKWAYS AND OVERHANGS

ROUGH WALL SURFACING

<u>09-098AAA</u>	5/12/2009	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

ADMINISTRATION AND LIBRARY PODS BUILDING - "MAIN BUILDING"

EXTERIOR WINDOWS

WINDOW SEALANT

<u>08-241AAA</u>	10/16/2008	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	------------	----------	---------	-----------	----

ADMINISTRATION AND LIBRARY PODS BUILDING - "MAIN BUILDING"

EXTERIOR WINDOWS

WINDOW SEALANT

<u>17-172-A11</u>	8/9/2017	Negative	ND	NONE DETECTED	ND
--------------------------	----------	----------	----	---------------	----

Sample Collected 17-172-A11, Area A, Office A101, Window Sealant.

<u>17-172-A12</u>	8/9/2017	Negative	ND	NONE DETECTED	ND
--------------------------	----------	----------	----	---------------	----

Sample Collected 17-172-A12, Area A, Office A105, (West) Window Sealant.

<u>17-172-B43</u>	8/9/2017	Negative	ND	NONE DETECTED	ND
--------------------------	----------	----------	----	---------------	----

Sample Collected 17-172-B43, Area B, Library B120 (West), Window Sealant.

<u>17-172-B44</u>	8/9/2017	Negative	ND	NONE DETECTED	ND
--------------------------	----------	----------	----	---------------	----

Sample Collected 17-172-B44, Area B, Library B120 (North Entryway), Window Sealant.

<u>17-172-B45</u>	8/9/2017	Negative	ND	NONE DETECTED	ND
--------------------------	----------	----------	----	---------------	----

Sample Collected 17-172-B45, Area B, Office B121A, Window Sealant.

SAMPLES REPORT FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

<u>17-172-B46</u>	8/9/2017	Negative	ND	NONE DETECTED	ND
--------------------------	----------	----------	----	---------------	----

Sample Collected 17-172-B46, Area B, Production Room, Window Sealant.

ADMINISTRATION AND LIBRARY PODS BUILDING - "MAIN BUILDING"

FOUR OFFICES, STORAGE ROOM OF LIBRARY, AND LIBRARY
 PRESSED WOOD WALL PANEL

<u>07-041AAA</u>	3/9/2007	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

<u>17-172-B28</u>	8/9/2017	Negative	ND	NONE DETECTED	ND
--------------------------	----------	----------	----	---------------	----

Sample Collected 17-172-B28, Area B, Storage B120B, Paint Texture on Wood Demising Walls.

ADMINISTRATION AND LIBRARY PODS BUILDING - "MAIN BUILDING"

FOUR OFFICES, STORAGE ROOM OF LIBRARY, AND LIBRARY
 PRESSED WOOD WALL PANEL MASTIC

<u>70-041AAA</u>	3/9/2007	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

ADMINISTRATION AND LIBRARY PODS BUILDING - "MAIN BUILDING"

FOUR OFFICES, STORAGE ROOM OF LIBRARY, AND LIBRARY
 VINYL WALL COVER MASTIC

<u>05-212AAA</u>	9/9/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

<u>17-172-B26</u>	8/9/2017	Negative	ND	NONE DETECTED	ND
--------------------------	----------	----------	----	---------------	----

Sample Collected 17-172-B26, Area B, Library B120, Adhesive for Vinyl Wall Cover.

ADMINISTRATION AND LIBRARY PODS BUILDING - "MAIN BUILDING"

HEALTH OFFICE, 2ND FLOOR STAFF'S LOUNGE ROOM, WORK ROOM, AND ADMINISTRATIVE ASSISTANT AREA
 SINK UNDERCOATING

<u>09-098AAA</u>	5/12/2009	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

ADMINISTRATION AND LIBRARY PODS BUILDING - "MAIN BUILDING"

LIBRARY, OFFICE OF LIBRARY, WORK ROOM, TEMP OFFICE, STORAGE ROOM, AND CORRIDOR BETWEEN
 ADMINISTRATION OFFICES AND LIBRARY
 SPRAY ON CEILING

<u>05-212AAA</u>	9/9/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

SAMPLES REPORT FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

ADMINISTRATION AND LIBRARY PODS BUILDING - "MAIN BUILDING"

LIBRARY STORAGE ROOM

DUCT INSULATION

<u>17-172-B29-Insulation</u>	8/9/2017	Negative	ND	NONE DETECTED	ND
-------------------------------------	----------	----------	----	---------------	----

Sample Collected 17-172-B29-Insulation, Area B, Storage B120B, Sub Ceiling (Soffit) Tape Materials on Fiberglass Duct Insulation.

<u>17-172-B29-Tape</u>	8/9/2017	Positive	3	CHRYSTOTILE	CH
-------------------------------	----------	----------	---	-------------	----

Duct Wrap Tape on Joints. Sample Collected 17-172-B29-Tape, Area B, Storage B120B, Sub Ceiling (Soffit) Tape Materials on Fiberglass Duct Insulation.

ADMINISTRATION AND LIBRARY PODS BUILDING - "MAIN BUILDING"

SECOND FLOOR STAFF LOUNGE ROOM PLENUM

SMOOTH WALL MISCELLANEOUS

<u>17-172-B19</u>	8/9/2017	Negative	ND	NONE DETECTED	ND
--------------------------	----------	----------	----	---------------	----

Sample Collected 17-172-B19, Area B, Production Room B123, Acoustical Ceiling Texture.

<u>17-172-B20</u>	8/9/2017	Negative	ND	NONE DETECTED	ND
--------------------------	----------	----------	----	---------------	----

Sample Collected 17-172-B20, Area B, Production Room B123, Acoustical Ceiling Texture.

<u>17-172-B21</u>	8/9/2017	Negative	ND	NONE DETECTED	ND
--------------------------	----------	----------	----	---------------	----

Sample Collected 17-172-B21, Area B, Storage Room B125, Acoustical Ceiling Texture.

SAMPLES REPORT FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

CLASSROOMS A1-A12, B1-B9, C1-C11 PODS BUILDING - "MAIN BUILDING"

CLASSROOMS A1-A12, B1-B9, C1-C11 PODS BUILDING - "MAIN BUILDING"

ALL ROOMS

SMOOTH WALL SURFACING

<u>09-212AAA</u>	9/9/2009	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

CLASSROOMS A1-A12, B1-B9, C1-C11 PODS BUILDING - "MAIN BUILDING"

ALL ROOMS, INCLUDING UPPER WALLS AND CEILING IN THE PLENUM (NO SKIM COAT)

SMOOTH WALL MISCELLANEOUS

<u>05-212AAA</u>	9/9/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

CLASSROOMS A1-A12, B1-B9, C1-C11 PODS BUILDING - "MAIN BUILDING"

CLASSROOM C-6

CEMENTITIOUS WALL PANEL

<u>09-098AAA</u>	5/12/2009	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS A1-A12, B1-B9, C1-C11 PODS BUILDING - "MAIN BUILDING"

CLASSROOMS A4, A9, A11, B1, B5, B7, C3, C6 AND C9

WINDOW SEALANT

<u>17-172-A28</u>	8/9/2017	Negative	ND	NONE DETECTED	ND
--------------------------	----------	----------	----	---------------	----

Sample Collected 17-172-A28, Area A, Classroom A4, Window Glazing Sealant.

<u>17-172-A29</u>	8/9/2017	Negative	ND	NONE DETECTED	ND
--------------------------	----------	----------	----	---------------	----

Sample Collected 17-172-A29, Area A, Classroom A9, Window Glazing Sealant.

<u>17-172-A30</u>	8/9/2017	Negative	ND	NONE DETECTED	ND
--------------------------	----------	----------	----	---------------	----

Sample Collected 17-172-A30, Area A, Classroom A11, Window Glazing Sealant.

<u>17-172-B47</u>	8/9/2017	Negative	ND	NONE DETECTED	ND
--------------------------	----------	----------	----	---------------	----

Sample Collected 17-172-B47, Area B, Classroom B1, Window Glazing Sealant.

<u>17-172-B48</u>	8/9/2017	Negative	ND	NONE DETECTED	ND
--------------------------	----------	----------	----	---------------	----

Sample Collected 17-172-B48, Area B, Classroom B5, Window Glazing Sealant.

<u>17-172-B49</u>	8/9/2017	Negative	ND	NONE DETECTED	ND
--------------------------	----------	----------	----	---------------	----

Sample Collected 17-172-B49, Area B, Classroom B7, Window Glazing Sealant.

<u>17-172-C15</u>	8/9/2017	Negative	ND	NONE DETECTED	ND
--------------------------	----------	----------	----	---------------	----

Sample Collected 17-172-C15, Area C, Classroom C3, Window Glazing Sealant.

SAMPLES REPORT FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

17-172-C16

8/9/2017

Negative

ND

NONE DETECTED

ND

Sample Collected 17-172-C16, Area C, Classroom C6, Window Glazing Sealant.

17-172-C17

8/9/2017

Negative

ND

NONE DETECTED

ND

Sample Collected 17-172-C17, Area C, Classroom C9, Window Glazing Sealant.

CLASSROOMS A1-A12, B1-B9, C1-C11 PODS BUILDING - "MAIN BUILDING"

EXTERIOR OVERHANGS

FELT/PAPER LINER

09-098AAA

5/12/2009

Positive

ASSUMED

NO SAMPLE

NS

CLASSROOMS A1-A12, B1-B9, C1-C11 PODS BUILDING - "MAIN BUILDING"

EXTERIOR OVERHANGS

ROUGH WALL

09-098AAA

5/12/2009

Positive

ASSUMED

NO SAMPLE

NS

CLASSROOMS A1-A12, B1-B9, C1-C11 PODS BUILDING - "MAIN BUILDING"

EXTERIOR OVERHANGS

ROUGH WALL SURFACING

09-098AAA

5/12/2009

Positive

ASSUMED

NO SAMPLE

NS

CLASSROOMS A1-A12, B1-B9, C1-C11 PODS BUILDING - "MAIN BUILDING"

PODS A, B, AND C

FIRE DOOR CORE INSULATION

22-024.NS

2/24/2022

Positive

ASSUMED

NO SAMPLE

NS

CLASSROOMS A1-A12, B1-B9, C1-C11 PODS BUILDING - "MAIN BUILDING"

PODS A, B, AND C

SINK UNDERCOATING

09-098AAA

5/12/2009

Positive

ASSUMED

NO SAMPLE

NS

SAMPLES REPORT FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

CLASSROOMS D1-D8 BUILDING

CLASSROOMS D1-D8 BUILDING

2 RESTROOMS AND ALL DRINKING FOUNTAINS
MORTAR MISCELLANEOUS

<u>08-241AAA</u>	10/16/2008	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	------------	----------	---------	-----------	----

CLASSROOMS D1-D8 BUILDING

CLASSROOM D-2
CEMENTITIOUS WALL PANEL

<u>09-098AAA</u>	5/12/2009	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS D1-D8 BUILDING

CLASSROOM D-2
CEMENTITIOUS WALL PANEL MASTIC

<u>09-098AAA</u>	5/12/2009	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS D1-D8 BUILDING

CLASSROOM D1
CEMENTITIOUS WALL PANEL

<u>05-212AAA</u>	9/9/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

CLASSROOMS D1-D8 BUILDING

CLASSROOMS D1, D2 AND D7
WINDOW SEALANT

<u>17-172-D19</u>	8/9/2017	Negative	ND	NONE DETECTED	ND
--------------------------	----------	----------	----	---------------	----

Sample Collected 17-172-D19, Area D, Classroom D1, Window Glazing Sealant.

<u>17-172-D20</u>	8/9/2017	Negative	ND	NONE DETECTED	ND
--------------------------	----------	----------	----	---------------	----

Sample Collected 17-172-D20, Area D, Classroom D2, Window Glazing Sealant.

<u>17-172-D21</u>	8/9/2017	Negative	ND	NONE DETECTED	ND
--------------------------	----------	----------	----	---------------	----

Sample Collected 17-172-D21, Area D, Classroom D7, Window Glazing Sealant.

CLASSROOMS D1-D8 BUILDING

CLASSROOMS D1, D2, AND D8
SINK UNDERCOATING

<u>10-174AAA</u>	9/2/2010	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

SAMPLES REPORT FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

CLASSROOMS D1-D8 BUILDING

ENTIRE BUILDING

FIRE DOOR CORE INSULATION

<u>22-024.NS</u>	2/24/2022	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS D1-D8 BUILDING

ENTIRE BUILDING (EXCEPT CLASSROOM D1, D8, RESTROOMS AND WATER HEATER CLOSET)

CEMENTITIOUS COUNTERTOP PANEL

<u>22-093AAA</u>	8/18/2022	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS D1-D8 BUILDING

ENTIRE BUILDING (INCLUDING OFFICES, STORAGE ROOMS, RESTROOMS, UTILITY ROOMS, AND HALLWAY)

SMOOTH WALL MISCELLANEOUS

<u>05-212AAA</u>	9/9/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

<u>17-172-D14</u>	8/9/2017	Negative	ND	NONE DETECTED	ND
--------------------------	----------	----------	----	---------------	----

Sample Collected 17-172-D14, Area D, Science Storage D12, Joint Mud for Water Damaged Drywall Board Ceiling.

<u>17-172-D15</u>	8/9/2017	Negative	ND	NONE DETECTED	ND
--------------------------	----------	----------	----	---------------	----

Sample Collected 17-172-D15, Area D, Science Storage D12, Water Damaged Drywall Board Ceiling.

CLASSROOMS D1-D8 BUILDING

ENTIRE BUILDING INCLUDING OFFICES, STORAGE ROOMS, RESTROOMS, UTILITY ROOMS, AND HALLWAY

SMOOTH WALL SURFACING

<u>06-223AAA</u>	8/25/2006	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

<u>17-172-D13</u>	8/9/2017	Negative	ND	NONE DETECTED	ND
--------------------------	----------	----------	----	---------------	----

Sample Collected 17-172-D13, Area D, Science Storage D12, Skim Coat (Paint) for Water Damaged Drywall Board Ceiling.

CLASSROOMS D1-D8 BUILDING

PLENUM / ATTIC OF CLASSROOMS D1-D7

SPRAY-ON CEILING TEXTURE

<u>08-075AAA</u>	4/18/2008	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS D1-D8 BUILDING

WATER HEATER CLOSET

BASEBOARD MASTIC

<u>06-223AAA</u>	8/25/2006	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

SAMPLES REPORT FOR
MORRILL MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE No.	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
COMMENTS					

CLASSROOMS P1-P2 PORTABLES BUILDING

CLASSROOMS P1-P2 PORTABLES BUILDING

PORTABLE CLASSROOMS P1-P2

PORTABLE BUILDING

05-212.NS

9/9/2005

Negative

NEW MATERIAL

NO SAMPLE

NS

New 2002 Construcion Relocatable Building per Manufacturer's Tag information.

SAMPLES REPORT FOR
MORRILL MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE NO.	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
COMMENTS					

METAL STORAGE CONTAINERS

METAL STORAGE CONTAINERS

METAL STORAGE CONTAINER (3 EA)

STORAGE CONTAINER

16-074.NS

3/18/2016

Negative

NEW MATERIAL

NO SAMPLE

NS

Metal Storage Structure.

SAMPLES REPORT FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

MULTI-PURPOSE, BOYS' & GIRLS' LOCKER ROOMS, AND MUSIC ROOM BUILDING

MULTI-PURPOSE, BOYS' & GIRLS' LOCKER ROOMS, AND MUSIC ROOM BUILDING

BOYS' AND GIRLS' RESTROOMS IN LOCKER ROOM AREA (OLD RESTROOMS)
CEMENTITIOUS WALL PANEL

<u>10-174AAA</u>	9/2/2010	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

MULTI-PURPOSE, BOYS' & GIRLS' LOCKER ROOMS, AND MUSIC ROOM BUILDING

BOYS' AND GIRLS' RESTROOMS IN LOCKER ROOM AREA (OLD RESTROOMS)
CEMENTITIOUS WALL PANEL MASTIC

<u>10-174AAA</u>	9/2/2010	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

MULTI-PURPOSE, BOYS' & GIRLS' LOCKER ROOMS, AND MUSIC ROOM BUILDING

CLASSROOMS E1 AND E2
SINK UNDERCOATING

<u>10-174AAA</u>	9/2/2010	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

MULTI-PURPOSE, BOYS' & GIRLS' LOCKER ROOMS, AND MUSIC ROOM BUILDING

ENTIRE BUILDING
SMOOTH WALL MISCELLANEOUS

<u>17-172-E22-Joint</u>	8/9/2017	Negative	ND	NONE DETECTED	ND
--------------------------------	----------	----------	----	---------------	----

Sample Collected 17-172-E22-Joint Tape, Area E, MechRoom, Joint Tape and Mud for Drywall Board.

<u>17-172-E22-Mud</u>	8/9/2017	Positive	2	CHRYSTILE	CH
------------------------------	----------	----------	---	-----------	----

Sample Collected 17-172-E22-Joint Mud, Area E, Mech Room, Joint Tape and Mud for Drywall Board.

<u>17-172-E23</u>	8/9/2017	Negative	ND	NONE DETECTED	ND
--------------------------	----------	----------	----	---------------	----

Sample Collected 17-172-E23, Area E, Mech Room, Drywall Board.

MULTI-PURPOSE, BOYS' & GIRLS' LOCKER ROOMS, AND MUSIC ROOM BUILDING

ENTIRE BUILDING
SMOOTH WALL SURFACING

<u>06-223AAA</u>	8/25/2006	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

MULTI-PURPOSE, BOYS' & GIRLS' LOCKER ROOMS, AND MUSIC ROOM BUILDING

EXTERIOR ENTRY TO MULTI-PURPOSE ROOM, KITCHEN, AND 2 SOFFITS (OF LOCKER ROOM)
ROUGH CEILING

<u>05-212AAA</u>	9/9/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

SAMPLES REPORT FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

MULTI-PURPOSE, BOYS' & GIRLS' LOCKER ROOMS, AND MUSIC ROOM BUILDING

EXTERIOR ENTRY TO MULTI-PURPOSE ROOM, KITCHEN, AND 2 SOFFITS (OF LOCKER ROOM)
 ROUGH CEILING SURFACING

<u>05-212AAA</u>	9/9/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

MULTI-PURPOSE, BOYS' & GIRLS' LOCKER ROOMS, AND MUSIC ROOM BUILDING

GIRLS AND BOYS LOCKER ROOM
 WINDOW SEALANT

<u>17-172-E24</u>	8/9/2017	Negative	ND	NONE DETECTED	ND
--------------------------	----------	----------	----	---------------	----

Sample Collected 17-172-E24, Area E, Girls Locker Room, Window Glazing Sealant.

<u>17-172-E25</u>	8/9/2017	Negative	ND	NONE DETECTED	ND
--------------------------	----------	----------	----	---------------	----

Sample Collected 17-172-E25, Area E, Boys Locker Room, Window Glazing Sealant.

MULTI-PURPOSE, BOYS' & GIRLS' LOCKER ROOMS, AND MUSIC ROOM BUILDING

HALLWAY TO KITCHEN, PLENUMS, AND OTHER INACCESSIBLE AREAS
 PIPE FITTING INSULATION

<u>06-223AAA</u>	3/9/2007	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

MULTI-PURPOSE, BOYS' & GIRLS' LOCKER ROOMS, AND MUSIC ROOM BUILDING

HALLWAY TO KITCHEN, PLENUMS, AND OTHER INACCESSIBLE AREAS
 PIPE RUN INSULATION

<u>06-223AAA</u>	3/9/2007	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

MULTI-PURPOSE, BOYS' & GIRLS' LOCKER ROOMS, AND MUSIC ROOM BUILDING

KITCHEN FREEZER
 CAULKING

<u>09-098AAA</u>	5/12/2009	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

MULTI-PURPOSE, BOYS' & GIRLS' LOCKER ROOMS, AND MUSIC ROOM BUILDING

MULTI-PURPOSE ROOM
 ROUGH WALL SURFACING

<u>05-212AAA</u>	9/9/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

SAMPLES REPORT FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE No. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

MULTI-PURPOSE, BOYS' & GIRLS' LOCKER ROOMS, AND MUSIC ROOM BUILDING

MUSIC ROOM E2

PRESSED WOOD WALL PANEL

<u>06-223AAA</u>	8/25/2006	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

MULTI-PURPOSE, BOYS' & GIRLS' LOCKER ROOMS, AND MUSIC ROOM BUILDING

MUSIC ROOM E2

PRESSED WOOD WALL PANEL MASTIC

<u>06-223AAA</u>	8/25/2006	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

MULTI-PURPOSE, BOYS' & GIRLS' LOCKER ROOMS, AND MUSIC ROOM BUILDING

MUSIC ROOM E2

SMOOTH WALL SURFACING

<u>06-223AAA</u>	8/25/2006	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

MULTI-PURPOSE, BOYS' & GIRLS' LOCKER ROOMS, AND MUSIC ROOM BUILDING

MUSIC ROOM E2

VINYL WALL COVER MASTIC

<u>06-223AAA</u>	8/25/2006	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

MULTI-PURPOSE, BOYS' & GIRLS' LOCKER ROOMS, AND MUSIC ROOM BUILDING

MUSIC ROOM LIBRARY (OFFICE)

FIRE DOOR CORE INSULATION

<u>05-212AAA</u>	9/9/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

MULTI-PURPOSE, BOYS' & GIRLS' LOCKER ROOMS, AND MUSIC ROOM BUILDING

UTILITY ROOM LOCATED IN P.E. STORAGE ROOM

TANK (HIGH TEMP) INSULATION

<u>05-212AAA</u>	9/9/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

MULTI-PURPOSE, BOYS' & GIRLS' LOCKER ROOMS, AND MUSIC ROOM BUILDING

WEIGHT ROOM, AND ROOM E1

CEMENTITIOUS WALL PANEL

<u>09-098AAA</u>	5/12/2009	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

SAMPLES REPORT FOR
MORRILL MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE NO.	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
COMMENTS					

MULTI-PURPOSE, BOYS' & GIRLS' LOCKER ROOMS, AND MUSIC ROOM BUILDING

WEIGHT ROOM, MULTI-PURPOSE ROOM, AND ROOM E1

SPRAY-ON CEILING TEXTURE

<u>05-212AAA</u>	9/9/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

SAMPLES REPORT FOR
MORRILL MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE NO.	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
COMMENTS					

YOUTH CENTER BUILDING

YOUTH CENTER BUILDING

YOUTH CENTER

PERMANENT BUILDING

05-212.NS

9/9/2005

Negative

NEW MATERIAL

NO SAMPLE

NS

End Of Report, Total Of 16 Pages

DAMAGE REPORT FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
RISK ASSESMENT CATEGORY	COMMENTS			

ADMINISTRATION AND LIBRARY PODS BUILDING - "MAIN BUILDING"

ADMINISTRATION AND LIBRARY PODS BUILDING - "MAIN BUILDING"

COMPUTER CLERK ROOM

CEMENTITIOUS WALL PANEL

40 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/09/2005	Cementitious Wall Panels. This Material is in GOOD condition as of this date.
10/16/2008	Damage Observed. <5% Physical Damage - in the form of One Panel with 1 hole. This Material is in FAIR condition overall. No other changes as of this date.
01/30/2020	This Material is unchanged as of this date.
08/31/2020	This Material is unchanged as of this date.
02/11/2021	This Material is unchanged as of this date.
08/12/2021	This Material is unchanged as of this date.
02/24/2022	This Material is unchanged as of this date.
08/18/2022	This Material is unchanged as of this date.
02/16/2023	This Material is unchanged as of this date.
08/17/2023	This Material is unchanged as of this date.
02/15/2024	This Material is unchanged as of this date.
08/15/2024	This Material is unchanged as of this date.
02/28/2025	This Material is unchanged as of this date.
09/18/2025	This Material is unchanged as of this date.

ADMINISTRATION AND LIBRARY PODS BUILDING - "MAIN BUILDING"

ENTIRE BUILDING

SMOOTH WALL MISCELLANEOUS

43,600 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/09/2005	Gypsum Wallboard System, Walls and Ceilings. Material exists above Suspended Ceiling Tile. Existing Gypsum Wallboard Systems Removed and Replaced with new in-kind in Path-of-Construction. This Material is in GOOD condition as of this date.
------------	---

DAMAGE REPORT FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME		QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
LOCATION	MATERIAL TYPE		
RISK ASSESMENT CATEGORY			
COMMENTS			

08/09/2017	Sample Collected 17-172-A02, Area A, Boy's Restroom A112, Drywall Board. Sample Collected 17-172-B03, Area B, Mezzanine Level, Electrical Room, Drywall Board. Sample Collected 17-172-B05-Joint Tape, Area B, Mezzanine, Level Roof Access, Joint Tape and Mud for Drywall Board System. Sample Collected 17-172-B05-Mud, Area B, Mezzanine, Level Roof Access, Joint Tape and Mud for Drywall Board System. Sample Collected 17-172-B06, Area B, Mezzanine Level, Electrical Room, Drywall Board. Sample Collected 17-172-B23-Mud, Area B, Storage Room B125, Joint Tape and Mud for Drywall Board. Sample Collected 17-172-B24, Area B, Storage Room B125, Drywall Board.		
08/30/2017	<5% Physical Damage Observed. Corner of the Wall in the Custodial Office has 2 SF of Physical Damage. No other Damages as of this date.		
01/30/2020	This Material is unchanged as of this date.		
08/31/2020	This Material is unchanged as of this date.		
02/11/2021	This Material is unchanged as of this date.		
08/12/2021	This Material is unchanged as of this date.		
02/24/2022	This Material is unchanged as of this date.		
08/18/2022	This Material is unchanged as of this date.		
02/16/2023	This Material is unchanged as of this date.		
08/17/2023	This Material is unchanged as of this date.		
02/15/2024	This Material is unchanged as of this date.		
08/15/2024	This Material is unchanged as of this date.		
02/28/2025	This Material is unchanged as of this date.		
09/18/2025	This Material is unchanged as of this date.		

ADMINISTRATION AND LIBRARY PODS BUILDING - "MAIN BUILDING"

ENTIRE BUILDING

SMOOTH WALL SURFACING	43,600 SF	P: Less Than 5%
		W: No Evidence

DAMAGED FRIABLE SURFACING ACM

09/09/2005	Skim Coat for Gypsum Wallboard System, Walls and Ceilings. Material exists above Suspended Ceiling Tile. Existing Gypsum Wallboard Systems Removed and Replaced with new in-kind in Path-of-Construction. This Material is in GOOD condition as of this date.		
08/09/2017	Sample Collected 17-172-A01-Skim Coat, Area A, Boy's Restroom A112, Skim Coat and Joint Mud for Drywall Board. Sample Collected 17-172-B01, Area B, Mezzanine, Level Electrical Room, Skim Coat Paint for Drywall Board System. Sample Collected 17-172-B02-Joint Tape, Area B, Mezzanine, Level Electrical Room, Joint Tape for Drywall Board System. Sample Collected 17-172-B02-Mud, Area B, Mezzanine, Level Electrical Room, Mud for Drywall Board System. Sample Collected 17-172-B04, Area B, Mezzanine, Level Roof Access, Skim Coat Paint for Drywall Board System. Sample Collected 17-172-B22, Area B, Storage Room B125, Skim Coat Paint for Drywall Board System.		

DAMAGE REPORT FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RISK ASSESSMENT CATEGORY

COMMENTS

QTY
(APPROXIMATE)

PHYSICAL DAMAGE (P:)
WATER DAMAGE (W:)

08/30/2017	<5% Physical Damage Observed. Corner of the Wall in the Custodial Office has 2 SF of Physical Damage. No other Damages as of this date.
01/30/2020	This Material is unchanged as of this date.
08/31/2020	This Material is unchanged as of this date.
02/11/2021	This Material is unchanged as of this date.
08/12/2021	This Material is unchanged as of this date.
02/24/2022	This Material is unchanged as of this date.
08/18/2022	This Material is unchanged as of this date.
02/16/2023	This Material is unchanged as of this date.
08/17/2023	This Material is unchanged as of this date.
02/15/2024	This Material is unchanged as of this date.
08/15/2024	This Material is unchanged as of this date.
02/28/2025	This Material is unchanged as of this date.
09/18/2025	This Material is unchanged as of this date.

ADMINISTRATION AND LIBRARY PODS BUILDING - "MAIN BUILDING"

FOUR OFFICES, STORAGE ROOM OF LIBRARY, AND LIBRARY

VINYL WALL COVER MASTIC

2,700 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/09/2005	Mastic/Adhesive for Vinyl Wall Cover, (on 4'x10' Pressed Wood Wall Panel). This Material is in GOOD condition as of this date.
08/07/2017	Sample Collected 17-172-B26, Area B, Library B120, Adhesive for Vinyl Wall Cover.
01/30/2020	This Material is unchanged as of this date.
08/31/2020	This Material is unchanged as of this date.
02/11/2021	Damage Observed. <5% Physical Damage in the form of 2 SF of Vinyl Wall Cover Peeling and becoming Loose on West end of Library. Material condition changed from GOOD to FAIR overall. Friability updated from Non-Friable to Friable. No other changes as of this date.
08/12/2021	This Material is unchanged as of this date.
02/24/2022	This Material is unchanged as of this date.
08/18/2022	This Material is unchanged as of this date.
02/16/2023	This Material is unchanged as of this date.
08/17/2023	This Material is unchanged as of this date.

DAMAGE REPORT FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RISK ASSESSMENT CATEGORY

COMMENTS

QTY
(APPROXIMATE)

PHYSICAL DAMAGE (P:)
WATER DAMAGE (W:)

02/15/2024 This Material is unchanged as of this date.

08/15/2024 This Material is unchanged as of this date.

02/28/2025 This Material is unchanged as of this date.

09/18/2025 This Material is unchanged as of this date.

ADMINISTRATION AND LIBRARY PODS BUILDING - "MAIN BUILDING"

LIBRARY, OFFICE OF LIBRARY, WORK ROOM, TEMP OFFICE, STORAGE ROOM, AND CORRIDOR BETWEEN ADMINISTRATION OFFICES AND LIBRARY

SPRAY ON CEILING

8,400 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/09/2005 Spray-on Ceiling Texture. This Material is in GOOD condition as of this date.

03/09/2007 Damage Observed. <5% Physical Damage - in the form of minor flaking condition observed in Main Corridor of Library and Main Office, and above Counselor's Office, in Book Storage Room, next to I-Beam above Work Room. This Material is in FAIR condition overall. No other changes as of this date.

03/09/2010 Location Description changed from LIBRARY, OFFICE OF LIBRARY, WORK ROOM, TEMP OFFICE, AND ONE STORAGE ROOM to LIBRARY, OFFICE OF LIBRARY, WORK ROOM, TEMP OFFICE, STORAGE ROOM, AND CORRIDOR BETWEEN ADMINISTRATION OFFICES AND LIBRARY. Quantity changed from 6,400 SF to 8,400 SF. No other changes as of this date.

01/30/2020 This Material is unchanged as of this date.

08/31/2020 This Material is unchanged as of this date.

02/11/2021 This Material is unchanged as of this date.

08/12/2021 This Material is unchanged as of this date.

02/24/2022 This Material is unchanged as of this date.

08/18/2022 This Material is unchanged as of this date.

02/16/2023 This Material is unchanged as of this date.

08/17/2023 This Material is unchanged as of this date.

02/15/2024 This Material is unchanged as of this date.

08/15/2024 This Material is unchanged as of this date.

02/28/2025 This Material is unchanged as of this date.

09/18/2025 This Material is unchanged as of this date.

DAMAGE REPORT FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESSMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	--------------------------	----------	----------------------	---

CLASSROOMS D1-D8 BUILDING

CLASSROOMS D1-D8 BUILDING

CLASSROOMS D1, D2 AND D7

WINDOW SEALANT

TBD

TBD

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

10/09/2012	Putty/Sealant on Interior side of Exterior Windows. Sample Collected 17-172-D19, Area D, Classroom D1, Window Glazing Sealant. Sample Collected 17-172-D20, Area D, Classroom D2, Window Glazing Sealant. Sample Collected 17-172-D21, Area D, Classroom D7, Window Glazing Sealant.
01/30/2020	This Material is unchanged as of this date.
08/31/2020	This Material is unchanged as of this date.
02/11/2021	This Material is unchanged as of this date.
08/12/2021	This Material is unchanged as of this date.
02/24/2022	This Material is unchanged as of this date.
08/18/2022	This Material is unchanged as of this date.
02/16/2023	Damage Observed. <5% Physical Damage - in the form of 2 LF of Cracks on both Windows of Classroom D7 4 LF in total. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.
08/17/2023	This Material is unchanged as of this date.
02/15/2024	This Material is unchanged as of this date.
08/15/2024	This Material is unchanged as of this date.
02/28/2025	This Material is unchanged as of this date.
09/18/2025	This Material is unchanged as of this date.

CLASSROOMS D1-D8 BUILDING

ENTIRE BUILDING (INCLUDING OFFICES, STORAGE ROOMS, RESTROOMS, UTILITY ROOMS, AND HALLWAY)

SMOOTH WALL MISCELLANEOUS

10,740 SF

P: Less Than 5%

W: <10% Stains or Flaking

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/09/2005	Gypsum Wallboard System, Walls and Ceilings. Existing Gypsum Wallboard Systems Removed and Replaced with new in-kind in Path-of-Construction. This Material is in GOOD condition as of this date.
04/18/2008	Water Heater Closet <10% Water Damage and <5% Physical Damage in the form of 5 SF of Water Damage behind the Water Heater, 2 SF is Damaged next to Ceiling flue opening, and several holes and cuts in various locations. This Material is in FAIR condition overall as of this date.

DAMAGE REPORT FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

09/16/2015	Additional Damage observed, Room D1 has 1 SF of Physical Damage, Exterior Boys' Restroom has small holes on ceiling and Small Storage Room by D3 has minor holes. No other changes as of this date.					
08/09/2017	Sample Collected 17-172-D14, Area D, Science Storage D12, Joint Mud for Water Damaged Drywall Board Ceiling. Sample Collected 17-172-D15, Area D, Science Storage D12, Water Damaged Drywall Board Ceiling.					
08/09/2018	Additional Damage Observed. 5 Small holes in Ceiling conduit in Classroom D8. No other changes as of this date.					
01/30/2020	This Material is unchanged as of this date.					
08/31/2020	This Material is unchanged as of this date.					
02/11/2021	This Material is unchanged as of this date.					
08/12/2021	This Material is unchanged as of this date.					
02/24/2022	This Material is unchanged as of this date.					
08/18/2022	This Material is unchanged as of this date.					
02/16/2023	This Material is unchanged as of this date.					
08/17/2023	This Material is unchanged as of this date.					
02/15/2024	This Material is unchanged as of this date.					
08/15/2024	This Material is unchanged as of this date.					
02/28/2025	This Material is unchanged as of this date.					
09/18/2025	This Material is unchanged as of this date.					

CLASSROOMS D1-D8 BUILDING

ENTIRE BUILDING INCLUDING OFFICES, STORAGE ROOMS, RESTROOMS, UTILITY ROOMS, AND HALLWAY

SMOOTH WALL SURFACING	10,740 SF	P: Less Than 5% W: <10% Stains or Flaking
-----------------------	-----------	--

DAMAGED FRIABLE SURFACING ACM

08/25/2006	Skim Coat for Gypsum Wallboard System, Walls and Ceilings. Existing Gypsum Wallboard Systems Removed and Replaced with new in-kind in Path-of-Construction. This Material is in GOOD condition as of this date.					
04/18/2008	Water Heater Closet <10% Water Damage and <5% Physical Damage in the form of 5 SF of Water Damage behind the Water Heater, 2 SF is Damaged next to Ceiling flue opening, and several holes and cuts in various locations. This Material is in FAIR condition overall as of this date.					
09/16/2015	Additional Damage observed, Room D1 has 1 SF of Physical Damage, Exterior Boys' Restroom has small holes on ceiling and Small Storage Room by D3 has minor holes. No other changes as of this date.					
08/09/2017	Sample Collected 17-172-D13, Area D, Science Storage D12, Skim Coat (Paint) for Water Damaged Drywall Board Ceiling.					

DAMAGE REPORT FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RISK ASSESMENT CATEGORY

COMMENTS

QTY

(APPROXIMATE)

PHYSICAL DAMAGE (P:)

WATER DAMAGE (W:)

08/09/2018	Additional Damage Observed. 5 Small holes in Ceiling conduit in Classroom D8. No other changes as of this date.
01/30/2020	This Material is unchanged as of this date.
08/31/2020	This Material is unchanged as of this date.
02/11/2021	This Material is unchanged as of this date.
08/12/2021	This Material is unchanged as of this date.
02/24/2022	This Material is unchanged as of this date.
08/18/2022	This Material is unchanged as of this date.
02/16/2023	This Material is unchanged as of this date.
08/17/2023	This Material is unchanged as of this date.
02/15/2024	This Material is unchanged as of this date.
08/15/2024	This Material is unchanged as of this date.
02/28/2025	This Material is unchanged as of this date.
09/18/2025	This Material is unchanged as of this date.

CLASSROOMS D1-D8 BUILDING

WATER HEATER CLOSET

BASEBOARD MASTIC

30 LF

P: Greater Than 75% With

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

08/25/2006	Mastic/Adhesive for 4" Brown Baseboard. This Material is in GOOD condition as of this date.
09/16/2015	Damage observed, 100% of Baseboard is missing and Mastic/Adhesive is exposed. Material condition changed from GOOD to POOR. Friability changed from Non-Friable to Friable. No other changes as of this date.
01/30/2020	This Material is unchanged as of this date.
08/31/2020	This Material is unchanged as of this date.
02/11/2021	This Material is unchanged as of this date.
08/12/2021	This Material is unchanged as of this date.
02/24/2022	This Material is unchanged as of this date.
08/18/2022	This Material is unchanged as of this date.
02/16/2023	This Material is unchanged as of this date.
08/17/2023	This Material is unchanged as of this date.

DAMAGE REPORT FOR
MORRILL MIDDLE SCHOOL

BUILDING NAME		QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
LOCATION	MATERIAL TYPE		
RISK ASSESMENT CATEGORY			
COMMENTS			

02/15/2024	This Material is unchanged as of this date.
08/15/2024	This Material is unchanged as of this date.
02/28/2025	This Material is unchanged as of this date.
09/18/2025	This Material is unchanged as of this date.

DAMAGE REPORT FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RISK ASSESSMENT CATEGORY

COMMENTS

QTY
(APPROXIMATE)

PHYSICAL DAMAGE (P:)
WATER DAMAGE (W:)

MULTI-PURPOSE, BOYS' & GIRLS' LOCKER ROOMS, AND MUSIC ROOM BUILDING

MULTI-PURPOSE, BOYS' & GIRLS' LOCKER ROOMS, AND MUSIC ROOM BUILDING

ENTIRE BUILDING

SMOOTH WALL MISCELLANEOUS

46,600 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/09/2005	Gypsum Wallboard System, Walls and Ceilings. This Material is in GOOD condition as of this date.
08/09/2017	Sample Collected 17-172-E22-Joint Tape, Area E, Mech Room, Joint Tape and Mud for Drywall Board. Sample Collected 17-172-E22-Joint Mud, Area E, Mech Room, Joint Tape and Mud for Drywall Board. Sample Collected 17-172-E23, Area E, Mech Room, Drywall Board.
01/30/2020	This Material is unchanged as of this date.
08/31/2020	This Material is unchanged as of this date.
02/11/2021	This Material is unchanged as of this date.
08/12/2021	This Material is unchanged as of this date.
02/24/2022	This Material is unchanged as of this date.
08/18/2022	Damages Observed. <5% Physical Damage in the form of 2 SF of Cuts and Holes on Walls and Ceiling of Mechanical/Electrical Room. Material condition changed from GOOD to FAIR overall. No other changes as of this date.
02/16/2023	This Material is unchanged as of this date.
08/17/2023	This Material is unchanged as of this date.
02/15/2024	This Material is unchanged as of this date.
08/15/2024	This Material is unchanged as of this date.
02/28/2025	This Material is unchanged as of this date.
09/18/2025	This Material is unchanged as of this date.

MULTI-PURPOSE, BOYS' & GIRLS' LOCKER ROOMS, AND MUSIC ROOM BUILDING

ENTIRE BUILDING

SMOOTH WALL SURFACING

46,600 SF

P: Less Than 5%

W: No Evidence

DAMAGED FRIABLE SURFACING ACM

08/25/2006	Skim Coat for Gypsum Wallboard System Walls and Ceilings. This Material is in GOOD condition as of this date.
01/30/2020	This Material is unchanged as of this date.
08/31/2020	This Material is unchanged as of this date.

DAMAGE REPORT FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME		QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
LOCATION	MATERIAL TYPE		
RISK ASSESMENT CATEGORY			
COMMENTS			

02/11/2021	This Material is unchanged as of this date.
08/12/2021	This Material is unchanged as of this date.
02/24/2022	This Material is unchanged as of this date.
08/18/2022	Damages Observed. <5% Physical Damage in the form of 2 SF of Cuts and Holes on Walls and Ceiling of Mechanical/Electrical Room. Material condition changed from GOOD to FAIR overall. No other changes as of this date.
02/16/2023	This Material is unchanged as of this date.
08/17/2023	This Material is unchanged as of this date.
02/15/2024	This Material is unchanged as of this date.
08/15/2024	This Material is unchanged as of this date.
02/28/2025	This Material is unchanged as of this date.
09/18/2025	This Material is unchanged as of this date.

MULTI-PURPOSE, BOYS' & GIRLS' LOCKER ROOMS, AND MUSIC ROOM BUILDING

MULTI-PURPOSE ROOM

ROUGH WALL SURFACING	200 SF	P: Less Than 5% W: No Evidence
----------------------	--------	-----------------------------------

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/09/2005	Stucco on Cinder Blocks. This Material is in good condition as of this date.
03/31/2017	Damage Observed. <5% Physical Damage - in the form of 20 LF surface damage around Kitchen Roll-Up Door. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.
01/30/2020	This Material is unchanged as of this date.
08/31/2020	This Material is unchanged as of this date.
02/11/2021	This Material is unchanged as of this date.
08/12/2021	This Material is unchanged as of this date.
02/24/2022	This Material is unchanged as of this date.
08/18/2022	This Material is unchanged as of this date.
02/16/2023	This Material is unchanged as of this date.
08/17/2023	This Material is unchanged as of this date.
02/15/2024	This Material is unchanged as of this date.
08/15/2024	This Material is unchanged as of this date.
02/28/2025	This Material is unchanged as of this date.

DAMAGE REPORT FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME		QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
LOCATION	MATERIAL TYPE		
RISK ASSESMENT CATEGORY			
COMMENTS			

09/18/2025 This Material is unchanged as of this date.

MULTI-PURPOSE, BOYS' & GIRLS' LOCKER ROOMS, AND MUSIC ROOM BUILDING

MUSIC ROOM E2

PRESSED WOOD WALL PANEL	1,200 SF	P: Less Than 5% W: No Evidence
-------------------------	----------	---

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

08/25/2006	4'x8' Glued-On Wall Panels (with Vinyl Wall Cover with Acoustic Paint/Finish Texture). This Material is in GOOD condition as of this date.
08/25/2006	This Material is unchanged as of this date.
01/30/2020	This Material is unchanged as of this date.
08/31/2020	Damage Observed. <5% Physical Damage in the form of 2 Panels Detaching from Wall. Material condition changed from GOOD to FAIR overall. Friability updated from Non-Friable to Friable. No other changes as of this date.
02/11/2021	This Material is unchanged as of this date.
08/12/2021	This Material is unchanged as of this date.
02/24/2022	This Material is unchanged as of this date.
08/18/2022	This Material is unchanged as of this date.
02/16/2023	This Material is unchanged as of this date.
08/17/2023	This Material is unchanged as of this date.
02/15/2024	This Material is unchanged as of this date.
08/15/2024	This Material is unchanged as of this date.
02/28/2025	This Material is unchanged as of this date.

MULTI-PURPOSE, BOYS' & GIRLS' LOCKER ROOMS, AND MUSIC ROOM BUILDING

MUSIC ROOM E2

PRESSED WOOD WALL PANEL MASTIC	1,200 SF	P: Less Than 5% W: No Evidence
--------------------------------	----------	---

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

08/25/2006	Mastic/Adhesive for 4'x8' Glued-On Wall Panels (with Vinyl Wall Cover with Acoustic Paint/Finish Texture). This Material is in GOOD condition as of this date.
08/25/2006	This Material is unchanged as of this date.
01/30/2020	This Material is unchanged as of this date.

DAMAGE REPORT FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME**LOCATION****MATERIAL TYPE****RISK ASSESSMENT CATEGORY****COMMENTS****QTY
(APPROXIMATE)****PHYSICAL DAMAGE (P:)
WATER DAMAGE (W:)**

08/31/2020	Damage Observed. <5% Physical Damage in the form of 2 Panels Detaching from Wall. Material condition changed from GOOD to FAIR overall. Friability updated from Non-Friable to Friable. No other changes as of this date.
02/11/2021	This Material is unchanged as of this date.
08/12/2021	This Material is unchanged as of this date.
02/24/2022	This Material is unchanged as of this date.
08/18/2022	This Material is unchanged as of this date.
02/16/2023	This Material is unchanged as of this date.
08/17/2023	This Material is unchanged as of this date.
02/15/2024	This Material is unchanged as of this date.
08/15/2024	This Material is unchanged as of this date.
02/28/2025	This Material is unchanged as of this date.

MULTI-PURPOSE, BOYS' & GIRLS' LOCKER ROOMS, AND MUSIC ROOM BUILDING**MUSIC ROOM E2**

VINYL WALL COVER MASTIC

1,200 SF

P: Less Than 5%**W:** No Evidence**DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM**

08/25/2006	Mastic/Adhesive for Vinyl Wall Cover with Acoustic Paint/Finish Texture on 4'x8' Glued-On Wall Panels . This Material is in GOOD condition as of this date.
08/25/2006	This Material is unchanged as of this date.
03/31/2017	Damage Observed. <5% Physical Damage - in the form of 2 LF Acoustic Material is peeling from the wall. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.
08/09/2018	Repairs observed. Damages repaired as of this date. Material Condition changed from FAIR to GOOD. No other changes as of this date.
01/30/2020	This Material is unchanged as of this date.
08/31/2020	Damage Observed. <5% Physical Damage in the form of 2 Panels Detaching from Wall. Material condition changed from GOOD to FAIR overall. Friability updated from Non-Friable to Friable. No other changes as of this date.
02/11/2021	This Material is unchanged as of this date.
08/12/2021	This Material is unchanged as of this date.
02/24/2022	This Material is unchanged as of this date.
08/18/2022	This Material is unchanged as of this date.

DAMAGE REPORT FOR

MORRILL MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RISK ASSESMENT CATEGORY

COMMENTS

QTY
(APPROXIMATE)

PHYSICAL DAMAGE (P:)
WATER DAMAGE (W:)

02/16/2023 This Material is unchanged as of this date.

08/17/2023 This Material is unchanged as of this date.

02/15/2024 This Material is unchanged as of this date.


08/15/2024 This Material is unchanged as of this date.

02/28/2025 This Material is unchanged as of this date.

End Of Report, Total Of 13 Pages

MAP OF MORRILL


MORRILL MIDDLE SCHOOL
INSPECTED ON: 9-18-85

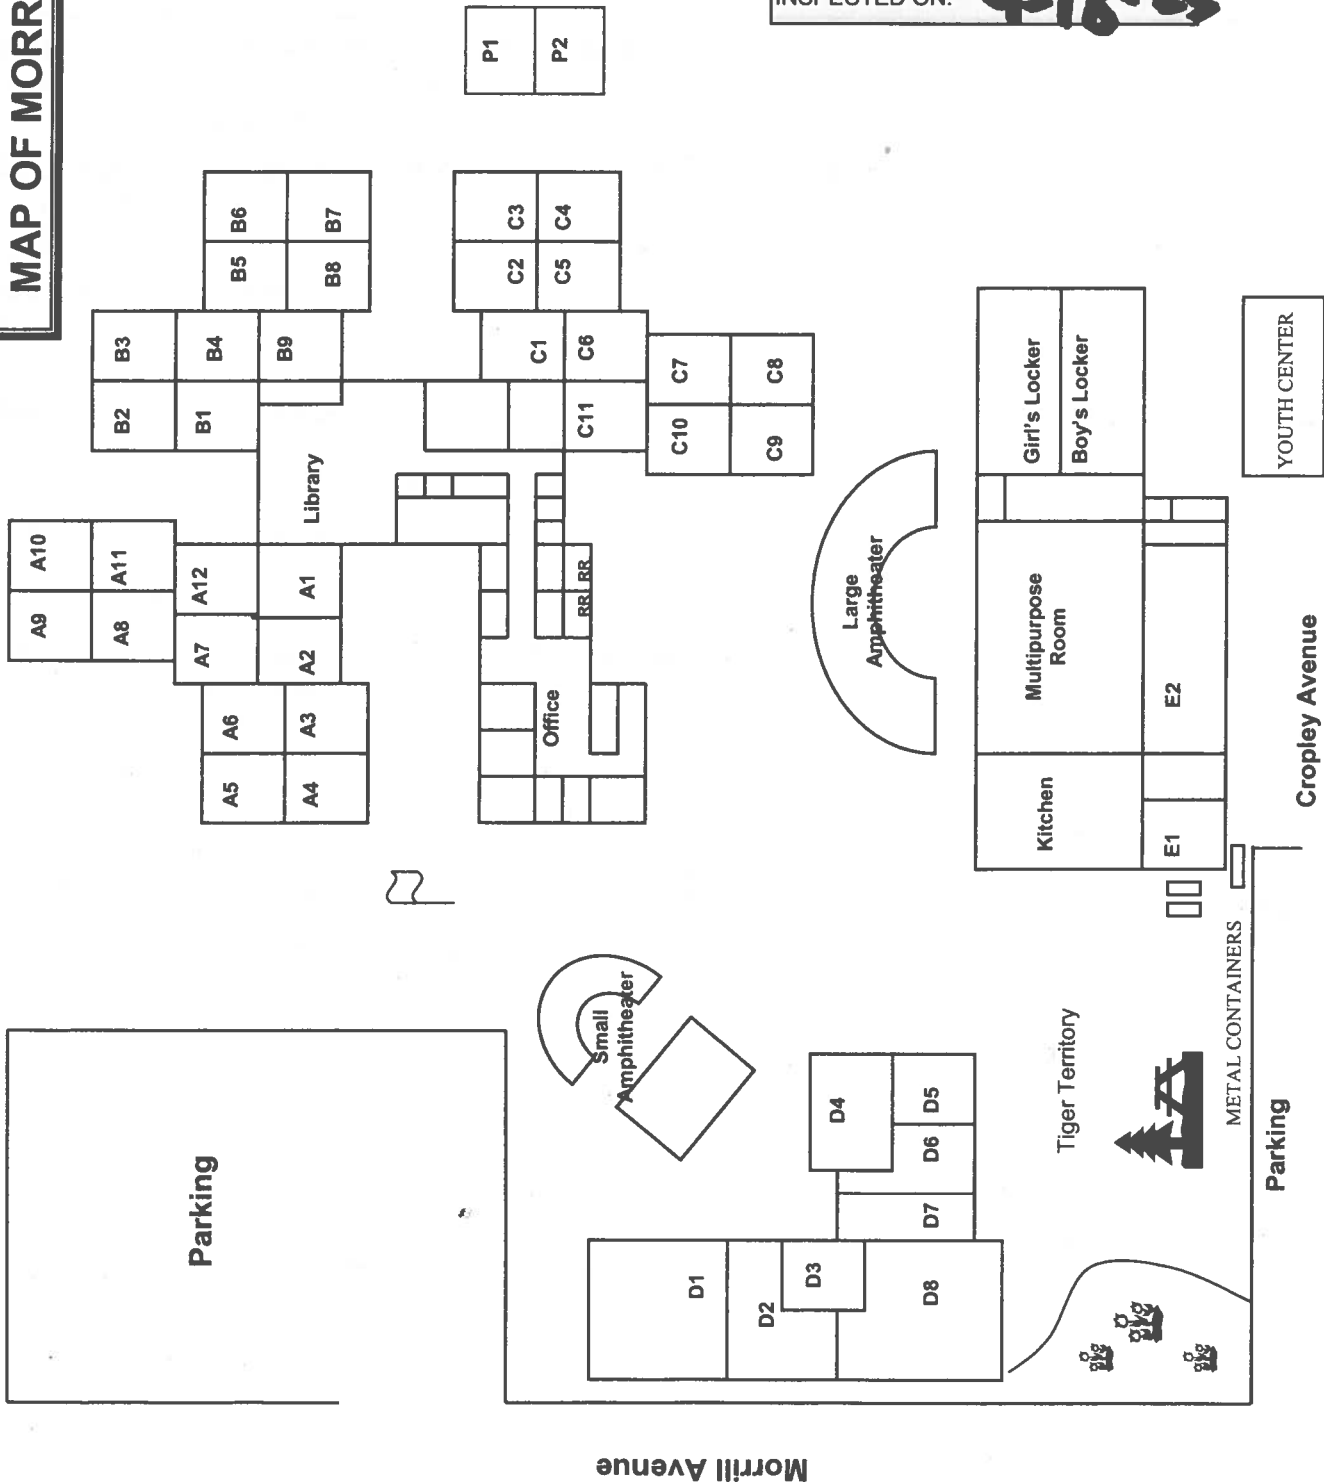

MAP OF MORRILL

MORRILL MIDDLE SCHOOL
INSPECTED ON: **2-28-25**

P1	P2
----	----

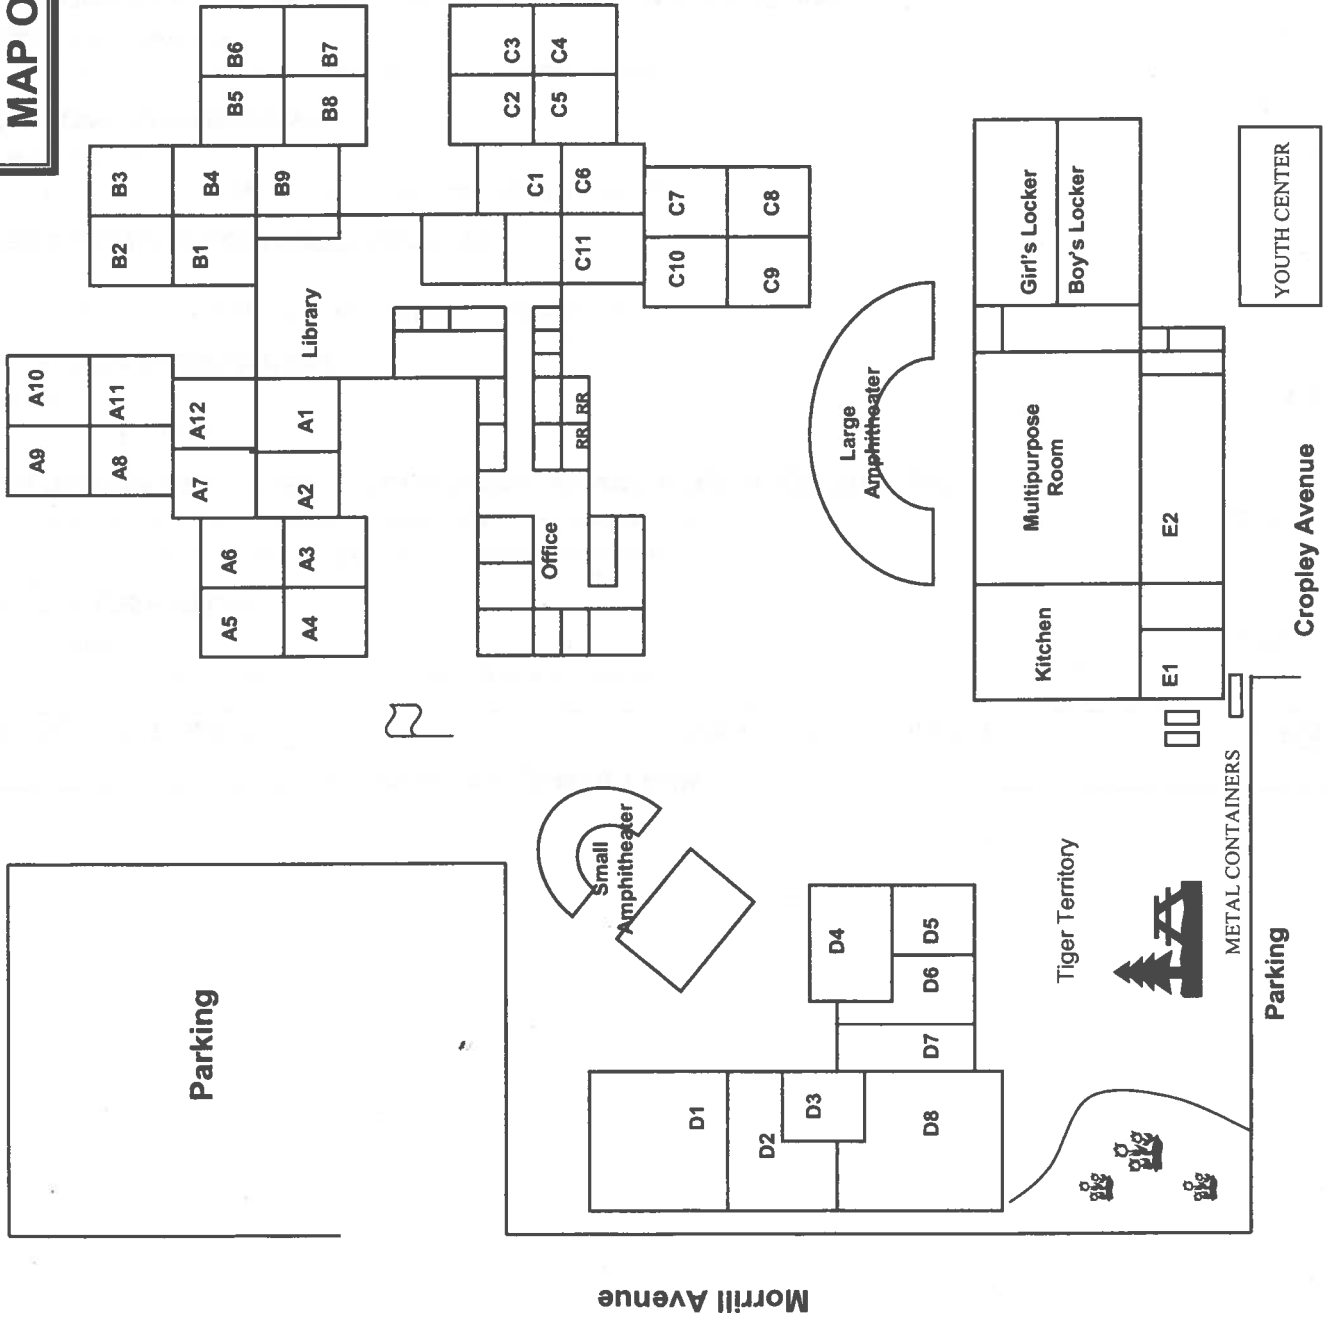


YOUTH CENTER

Cropley Avenue

Morrill Avenue


MAP OF MORRILL

MORRILL MIDDLE SCHOOL
INSPECTED ON: 8-15-24

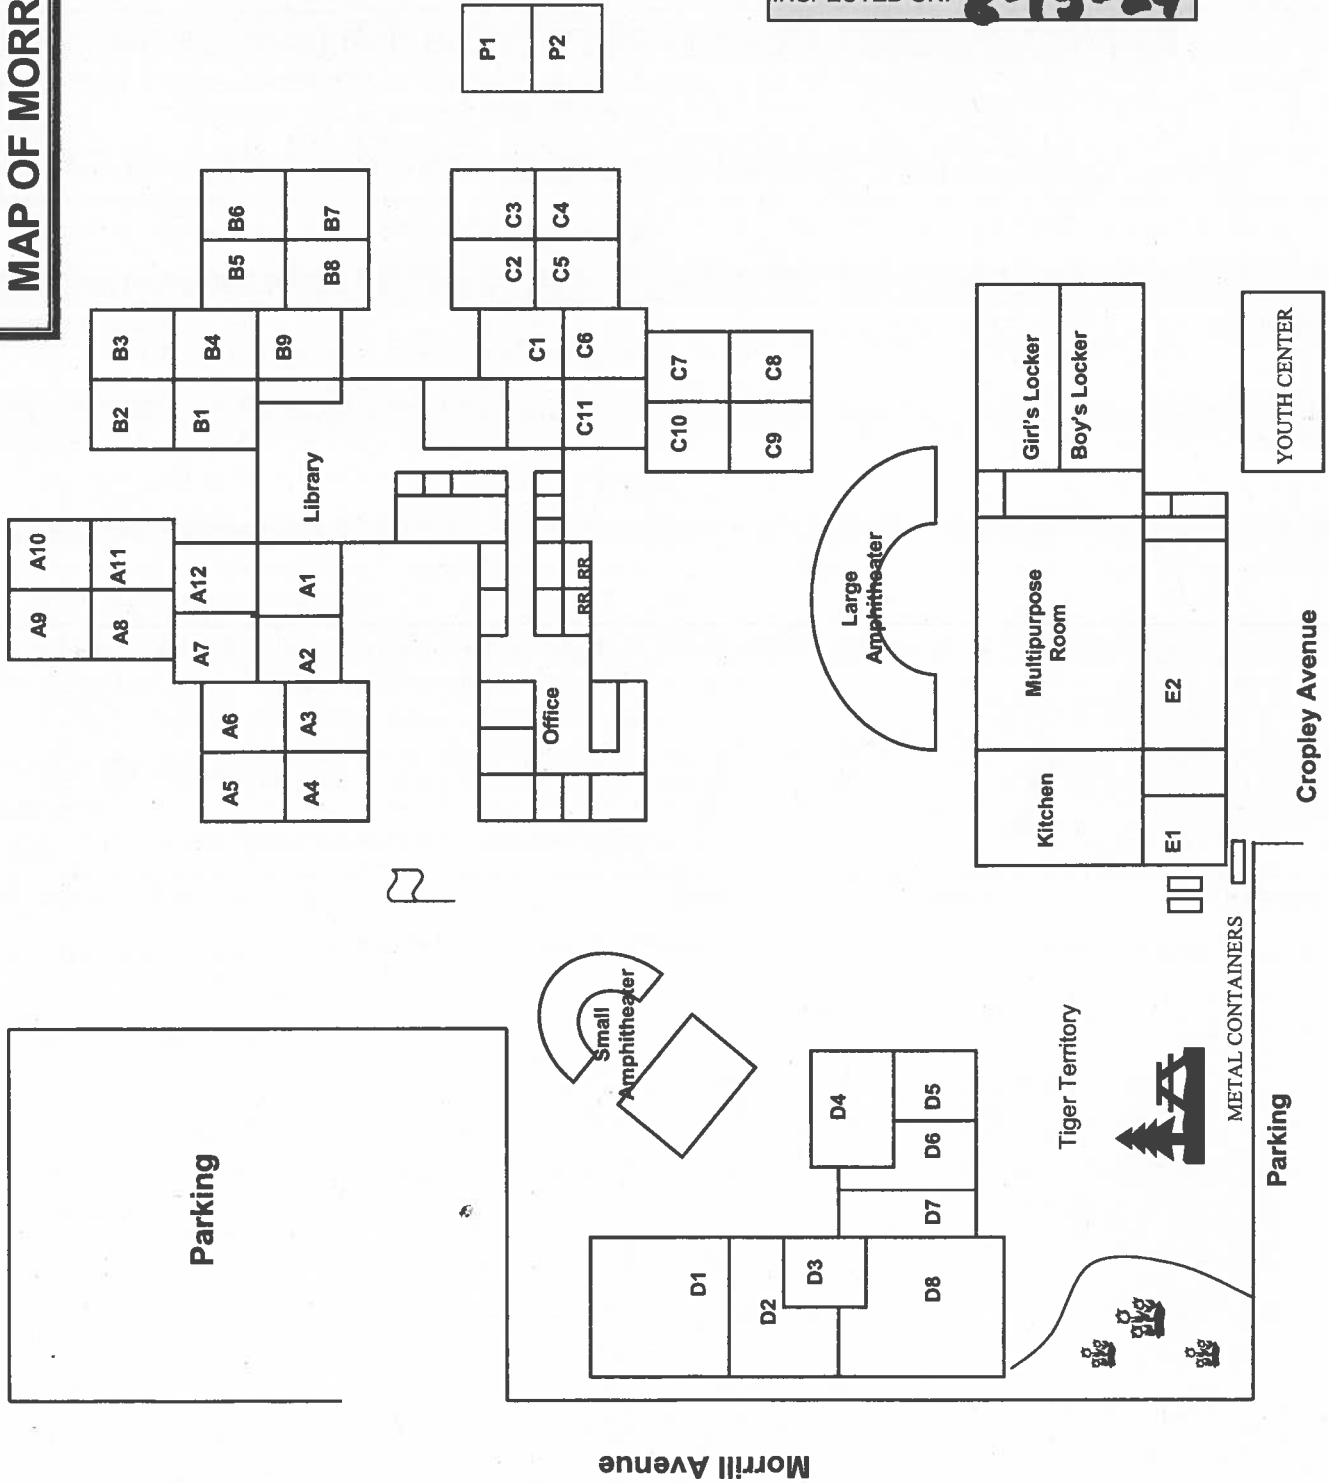


MAP OF MORRILL

MORRILL MIDDLE SCHOOL
INSPECTED ON: 2-15-24

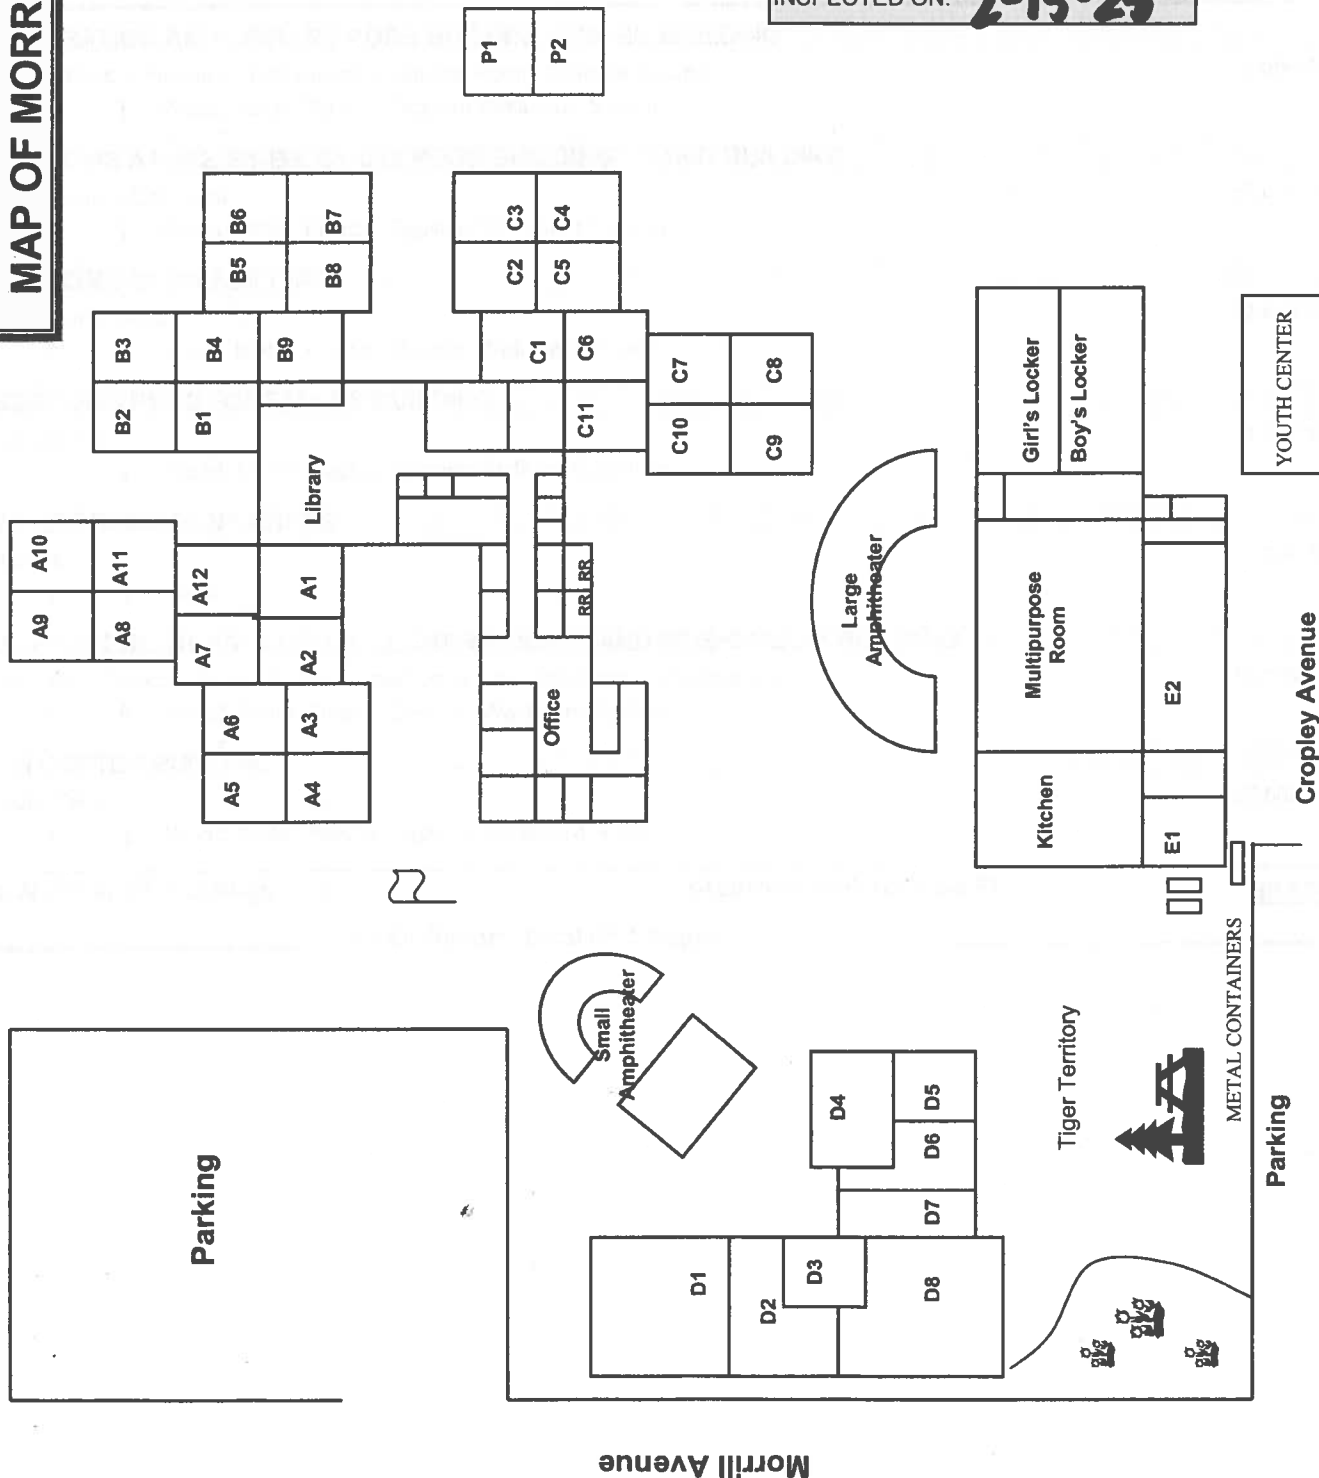


MAP OF MORRILL

MORRILL MIDDLE SCHOOL
INSPECTED ON: 08-17-2023

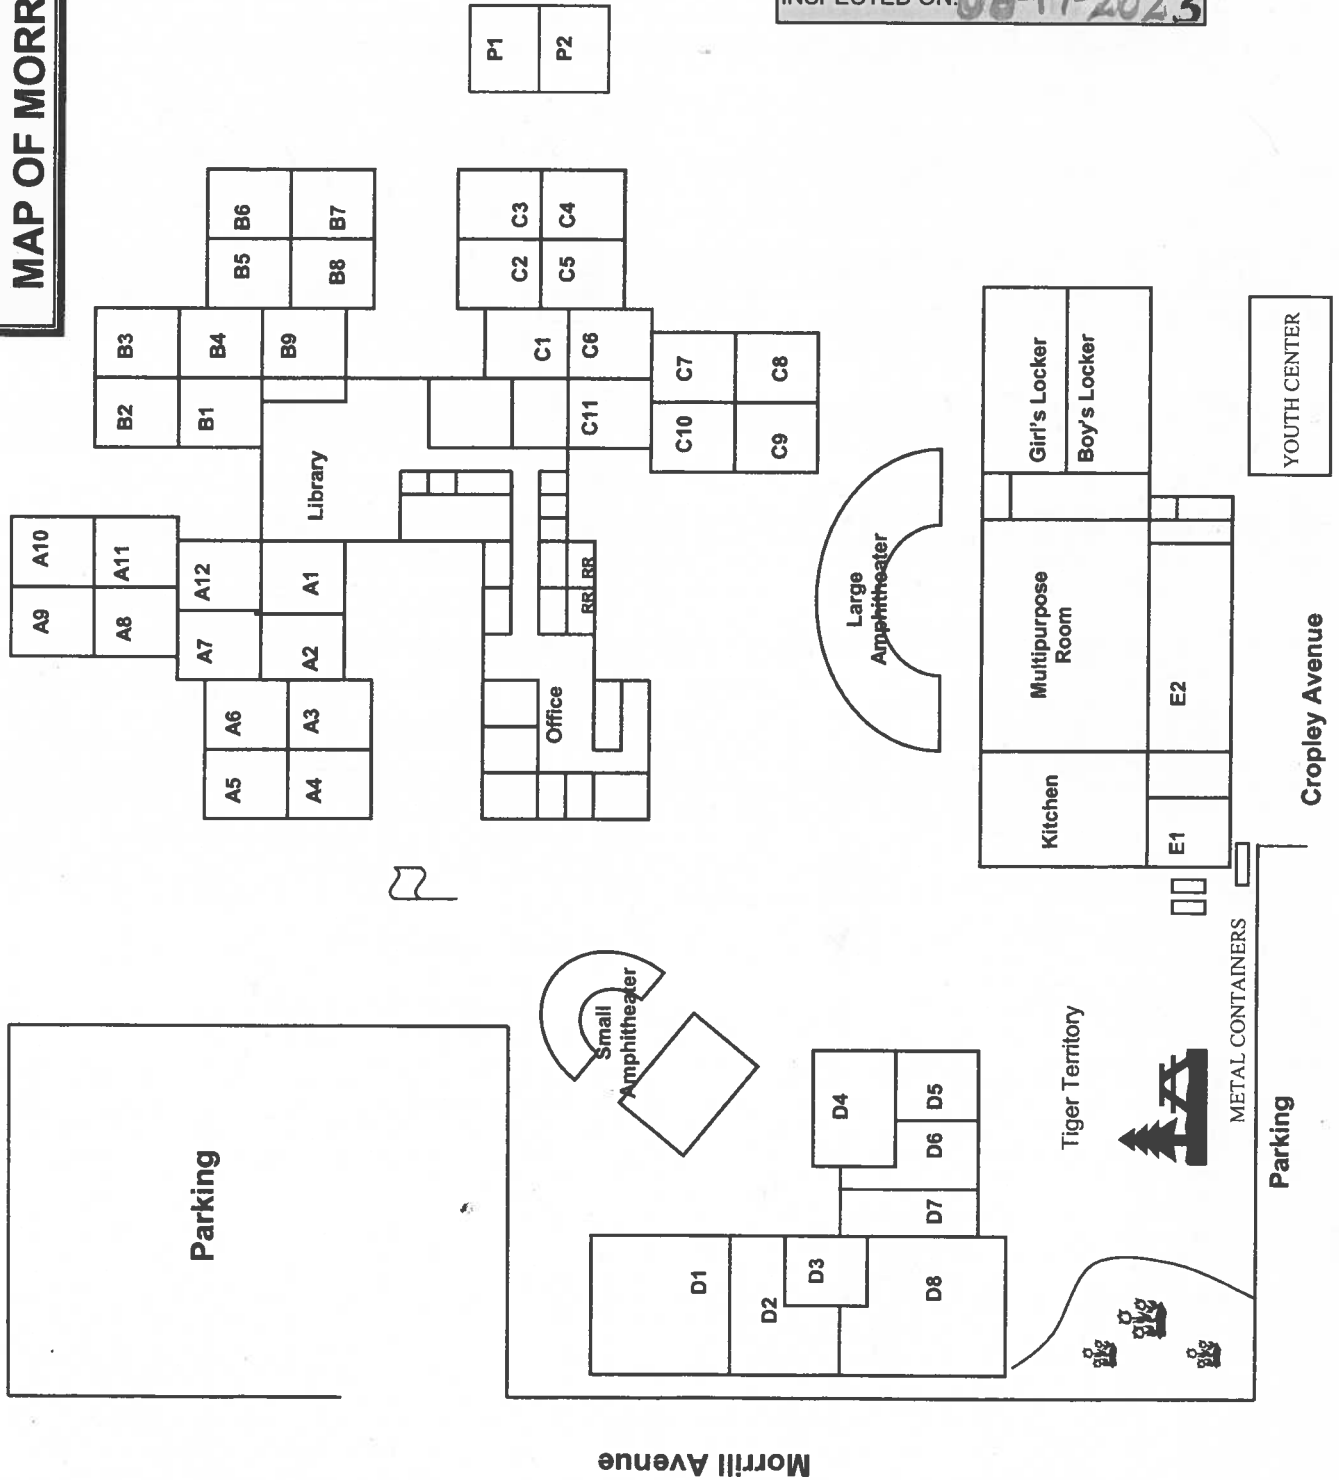

MAP OF MORRILL


MORRILL MIDDLE SCHOOL
INSPECTED ON: **2/16/23**

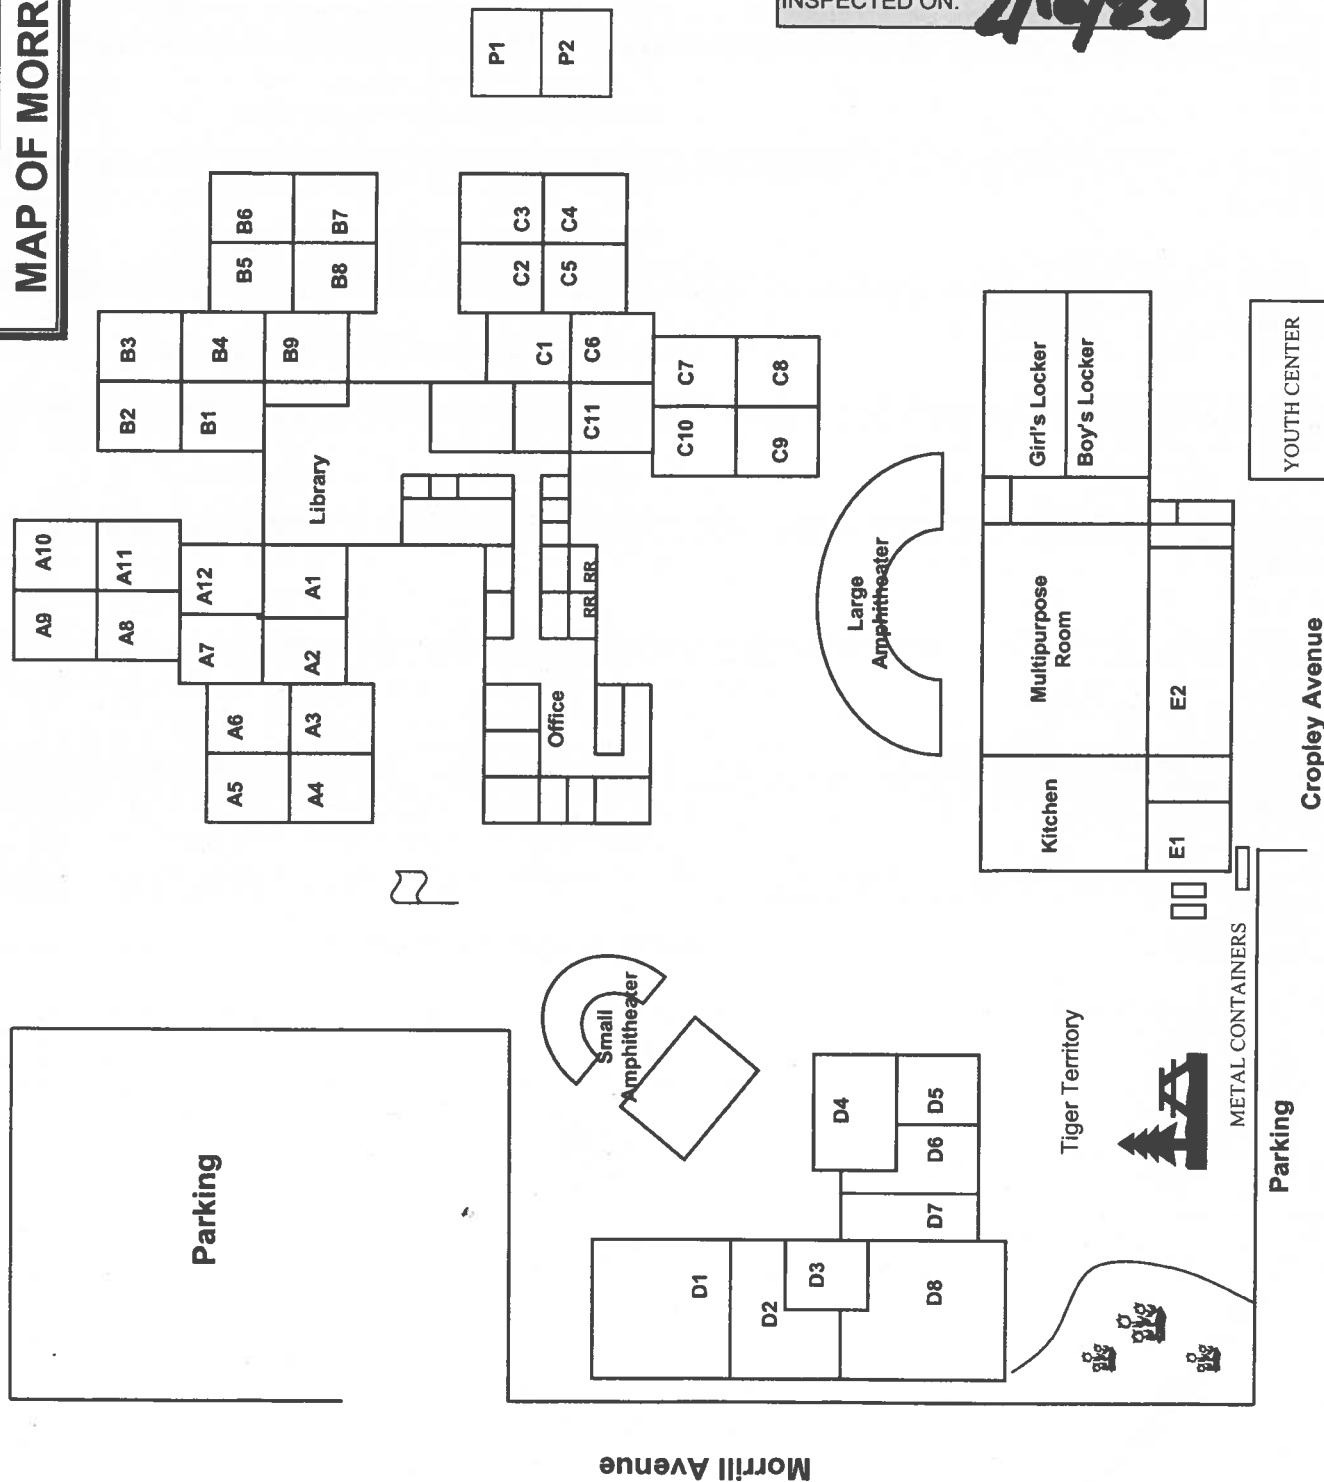



MAP OF MORRILL


MORRILL MIDDLE SCHOOL
INSPECTED ON: 08-18-2022

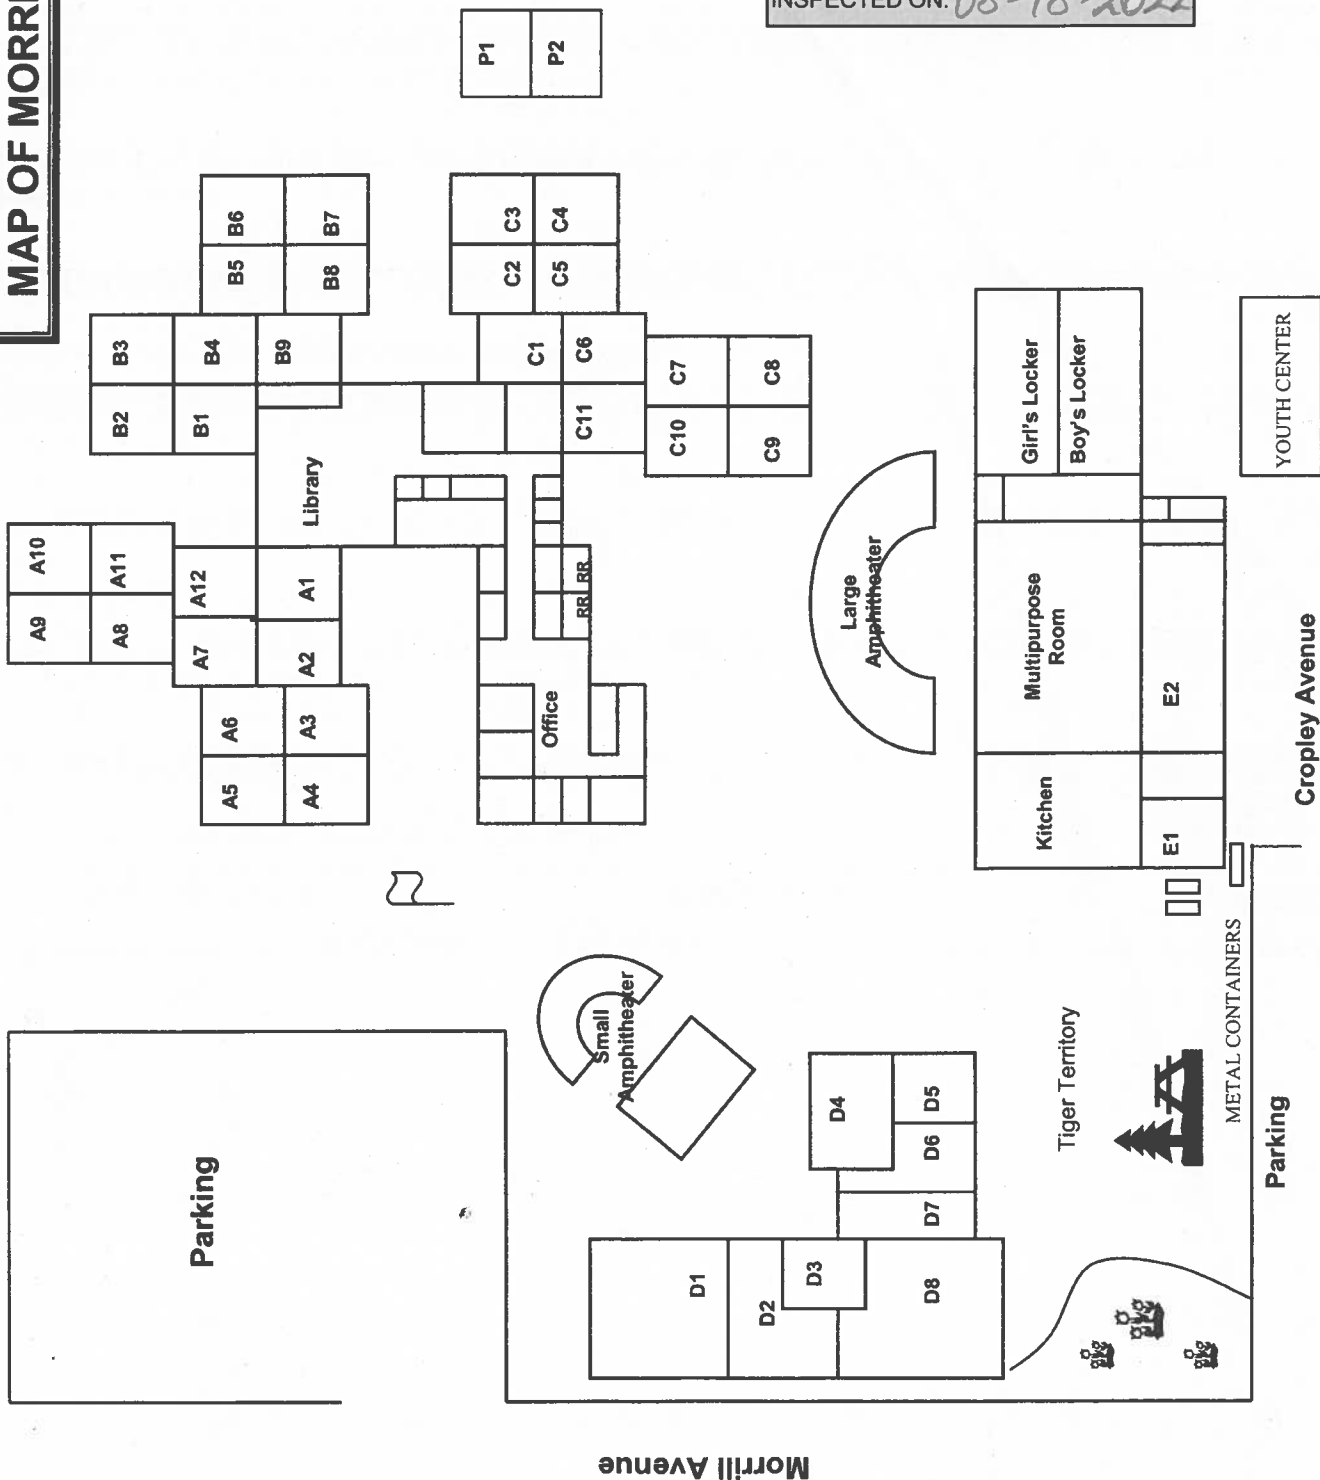

MAP OF MORRILL

MORRILL MIDDLE SCHOOL


INSPECTED ON: 02-24-2022

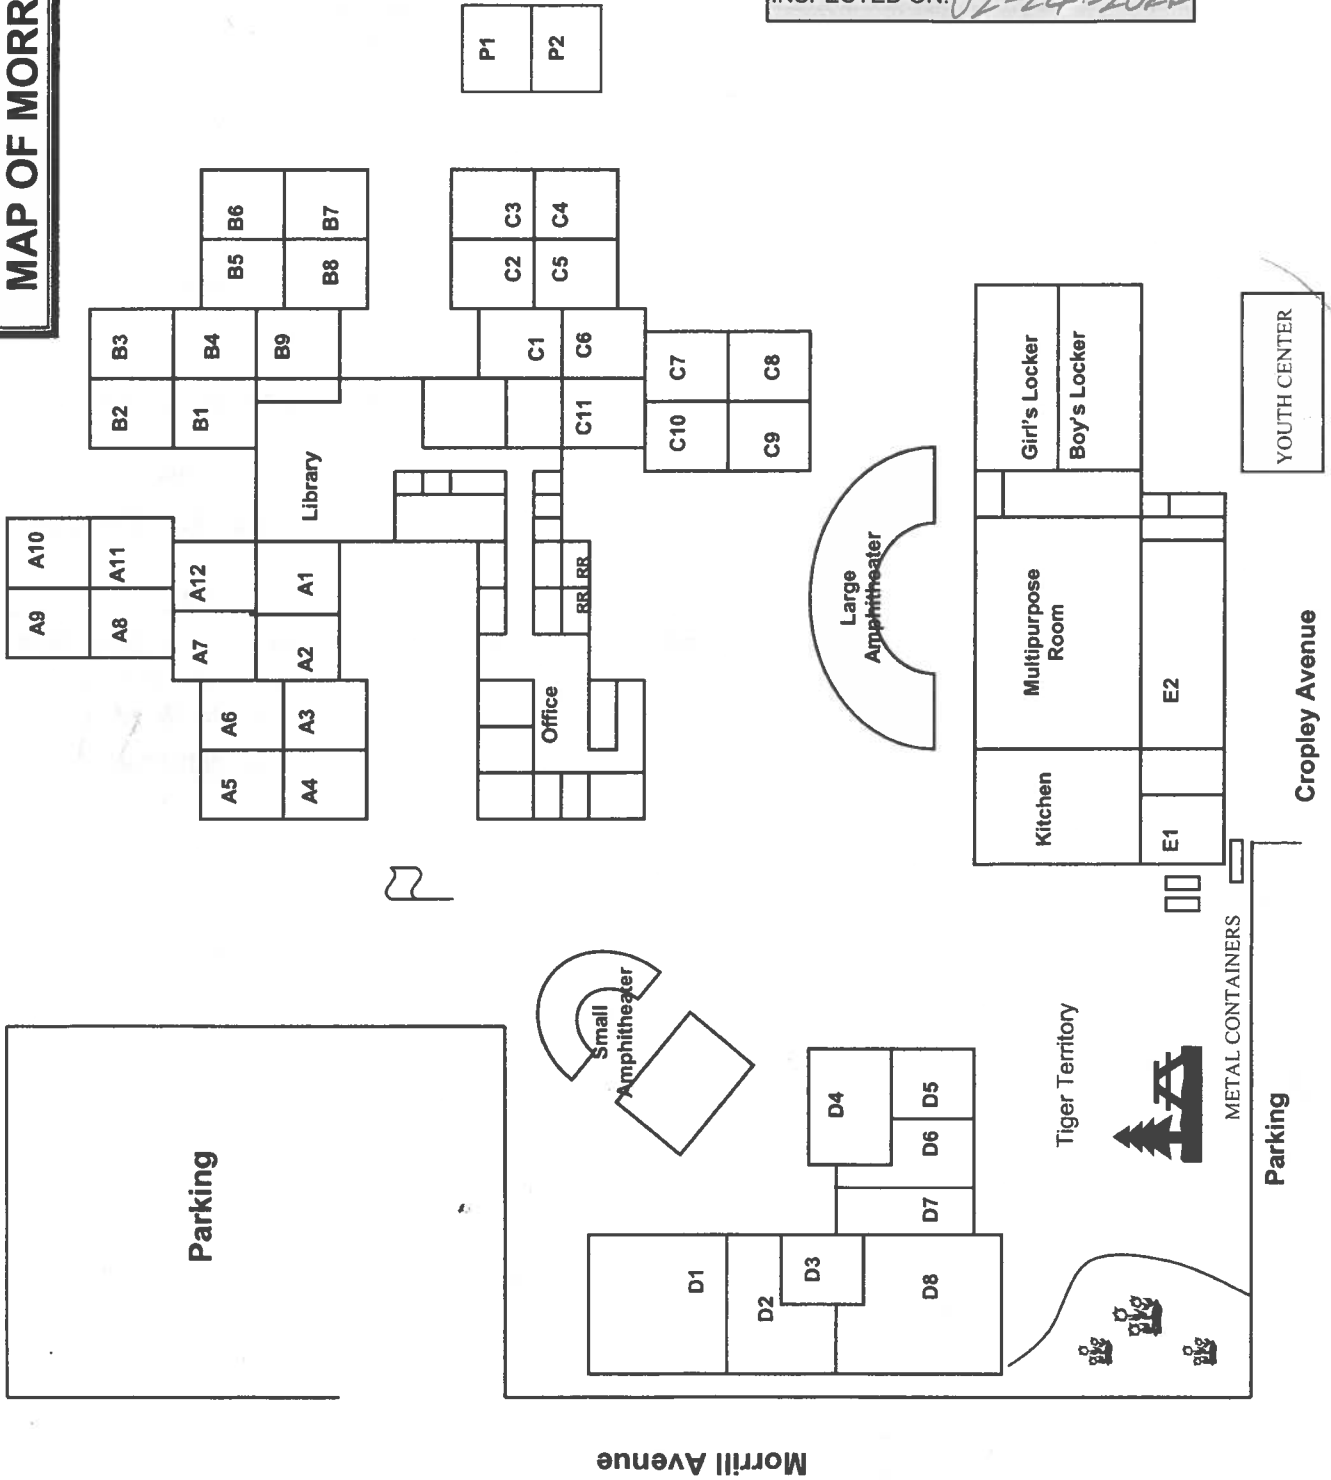

MAP OF MORRILL

MORRILL MIDDLE SCHOOL
INSPECTED ON: 8/12/21


P1	P2
----	----

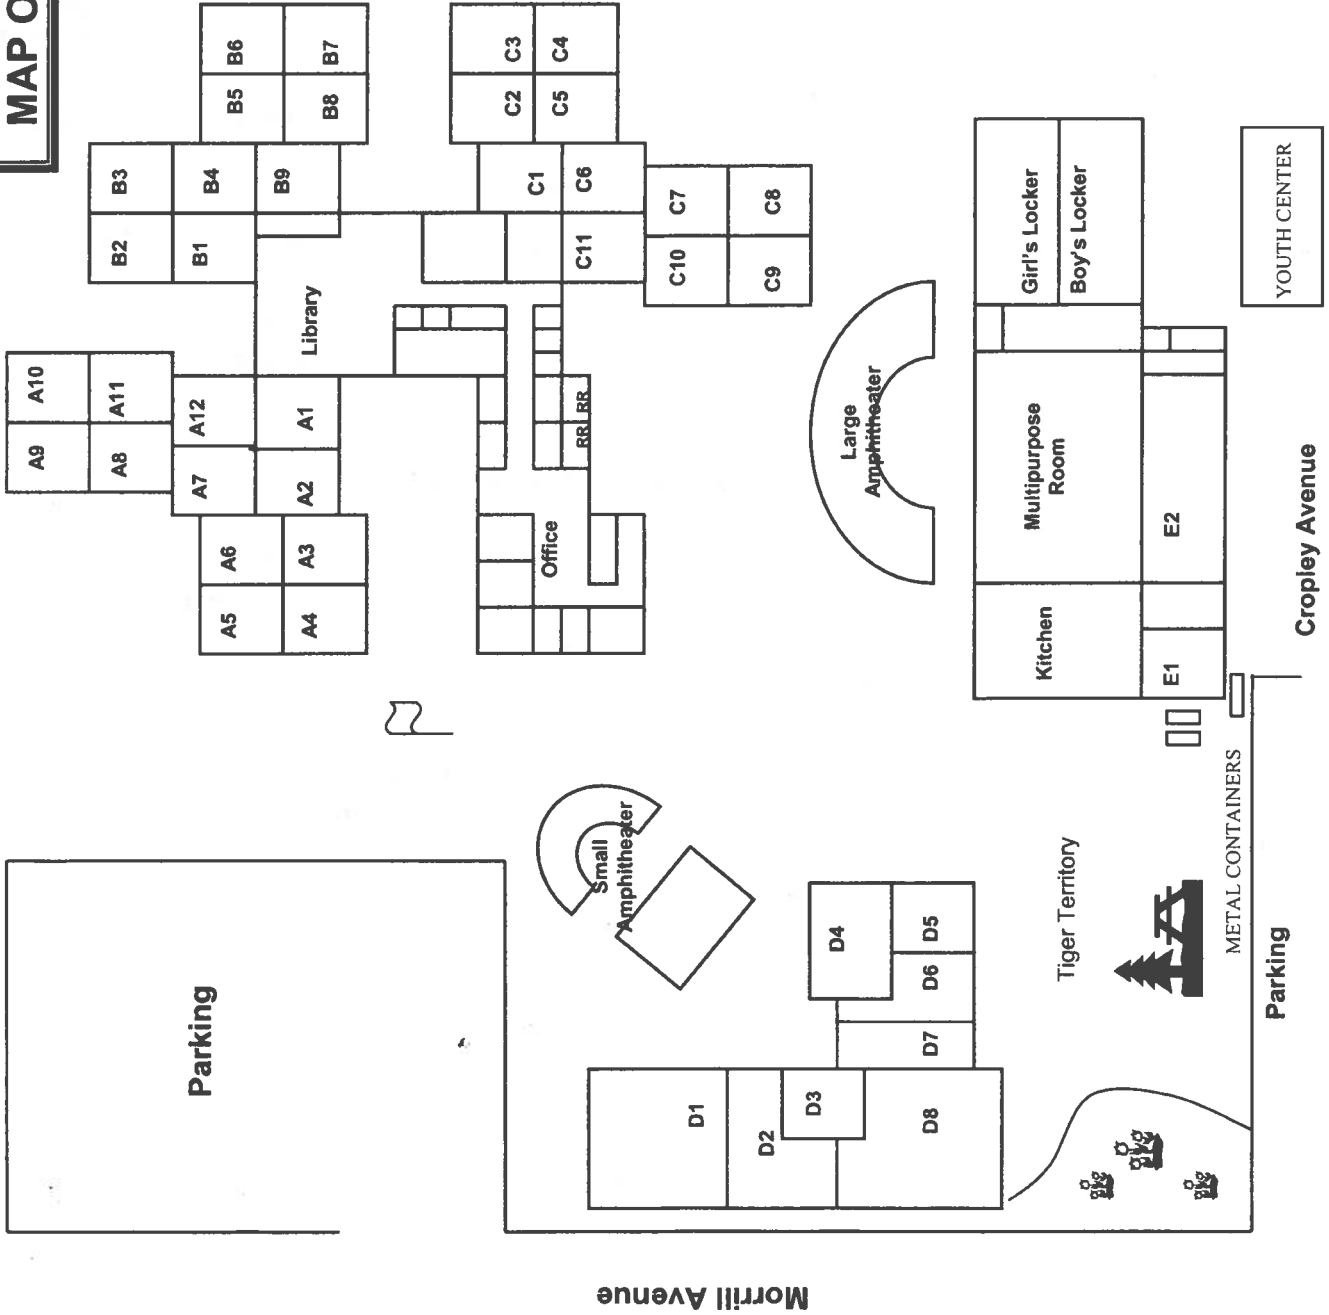

MAP OF MORRILL


MORRILL MIDDLE SCHOOL
INSPECTED ON: 2/11/21

P1
P2

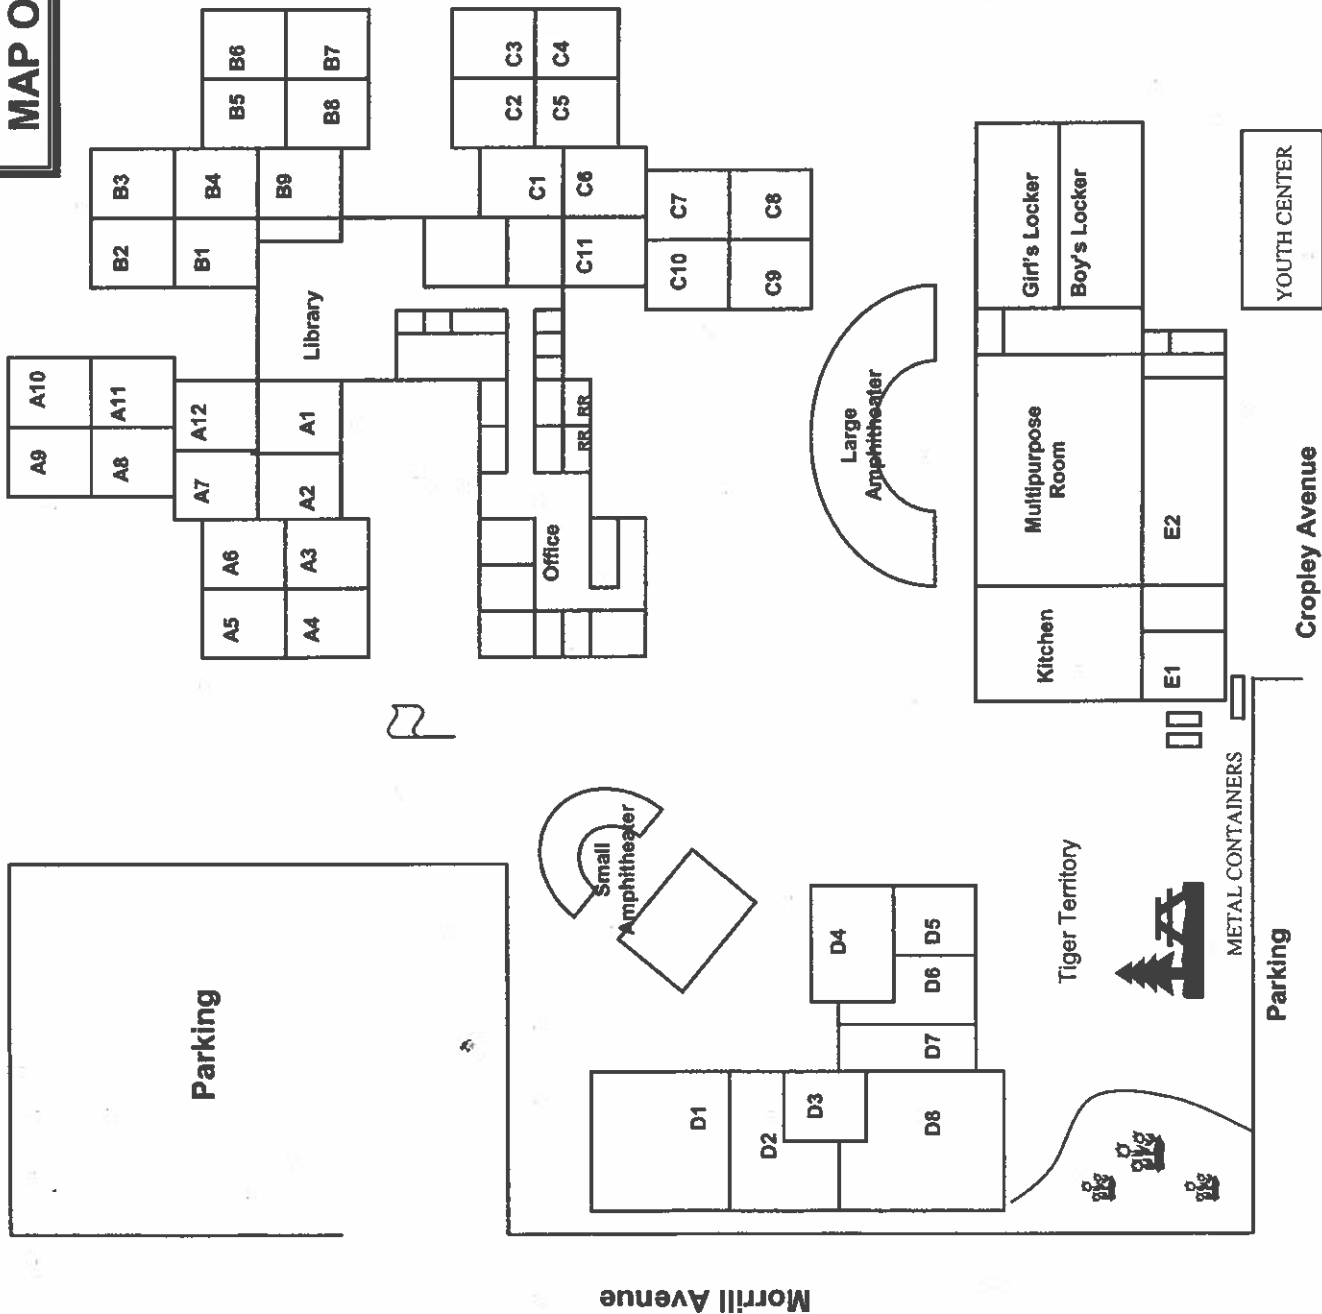


MAP OF MORRILL

MORRILL MIDDLE SCHOOL
INSPECTED ON: 8/31/20

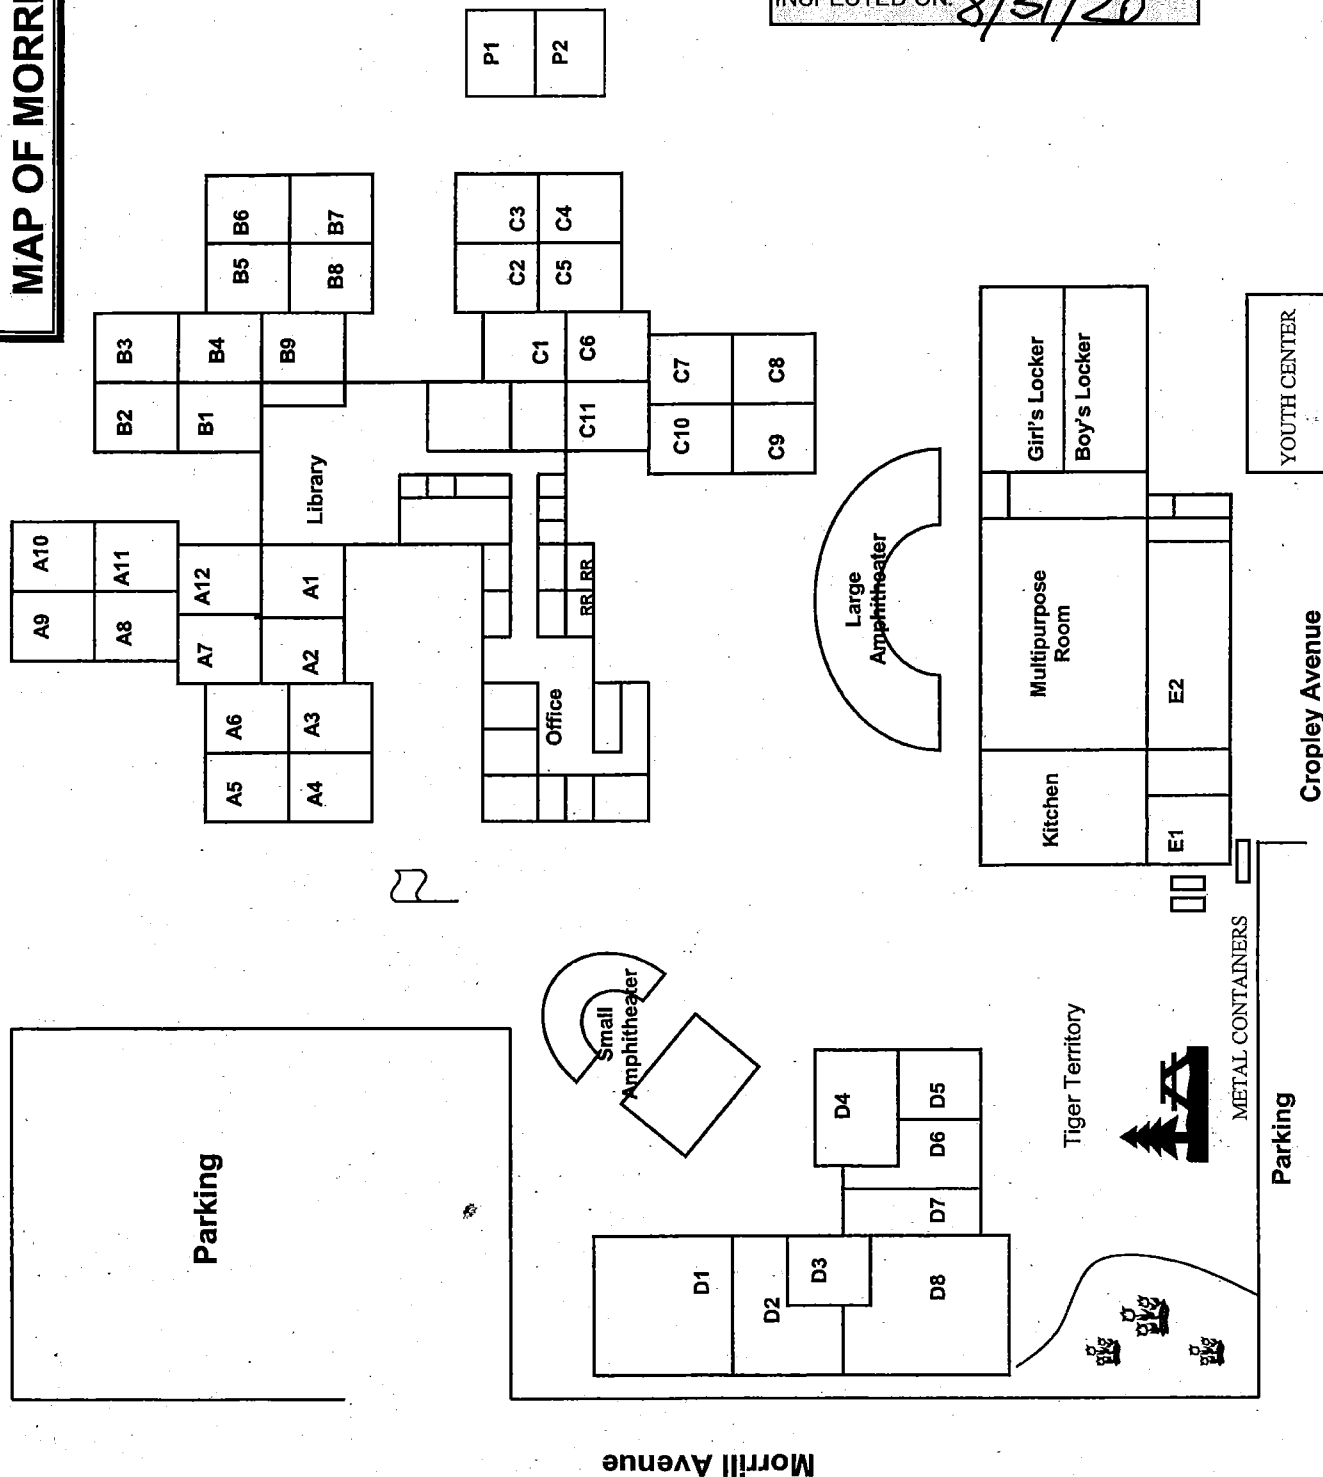

MAP OF MORRILL

MORRILL MIDDLE SCHOOL
INSPECTED ON: 1-30-2022

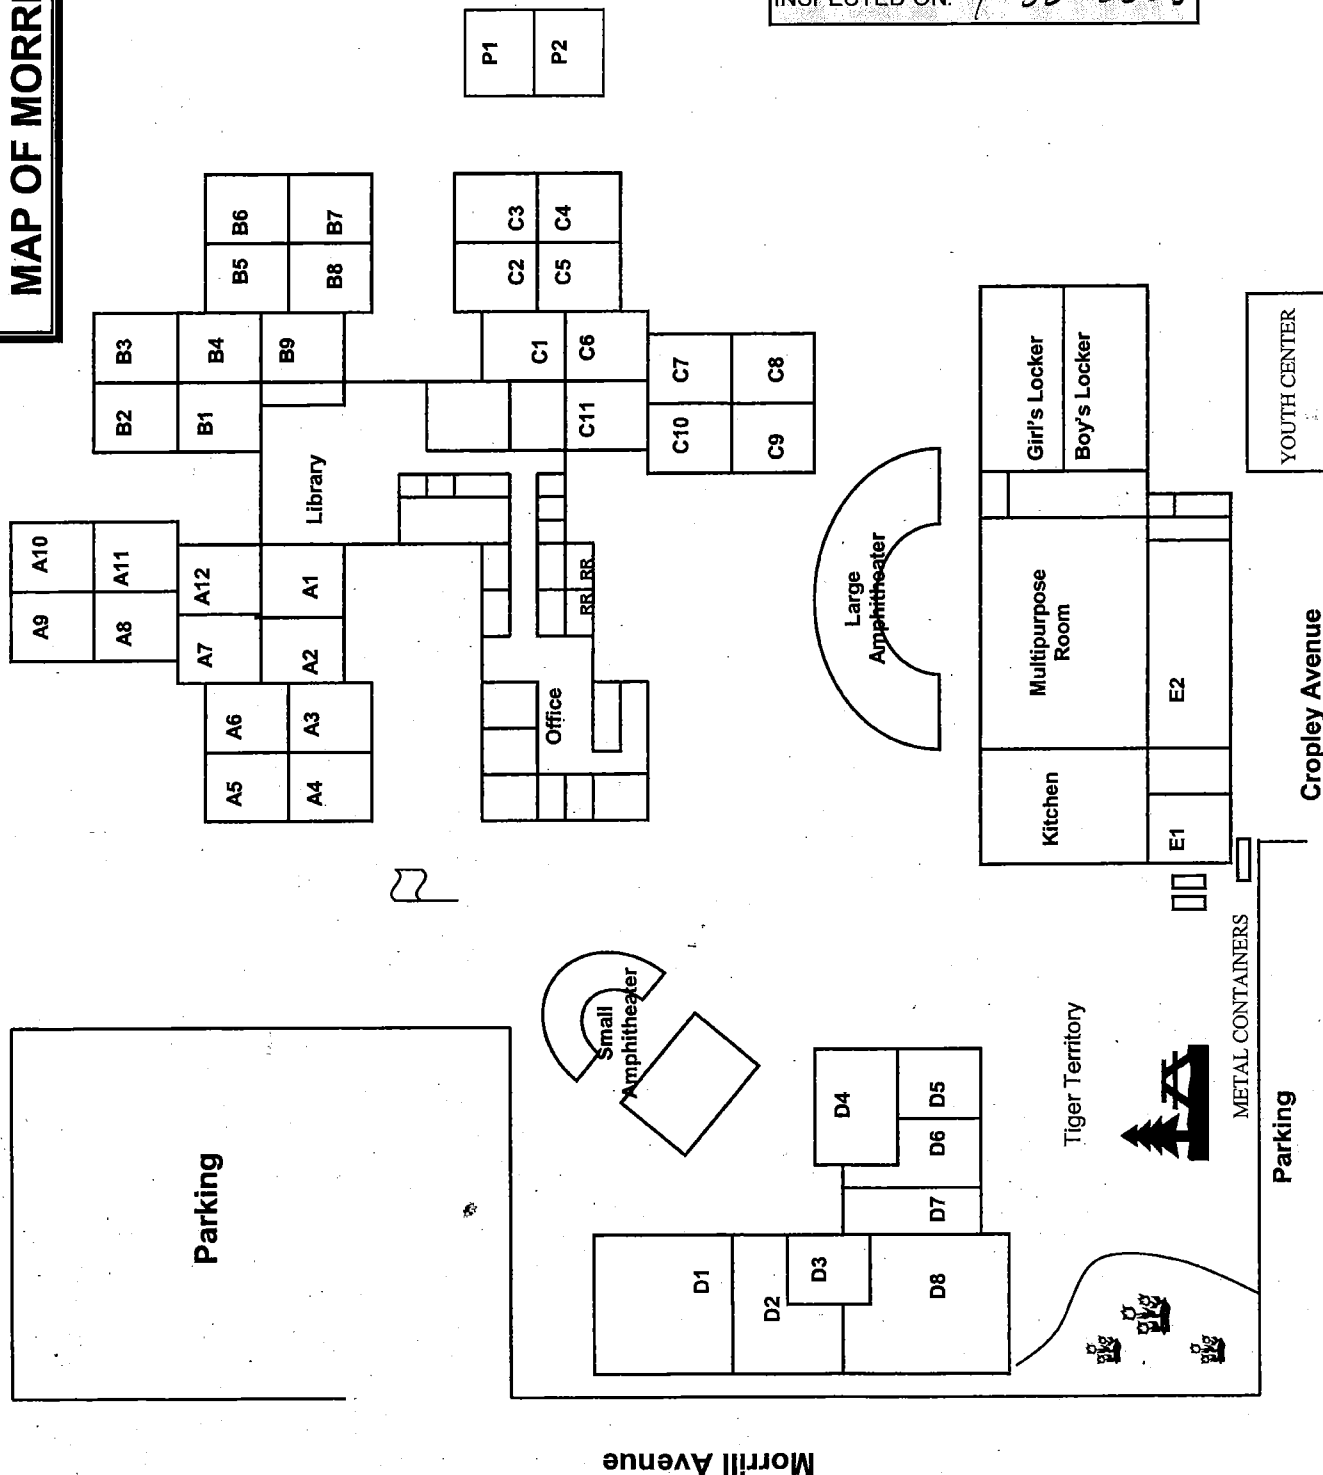


MAP OF MORRILL

MORRILL MIDDLE SCHOOL

INSPECTED ON: 8-15-19

P1

P2

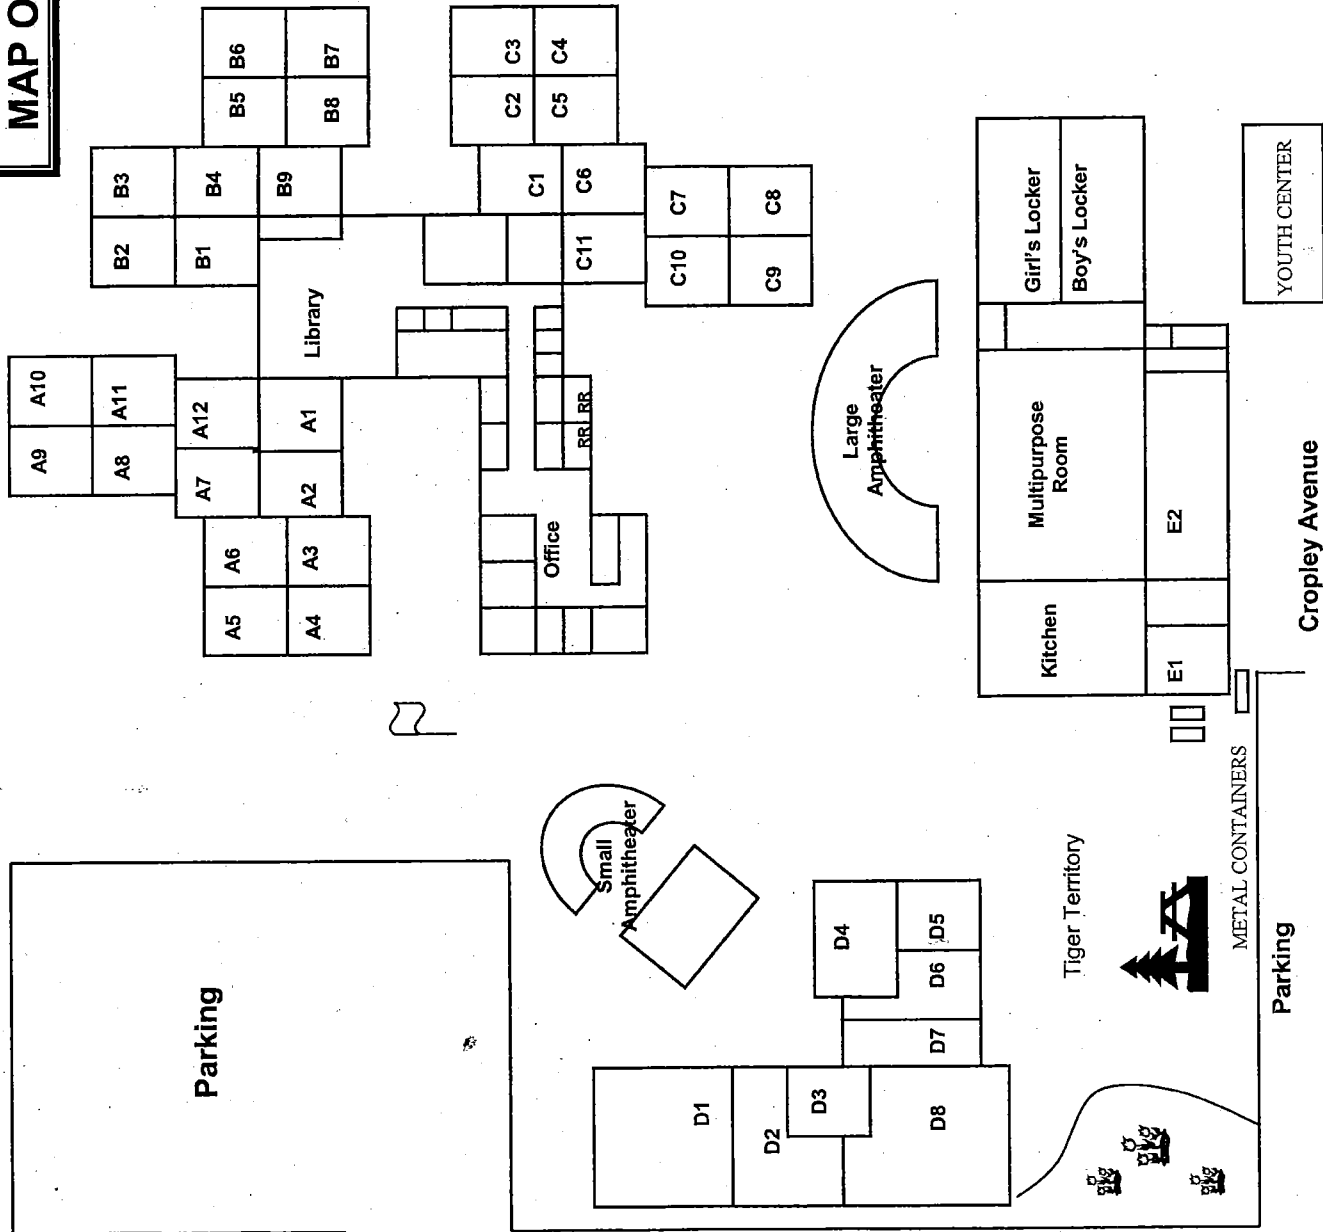


Morrill Avenue

Cropley Avenue

MAP OF MORRILL


MORRILL MIDDLE SCHOOL
INSPECTED ON: 02-07-2019

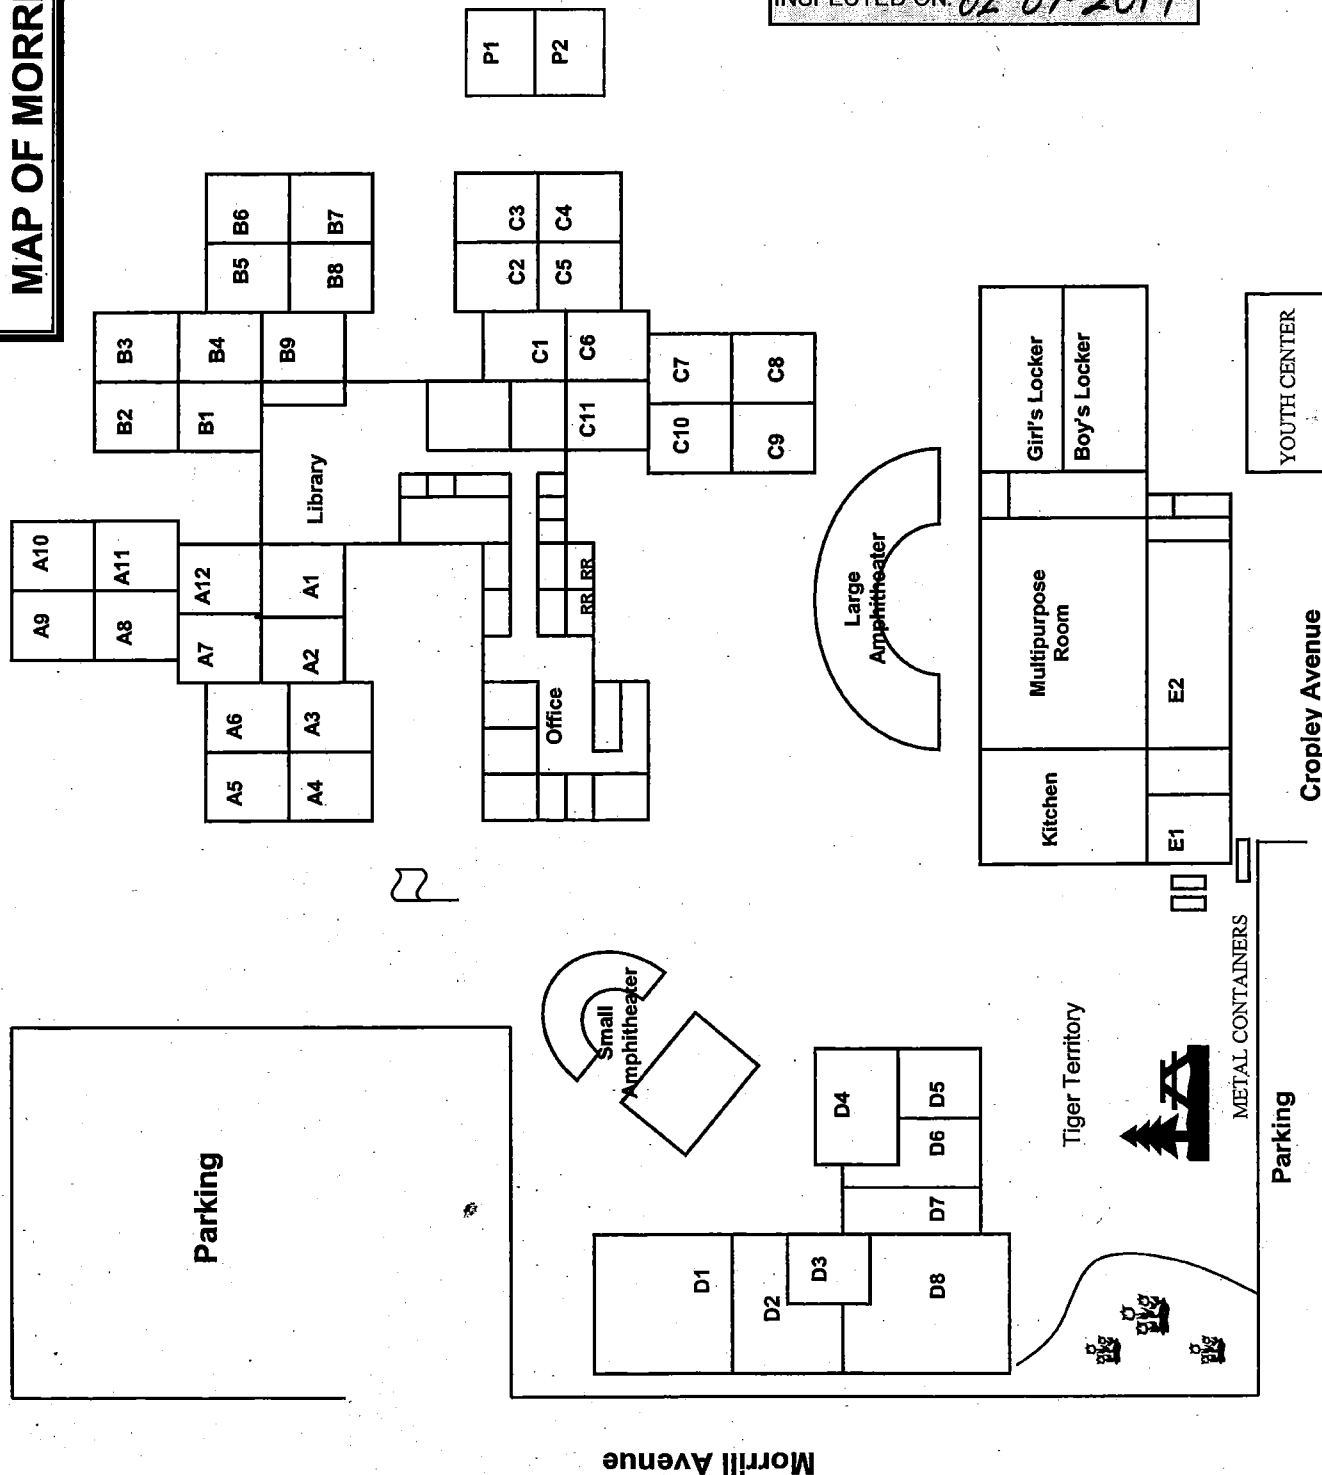

MAP OF MORRILL

MORRILL MIDDLE SCHOOL
INSPECTED ON: 8/9/18

P1 P2

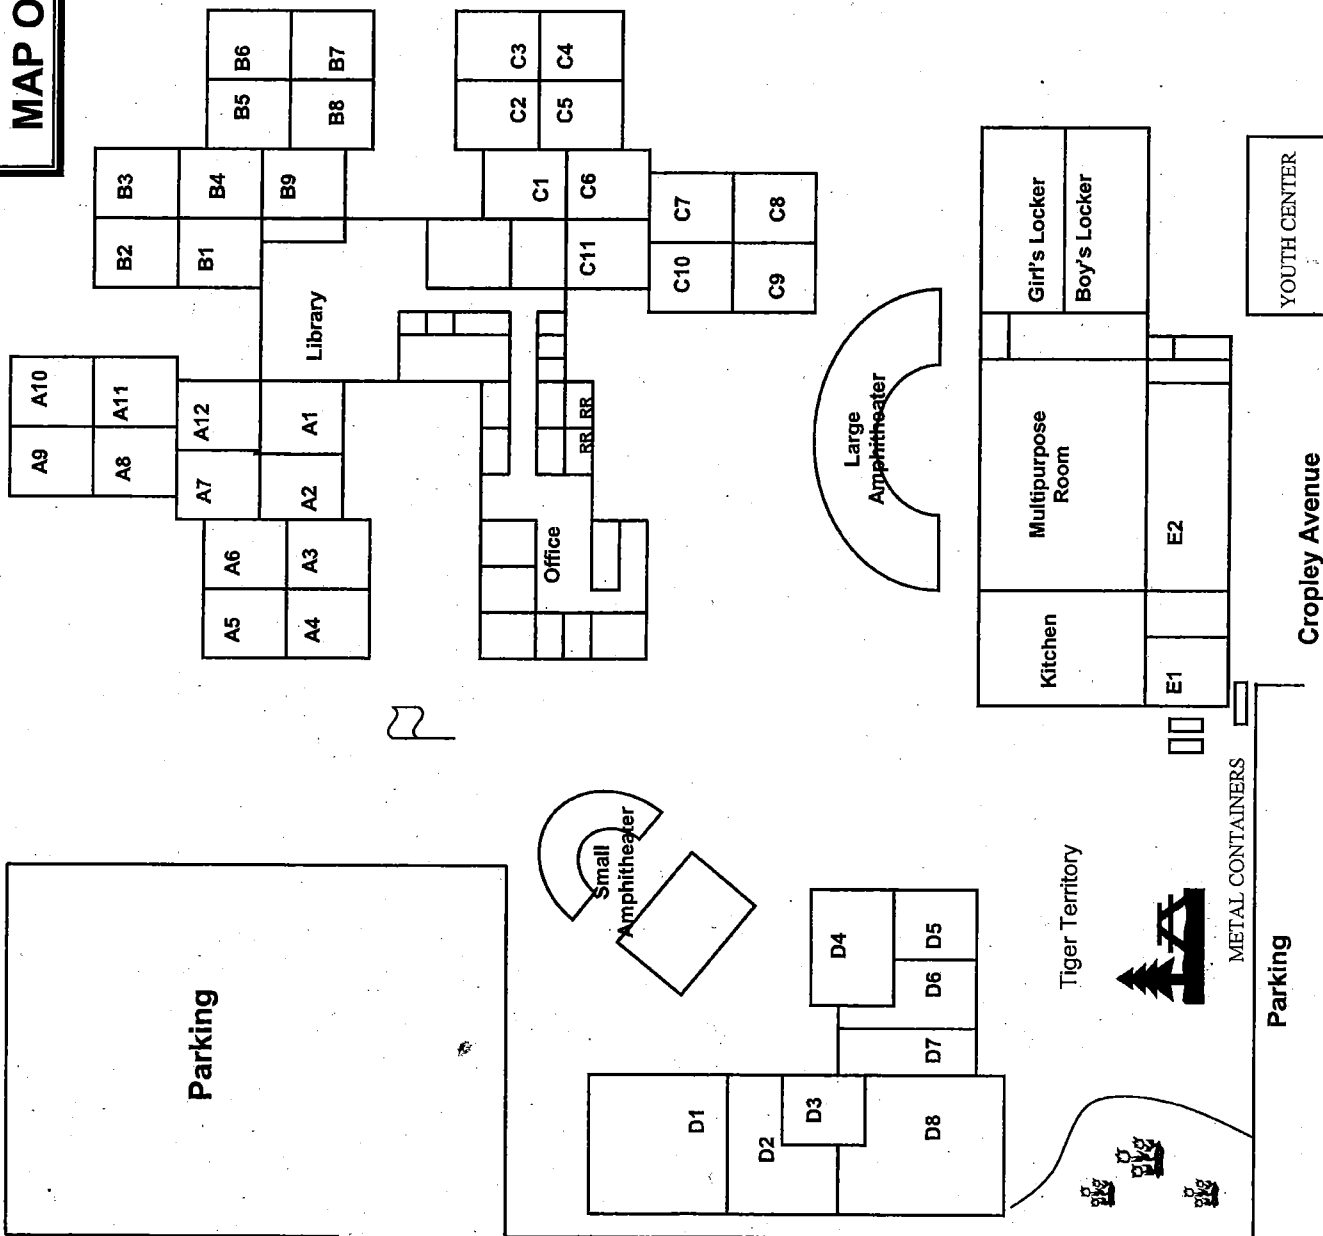


Morrill Avenue

Cropley Avenue

Parking


MAP OF MORRILL

MORRILL MIDDLE SCHOOL
INSPECTED ON: 2/15/12

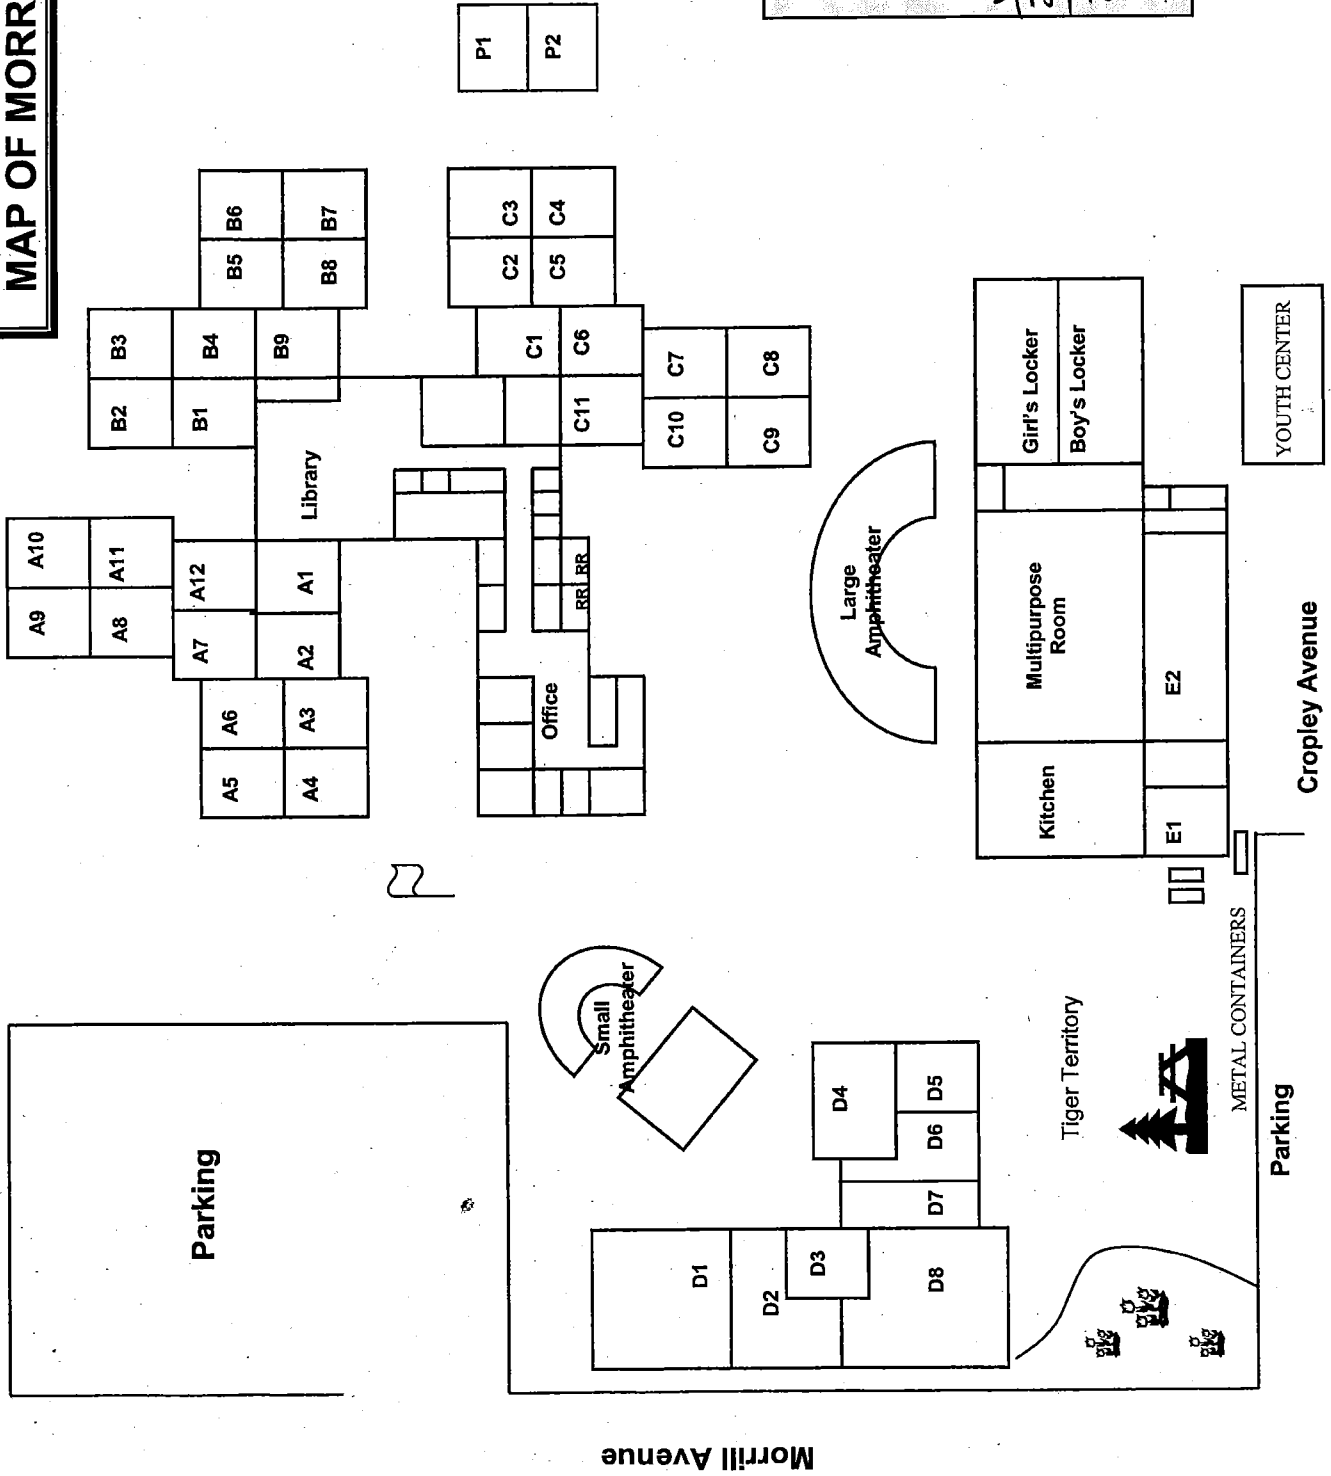


MAP OF MORRILL

MORRILL MIDDLE SCHOOL
INSPECTED ON: 4/30/17

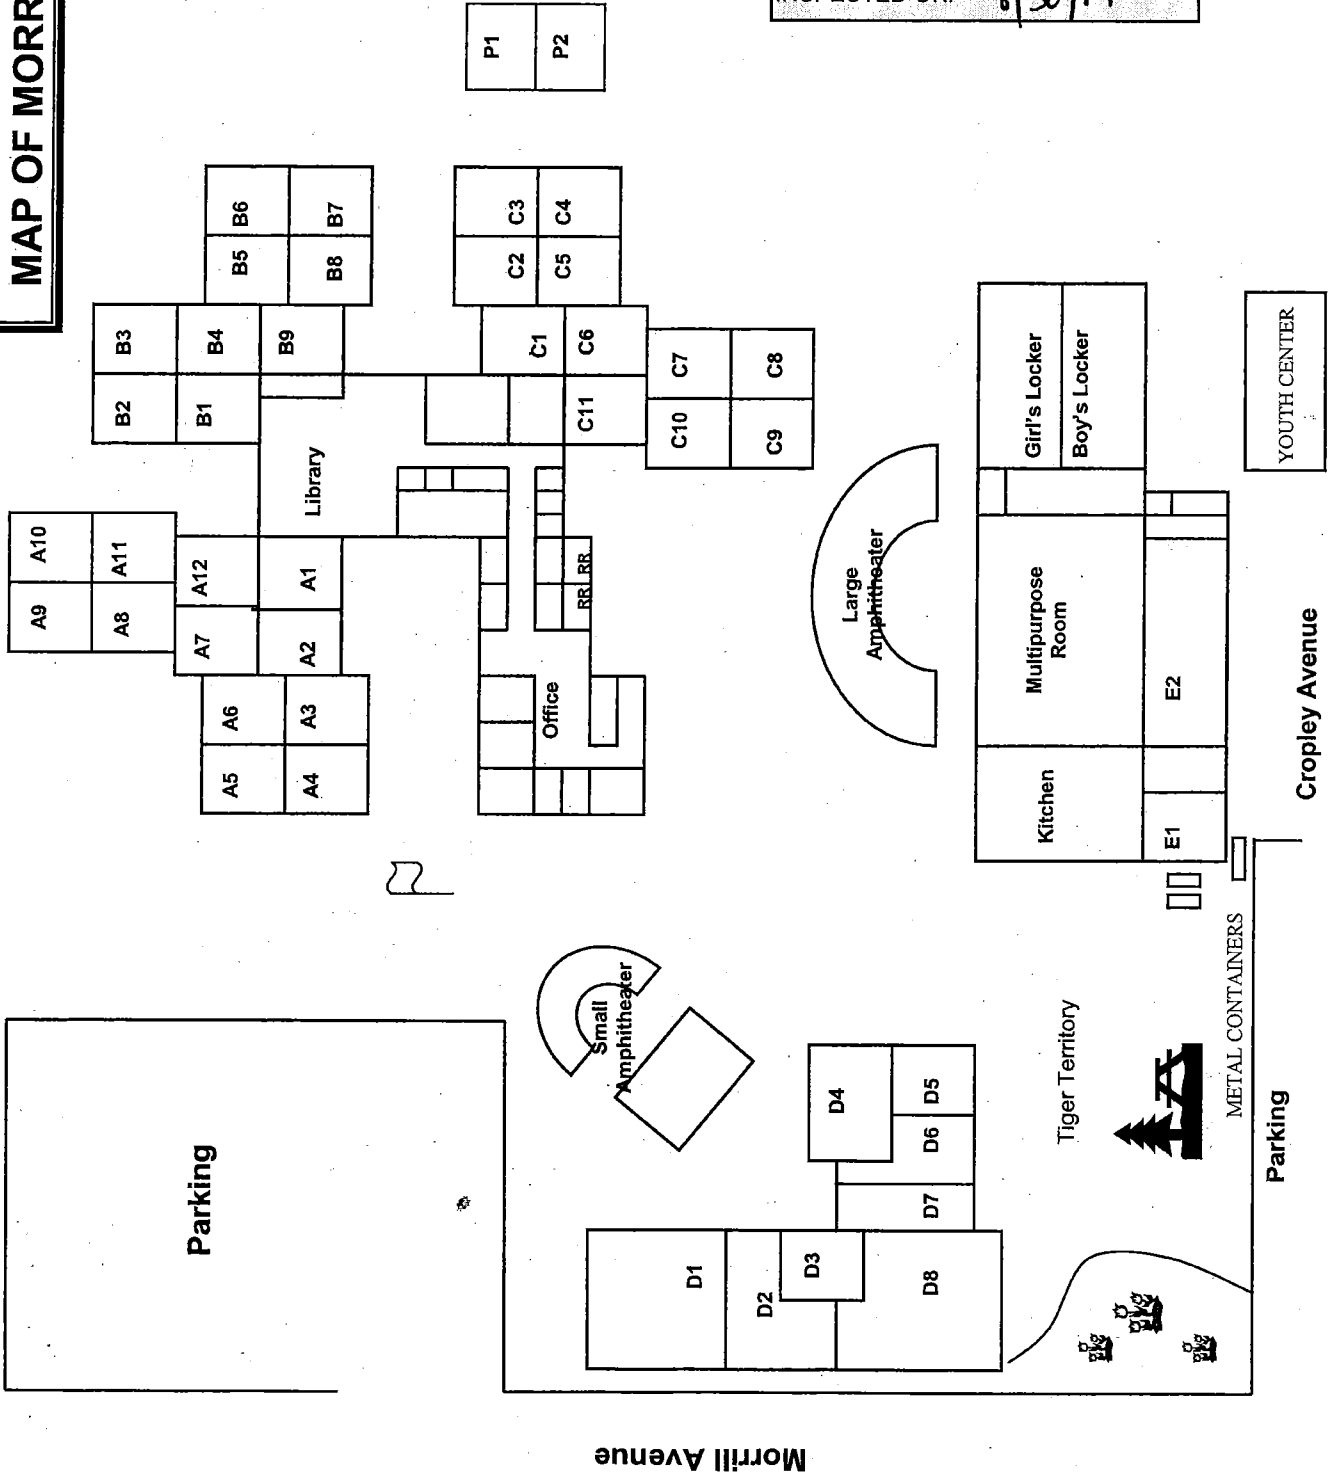

MAP OF MORRILL


MORRILL MIDDLE SCHOOL
INSPECTED ON: 3/31/17

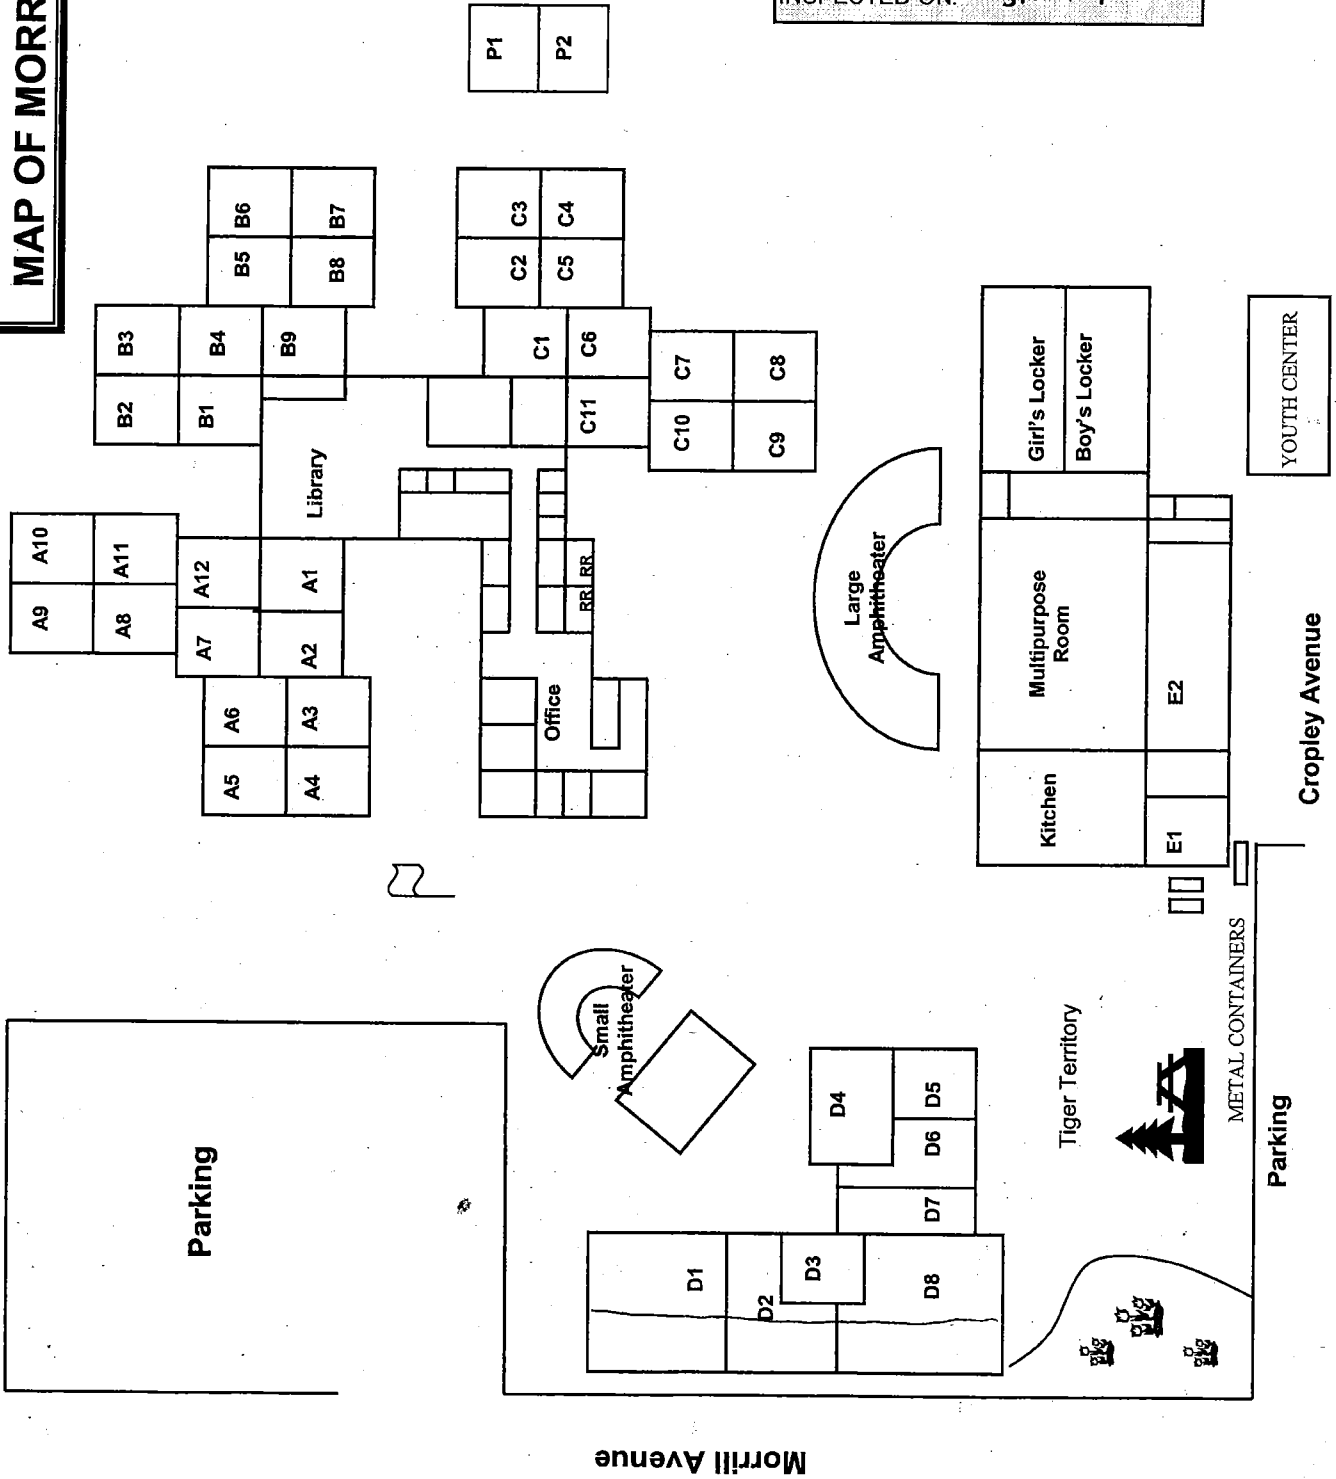

MAP OF MORRILL

MORRILL MIDDLE SCHOOL
INSPECTED ON: 9-14-16

P1
P2

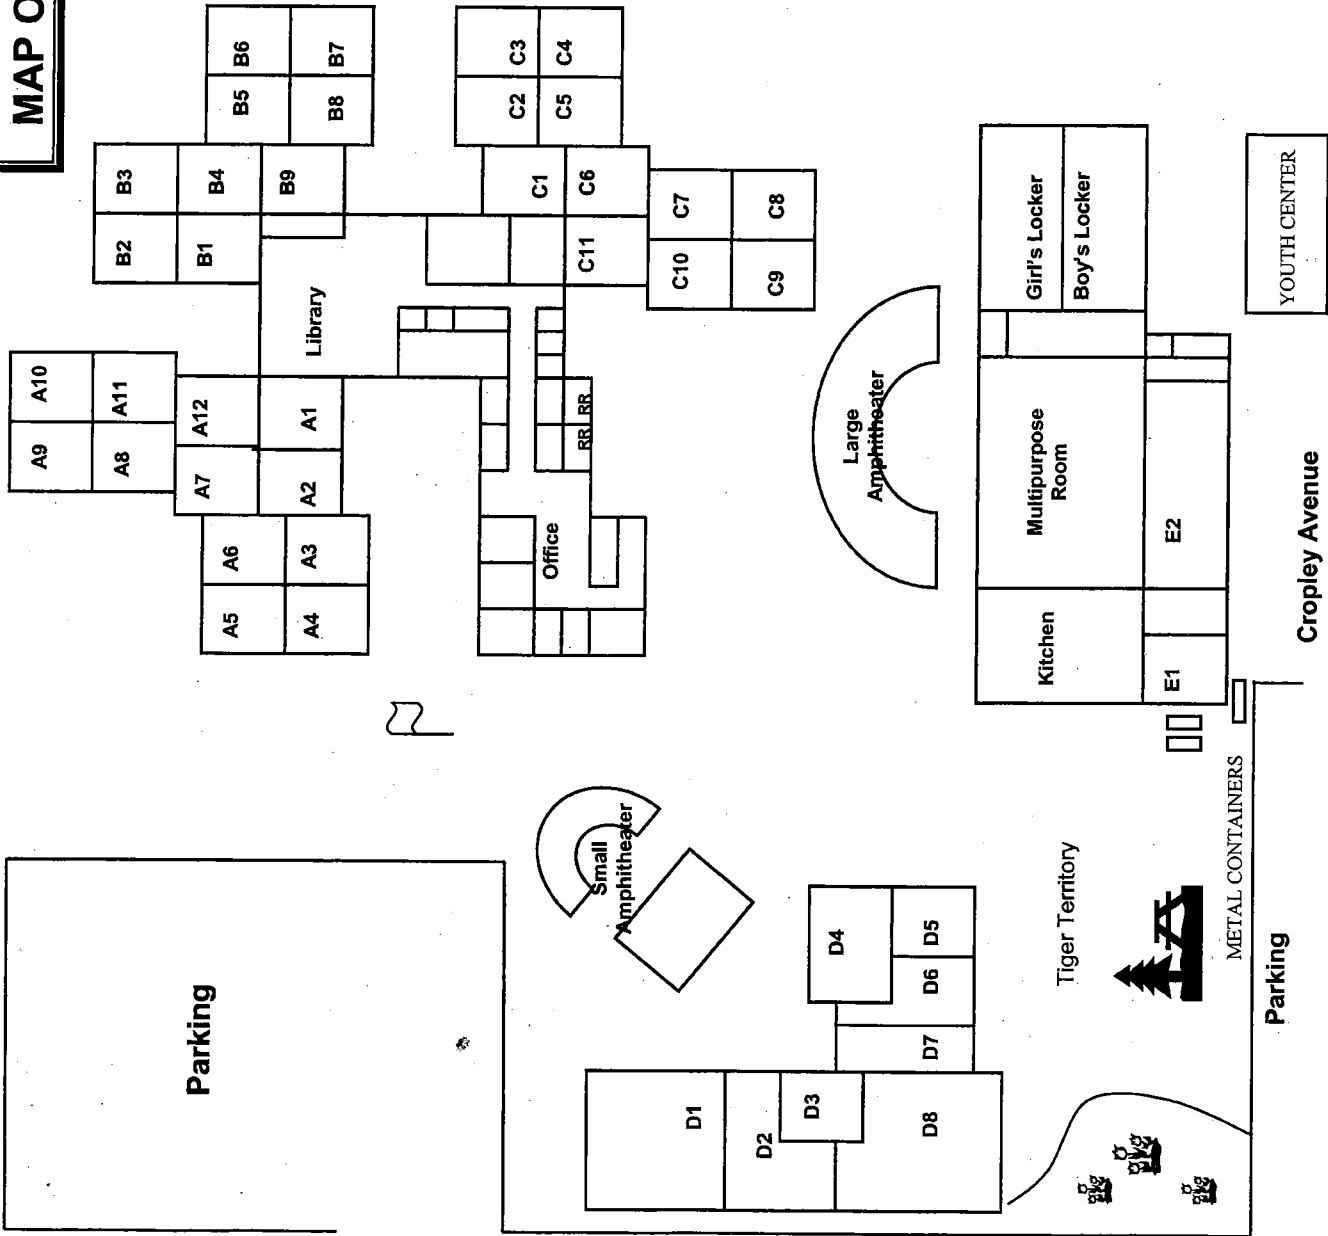


Morrill Avenue

Cropley Avenue

MAP OF MORRILL

MORRILL MIDDLE SCHOOL
INSPECTED ON: 03-18-2016

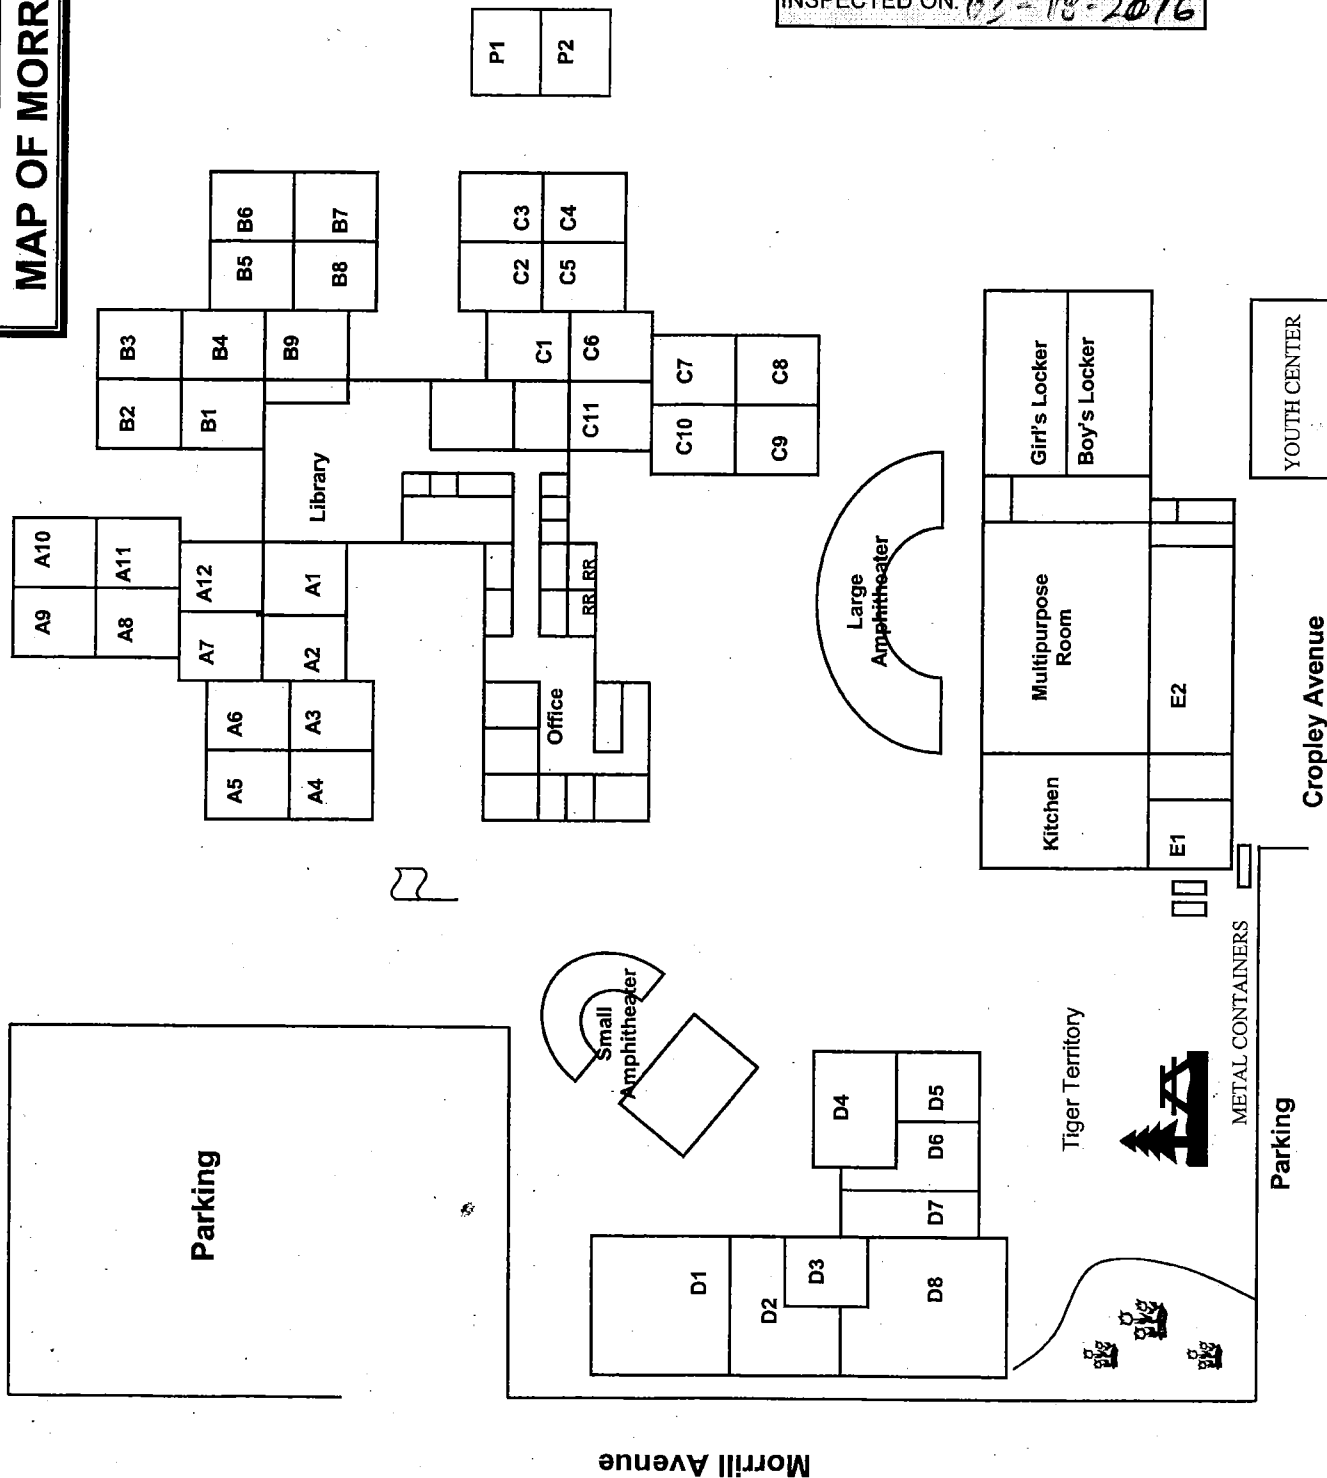


MAP OF MORRILL

MORRILL MIDDLE SCHOOL
INSPECTED ON: 9-16-15


P1

P2

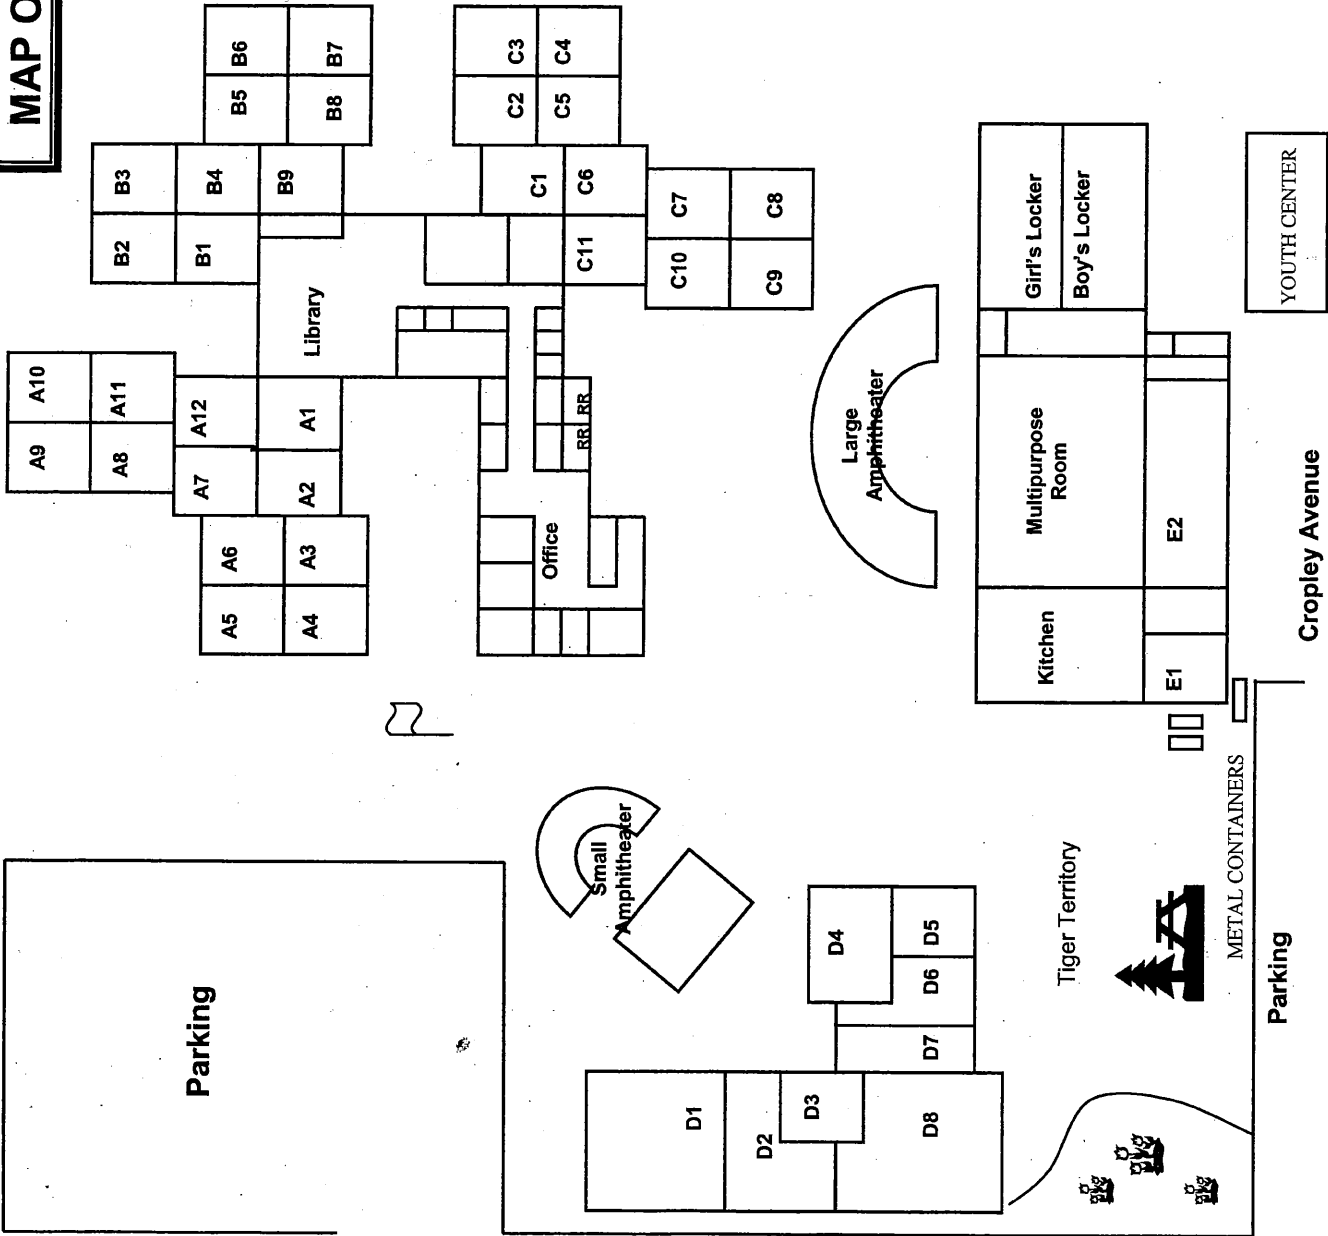


MAP OF MORRILL

MORRILL MIDDLE SCHOOL
INSPECTED ON: 03-18-2015

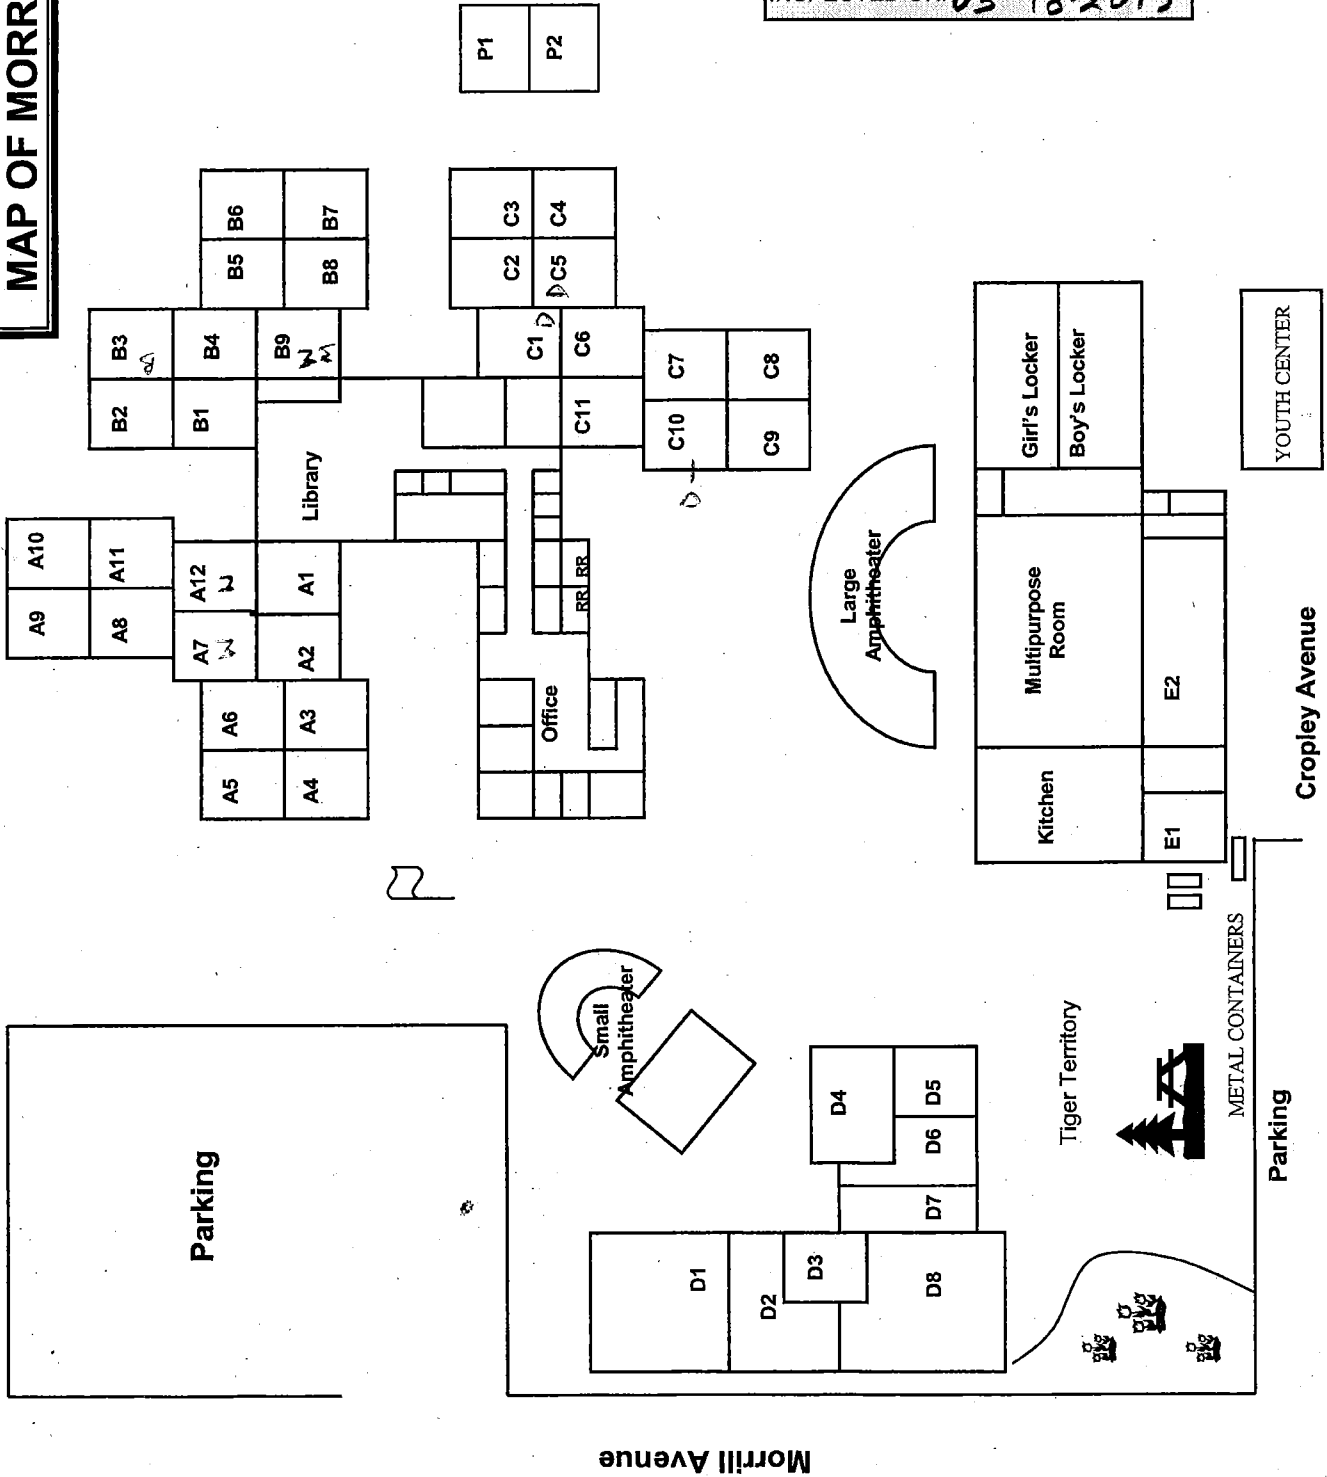


MAP OF MORRILL

MORRILL MIDDLE SCHOOL
INSPECTED ON: 08-28-2014

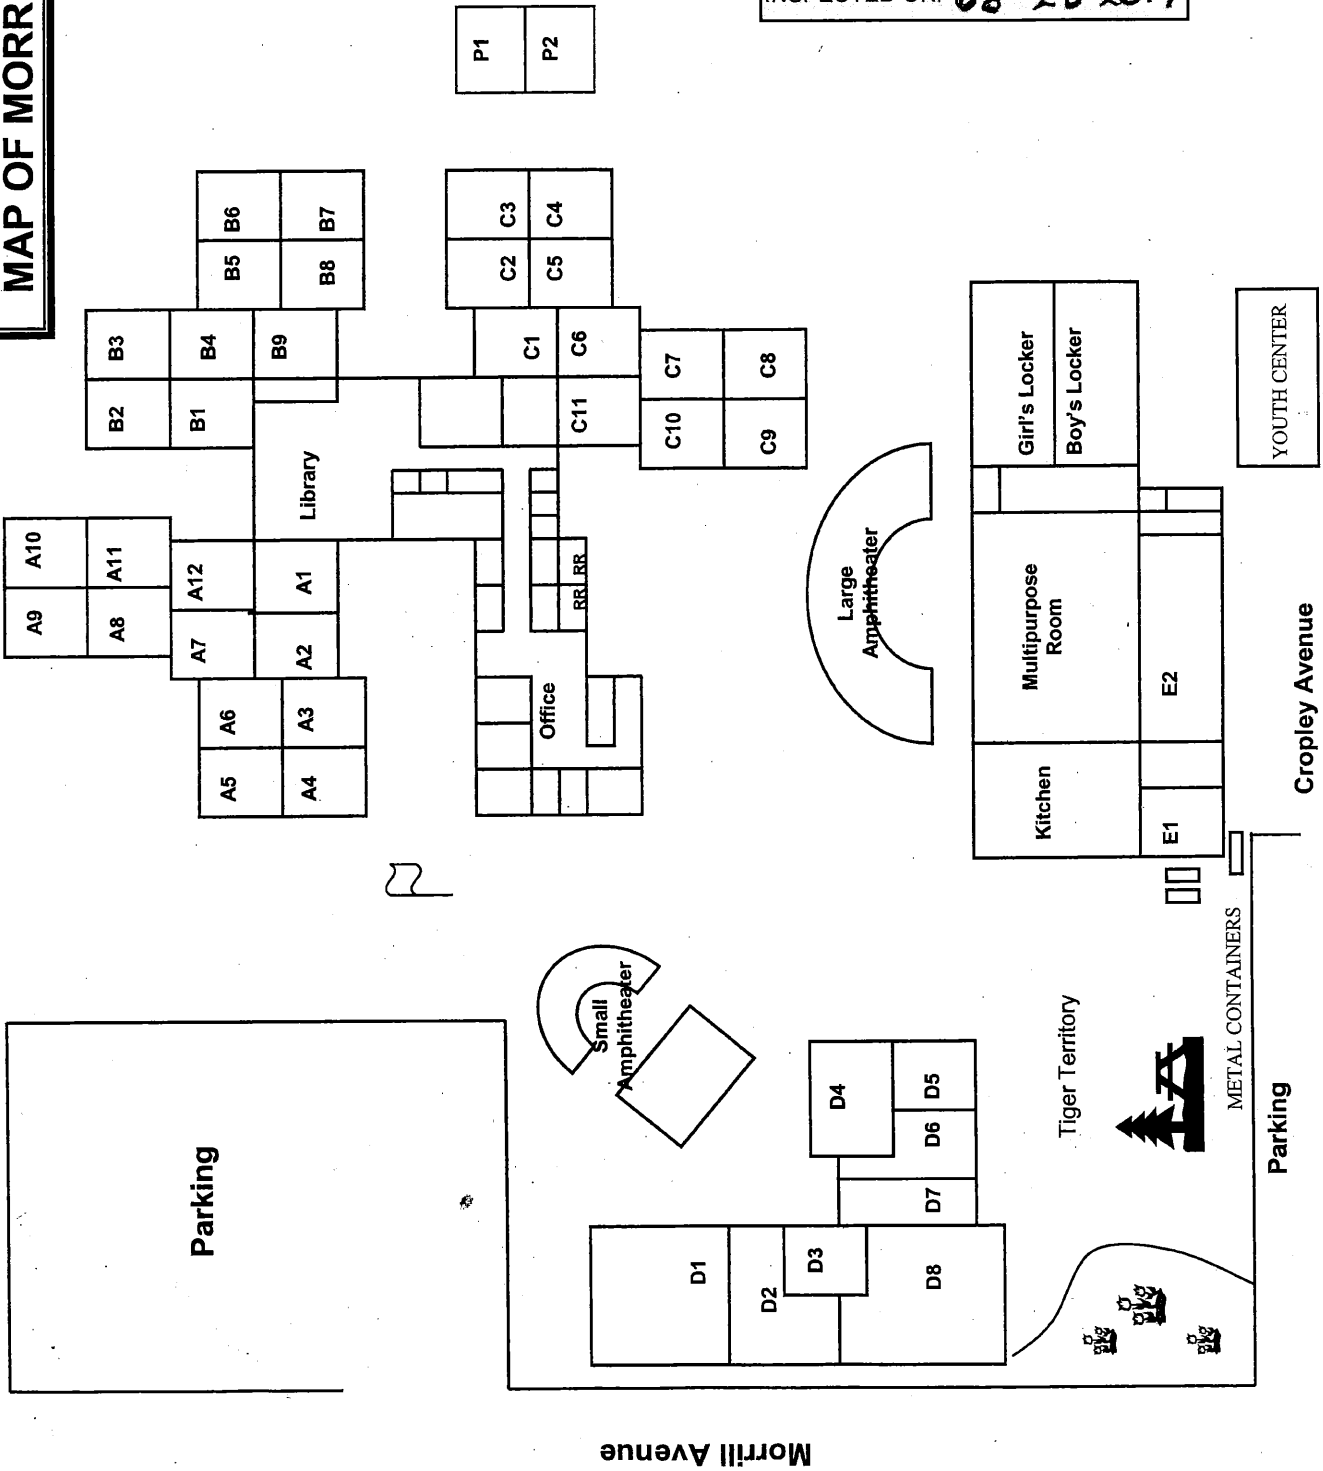


MAP OF MORRILL

MORRILL MIDDLE SCHOOL
INSPECTED ON: 3-6-19

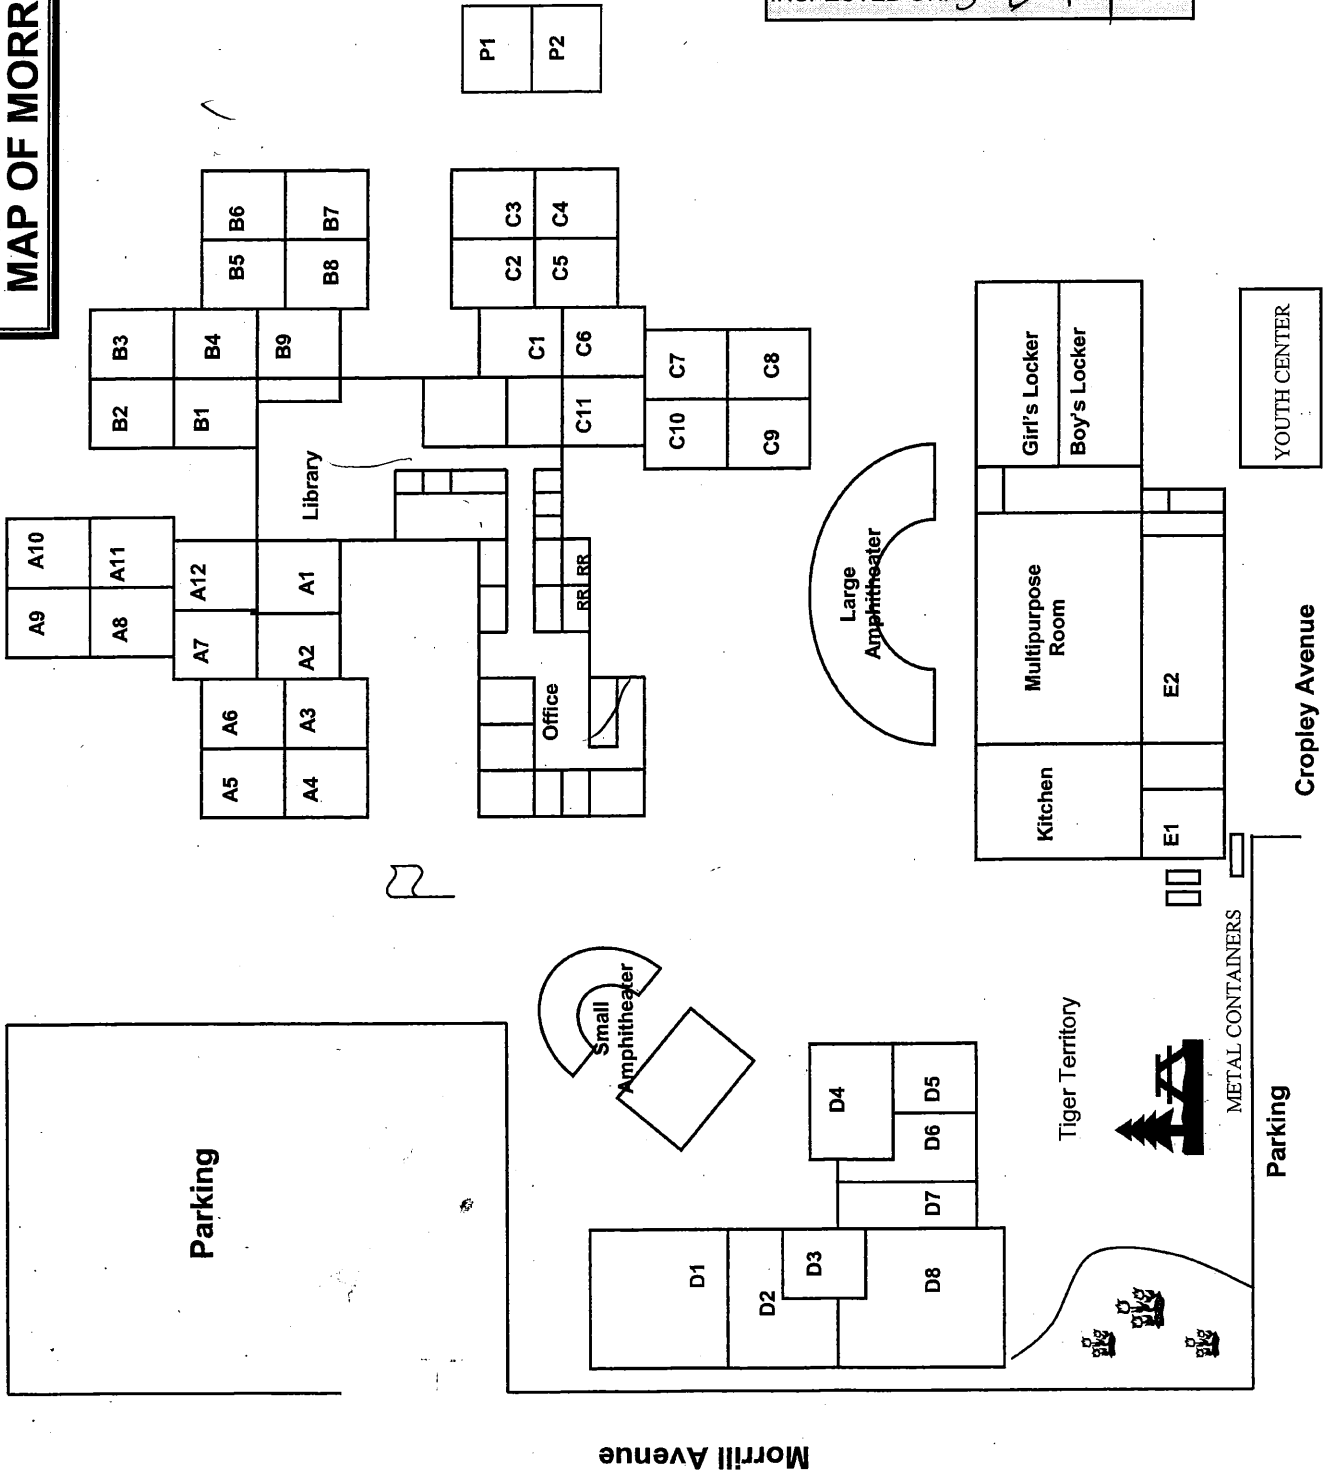

MAP OF MORRILL

MORRILL MIDDLE SCHOOL
INSPECTED ON: 09-24-2013

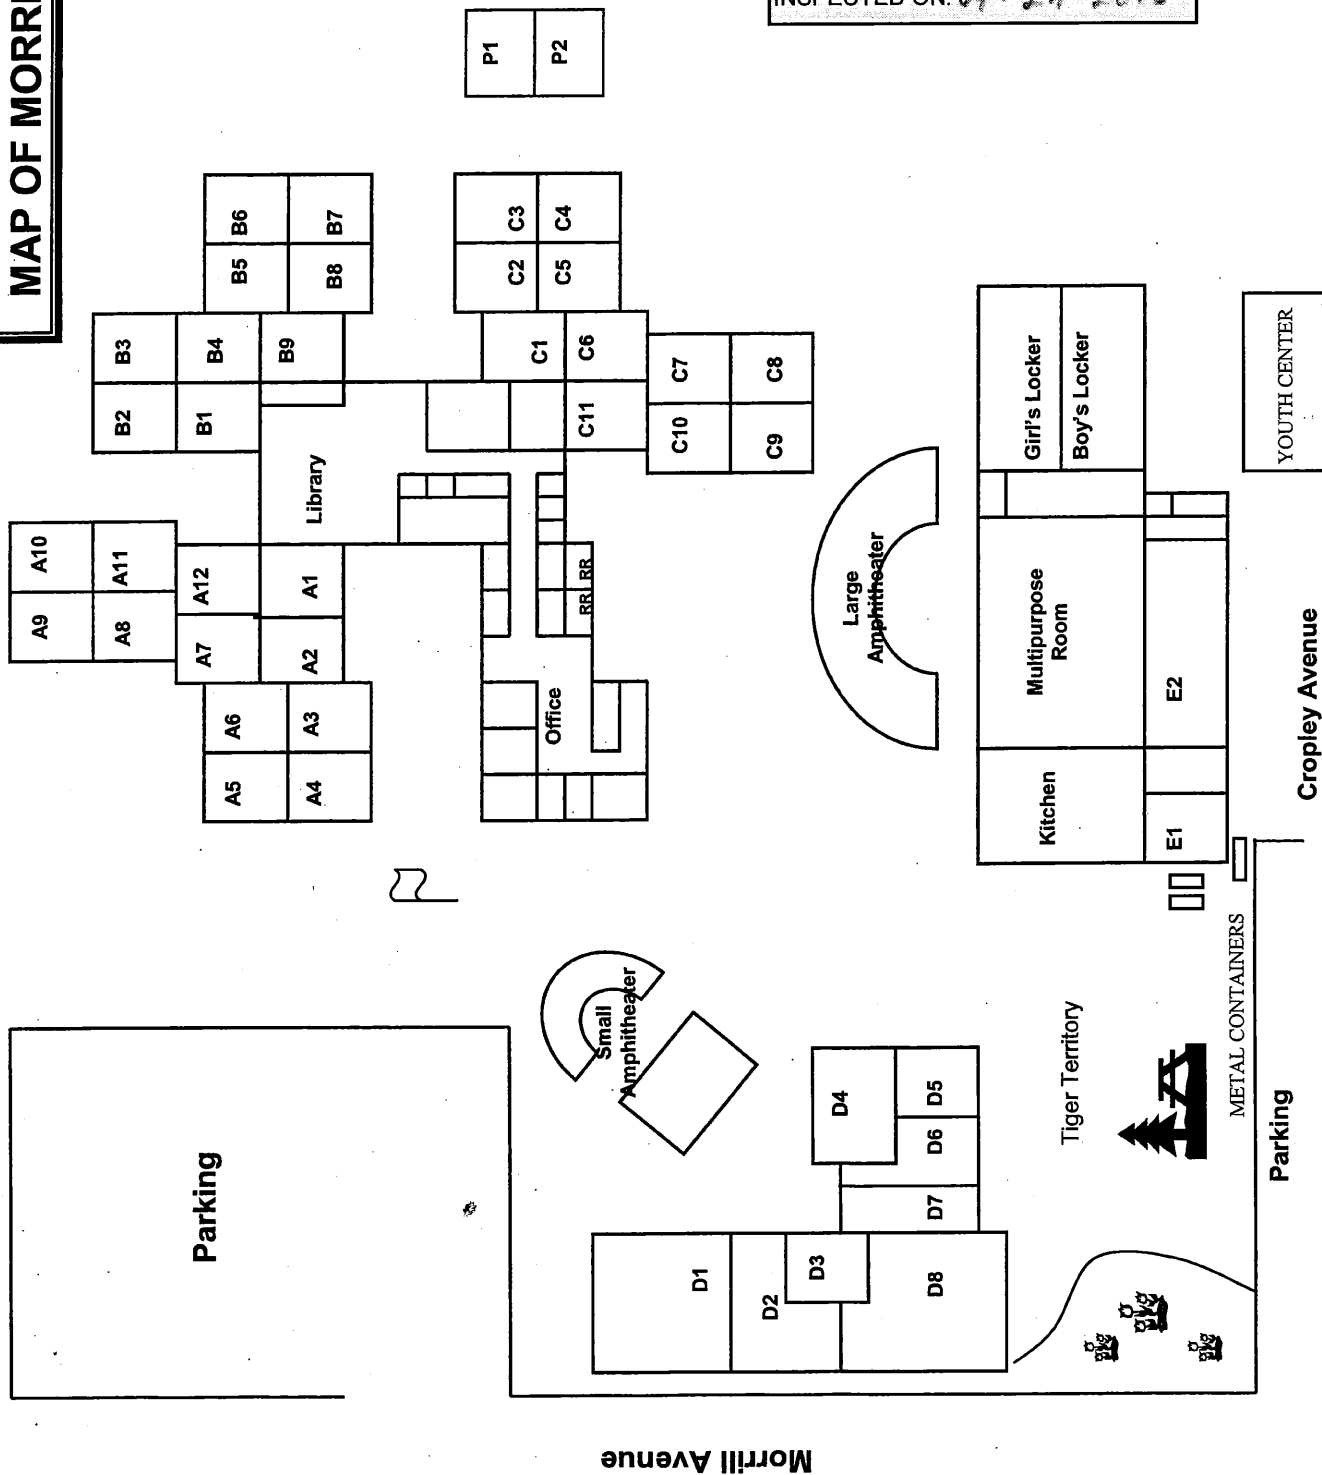


MAP OF MORRILL

MORRILL MIDDLE SCHOOL

INSPECTED ON: 04-02-13


P1

P2

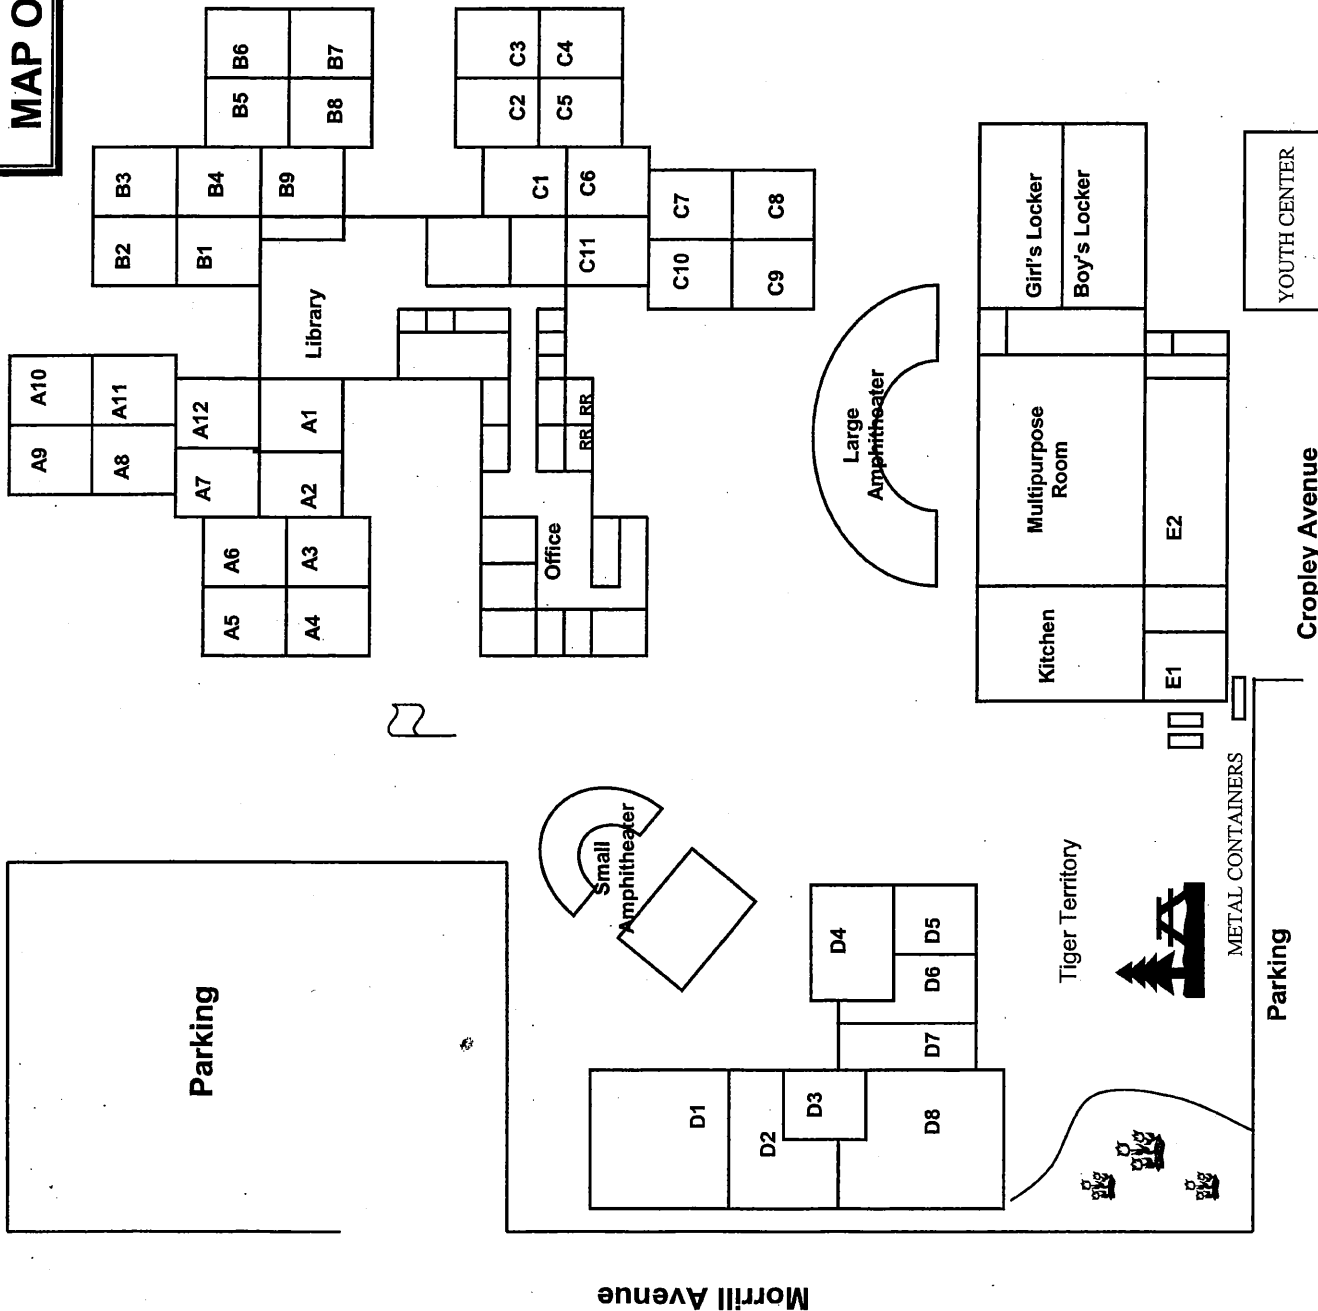


MAP OF MORRILL

MORRILL MIDDLE SCHOOL
INSPECTED ON: 10-9-12

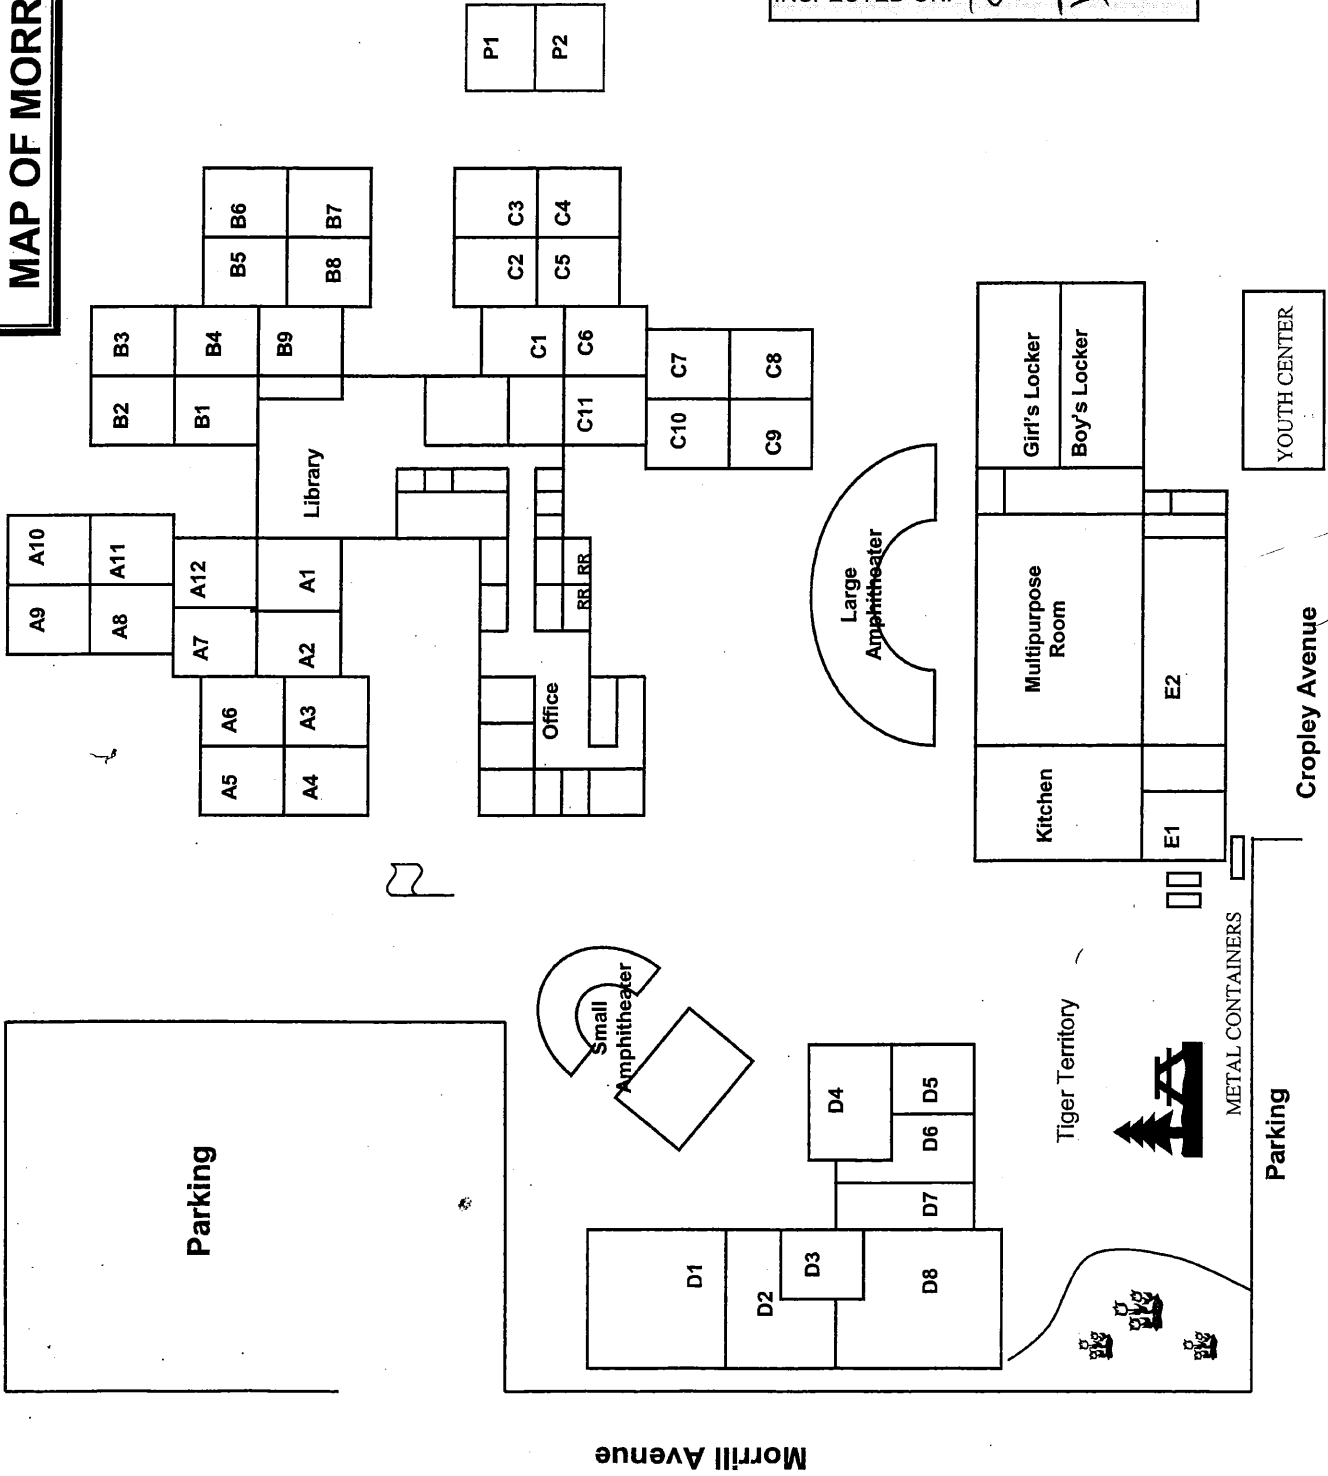

MAP OF MORRILL

MORRILL MIDDLE SCHOOL
INSPECTED ON: 04-12-12

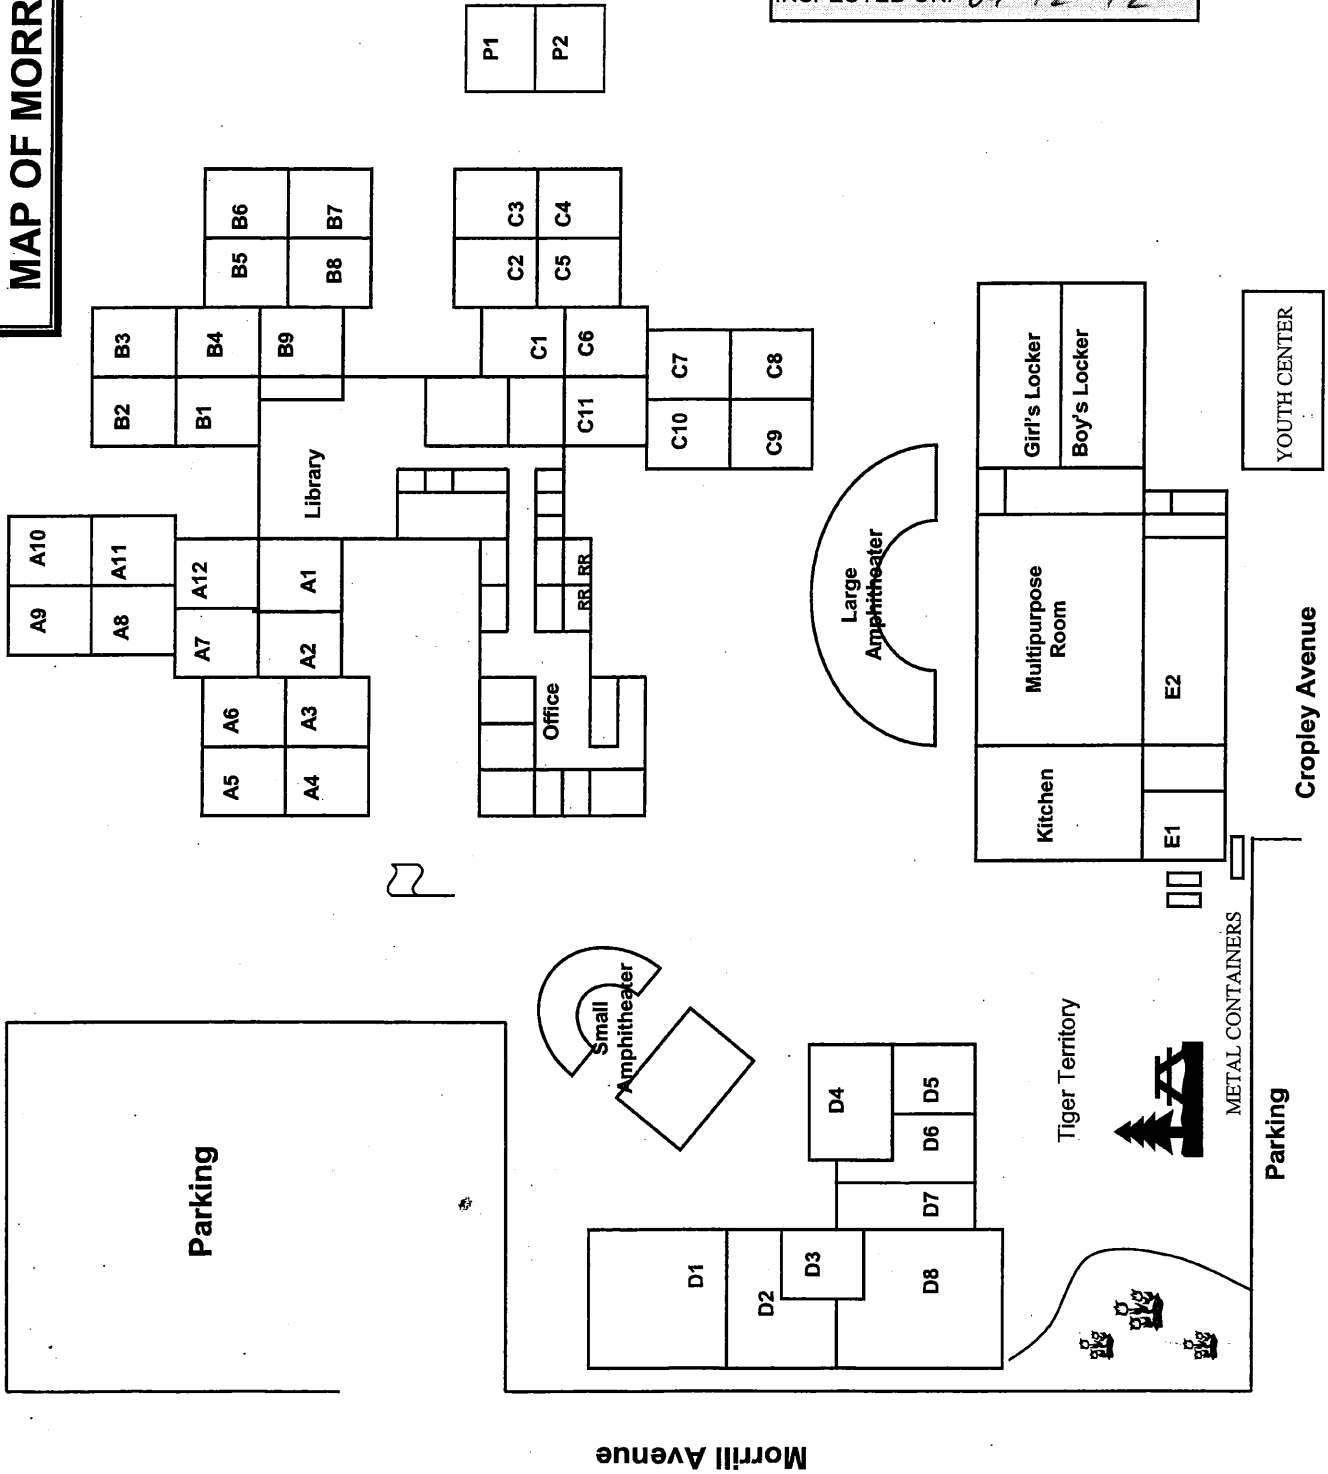


MAP OF MORRILL

MORRILL MIDDLE SCHOOL

INSPECTED ON: 11-29-11

P1

P2

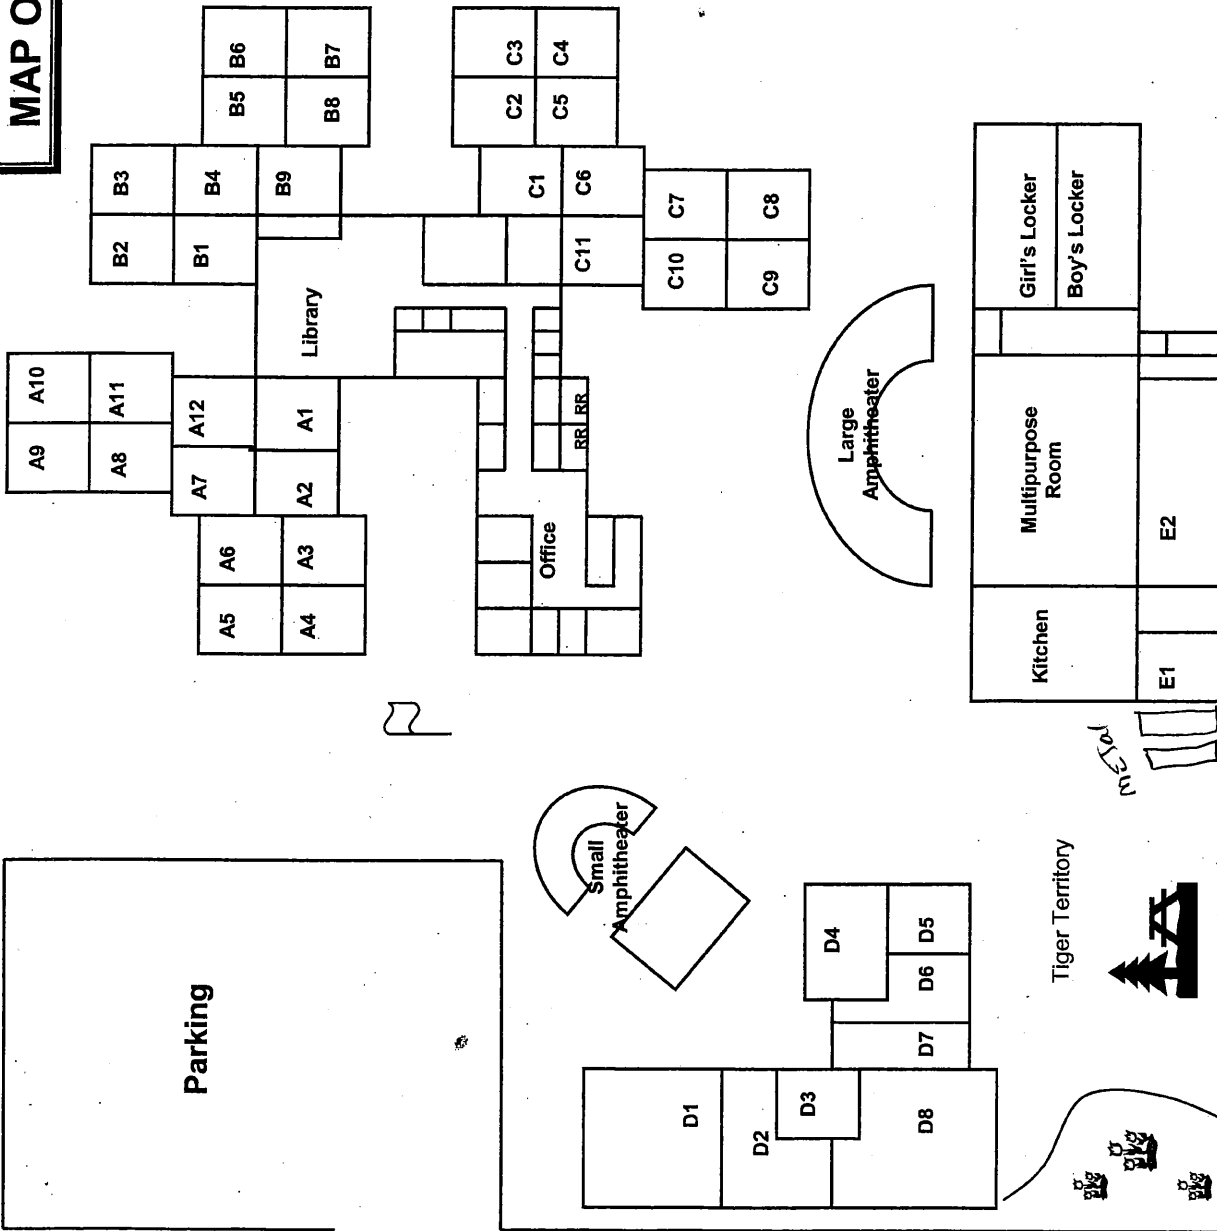

YOUTH CENTER

Cropley Avenue


Parking

Morrill Avenue

MAP OF MORRILL

MORRILL MIDDLE SCHOOL
INSPECTED ON: 9/2/10

P1	P2
----	----

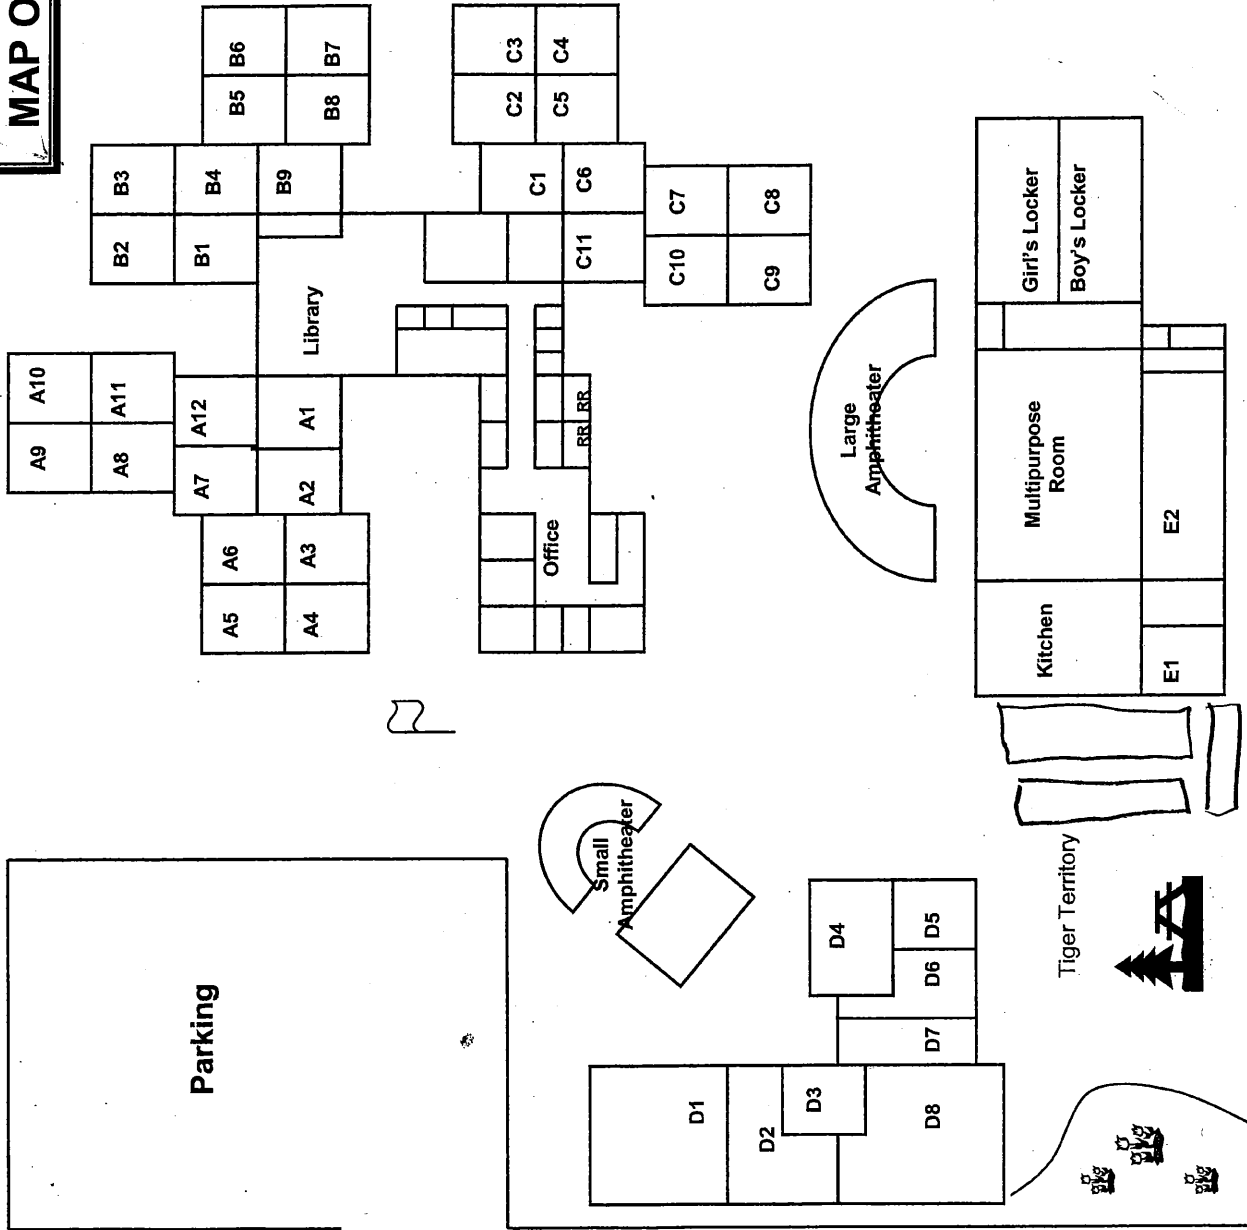


Morrill Avenue

Cropley Avenue

MAP OF MORRILL





MORRILL MIDDLE SCHOOL
INSPECTED ON: 03-09-10

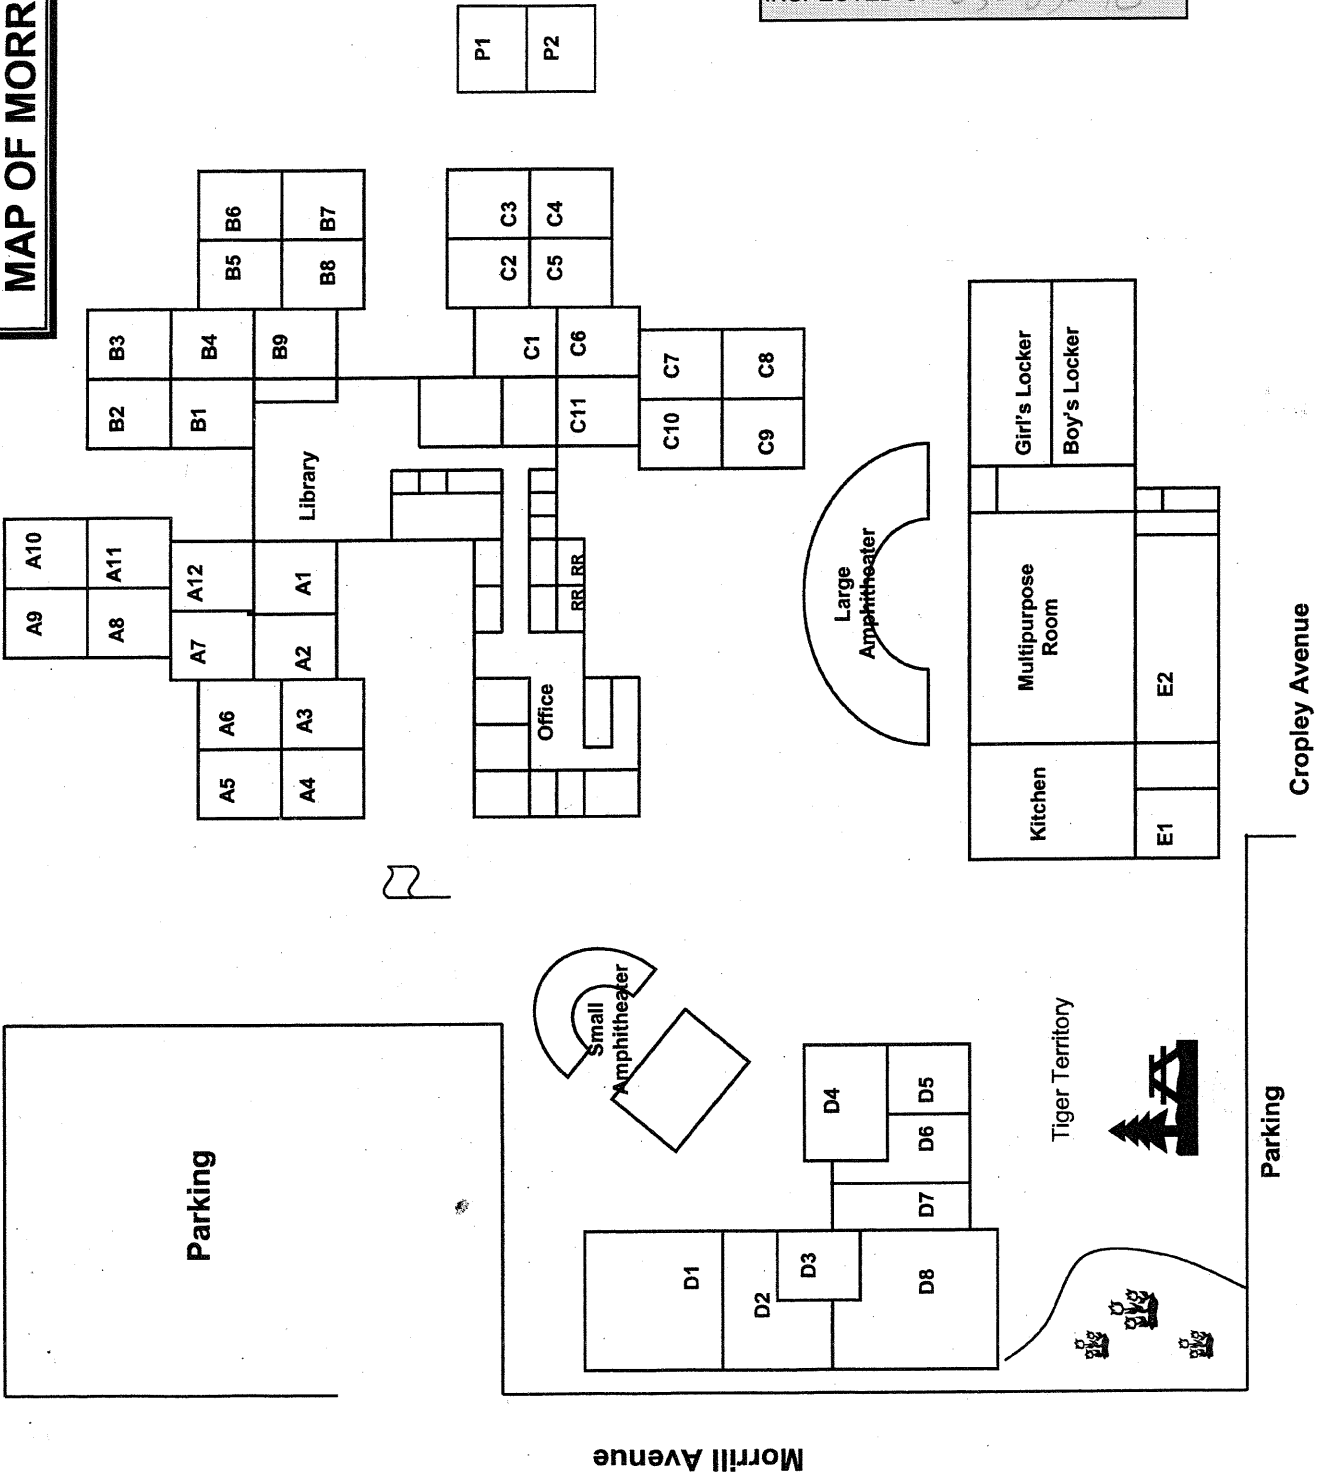

MAP OF MORRILL

MORRILL MIDDLE SCHOOL
INSPECTED ON: 09-08-09

P1	P2
----	----

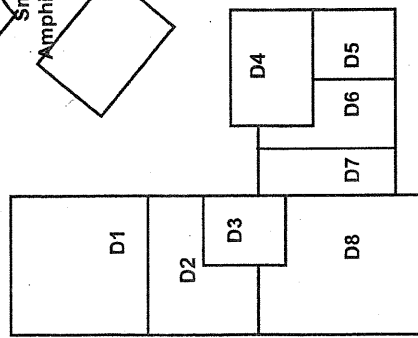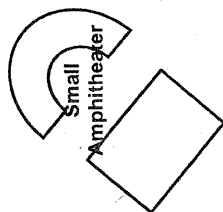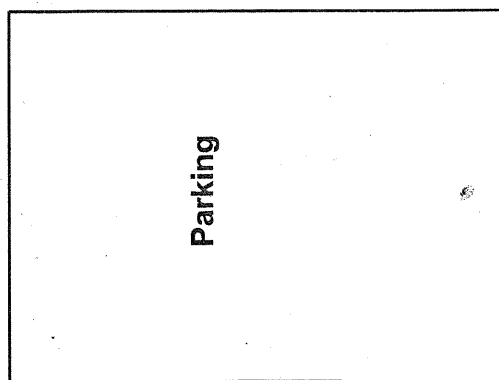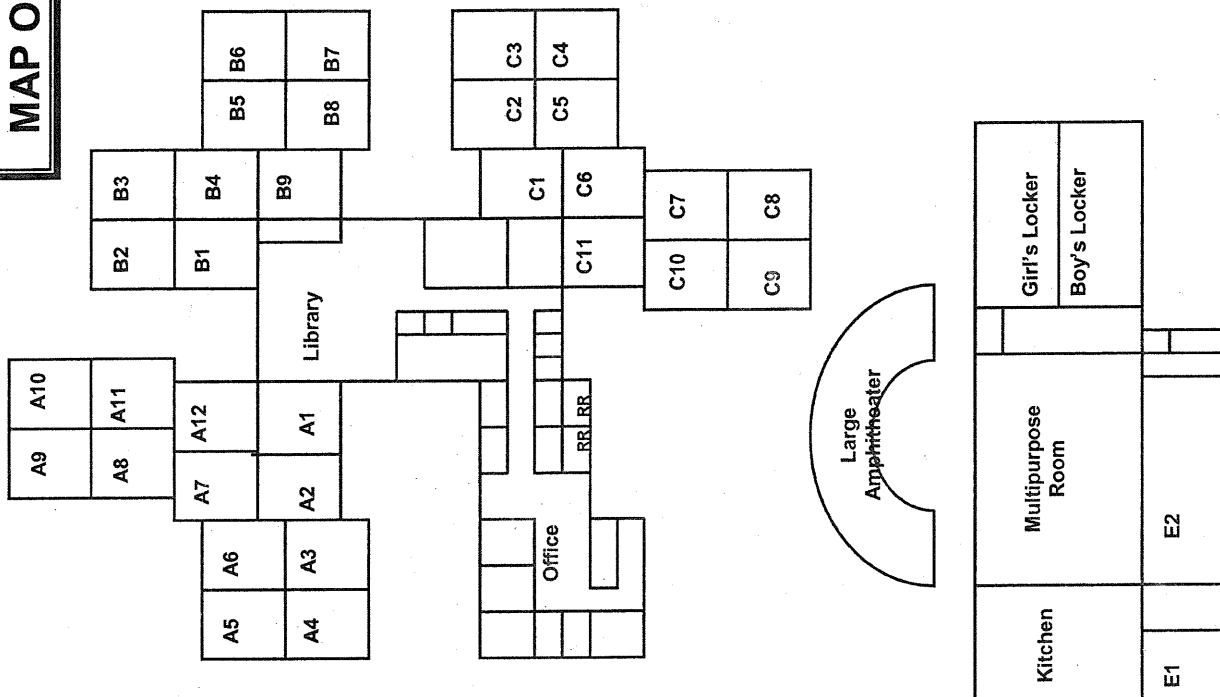

Tiger Territory



Handwritten: Metal Storage Containers

Parking




Cropley Avenue

Morrill Avenue

MAP OF MORRILL

MORRILL MIDDLE SCHOOL
INSPECTED ON: 09-098
5/12/09

P1	P2
----	----

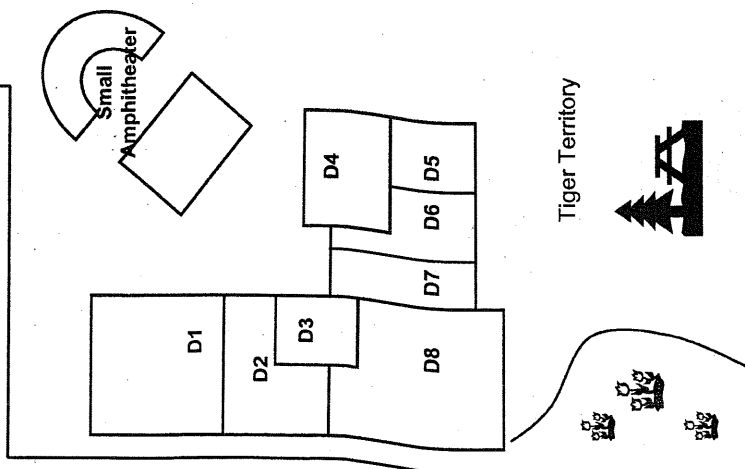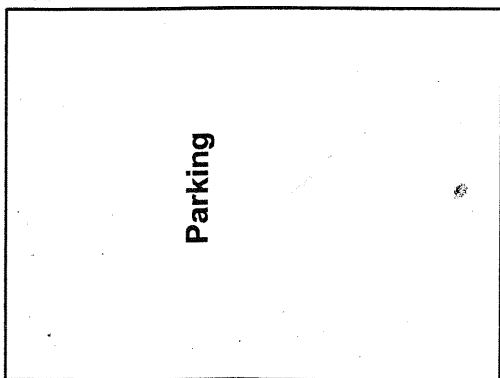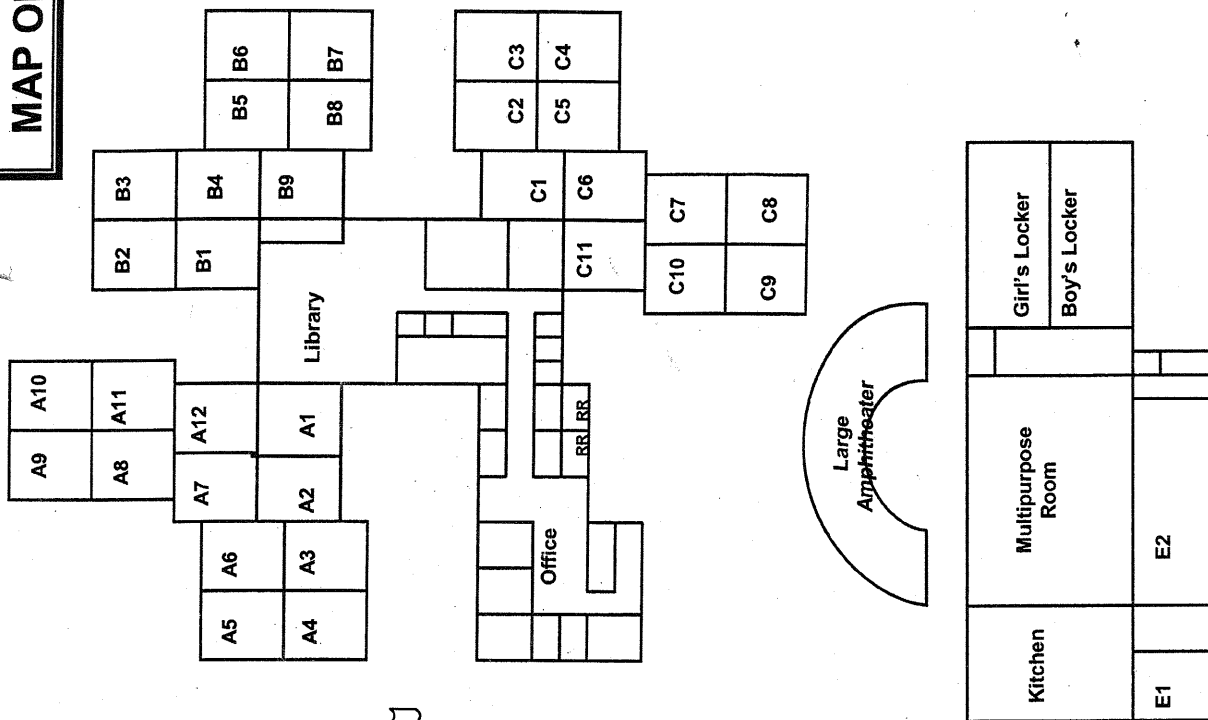


Morrill Avenue

Cropley Avenue


MAP OF MORRILL

MORRILL MIDDLE SCHOOL
INSPECTED ON: 10/6/08

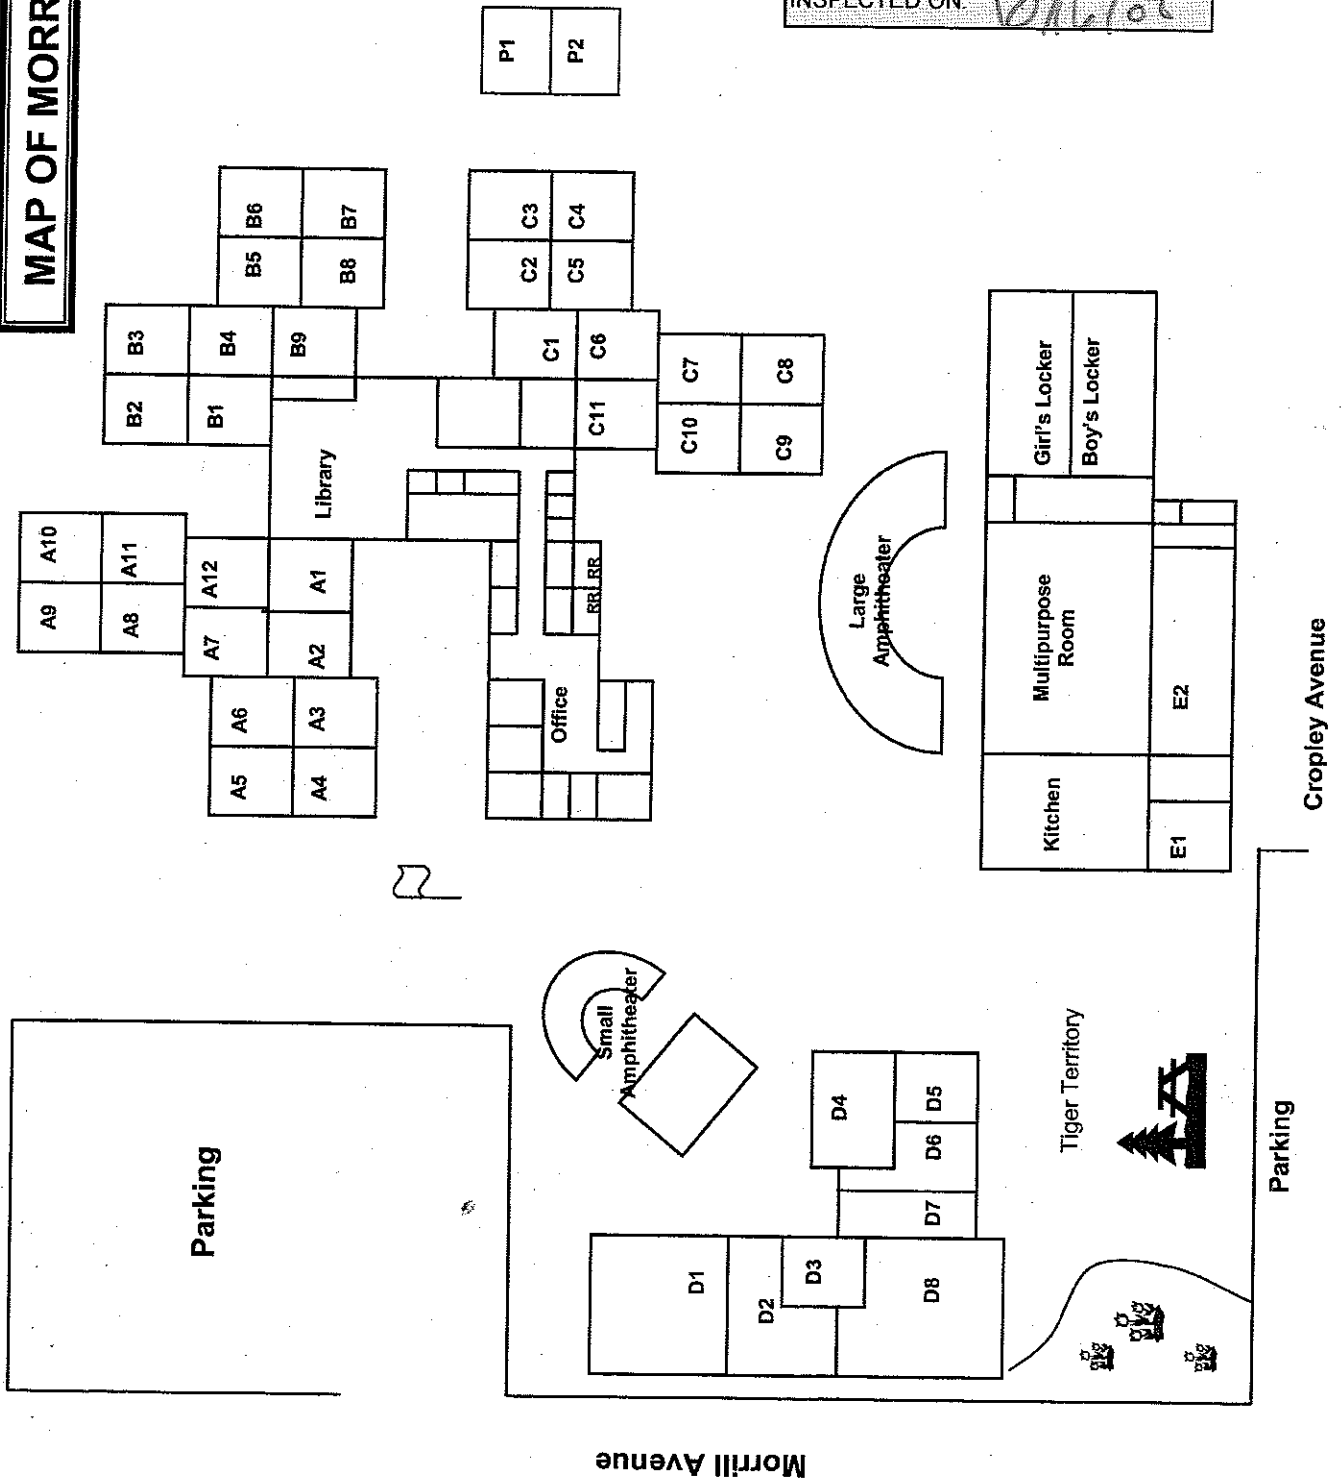

MAP OF MORRILL

MORRILL MIDDLE SCHOOL
INSPECTED ON: 4-18-08

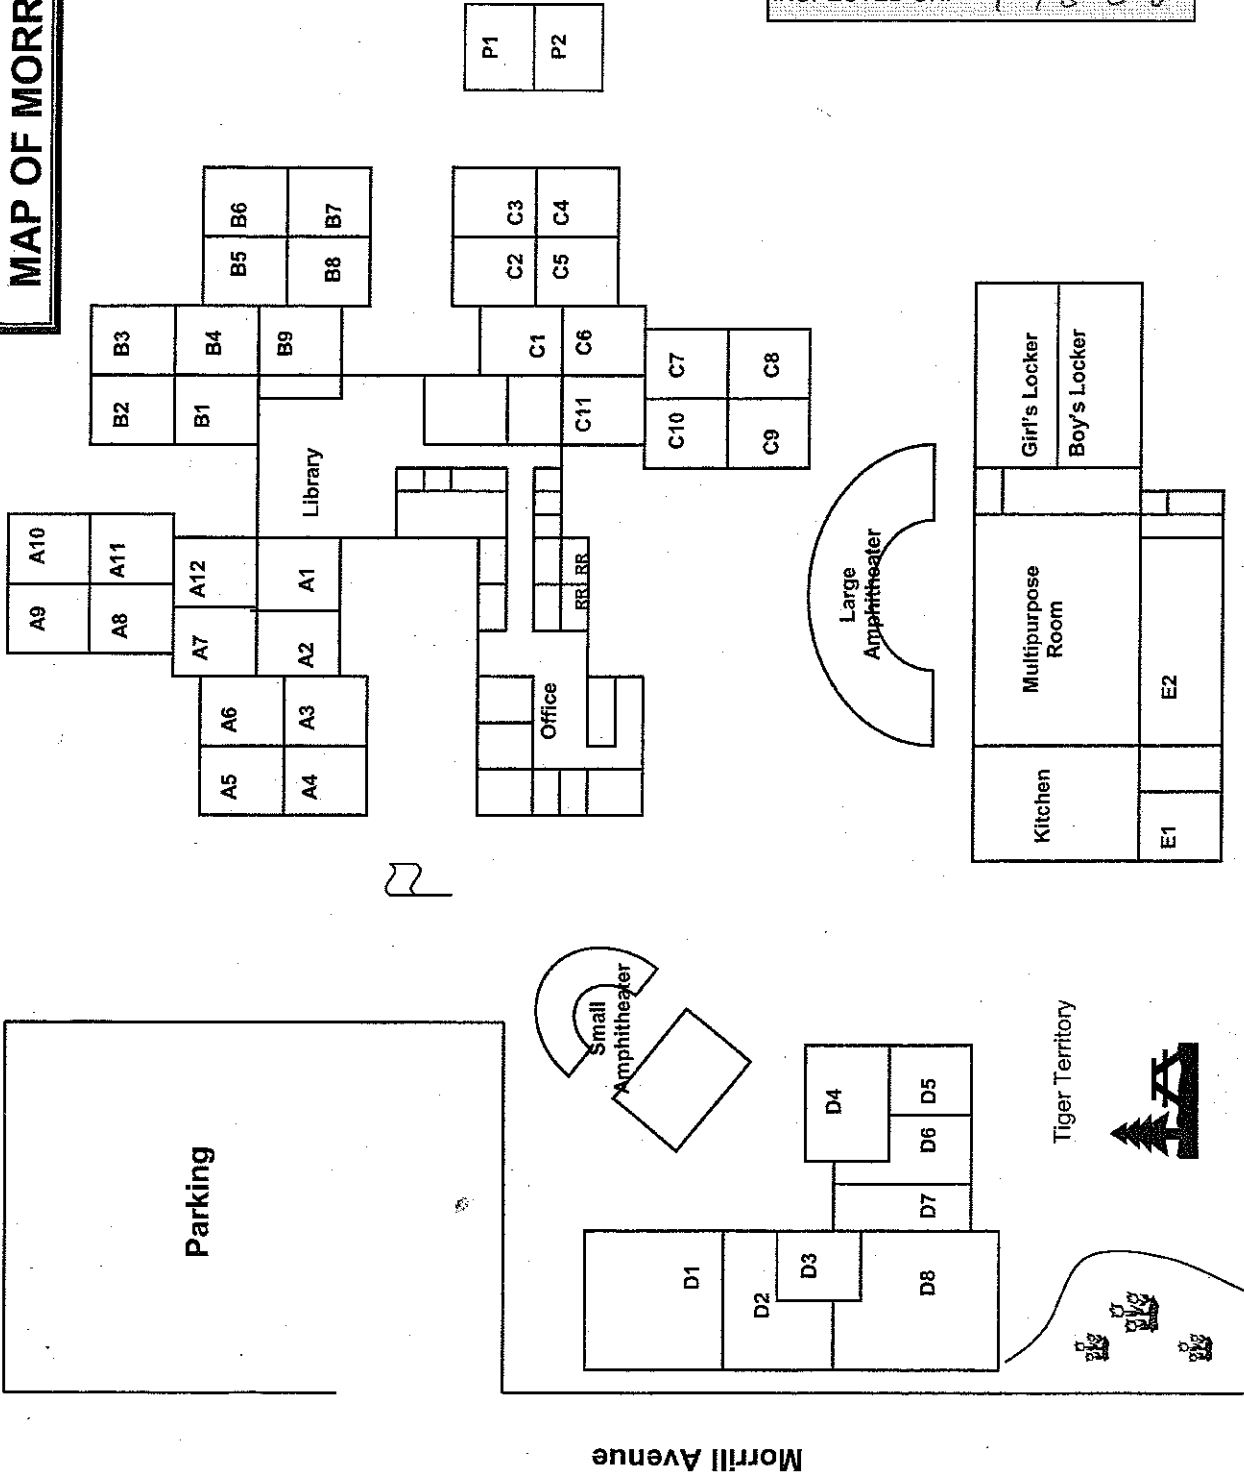

Morrill Avenue


Cropley Avenue

Parking

Parking

MAP OF MORRILL


MORRILL MIDDLE SCHOOL
INSPECTED ON: 11-06-07

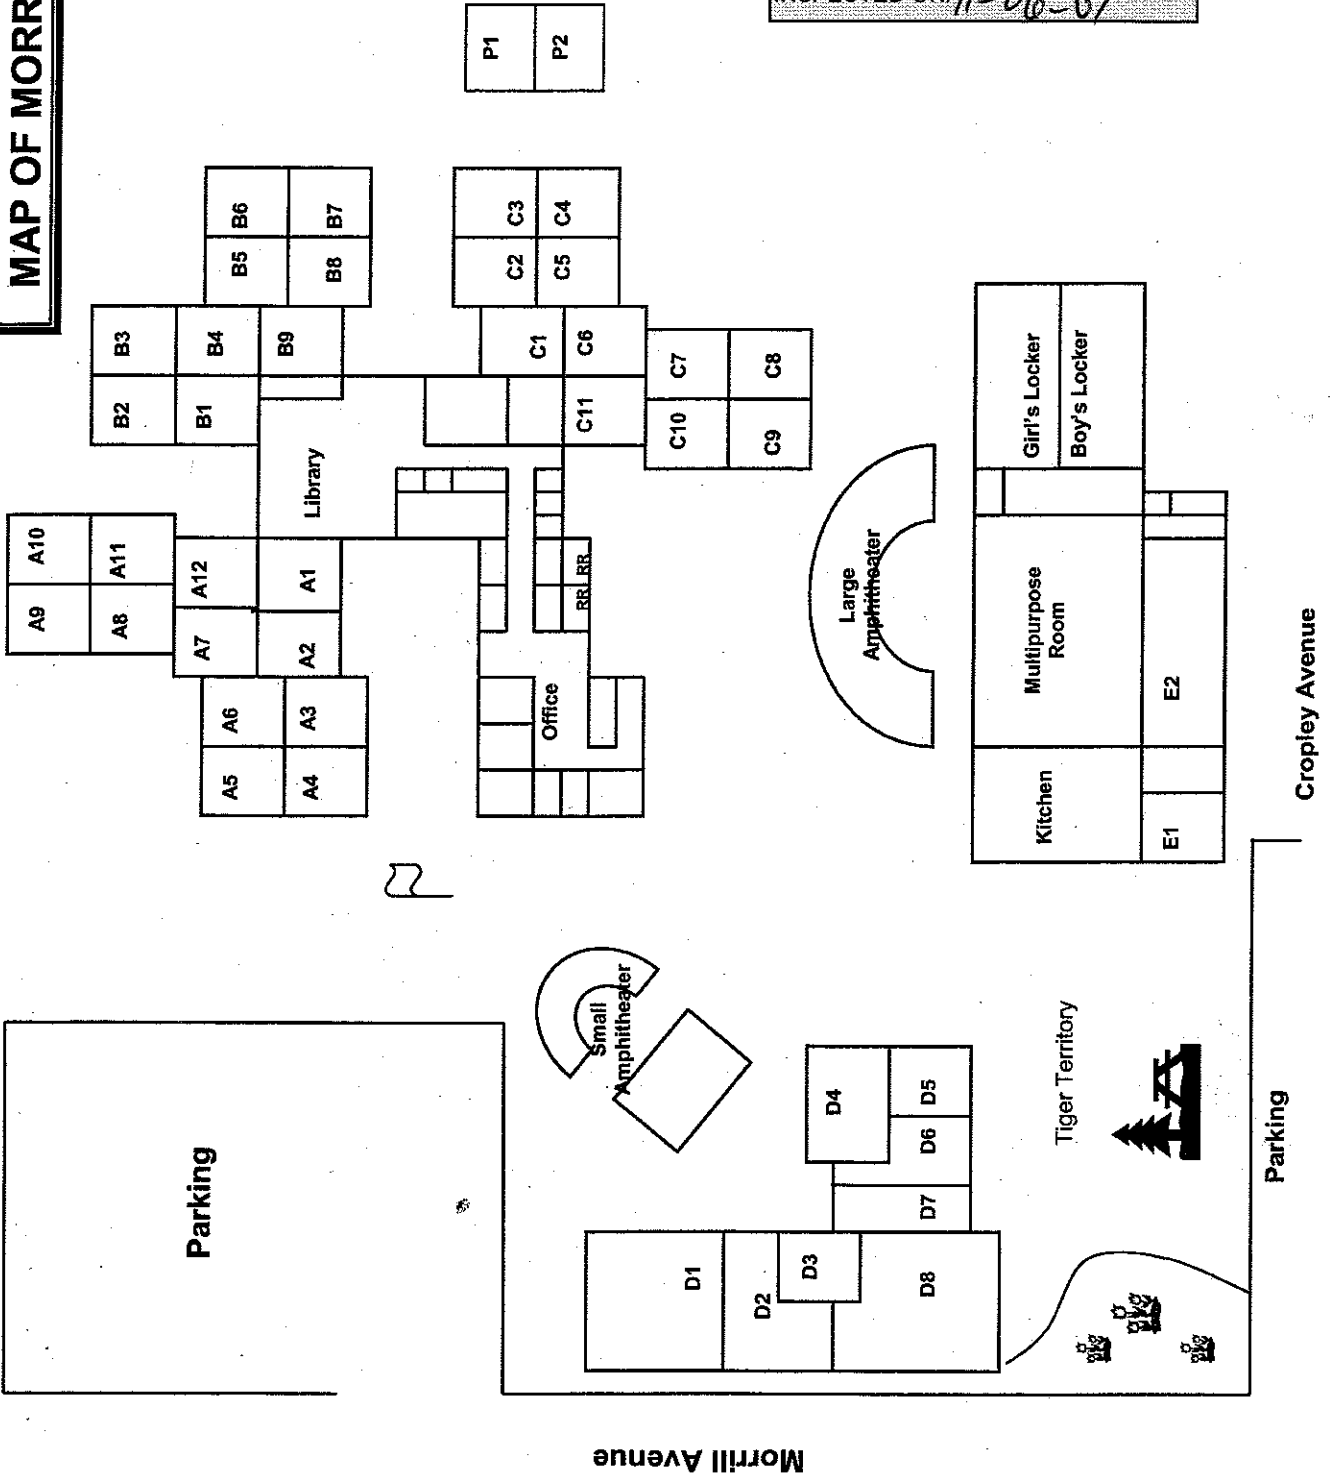

MORRILL MIDDLE SCHOOL 2012
 INSPECTED ON: 03/09/07



NOT TO SCALE

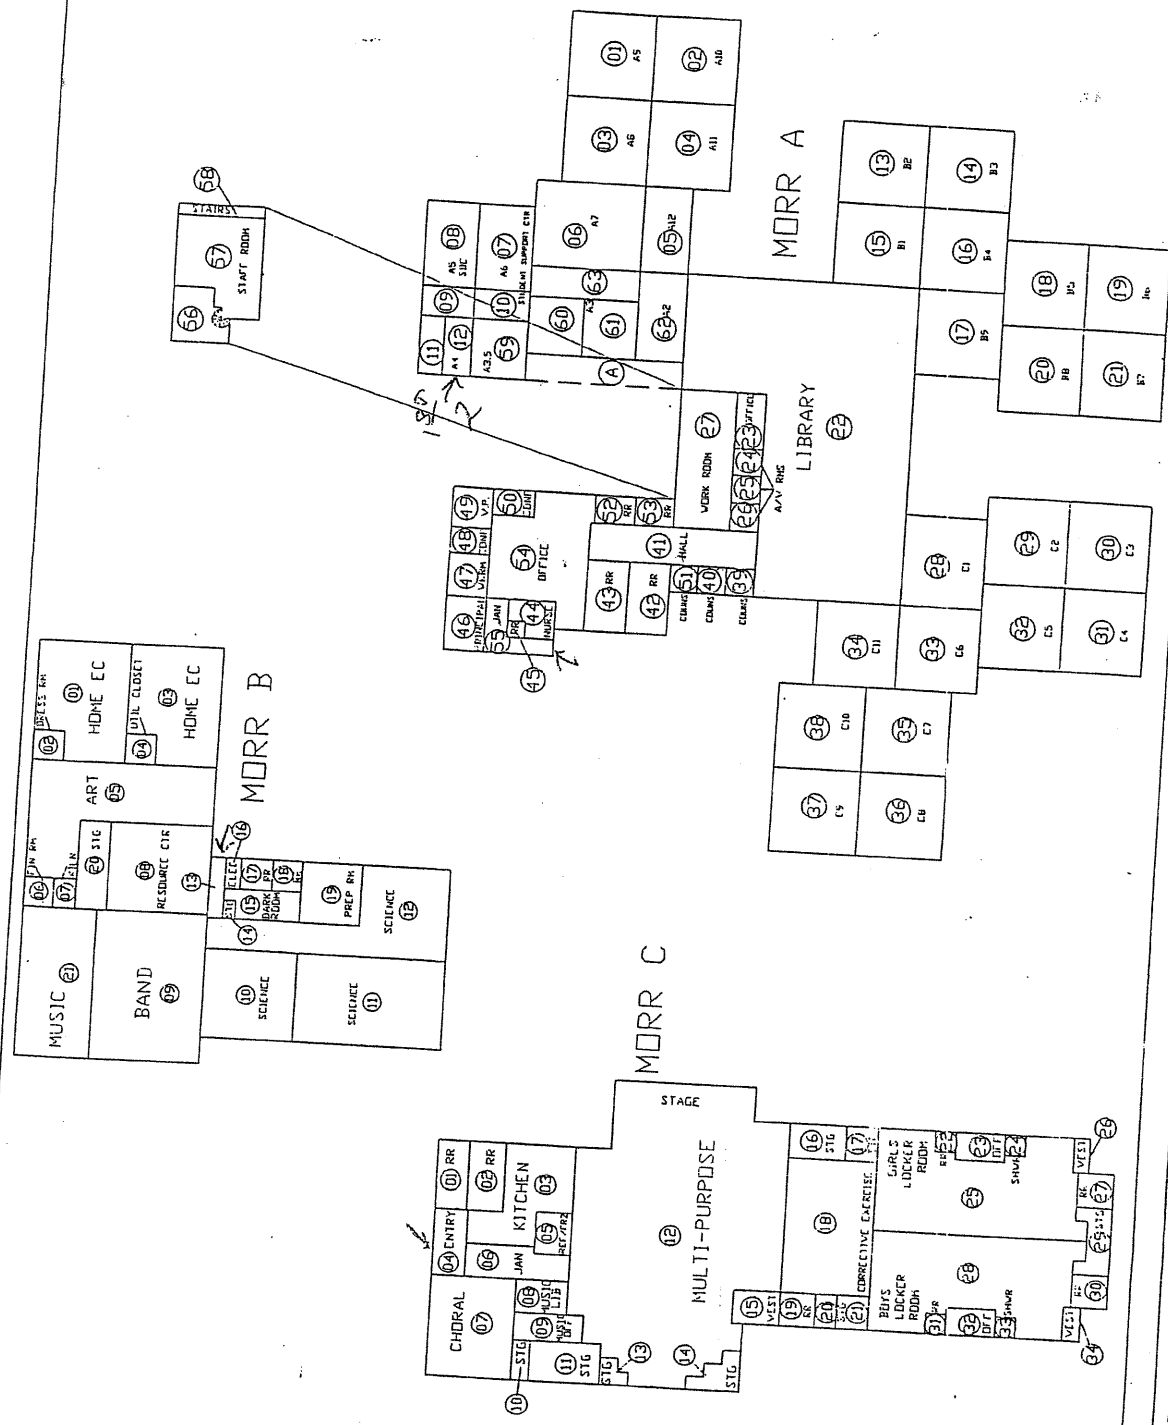


NAMING CONVENTION SITEPLAN

SCHOOL NAME: MORRILL MIDDLE
 ADDRESS: 1970 MORRILL AVENUE
 COUNTY: SANTA CLARA
 ACREAGE: N/A
 REV. DATE: 01/25/99

BERRYESSA UNITED
 1376 PIEDMONT RD
 SAN JOSE, CA 95132

MAP OF MORRILL


MORRILL MIDDLE SCHOOL
PAGE 1 OF 2
INSPECTED ON: 03/09/07

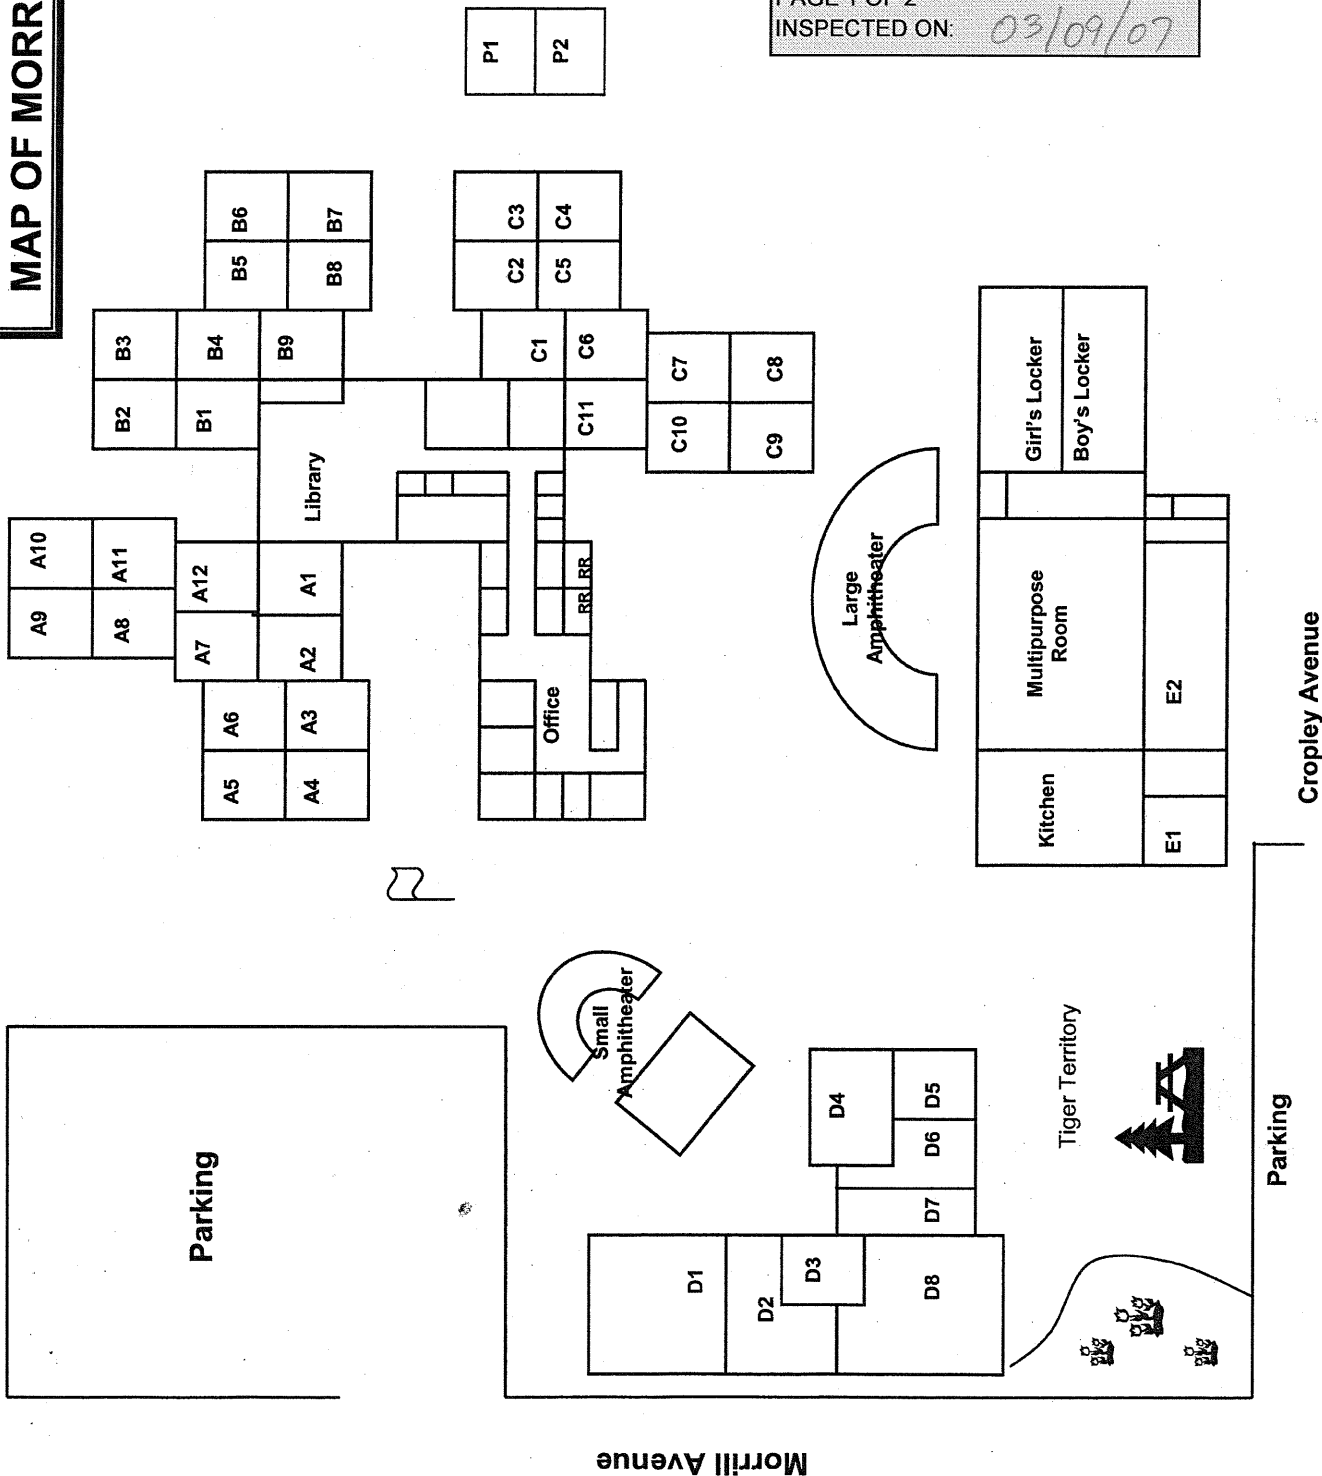

MORRILL MIDDLE SCHOOL
INSPECTED ON: 08-25-06



NOT TO SCALE

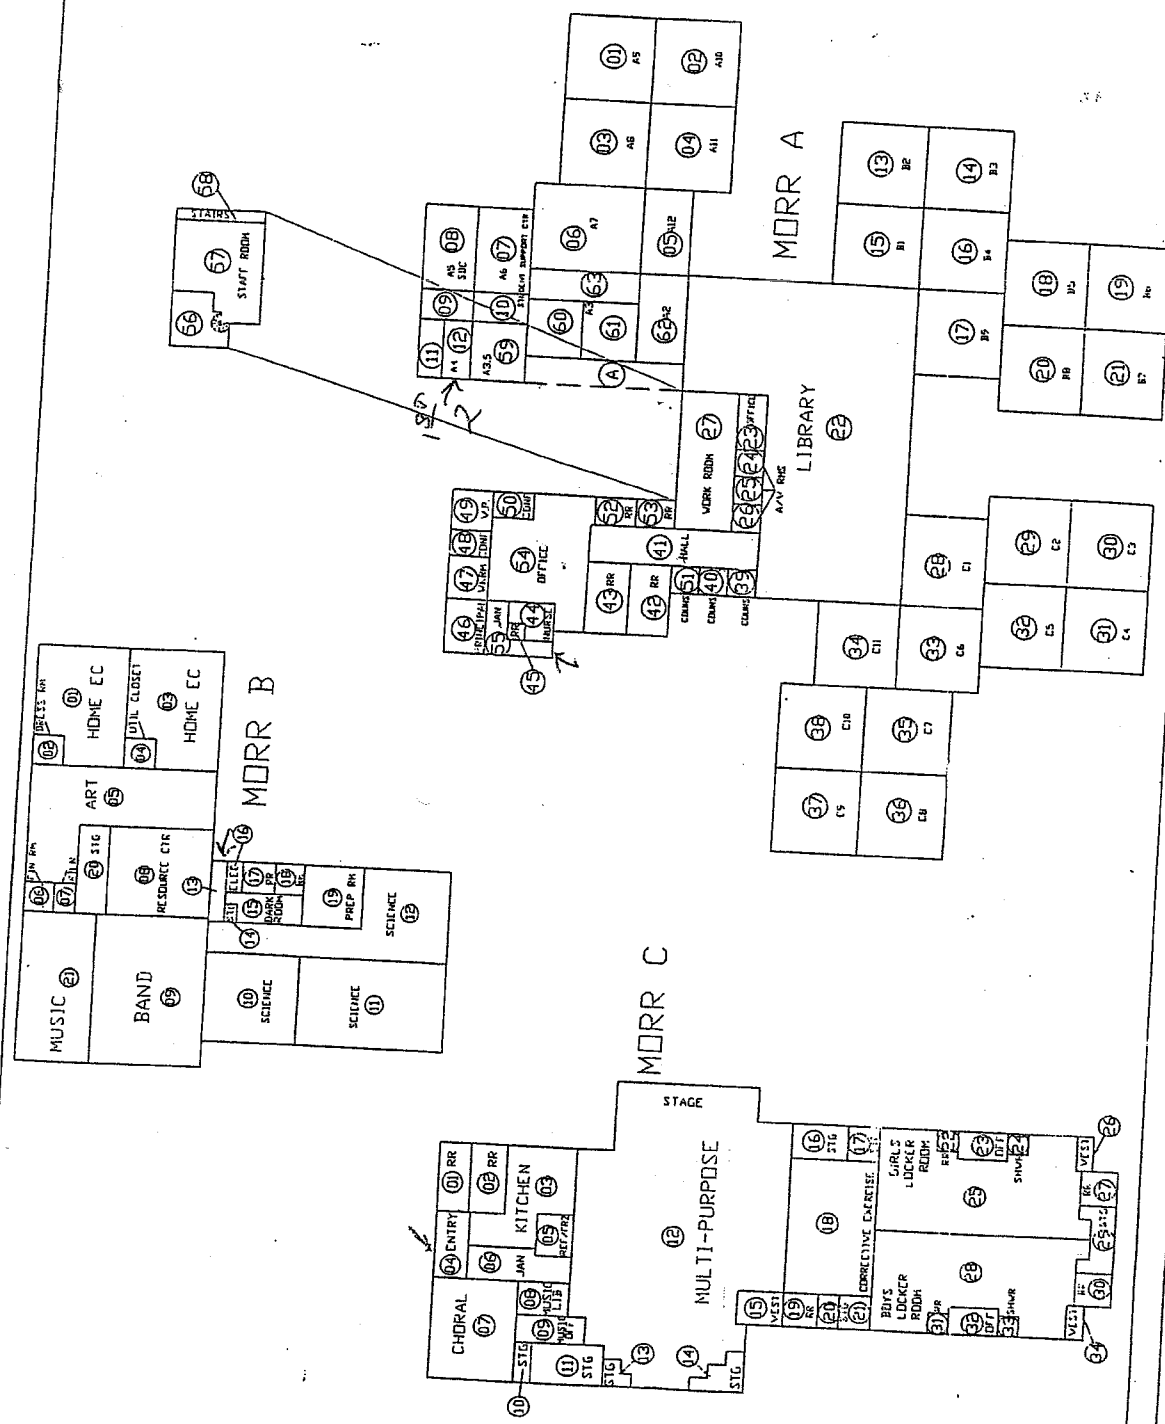

NAMING CONVENTION SITEPLAN


BERRYESSA UNIFIED
1376 PIEDMONT RD
SAN JOSE, CA 95132

SCHOOL NAME: MORRILL MIDDLE
ADDRESS: 1970 MORRILL AVENUE
SCHOOL DISTRICT: BERRYESSA UNIFIED
COUNTY: SANTA CLARA
ACREAGE: N/A
REV. DATE: 01/25/99

MORRILL MIDDLE SCHOOL
INSPECTED ON: 04/20/06



NOT TO SCALE

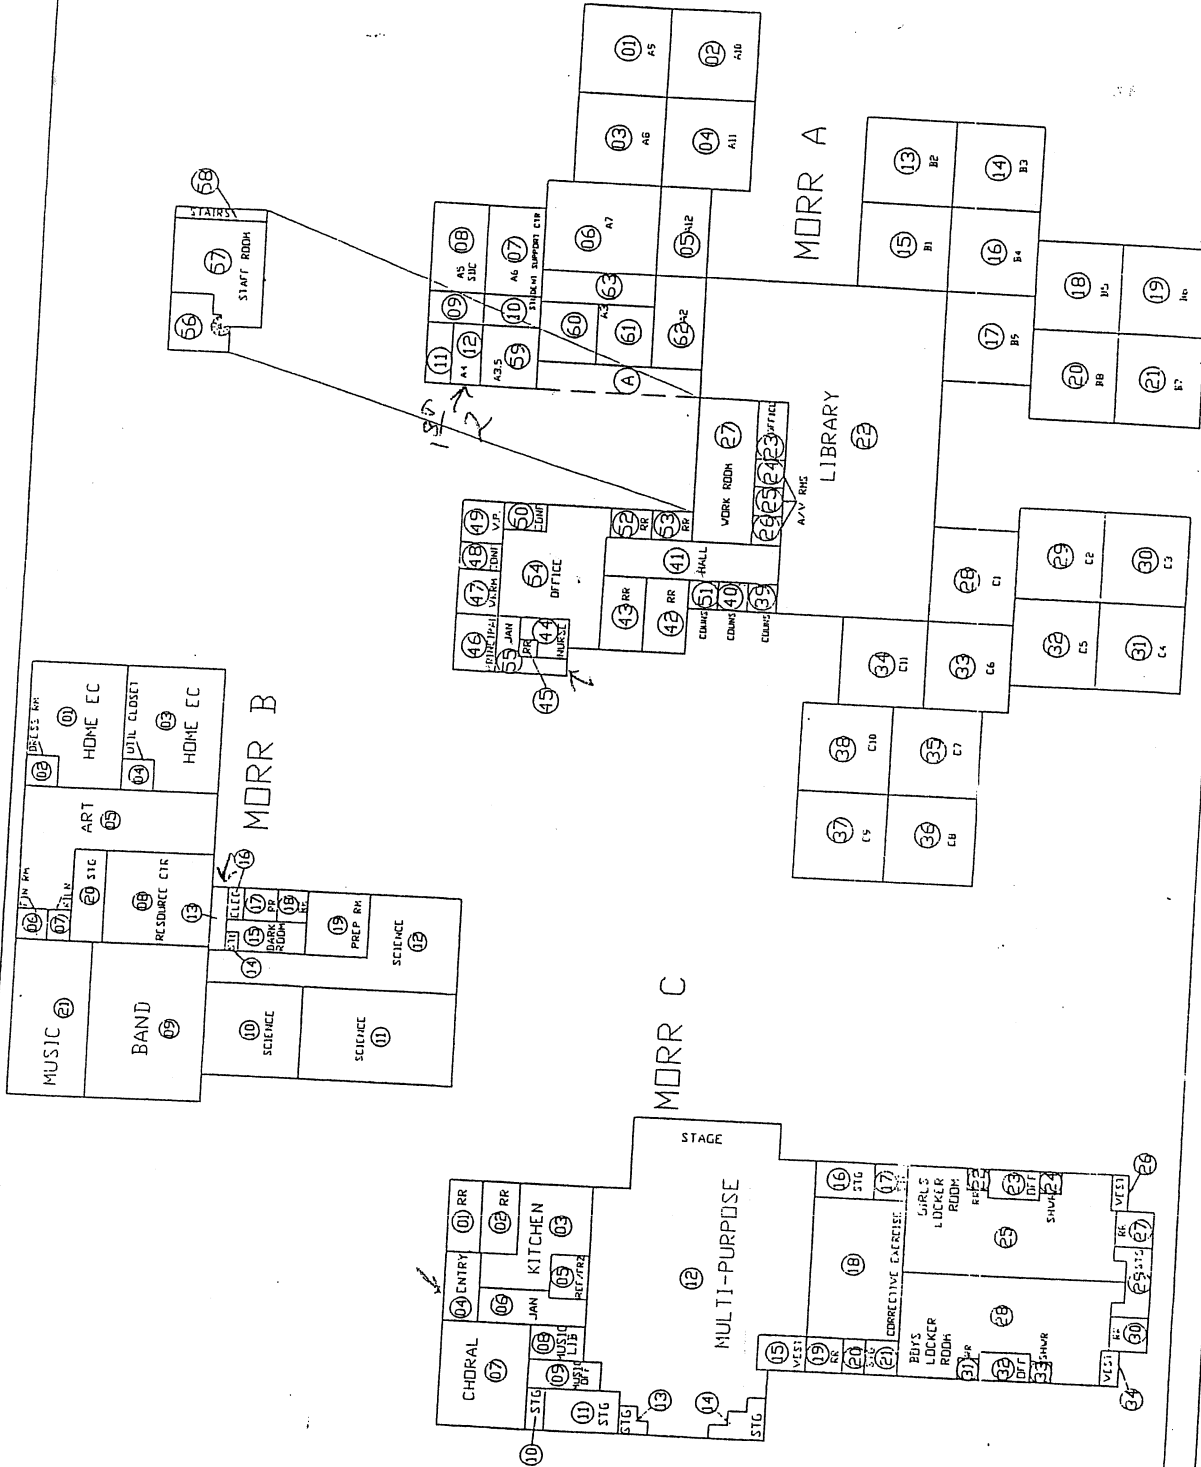

NAMING CONVENTION SITEPLAN


SCHOOL NAME: MORRILL MIDDLE
ADDRESS: 1970 MORRILL AVENUE
SCHOOL DISTRICT: BERRYESSA UNIFIED
COUNTY: SANTA CLARA
ACREAGE: N/A
REV. DATE: 01/25/99

BERRYESSA UNIFIED
1376 PIEDMONT RD
SAN JOSE, CA 95132

MORRILL MIDDLE SCHOOL
INSPECTED SEPTEMBER 2005



NOT TO SCALE

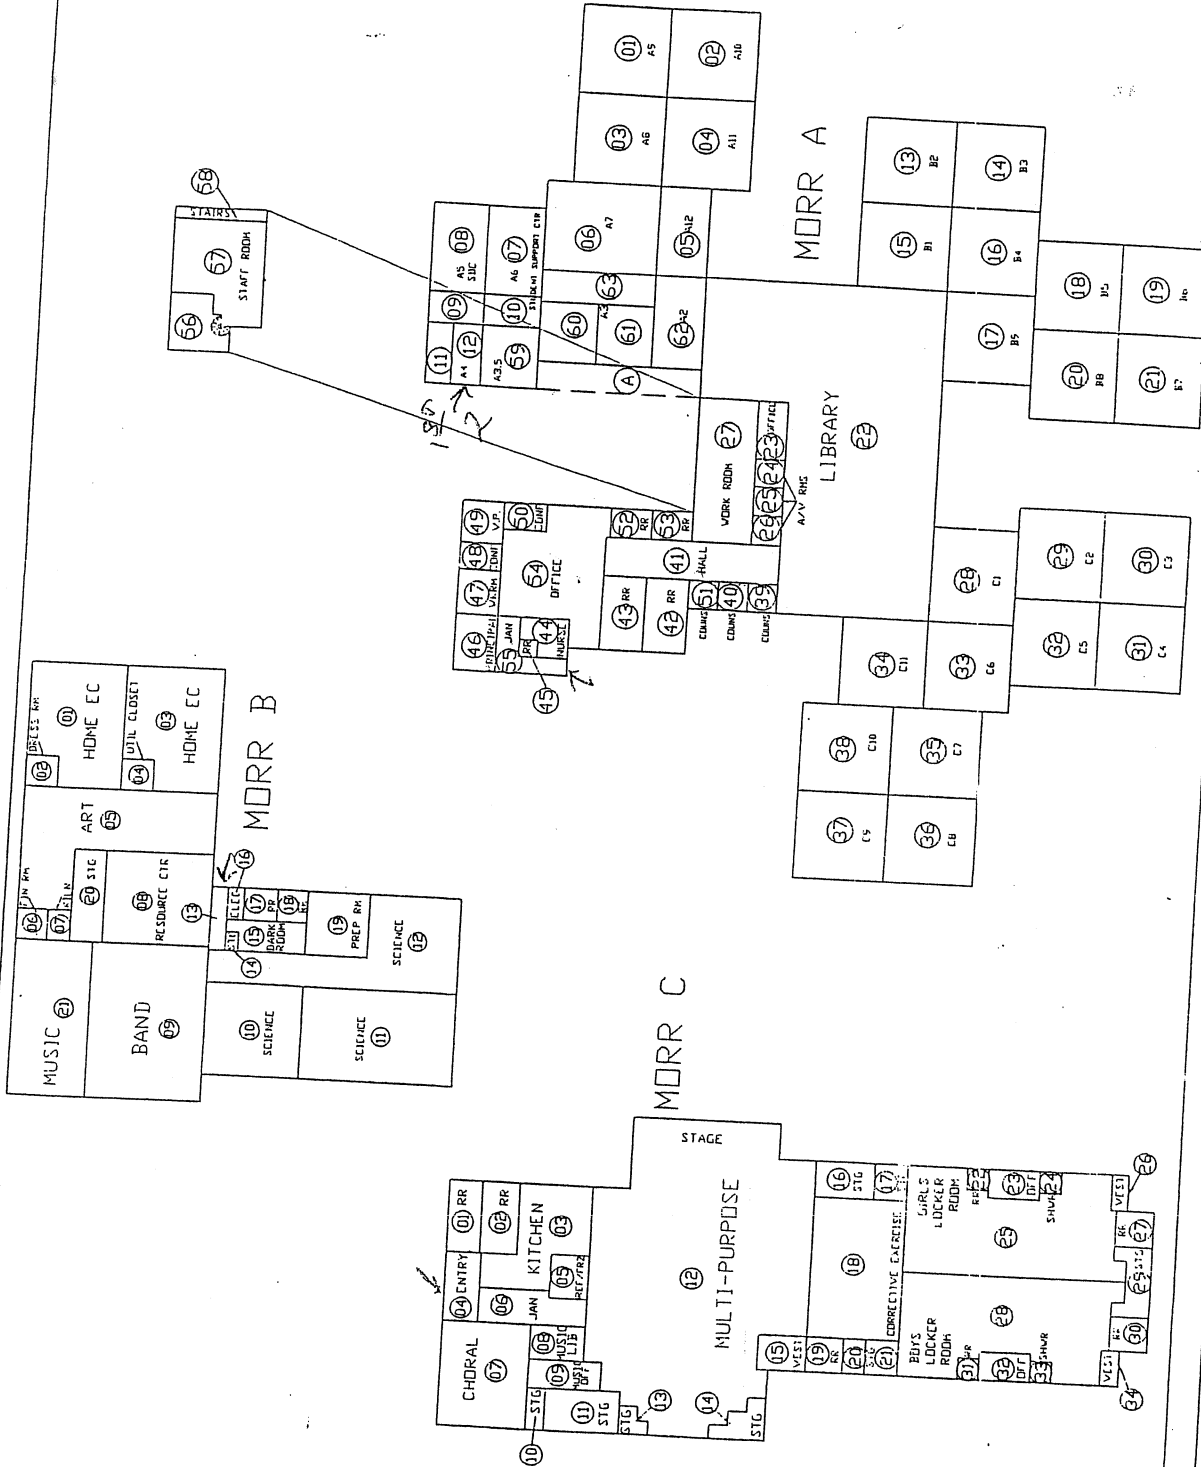

NAMING CONVENTION SITEPLAN

SCHOOL NAME: MORRILL MIDDLE
ADDRESS: 1970 MORRILL AVENUE
SCHOOL DISTRICT: BERRYESSA UNIFIED
COUNTY: SANTA CLARA
ACREAGE: N/A
REV. DATE: 01/25/99

BERRYESSA UNIFIED
1376 PIEDMONT RD
SAN JOSE, CA 95132