

SIX-MONTH SURVEILLANCE AHERA REPORT

**BUESD OLD DISTRICT OFFICE
1376 PIEDMONT ROAD
SAN JOSE, CA 95132**

**PREPARED FOR:
BERRYESSA UNION ELEMENTARY SCHOOL DISTRICT
981 RIDDER PARK DRIVE
SAN JOSE, CA 95131**

**INSPECTED ON:
SEPTEMBER 16, 2025**

HAZMAT DOC PROJECT #25-101

**PREPARED BY:
HAZMAT DOC
3080 OLCOTT STREET • SUITE D135
SANTA CLARA, CA 95054
Tel: 408.748.0055**

BERRYESSA UNION ELEMENTARY SCHOOL DISTRICT

BUESD OLD DISTRICT OFFICE

**INSPECTED ON:
SEPTEMBER 16, 2025**

INSPECTED BY:



**Leland Kafeyan
Cal/OSHA Certified Site Surveillance Technician
Certification Number 06-4110**

REPORTED BY:

Maheen B. Doctor

**Maheen B. Doctor
Cal/OSHA Certified Asbestos Consultant
Certification Number 95-1798**

CONTENTS

PART - I

LEGEND AND GLOSSARY OF TERMS

PART – II

AHERA REPORT A – LIST OF BUILDINGS

PART – III

AHERA REPORT B – SURVEY REPORT

PART – IV

HOMOGENEOUS MATERIALS REPORT

PART – V

FRIABLE LOCATIONS REPORT

PART – VI

NON-FRIABLE LOCATIONS REPORT

PART – VII

RECOMMENDATIONS REPORT

PART – VIII

SAMPLES REPORT

PART – IX

DAMAGE REPORT

PART - X

SITE MAPS

LEGEND

THE FOLLOWING IS A LIST OF ABBREVIATIONS USED IN THIS REPORT:

Asbestos Sample Types

AC	=	ACTINOLITE
AM	=	AMOSITE
AN	=	ANTHOPHYLLITE
CH	=	CHRYSOTILE
CR	=	CROCIDOLITE
TR	=	TREMOLITE
ND	=	NONE DETECTED
NS	=	NO SAMPLE

Measurements

APPROX.	=	APPROXIMATELY
EA	=	EACH
I	=	INCHES
LF	=	LINEAR FEET
N	=	NUMBER
O.D.	=	OUTSIDE DIAMETER
SF	=	SQUARE FEET
TBD	=	TO BE DETERMINED

LIST OF BUILDINGS AT

BUESD OLD DISTRICT OFFICE

BUILDING NAME	BUILDING AREA (APPROXIMATE)
BUILDING USED AS (#FLOORS) CONSTRUCTION	

AAA SITE NOTE AAA

()

MAIN OFFICE BUILDING

Offices, Classrooms, Storage Rooms, Restrooms, Staff Rooms 24,500 SF
(1) Wood, Metal, Plaster

METAL STORAGE CONTAINER

Storage 256 SF
(1) Metal

Total Number Of Buildings :	<u>3</u>	(Approximate) Total Sq Ft. :	<u>24,756</u>
-----------------------------	----------	------------------------------	---------------

End Of Report, Total Of 1 Pages

SURVEY REPORT FOR
BUESD OLD DISTRICT OFFICE

BUILDING NAME		
LOCATION		
MATERIAL TYPE		QTY (APPROXIMATE)
COMMENTS		

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

AAA	SITE NOTE	AAA
AAA	SITE NOTE	AAA

02/13/2024	SITE NOTE:
02/13/2024	BUESD DISTRICT OFFICE MOVED TO 981 RIDDER PARK DRIVE, SAN JOSE, CA 95131. 1376 PIEDMONT ROAD, SAN JOSE, CA 95132 CAMPUS USED FOR OFFICES OVERFLOW.

SURVEY REPORT FOR

BUESD OLD DISTRICT OFFICE

BUILDING NAME	
LOCATION	
MATERIAL TYPE	QTY (APPROXIMATE)
COMMENTS	

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
-------------------	-------------------------	----------------------	----------------------

MAIN OFFICE BUILDING

MAIN OFFICE BUILDING

03/06/2007	BUILDING NOTES:
05/13/2009	New Suspended Ceiling Tiles installed in COMPUTER EQUIPMENT SERVER ROOM.
10/10/2012	New Ceramic Floor Tiles installed on Lobby Entrance Interior and Exterior Floor.
10/10/2012	New Ceramic Floor Tiles installed in Lunch Room.
04/03/2013	New Carpet installed in EDUCATION SERVICES: 3 OFFICES, AND ADJACENT HALLWAY TO RESTROOMS AND BREAK ROOM.
02/13/2024	District Office relocated to 981 Ridder Park Drive, San Jose, CA as of this date.

MAIN OFFICE BUILDING

ADVANCED TRAINING CENTER, AND COMPUTER REPAIR SHOP

CARPET MASTIC 440 SF

09/13/2005	Mastic/Adhesive for Grey carpet. This Material is in good condition as of this date.
08/31/2010	Location Description changed from FILE ROOM, SUPPLY ROOM, AND COMPUTER REPAIR SHOP to ADVANCED TRAINING CENTER, AND COMPUTER REPAIR SHOP. No other changes as of this date.
01/30/2020	This Material is unchanged as of this date.
08/27/2020	This Material is unchanged as of this date.
02/09/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/17/2022	This Material is unchanged as of this date.
08/16/2022	This Material is unchanged as of this date.
02/14/2023	This Material is unchanged as of this date.
08/15/2023	This Material is unchanged as of this date.
02/13/2024	This Material is unchanged as of this date.
08/13/2024	This Material is unchanged as of this date.

SURVEY REPORT FOR

BUESD OLD DISTRICT OFFICE

BUILDING NAME	
LOCATION	
MATERIAL TYPE	QTY (APPROXIMATE)
COMMENTS	

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
02/26/2025	This Material is unchanged as of this date.		
09/16/2025	This Material is unchanged as of this date.		
05-212AAA	ASSUMED	NO SAMPLE	(NS)

MAIN OFFICE BUILDING

BOARD ROOM

SPRAY-ON CEILING TEXTURE 600 SF

09/13/2005	Spray-on Ceiling Texture. This Material is in GOOD condition as of this date.
01/30/2020	This Material is unchanged as of this date.
08/27/2020	This Material is unchanged as of this date.
02/09/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/17/2022	This Material is unchanged as of this date.
08/16/2022	This Material is unchanged as of this date.
02/14/2023	This Material is unchanged as of this date.
08/15/2023	This Material is unchanged as of this date.
02/13/2024	This Material is unchanged as of this date.
08/13/2024	This Material is unchanged as of this date.
02/26/2025	This Material is unchanged as of this date.
09/16/2025	This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
------------------	----------------	------------------	---------------

MAIN OFFICE BUILDING

BOARD ROOM

VINYL WALL COVER 1,500 SF

09/13/2005	Vinyl Wall Cover on Collapsible Accordion Walls (3 EA). This Material is in good condition as of this date.
01/30/2020	This Material is unchanged as of this date.

SURVEY REPORT FOR

BUESD OLD DISTRICT OFFICE

BUILDING NAME	
LOCATION	
MATERIAL TYPE	QTY (APPROXIMATE)
COMMENTS	

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
08/27/2020	This Material is unchanged as of this date.		
02/09/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/17/2022	This Material is unchanged as of this date.		
08/16/2022	This Material is unchanged as of this date.		
02/14/2023	This Material is unchanged as of this date.		
08/15/2023	This Material is unchanged as of this date.		
02/13/2024	This Material is unchanged as of this date.		
08/13/2024	This Material is unchanged as of this date.		
02/26/2025	This Material is unchanged as of this date.		
09/16/2025	This Material is unchanged as of this date.		

05-212AAA	ASSUMED	NO SAMPLE	(NS)
------------------	----------------	------------------	---------------

MAIN OFFICE BUILDING

BOARD ROOM

VINYL WALL COVER MASTIC

1,500 SF

05/13/2009	Mastic/Adhesive for Vinyl Wall Cover on Collapsible Accordion Walls (3 EA). This Material is in GOOD condition as of this date.		
01/30/2020	This Material is unchanged as of this date.		
08/27/2020	This Material is unchanged as of this date.		
02/09/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/17/2022	This Material is unchanged as of this date.		
08/16/2022	This Material is unchanged as of this date.		
02/14/2023	This Material is unchanged as of this date.		
08/15/2023	This Material is unchanged as of this date.		
02/13/2024	This Material is unchanged as of this date.		

SF= Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

BUESD OLD DISTRICT OFFICE

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

08/13/2024 This Material is unchanged as of this date.

02/26/2025 This Material is unchanged as of this date.

09/16/2025 This Material is unchanged as of this date.

09-098AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

MAIN OFFICE BUILDING

BOARD ROOM, CONFERENCE ROOM, SEVERAL OFFICES, ENTRY HALLWAYS, AND SUPERINTENDENT OFFICE

CEILING TILE

6,350 SF

09/13/2005 1'x 1' Rough Surface Glued-On Ceiling Tile. This Material is in GOOD condition as of this date.

08/29/2014 The Conference Room has 3 Ceiling Tiles Broken. <5% Physical Damage. No other changes as of this date.

09/12/2016 Additional Damage observed. 2 SF of Tiles missing by the Door to Board Room. No other changes as of this date.

03/28/2017 Additional Damage Observed. 1 Loose Tile Board Room Side Entry. 1 Tile Broken by Admin Desk in open Office Area. 2 Tiles Loose in Superintendent Office. No other changes as of this date.

02/13/2018 Additional Damage Observed. Board Room has 2 Tiles with Holes cut into them. No other changes as of this date.

08/07/2018 Additional Damage Observed. <10% Water Damage in the form of 10 SF of Water Stains in Lobby outside of Board Room. No other changes as of this date.

01/30/2020 This Material is unchanged as of this date.

08/27/2020 This Material is unchanged as of this date.

02/09/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/17/2022 This Material is unchanged as of this date.

08/16/2022 This Material is unchanged as of this date.

02/14/2023 This Material is unchanged as of this date.

08/15/2023 This Material is unchanged as of this date.

02/13/2024 This Material is unchanged as of this date.

SURVEY REPORT FOR

BUESD OLD DISTRICT OFFICE

BUILDING NAME	
LOCATION	
MATERIAL TYPE	QTY (APPROXIMATE)
COMMENTS	

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

08/13/2024 This Material is unchanged as of this date.

02/26/2025 This Material is unchanged as of this date.

09/16/2025 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
------------------	----------------	------------------	---------------

MAIN OFFICE BUILDING

BOARD ROOM, CONFERENCE ROOM, SEVERAL OFFICES, ENTRY HALLWAYS, AND SUPERINTENDENT OFFICE

CEILING TILE MASTIC 6,350 SF

09/13/2005 Mastic/Adhesive for 1'x 1' Rough Surface Glued-On Ceiling Tile. This Material is in GOOD condition as of this date.

08/29/2014 The Conference Room has 3 Ceiling Tiles Broken. <5% Physical Damage. No other changes as of this date.

09/12/2016 Additional Damage observed. 2 SF of Tiles missing by the Door to Board Room. No other changes as of this date.

03/28/2017 Additional Damage Observed. 1 Loose Tile Board Room Side Entry. 1 Tile Broken by Admin Desk in open Office Area. 2 Tiles Loose in Superintendent Office. No other changes as of this date.

02/03/2018 Additional Damage Observed. Board Room has 2 Tiles with Holes cut into them. No other changes as of this date.

08/07/2018 Additional Damage Observed. <10% Water Damage in the form of 10 SF of Water Stains in Lobby outside of Board Room. No other changes as of this date.

01/30/2020 This Material is unchanged as of this date.

08/27/2020 This Material is unchanged as of this date.

02/09/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/17/2022 This Material is unchanged as of this date.

08/16/2022 This Material is unchanged as of this date.

02/14/2023 This Material is unchanged as of this date.

08/15/2023 This Material is unchanged as of this date.

02/13/2024 This Material is unchanged as of this date.

SURVEY REPORT FOR

BUESD OLD DISTRICT OFFICE

BUILDING NAME	
LOCATION	
MATERIAL TYPE	QTY (APPROXIMATE)
COMMENTS	

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
08/13/2024	This Material is unchanged as of this date.		
02/26/2025	This Material is unchanged as of this date.		
09/16/2025	This Material is unchanged as of this date.		

05-212AAA	ASSUMED	NO SAMPLE	(NS)
------------------	----------------	------------------	---------------

MAIN OFFICE BUILDING

CHILD NUTRITION SERVICES OFFICE

CEMENTITIOUS WALL PANEL 32 SF

10/10/2012	Cementitious Chalkboard. (1 EA). This Material is in GOOD condition as of this date.
01/30/2020	This Material is unchanged as of this date.
08/27/2020	This Material is unchanged as of this date.
02/09/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/17/2022	This Material is unchanged as of this date.
08/16/2022	This Material is unchanged as of this date.
02/14/2023	This Material is unchanged as of this date.
08/15/2023	This Material is unchanged as of this date.
02/13/2024	This Material is unchanged as of this date.
08/13/2024	This Material is unchanged as of this date.
02/26/2025	This Material is unchanged as of this date.
09/16/2025	This Material is unchanged as of this date.

12-185AAA	ASSUMED	NO SAMPLE	(NS)
------------------	----------------	------------------	---------------

MAIN OFFICE BUILDING

ELECTRICAL ROOM

DUCT WRAP TAPE 2 SF

09/13/2005	Duct Wrap Tape. This Material is in good condition as of this date.
------------	---

SURVEY REPORT FOR

BUESD OLD DISTRICT OFFICE

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
01/30/2020	This Material is unchanged as of this date.		
08/27/2020	This Material is unchanged as of this date.		
02/09/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/17/2022	This Material is unchanged as of this date.		
08/16/2022	This Material is unchanged as of this date.		
02/14/2023	This Material is unchanged as of this date.		
08/15/2023	This Material is unchanged as of this date.		
02/13/2024	This Material is unchanged as of this date.		
08/13/2024	This Material is unchanged as of this date.		
02/26/2025	This Material is unchanged as of this date.		
09/16/2025	This Material is unchanged as of this date.		
05-212AAA	ASSUMED	NO SAMPLE	(NS)

MAIN OFFICE BUILDING

ENTIRE OFFICE SPACE, AND HALLWAYS

BASEBOARD MASTIC

2,160 LF

09/13/2005	Mastic/Adhesive for 4" and 6" Brown Baseboard. This Material is in good condition as of this date.		
01/30/2020	This Material is unchanged as of this date.		
08/27/2020	This Material is unchanged as of this date.		
02/09/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/17/2022	This Material is unchanged as of this date.		
08/16/2022	This Material is unchanged as of this date.		
02/14/2023	This Material is unchanged as of this date.		
08/15/2023	This Material is unchanged as of this date.		

SURVEY REPORT FOR

BUESD OLD DISTRICT OFFICE

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/13/2024 This Material is unchanged as of this date.

08/13/2024 This Material is unchanged as of this date.

02/26/2025 This Material is unchanged as of this date.

09/16/2025 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

MAIN OFFICE BUILDING

EXTERIOR WALL OF BOARDROOM IN ENTRY HALLWAY, AND 1 WALL OF BOARDROOM

WOOD WALL PANEL MASTIC

1,900 SF

03/10/2010 Mastic/Adhesive for Wood Wall Panel. This Material is in GOOD condition as of this date.

01/30/2020 This Material is unchanged as of this date.

08/27/2020 This Material is unchanged as of this date.

02/09/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/17/2022 This Material is unchanged as of this date.

08/16/2022 This Material is unchanged as of this date.

02/14/2023 This Material is unchanged as of this date.

08/15/2023 This Material is unchanged as of this date.

02/13/2024 This Material is unchanged as of this date.

08/13/2024 This Material is unchanged as of this date.

02/26/2025 This Material is unchanged as of this date.

09/16/2025 This Material is unchanged as of this date.

10-052AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

SURVEY REPORT FOR

BUESD OLD DISTRICT OFFICE

BUILDING NAME	
LOCATION	
MATERIAL TYPE	QTY (APPROXIMATE)
COMMENTS	

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

MAIN OFFICE BUILDING

EXTERIOR WALLS AND OVERHANGS

ROUGH WALL 17,500 SF

09/13/2005	Stucco Walls and Overhangs. This Material is in good condition as of this date.
01/30/2020	This Material is unchanged as of this date.
08/27/2020	Damage Observed. <5% Physical Damage - in the form of 3 LF of Cracks on South-East corner of Wall. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.
02/09/2021	Additional Damage Observed. <5% Physical Damage in th form of 2 LF Crack on West Wall. Material remains in FAIR condition overall. No other changes as of this date.
08/09/2021	This Material is unchanged as of this date.
02/17/2022	This Material is unchanged as of this date.
08/16/2022	This Material is unchanged as of this date.
02/14/2023	This Material is unchanged as of this date.
08/15/2023	This Material is unchanged as of this date.
02/13/2024	This Material is unchanged as of this date.
08/13/2024	This Material is unchanged as of this date.
02/26/2025	This Material is unchanged as of this date.
09/16/2025	This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
------------------	----------------	------------------	---------------

MAIN OFFICE BUILDING

EXTERIOR WALLS AND OVERHANGS

ROUGH WALL SURFACING 17,500 SF

09/13/2005	Skim Coat for Stucco Walls and Overhangs. This Material is in good condition as of this date.
01/30/2020	This Material is unchanged as of this date.
08/27/2020	Damage Observed. <5% Physical Damage - in the form of 3 LF of Cracks on South-East corner of Wall. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.

SURVEY REPORT FOR

BUESD OLD DISTRICT OFFICE

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
02/09/2021	Additional Damage Observed. <5% Physical Damage in th form of 2 LF Crack on West Wall. Material remains in FAIR condition overall. No other changes as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/17/2022	This Material is unchanged as of this date.		
08/16/2022	This Material is unchanged as of this date.		
02/14/2023	This Material is unchanged as of this date.		
08/15/2023	This Material is unchanged as of this date.		
02/13/2024	This Material is unchanged as of this date.		
08/13/2024	This Material is unchanged as of this date.		
02/26/2025	This Material is unchanged as of this date.		
09/16/2025	This Material is unchanged as of this date.		
05-212AAA	ASSUMED	NO SAMPLE	(NS)

MAIN OFFICE BUILDING

HALLWAYS, BOARD ROOMS, STORAGE ROOMS, CLOSETS, CUSTODIAN ROOM, FILE ROOM, DARK ROOM, AND OFFICES

SMOOTH WALL MISCELLANEOUS

26,605 SF

09/13/2005	Gypsum Wallboard System Walls and Ceilings. This Material is in good condition as of this date.
05/13/2009	Damage: <5% Physical Damage in Main Warehouse and Electrical Panel Room due to cuts, holes, and scratches on textured surfaces. Material condition changed from GOOD to FAIR overall as of this date. No other changes as of this date.
03/28/2017	Additional Damage Observed. 3 LF Crack in Hallway by Open Area. Workroom has 12 LF of Peeling Skim Coat. No other changes as of this date.
02/13/2018	Damage Observed. <5% Physical Damage - in the form of a 3 inch Diameter Hole in the Wall by Admin Desk near Entry to Lobby. No other changes as of this date.
01/30/2020	This Material is unchanged as of this date.
08/27/2020	This Material is unchanged as of this date.
02/09/2021	Additional Damage Observed. <5% Physical Damage in th form of 2 SF of Water Stains in File Room. Material remains in FAIR condition overall. No other changes as of this date.
08/09/2021	This Material is unchanged as of this date.

SURVEY REPORT FOR

BUESD OLD DISTRICT OFFICE

BUILDING NAME	
LOCATION	
MATERIAL TYPE	
COMMENTS	QTY (APPROXIMATE)

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
02/17/2022	This Material is unchanged as of this date.		
08/16/2022	This Material is unchanged as of this date.		
02/14/2023	This Material is unchanged as of this date.		
08/15/2023	This Material is unchanged as of this date.		
02/13/2024	This Material is unchanged as of this date.		
08/13/2024	This Material is unchanged as of this date.		
02/26/2025	This Material is unchanged as of this date.		
09/16/2025	This Material is unchanged as of this date.		
05-212AAA	ASSUMED	NO SAMPLE	(NS)

MAIN OFFICE BUILDING

HALLWAYS, STORAGE ROOMS, CLOSETS, CUSTODIAN ROOM, FILE ROOM, AND DARK ROOM

SMOOTH WALL SURFACING 6,800 SF

04/18/2006	Skim Coat for Gypsum Wallboard System Walls and Ceilings. This Material is in GOOD condition as of this date.
05/13/2009	Damage: <5% Physical Damage in Main Warehouse and Electrical Panel Room due to cuts, holes, and scratches on textured surfaces. Material condition changed from GOOD to FAIR overall as of this date. No other changes as of this date.
08/31/2010	Location Description changed from OFFICES, HALLWAYS, BOARD ROOMS, STORAGE ROOMS, CLOSETS, CUSTODIAN ROOM, FILE ROOM, AND DARK ROOM to HALLWAYS, STORAGE ROOMS, CLOSETS, CUSTODIAN ROOM, FILE ROOM, AND DARK ROOM. Quantity changed from 26,605 SF to 6,800 SF. No other changes as of this date.
03/28/2017	Additional Damage Observed. 3 LF Crack in Hallway by Open Area. Workroom has 12 LF of Peeling Skim Coat. No other changes as of this date.
02/13/2018	Damage Observed. <5% Physical Damage - in the form of a 3 inch Diameter Hole in the Wall by Admin Desk near Entry to Lobby. No other changes as of this date.
01/30/2020	This Material is unchanged as of this date.
08/27/2020	This Material is unchanged as of this date.
02/09/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.

SURVEY REPORT FOR

BUESD OLD DISTRICT OFFICE

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
02/17/2022	This Material is unchanged as of this date.		
08/16/2022	This Material is unchanged as of this date.		
02/14/2023	This Material is unchanged as of this date.		
08/15/2023	This Material is unchanged as of this date.		
02/13/2024	This Material is unchanged as of this date.		
08/13/2024	This Material is unchanged as of this date.		
02/26/2025	This Material is unchanged as of this date.		
09/16/2025	This Material is unchanged as of this date.		
05-212AAA	ASSUMED	NO SAMPLE	(NS)

MAIN OFFICE BUILDING

MAIN SERVER ROOM

BASEBOARD MASTIC

64 LF

10/17/2008	Mastic/Adhesive for 6" Beige Baseboard. This Material is in GOOD condition as of this date.
01/30/2020	This Material is unchanged as of this date.
08/27/2020	This Material is unchanged as of this date.
02/09/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/17/2022	This Material is unchanged as of this date.
08/16/2022	This Material is unchanged as of this date.
02/14/2023	This Material is unchanged as of this date.
08/15/2023	This Material is unchanged as of this date.
02/13/2024	This Material is unchanged as of this date.
08/13/2024	This Material is unchanged as of this date.
02/26/2025	This Material is unchanged as of this date.
09/16/2025	This Material is unchanged as of this date.

SURVEY REPORT FOR

BUESD OLD DISTRICT OFFICE

BUILDING NAME	
LOCATION	
MATERIAL TYPE	QTY (APPROXIMATE)
COMMENTS	

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
08-241 AAA	ASSUMED	NO SAMPLE	(NS)

MAIN OFFICE BUILDING

MAIN SERVER ROOM

VINYL FLOOR TILE 240 SF

10/17/2008 12"x12" Off White Vinyl Floor Tile. This Material is in GOOD condition as of this date.

01/30/2020 This Material is unchanged as of this date.

08/27/2020 This Material is unchanged as of this date.

02/09/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/17/2022 This Material is unchanged as of this date.

08/16/2022 This Material is unchanged as of this date.

02/14/2023 This Material is unchanged as of this date.

08/15/2023 This Material is unchanged as of this date.

02/13/2024 This Material is unchanged as of this date.

08/13/2024 This Material is unchanged as of this date.

02/26/2025 This Material is unchanged as of this date.

09/16/2025 This Material is unchanged as of this date.

08-241AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

MAIN OFFICE BUILDING

MAIN SERVER ROOM

VINYL FLOOR TILE MASTIC 240 SF

10/17/2008 Mastic/Adhesive for 12"x12" Off-White Vinyl Floor Tile. This Material is in GOOD condition as of this date.
(Original Entry updated on 11/30/11.)

01/30/2020 This Material is unchanged as of this date.

08/27/2020 This Material is unchanged as of this date.

02/09/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

SURVEY REPORT FOR

BUESD OLD DISTRICT OFFICE

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
02/17/2022	This Material is unchanged as of this date.		
08/16/2022	This Material is unchanged as of this date.		
02/14/2023	This Material is unchanged as of this date.		
08/15/2023	This Material is unchanged as of this date.		
02/13/2024	This Material is unchanged as of this date.		
08/13/2024	This Material is unchanged as of this date.		
02/26/2025	This Material is unchanged as of this date.		
09/16/2025	This Material is unchanged as of this date.		
08-241AAA	ASSUMED	NO SAMPLE	(NS)

MAIN OFFICE BUILDING

MICRO FILM ROOM, SAFE ROOM, DARK ROOM, CUSTODIAN ROOM, STORAGE ROOM OF BOARD ROOM, AND STORAGE ROOM (LOCATED BETWEEN CUSTODIAN ROOM AND COMPUTER LAB)

VINYL FLOOR TILE

600 SF

09/13/2005	12"x 12" Brown Vinyl Floor Tile. This Material is in GOOD condition as of this date.		
04/17/2008	<10% Water Damage. 10 SF Damaged under the Sink in the Custodial Room. Material in in FAIR condition overall as of this date. No other changes as of this date.		
03/10/2010	Quantity changed from 430 SF to 500 SF. No other changes as of this date.		
10/10/2012	Quantity changed from 500 SF to 600 SF. No other changes as of this date.		
01/30/2020	This Material is unchanged as of this date.		
08/27/2020	This Material is unchanged as of this date.		
02/09/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/17/2022	This Material is unchanged as of this date.		
08/16/2022	This Material is unchanged as of this date.		
02/14/2023	This Material is unchanged as of this date.		
08/15/2023	This Material is unchanged as of this date.		

SURVEY REPORT FOR

BUESD OLD DISTRICT OFFICE

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/13/2024 This Material is unchanged as of this date.

08/13/2024 This Material is unchanged as of this date.

02/26/2025 This Material is unchanged as of this date.

09/16/2025 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

MAIN OFFICE BUILDING

MICRO FILM ROOM, SAFE ROOM, DARK ROOM, CUSTODIAN ROOM, STORAGE ROOM OF BOARD ROOM, AND STORAGE ROOM (LOCATED BETWEEN CUSTODIAN ROOM AND COMPUTER LAB)

VINYL FLOOR TILE MASTIC

600 SF

09/13/2005 Mastic/adhesive for 12"x 12" Brown Vinyl Floor Tile. This Material is in GOOD condition as of this date.

04/17/2008 <10% Water Damage. 10 SF Damaged under the Sink in the Custodial Room. Material in in FAIR condition overall as of this date. No other changes as of this date.

03/10/2010 Quantity changed from 430 SF to 500 SF. No other changes as of this date.

10/10/2012 Quantity changed from 500 SF to 600 SF. No other changes as of this date.

01/30/2020 This Material is unchanged as of this date.

08/27/2020 This Material is unchanged as of this date.

02/09/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/17/2022 This Material is unchanged as of this date.

08/16/2022 This Material is unchanged as of this date.

02/14/2023 This Material is unchanged as of this date.

08/15/2023 This Material is unchanged as of this date.

02/13/2024 This Material is unchanged as of this date.

08/13/2024 This Material is unchanged as of this date.

02/26/2025 This Material is unchanged as of this date.

09/16/2025 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

BUESD OLD DISTRICT OFFICE

BUILDING NAME	
LOCATION	
MATERIAL TYPE	QTY (APPROXIMATE)
COMMENTS	

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
05-242AAA	ASSUMED	NO SAMPLE	(NS)

MAIN OFFICE BUILDING

OFFICES

SMOOTH WALL MISCELLANEOUS

6,800 SF

08/31/2010	Gypsum Wallboard System Walls, (with Vinyl Wall Cover in some areas). This Material is in GOOD condition as of this date.
02/13/2018	Damage Observed. <5% Physical Damage - in the form of a 3 inch Diameter Hole in the Wall by Admin Desk near Entry to Lobby. Material condition changed from GOOD to FAIR overall. Friability changed from Low to Moderate. No other changes as of this date.
08/07/2018	Additional Damage Observed. 2" Chipped Corner in Wall by Admin Desk near Entry to Lobby. No other changes as of this date.
01/30/2020	This Material is unchanged as of this date.
08/27/2020	This Material is unchanged as of this date.
02/09/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/17/2022	This Material is unchanged as of this date.
08/16/2022	This Material is unchanged as of this date.
02/14/2023	This Material is unchanged as of this date.
08/15/2023	This Material is unchanged as of this date.
02/13/2024	This Material is unchanged as of this date.
08/13/2024	This Material is unchanged as of this date.
02/26/2025	This Material is unchanged as of this date.
09/16/2025	This Material is unchanged as of this date.

10-174AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

MAIN OFFICE BUILDING

OFFICES

VINYL WALL COVER MASTIC

6,800 SF

08/31/2010	Mastic/Adhesive for Vinyl Wall Cover, (over Gypsum Wallboard System). This Material is in GOOD condition as of this date.
------------	---

SURVEY REPORT FOR

BUESD OLD DISTRICT OFFICE

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
01/30/2020	Damage Observed. <5% Physical Damage - in the form of 6SF of Viny Wall Peeling in Human Resource Office. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date		
08/27/2020	This Material is unchanged as of this date.		
02/09/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/17/2022	This Material is unchanged as of this date.		
08/16/2022	This Material is unchanged as of this date.		
02/14/2023	This Material is unchanged as of this date.		
08/15/2023	This Material is unchanged as of this date.		
02/13/2024	This Material is unchanged as of this date.		
08/13/2024	This Material is unchanged as of this date.		
02/26/2025	This Material is unchanged as of this date.		
09/16/2025	This Material is unchanged as of this date.		
10-174AAA	ASSUMED	NO SAMPLE	(NS)

MAIN OFFICE BUILDING

OFFICES, CURRICULUM ROOM, MICRO FILM ROOM, PRODUCTION ROOM, FILE ROOMS, SUPPLY ROOM, COMPUTER ROOM, MAIN WORK ROOM, AND WAREHOUSE

SUSPENDED CEILING TILE

10,960 SF

09/13/2005	2'x4' Rough Surface Suspended Ceiling Tile . This Material is in GOOD condition as of this date.		
08/29/2014	The Printing Room has 4 Suspended Ceiling Tiles with Water Stains. <10% Water Damage. No other changes as of this date.		
03/16/2015	Additional Damage observed. 1 Tile in front of Personnel Service Front Desk has Physical and Water Damage. Tiles replaced in the Warehouse are 2'x4' White with Nail and Pin Hole pattern. No other changes as of this date.		
09/12/2016	Additional Damage observed. 1 Tile is missing in the Instructional Material Center. No other changes as of this date.		
03/28/2017	Additional Damage Observed. 4 Tiles have Water Damage, Several others are showing discoloration from Air Flow. No other changes as of this date.		

SURVEY REPORT FOR

BUESD OLD DISTRICT OFFICE

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
08/28/2017	Additional Damage Observed. 6 Tiles now with Water Damage in the Printing Room. No other changes as of this date.		
01/30/2020	This Material is unchanged as of this date.		
08/27/2020	This Material is unchanged as of this date.		
02/09/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/17/2022	This Material is unchanged as of this date.		
08/16/2022	This Material is unchanged as of this date.		
02/14/2023	This Material is unchanged as of this date.		
08/15/2023	This Material is unchanged as of this date.		
02/13/2024	This Material is unchanged as of this date.		
08/13/2024	This Material is unchanged as of this date.		
02/26/2025	This Material is unchanged as of this date.		
09/16/2025	This Material is unchanged as of this date.		

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

MAIN OFFICE BUILDING

OFFICES, HALLWAY, LOUNGE, AND RESTROOMS (4)

VINYL WALL COVER MASTIC

10,000 SF

08/31/2010	Mastic/Adhesive for Vinyl Wall Cover, (over Gypsum Wallboard System). This Material is in GOOD condition as of this date.		
01/30/2020	This Material is unchanged as of this date.		
08/27/2020	This Material is unchanged as of this date.		
02/09/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/17/2022	This Material is unchanged as of this date.		
08/16/2022	This Material is unchanged as of this date.		

SURVEY REPORT FOR

BUESD OLD DISTRICT OFFICE

BUILDING NAME	
LOCATION	
MATERIAL TYPE	QTY (APPROXIMATE)
COMMENTS	

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
02/14/2023	This Material is unchanged as of this date.		
08/15/2023	This Material is unchanged as of this date.		
02/13/2024	Additional Damage Observed. 1 LF of Peeling Vinyl Wall Cover in Men's Restroom in Lobby Area on Wall with Urinals. No other changes as of this date.		
08/13/2024	This Material is unchanged as of this date.		
02/26/2025	This Material is unchanged as of this date.		
09/16/2025	This Material is unchanged as of this date.		

10-174AAA	ASSUMED	NO SAMPLE	(NS)
------------------	----------------	------------------	---------------

MAIN OFFICE BUILDING

OFFICES, HALLWAYS, AND BOARD ROOMS

CARPET MASTIC 16,410 SF

09/13/2005	Mastic/Adhesive for Light Grey Carpet. This Material is in GOOD condition as of this date.		
04/03/2013	Approximately 850 SF has been Removed in 3 Offices in Education Services, and Hallway Area to Restrooms & Break Room. Quantity changed from 17,260 SF to 16,410 SF. No other changes as of this date.		
01/30/2020	This Material is unchanged as of this date.		
08/27/2020	This Material is unchanged as of this date.		
02/09/2021	Damage Observed. <5% Physical Damage in the form of 2 SF of Loose Carpet in Superintendent Office Area. Material condition changed from GOOD to FAIR overall. Friability updated from Non-Friable to Friable. No other changes as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/17/2022	This Material is unchanged as of this date.		
08/16/2022	This Material is unchanged as of this date.		
02/14/2023	This Material is unchanged as of this date.		
08/15/2023	This Material is unchanged as of this date.		
02/13/2024	This Material is unchanged as of this date.		
08/13/2024	This Material is unchanged as of this date.		
02/26/2025	This Material is unchanged as of this date.		

SURVEY REPORT FOR

BUESD OLD DISTRICT OFFICE

BUILDING NAME	
LOCATION	
MATERIAL TYPE	QTY (APPROXIMATE)
COMMENTS	

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

09/16/2025 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

MAIN OFFICE BUILDING

RESTROOM (1)

HEAT SHIELD 1 SF

09/13/2005 Light Fixture Heat Shields. This Material is in good condition as of this date.

01/30/2020 This Material is unchanged as of this date.

08/27/2020 This Material is unchanged as of this date.

02/09/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/17/2022 This Material is unchanged as of this date.

08/16/2022 This Material is unchanged as of this date.

02/14/2023 This Material is unchanged as of this date.

08/15/2023 This Material is unchanged as of this date.

02/13/2024 This Material is unchanged as of this date.

08/13/2024 This Material is unchanged as of this date.

02/26/2025 This Material is unchanged as of this date.

09/16/2025 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

MAIN OFFICE BUILDING

RESTROOMS (4)

SMOOTH CEILING MISCELLANEOUS 1,100 SF

09/13/2005 Gypsum Wallboard System Walls and Ceilings. This Material is in GOOD condition as of this date.

04/17/2008 <10% Water Damage. 10 SF is Water Damaged under the Sinks in each of the Staff Restrooms, (Mens and Womens), next to the Lounge Room. Material condition changed from GOOD to FAIR overall. No other changes as of this date.

SURVEY REPORT FOR

BUESD OLD DISTRICT OFFICE

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
08/31/2010	Quantity changed from 2,200 SF to 800 SF. Additional Damage observed in the form of approx. 4 SF of Water Damage due to Water leak at Mens Restroom in Personnel Department. No other changes as of this date.		
11/30/2011	Quantity changed from 800 SF to 1,100 SF. Personnel Department is now called Education Services. No other changes as of this date.		
01/30/2020	This Material is unchanged as of this date.		
08/27/2020	This Material is unchanged as of this date.		
02/09/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/17/2022	This Material is unchanged as of this date.		
08/16/2022	This Material is unchanged as of this date.		
02/14/2023	This Material is unchanged as of this date.		
08/15/2023	This Material is unchanged as of this date.		
02/13/2024	This Material is unchanged as of this date.		
08/13/2024	This Material is unchanged as of this date.		
02/26/2025	This Material is unchanged as of this date.		
09/16/2025	This Material is unchanged as of this date.		

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

MAIN OFFICE BUILDING

RESTROOMS (4)

SMOOTH CEILING SURFACING

1,100 SF

09/13/2005	Skim Coat for Gypsum Wallboard System Walls and Ceilings. This Material is in GOOD condition as of this date.		
04/17/2008	<10% Water Damage. 10 SF is Water Damaged under the Sinks in each of the Staff Restrooms, (Mens and Womens), next to the Lounge Room. Material condition changed from GOOD to FAIR overall. No other changes as of this date.		
08/31/2010	Quantity changed from 2,200 SF to 800 SF. Additional Damage observed in the form of approx. 4 SF of Water Damage due to Water leak at Mens Restroom in Personnel Department. No other changes as of this date.		

SURVEY REPORT FOR

BUESD OLD DISTRICT OFFICE

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
11/30/2011	Quantity changed from 800 SF to 1,100 SF. Personnel Department is now called Education Services. No other changes as of this date.		
01/30/2020	This Material is unchanged as of this date.		
08/27/2020	This Material is unchanged as of this date.		
02/09/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/17/2022	This Material is unchanged as of this date.		
08/16/2022	This Material is unchanged as of this date.		
02/14/2023	This Material is unchanged as of this date.		
08/15/2023	This Material is unchanged as of this date.		
02/13/2024	This Material is unchanged as of this date.		
08/13/2024	This Material is unchanged as of this date.		
02/26/2025	This Material is unchanged as of this date.		
09/16/2025	This Material is unchanged as of this date.		

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

MAIN OFFICE BUILDING

RESTROOMS STAFF (4) AND PUBLIC

TERRAZZO FLOOR

560 SF

04/17/2008	Terrazzo Floor. This Material is in GOOD condition in both Men's Restrooms. Damage: <5% Physical Damage - in the form of cracks in both Women's Restrooms. Friability changed from Non-Friable to Friable. This Material is in FAIR condition overall as of this date.		
01/30/2020	This Material is unchanged as of this date.		
08/27/2020	Additional Damage Observed. 2 LF of Cracks in Men's Restroom near Staff Lunchroom. No other changes as of this date.		
02/09/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/17/2022	This Material is unchanged as of this date.		

SURVEY REPORT FOR

BUESD OLD DISTRICT OFFICE

BUILDING NAME	
LOCATION	
MATERIAL TYPE	
COMMENTS	QTY (APPROXIMATE)

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
08/16/2022	This Material is unchanged as of this date.		
02/14/2023	This Material is unchanged as of this date.		
08/15/2023	This Material is unchanged as of this date.		
02/13/2024	Additional Damage Observed. 4 LF of Cracks in Women's Restroom next to Lunch Room. No other changes as of this date.		
08/13/2024	This Material is unchanged as of this date.		
02/26/2025	This Material is unchanged as of this date.		
09/16/2025	This Material is unchanged as of this date.		

08-075AAA	ASSUMED	NO SAMPLE	(NS)
------------------	----------------	------------------	---------------

MAIN OFFICE BUILDING

SAFE ROOM AND MICRO FILM ROOM

SMOOTH WALL SURFACING

560 SF

09/13/2005	Skim Coat / Texture on Concrete. This Material is in good condition as of this date.		
01/30/2020	This Material is unchanged as of this date.		
08/27/2020	This Material is unchanged as of this date.		
02/09/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/17/2022	This Material is unchanged as of this date.		
08/16/2022	This Material is unchanged as of this date.		
02/14/2023	This Material is unchanged as of this date.		
08/15/2023	This Material is unchanged as of this date.		
02/13/2024	This Material is unchanged as of this date.		
08/13/2024	This Material is unchanged as of this date.		
02/26/2025	This Material is unchanged as of this date.		
09/16/2025	This Material is unchanged as of this date.		

05-212AAA	ASSUMED	NO SAMPLE	(NS)
------------------	----------------	------------------	---------------

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

BUESD OLD DISTRICT OFFICE

BUILDING NAME	
LOCATION	
MATERIAL TYPE	QTY (APPROXIMATE)
COMMENTS	

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

MAIN OFFICE BUILDING

STORAGE ROOMS, UTILITY ROOM, AND CUSTODIAL CLOSET

BASEBOARD MASTIC

485 LF

09/13/2005	Brown Mastic/Adhesive for 4" Dark Brown Baseboard. This Material is in GOOD condition as of this date.
04/03/2013	Damage: <5% Physical Damage - in the form of approximately 20 LF of material is exposed in Equipment Closet, due to missing Baseboard. Material condition changed from GOOD to FAIR overall as of this date. Friability changed from Non to Friable. No other changes as of this date.
01/30/2020	This Material is unchanged as of this date.
08/27/2020	This Material is unchanged as of this date.
02/09/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/17/2022	This Material is unchanged as of this date.
08/16/2022	This Material is unchanged as of this date.
02/14/2023	This Material is unchanged as of this date.
08/15/2023	This Material is unchanged as of this date.
02/13/2024	This Material is unchanged as of this date.
08/13/2024	This Material is unchanged as of this date.
02/26/2025	This Material is unchanged as of this date.
09/16/2025	This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

SURVEY REPORT FOR

BUESD OLD DISTRICT OFFICE

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

METAL STORAGE CONTAINER

METAL STORAGE CONTAINER

08/31/2010 BUILDING NOTES:

08/31/2010 Metal Storage Container. (1 EA Container).

08/28/2017 Metal Storage Containers. 2 EA. 1 8x40 320 SF. 1 8x12 96 SF.

METAL STORAGE CONTAINER

METAL STORAGE CONTAINER (1 EA)

STORAGE CONTAINER

256 SF

03/21/2016 Metal Storage Containers, 2 EA. (Metal Storage Container 1 EA)

08/28/2017 Material Re-assessed. 2 Storage Containers. Quantity changed from 256 SF to 416 SF. No other changes as of this date.

01/30/2020 This Material is unchanged as of this date.

08/27/2020 This Material is unchanged as of this date.

02/09/2021 This Material is unchanged as of this date.

02/17/2022 This Material is unchanged as of this date.

08/16/2022 This Material is unchanged as of this date.

02/14/2023 This Material is unchanged as of this date.

08/15/2023 This Material is unchanged as of this date.

02/13/2024 This Material is unchanged as of this date.

08/13/2024 This Material is unchanged as of this date.

02/26/2025 This Material is unchanged as of this date.

09/16/2025 This Material is unchanged as of this date.

16-074.NS NEW NO SAMPLE (NS)

End Of Report, Total Of 26 Pages

HOMOGENEOUS MATERIALS IN BUESD OLD DISTRICT OFFICE

BUILDING NAME	MATERIAL CATEGORY	LOCATION	MATERIAL TYPE
---------------	-------------------	----------	---------------

AAA SITE NOTE AAA

MAIN OFFICE BUILDING

MISCELLANEOUS MATERIAL

ADVANCED TRAINING CENTER, AND COMPUTER REPAIR SHOP	CARPET MASTIC
BOARD ROOM	VINYL WALL COVER
BOARD ROOM	VINYL WALL COVER MASTIC
BOARD ROOM, CONFERENCE ROOM, SEVERAL OFFICES, ENTRY HALLWAYS, AND SUPERINTENDENT OFFICE	CEILING TILE
BOARD ROOM, CONFERENCE ROOM, SEVERAL OFFICES, ENTRY HALLWAYS, AND SUPERINTENDENT OFFICE	CEILING TILE MASTIC
CHILD NUTRITION SERVICES OFFICE	CEMENTITIOUS WALL PANEL
ENTIRE OFFICE SPACE, AND HALLWAYS	BASEBOARD MASTIC
EXTERIOR WALL OF BOARDROOM IN ENTRY HALLWAY, AND 1 WALL OF BOARDROOM	WOOD WALL PANEL MASTIC
HALLWAYS, BOARD ROOMS, STORAGE ROOMS, CLOSETS, CUSTODIAN ROOM, FILE ROOM, DARK ROOM, AND OFFICES	SMOOTH WALL
MAIN SERVER ROOM	MISCELLANEOUS
MAIN SERVER ROOM	BASEBOARD MASTIC
MAIN SERVER ROOM	VINYL FLOOR TILE
MICRO FILM ROOM, SAFE ROOM, DARK ROOM, CUSTODIAN ROOM, STORAGE ROOM OF BOARD ROOM, AND STORAGE ROOM (LOCATED BETWEEN CUSTODIAN ROOM AND COMPUTER LAB)	VINYL FLOOR TILE MASTIC
MICRO FILM ROOM, SAFE ROOM, DARK ROOM, CUSTODIAN ROOM, STORAGE ROOM OF BOARD ROOM, AND STORAGE ROOM (LOCATED BETWEEN CUSTODIAN ROOM AND COMPUTER LAB)	VINYL FLOOR TILE
OFFICES	VINYL FLOOR TILE MASTIC
OFFICES	SMOOTH WALL
OFFICES, CURRICULUM ROOM, MICRO FILM ROOM, PRODUCTION ROOM, FILE ROOMS, SUPPLY ROOM, COMPUTER ROOM, MAIN WORK ROOM, AND WAREHOUSE	MISCELLANEOUS
OFFICES, HALLWAY, LOUNGE, AND RESTROOMS (4)	VINYL WALL COVER MASTIC
OFFICES, HALLWAYS, AND BOARD ROOMS	SUSPENDED CEILING TILE
RESTROOM (1)	
RESTROOMS (4)	VINYL WALL COVER MASTIC
	CARPET MASTIC
	HEAT SHIELD
	SMOOTH CEILING
	MISCELLANEOUS
RESTROOMS STAFF (4) AND PUBLIC	TERRAZZO FLOOR
STORAGE ROOMS, UTILITY ROOM, AND CUSTODIAL CLOSET	BASEBOARD MASTIC

SURFACING MATERIAL

BOARD ROOM	SPRAY-ON CEILING TEXTURE
EXTERIOR WALLS AND OVERHANGS	ROUGH WALL
EXTERIOR WALLS AND OVERHANGS	ROUGH WALL SURFACING
HALLWAYS, STORAGE ROOMS, CLOSETS, CUSTODIAN ROOM, FILE ROOM, AND DARK ROOM	SMOOTH WALL SURFACING
RESTROOMS (4)	
SAFE ROOM AND MICRO FILM ROOM	SMOOTH CEILING SURFACING
	SMOOTH WALL SURFACING

HOMOGENEOUS MATERIALS IN
BUESD OLD DISTRICT OFFICE

BUILDING NAME

MATERIAL CATEGORY

LOCATION

MATERIAL TYPE

THERMAL SYSTEM INSULATION

ELECTRICAL ROOM

DUCT WRAP TAPE

METAL STORAGE CONTAINER

MISCELLANEOUS MATERIAL

METAL STORAGE CONTAINER (1 EA)

STORAGE CONTAINER

End Of Report, Total Of 2 Pages

FRIABLE LOCATIONS IN BUESD OLD DISTRICT OFFICE

BUILDING NAME	LOCATION	QTY (APPROXIMATE)	ASBESTOS CONTENT
MATERIAL TYPE			
MAIN OFFICE BUILDING			
BOARD ROOM	SPRAY-ON CEILING TEXTURE	600 SF	Assumed
BOARD ROOM, CONFERENCE ROOM, SEVERAL OFFICES, ENTRY HALLWAYS, AND SUPERINTENDENT OFFICE	CEILING TILE	6,350 SF	Assumed
BOARD ROOM, CONFERENCE ROOM, SEVERAL OFFICES, ENTRY HALLWAYS, AND SUPERINTENDENT OFFICE	CEILING TILE MASTIC	6,350 SF	Assumed
ELECTRICAL ROOM	DUCT WRAP TAPE	2 SF	Assumed
EXTERIOR WALLS AND OVERHANGS	ROUGH WALL	17,500 SF	Assumed
EXTERIOR WALLS AND OVERHANGS	ROUGH WALL SURFACING	17,500 SF	Assumed
HALLWAYS, BOARD ROOMS, STORAGE ROOMS, CLOSETS, CUSTODIAN ROOM, FILE ROOM, DARK ROOM, AND OFFICES	SMOOTH WALL MISCELLANEOUS	26,605 SF	Assumed
HALLWAYS, STORAGE ROOMS, CLOSETS, CUSTODIAN ROOM, FILE ROOM, AND DARK ROOM	SMOOTH WALL SURFACING	6,800 SF	Assumed
MICRO FILM ROOM, SAFE ROOM, DARK ROOM, CUSTODIAN ROOM, STORAGE ROOM OF BOARD ROOM, AND STORAGE ROOM (LOCATED BETWEEN CUSTODIAN ROOM AND COMPUTER LAB)	VINYL FLOOR TILE	600 SF	Assumed
MICRO FILM ROOM, SAFE ROOM, DARK ROOM, CUSTODIAN ROOM, STORAGE ROOM OF BOARD ROOM, AND STORAGE ROOM (LOCATED BETWEEN CUSTODIAN ROOM AND COMPUTER LAB)	VINYL FLOOR TILE MASTIC	600 SF	Assumed
OFFICES	SMOOTH WALL MISCELLANEOUS	6,800 SF	Assumed
OFFICES	VINYL WALL COVER MASTIC	6,800 SF	Assumed
OFFICES, CURRICULUM ROOM, MICRO FILM ROOM, PRODUCTION ROOM, FILE ROOMS, SUPPLY ROOM, COMPUTER ROOM, MAIN WORK ROOM, AND WAREHOUSE	SUSPENDED CEILING TILE	10,960 SF	Assumed
OFFICES, HALLWAY, LOUNGE, AND RESTROOMS (4)	VINYL WALL COVER MASTIC	10,000 SF	Assumed
OFFICES, HALLWAYS, AND BOARD ROOMS	CARPET MASTIC	16,410 SF	Assumed
RESTROOM (1)	HEAT SHIELD	1 SF	Assumed

S= Sq. Ft, L=Inches, L=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

FRIABLE LOCATIONS IN BUESD OLD DISTRICT OFFICE

BUILDING NAME			
LOCATION		QTY	ASBESTOS
MATERIAL TYPE		(APPROXIMATE)	CONTENT
RESTROOMS (4)			
SMOOTH CEILING MISCELLANEOUS		1,100 SF	Assumed
RESTROOMS (4)			
SMOOTH CEILING SURFACING		1,100 SF	Assumed
RESTROOMS STAFF (4) AND PUBLIC			
TERRAZZO FLOOR		560 SF	Assumed
SAFE ROOM AND MICRO FILM ROOM			
SMOOTH WALL SURFACING		560 SF	Assumed
STORAGE ROOMS, UTILITY ROOM, AND CUSTODIAL CLOSET			
BASEBOARD MASTIC		485 LF	Assumed
End Of Report, Total Of 2 Pages			

Non- Friable Locations In BUESD OLD DISTRICT OFFICE

BUILDING NAME			
LOCATION		QTY	ASBESTOS
MATERIAL TYPE		(APPROXIMATE)	CONTENT
MAIN OFFICE BUILDING			
ADVANCED TRAINING CENTER, AND COMPUTER REPAIR SHOP			
CARPET MASTIC		440 SF	Assumed
BOARD ROOM			
VINYL WALL COVER		1,500 SF	Assumed
BOARD ROOM			
VINYL WALL COVER MASTIC		1,500 SF	Assumed
CHILD NUTRITION SERVICES OFFICE			
CEMENTITIOUS WALL PANEL		32 SF	Assumed
ENTIRE OFFICE SPACE, AND HALLWAYS			
BASEBOARD MASTIC		2,160 LF	Assumed
EXTERIOR WALL OF BOARDROOM IN ENTRY HALLWAY, AND 1 WALL OF BOARDROOM			
WOOD WALL PANEL MASTIC		1,900 SF	Assumed
MAIN SERVER ROOM			
BASEBOARD MASTIC		64 LF	Assumed
MAIN SERVER ROOM			
VINYL FLOOR TILE		240 SF	Assumed
MAIN SERVER ROOM			
VINYL FLOOR TILE MASTIC		240 SF	Assumed
End Of Report, Total Of 1 Pages			

RECOMMENDATIONS FOR
BUESD OLD DISTRICT OFFICE

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

AAA SITE NOTE AAA

MAIN OFFICE BUILDING

ADVANCED TRAINING CENTER, AND COMPUTER REPAIR SHOP

CARPET MASTIC

440 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

BOARD ROOM

SPRAY-ON CEILING TEXTURE

600 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

BOARD ROOM

VINYL WALL COVER

1,500 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR

BUESD OLD DISTRICT OFFICE

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

BOARD ROOM

VINYL WALL COVER MASTIC

1,500 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

BOARD ROOM, CONFERENCE ROOM, SEVERAL OFFICES, ENTRY HALLWAYS, AND SUPERINTENDENT OFFICE

CEILING TILE

6,350 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

BOARD ROOM, CONFERENCE ROOM, SEVERAL OFFICES, ENTRY HALLWAYS, AND SUPERINTENDENT OFFICE

CEILING TILE MASTIC

6,350 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CHILD NUTRITION SERVICES OFFICE

CEMENTITIOUS WALL PANEL

32 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR
BUESD OLD DISTRICT OFFICE

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

ELECTRICAL ROOM

DUCT WRAP TAPE

2 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

ENTIRE OFFICE SPACE, AND HALLWAYS

BASEBOARD MASTIC

2,160 LF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

EXTERIOR WALL OF BOARDROOM IN ENTRY HALLWAY, AND 1 WALL OF BOARDROOM

WOOD WALL PANEL MASTIC

1,900 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

EXTERIOR WALLS AND OVERHANGS

ROUGH WALL

17,500 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR

BUESD OLD DISTRICT OFFICE

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

EXTERIOR WALLS AND OVERHANGS

ROUGH WALL SURFACING

17,500 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

HALLWAYS, BOARD ROOMS, STORAGE ROOMS, CLOSETS, CUSTODIAN ROOM, FILE ROOM, DARK ROOM, AND OFFICES

SMOOTH WALL MISCELLANEOUS

26,605 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

HALLWAYS, STORAGE ROOMS, CLOSETS, CUSTODIAN ROOM, FILE ROOM, AND DARK ROOM

SMOOTH WALL SURFACING

6,800 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

MAIN SERVER ROOM

BASEBOARD MASTIC

64 LF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR
BUESD OLD DISTRICT OFFICE

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

MAIN SERVER ROOM

VINYL FLOOR TILE

240 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

MAIN SERVER ROOM

VINYL FLOOR TILE MASTIC

240 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

MICRO FILM ROOM, SAFE ROOM, DARK ROOM, CUSTODIAN ROOM, STORAGE ROOM OF BOARD ROOM, AND STORAGE ROOM (LOCATED BETWEEN CUSTODIAN ROOM AND COMPUTER LAB)

VINYL FLOOR TILE

600 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

MICRO FILM ROOM, SAFE ROOM, DARK ROOM, CUSTODIAN ROOM, STORAGE ROOM OF BOARD ROOM, AND STORAGE ROOM (LOCATED BETWEEN CUSTODIAN ROOM AND COMPUTER LAB)

VINYL FLOOR TILE MASTIC

600 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR

BUESD OLD DISTRICT OFFICE

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

OFFICES

SMOOTH WALL MISCELLANEOUS 6,800 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

OFFICES

VINYL WALL COVER MASTIC 6,800 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

OFFICES, CURRICULUM ROOM, MICRO FILM ROOM, PRODUCTION ROOM, FILE ROOMS, SUPPLY ROOM, COMPUTER ROOM, MAIN WORK ROOM, AND WAREHOUSE

SUSPENDED CEILING TILE 10,960 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

OFFICES, HALLWAY, LOUNGE, AND RESTROOMS (4)

VINYL WALL COVER MASTIC 10,000 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR

BUESD OLD DISTRICT OFFICE

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

OFFICES, HALLWAYS, AND BOARD ROOMS

CARPET MASTIC

16,410 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RESTROOM (1)

HEAT SHIELD

1 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RESTROOMS (4)

SMOOTH CEILING MISCELLANEOUS

1,100 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RESTROOMS (4)

SMOOTH CEILING SURFACING

1,100 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR
BUESD OLD DISTRICT OFFICE

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

RESTROOMS STAFF (4) AND PUBLIC

TERRAZZO FLOOR

560 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

SAFE ROOM AND MICRO FILM ROOM

SMOOTH WALL SURFACING

560 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

STORAGE ROOMS, UTILITY ROOM, AND CUSTODIAL CLOSET

BASEBOARD MASTIC

485 LF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR
BUESD OLD DISTRICT OFFICE

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

METAL STORAGE CONTAINER

METAL STORAGE CONTAINER (1 EA)

STORAGE CONTAINER

256 SF

- (a) This is a replacement/new material.
 - (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
 - (c) This documentation is to be maintained with the District's AHERA records.
-

End Of Report, Total Of 9 Pages

SAMPLES REPORT FOR

BUESD OLD DISTRICT OFFICE

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

MAIN OFFICE BUILDING

MAIN OFFICE BUILDING

ADVANCED TRAINING CENTER, AND COMPUTER REPAIR SHOP

CARPET MASTIC

<u>05-212AAA</u>	9/13/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

MAIN OFFICE BUILDING

BOARD ROOM

SPRAY-ON CEILING TEXTURE

<u>05-212AAA</u>	9/13/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

MAIN OFFICE BUILDING

BOARD ROOM

VINYL WALL COVER

<u>05-212AAA</u>	9/13/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

MAIN OFFICE BUILDING

BOARD ROOM

VINYL WALL COVER MASTIC

<u>09-098AAA</u>	5/13/2009	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

MAIN OFFICE BUILDING

BOARD ROOM, CONFERENCE ROOM, SEVERAL OFFICES, ENTRY HALLWAYS, AND SUPERINTENDENT OFFICE

CEILING TILE

<u>05-212AAA</u>	9/13/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

MAIN OFFICE BUILDING

BOARD ROOM, CONFERENCE ROOM, SEVERAL OFFICES, ENTRY HALLWAYS, AND SUPERINTENDENT OFFICE

CEILING TILE MASTIC

<u>05-212AAA</u>	9/13/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

MAIN OFFICE BUILDING

CHILD NUTRITION SERVICES OFFICE

CEMENTITIOUS WALL PANEL

<u>12-185AAA</u>	10/10/2012	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	------------	----------	---------	-----------	----

SAMPLES REPORT FOR

BUESD OLD DISTRICT OFFICE

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE No. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

MAIN OFFICE BUILDING

ELECTRICAL ROOM

DUCT WRAP TAPE

<u>05-212AAA</u>	9/13/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

MAIN OFFICE BUILDING

ENTIRE OFFICE SPACE, AND HALLWAYS

BASEBOARD MASTIC

<u>05-212AAA</u>	9/13/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

MAIN OFFICE BUILDING

EXTERIOR WALL OF BOARDROOM IN ENTRY HALLWAY, AND 1 WALL OF BOARDROOM

WOOD WALL PANEL MASTIC

<u>10-052AAA</u>	3/10/2010	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

MAIN OFFICE BUILDING

EXTERIOR WALLS AND OVERHANGS

ROUGH WALL

<u>05-212AAA</u>	9/13/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

MAIN OFFICE BUILDING

EXTERIOR WALLS AND OVERHANGS

ROUGH WALL SURFACING

<u>05-212AAA</u>	9/13/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

MAIN OFFICE BUILDING

HALLWAYS, BOARD ROOMS, STORAGE ROOMS, CLOSETS, CUSTODIAN ROOM, FILE ROOM, DARK ROOM, AND OFFICES

SMOOTH WALL MISCELLANEOUS

<u>05-212AAA</u>	9/13/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

MAIN OFFICE BUILDING

HALLWAYS, STORAGE ROOMS, CLOSETS, CUSTODIAN ROOM, FILE ROOM, AND DARK ROOM

SMOOTH WALL SURFACING

<u>05-212AAA</u>	4/18/2006	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

SAMPLES REPORT FOR

BUESD OLD DISTRICT OFFICE

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE No. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

MAIN OFFICE BUILDING

MAIN SERVER ROOM

BASEBOARD MASTIC

<u>08-241 AAA</u>	10/17/2008	Positive	ASSUMED	NO SAMPLE	NS
--------------------------	------------	----------	---------	-----------	----

MAIN OFFICE BUILDING

MAIN SERVER ROOM

VINYL FLOOR TILE

<u>08-241AAA</u>	10/17/2008	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	------------	----------	---------	-----------	----

MAIN OFFICE BUILDING

MAIN SERVER ROOM

VINYL FLOOR TILE MASTIC

<u>08-241AAA</u>	10/17/2008	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	------------	----------	---------	-----------	----

MAIN OFFICE BUILDING

MICRO FILM ROOM, SAFE ROOM, DARK ROOM, CUSTODIAN ROOM, STORAGE ROOM OF BOARD ROOM, AND STORAGE ROOM (LOCATED BETWEEN CUSTODIAN ROOM AND COMPUTER LAB)

VINYL FLOOR TILE

<u>05-212AAA</u>	9/13/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

MAIN OFFICE BUILDING

MICRO FILM ROOM, SAFE ROOM, DARK ROOM, CUSTODIAN ROOM, STORAGE ROOM OF BOARD ROOM, AND STORAGE ROOM (LOCATED BETWEEN CUSTODIAN ROOM AND COMPUTER LAB)

VINYL FLOOR TILE MASTIC

<u>05-212AAA</u>	9/13/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

MAIN OFFICE BUILDING

OFFICES

SMOOTH WALL MISCELLANEOUS

<u>10-174AAA</u>	8/31/2010	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

MAIN OFFICE BUILDING

OFFICES

VINYL WALL COVER MASTIC

<u>10-174AAA</u>	8/31/2010	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

SAMPLES REPORT FOR

BUESD OLD DISTRICT OFFICE

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

MAIN OFFICE BUILDING

OFFICES, CURRICULUM ROOM, MICRO FILM ROOM, PRODUCTION ROOM, FILE ROOMS, SUPPLY ROOM, COMPUTER ROOM, MAIN WORK ROOM, AND WAREHOUSE
 SUSPENDED CEILING TILE

<u>05-212AAA</u>	9/13/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

MAIN OFFICE BUILDING

OFFICES, HALLWAY, LOUNGE, AND RESTROOMS (4)
 VINYL WALL COVER MASTIC

<u>10-174AAA</u>	8/31/2010	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

MAIN OFFICE BUILDING

OFFICES, HALLWAYS, AND BOARD ROOMS
 CARPET MASTIC

<u>05-212AAA</u>	9/13/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

MAIN OFFICE BUILDING

RESTROOM (1)
 HEAT SHIELD

<u>05-212AAA</u>	9/13/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

MAIN OFFICE BUILDING

RESTROOMS (4)
 SMOOTH CEILING MISCELLANEOUS

<u>05-212AAA</u>	9/13/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

MAIN OFFICE BUILDING

RESTROOMS (4)
 SMOOTH CEILING SURFACING

<u>05-212AAA</u>	9/13/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

MAIN OFFICE BUILDING

RESTROOMS STAFF (4) AND PUBLIC
 TERRAZZO FLOOR

<u>08-075AAA</u>	4/17/2008	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

SAMPLES REPORT FOR
BUESD OLD DISTRICT OFFICE

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE No.	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
COMMENTS					

MAIN OFFICE BUILDING

SAFE ROOM AND MICRO FILM ROOM

SMOOTH WALL SURFACING

<u>05-212AAA</u>	9/13/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

MAIN OFFICE BUILDING

STORAGE ROOMS, UTILITY ROOM, AND CUSTODIAL CLOSET

BASEBOARD MASTIC

<u>05-212AAA</u>	9/13/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

SAMPLES REPORT FOR
BUESD OLD DISTRICT OFFICE

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE NO.	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
COMMENTS					

METAL STORAGE CONTAINER

METAL STORAGE CONTAINER

METAL STORAGE CONTAINER (1 EA)

STORAGE CONTAINER

16-074.NS

3/21/2016

Negative

NEW MATERIAL

NO SAMPLE

NS

Metal Storage Structure.

End Of Report, Total Of 6 Pages

DAMAGE REPORT FOR

BUESD OLD DISTRICT OFFICE

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

MAIN OFFICE BUILDING

MAIN OFFICE BUILDING

BOARD ROOM, CONFERENCE ROOM, SEVERAL OFFICES, ENTRY HALLWAYS, AND SUPERINTENDENT OFFICE

CEILING TILE	6,350 SF	P: Less Than 5% W: <10% Stains or Flaking
--------------	----------	--

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/13/2005	1'x 1' Rough Surface Glued-On Ceiling Tile. This Material is in GOOD condition as of this date.
08/29/2014	The Conference Room has 3 Ceiling Tiles Broken. <5% Physical Damage. No other changes as of this date.
09/12/2016	Additional Damage observed. 2 SF of Tiles missing by the Door to Board Room. No other changes as of this date.
03/28/2017	Additional Damage Observed. 1 Loose Tile Board Room Side Entry. 1 Tile Broken by Admin Desk in open Office Area. 2 Tiles Loose in Superintendent Office. No other changes as of this date.
02/13/2018	Additional Damage Observed. Board Room has 2 Tiles with Holes cut into them. No other changes as of this date.
08/07/2018	Additional Damage Observed. <10% Water Damage in the form of 10 SF of Water Stains in Lobby outside of Board Room. No other changes as of this date.
01/30/2020	This Material is unchanged as of this date.
08/27/2020	This Material is unchanged as of this date.
02/09/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/17/2022	This Material is unchanged as of this date.
08/16/2022	This Material is unchanged as of this date.
02/14/2023	This Material is unchanged as of this date.
08/15/2023	This Material is unchanged as of this date.
02/13/2024	This Material is unchanged as of this date.
08/13/2024	This Material is unchanged as of this date.
02/26/2025	This Material is unchanged as of this date.
09/16/2025	This Material is unchanged as of this date.

DAMAGE REPORT FOR

BUESD OLD DISTRICT OFFICE

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

MAIN OFFICE BUILDING

BOARD ROOM, CONFERENCE ROOM, SEVERAL OFFICES, ENTRY HALLWAYS, AND SUPERINTENDENT OFFICE

CEILING TILE MASTIC

6,350 SF

P: Less Than 5%

W: <10% Stains or Flaking

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/13/2005	Mastic/Adhesive for 1'x 1' Rough Surface Glued-On Ceiling Tile. This Material is in GOOD condition as of this date.
08/29/2014	The Conference Room has 3 Ceiling Tiles Broken. <5% Physical Damage. No other changes as of this date.
09/12/2016	Additional Damage observed. 2 SF of Tiles missing by the Door to Board Room. No other changes as of this date.
03/28/2017	Additional Damage Observed. 1 Loose Tile Board Room Side Entry. 1 Tile Broken by Admin Desk in open Office Area. 2 Tiles Loose in Superintendent Office. No other changes as of this date.
02/03/2018	Additional Damage Observed. Board Room has 2 Tiles with Holes cut into them. No other changes as of this date.
08/07/2018	Additional Damage Observed. <10% Water Damage in the form of 10 SF of Water Stains in Lobby outside of Board Room. No other changes as of this date.
01/30/2020	This Material is unchanged as of this date.
08/27/2020	This Material is unchanged as of this date.
02/09/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/17/2022	This Material is unchanged as of this date.
08/16/2022	This Material is unchanged as of this date.
02/14/2023	This Material is unchanged as of this date.
08/15/2023	This Material is unchanged as of this date.
02/13/2024	This Material is unchanged as of this date.
08/13/2024	This Material is unchanged as of this date.
02/26/2025	This Material is unchanged as of this date.
09/16/2025	This Material is unchanged as of this date.

DAMAGE REPORT FOR

BUESD OLD DISTRICT OFFICE

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

MAIN OFFICE BUILDING

EXTERIOR WALLS AND OVERHANGS

ROUGH WALL	17,500 SF	P: Less Than 5% W: No Evidence
------------	-----------	-----------------------------------

DAMAGED FRIABLE SURFACING ACM

09/13/2005	Stucco Walls and Overhangs. This Material is in good condition as of this date.
01/30/2020	This Material is unchanged as of this date.
08/27/2020	Damage Observed. <5% Physical Damage - in the form of 3 LF of Cracks on South-East corner of Wall. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.
02/09/2021	Additional Damage Observed. <5% Physical Damage in th form of 2 LF Crack on West Wall. Material remains in FAIR condition overall. No other changes as of this date.
08/09/2021	This Material is unchanged as of this date.
02/17/2022	This Material is unchanged as of this date.
08/16/2022	This Material is unchanged as of this date.
02/14/2023	This Material is unchanged as of this date.
08/15/2023	This Material is unchanged as of this date.
02/13/2024	This Material is unchanged as of this date.
08/13/2024	This Material is unchanged as of this date.
02/26/2025	This Material is unchanged as of this date.
09/16/2025	This Material is unchanged as of this date.

MAIN OFFICE BUILDING

EXTERIOR WALLS AND OVERHANGS

ROUGH WALL SURFACING	17,500 SF	P: Less Than 5% W: No Evidence
----------------------	-----------	-----------------------------------

DAMAGED FRIABLE SURFACING ACM

09/13/2005	Skim Coat for Stucco Walls and Overhangs. This Material is in good condition as of this date.
01/30/2020	This Material is unchanged as of this date.
08/27/2020	Damage Observed. <5% Physical Damage - in the form of 3 LF of Cracks on South-East corner of Wall. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.
02/09/2021	Additional Damage Observed. <5% Physical Damage in th form of 2 LF Crack on West Wall. Material remains in FAIR condition overall. No other changes as of this date.

DAMAGE REPORT FOR

BUESD OLD DISTRICT OFFICE

BUILDING NAME

LOCATION

MATERIAL TYPE

RISK ASSESMENT CATEGORY

COMMENTS

QTY
(APPROXIMATE)

PHYSICAL DAMAGE (P:)
WATER DAMAGE (W:)

08/09/2021 This Material is unchanged as of this date.
02/17/2022 This Material is unchanged as of this date.
08/16/2022 This Material is unchanged as of this date.
02/14/2023 This Material is unchanged as of this date.
08/15/2023 This Material is unchanged as of this date.
02/13/2024 This Material is unchanged as of this date.
08/13/2024 This Material is unchanged as of this date.
02/26/2025 This Material is unchanged as of this date.
09/16/2025 This Material is unchanged as of this date.

MAIN OFFICE BUILDING

HALLWAYS, BOARD ROOMS, STORAGE ROOMS, CLOSETS, CUSTODIAN ROOM, FILE ROOM, DARK ROOM, AND OFFICES

SMOOTH WALL MISCELLANEOUS

26,605 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/13/2005 Gypsum Wallboard System Walls and Ceilings. This Material is in good condition as of this date.
05/13/2009 Damage: <5% Physical Damage in Main Warehouse and Electrical Panel Room due to cuts, holes, and scratches on textured surfaces. Material condition changed from GOOD to FAIR overall as of this date. No other changes as of this date.
03/28/2017 Additional Damage Observed. 3 LF Crack in Hallway by Open Area. Workroom has 12 LF of Peeling Skim Coat. No other changes as of this date.
02/13/2018 Damage Observed. <5% Physical Damage - in the form of a 3 inch Diameter Hole in the Wall by Admin Desk near Entry to Lobby. No other changes as of this date.
01/30/2020 This Material is unchanged as of this date.
08/27/2020 This Material is unchanged as of this date.
02/09/2021 Additional Damage Observed. <5% Physical Damage in th form of 2 SF of Water Stains in File Room. Material remains in FAIR condition overall. No other changes as of this date.
08/09/2021 This Material is unchanged as of this date.
02/17/2022 This Material is unchanged as of this date.
08/16/2022 This Material is unchanged as of this date.
02/14/2023 This Material is unchanged as of this date.
08/15/2023 This Material is unchanged as of this date.
02/13/2024 This Material is unchanged as of this date.

DAMAGE REPORT FOR

BUESD OLD DISTRICT OFFICE

BUILDING NAME

LOCATION

MATERIAL TYPE

RISK ASSESSMENT CATEGORY

COMMENTS

QTY
(APPROXIMATE)

PHYSICAL DAMAGE (P:)
WATER DAMAGE (W:)

08/13/2024 This Material is unchanged as of this date.
02/26/2025 This Material is unchanged as of this date.
09/16/2025 This Material is unchanged as of this date.

MAIN OFFICE BUILDING

HALLWAYS, STORAGE ROOMS, CLOSETS, CUSTODIAN ROOM, FILE ROOM, AND DARK ROOM

SMOOTH WALL SURFACING

6,800 SF

P: Less Than 5%

W: No Evidence

DAMAGED FRIABLE SURFACING ACM

04/18/2006 Skim Coat for Gypsum Wallboard System Walls and Ceilings. This Material is in GOOD condition as of this date.
05/13/2009 Damage: <5% Physical Damage in Main Warehouse and Electrical Panel Room due to cuts, holes, and scratches on textured surfaces. Material condition changed from GOOD to FAIR overall as of this date. No other changes as of this date.
08/31/2010 Location Description changed from OFFICES, HALLWAYS, BOARD ROOMS, STORAGE ROOMS, CLOSETS, CUSTODIAN ROOM, FILE ROOM, AND DARK ROOM to HALLWAYS, STORAGE ROOMS, CLOSETS, CUSTODIAN ROOM, FILE ROOM, AND DARK ROOM. Quantity changed from 26,605 SF to 6,800 SF. No other changes as of this date.
03/28/2017 Additional Damage Observed. 3 LF Crack in Hallway by Open Area. Workroom has 12 LF of Peeling Skim Coat. No other changes as of this date.
02/13/2018 Damage Observed. <5% Physical Damage - in the form of a 3 inch Diameter Hole in the Wall by Admin Desk near Entry to Lobby. No other changes as of this date.
01/30/2020 This Material is unchanged as of this date.
08/27/2020 This Material is unchanged as of this date.
02/09/2021 This Material is unchanged as of this date.
08/09/2021 This Material is unchanged as of this date.
02/17/2022 This Material is unchanged as of this date.
08/16/2022 This Material is unchanged as of this date.
02/14/2023 This Material is unchanged as of this date.
08/15/2023 This Material is unchanged as of this date.
02/13/2024 This Material is unchanged as of this date.
08/13/2024 This Material is unchanged as of this date.
02/26/2025 This Material is unchanged as of this date.
09/16/2025 This Material is unchanged as of this date.

DAMAGE REPORT FOR

BUESD OLD DISTRICT OFFICE

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

MAIN OFFICE BUILDING

MICRO FILM ROOM, SAFE ROOM, DARK ROOM, CUSTODIAN ROOM, STORAGE ROOM OF BOARD ROOM, AND STORAGE ROOM (LOCATED BETWEEN CUSTODIAN ROOM AND COMPUTER LAB)

VINYL FLOOR TILE

600 SF

P: Less Than 5%

W: <10% Stains or Flaking

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/13/2005	12"x 12" Brown Vinyl Floor Tile. This Material is in GOOD condition as of this date.
04/17/2008	<10% Water Damage. 10 SF Damaged under the Sink in the Custodial Room. Material in in FAIR condition overall as of this date. No other changes as of this date.
03/10/2010	Quantity changed from 430 SF to 500 SF. No other changes as of this date.
10/10/2012	Quantity changed from 500 SF to 600 SF. No other changes as of this date.
01/30/2020	This Material is unchanged as of this date.
08/27/2020	This Material is unchanged as of this date.
02/09/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/17/2022	This Material is unchanged as of this date.
08/16/2022	This Material is unchanged as of this date.
02/14/2023	This Material is unchanged as of this date.
08/15/2023	This Material is unchanged as of this date.
02/13/2024	This Material is unchanged as of this date.
08/13/2024	This Material is unchanged as of this date.
02/26/2025	This Material is unchanged as of this date.
09/16/2025	This Material is unchanged as of this date.

MAIN OFFICE BUILDING

MICRO FILM ROOM, SAFE ROOM, DARK ROOM, CUSTODIAN ROOM, STORAGE ROOM OF BOARD ROOM, AND STORAGE ROOM (LOCATED BETWEEN CUSTODIAN ROOM AND COMPUTER LAB)

VINYL FLOOR TILE MASTIC

600 SF

P: Less Than 5%

W: <10% Stains or Flaking

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/13/2005	Mastic/adhesive for 12"x 12" Brown Vinyl Floor Tile. This Material is in GOOD condition as of this date.
04/17/2008	<10% Water Damage. 10 SF Damaged under the Sink in the Custodial Room. Material in in FAIR condition overall as of this date. No other changes as of this date.
03/10/2010	Quantity changed from 430 SF to 500 SF. No other changes as of this date.

DAMAGE REPORT FOR

BUESD OLD DISTRICT OFFICE

BUILDING NAME

LOCATION

MATERIAL TYPE

RISK ASSESMENT CATEGORY

COMMENTS

QTY
(APPROXIMATE)

PHYSICAL DAMAGE (P:)
WATER DAMAGE (W:)

10/10/2012	Quantity changed from 500 SF to 600 SF. No other changes as of this date.
01/30/2020	This Material is unchanged as of this date.
08/27/2020	This Material is unchanged as of this date.
02/09/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/17/2022	This Material is unchanged as of this date.
08/16/2022	This Material is unchanged as of this date.
02/14/2023	This Material is unchanged as of this date.
08/15/2023	This Material is unchanged as of this date.
02/13/2024	This Material is unchanged as of this date.
08/13/2024	This Material is unchanged as of this date.
02/26/2025	This Material is unchanged as of this date.
09/16/2025	This Material is unchanged as of this date.

MAIN OFFICE BUILDING

OFFICES

SMOOTH WALL MISCELLANEOUS

6,800 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

08/31/2010	Gypsum Wallboard System Walls, (with Vinyl Wall Cover in some areas). This Material is in GOOD condition as of this date.
02/13/2018	Damage Observed. <5% Physical Damage - in the form of a 3 inch Diameter Hole in the Wall by Admin Desk near Entry to Lobby. Material condition changed from GOOD to FAIR overall. Friability changed from Low to Moderate. No other changes as of this date.
08/07/2018	Additional Damage Observed. 2" Chipped Corner in Wall by Admin Desk near Entry to Lobby. No other changes as of this date.
01/30/2020	This Material is unchanged as of this date.
08/27/2020	This Material is unchanged as of this date.
02/09/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/17/2022	This Material is unchanged as of this date.
08/16/2022	This Material is unchanged as of this date.
02/14/2023	This Material is unchanged as of this date.

DAMAGE REPORT FOR

BUESD OLD DISTRICT OFFICE

BUILDING NAME**LOCATION****MATERIAL TYPE****RISK ASSESSMENT CATEGORY****COMMENTS****QTY**
(APPROXIMATE)**PHYSICAL DAMAGE (P:)**
WATER DAMAGE (W:)

08/15/2023 This Material is unchanged as of this date.

02/13/2024 This Material is unchanged as of this date.

08/13/2024 This Material is unchanged as of this date.

02/26/2025 This Material is unchanged as of this date.

09/16/2025 This Material is unchanged as of this date.

MAIN OFFICE BUILDING**OFFICES**

VINYL WALL COVER MASTIC

6,800 SF

P: Less Than 5%**W:** No EvidenceDAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

08/31/2010 Mastic/Adhesive for Vinyl Wall Cover, (over Gypsum Wallboard System). This Material is in GOOD condition as of this date.

01/30/2020 Damage Observed. <5% Physical Damage - in the form of 6SF of Viny Wall Peeling in Human Resource Office. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date

08/27/2020 This Material is unchanged as of this date.

02/09/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/17/2022 This Material is unchanged as of this date.

08/16/2022 This Material is unchanged as of this date.

02/14/2023 This Material is unchanged as of this date.

08/15/2023 This Material is unchanged as of this date.

02/13/2024 This Material is unchanged as of this date.

08/13/2024 This Material is unchanged as of this date.

02/26/2025 This Material is unchanged as of this date.

09/16/2025 This Material is unchanged as of this date.

DAMAGE REPORT FOR

BUESD OLD DISTRICT OFFICE

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
COMMENTS					

MAIN OFFICE BUILDING

OFFICES, CURRICULUM ROOM, MICRO FILM ROOM, PRODUCTION ROOM, FILE ROOMS, SUPPLY ROOM, COMPUTER ROOM, MAIN WORK ROOM, AND WAREHOUSE

SUSPENDE CEILING TILE

10,960 SF

P: No Visible Damage

W: <10% Stains or Flaking

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/13/2005	2'x4' Rough Surface Suspended Ceiling Tile . This Material is in GOOD condition as of this date.
08/29/2014	The Printing Room has 4 Suspended Ceiling Tiles with Water Stains. <10% Water Damage. No other changes as of this date.
03/16/2015	Additional Damage observed. 1 Tile in front of Personnel Service Front Desk has Physical and Water Damage. Tiles replaced in the Warehouse are 2'x4' White with Nail and Pin Hole pattern. No other changes as of this date.
09/12/2016	Additional Damage observed. 1 Tile is missing in the Instructional Material Center. No other changes as of this date.
03/28/2017	Additional Damage Observed. 4 Tiles have Water Damage, Several others are showing discoloration from Air Flow. No other changes as of this date.
08/28/2017	Additional Damage Observed. 6 Tiles now with Water Damage in the Printing Room. No other changes as of this date.
01/30/2020	This Material is unchanged as of this date.
08/27/2020	This Material is unchanged as of this date.
02/09/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/17/2022	This Material is unchanged as of this date.
08/16/2022	This Material is unchanged as of this date.
02/14/2023	This Material is unchanged as of this date.
08/15/2023	This Material is unchanged as of this date.
02/13/2024	This Material is unchanged as of this date.
08/13/2024	This Material is unchanged as of this date.
02/26/2025	This Material is unchanged as of this date.
09/16/2025	This Material is unchanged as of this date.

DAMAGE REPORT FOR

BUESD OLD DISTRICT OFFICE

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

MAIN OFFICE BUILDING

OFFICES, HALLWAYS, AND BOARD ROOMS

CARPET MASTIC	16,410 SF	P: Less Than 5% W: No Evidence
---------------	-----------	-----------------------------------

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/13/2005	Mastic/Adhesive for Light Grey Carpet. This Material is in GOOD condition as of this date.
04/03/2013	Approximately 850 SF has been Removed in 3 Offices in Education Services, and Hallway Area to Restrooms & Break Room. Quantity changed from 17,260 SF to 16,410 SF. No other changes as of this date.
01/30/2020	This Material is unchanged as of this date.
08/27/2020	This Material is unchanged as of this date.
02/09/2021	Damage Observed. <5% Physical Damage in the form of 2 SF of Loose Carpet in Superintendent Office Area. Material condition changed from GOOD to FAIR overall. Friability updated from Non-Friable to Friable. No other changes as of this date.
08/09/2021	This Material is unchanged as of this date.
02/17/2022	This Material is unchanged as of this date.
08/16/2022	This Material is unchanged as of this date.
02/14/2023	This Material is unchanged as of this date.
08/15/2023	This Material is unchanged as of this date.
02/13/2024	This Material is unchanged as of this date.
08/13/2024	This Material is unchanged as of this date.
02/26/2025	This Material is unchanged as of this date.
09/16/2025	This Material is unchanged as of this date.

MAIN OFFICE BUILDING

RESTROOMS (4)

SMOOTH CEILING MISCELLANEOUS	1,100 SF	P: Less Than 5% W: <10% Stains or Flaking
------------------------------	----------	--

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/13/2005	Gypsum Wallboard System Walls and Ceilings. This Material is in GOOD condition as of this date.
04/17/2008	<10% Water Damage. 10 SF is Water Damaged under the Sinks in each of the Staff Restrooms, (Mens and Womens), next to the Lounge Room. Material condition changed from GOOD to FAIR overall. No other changes as of this date.

DAMAGE REPORT FOR

BUESD OLD DISTRICT OFFICE

BUILDING NAME**LOCATION****MATERIAL TYPE****RISK ASSESMENT CATEGORY****COMMENTS****QTY
(APPROXIMATE)****PHYSICAL DAMAGE (P:)
WATER DAMAGE (W:)**

08/31/2010	Quantity changed from 2,200 SF to 800 SF. Additional Damage observed in the form of approx. 4 SF of Water Damage due to Water leak at Mens Restroom in Personnel Department. No other changes as of this date.
11/30/2011	Quantity changed from 800 SF to 1,100 SF. Personnel Department is now called Education Services. No other changes as of this date.
01/30/2020	This Material is unchanged as of this date.
08/27/2020	This Material is unchanged as of this date.
02/09/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/17/2022	This Material is unchanged as of this date.
08/16/2022	This Material is unchanged as of this date.
02/14/2023	This Material is unchanged as of this date.
08/15/2023	This Material is unchanged as of this date.
02/13/2024	This Material is unchanged as of this date.
08/13/2024	This Material is unchanged as of this date.
02/26/2025	This Material is unchanged as of this date.
09/16/2025	This Material is unchanged as of this date.

MAIN OFFICE BUILDING**RESTROOMS (4)****SMOOTH CEILING SURFACING**

1,100 SF

P: Less Than 5%**W:** <10% Stains or Flaking**DAMAGED FRIABLE SURFACING ACM**

09/13/2005	Skim Coat for Gypsum Wallboard System Walls and Ceilings. This Material is in GOOD condition as of this date.
04/17/2008	<10% Water Damage. 10 SF is Water Damaged under the Sinks in each of the Staff Restrooms, (Mens and Womens), next to the Lounge Room. Material condition changed from GOOD to FAIR overall. No other changes as of this date.
08/31/2010	Quantity changed from 2,200 SF to 800 SF. Additional Damage observed in the form of approx. 4 SF of Water Damage due to Water leak at Mens Restroom in Personnel Department. No other changes as of this date.
11/30/2011	Quantity changed from 800 SF to 1,100 SF. Personnel Department is now called Education Services. No other changes as of this date.
01/30/2020	This Material is unchanged as of this date.
08/27/2020	This Material is unchanged as of this date.

DAMAGE REPORT FOR

BUESD OLD DISTRICT OFFICE

BUILDING NAME

LOCATION

MATERIAL TYPE

RISK ASSESMENT CATEGORY

COMMENTS

QTY
(APPROXIMATE)

PHYSICAL DAMAGE (P:)
WATER DAMAGE (W:)

02/09/2021 This Material is unchanged as of this date.
08/09/2021 This Material is unchanged as of this date.
02/17/2022 This Material is unchanged as of this date.
08/16/2022 This Material is unchanged as of this date.
02/14/2023 This Material is unchanged as of this date.
08/15/2023 This Material is unchanged as of this date.
02/13/2024 This Material is unchanged as of this date.
08/13/2024 This Material is unchanged as of this date.
02/26/2025 This Material is unchanged as of this date.
09/16/2025 This Material is unchanged as of this date.

MAIN OFFICE BUILDING

RESTROOMS STAFF (4) AND PUBLIC

TERRAZZO FLOOR

560 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

04/17/2008 Terrazzo Floor. This Material is in GOOD condition in both Men's Restrooms. Damage: <5% Physical Damage - in the form of cracks in both Women's Restrooms. Friability changed from Non-Friable to Friable. This Material is in FAIR condition overall as of this date.
01/30/2020 This Material is unchanged as of this date.
08/27/2020 Additional Damage Observed. 2 LF of Cracks in Men's Restroom near Staff Lunchroom. No other changes as of this date.
02/09/2021 This Material is unchanged as of this date.
08/09/2021 This Material is unchanged as of this date.
02/17/2022 This Material is unchanged as of this date.
08/16/2022 This Material is unchanged as of this date.
02/14/2023 This Material is unchanged as of this date.
08/15/2023 This Material is unchanged as of this date.
02/13/2024 Additional Damage Observed. 4 LF of Cracks in Women's Restroom next to Lunch Room. No other changes as of this date.
08/13/2024 This Material is unchanged as of this date.
02/26/2025 This Material is unchanged as of this date.
09/16/2025 This Material is unchanged as of this date.

DAMAGE REPORT FOR
BUESD OLD DISTRICT OFFICE

BUILDING NAME		QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
LOCATION	MATERIAL TYPE		
RISK ASSESMENT CATEGORY			
COMMENTS			

MAIN OFFICE BUILDING

STORAGE ROOMS, UTILITY ROOM, AND CUSTODIAL CLOSET

BASEBOARD MASTIC

485 LF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/13/2005	Brown Mastic/Adhesive for 4" Dark Brown Baseboard. This Material is in GOOD condition as of this date.
04/03/2013	Damage: <5% Physical Damage - in the form of approximately 20 LF of material is exposed in Equipment Closet, due to missing Baseboard. Material condition changed from GOOD to FAIR overall as of this date. Friability changed from Non to Friable. No other changes as of this date.
01/30/2020	This Material is unchanged as of this date.
08/27/2020	This Material is unchanged as of this date.
02/09/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/17/2022	This Material is unchanged as of this date.
08/16/2022	This Material is unchanged as of this date.
02/14/2023	This Material is unchanged as of this date.
08/15/2023	This Material is unchanged as of this date.
02/13/2024	This Material is unchanged as of this date.
08/13/2024	This Material is unchanged as of this date.
02/26/2025	This Material is unchanged as of this date.
09/16/2025	This Material is unchanged as of this date.



End Of Report, Total Of 13 Pages

BUESD DISTRICT OFFICES


PAGE 1 OF 2

INSPECTED ON:

9-16-25

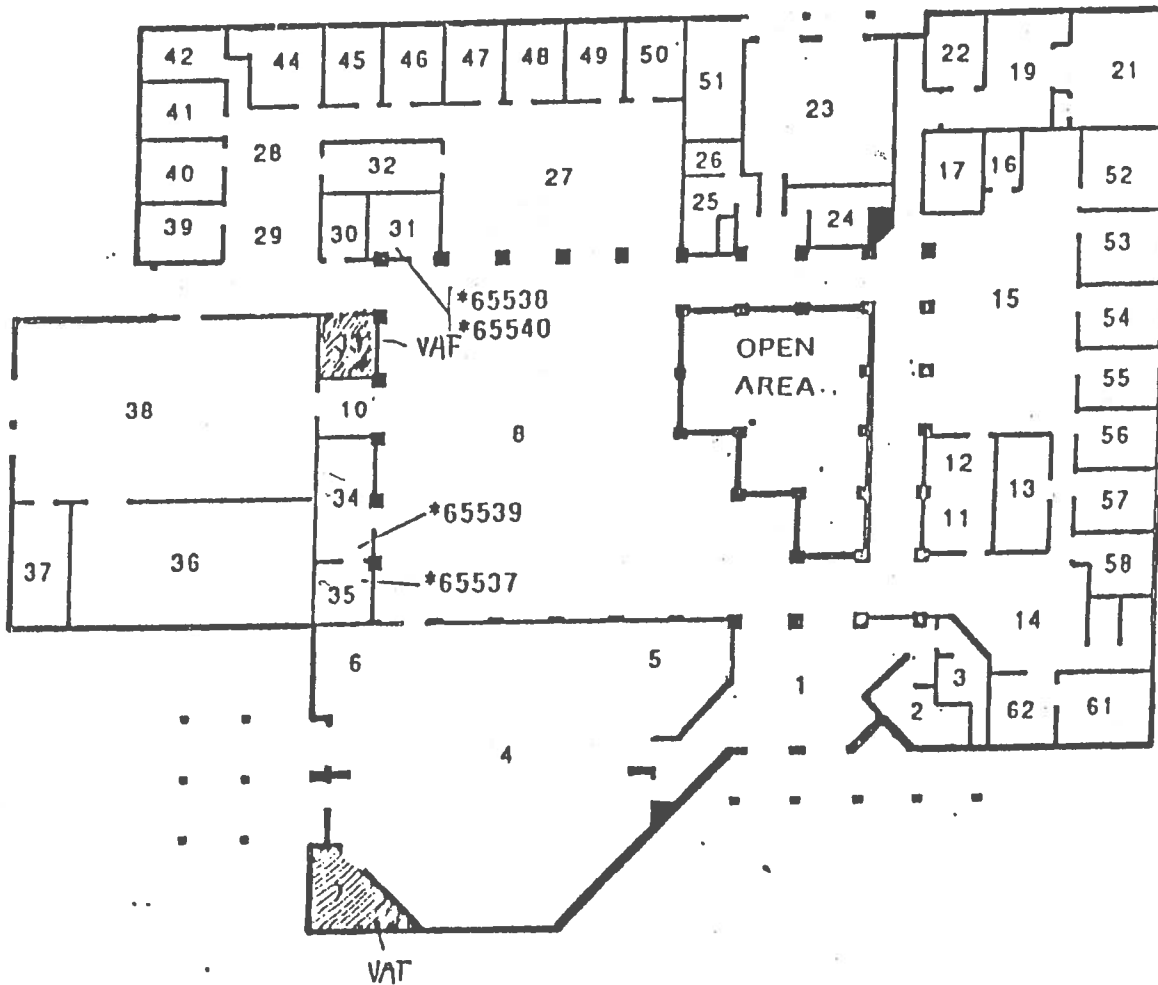

NORTH

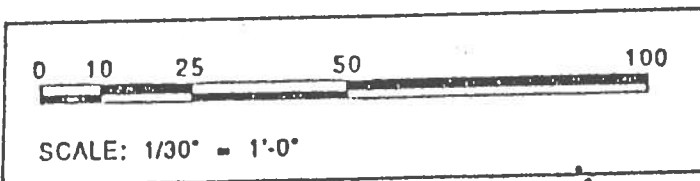


BUSD


BERRYESSA UNION SCHOOL DISTRICT

DISTRICT OFFICE
1376 Piedmont Road
San Jose, CA



FIGURE #1




Berryessa Union School District / District Office...Confidential Documents...

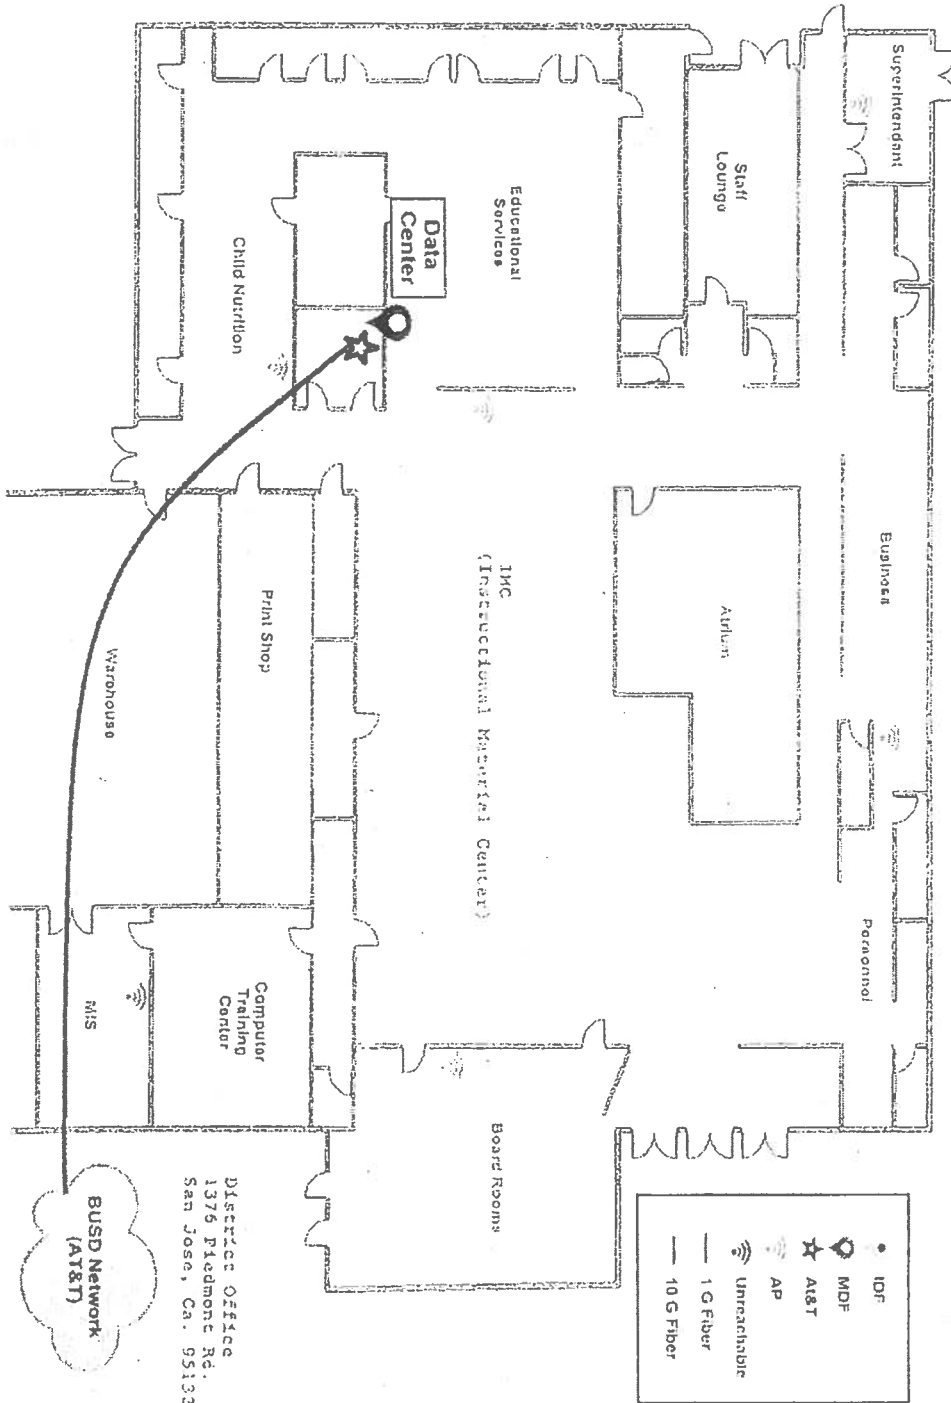

2/26/25

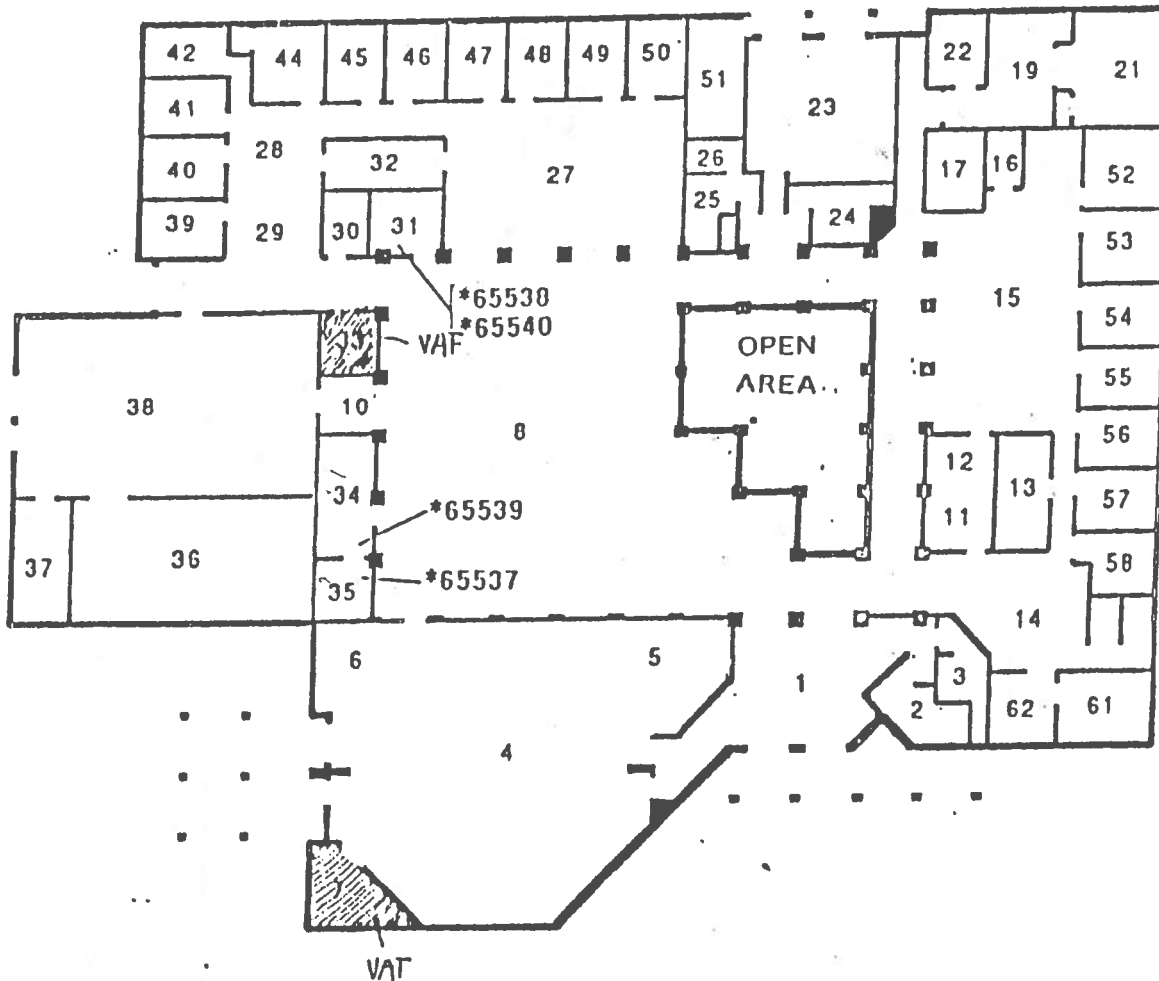

NORTH




SCALE: 1/30" = 1'-0"

BUSD

BERRYESSA UNION SCHOOL DISTRICT



DISTRICT OFFICE
1376 Piedmont Road
San Jose, CA

FIGURE #1

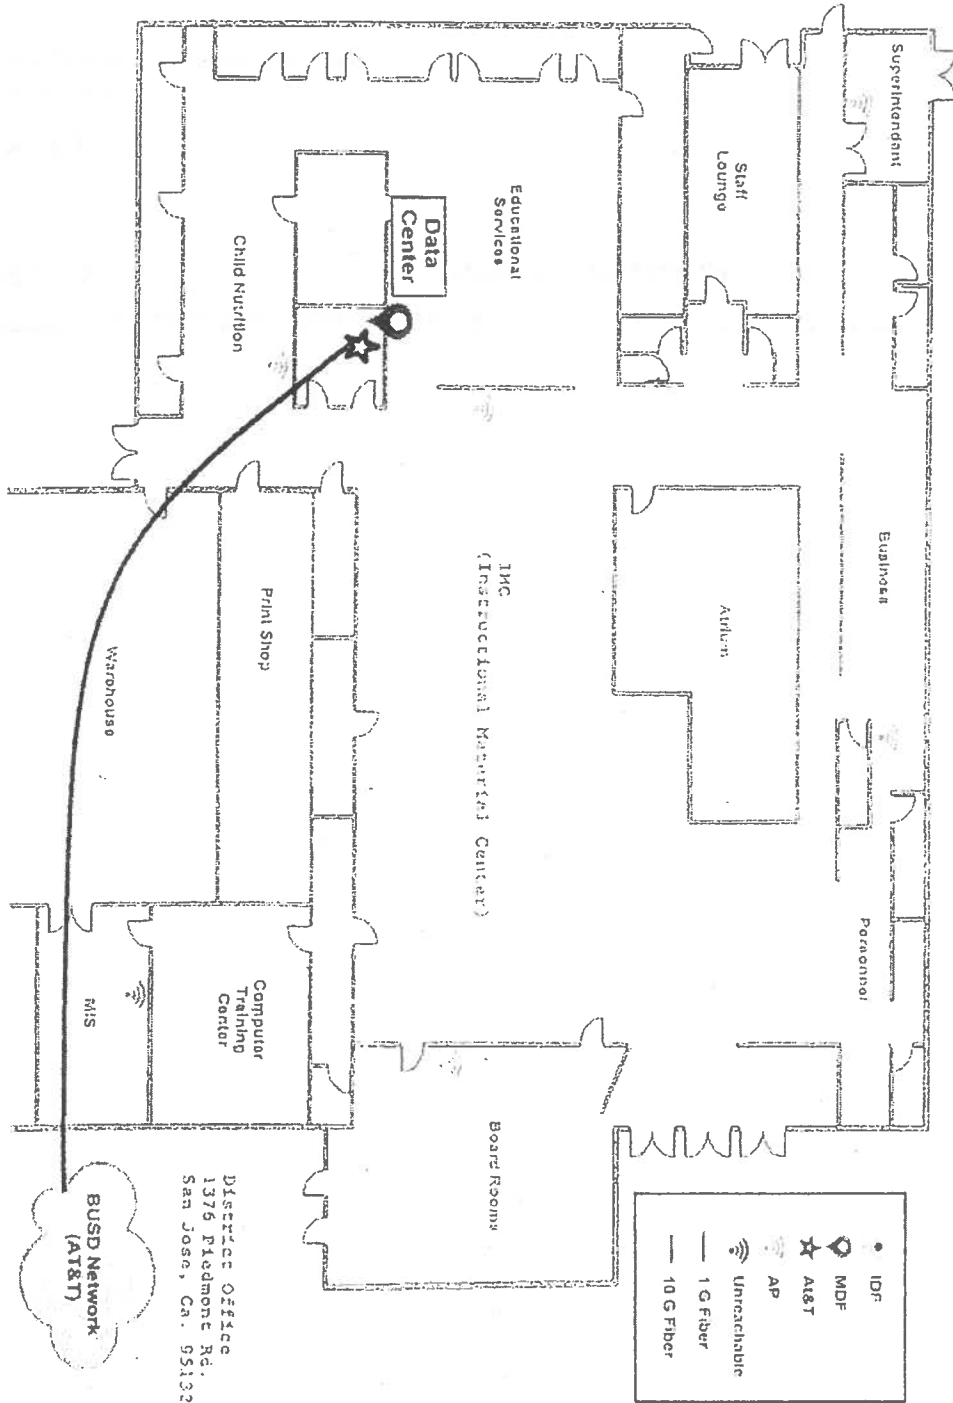



Berryessa Union School District / District Office...Confidential Documents...



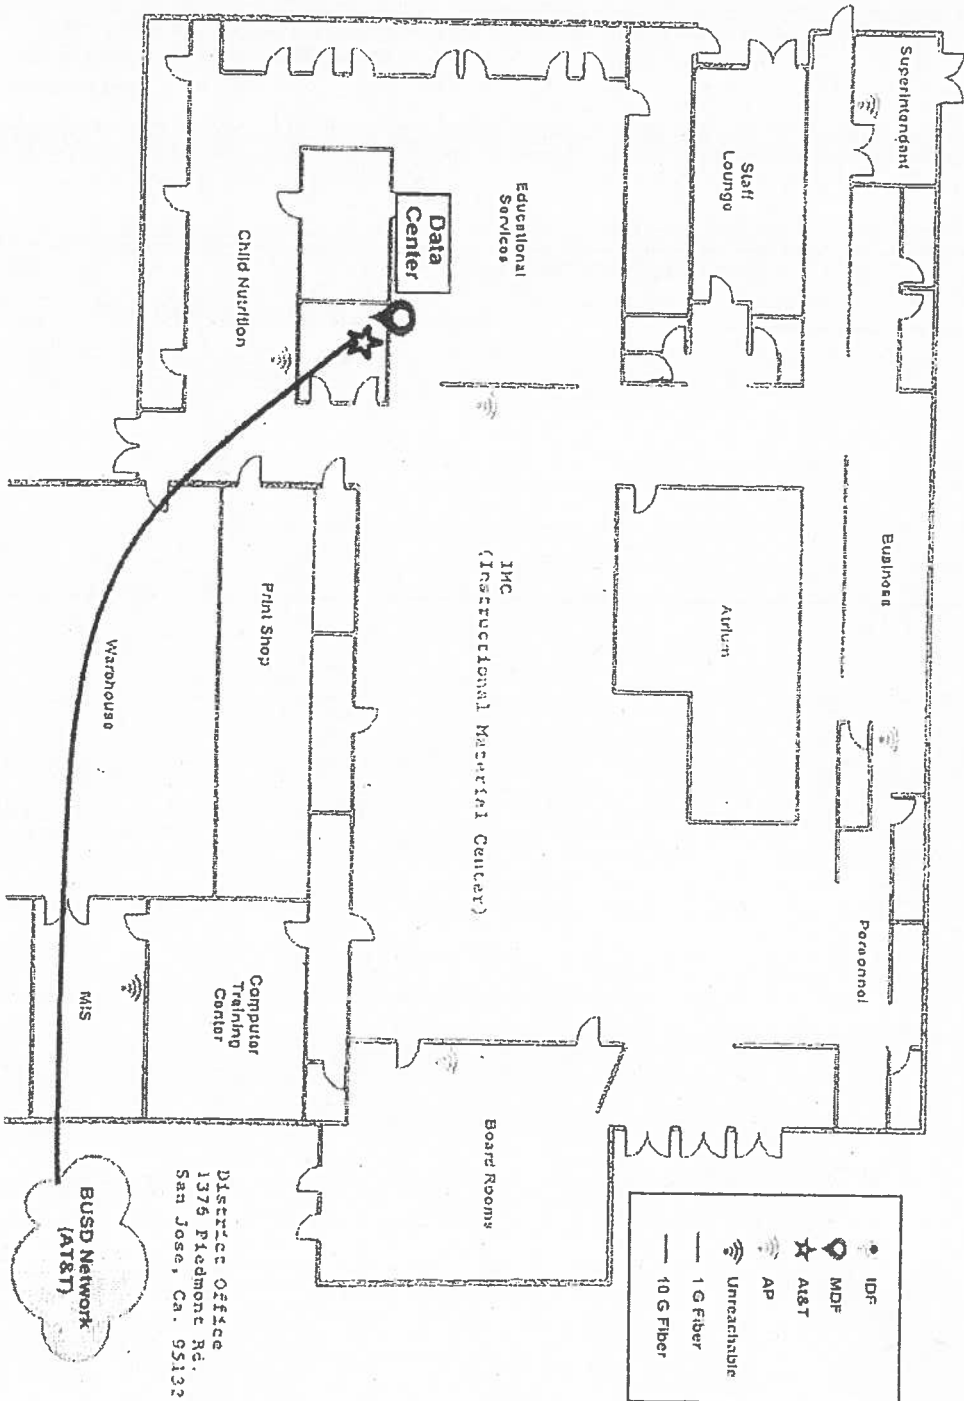


Berryessa Union School District / District Office...Confidential Documents...

4/5/2016

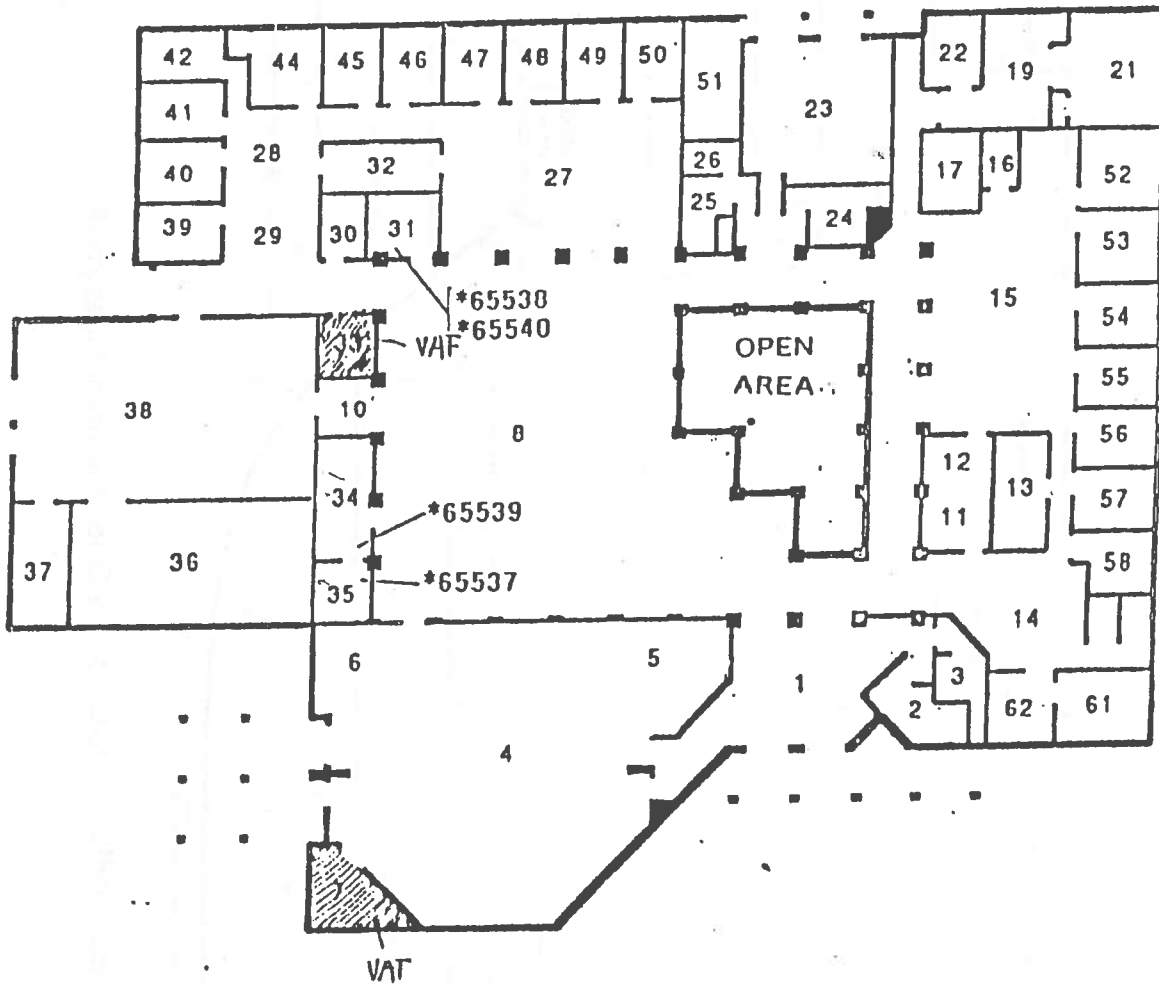

NORTH





SCALE: 1/30" = 1'-0"

BUSD



BERRYESSA UNION SCHOOL DISTRICT

DISTRICT OFFICE
 1376 Piedmont Road
 San Jose, CA

FIGURE #1

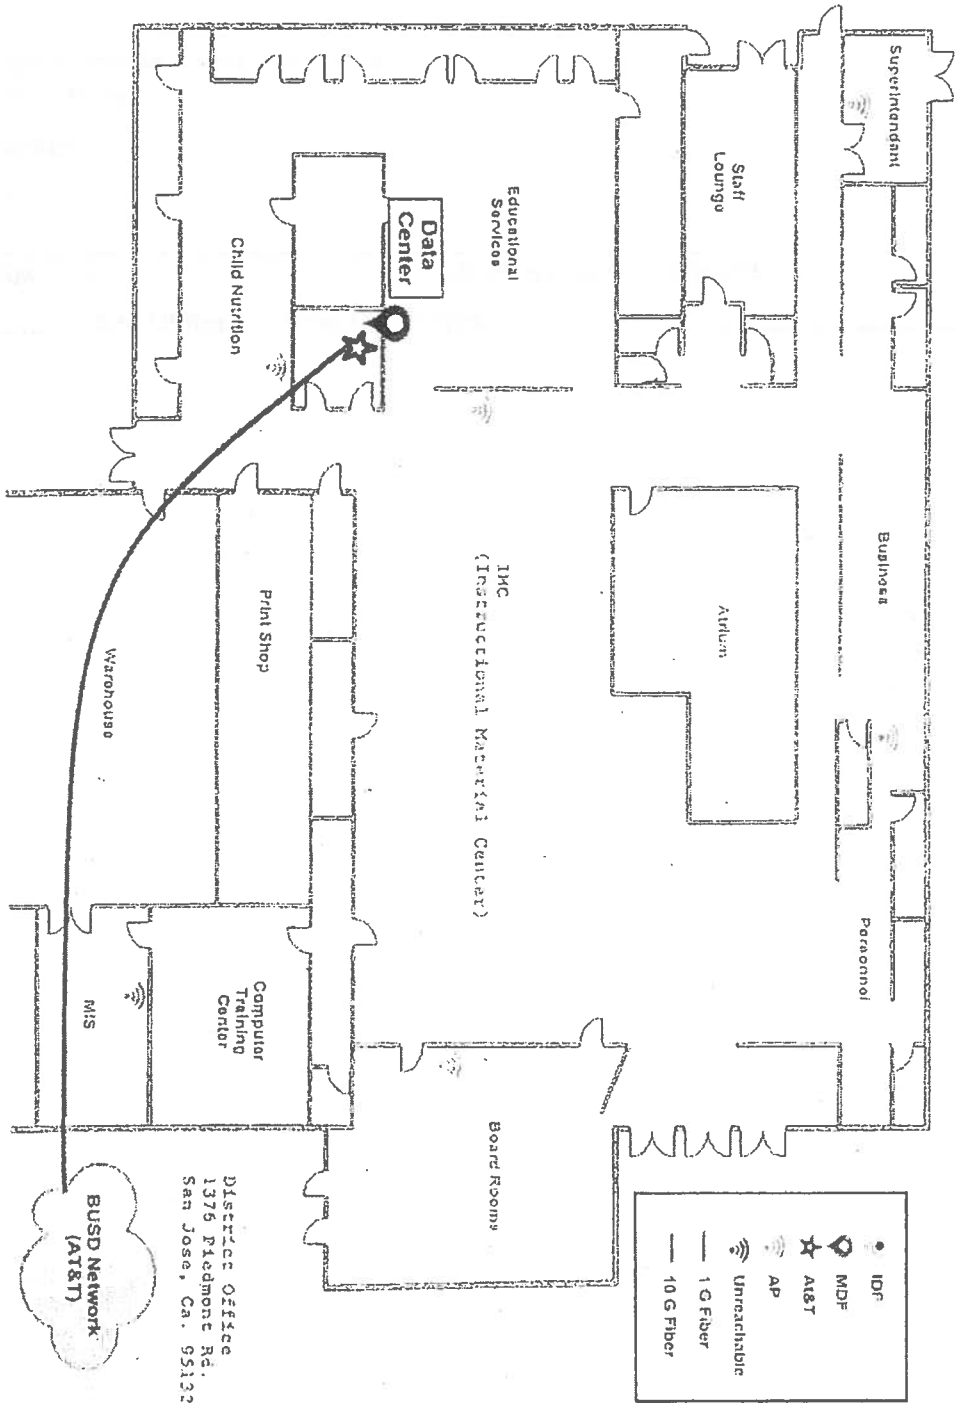

Berryessa Union School District / District Office...Confidential Documents...

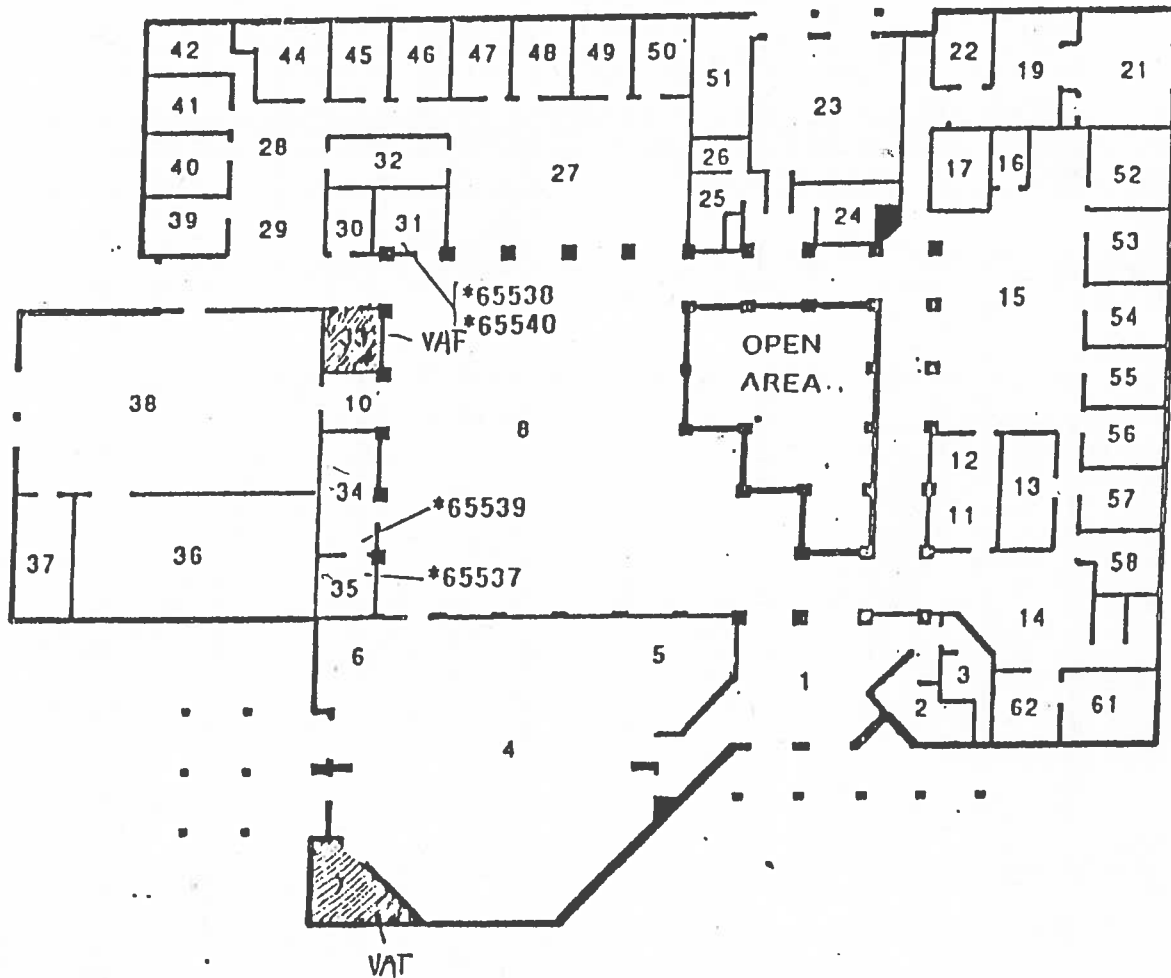

BUSD

BERRYESSA UNION SCHOOL DISTRICT


DISTRICT OFFICE
1376 Piedmont Road
San Jose, CA

FIGURE #1



MANAGEMENT
77001 : 011000 : 000000

Berryessa Union School District / District Office...Confidential Documents...


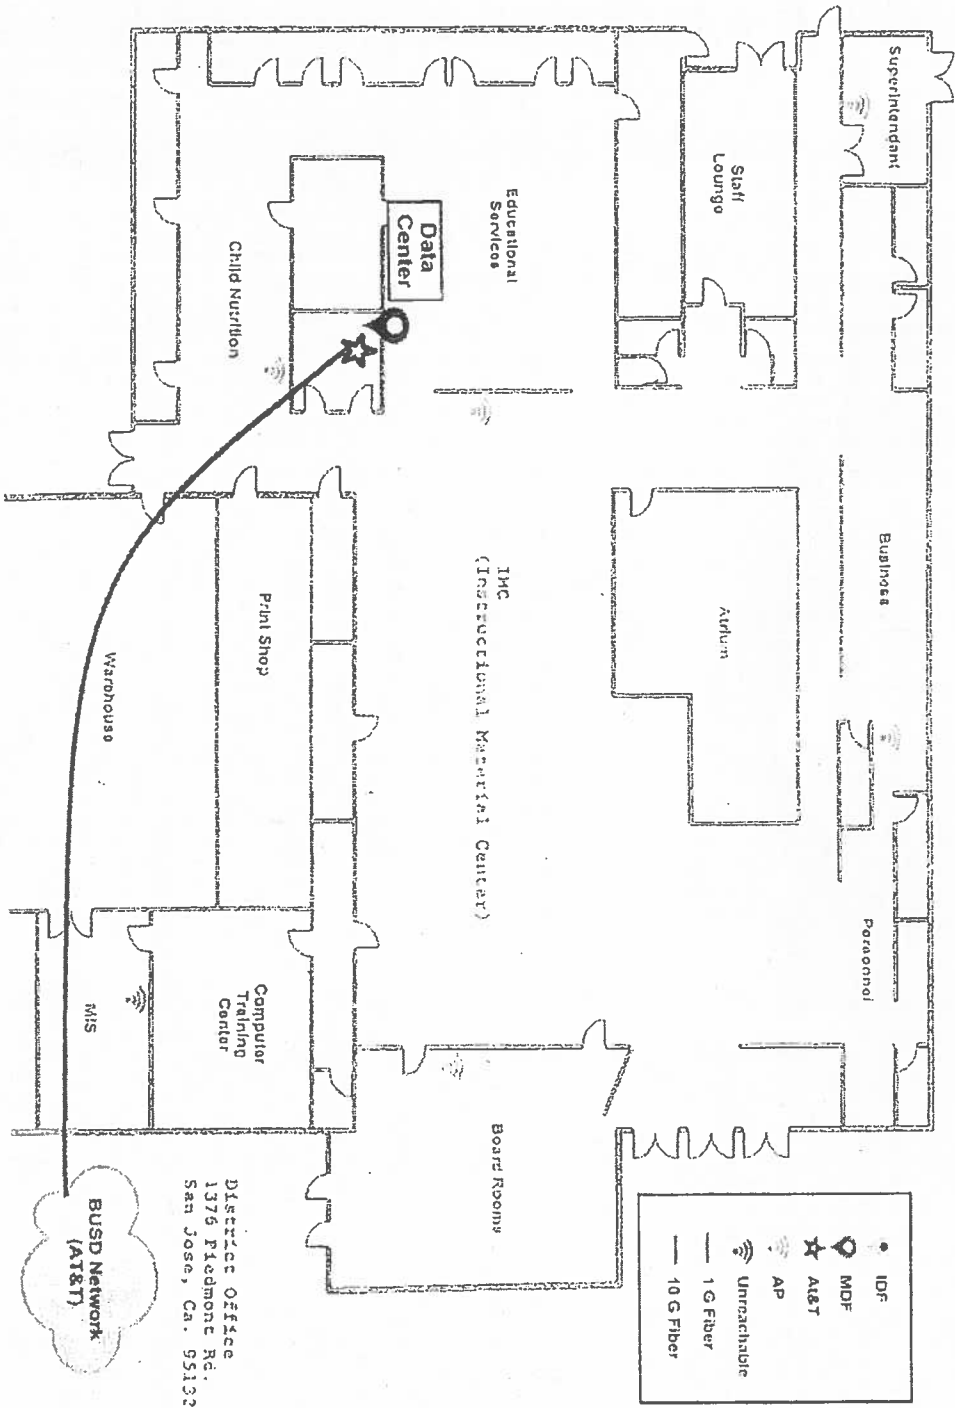


BUESD DISTRICT OFFICES


PAGE 1 OF 2

INSPECTED ON:

2/14/23

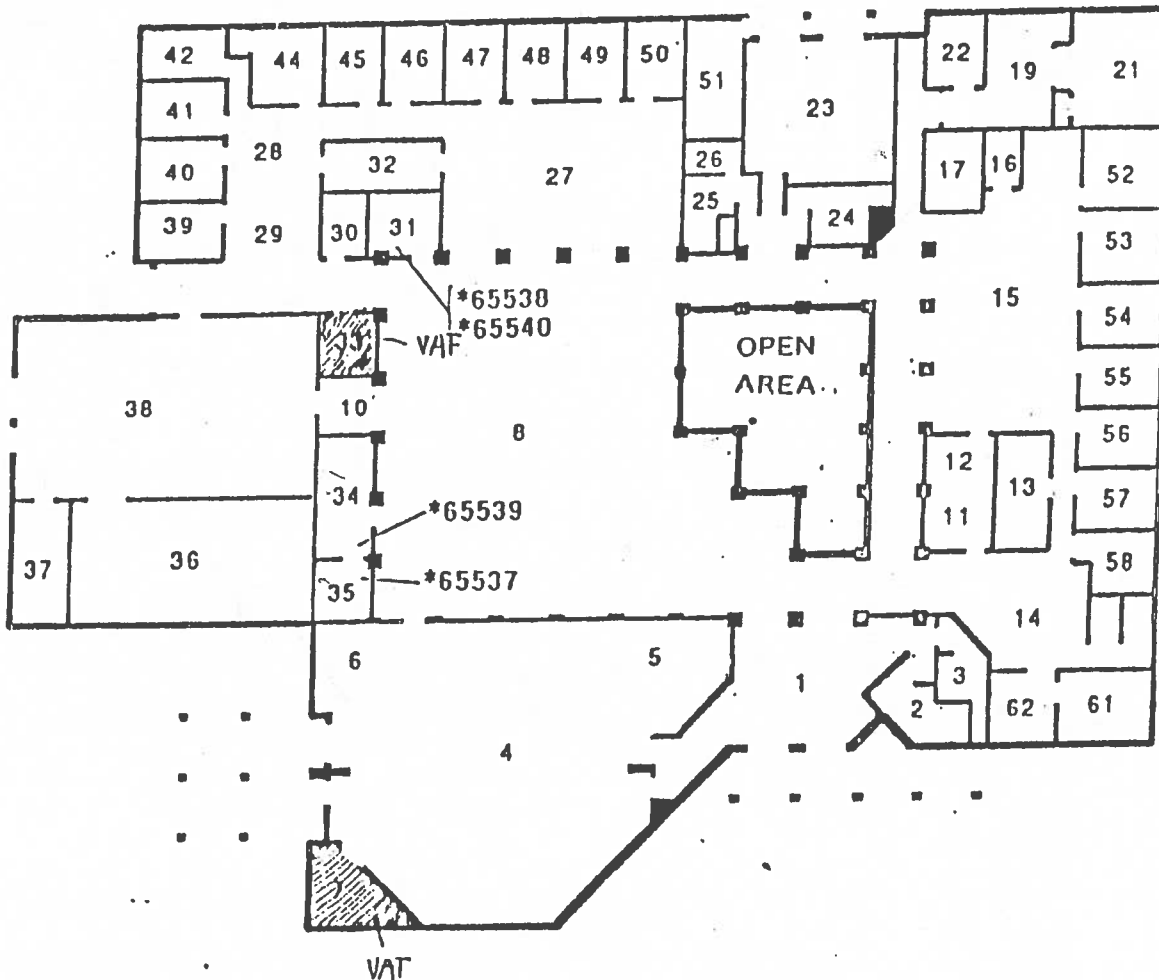

NORTH



SCALE: 1/30" = 1'-0"




BUSD

BERRYESSA UNION SCHOOL DISTRICT

DISTRICT OFFICE
1376 Piedmont Road
San Jose, CA

FIGURE #1



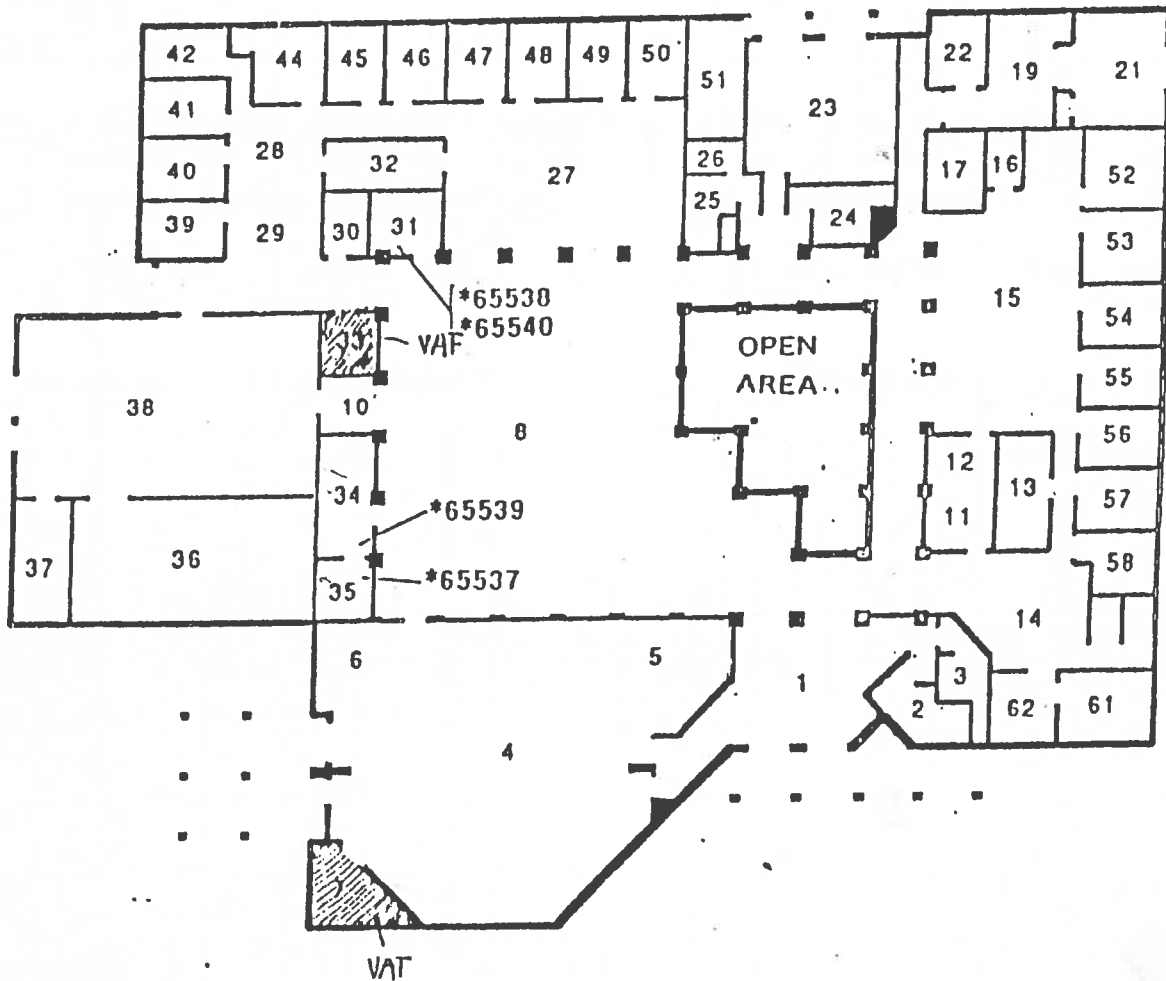



SCALE: 1/30" = 1'-0"

BUSD



BERRYESSA UNION SCHOOL DISTRICT

DISTRICT OFFICE
 1376 Piedmont Road
 San Jose, CA

FIGURE #1

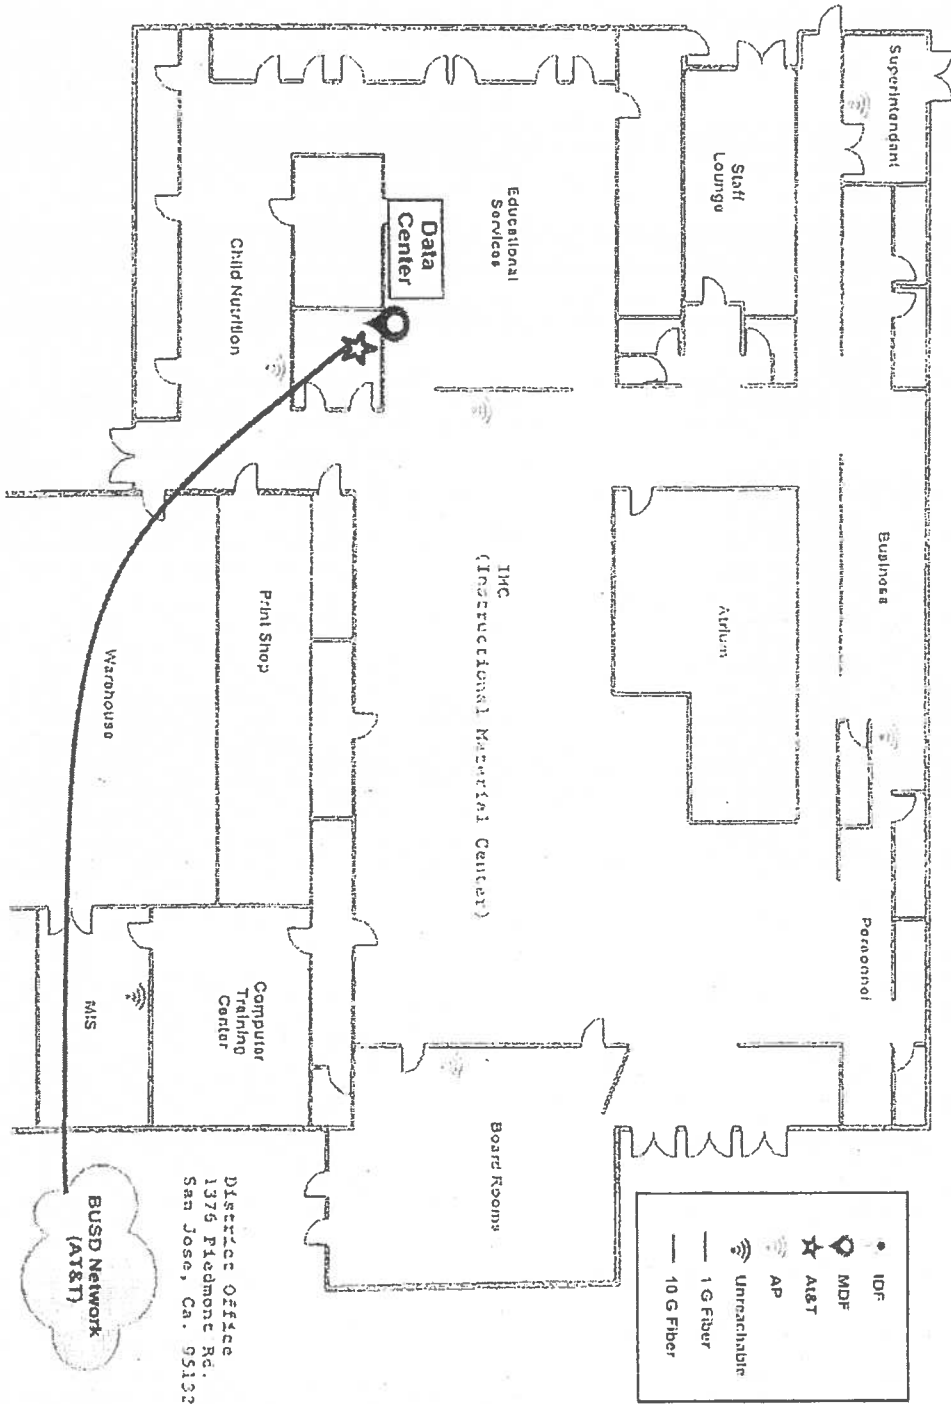

Berryessa Union School District / District Office...:Confidential Documents...

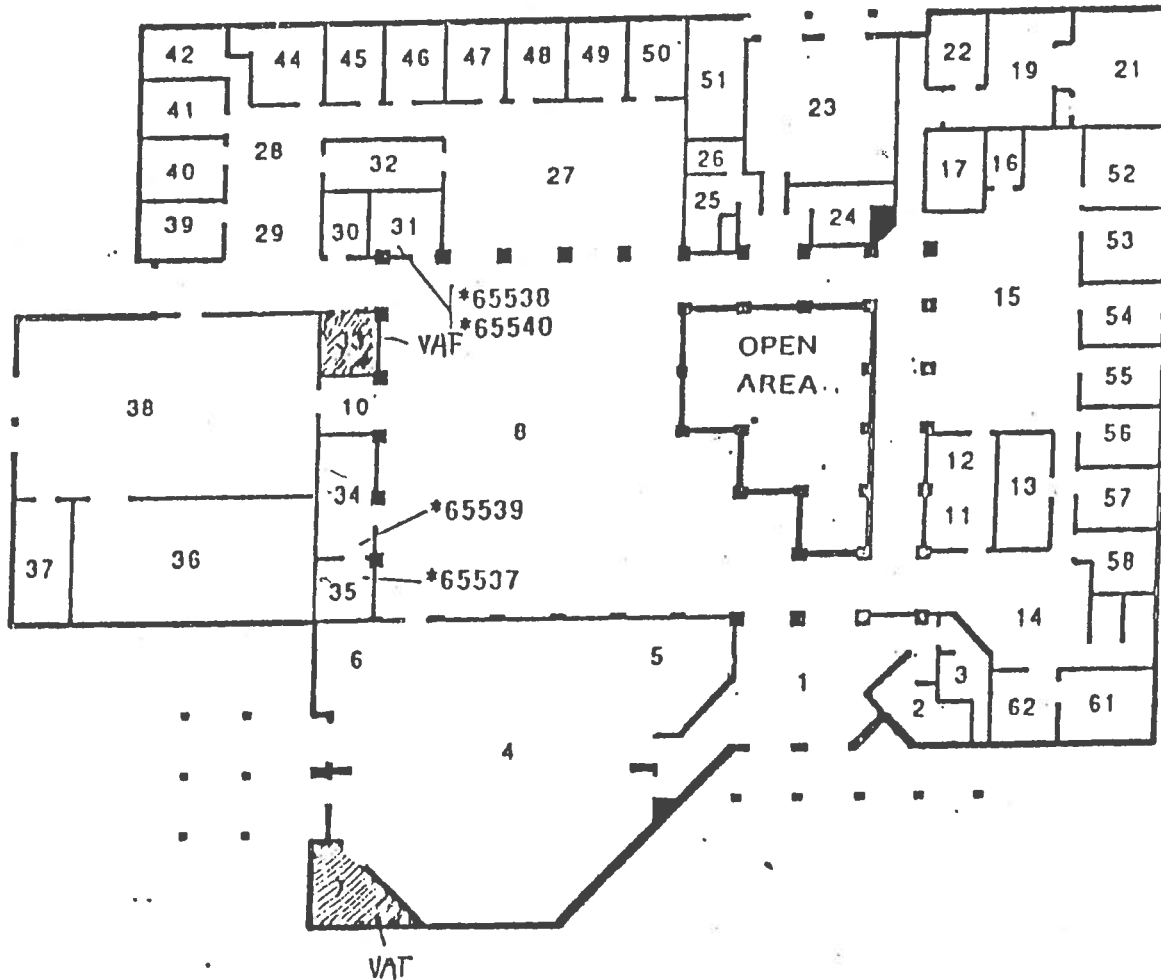

NORTH

0 10 25 50 100


SCALE: 1/30" = 1'-0"

BUSD

BERRYESSA UNION SCHOOL DISTRICT

DISTRICT OFFICE
1376 Piedmont Road
San Jose, CA

FIGURE #1

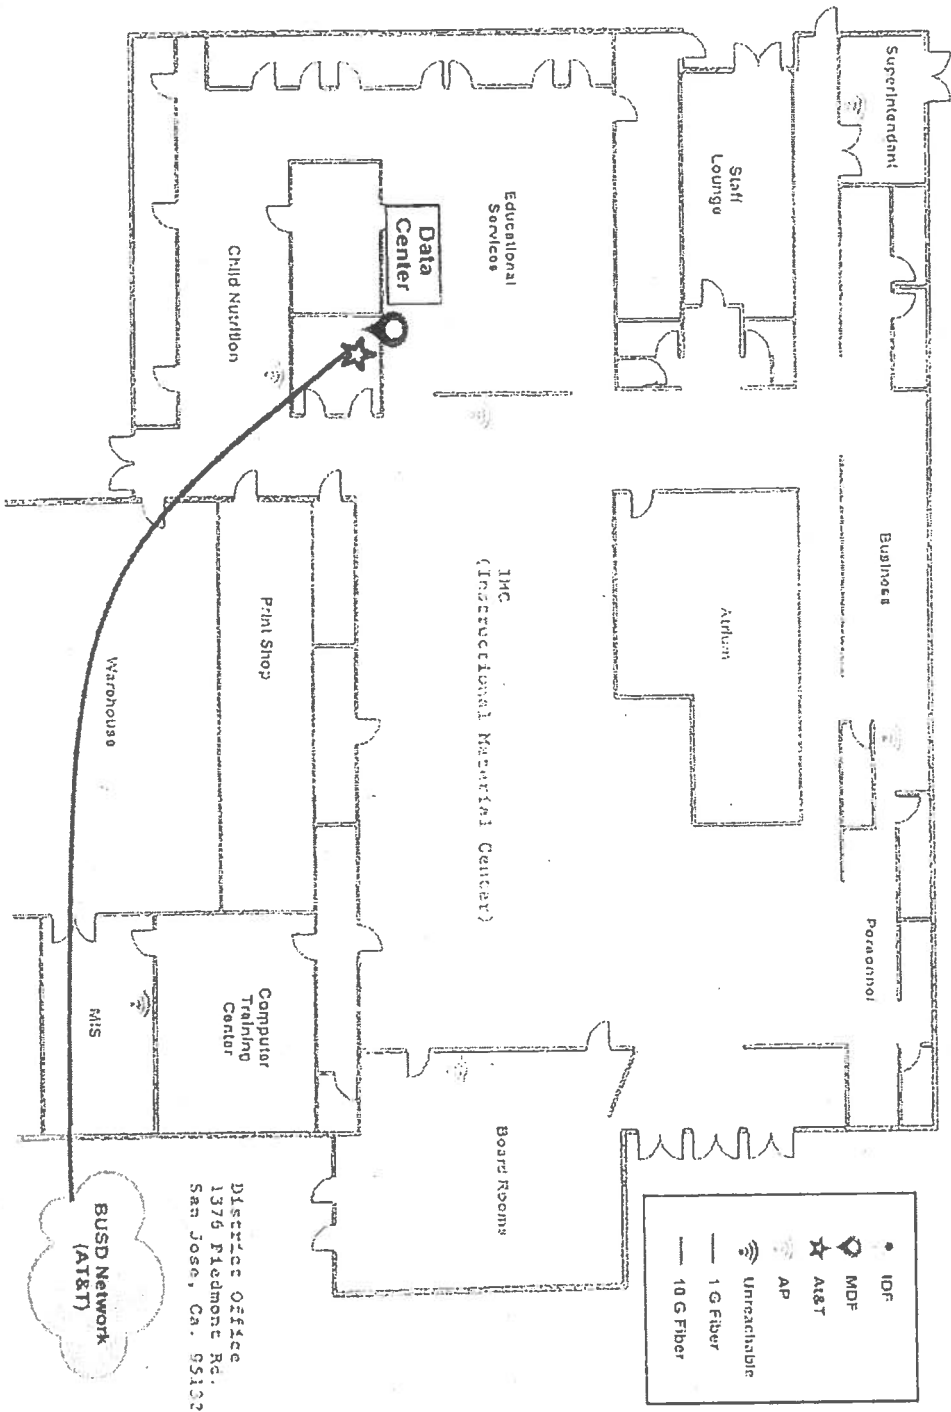

Berryessa Union School District / District Office...Confidential Documents...

BUESD DISTRICT OFFICES


PAGE 1 OF 2

INSPECTED ON:

8/9/21



Metal Container

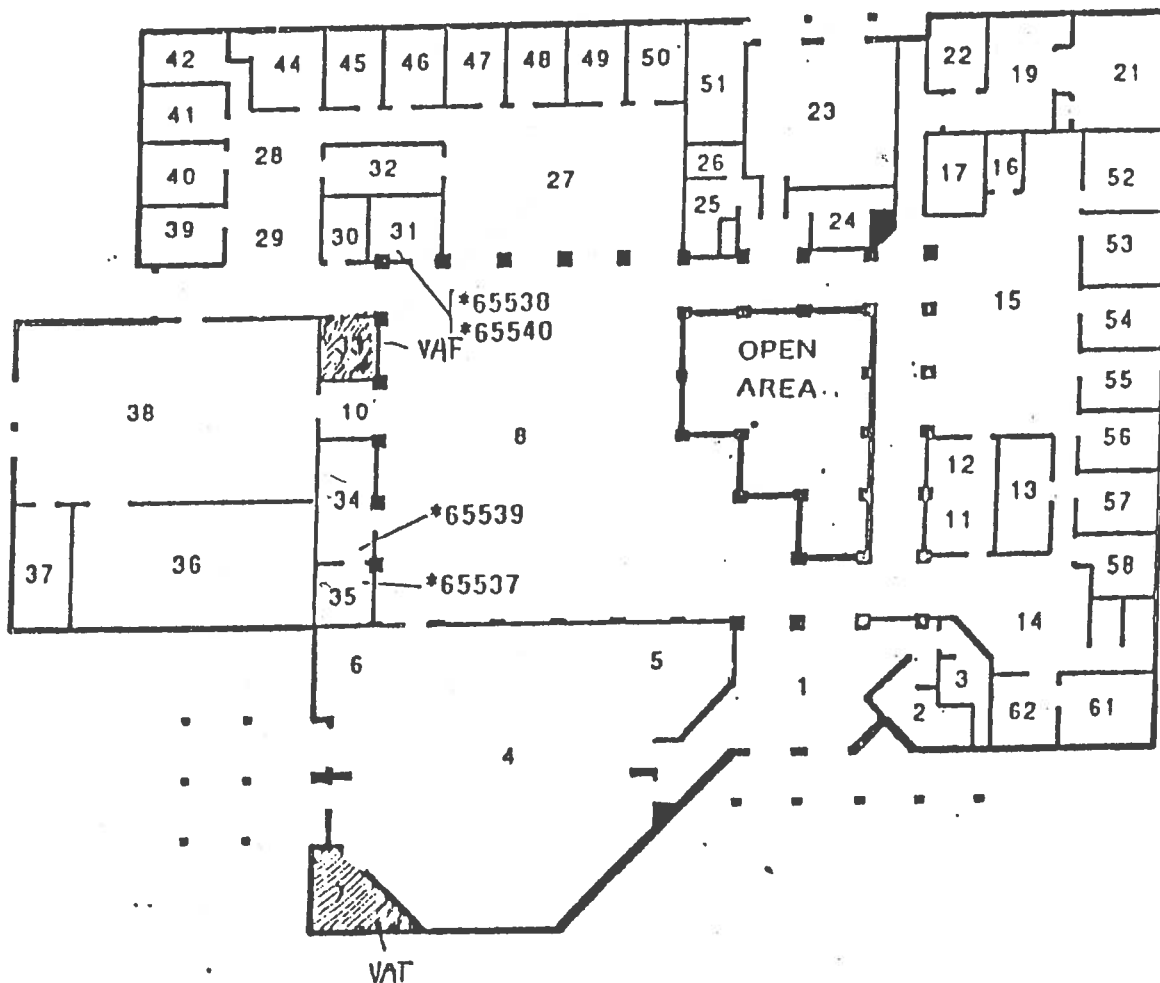

NORTH

0 10 25 50 100

SCALE: 1/30" = 1'-0"

BUSD


BERRYESSA UNION SCHOOL DISTRICT

DISTRICT OFFICE


1376 Piedmont Road

San Jose, CA



FIGURE #1



Berrysessa Union School District / District Office... Confidential Documents...

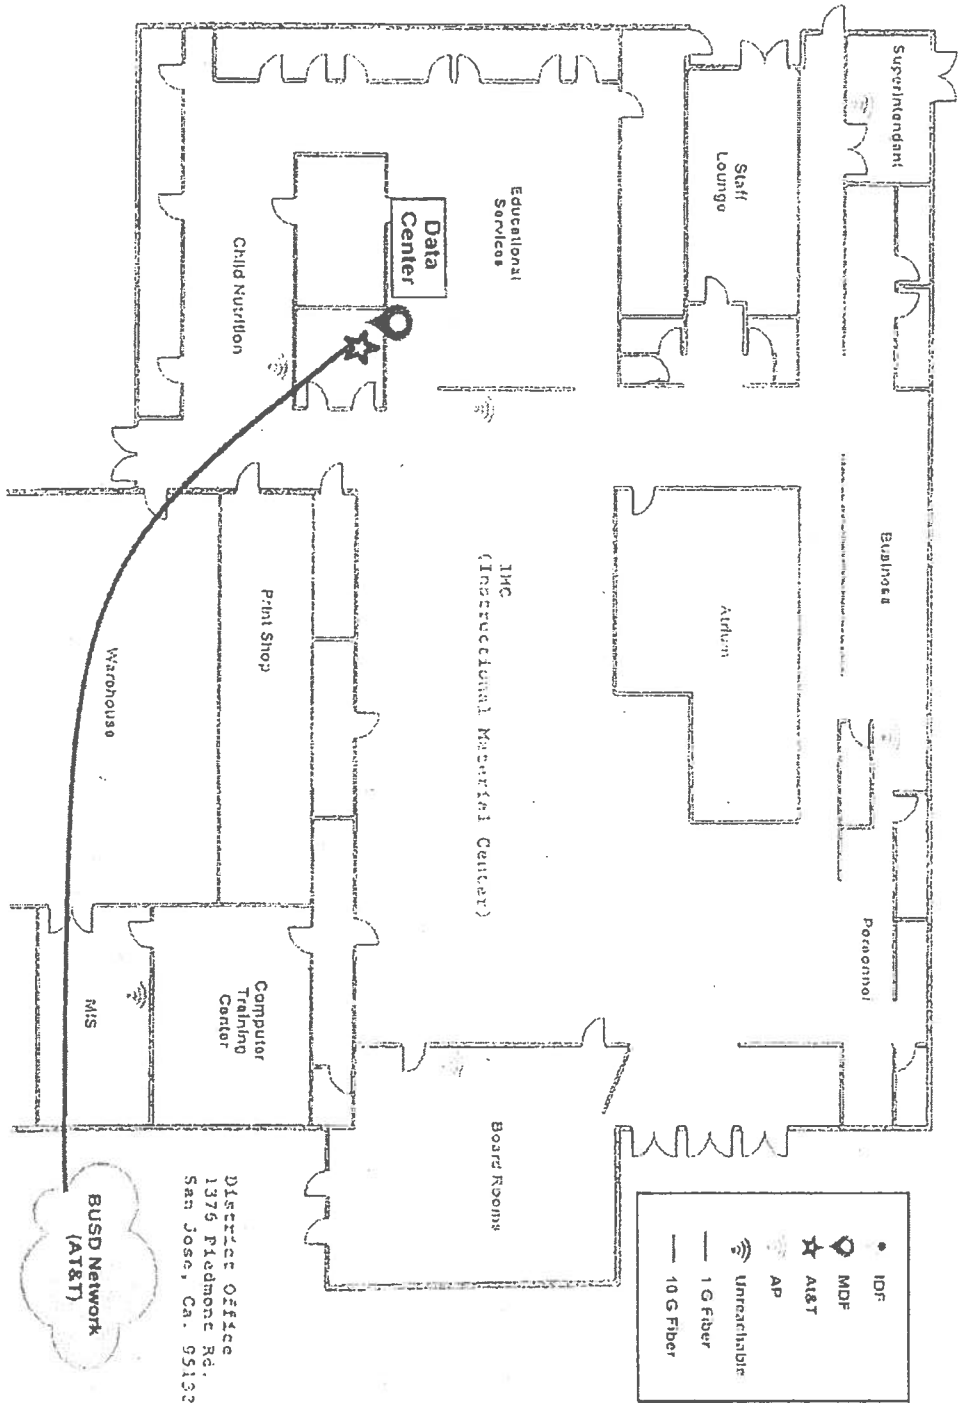

2/9/21

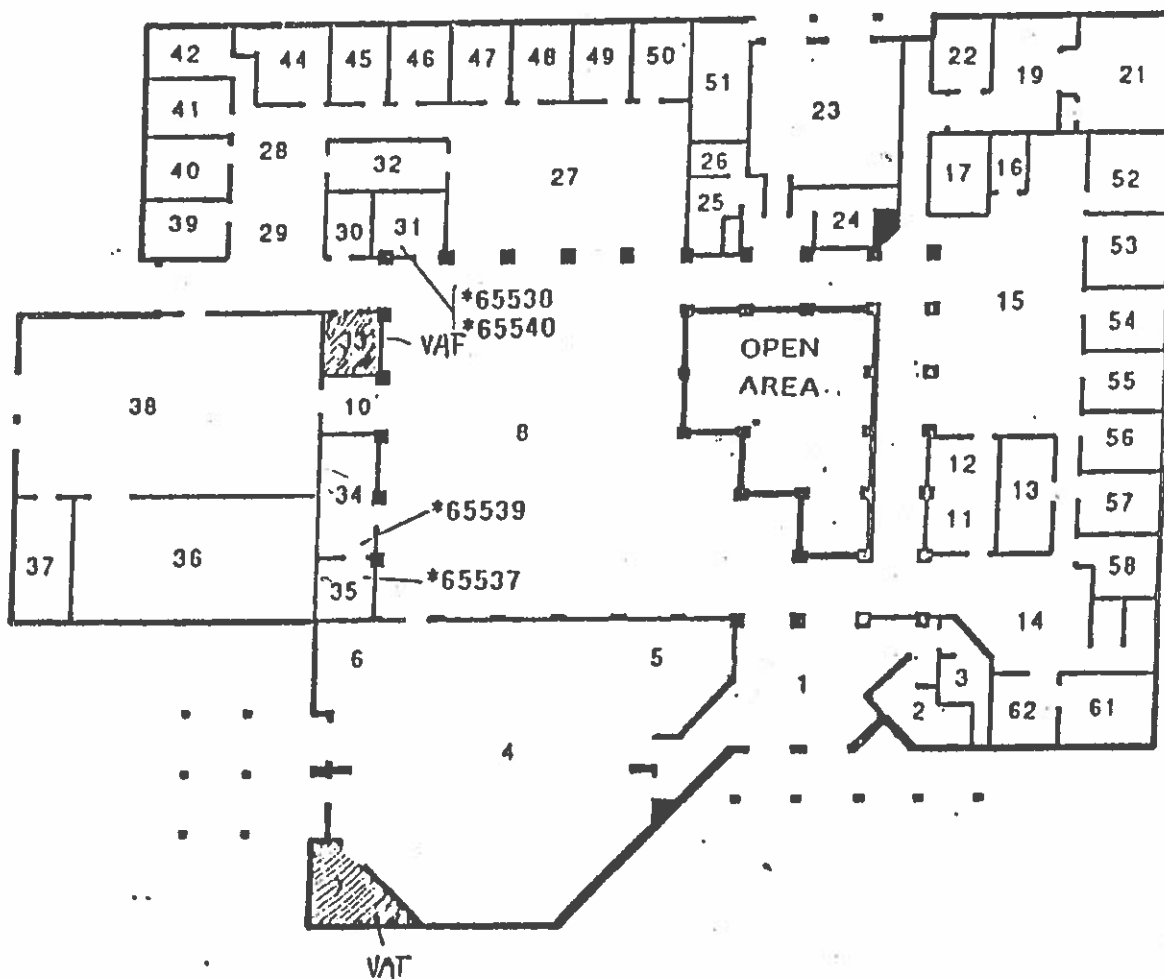

NORTH

0 10 25 50 100

SCALE: 1/30" = 1'-0"


BUSD

BERRYESSA UNION SCHOOL DISTRICT

DISTRICT OFFICE


1376 Piedmont Road
San Jose, CA

FIGURE #1



Berryessa Union School District / District Office...Confidential Documents...

4/5/2016


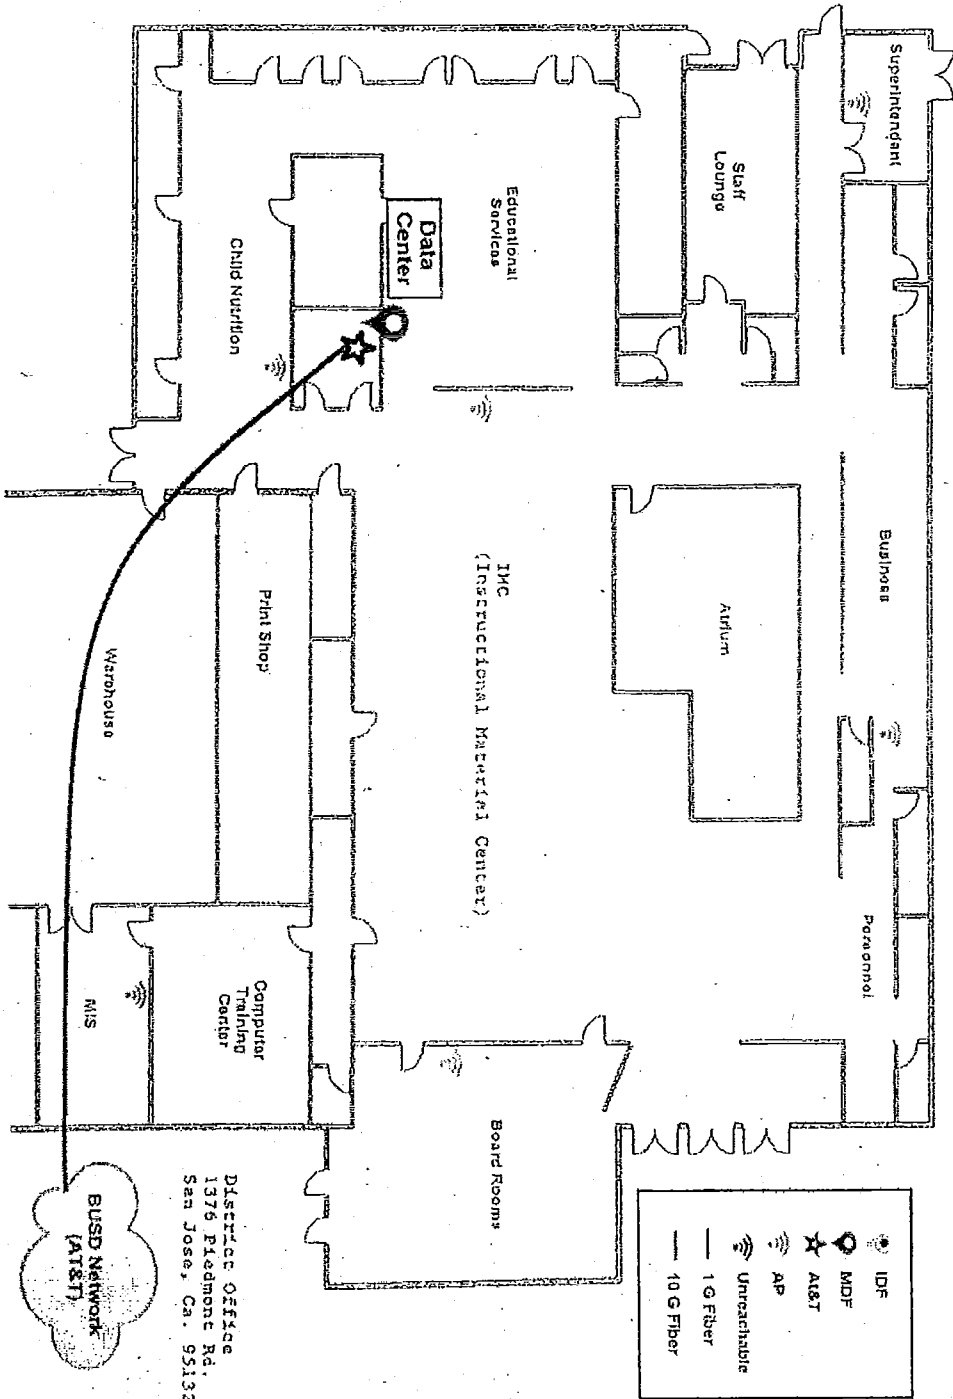


BUESD DISTRICT OFFICES


PAGE 1 OF 2

INSPECTED ON:

8/27/20

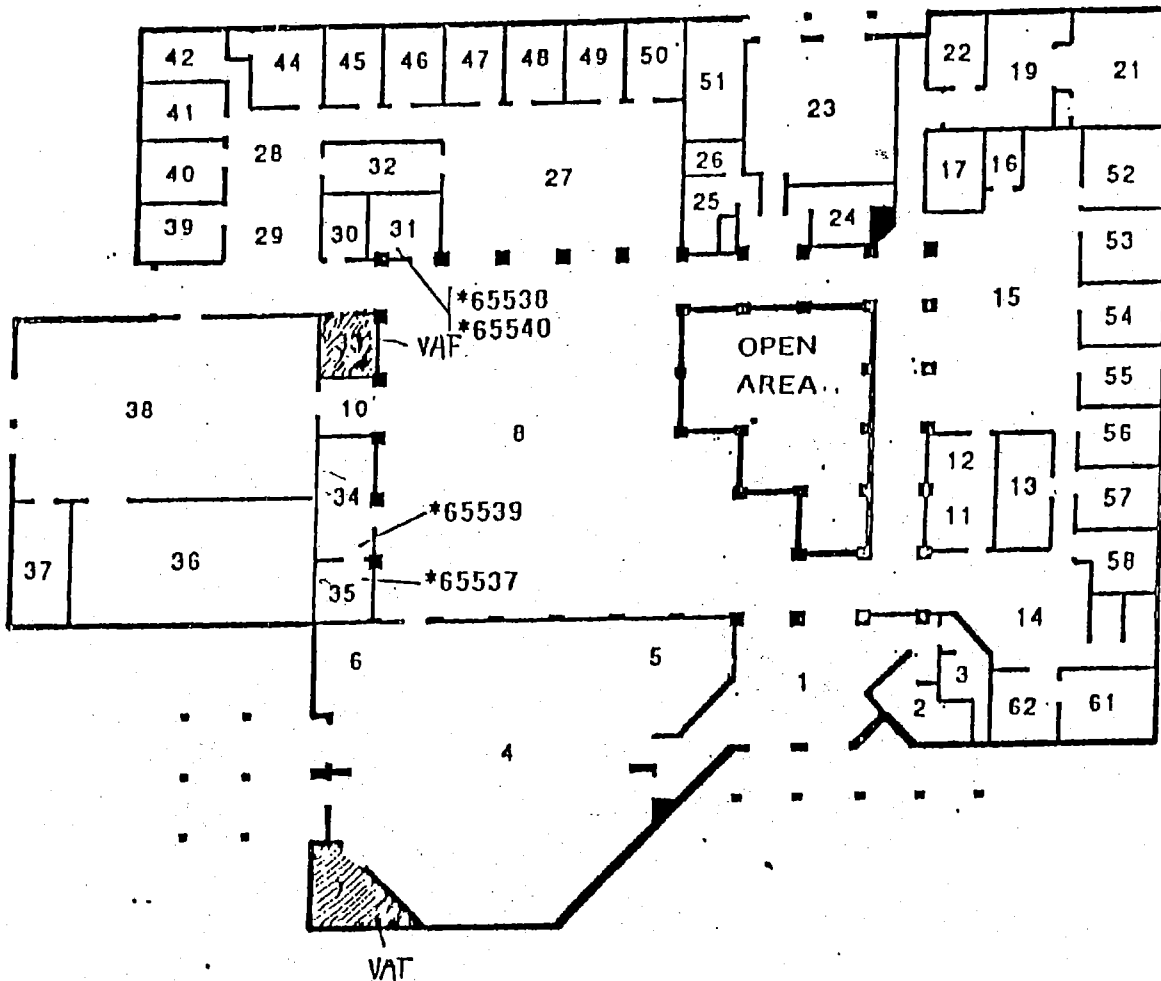

NORTH




SCALE: 1/30" = 1'-0"

BUSD

BERRYESSA UNION SCHOOL DISTRICT


DISTRICT OFFICE
1376 Piedmont Road
San Jose, CA

FIGURE #1



Berryessa Union School District / District Office...Confidential Documents...



4/5/2016

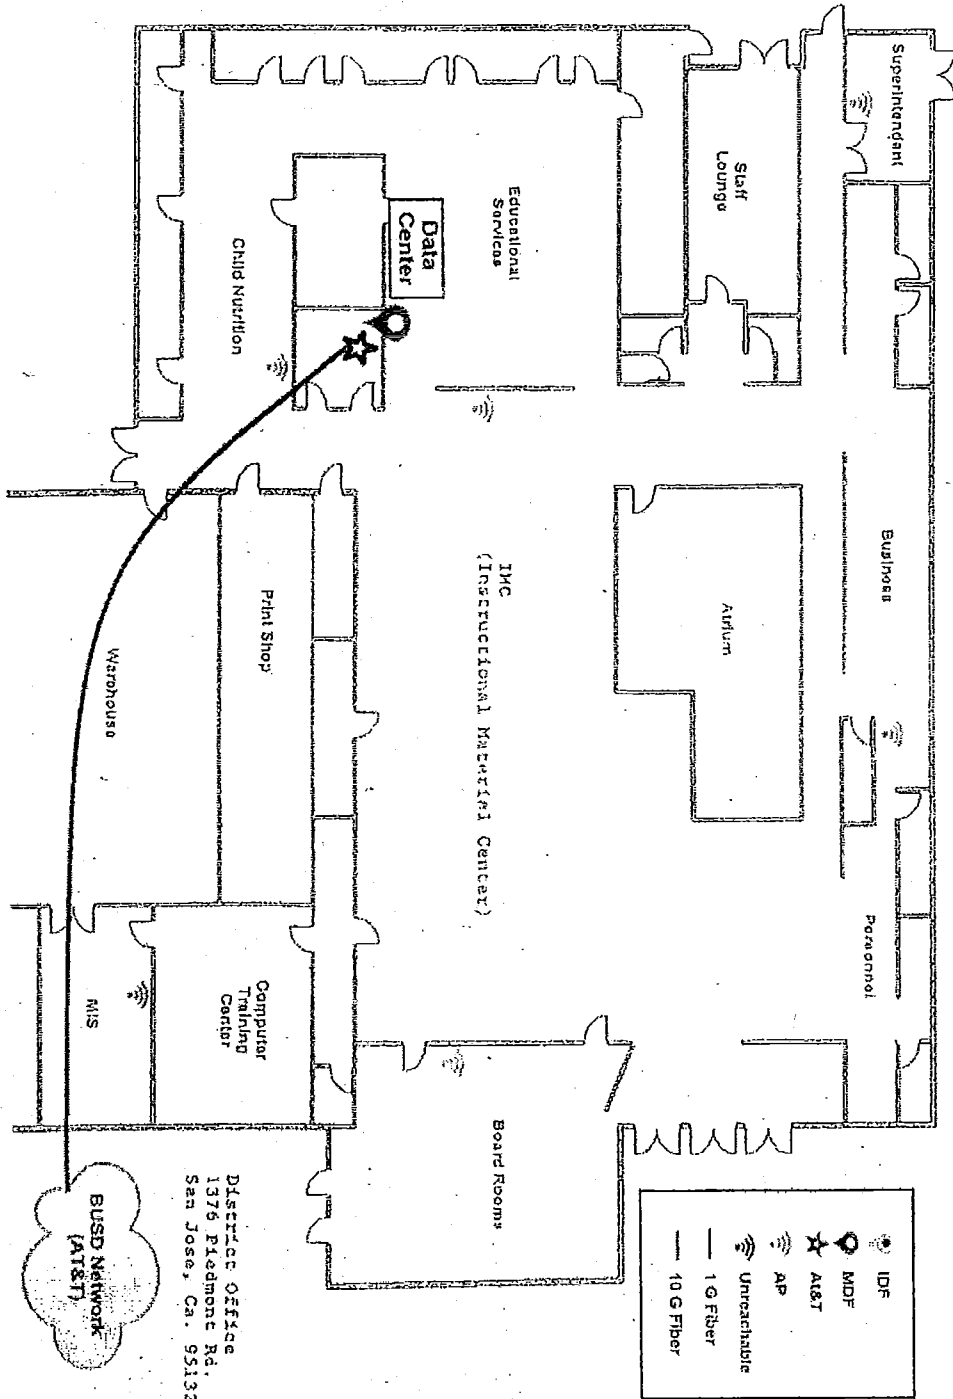


BUESD DISTRICT OFFICES

PAGE 1 OF 2

INSPECTED ON: 1-30-2020

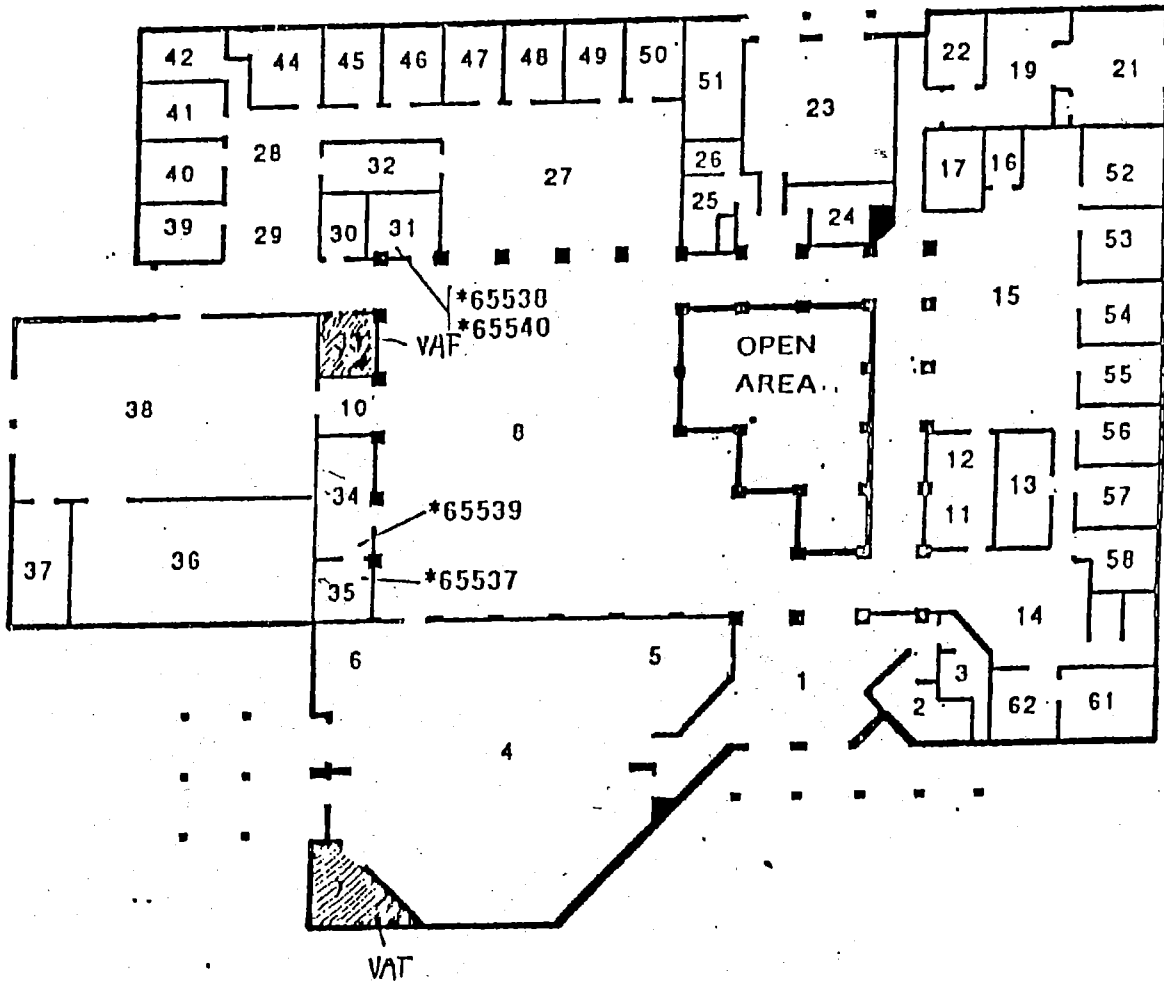

NORTH




SCALE: 1/30" = 1'-0"

BUSD


BERRYESSA UNION SCHOOL DISTRICT

DISTRICT OFFICE
1376 Piedmont Road
San Jose, CA

FIGURE #1





Berryessa Union School District / District Office...Confidential Documents...

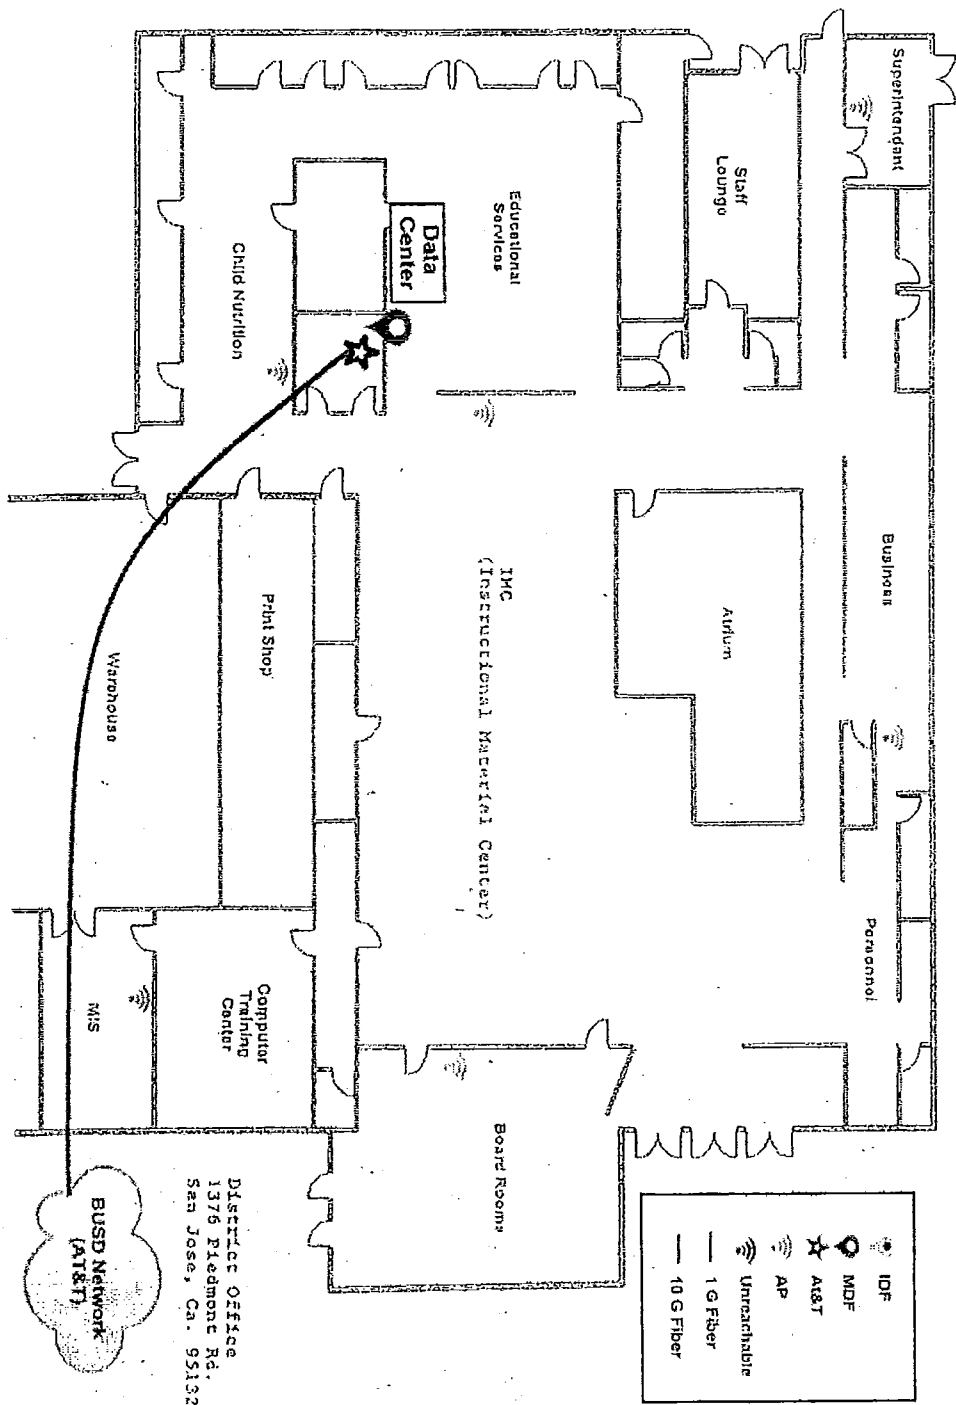

BUESD DISTRICT OFFICES

PAGE 1 OF 2

INSPECTED ON: 8-13-19

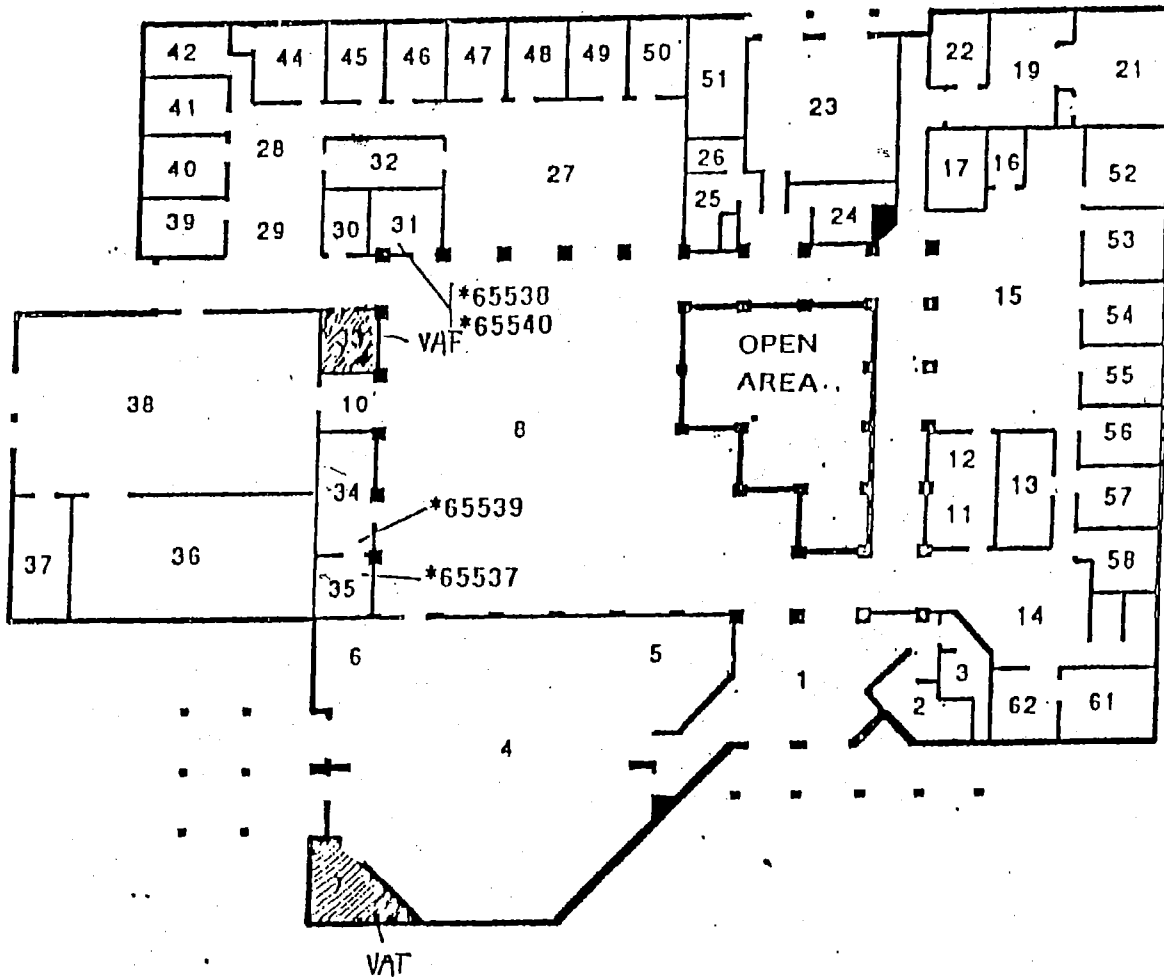

0 10 25 50 100


SCALE: 1/30" = 1'-0"

BUSD




BERRYESSA UNION SCHOOL DISTRICT

DISTRICT OFFICE
1376 Piedmont Road
San Jose, CA

FIGURE #1

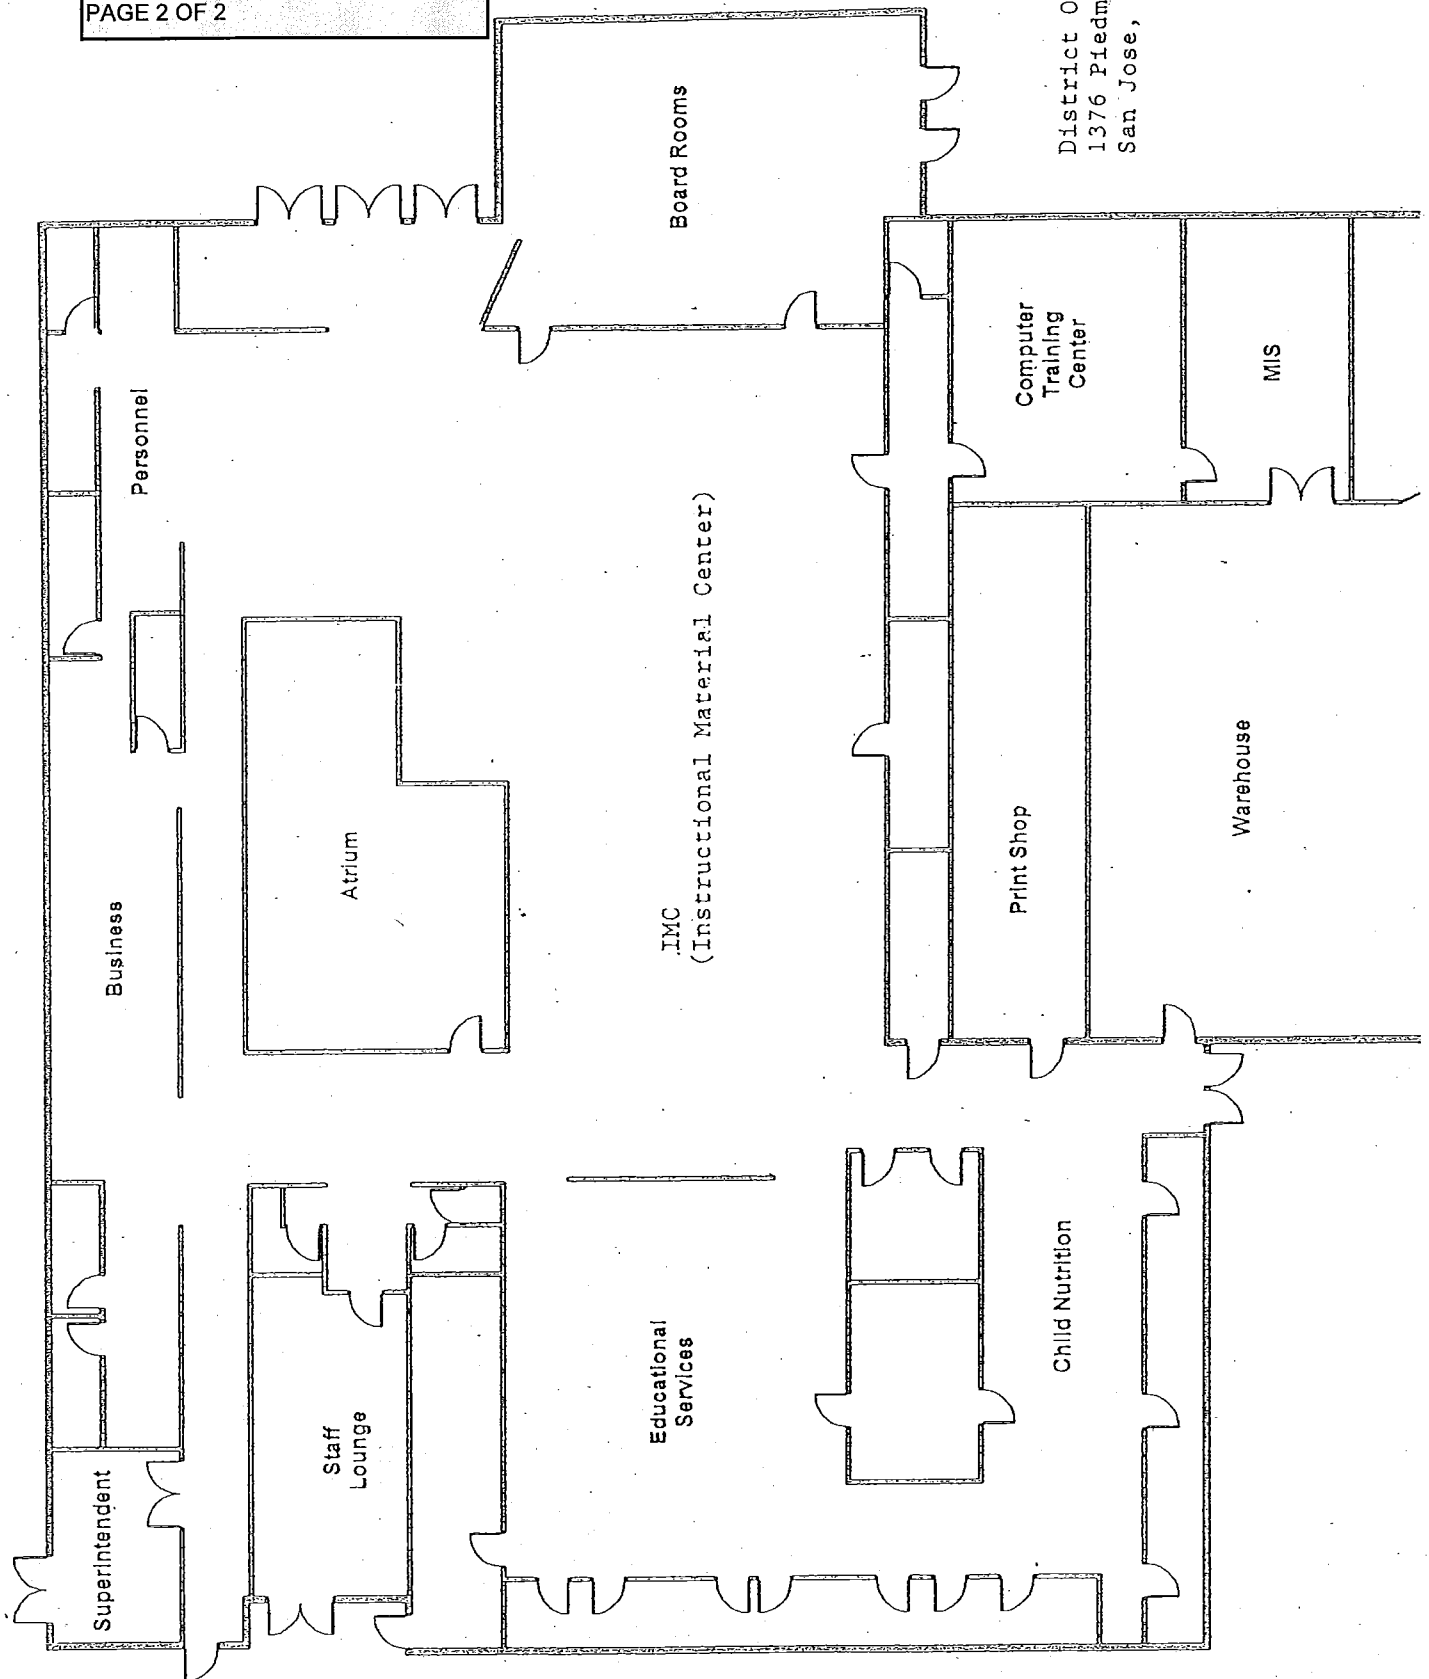

District Office
1376 Piedmont Rd.
San Jose, Ca. 95132

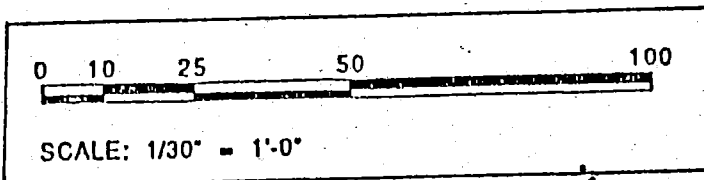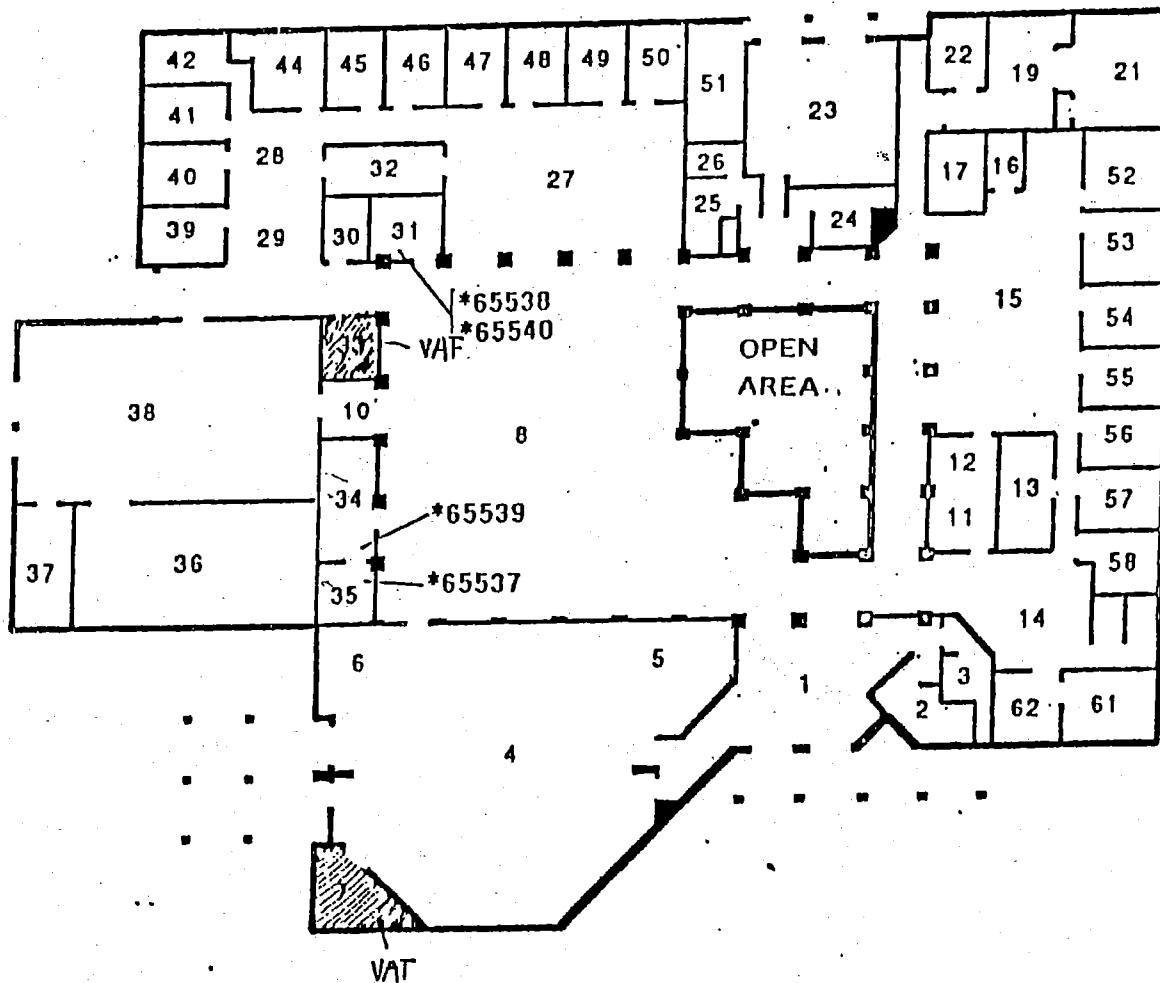


BUSD

BERRYESSA UNION SCHOOL DISTRICT

DISTRICT OFFICE
 1376 Piedmont Road
 San Jose, CA

FIGURE #1

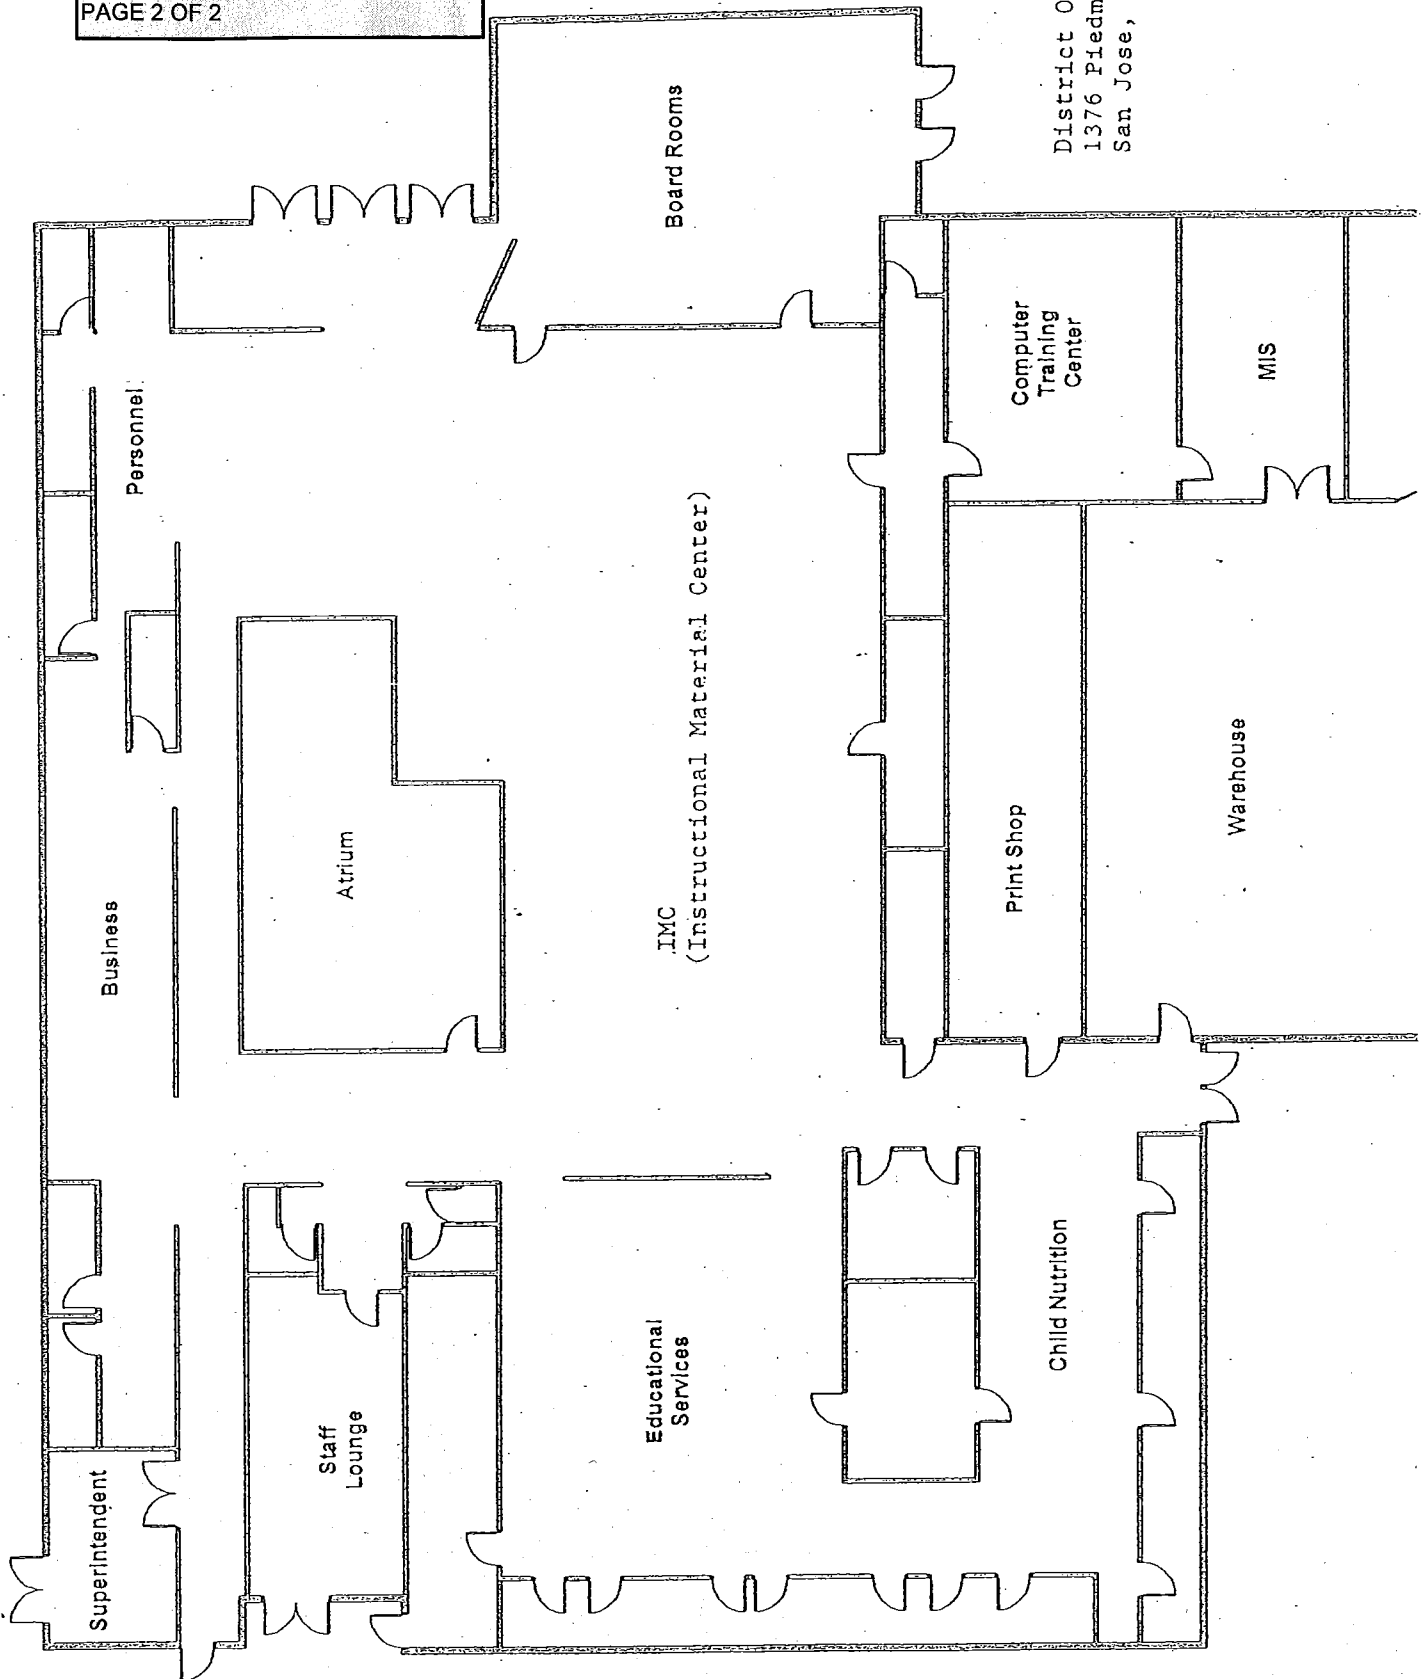



District Office
1376 Piedmont Rd.
San Jose, Ca. 95132

BUESD DISTRICT OFFICES

PAGE 1 OF 2

INSPECTED ON:

8/7/18

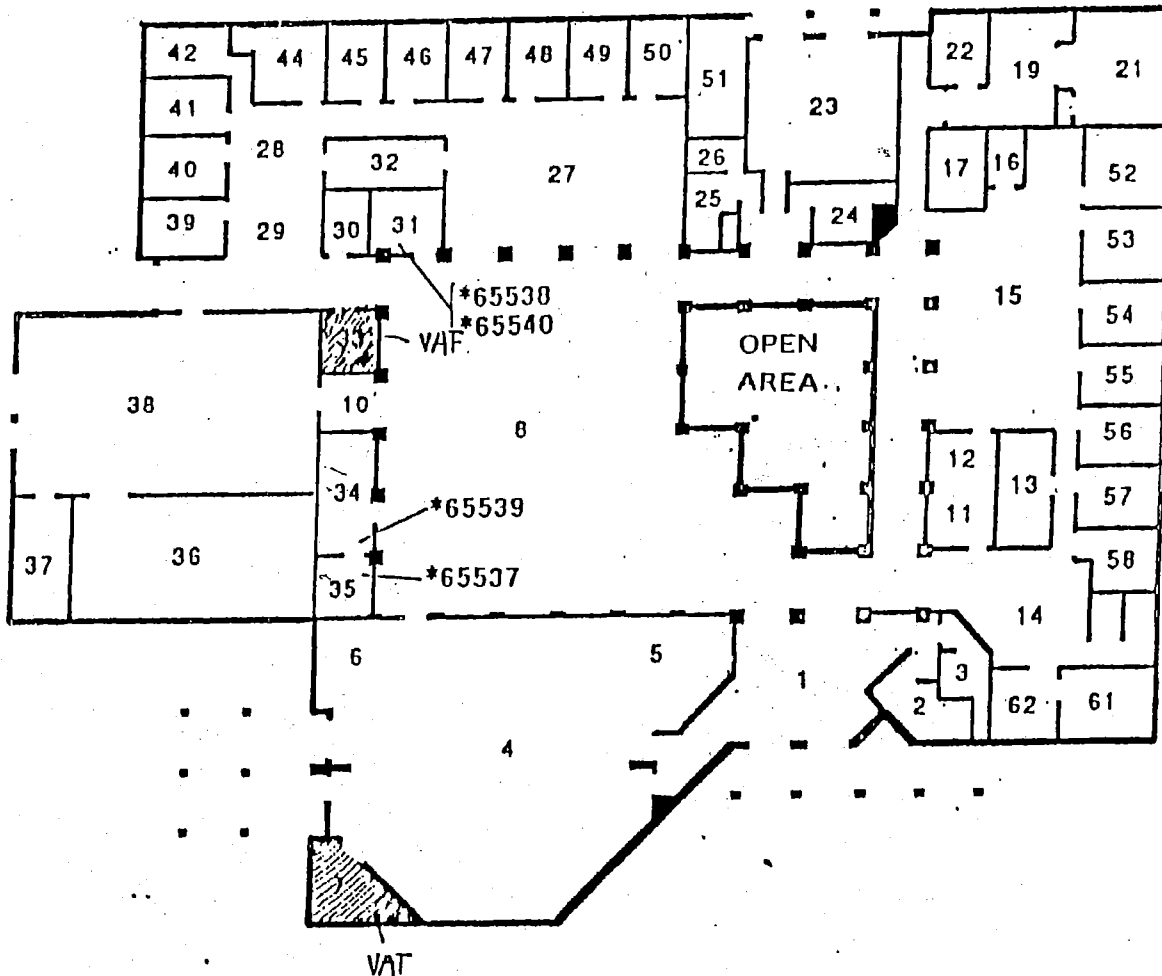

0 10 25 50 100


SCALE: 1/30" = 1'-0"

BUSD

BERRYESSA UNION SCHOOL DISTRICT

DISTRICT OFFICE
1376 Piedmont Road
San Jose, CA

FIGURE #1


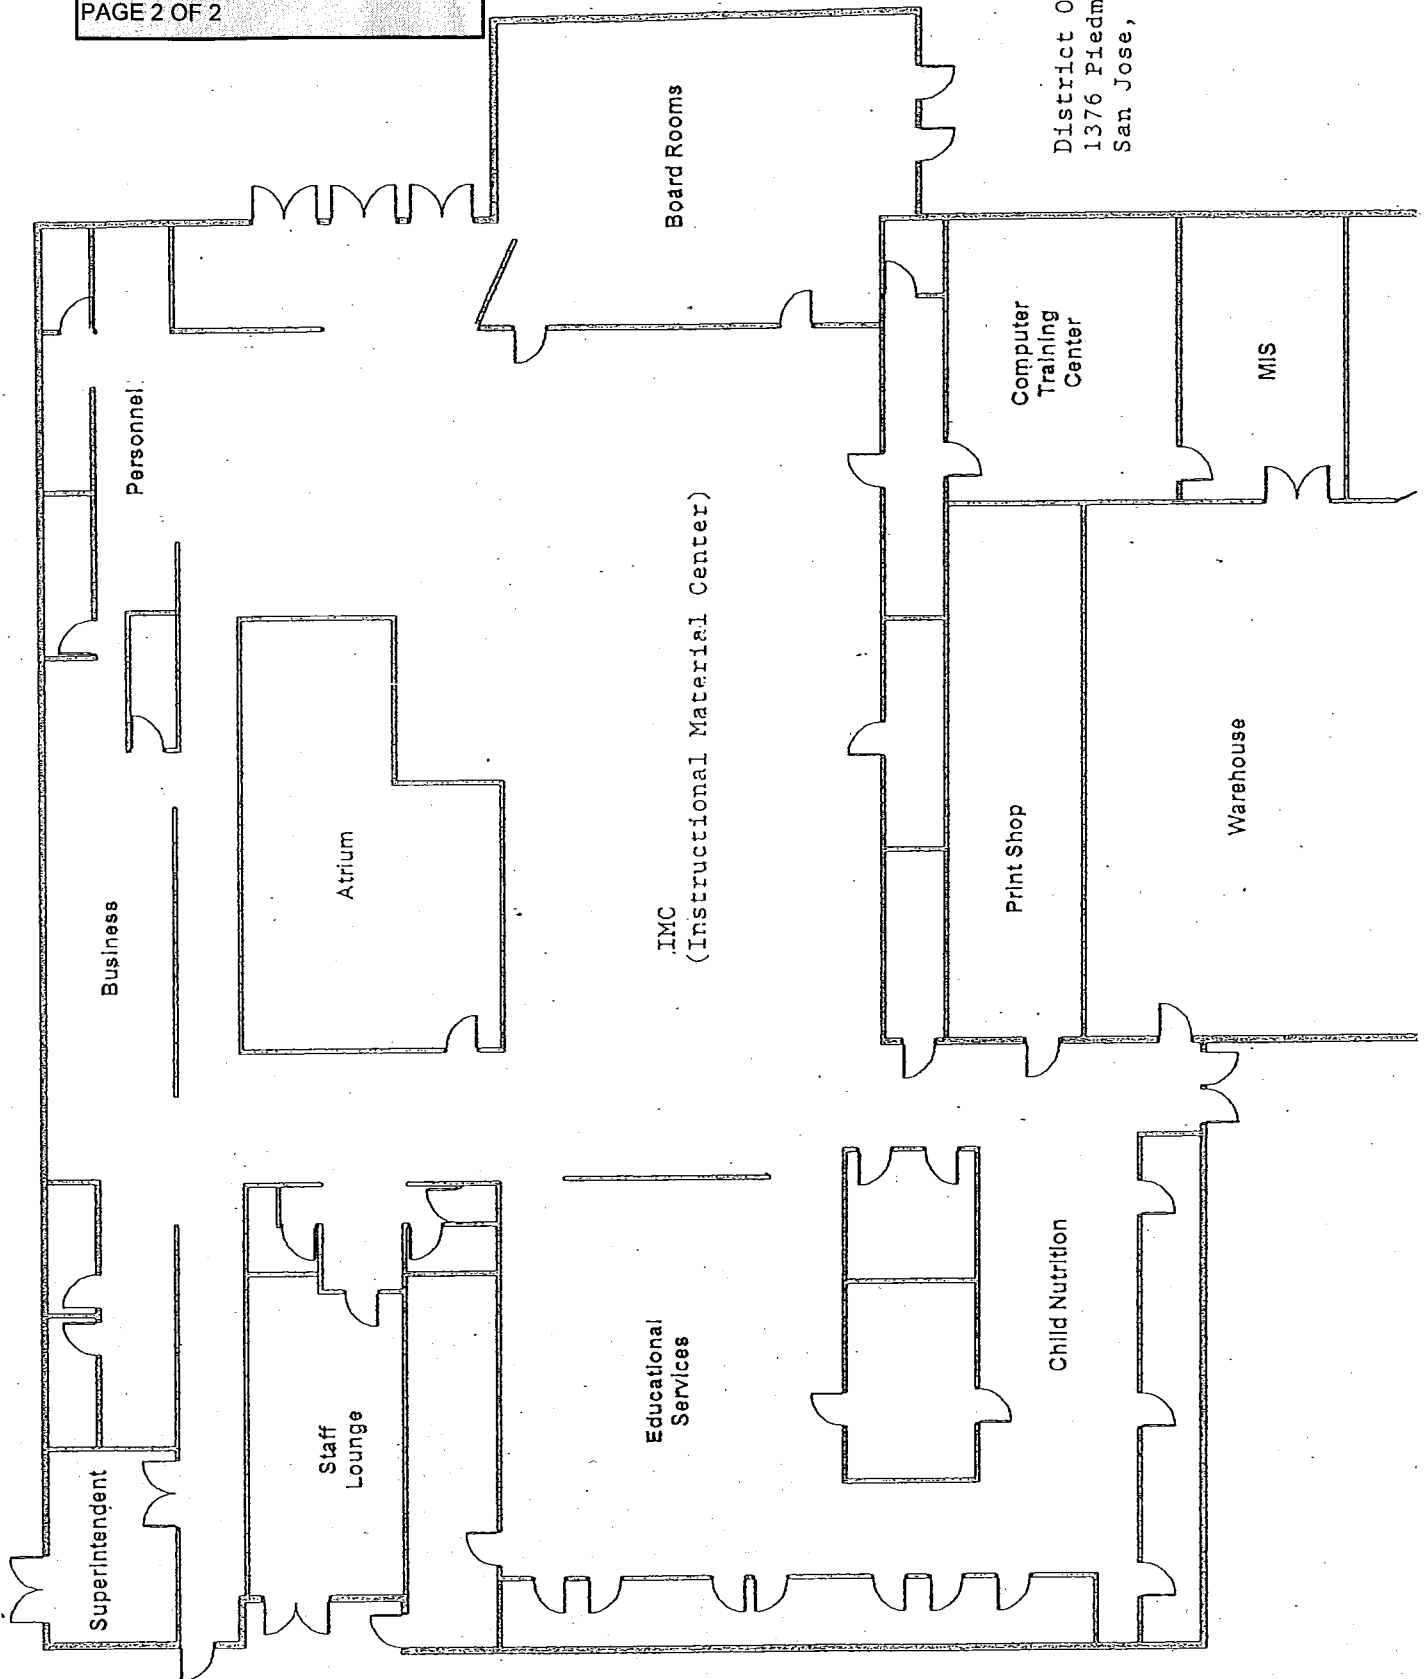


District Office
1376 Piedmont Rd.
San Jose, Ca. 95132

BUESD DISTRICT OFFICES

PAGE 1 OF 2

INSPECTED ON: 2/13/88

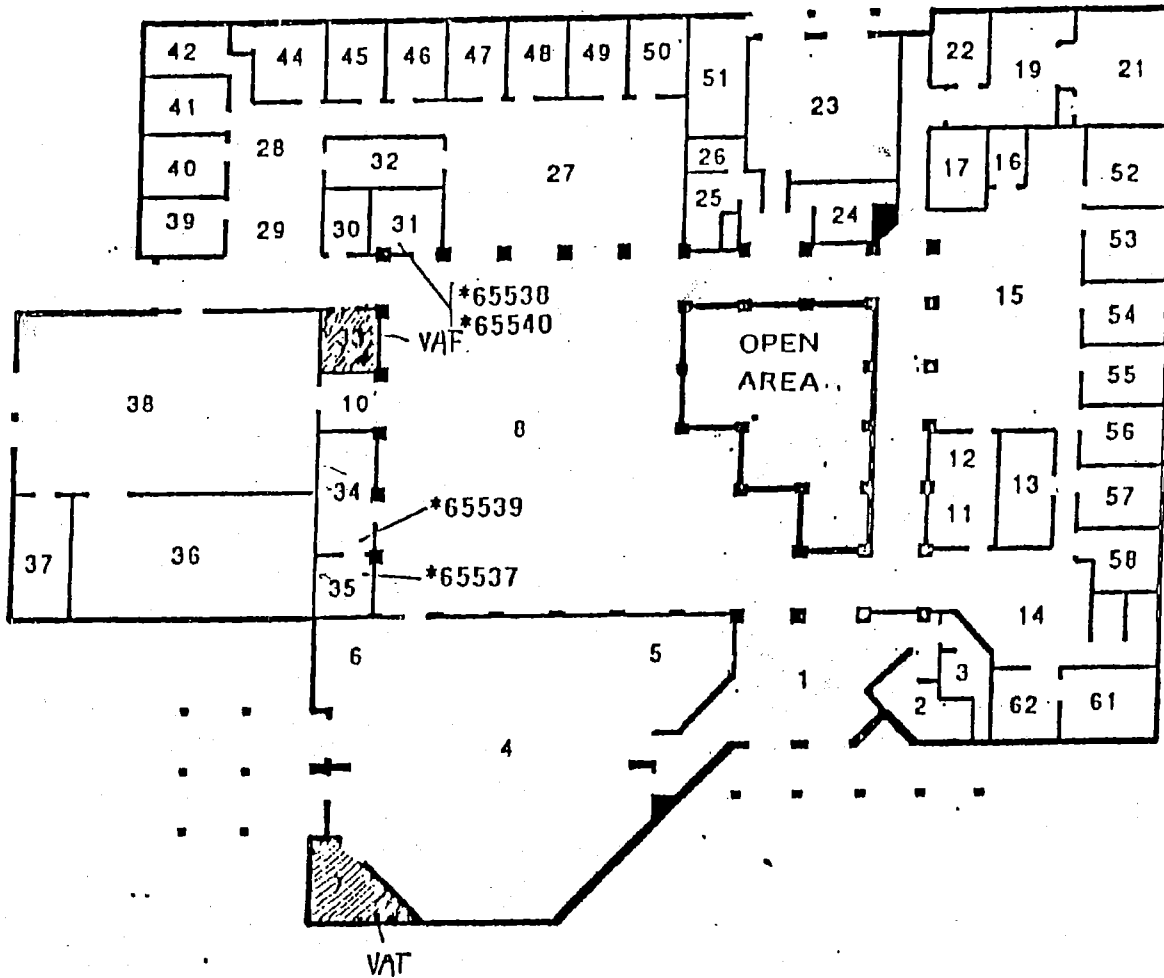

NORTH

0 10 25 50 100

SCALE: 1/30" = 1'-0"

BUSD


BERRYESSA UNION SCHOOL DISTRICT

DISTRICT OFFICE

1376 Piedmont Road

San Jose, CA

FIGURE #1

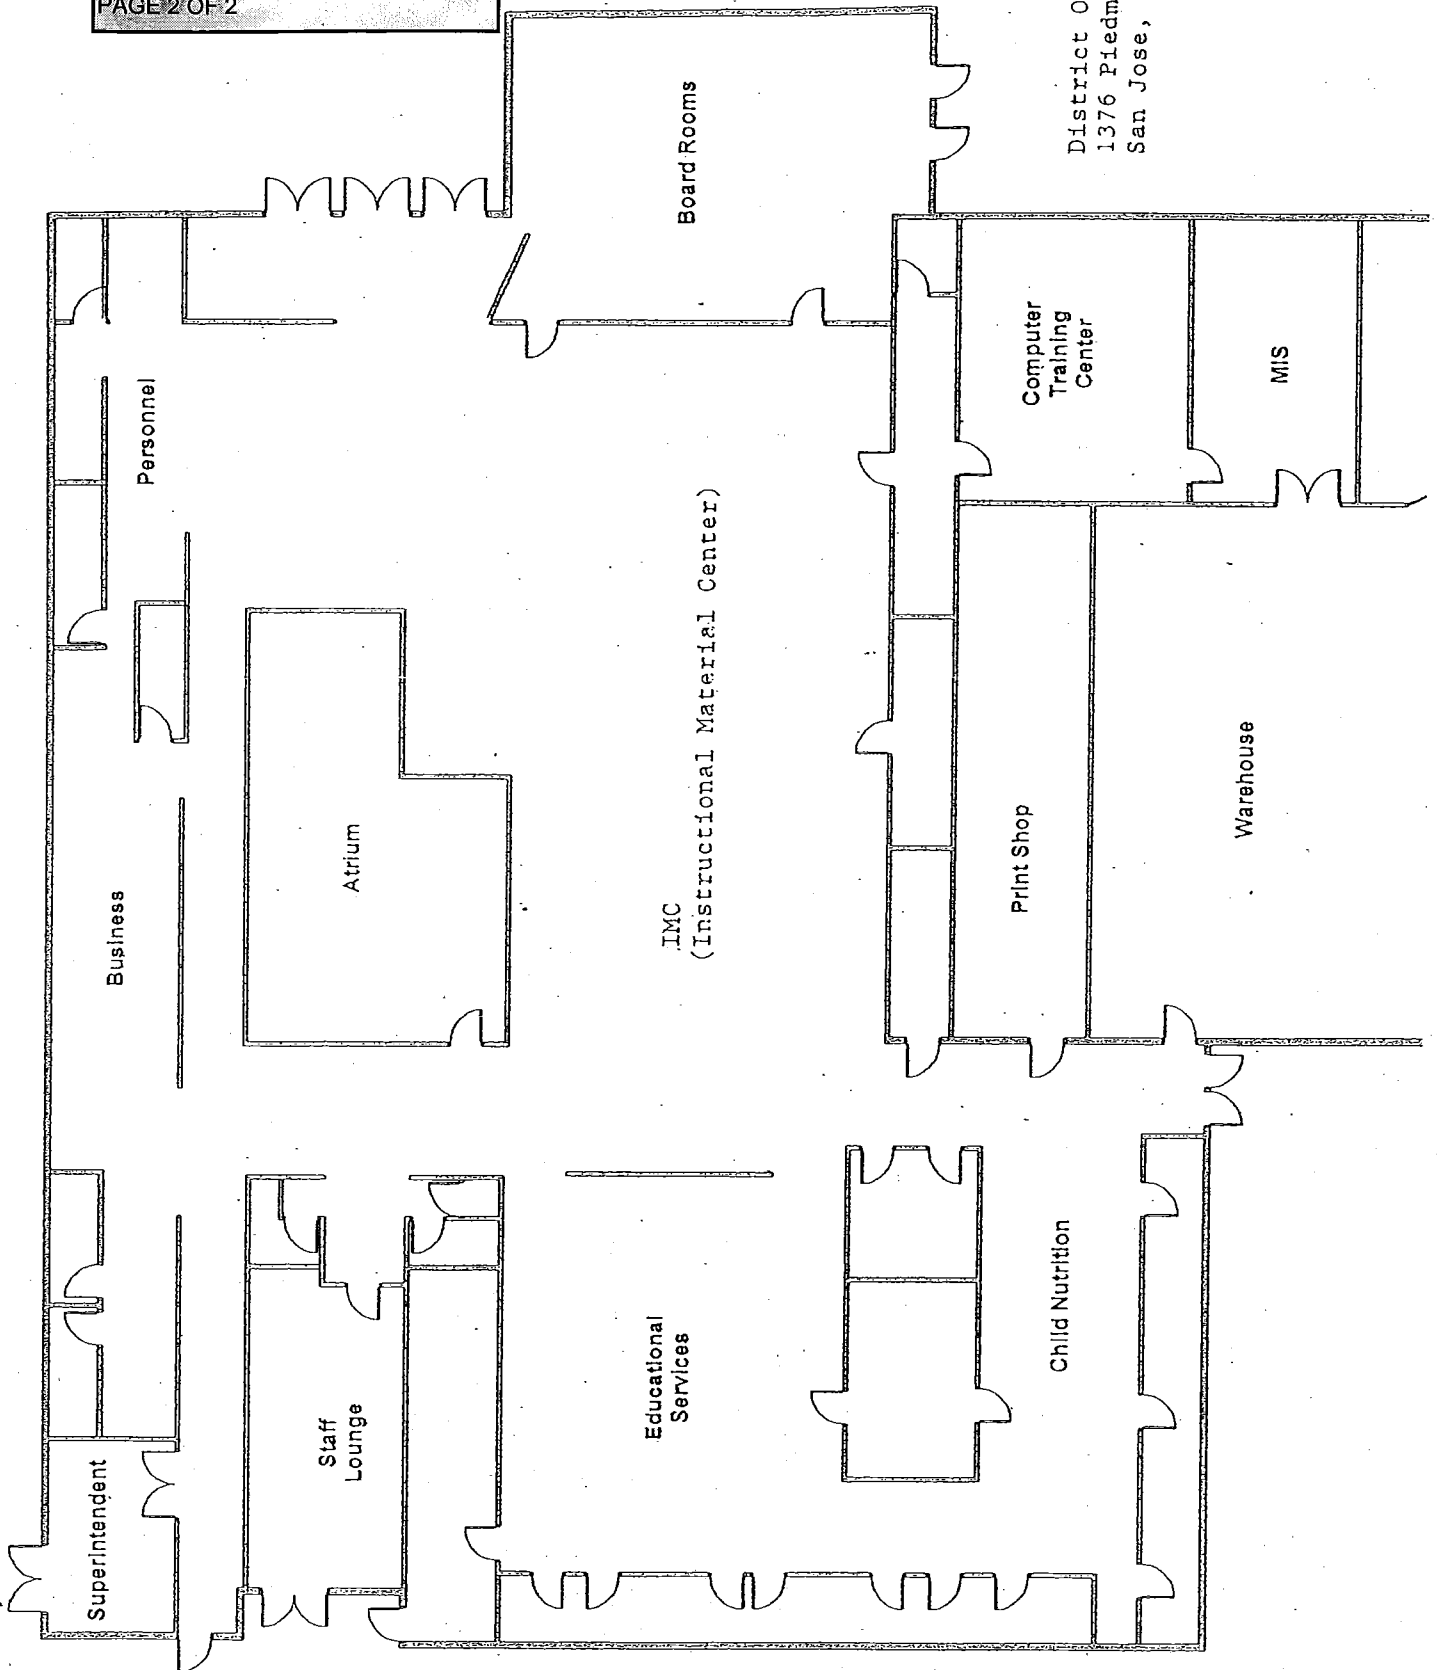

District Office
1376 Piedmont Rd.
San Jose, Ca. 95132

BUESD DISTRICT OFFICES


PAGE 1 OF 2

INSPECTED ON:

8/28/17



Metal Container

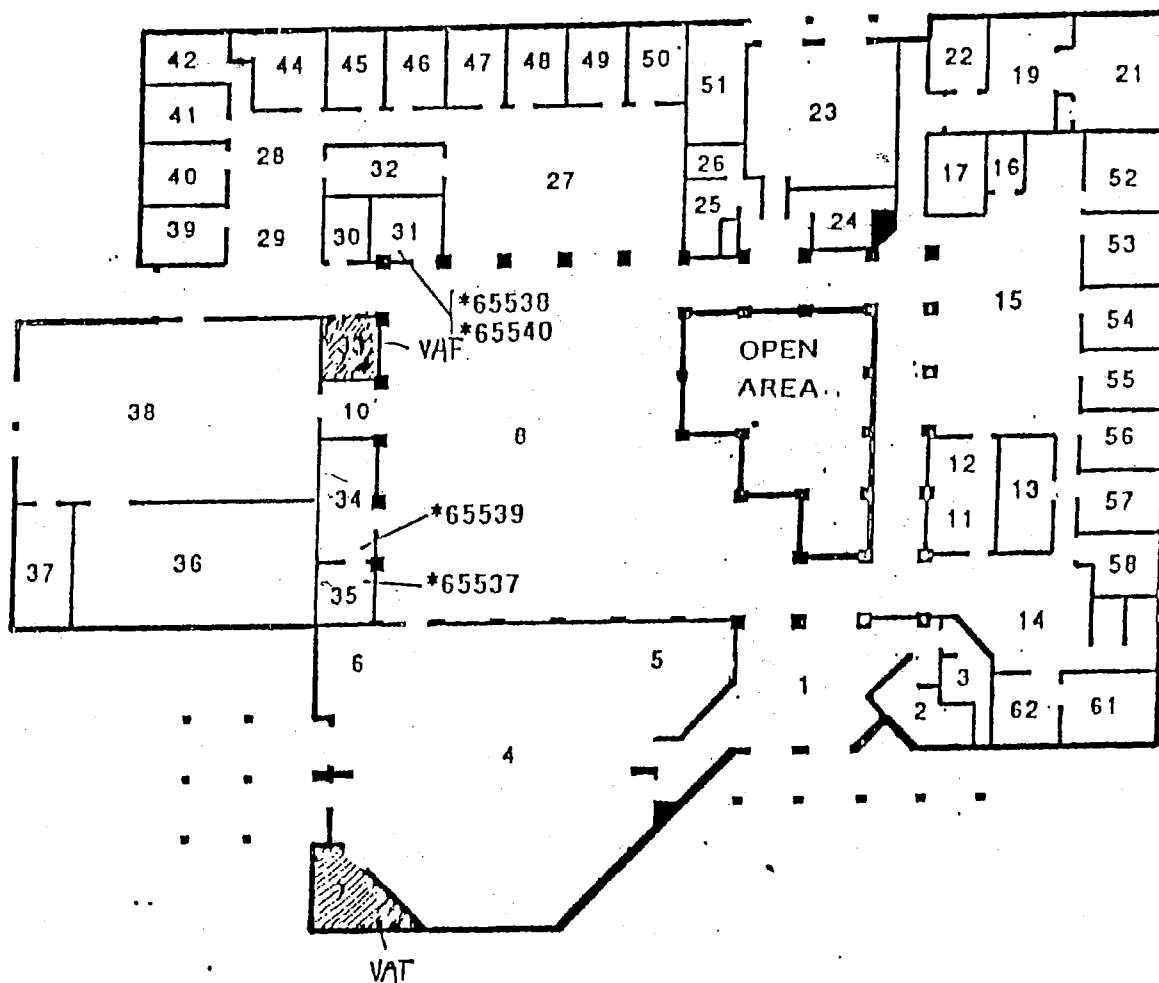

BUSD

BERRYESSA UNION SCHOOL DISTRICT


DISTRICT OFFICE

1376 Piedmont Road

San Jose, CA

FIGURE #1




District Office
1376 Piedmont Rd.
San Jose, Ca. 95132

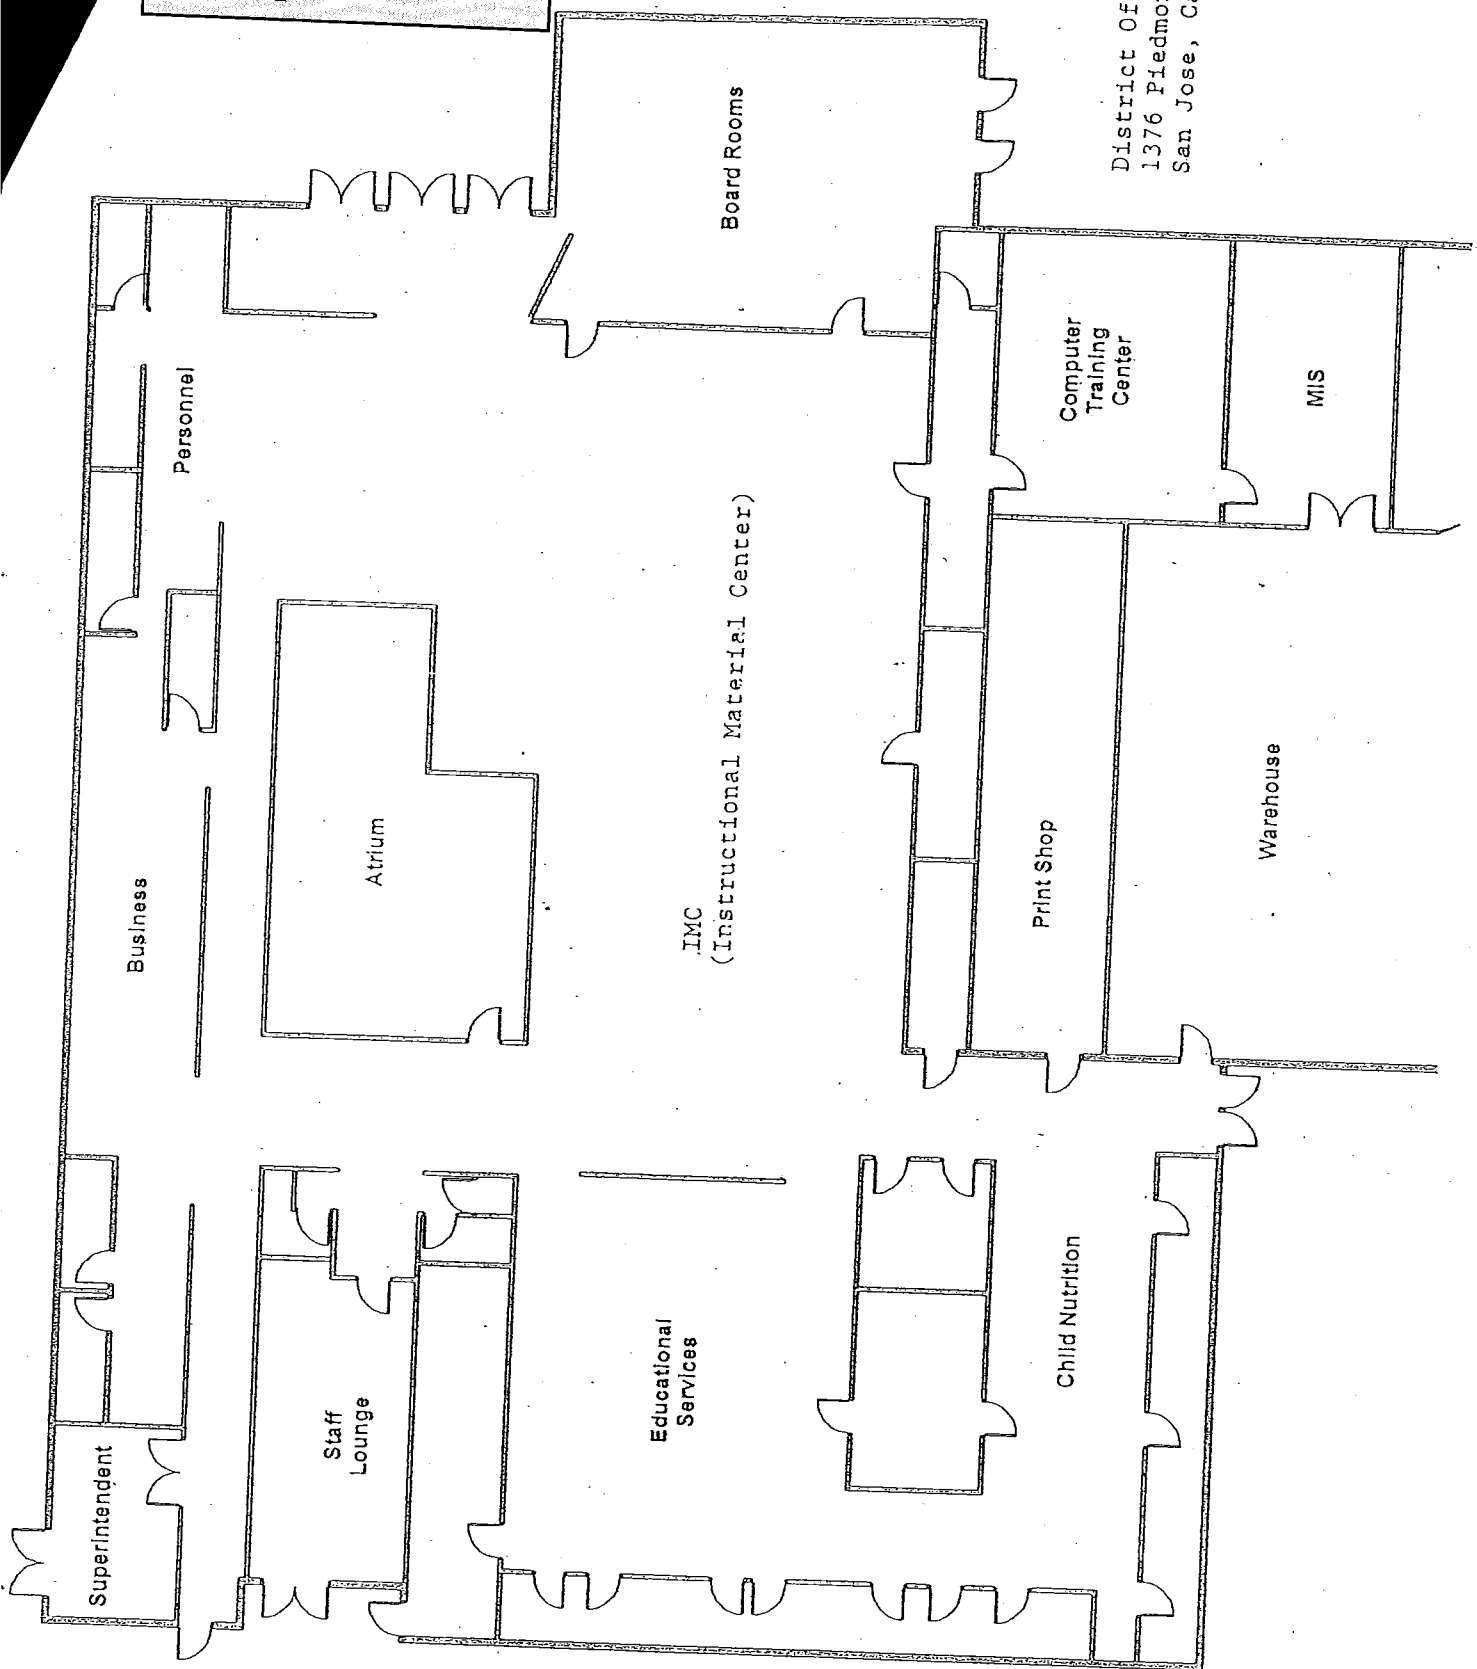

BUESD DISTRICT OFFICES

PAGE 1 OF 2

INSPECTED ON: 3/28/17

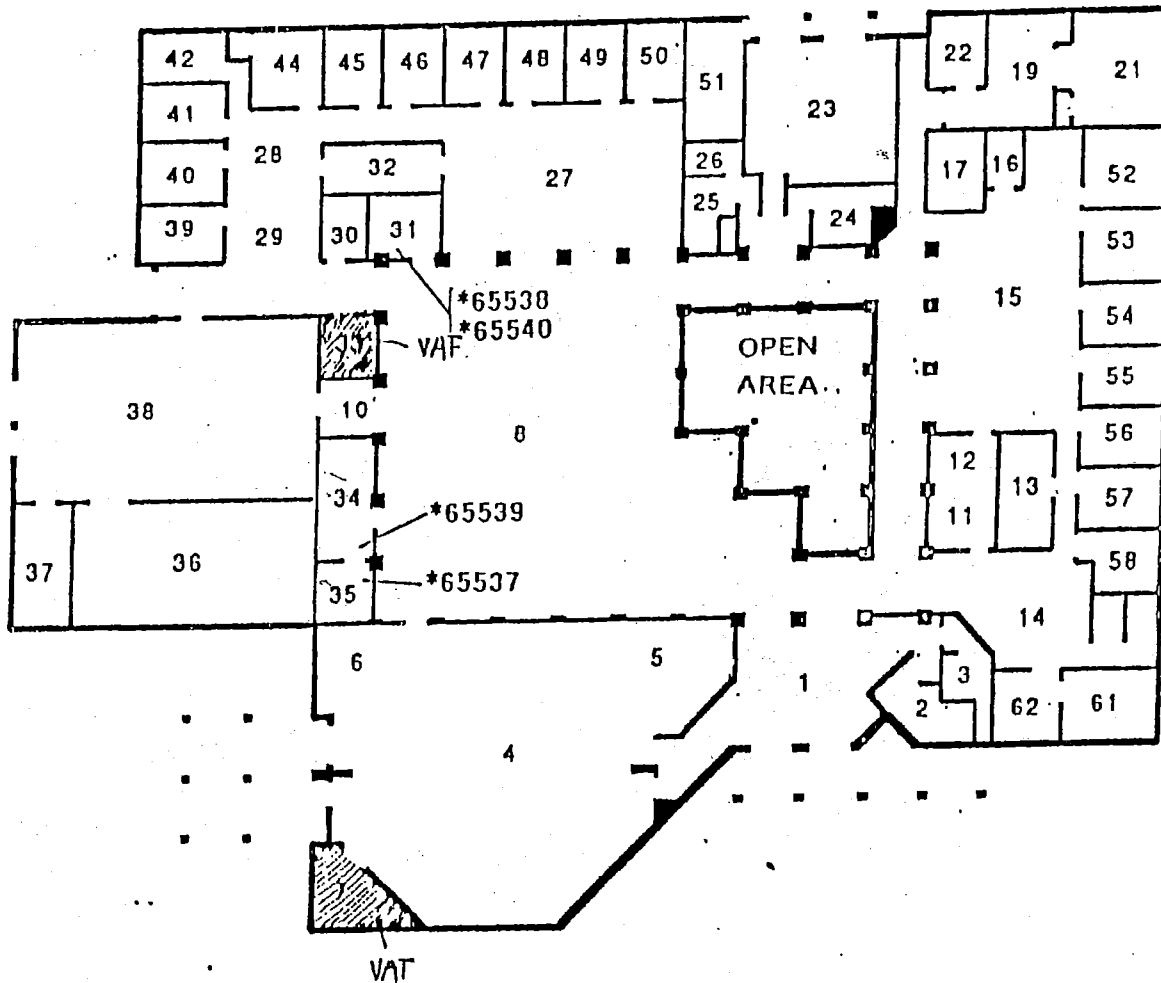


SCALE: 1/30" = 1'-0"

BUSD

BERRYESSA UNION SCHOOL DISTRICT

DISTRICT OFFICE
1376 Piedmont Road
San Jose, CA

FIGURE #1


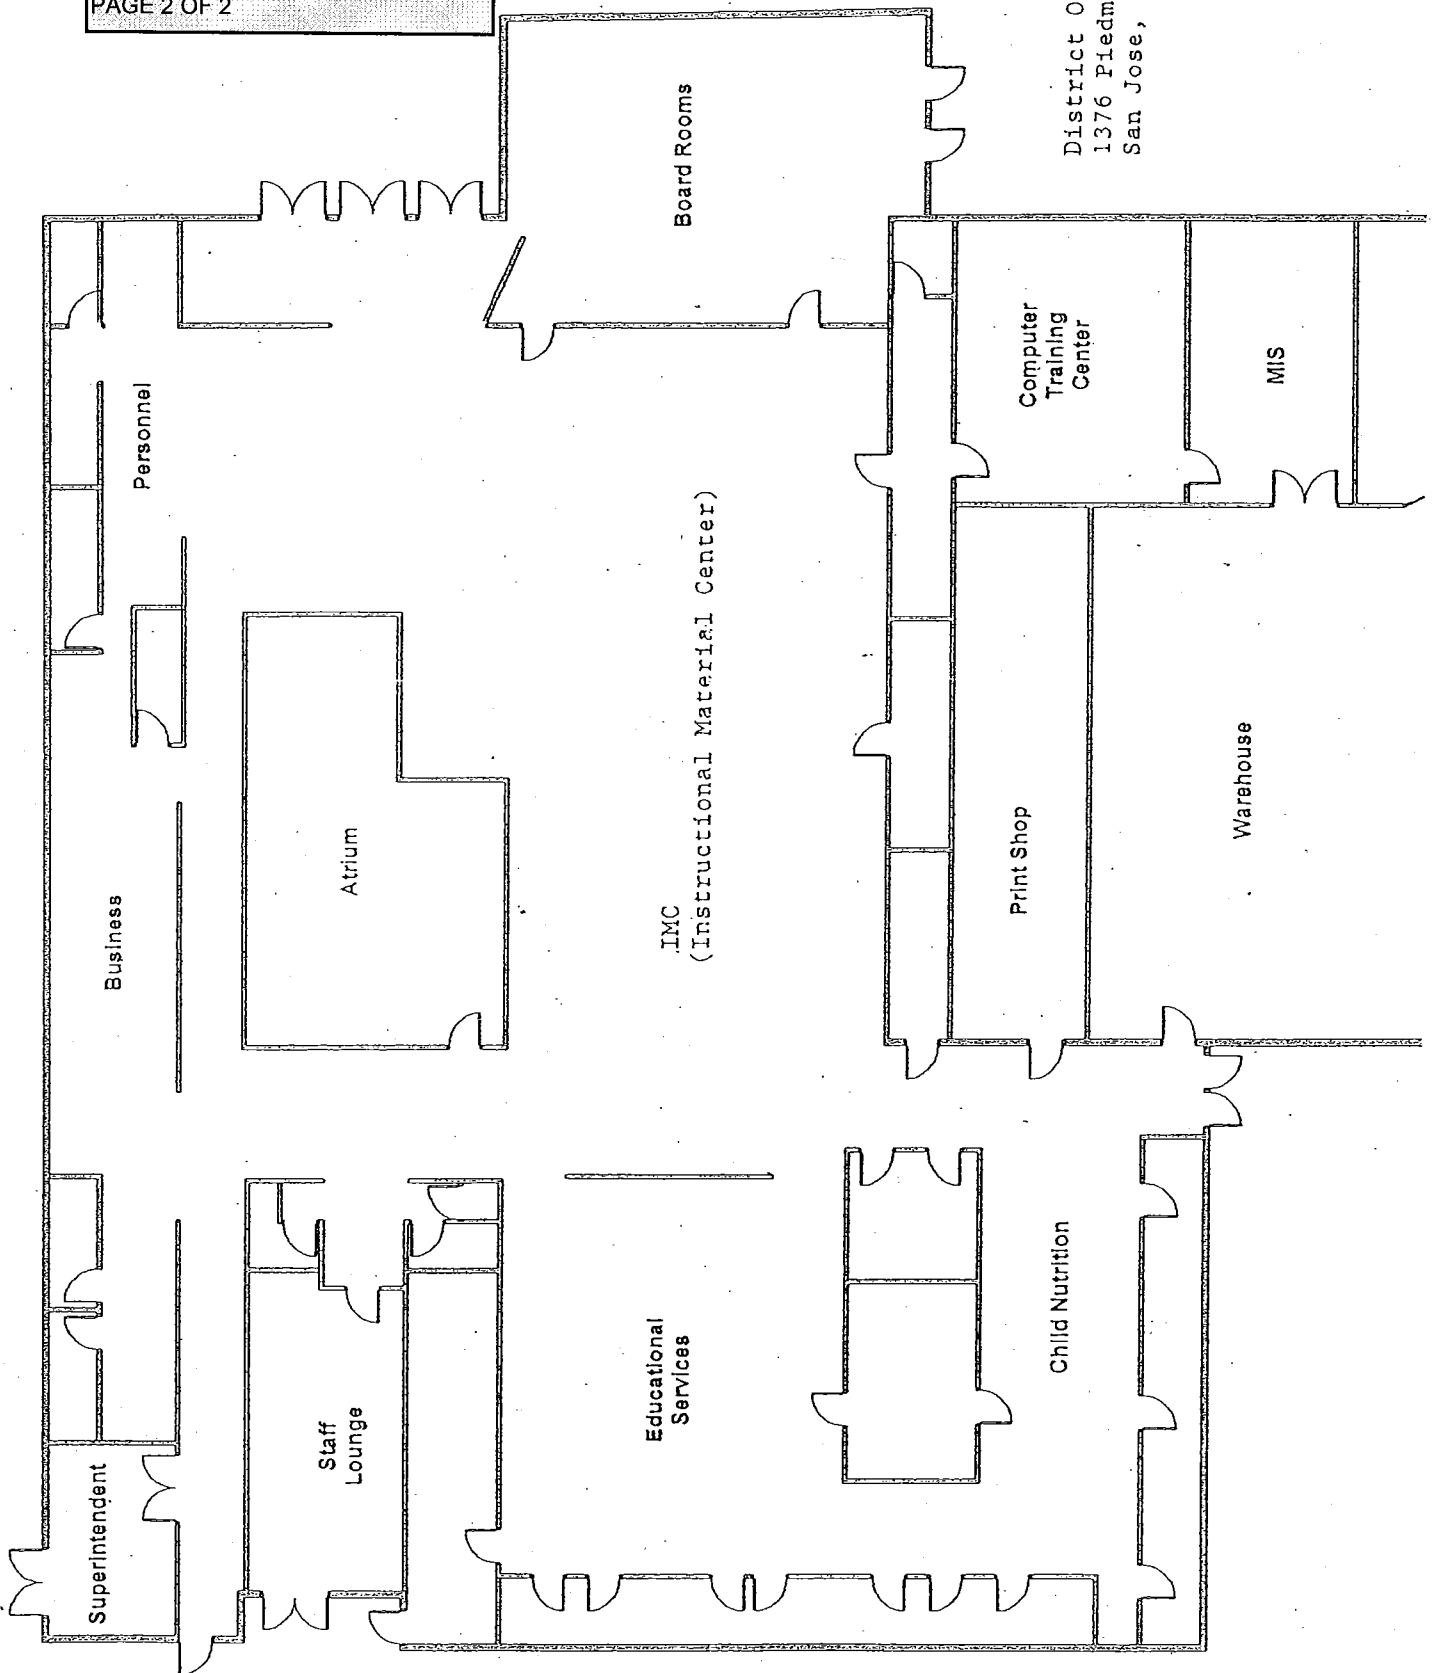


District Office
1376 Piedmont Rd.
San Jose, Ca. 95132

BUESD DISTRICT OFFICES

PAGE 1 OF 2

INSPECTED ON: 9-12-16

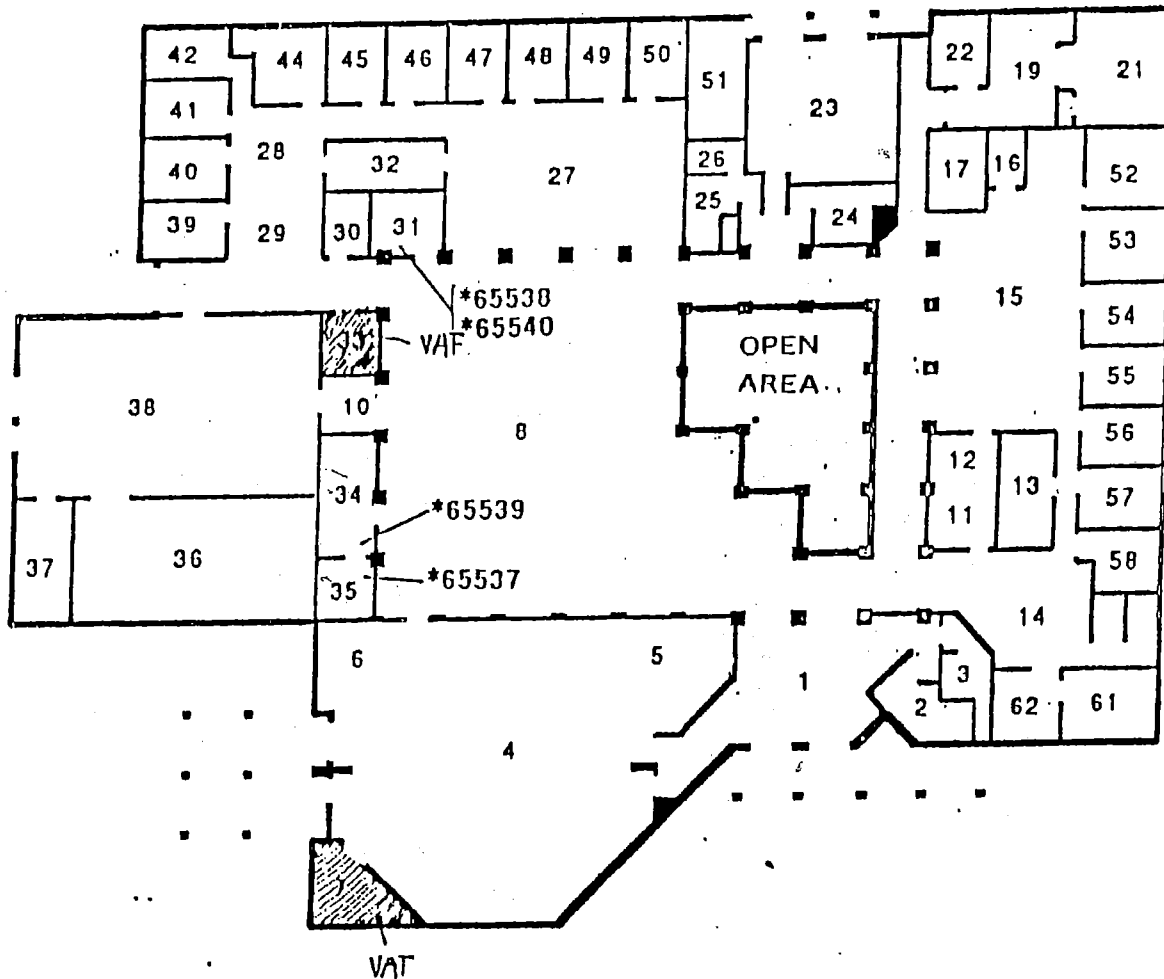

0 10 25 50 100

SCALE: 1/30" = 1'-0"

BUSD


BERRYESSA UNION SCHOOL DISTRICT




DISTRICT OFFICE
1376 Piedmont Road
San Jose, CA

FIGURE #1

BUESD DISTRICT OFFICES
PAGE 2 OF 2

District Office
1376 Piedmont Rd.
San Jose, Ca. 95132

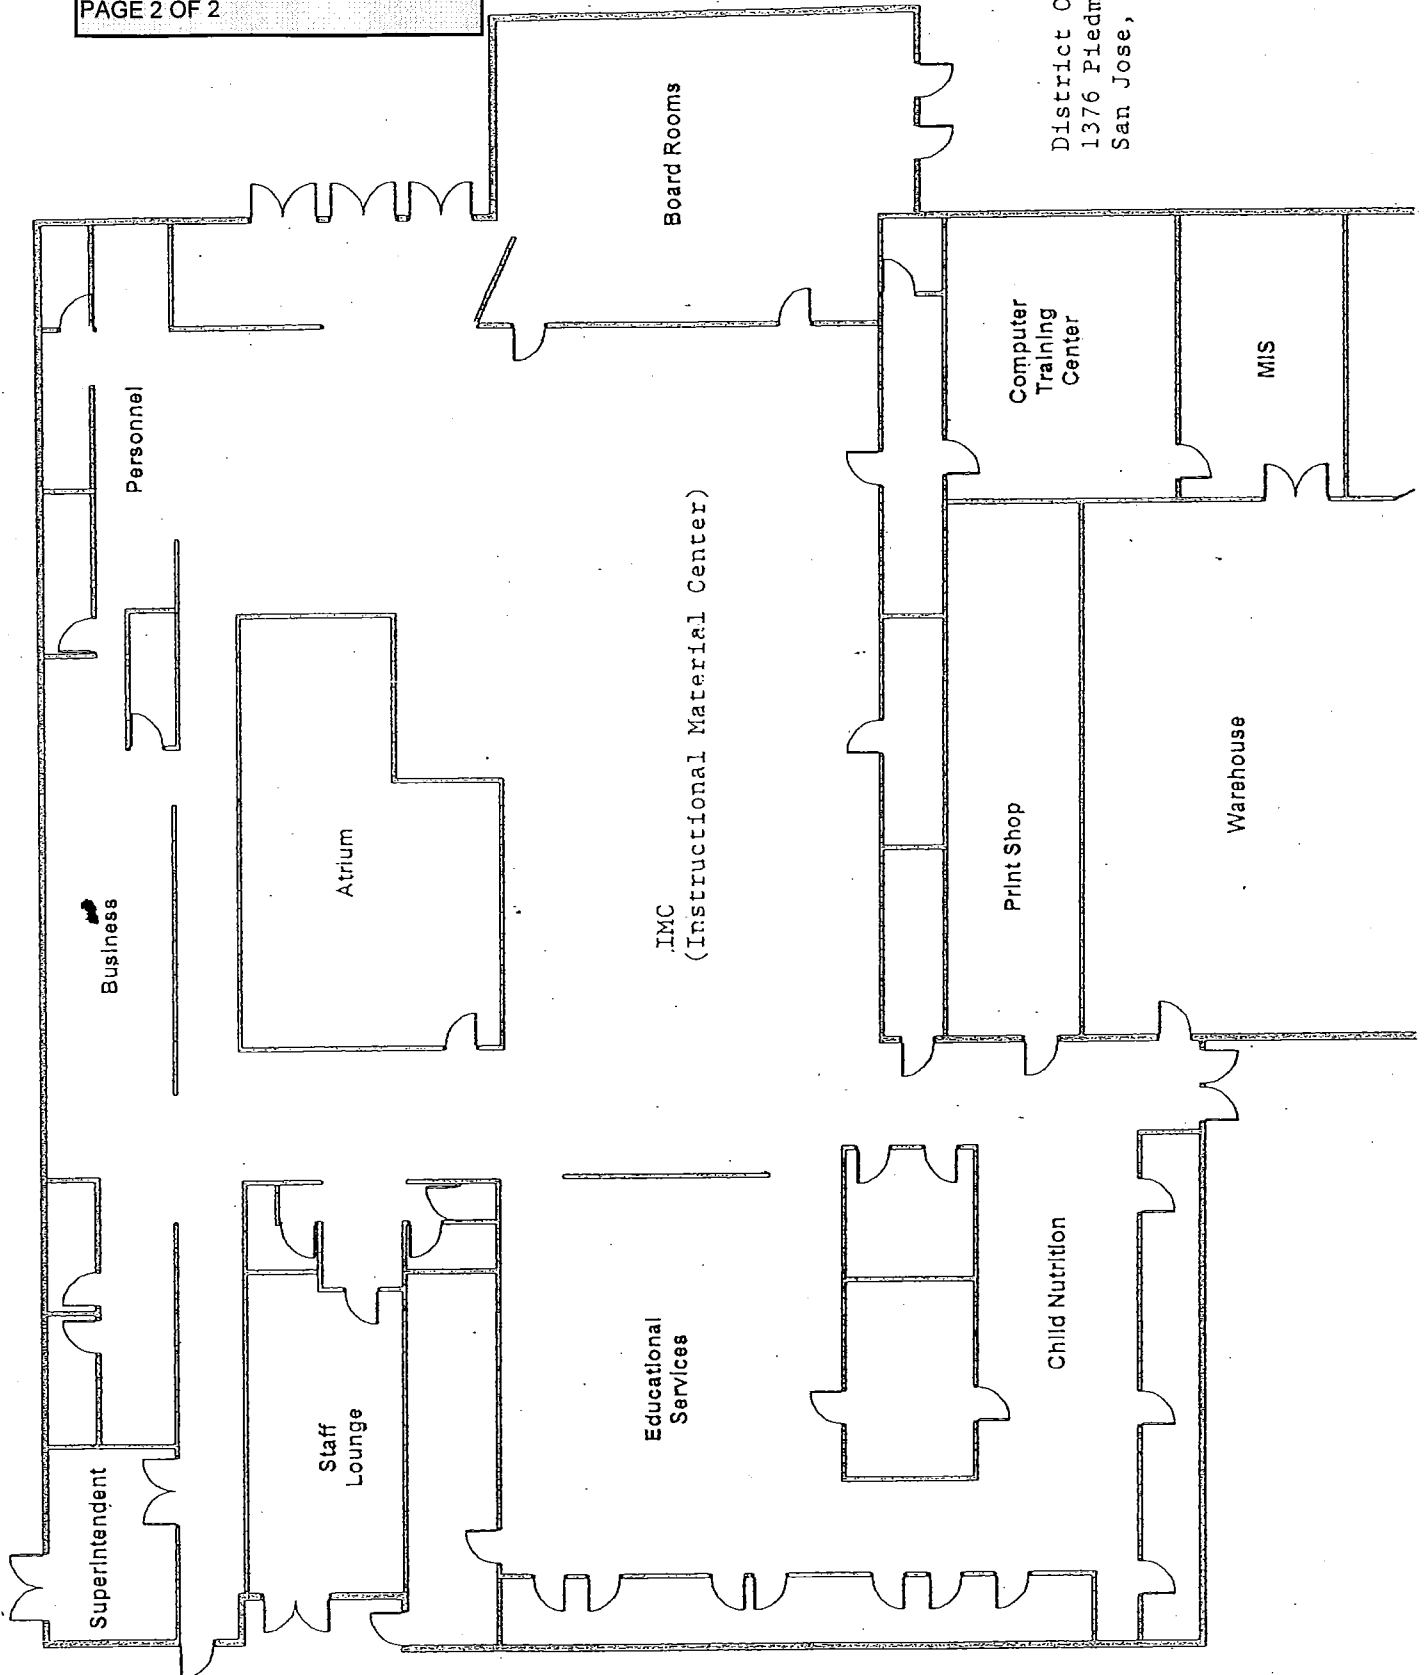

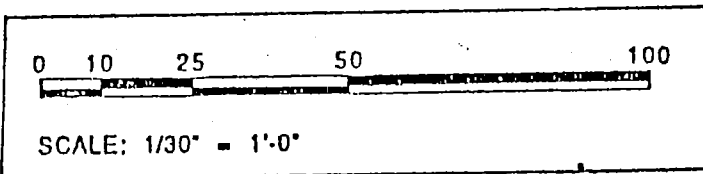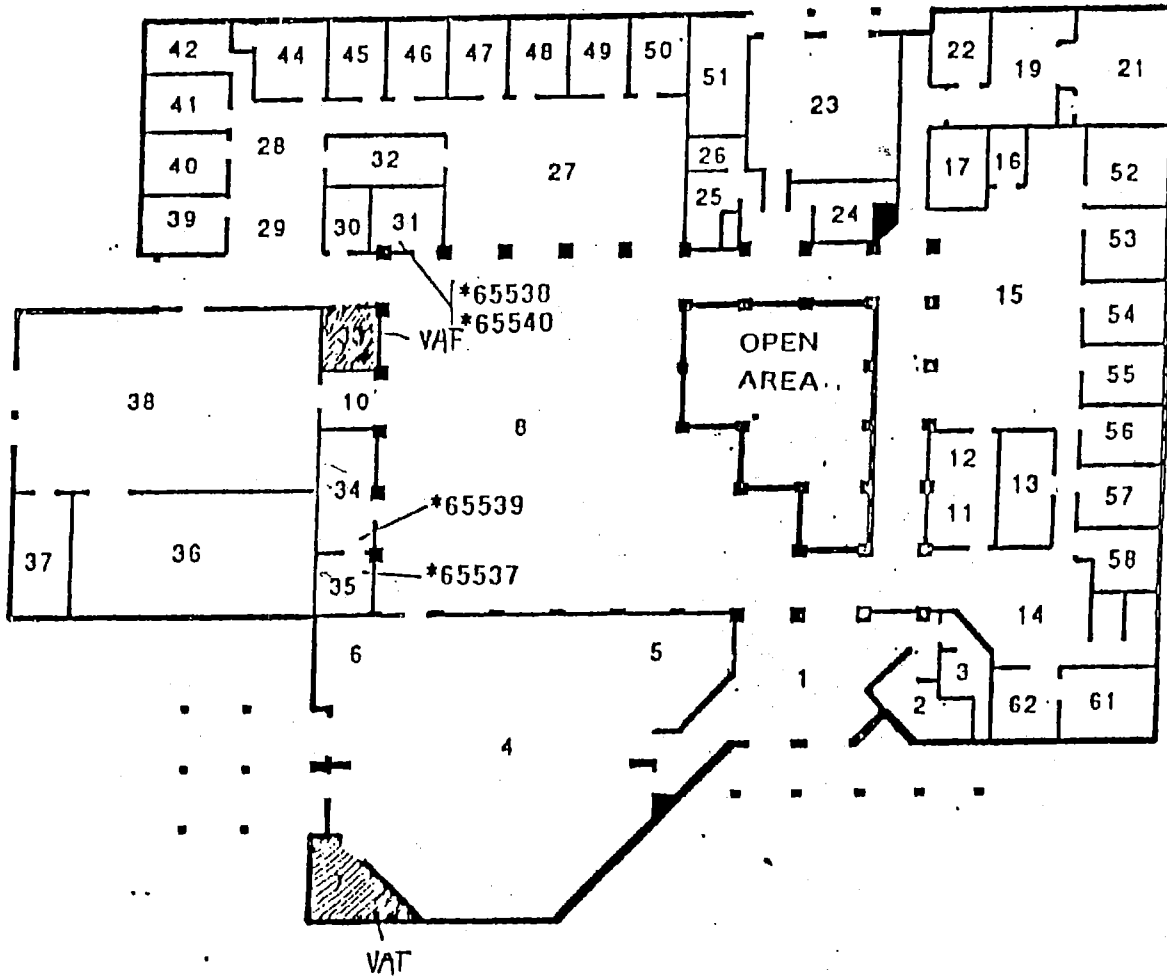


BUSD

BERRYESSA UNION SCHOOL DISTRICT

DISTRICT OFFICE
 1376 Piedmont Road
 San Jose, CA

FIGURE #1

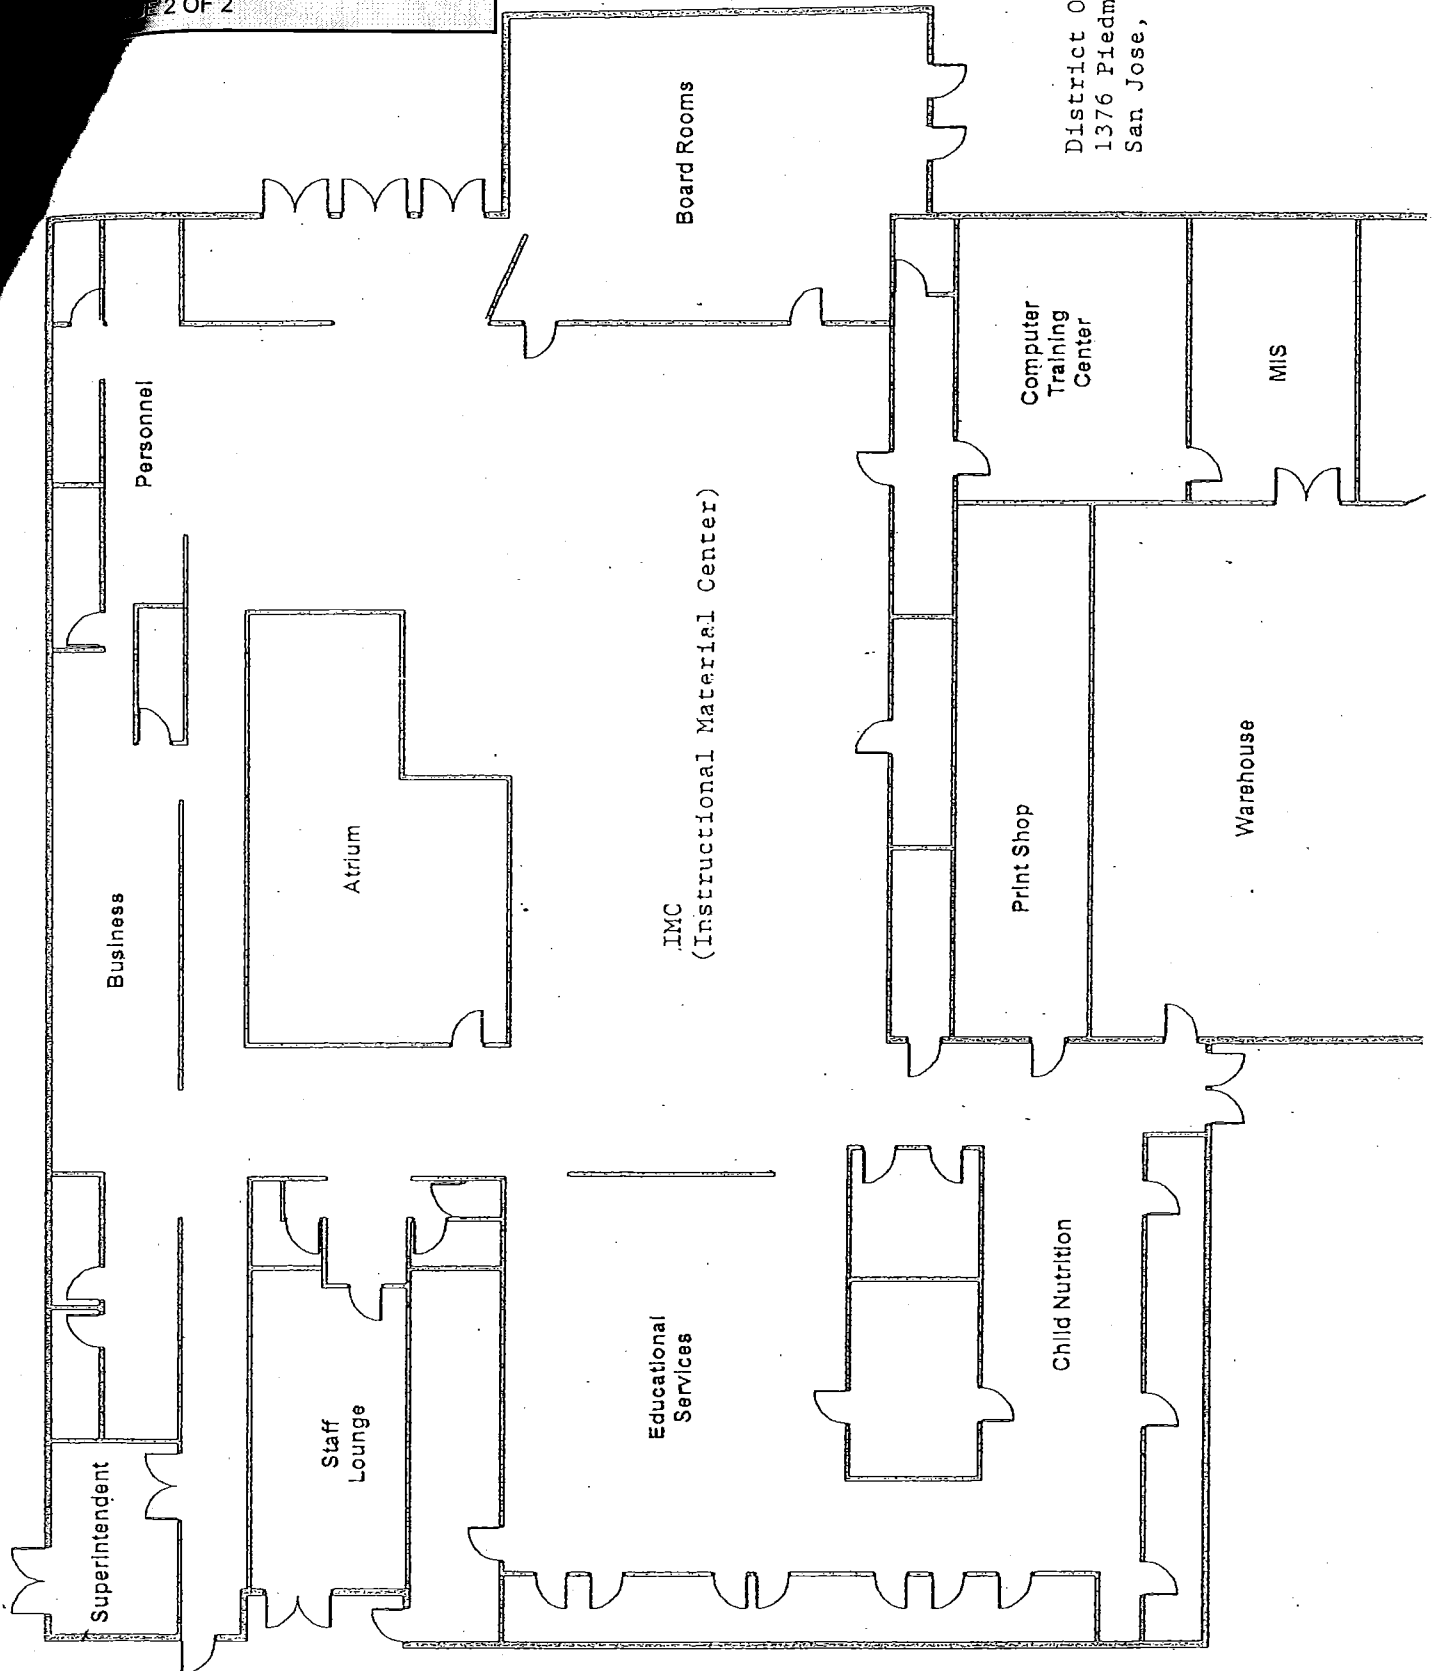

District Office
1376 Piedmont Rd.
San Jose, Ca. 95132

BUESD DISTRICT OFFICES


PAGE 1 OF 2

INSPECTED ON:

1/17/85



Metal Container

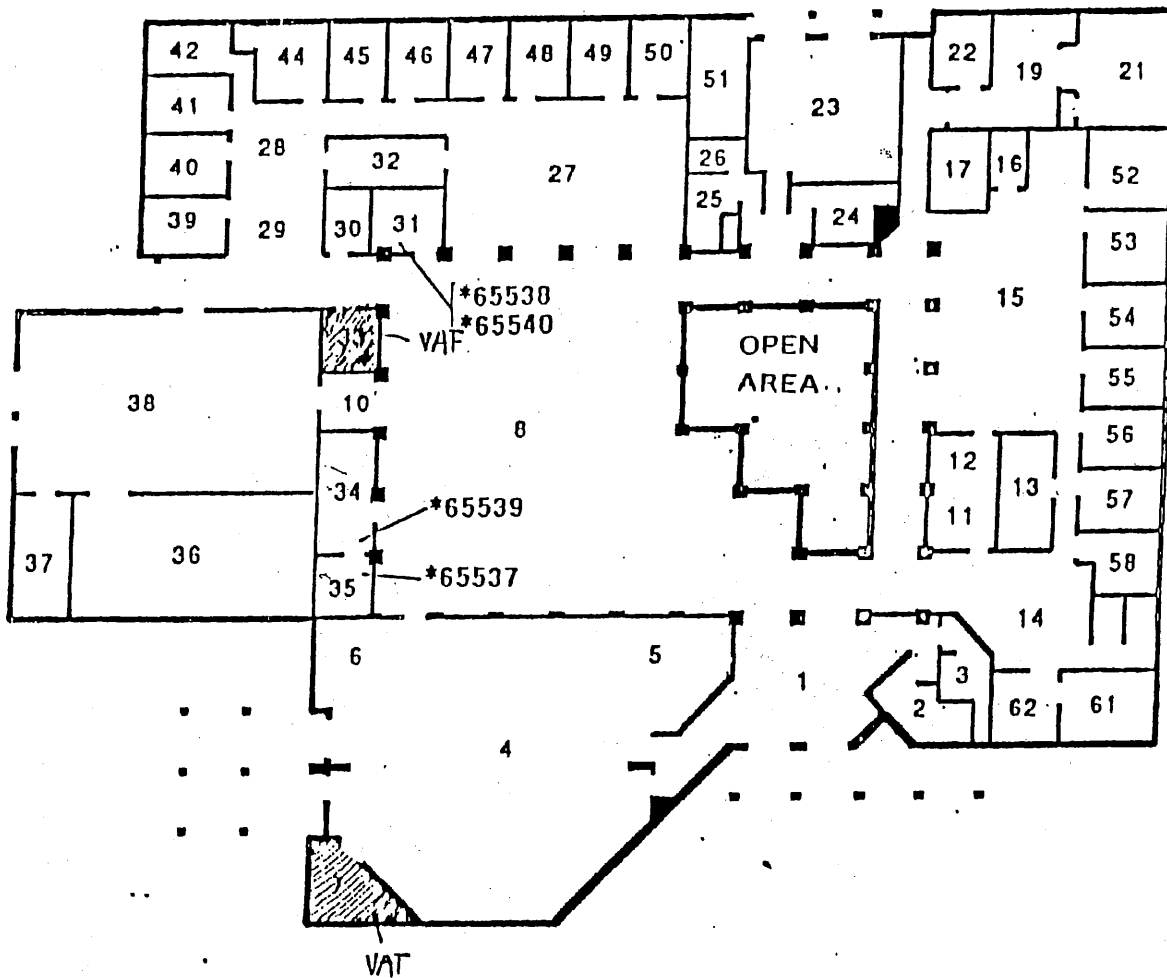

NORTH

0 10 25 50 100

SCALE: 1/30" = 1'-0"

BUSD


BERRYESSA UNION SCHOOL DISTRICT

DISTRICT OFFICE
1376 Piedmont Road
San Jose, CA

FIGURE #1

BUESD DISTRICT OFFICES
PAGE 2 OF 2
INSPECTED ON:



District Office
1376 Piedmont Rd.
San Jose, Ca. 95132

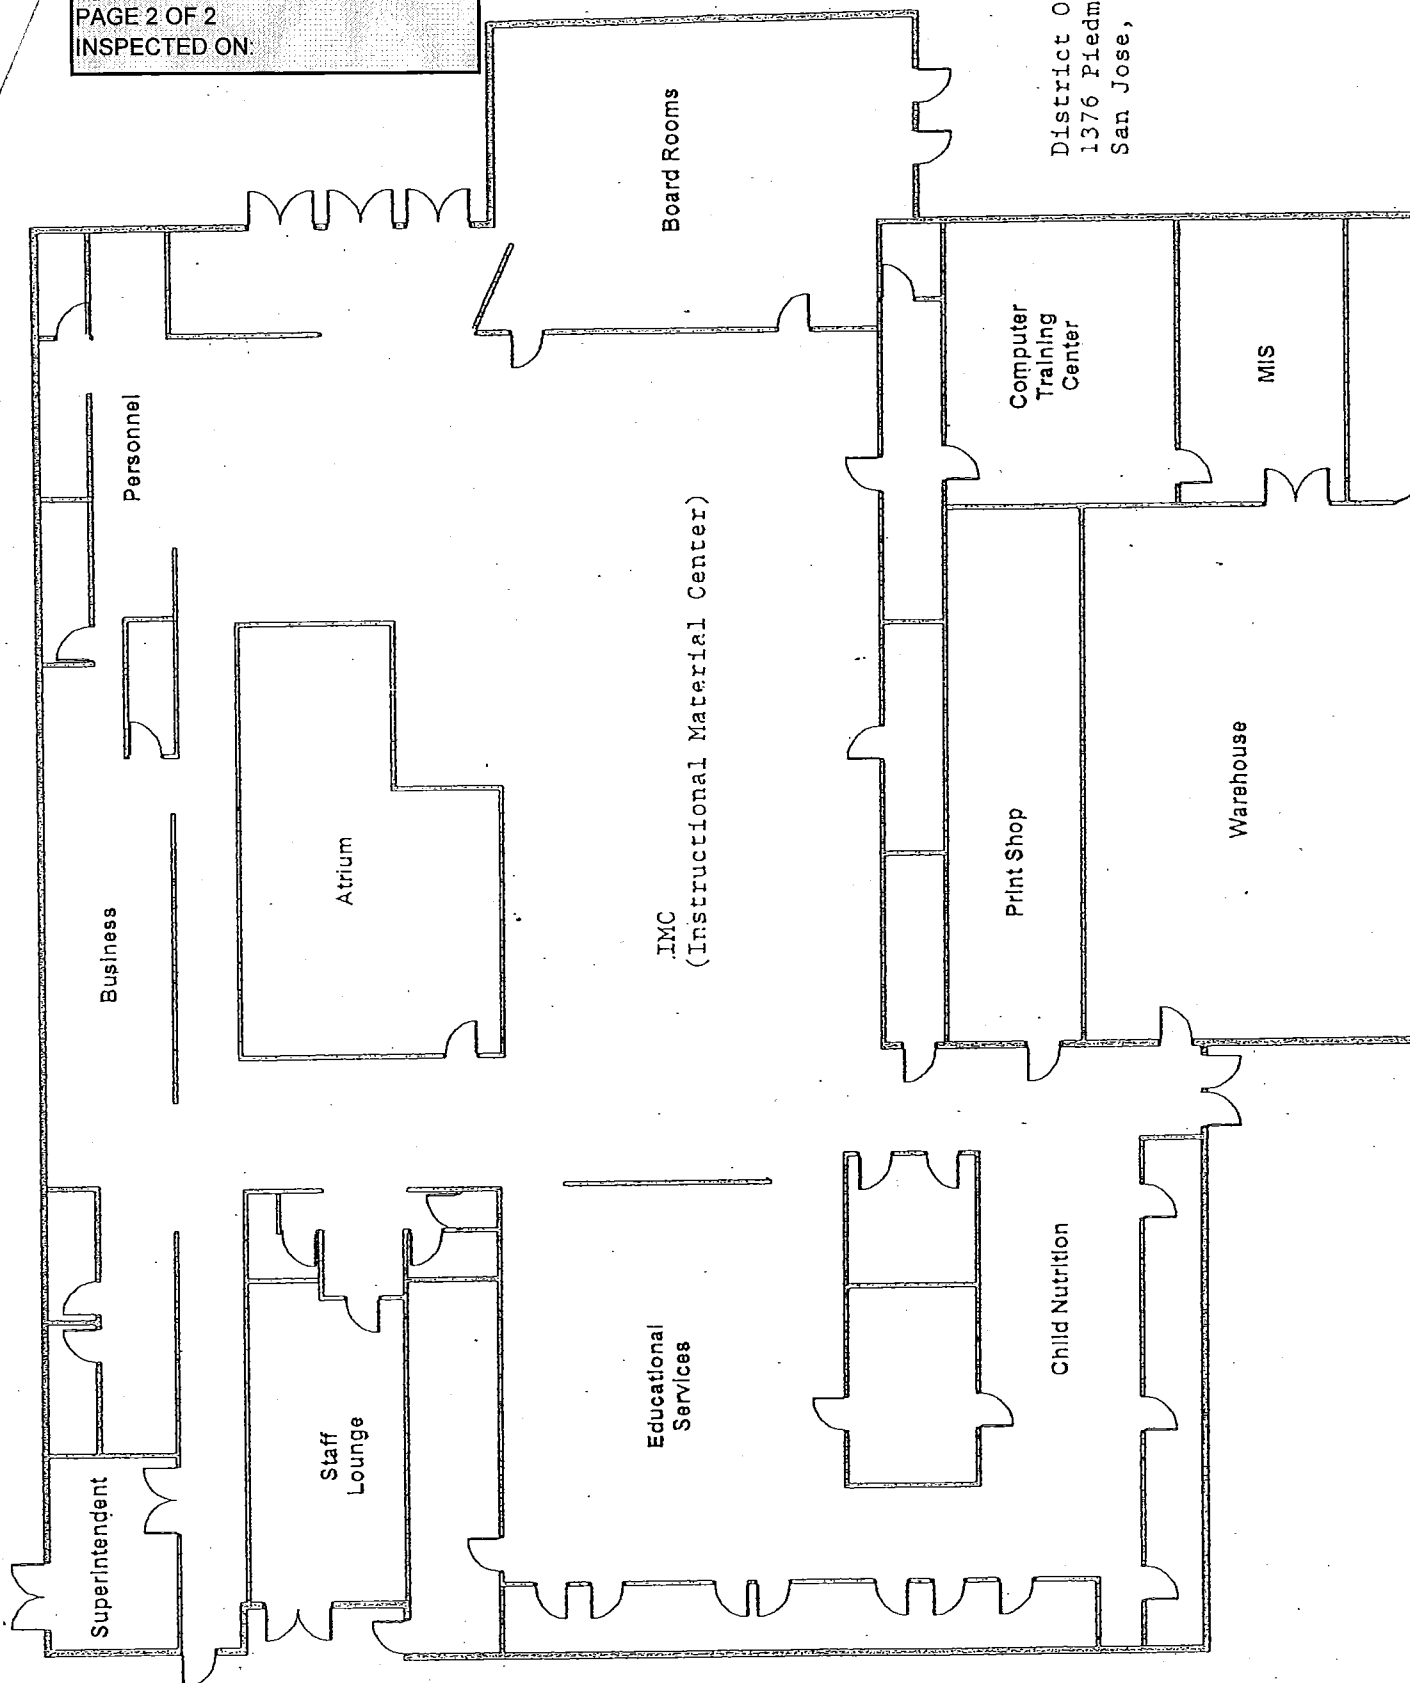

BUESD DISTRICT OFFICES

PAGE 1 OF 2

INSPECTED ON: 03-16-2015

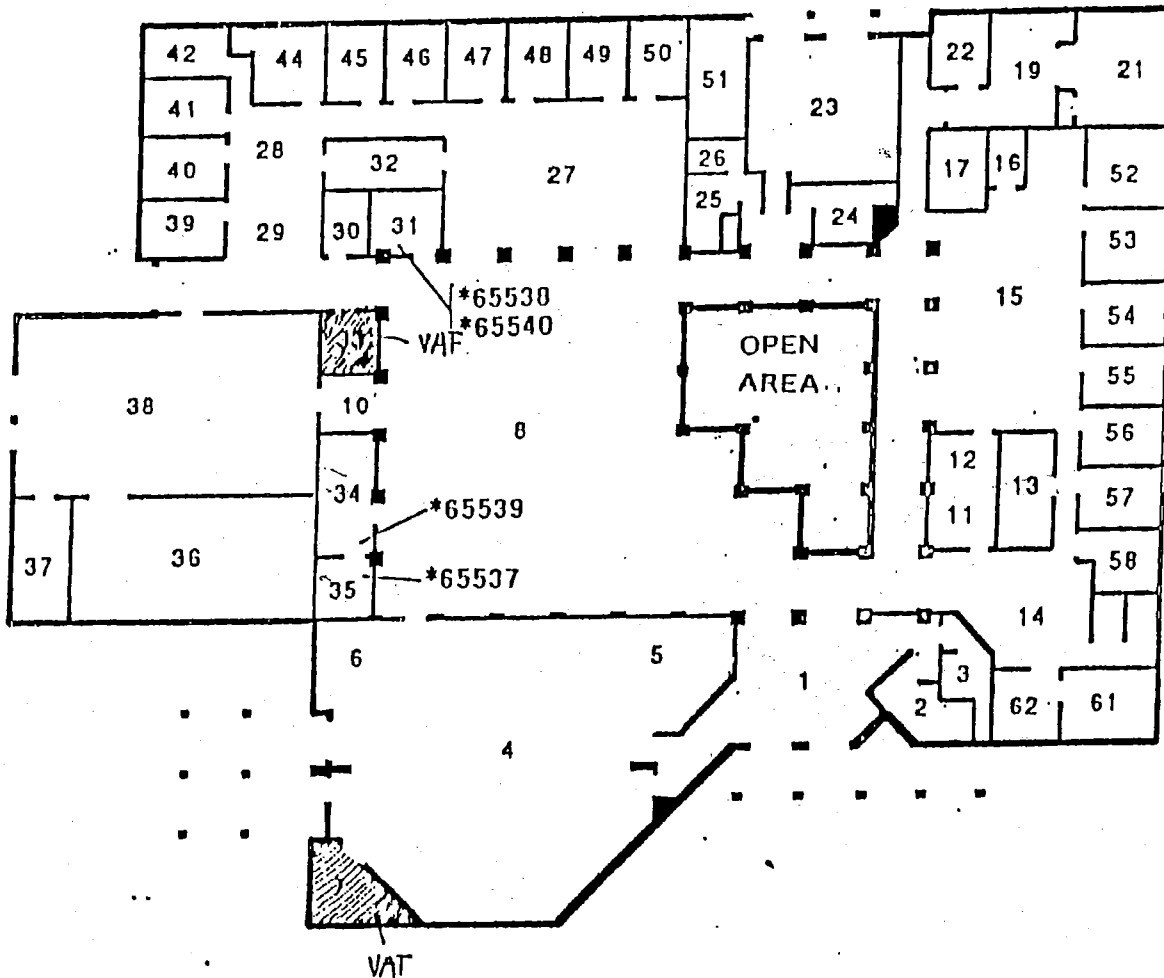

0 10 25 50 100

SCALE: 1/30" = 1'-0"

BUSD

BERRYESSA UNION SCHOOL DISTRICT

DISTRICT OFFICE


1376 Piedmont Road

San Jose, CA

FIGURE #1

BUESD DISTRICT OFFICES
PAGE 2 OF 2
INSPECTED ON:

District Office
1376 Piedmont Rd.
San Jose, Ca. 95132

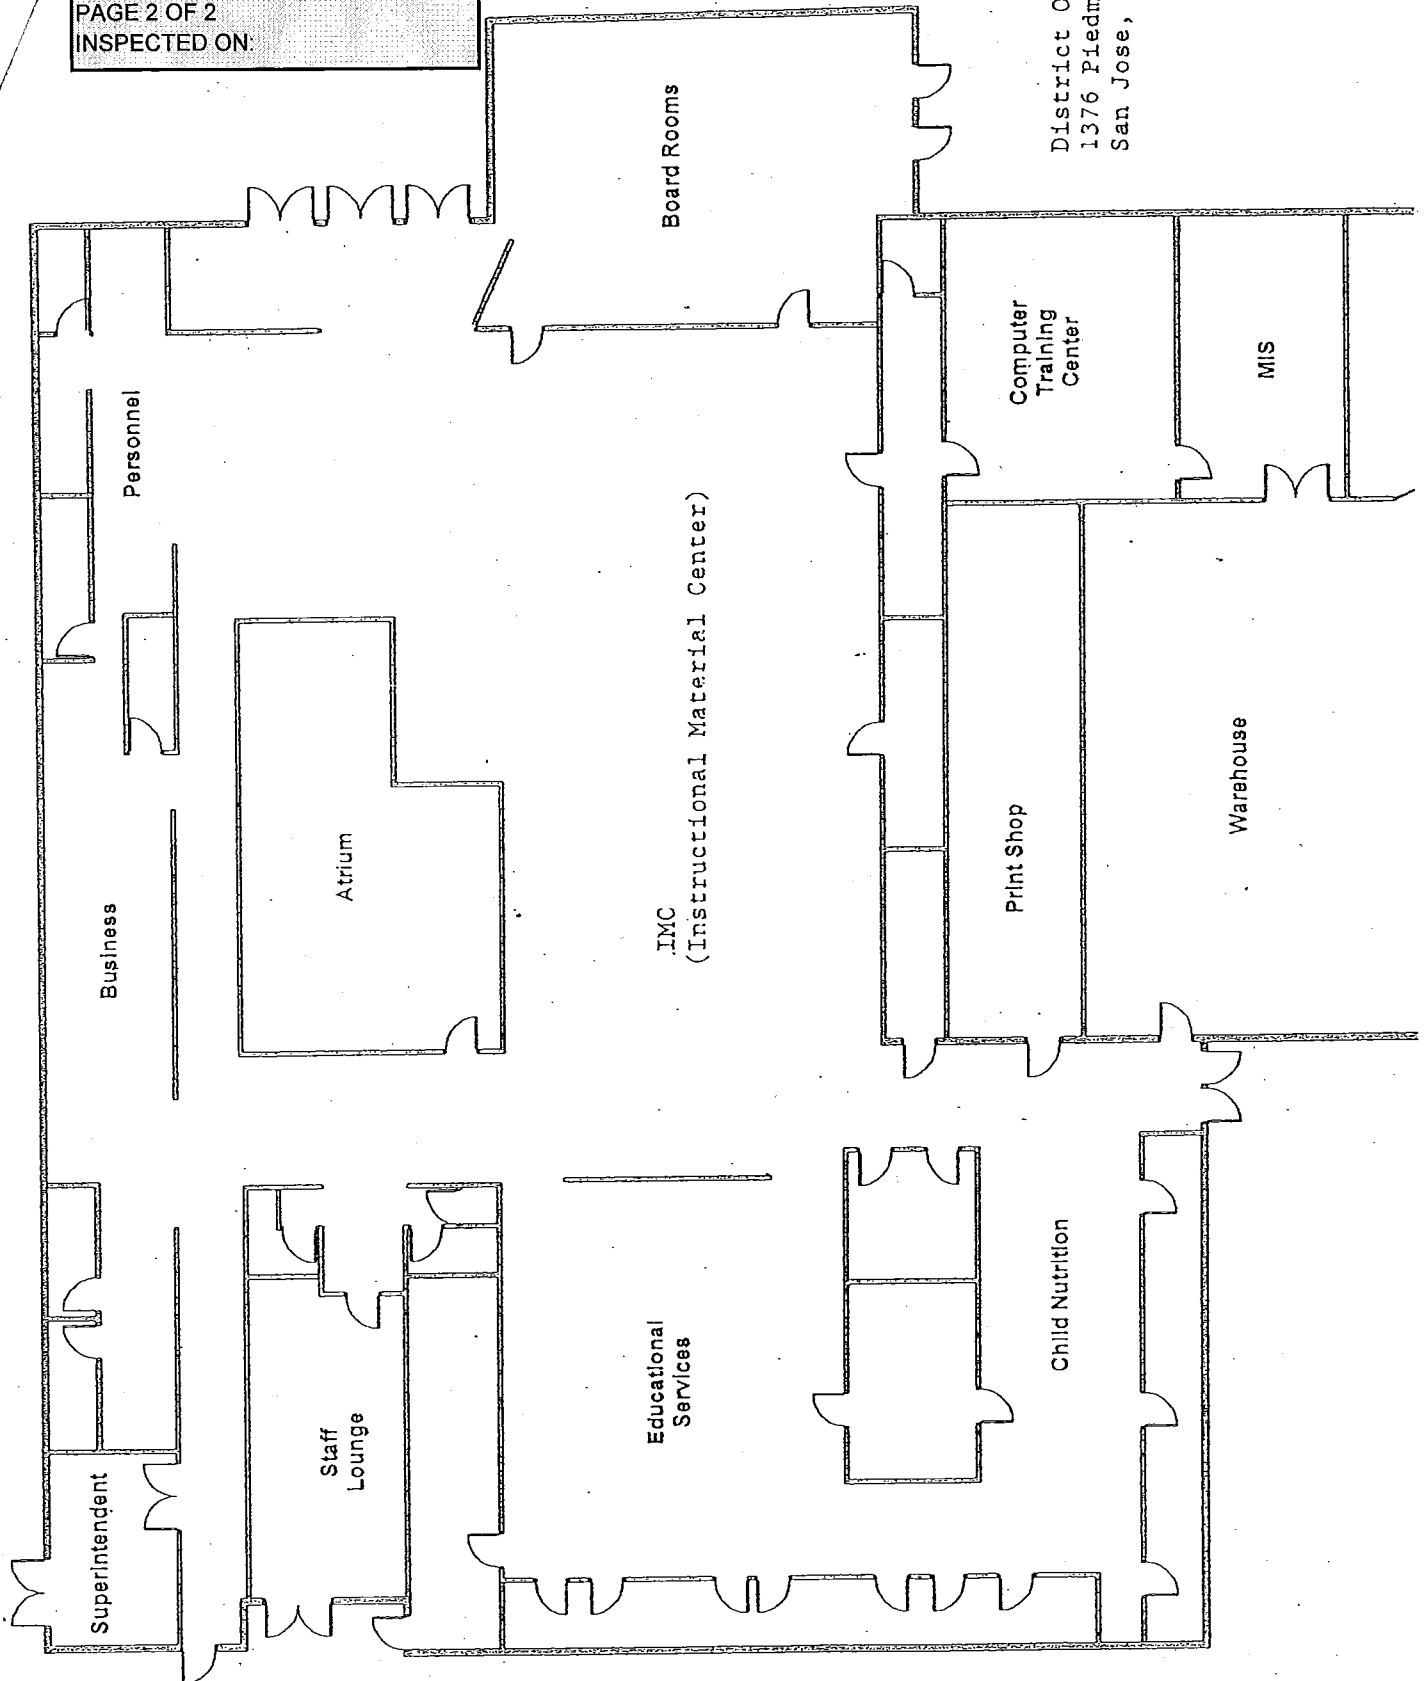

BUESD DISTRICT OFFICES


PAGE 1 OF 2

INSPECTED ON:

8/29/14



Metal Container

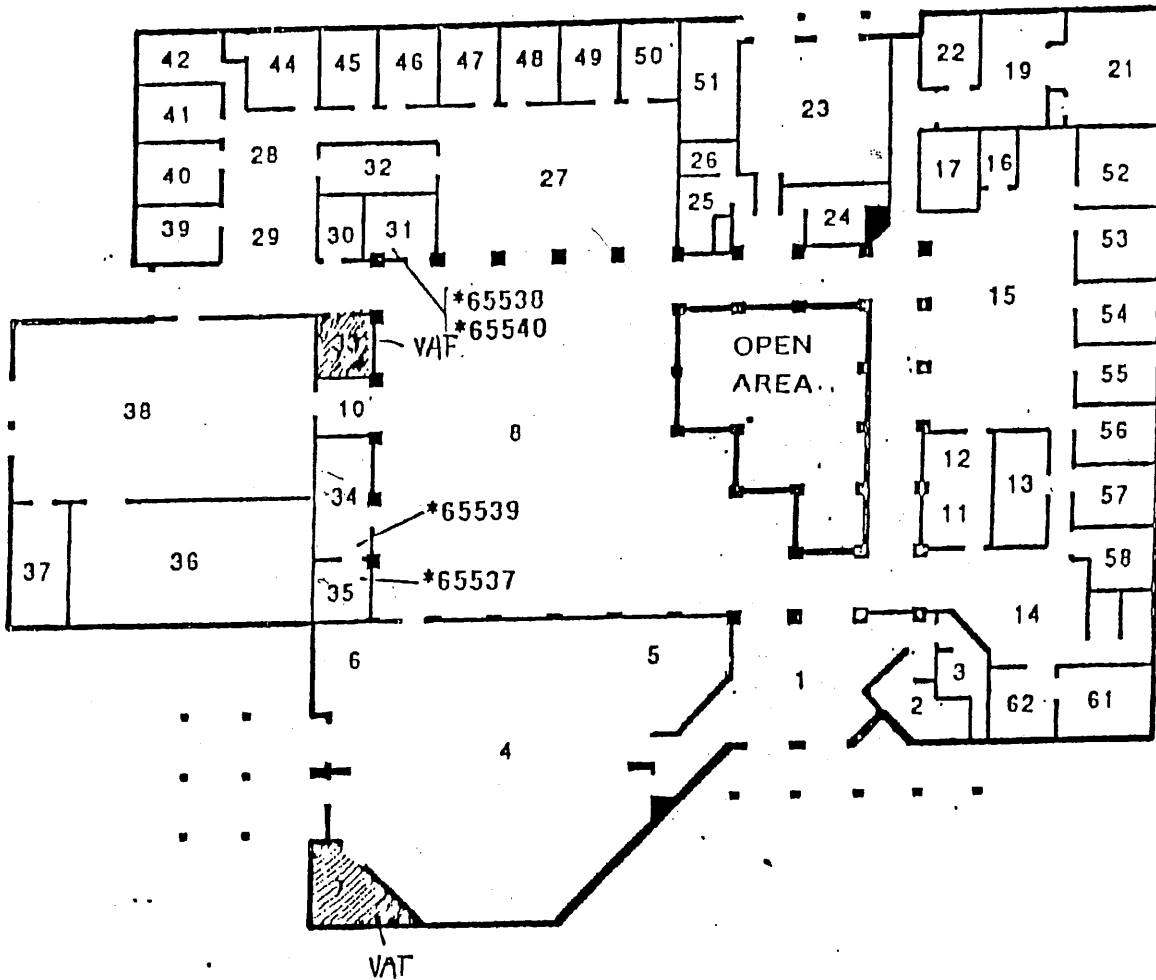

NORTH

0 10 25 50 100

SCALE: 1/30" = 1'-0"

BUSD

BERRYESSA UNION SCHOOL DISTRICT

DISTRICT OFFICE


1376 Piedmont Road

San Jose, CA

FIGURE #1

BUESD DISTRICT OFFICES
PAGE 2 OF 2
INSPECTED ON: 8/29/14



District Office
1376 Piedmont Rd.
San Jose, Ca. 95132

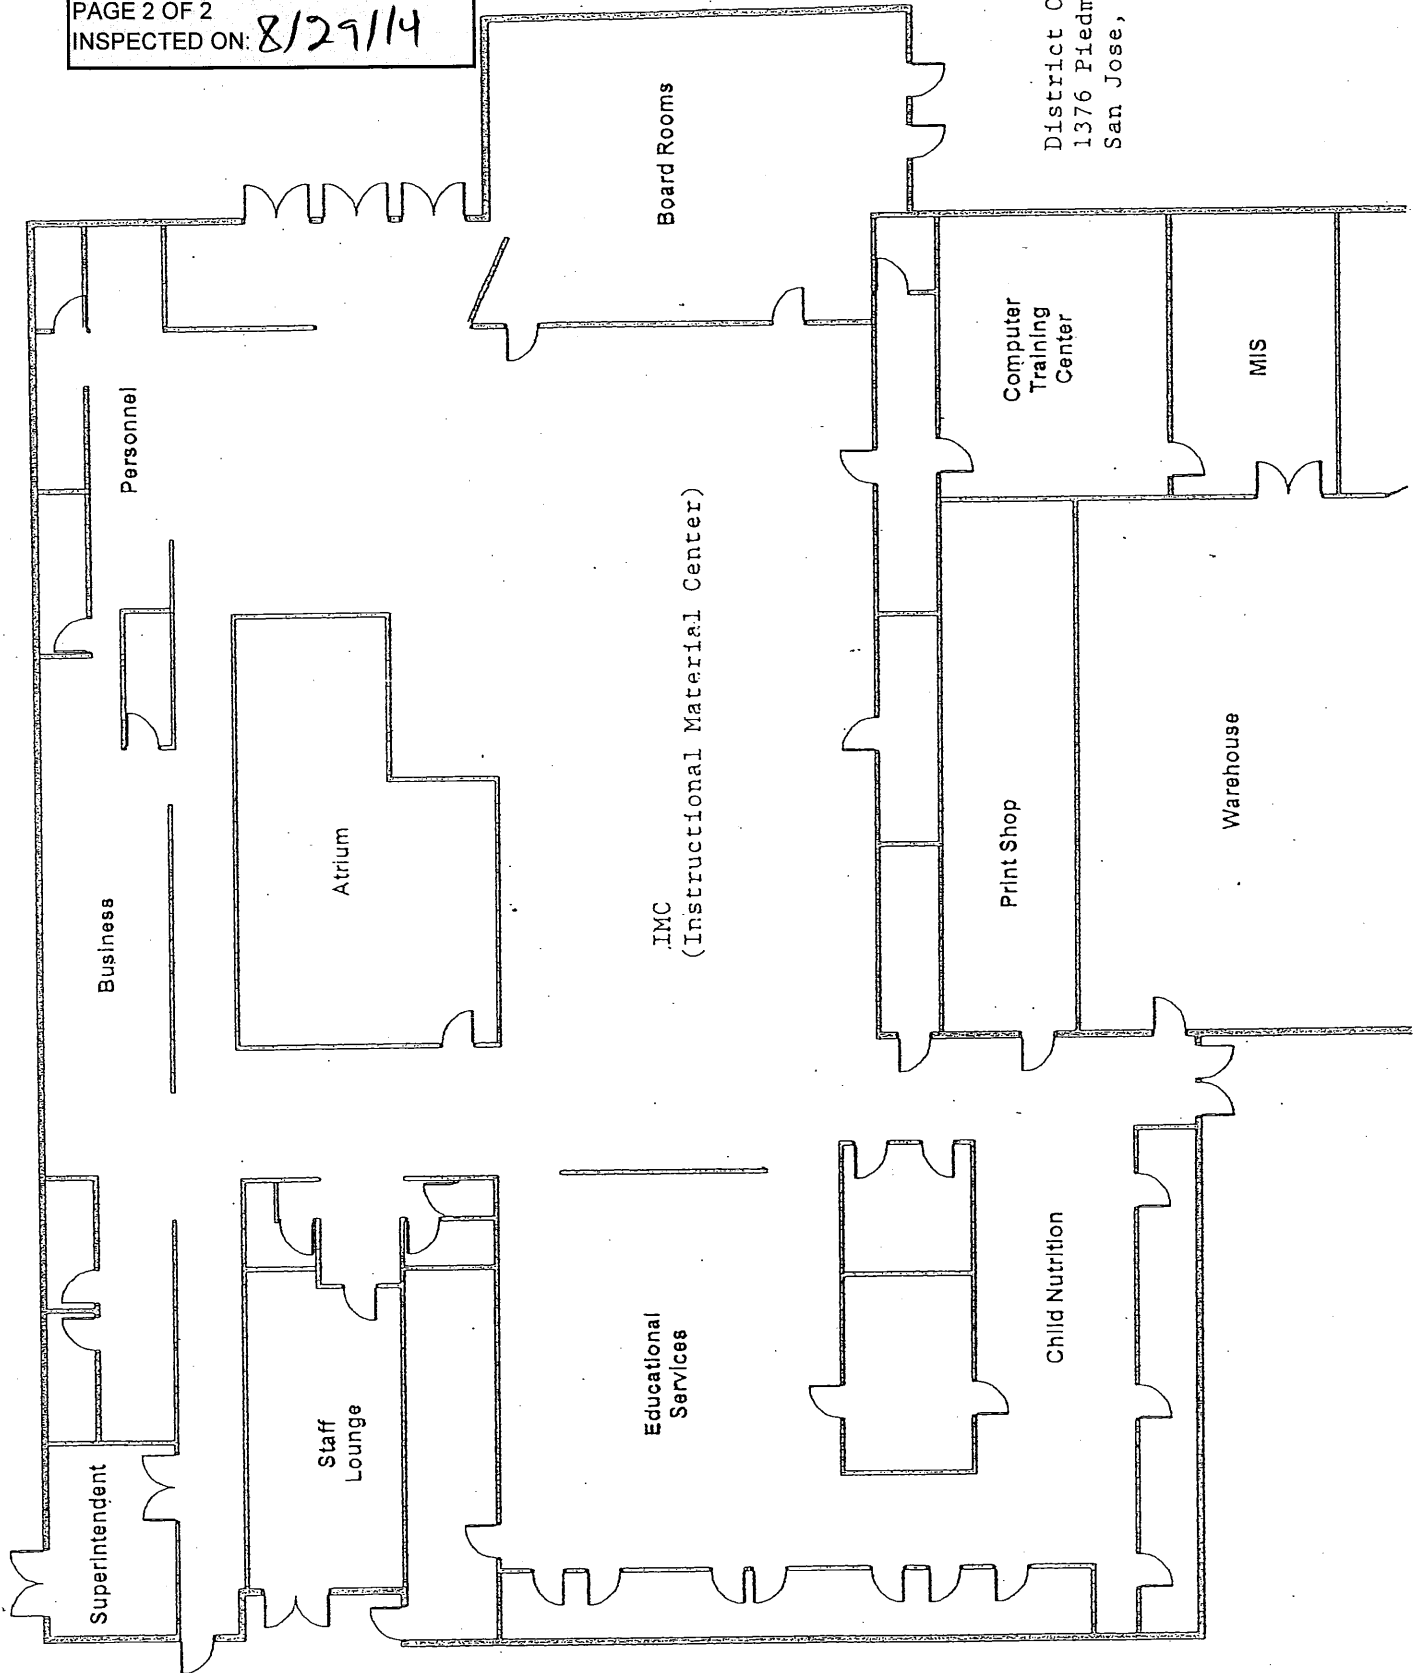

BUESD DISTRICT OFFICES

PAGE 1 OF 2

INSPECTED ON: 3-4-14

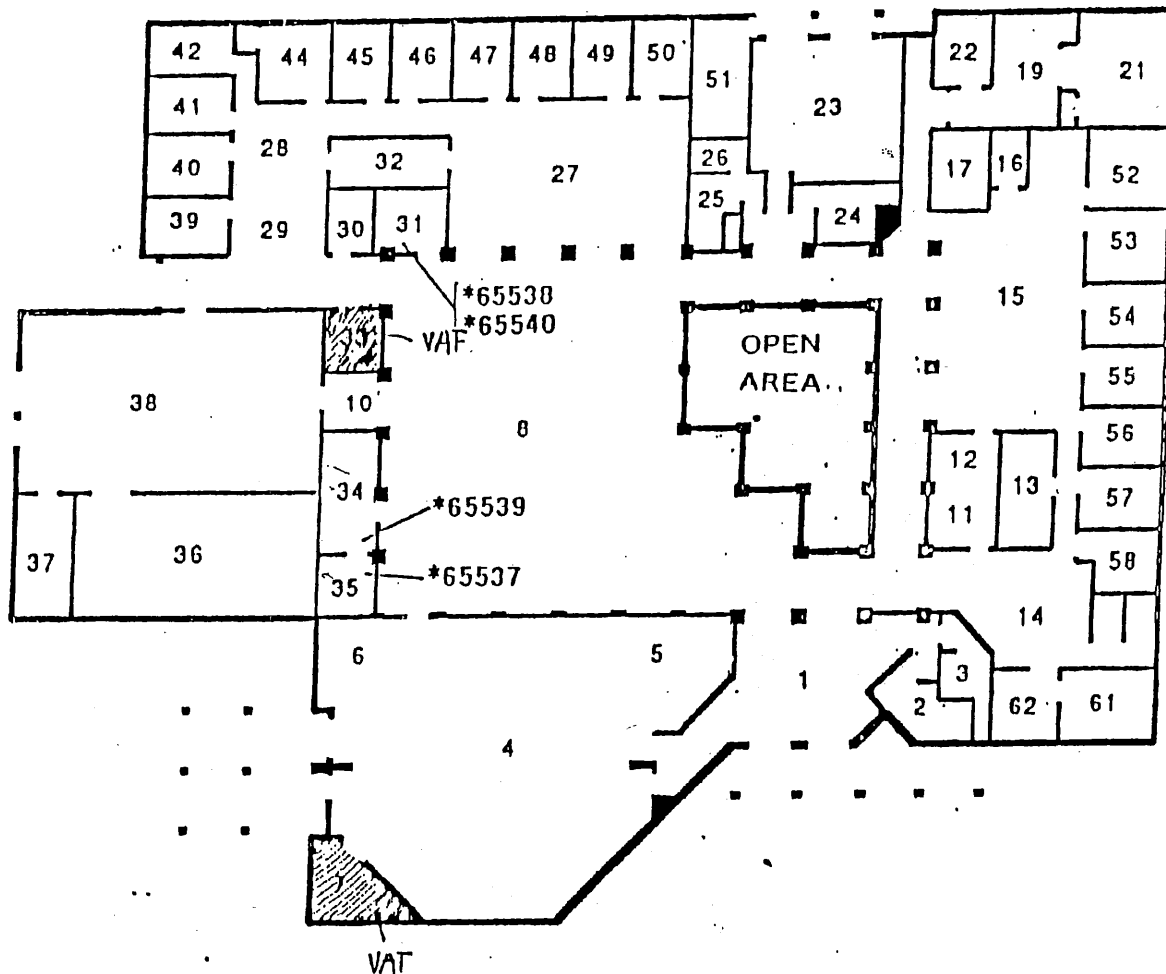

0 10 25 50 100

SCALE: 1/30" = 1'-0"

BUSD

BERRYESSA UNION SCHOOL DISTRICT


DISTRICT OFFICE
1376 Piedmont Road
San Jose, CA

FIGURE #1




BUESD DISTRICT OFFICES

PAGE 2 OF 2

INSPECTED ON: 3-9-19

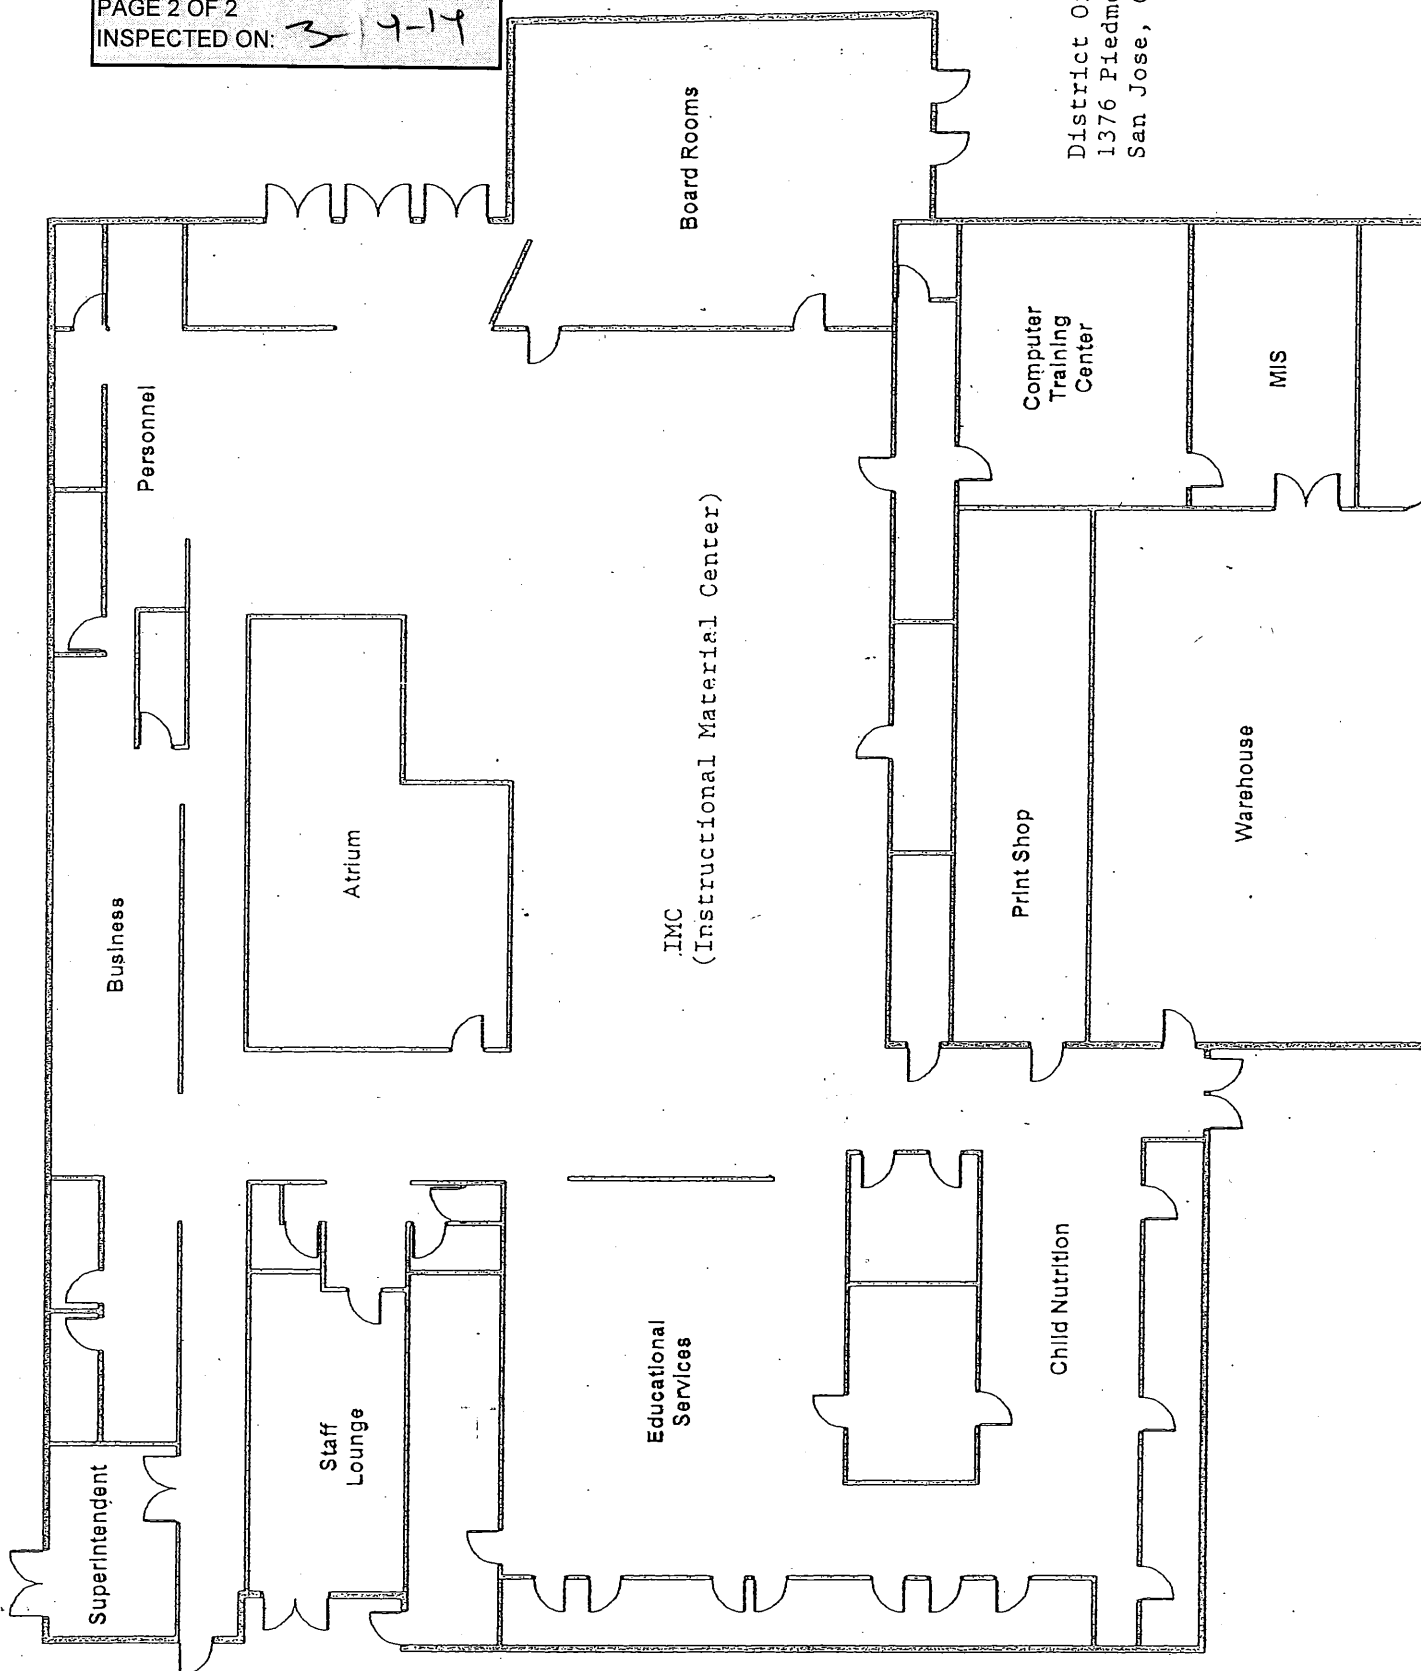

District Office
1376 Piedmont Rd.
San Jose, Ca. 95132

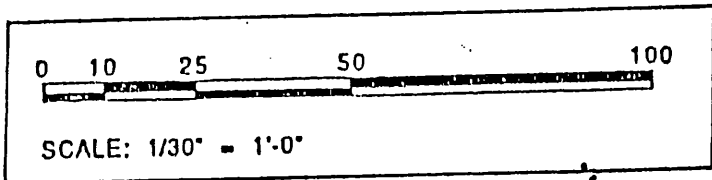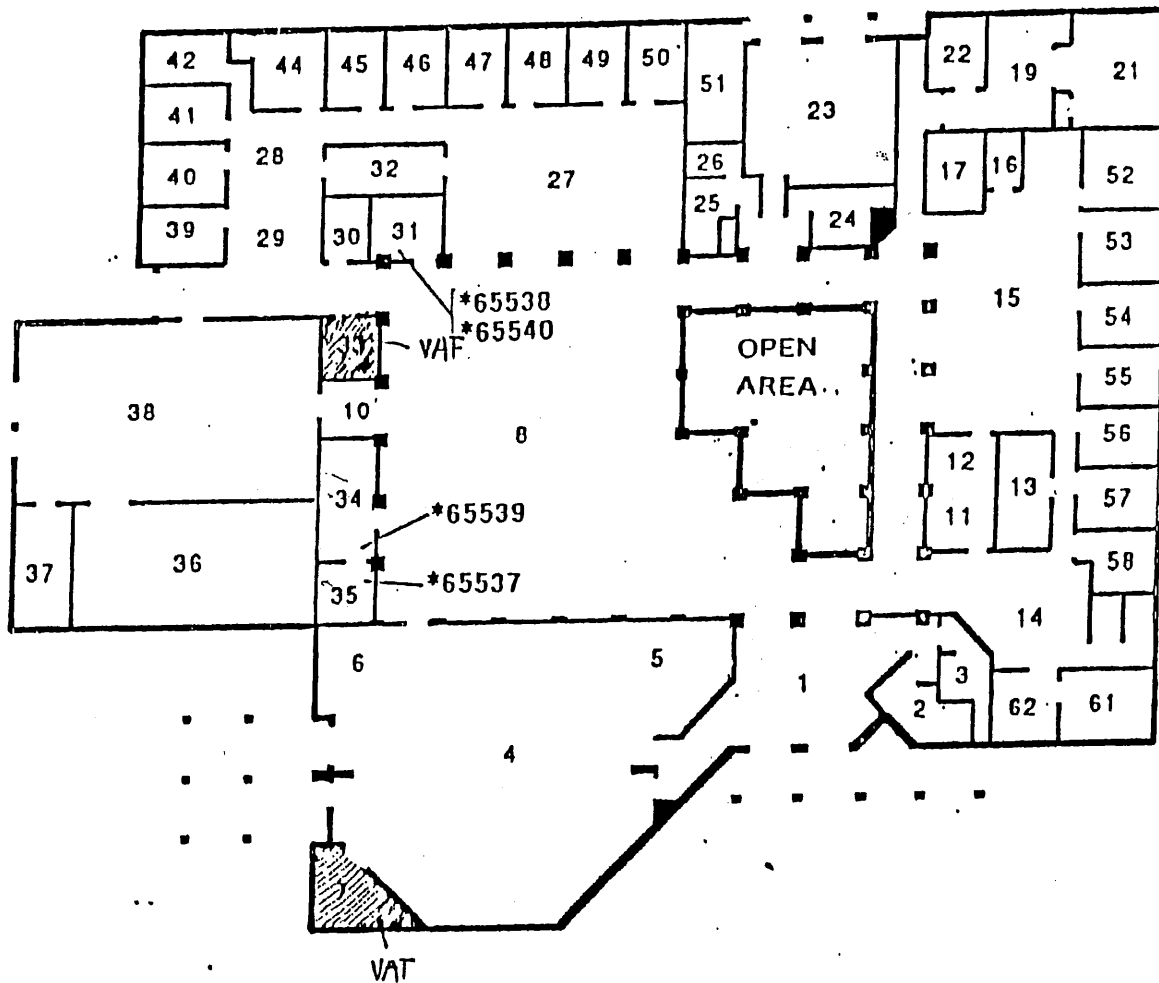


BUSD
BERRYESSA UNION SCHOOL DISTRICT

DISTRICT OFFICE
1376 Piedmont Road
San Jose, CA

FIGURE #1

BUESD DISTRICT OFFICES
PAGE 2 OF 2
INSPECTED ON:

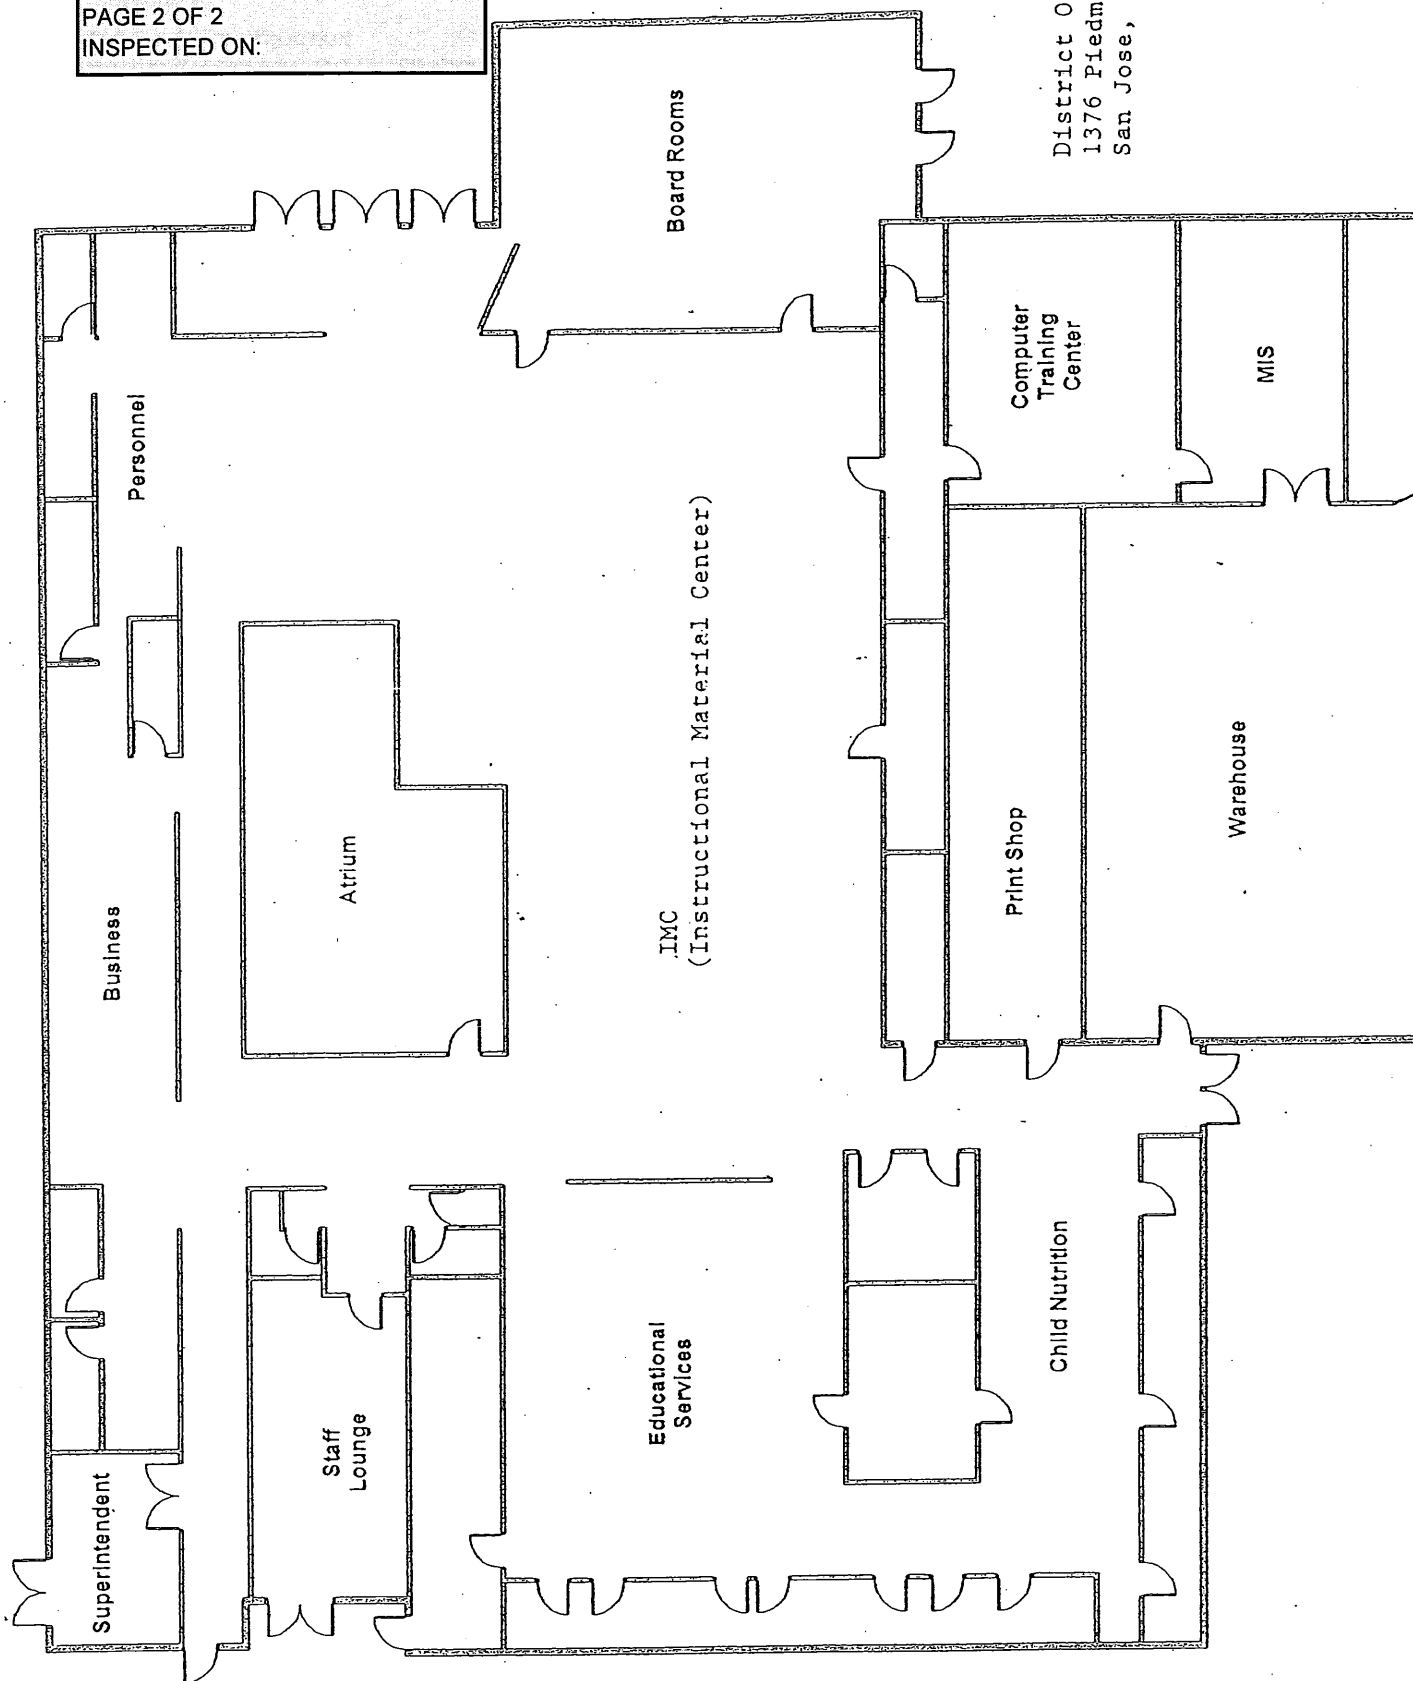

District Office
1376 Piedmont Rd.
San Jose, Ca. 95132

BUESD DISTRICT OFFICES


PAGE 1 OF 2

INSPECTED ON:

04-03-13



Metal Container

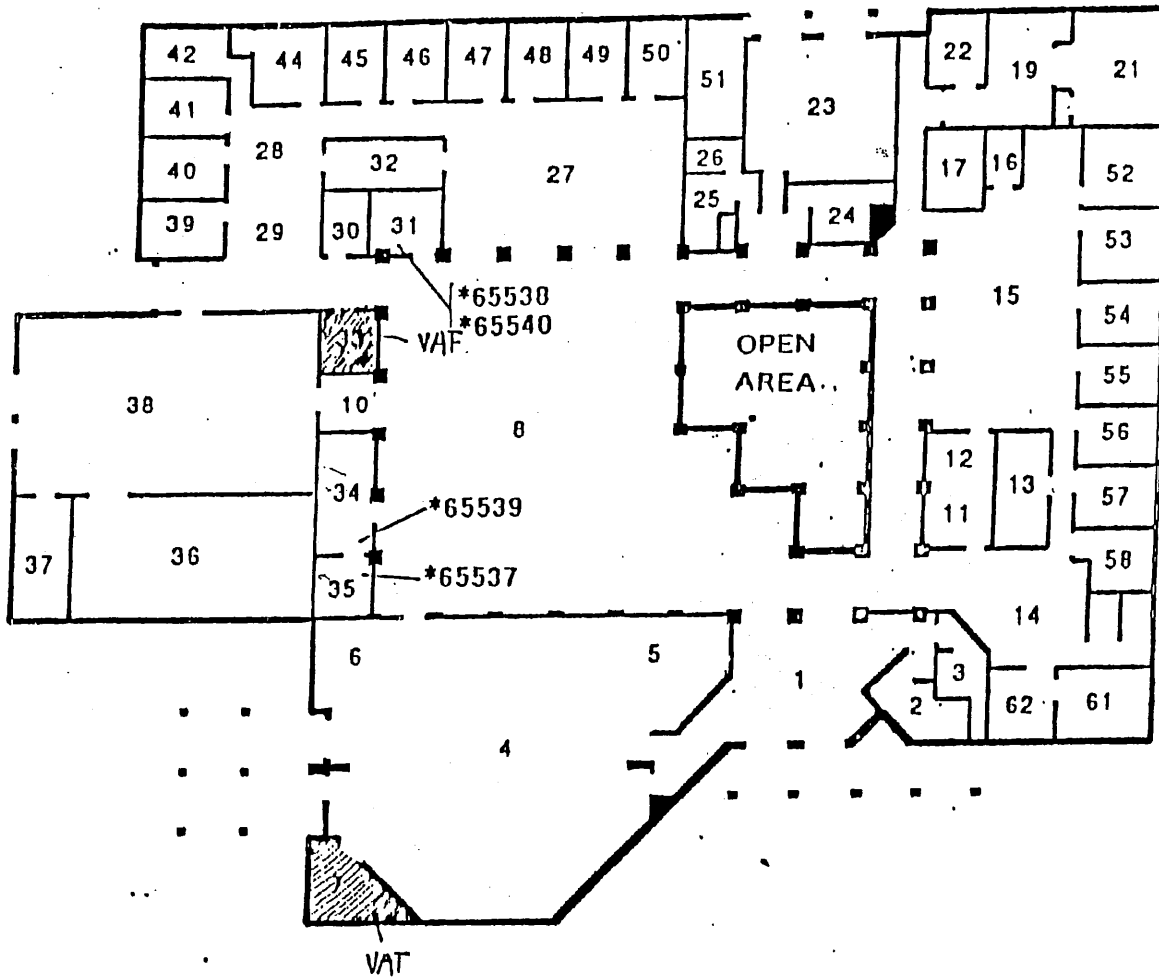

NORTH

0 10 25 50 100

SCALE: 1/30" = 1'-0"

BUSD

BERRYESSA UNION SCHOOL DISTRICT

DISTRICT OFFICE


1376 Piedmont Road

San Jose, CA

FIGURE #1

BUESD DISTRICT OFFICES
PAGE 2 OF 2
INSPECTED ON:



District Office
1376 Piedmont Rd.
San Jose, Ca. 95132

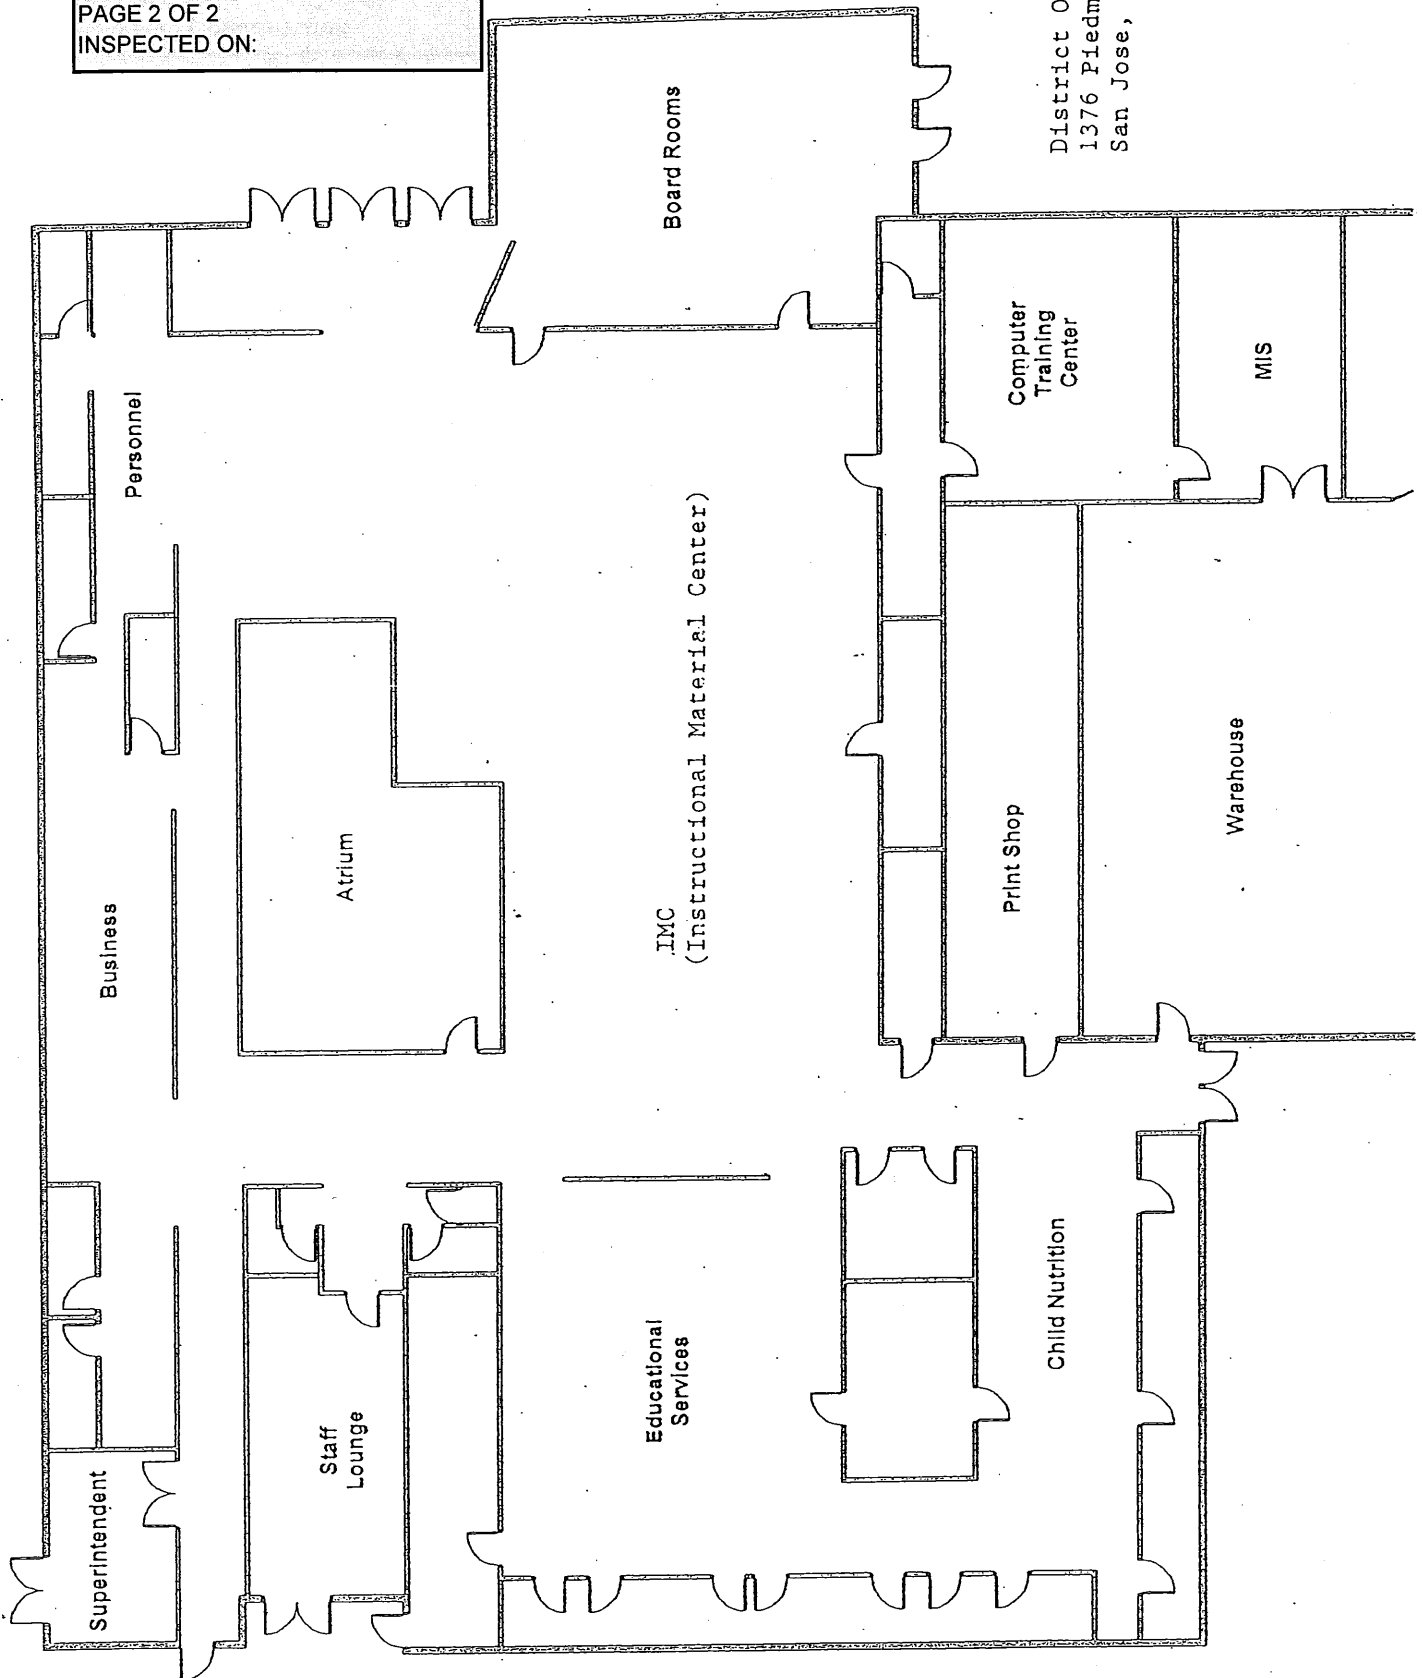

BUESD DISTRICT OFFICES

PAGE 1 OF 2

INSPECTED ON: 10-16-12

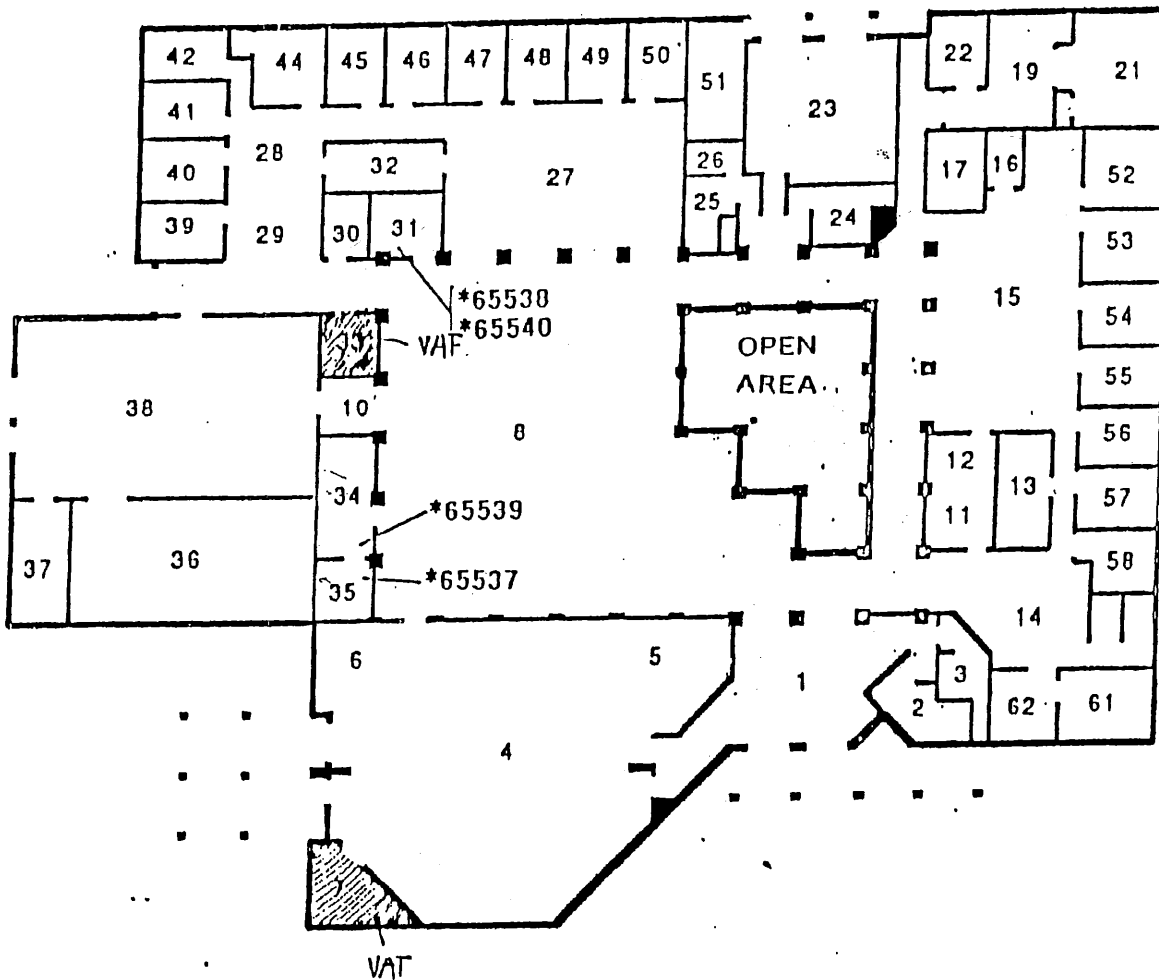

NORTH

0 10 25 50 100

SCALE: 1/30" = 1'-0"

BUSD

BERRYESSA UNION SCHOOL DISTRICT


DISTRICT OFFICE
1376 Piedmont Road
San Jose, CA

FIGURE #1

BUESD DISTRICT OFFICES

PAGE 2 OF 2

INSPECTED ON: 6-10-12

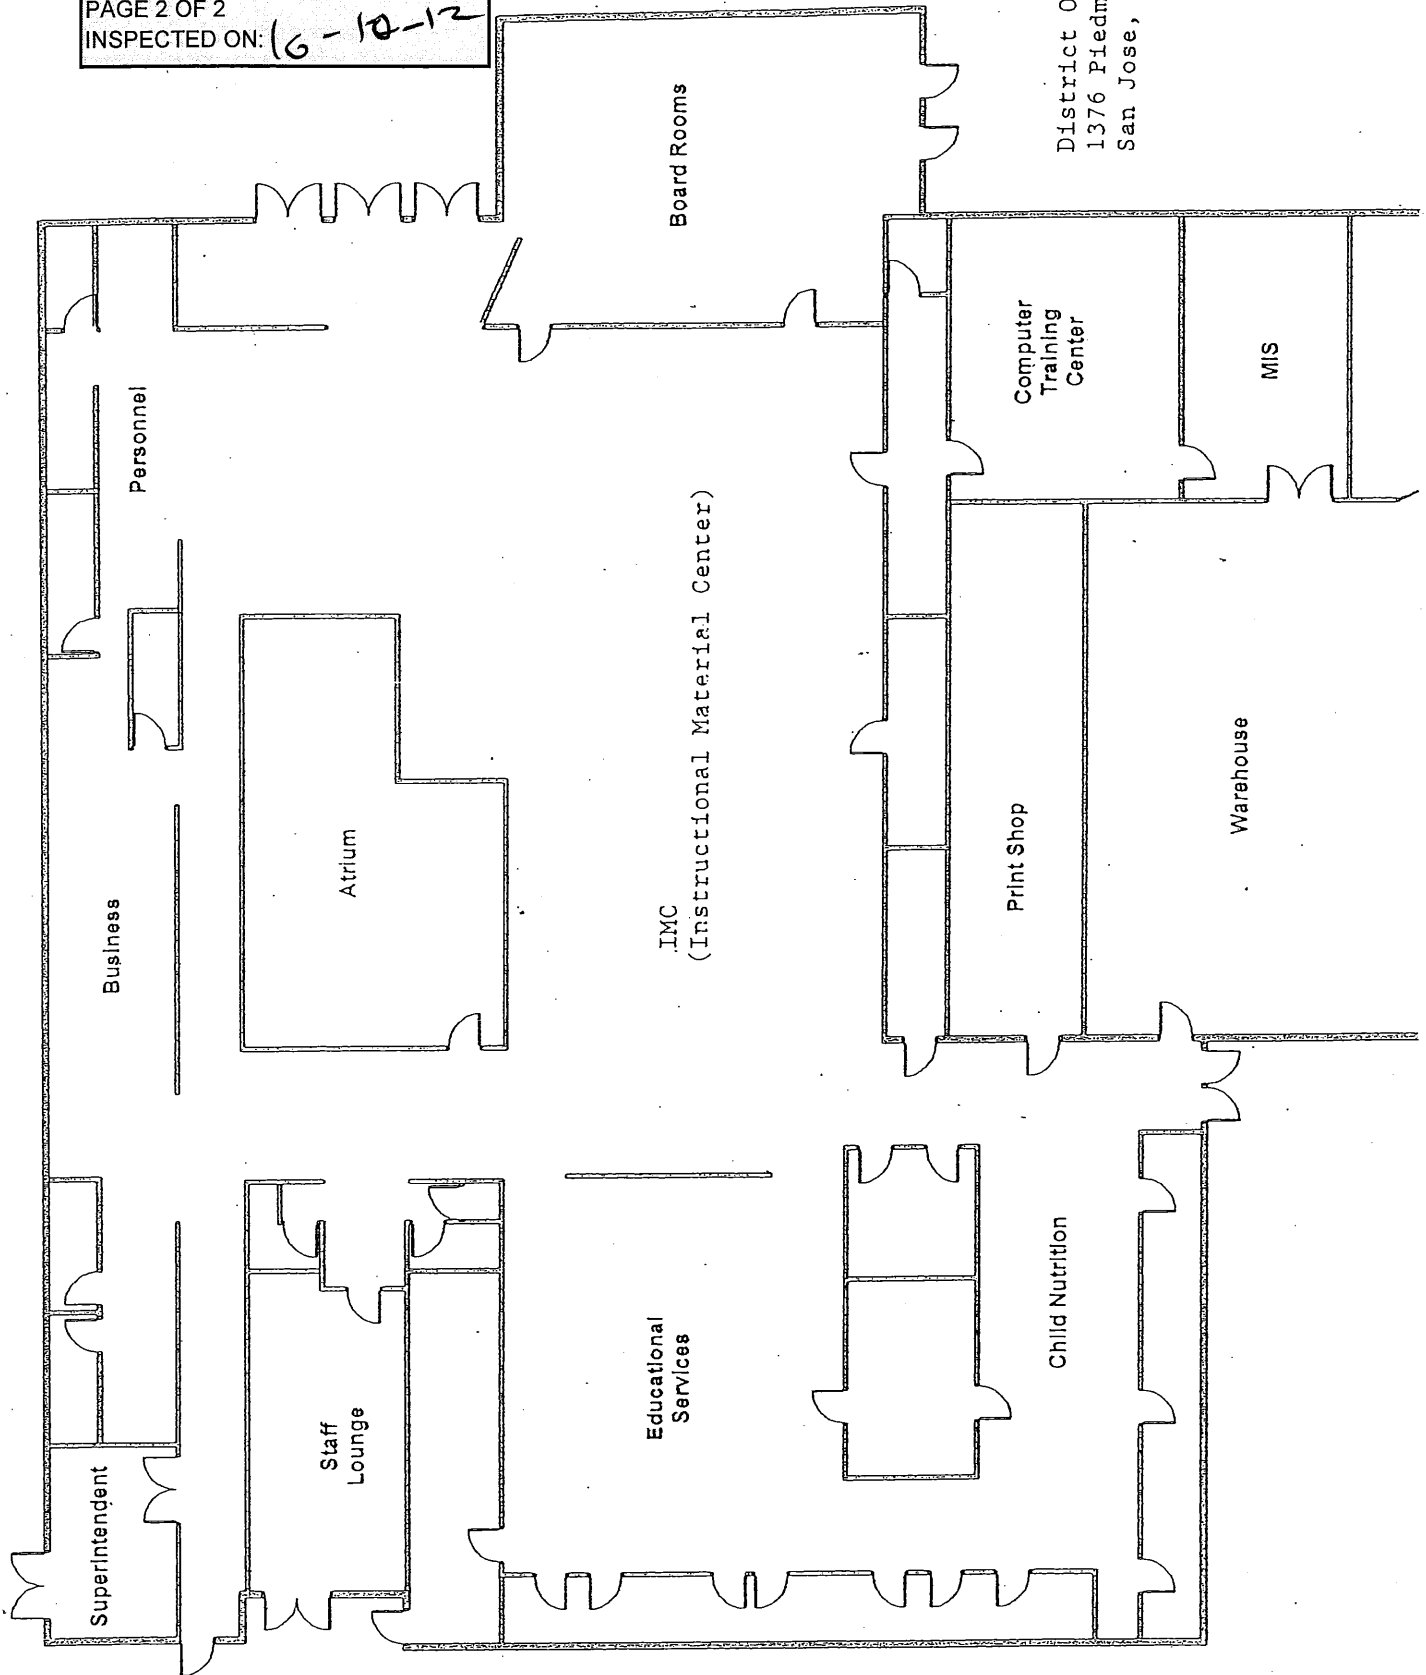



District Office
1376 Piedmont Rd.
San Jose, Ca. 95132

BUESD DISTRICT OFFICES

PAGE 1 OF 2

INSPECTED ON:

04-13-12

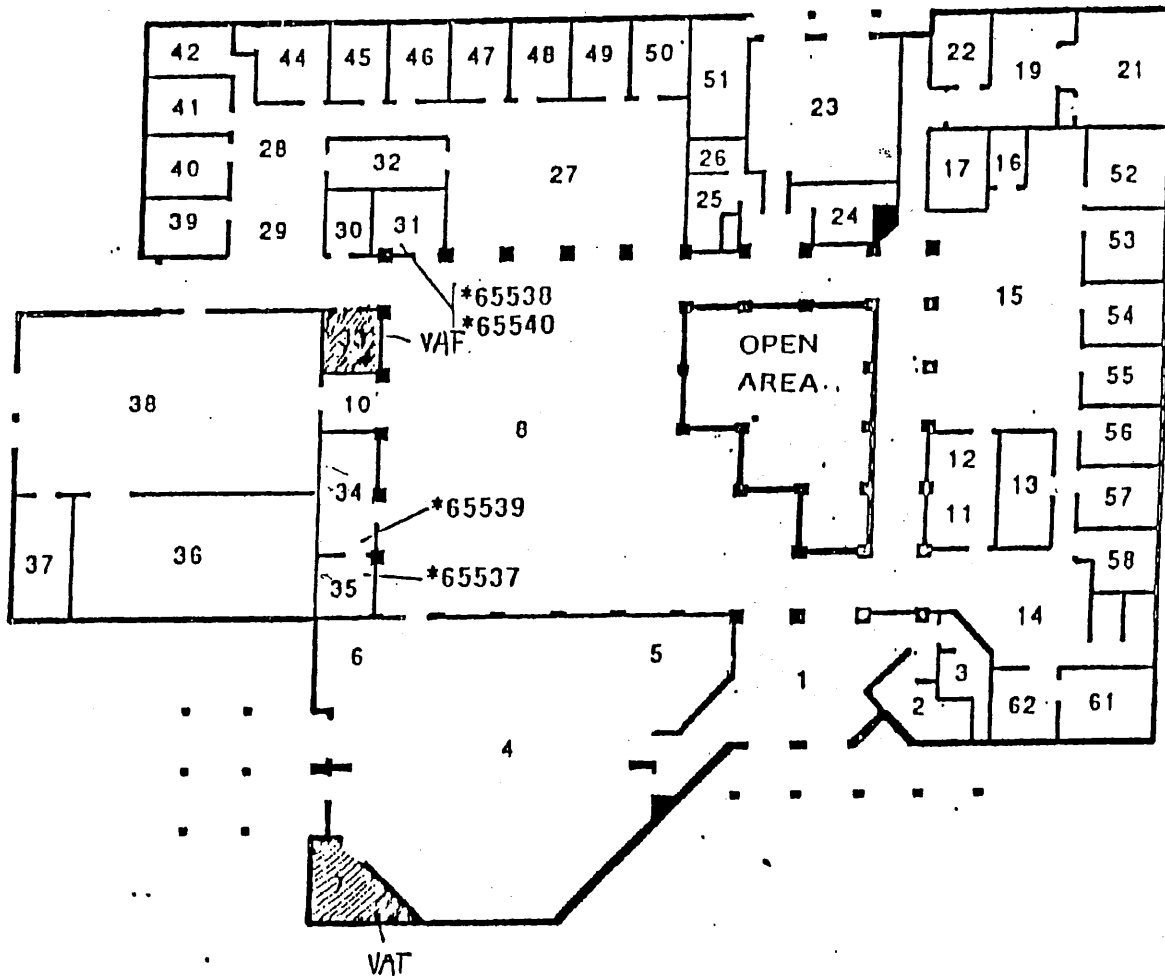

NORTH

0 10 25 50 100

SCALE: 1/30" = 1'-0"

BUSD

BERRYESSA UNION SCHOOL DISTRICT

DISTRICT OFFICE
1376 Piedmont Road
San Jose, CA


FIGURE #1

BUESD DISTRICT OFFICES

PAGE 2 OF 2

INSPECTED ON: 04-13-12



District Office
1376 Piedmont Rd.
San Jose, Ca. 95132

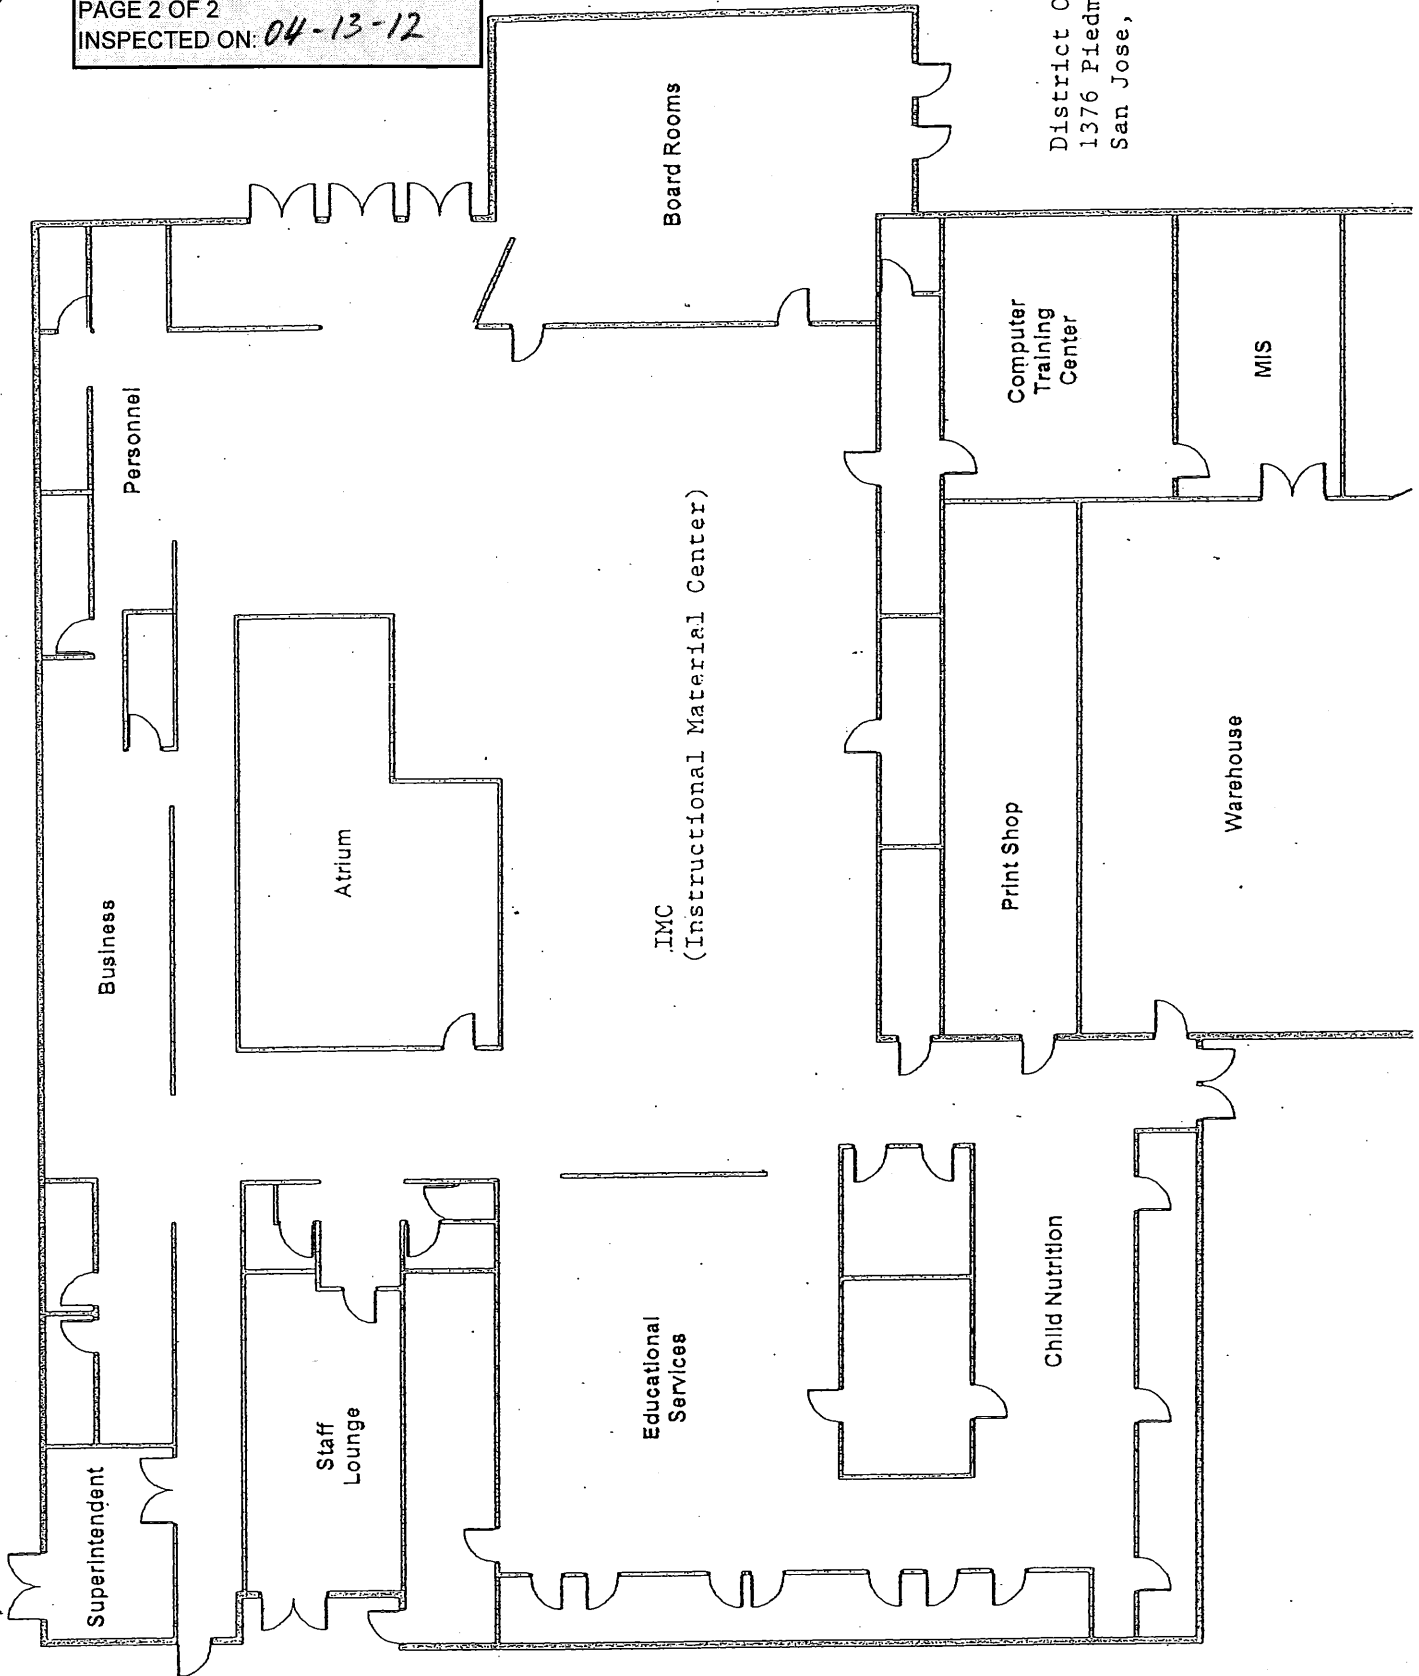

BUESD DISTRICT OFFICES

PAGE 1 OF 2

INSPECTED ON: 11-30-11

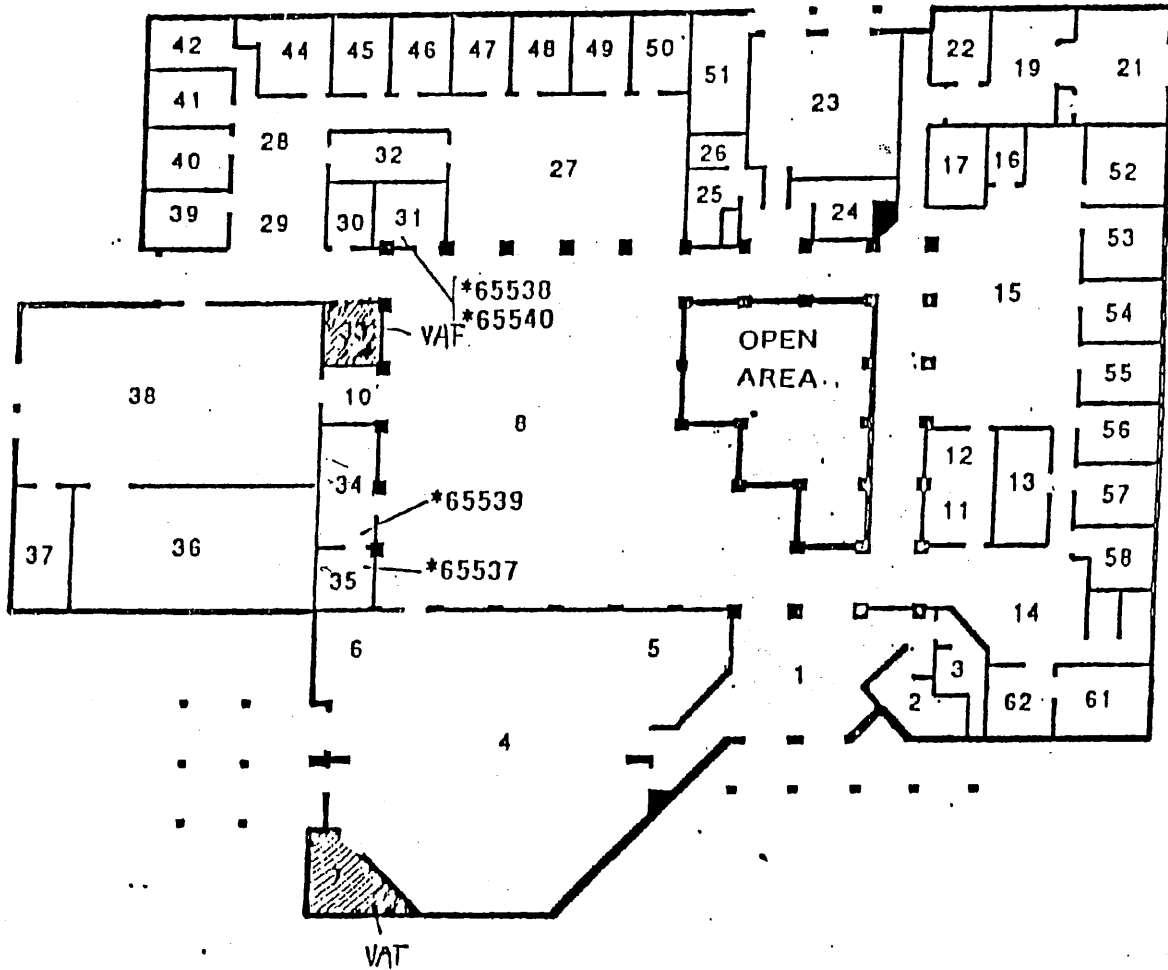

0 10 25 50 100

SCALE: 1/30" = 1'-0"

BUSD

BERRYESSA UNION SCHOOL DISTRICT

DISTRICT OFFICE
1376 Piedmont Road
San Jose, CA


FIGURE #1

BUESD DISTRICT OFFICES

PAGE 2 OF 2

INSPECTED ON: 11-30-11

District Office
1376 Piedmont Rd.
San Jose, Ca. 95132

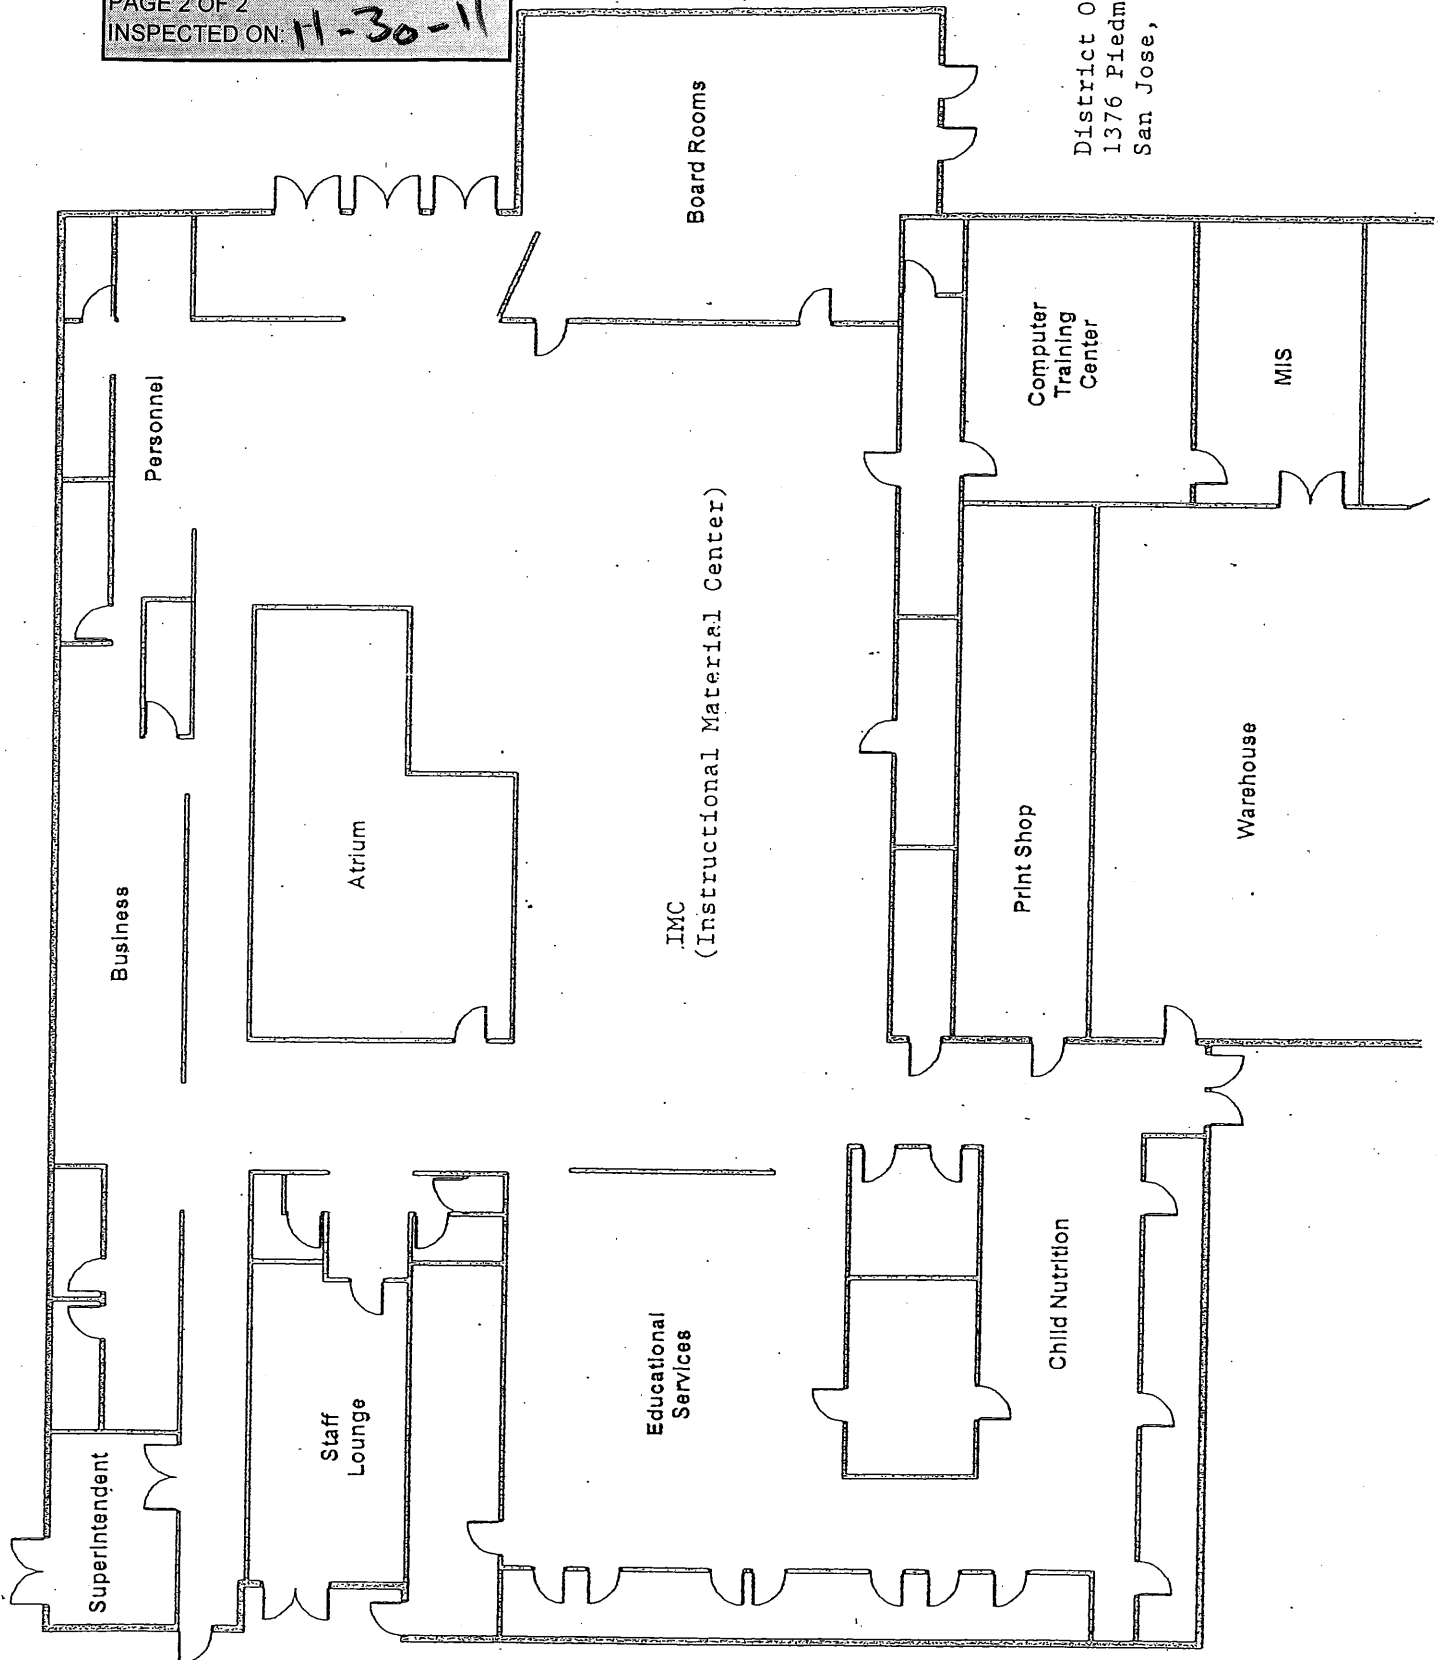


BUESD DISTRICT OFFICES

PAGE 1 OF 2

INSPECTED ON: 8/31/10

9/11/10

ME 504

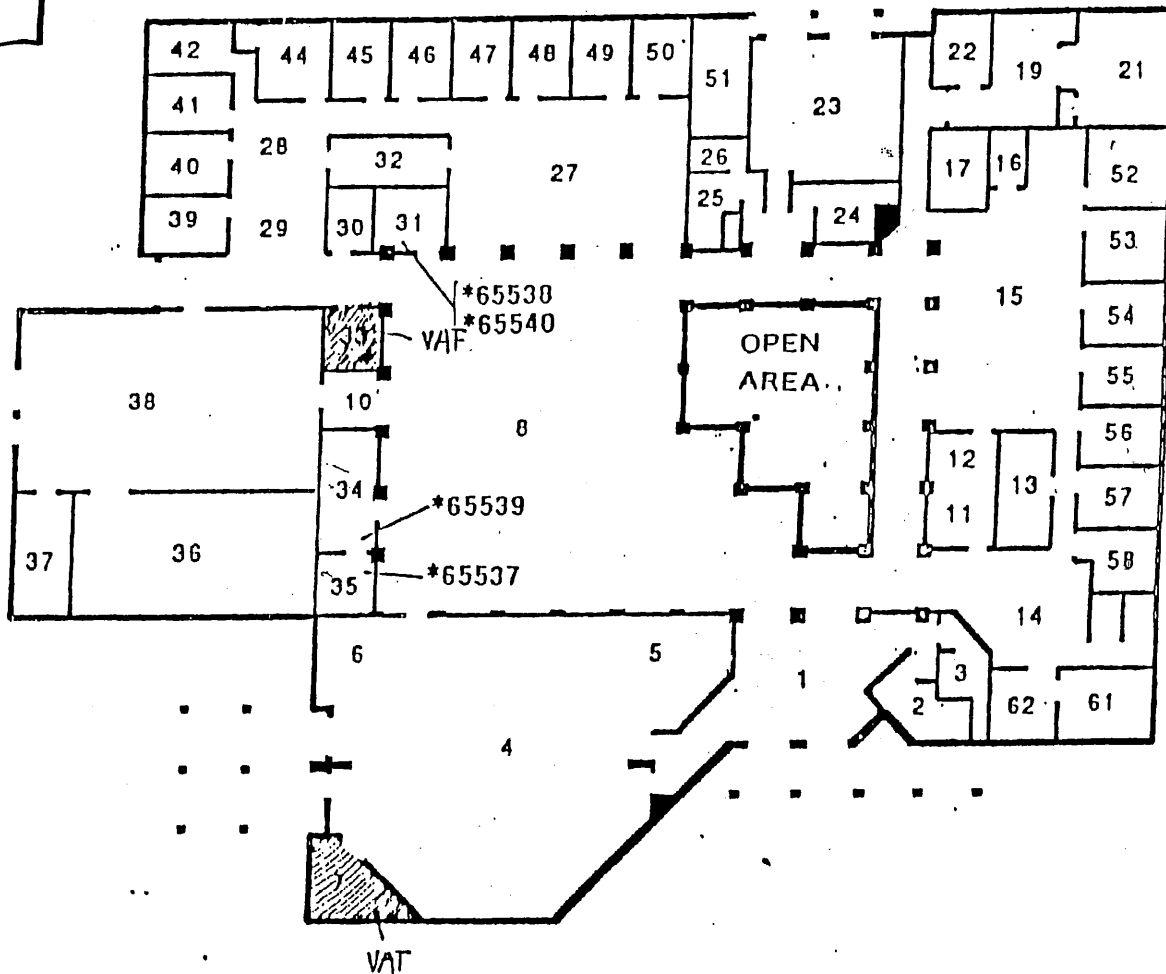

NORTH

0 10 25 50 100

SCALE: 1/30" = 1'-0"

BUSD

BERRYESSA UNION SCHOOL DISTRICT

DISTRICT OFFICE

1376 Piedmont Road

San Jose, CA

FIGURE #1


BUESD DISTRICT OFFICES


PAGE 2 OF 2

INSPECTED ON 8/31/0


8/1/0

District Office
1376 Piedmont Rd.
San Jose, Ca. 95132

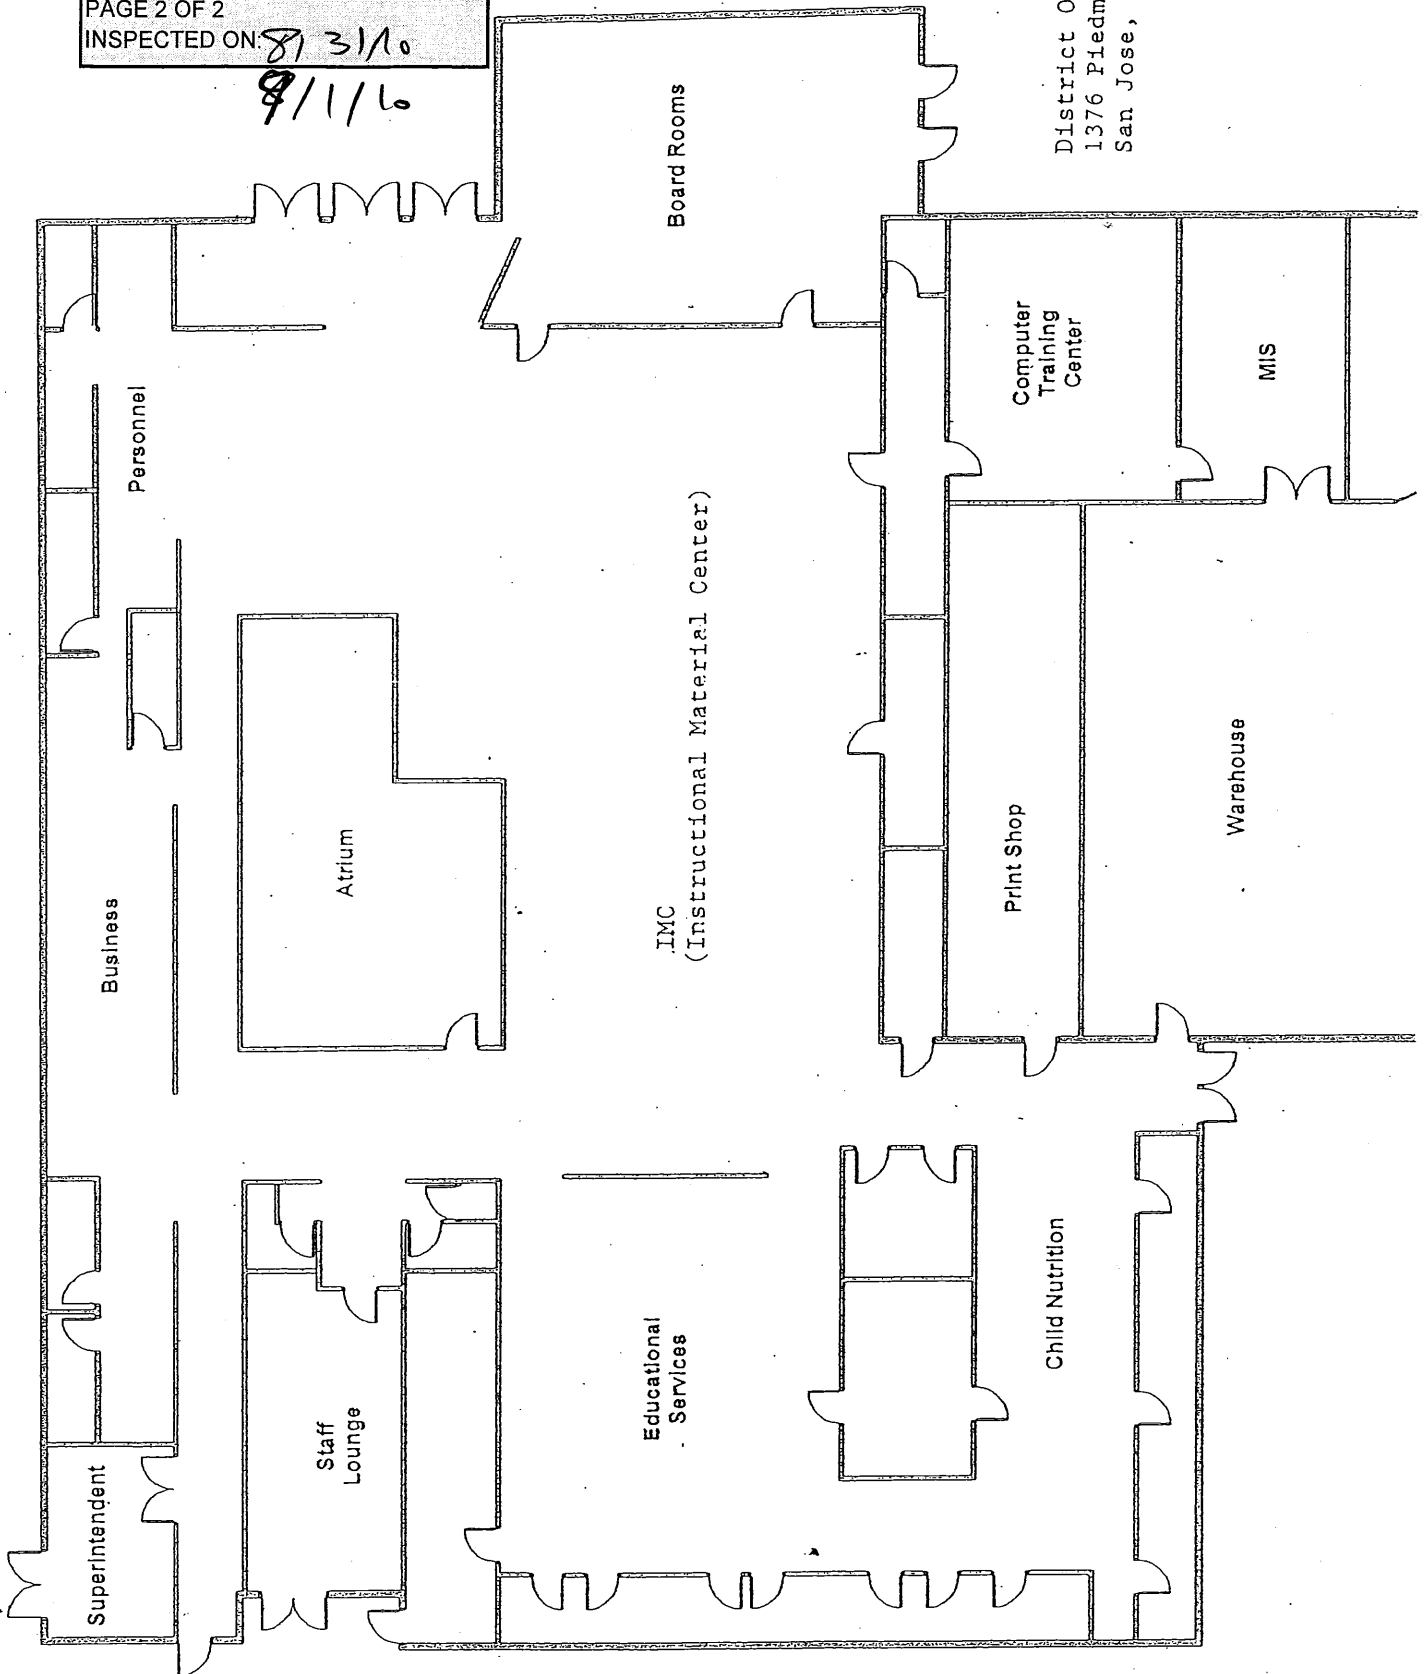

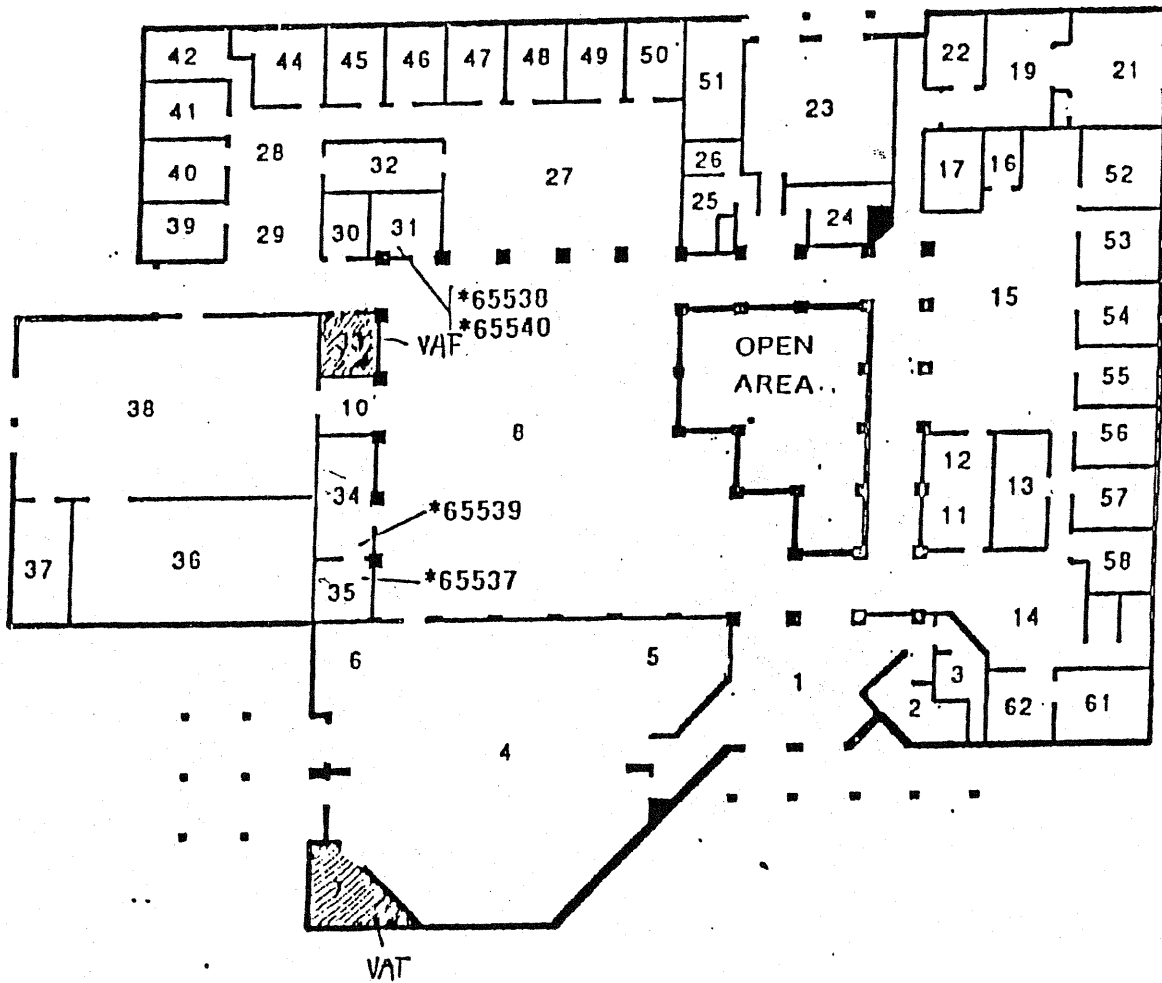

NORTH



SCALE: 1/30" = 1'-0"

BUSD

BERRYESSA UNION SCHOOL DISTRICT

DISTRICT OFFICE


1376 Piedmont Road


San Jose, CA

FIGURE #1


BUESD DISTRICT OFFICES
PAGE 2 OF 2
INSPECTED ON: 3-10-10

District Office
1376 Piedmont Rd.
San Jose, Ca. 95132

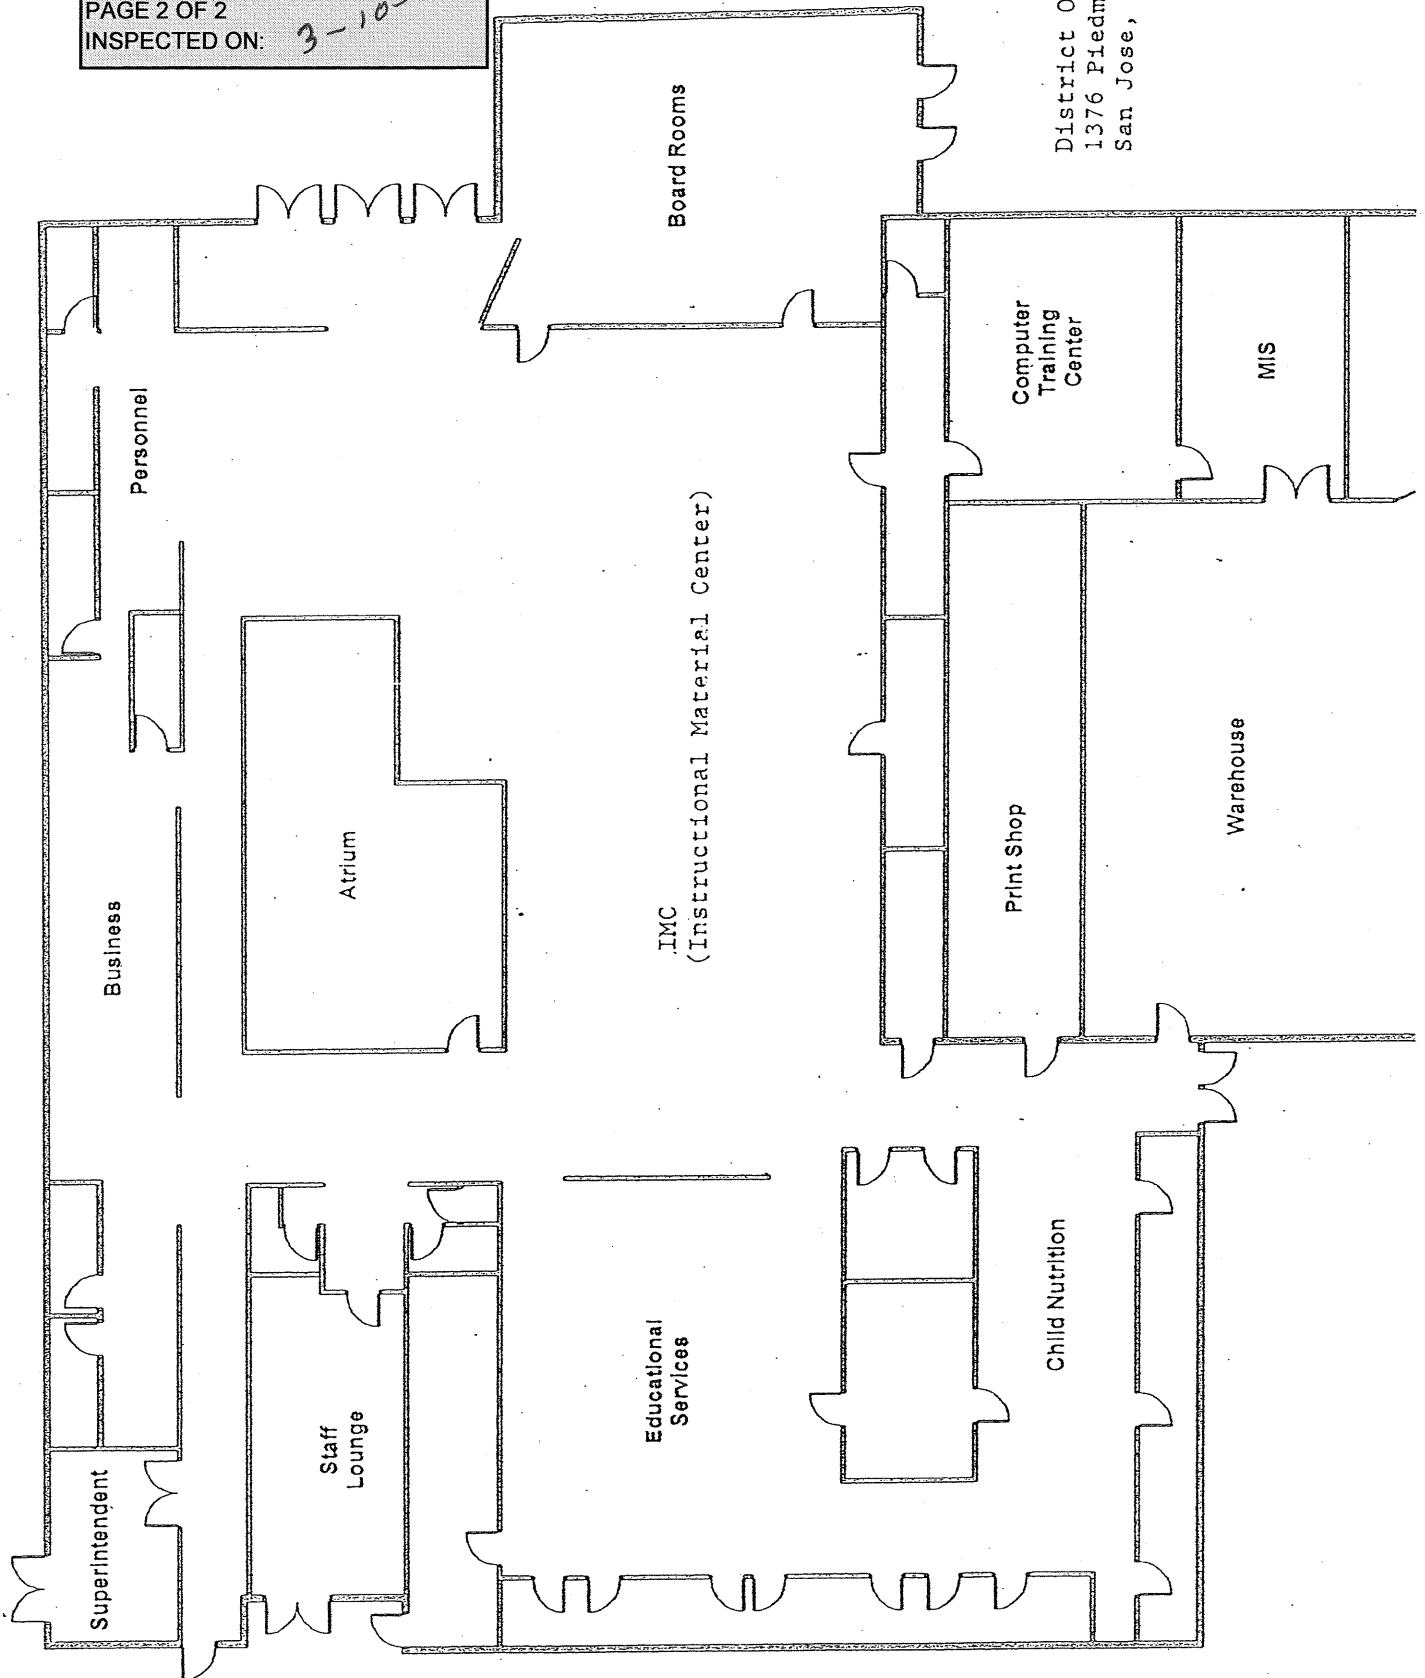

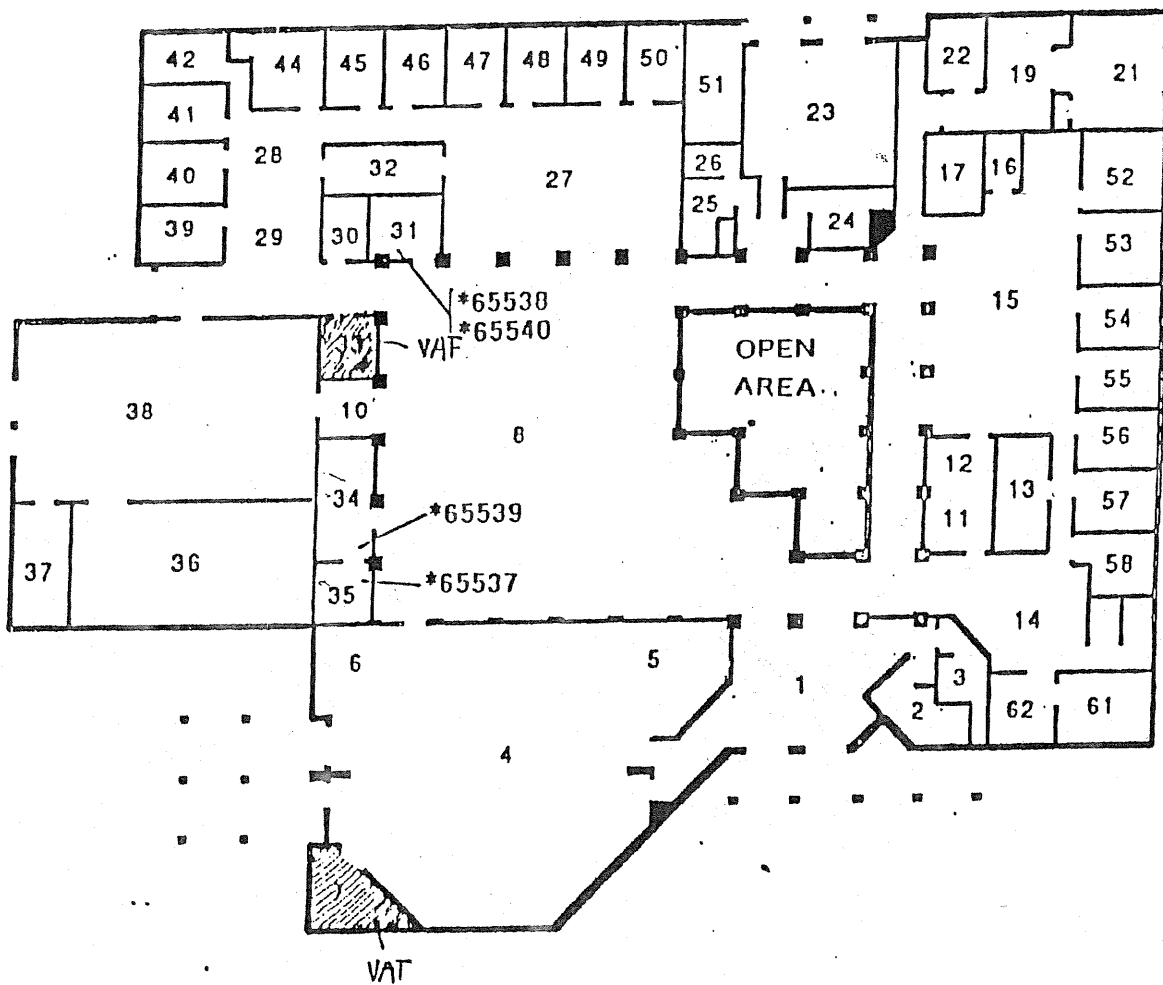

NORTH



SCALE: 1/30" = 1'-0"

BUSD

BERRYESSA UNION SCHOOL DISTRICT

DISTRICT OFFICE


1376 Piedmont Road

San Jose, CA

FIGURE #1

BUESD DISTRICT OFFICES
PAGE 2 OF 2
INSPECTED ON:

District Office
1376 Piedmont Rd.
San Jose, Ca. 95132

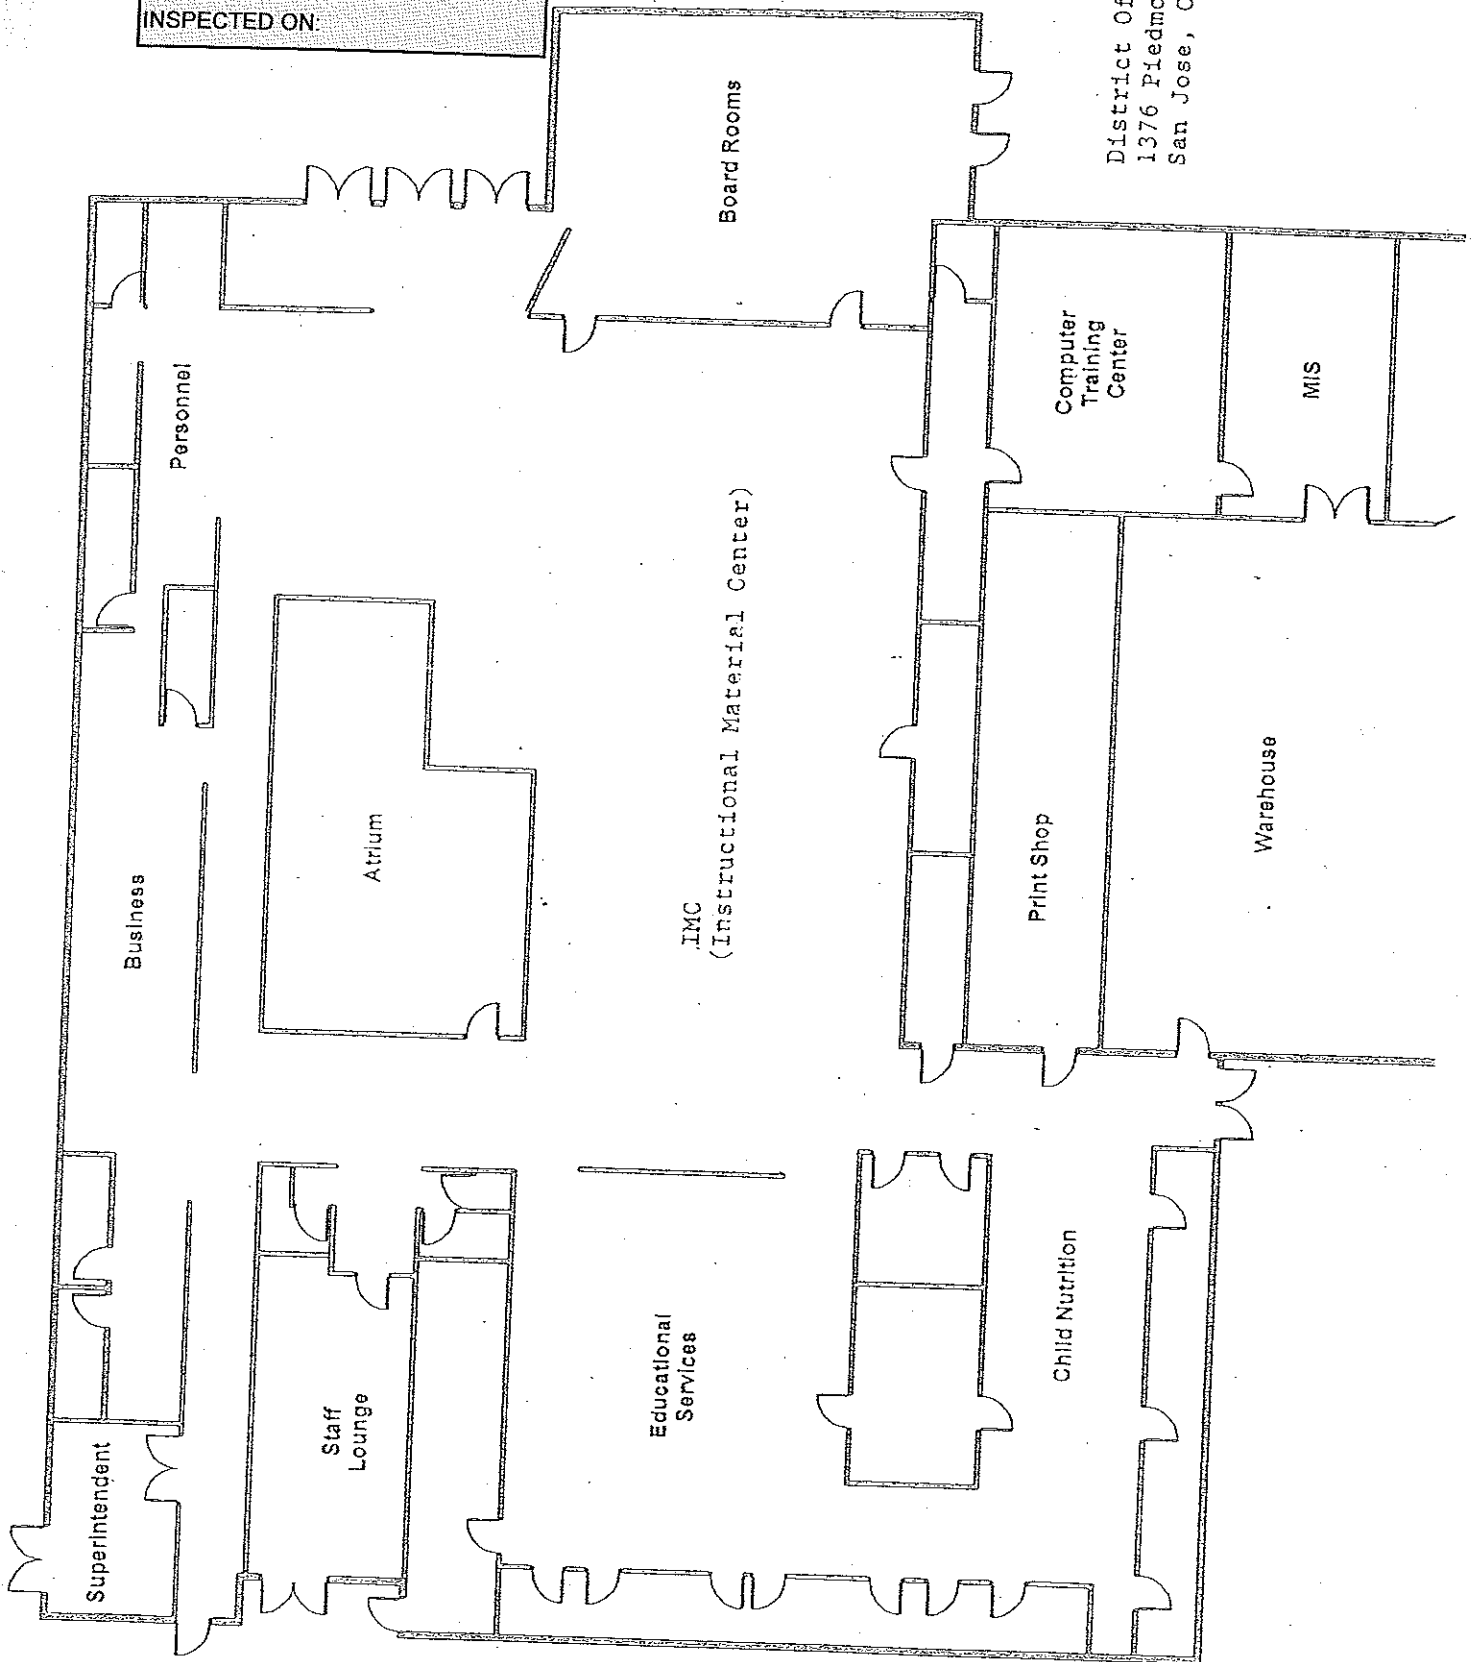


BUESD DISTRICT OFFICES


PAGE 1 OF 2

INSPECTED ON:

5/13/09

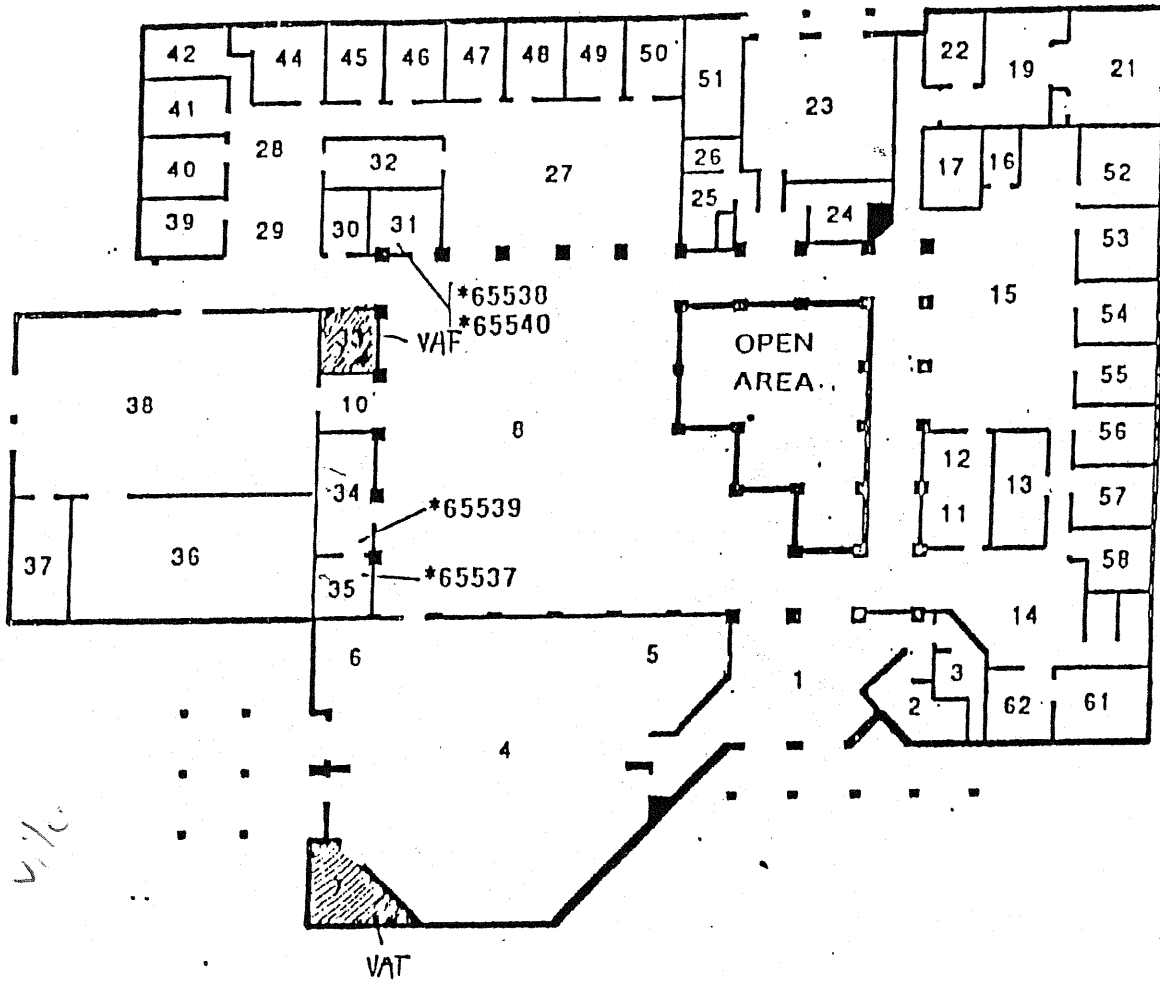

NORTH



SCALE: 1/30" = 1'-0"


BUSD

BERRYESSA UNION SCHOOL DISTRICT

DISTRICT OFFICE
1376 Piedmont Road
San Jose, CA

FIGURE #1

BUESD DISTRICT OFFICES
PAGE 2 OF 2
INSPECTED ON:

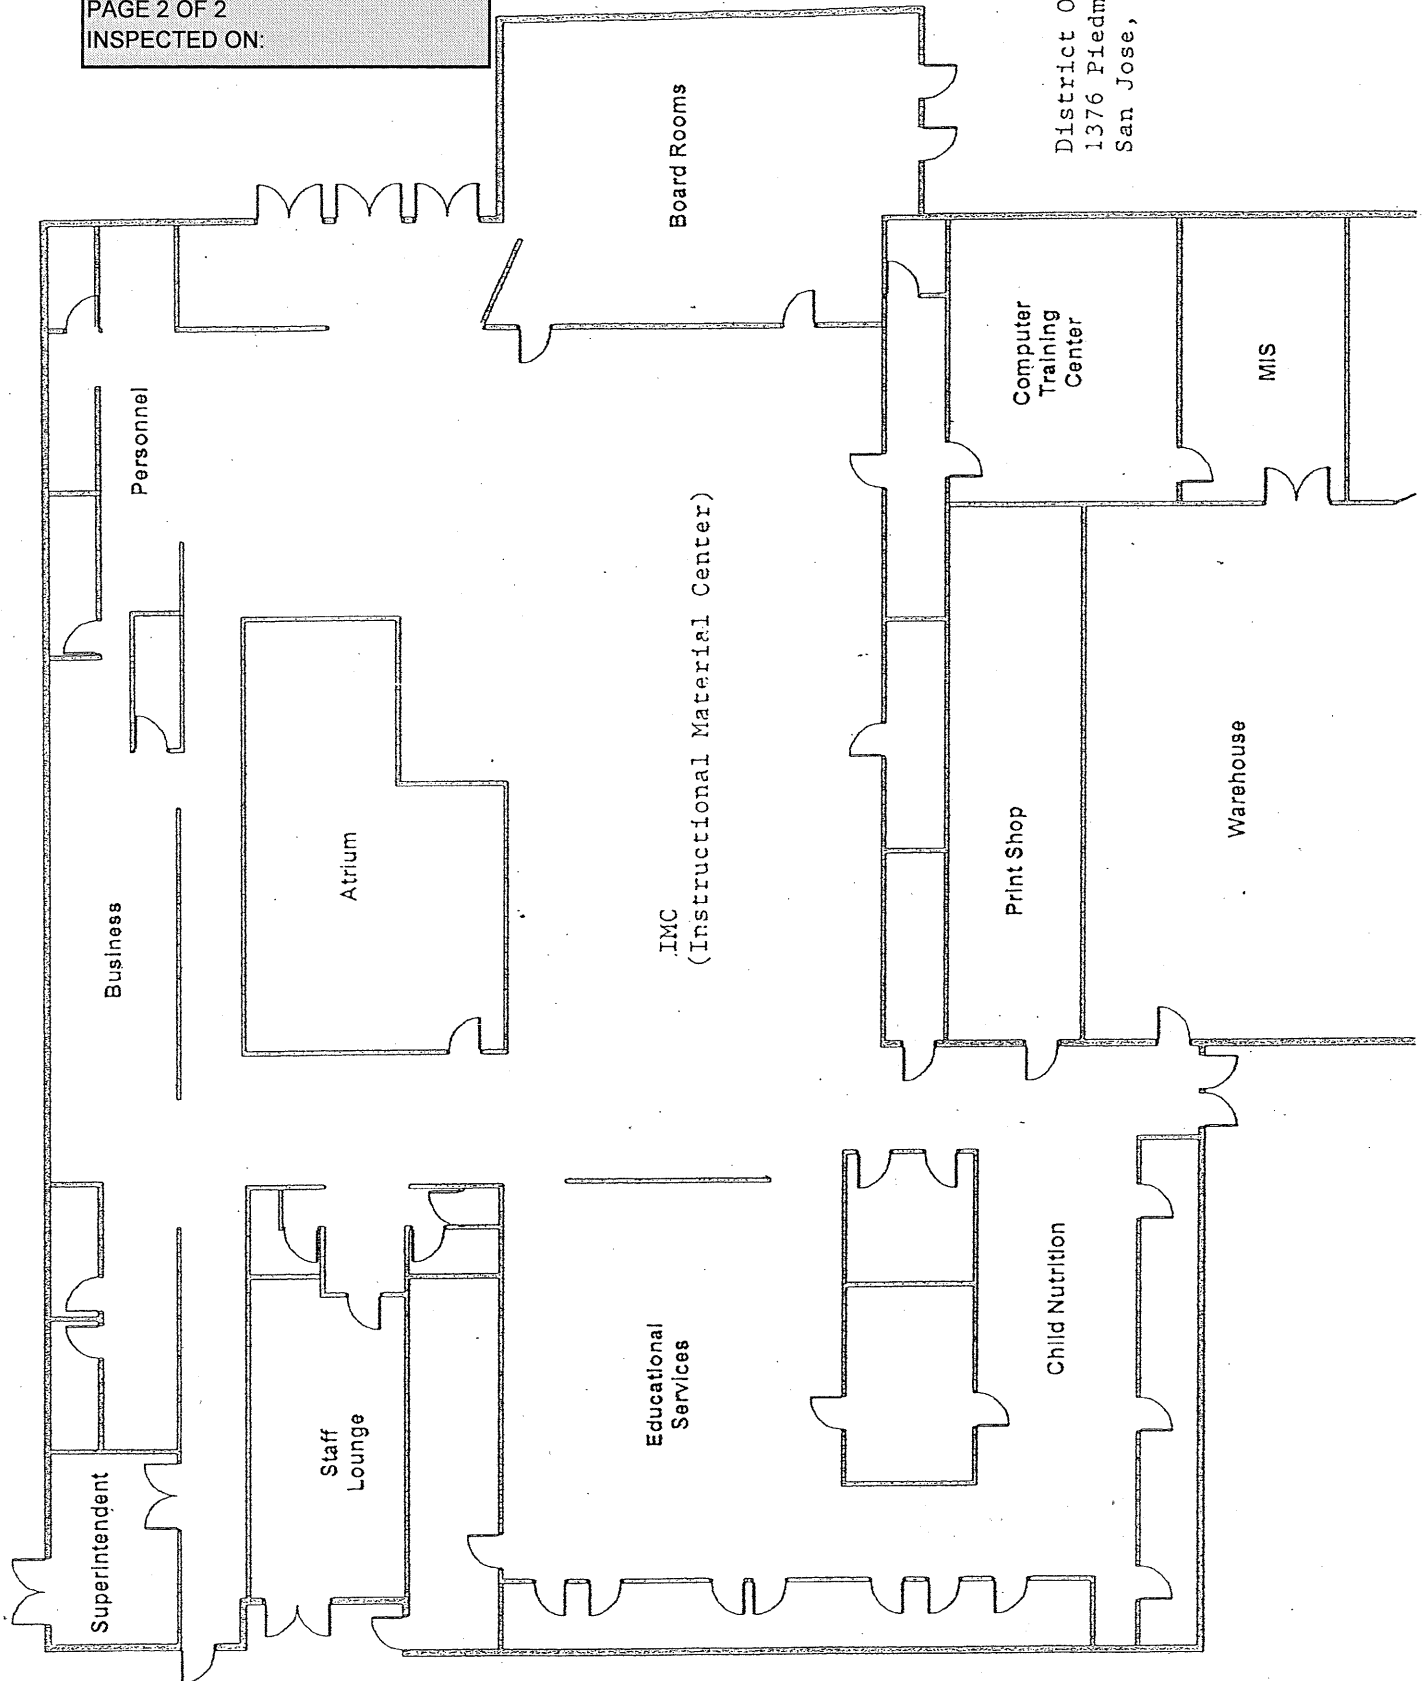


District Office
1376 Piedmont Rd.
San Jose, Ca. 95132

BUESD DISTRICT OFFICES

PAGE 1 OF 2

INSPECTED ON: 10/17/08

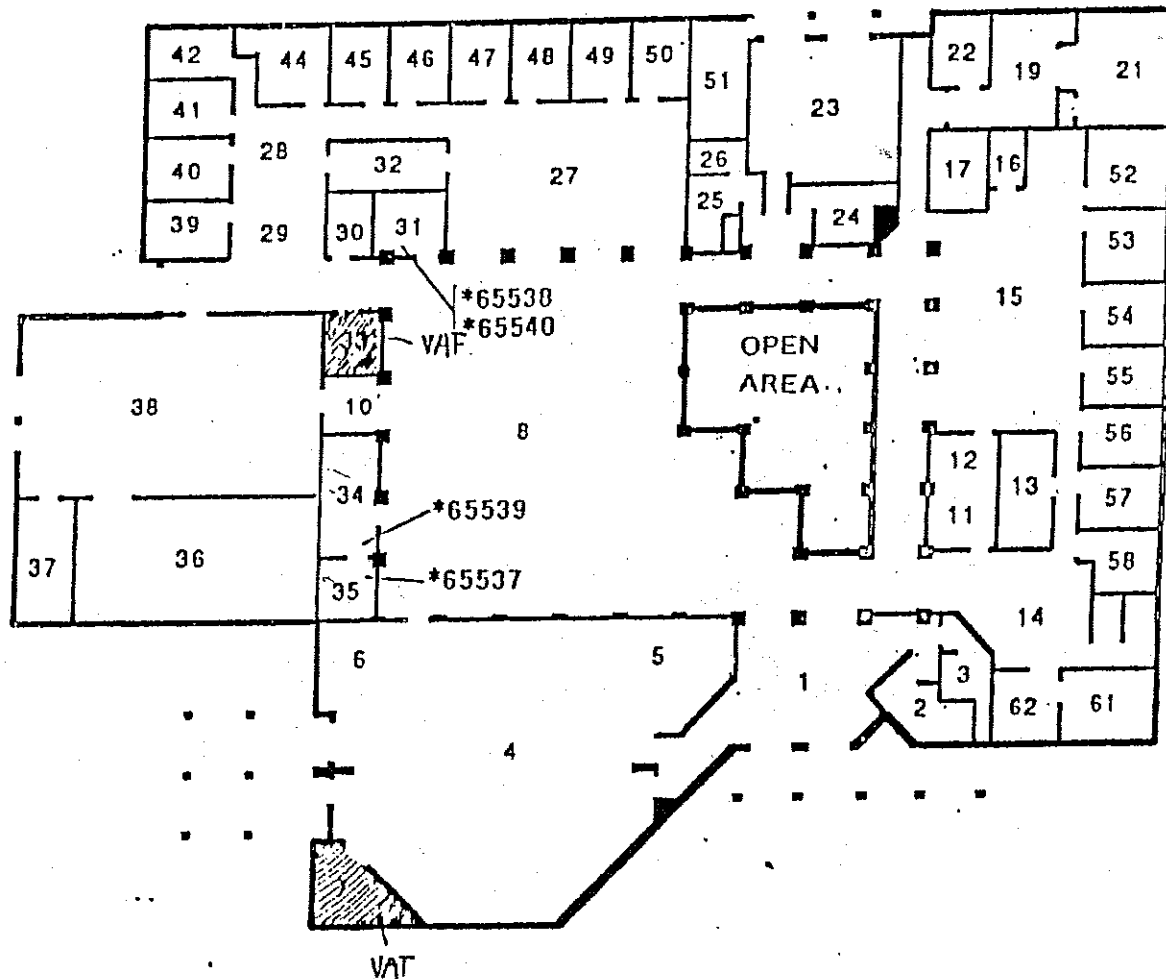

NORTH

0 10 25 50 100

SCALE: 1/30" = 1'-0"

BUSD

BERRYESSA UNION SCHOOL DISTRICT

DISTRICT OFFICE
1376 Piedmont Road
San Jose, CA


FIGURE #1

BUESD DISTRICT OFFICES

PAGE 2 OF 2

INSPECTED ON: 10/17/08


District Office
1376 Piedmont Rd.
San Jose, Ca. 95132

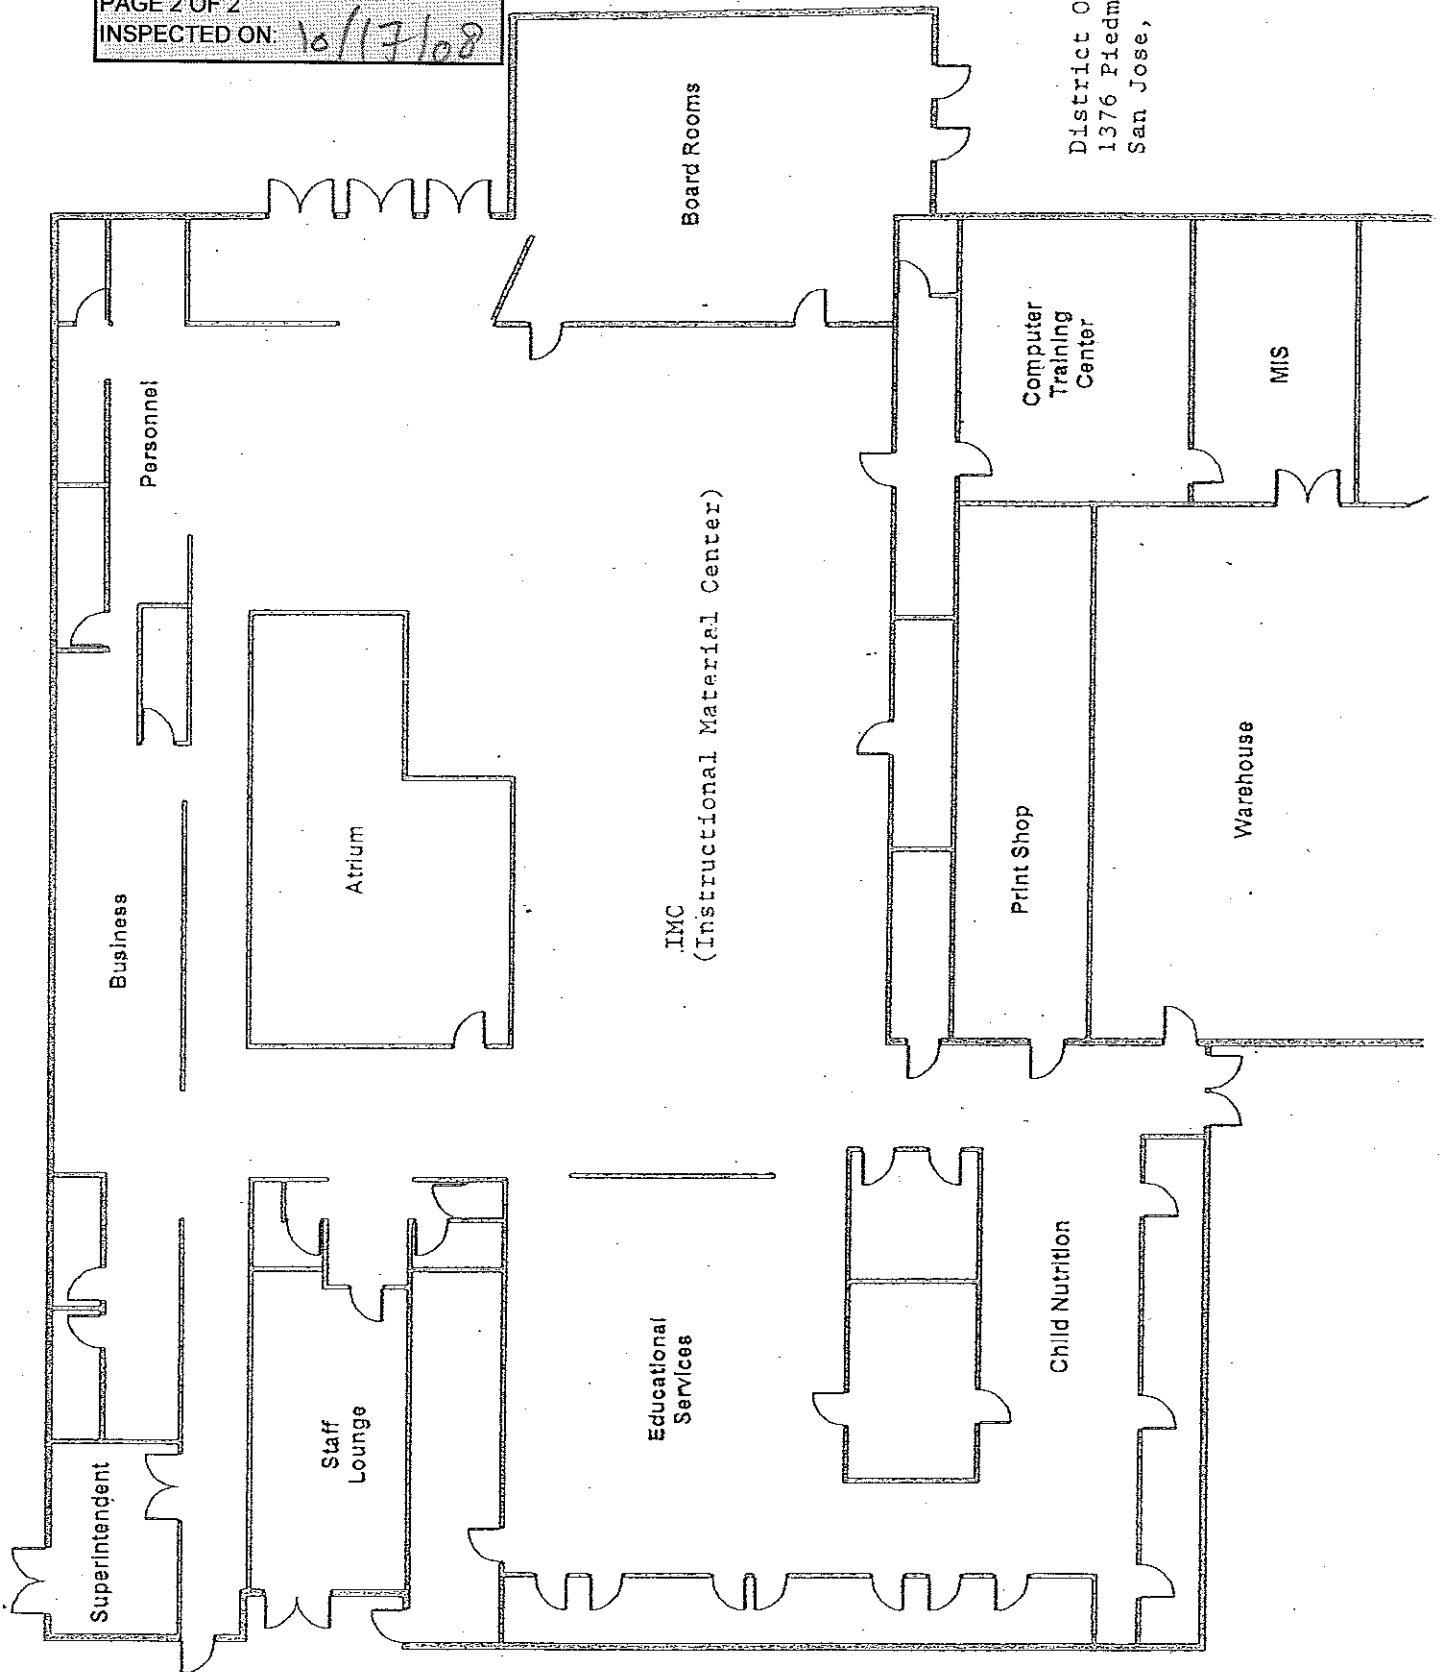


BUESD DISTRICT OFFICES

PAGE 1 OF 2

INSPECTED ON: 4-17-08

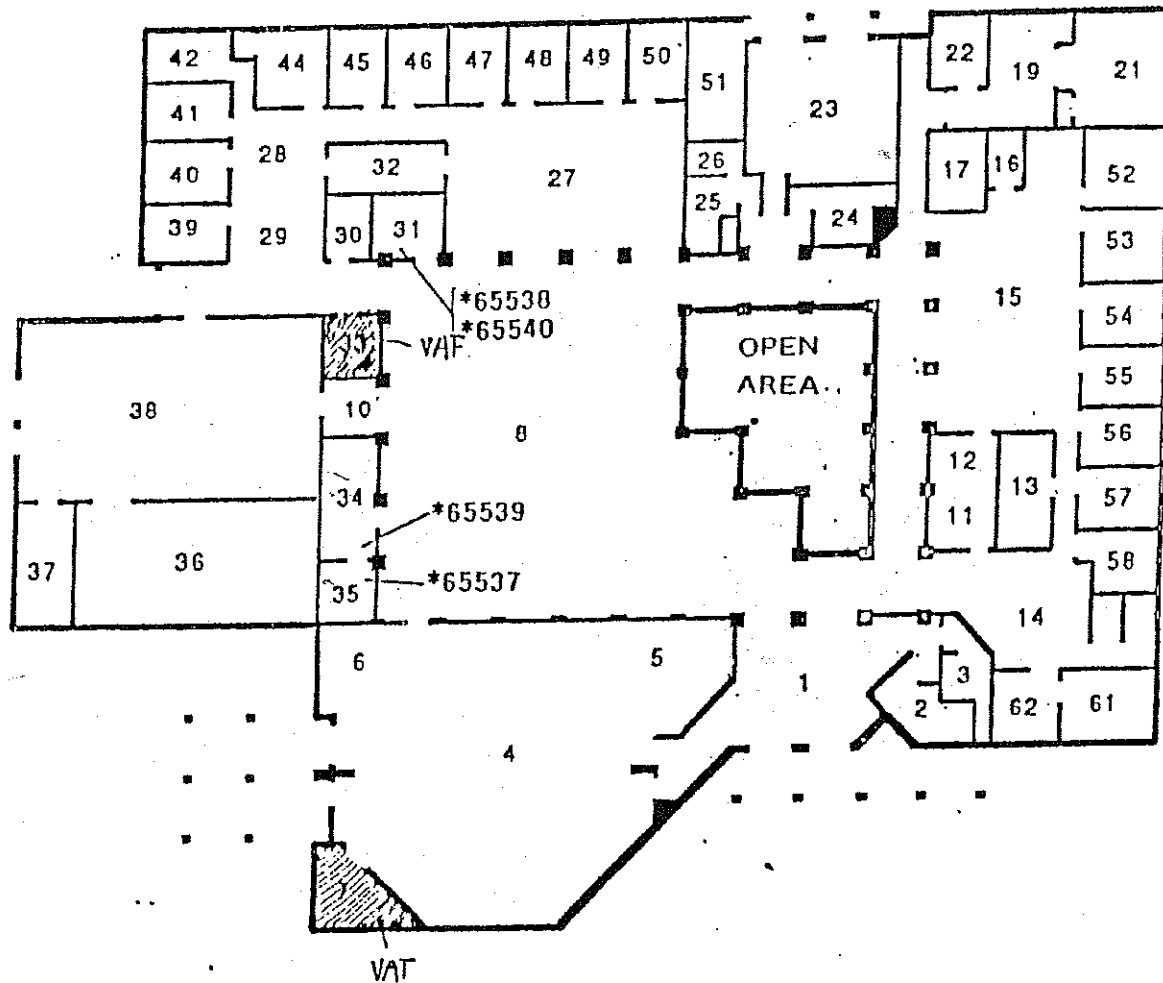

NORTH



SCALE: 1/30" = 1'-0"

BUSD


BERRYESSA UNION SCHOOL DISTRICT

DISTRICT OFFICE
1376 Piedmont Road
San Jose, CA

FIGURE #1

BUESD DISTRICT OFFICES
PAGE 2 OF 2
INSPECTED ON:


District Office
1376 Piedmont Rd.
San Jose, Ca. 95132

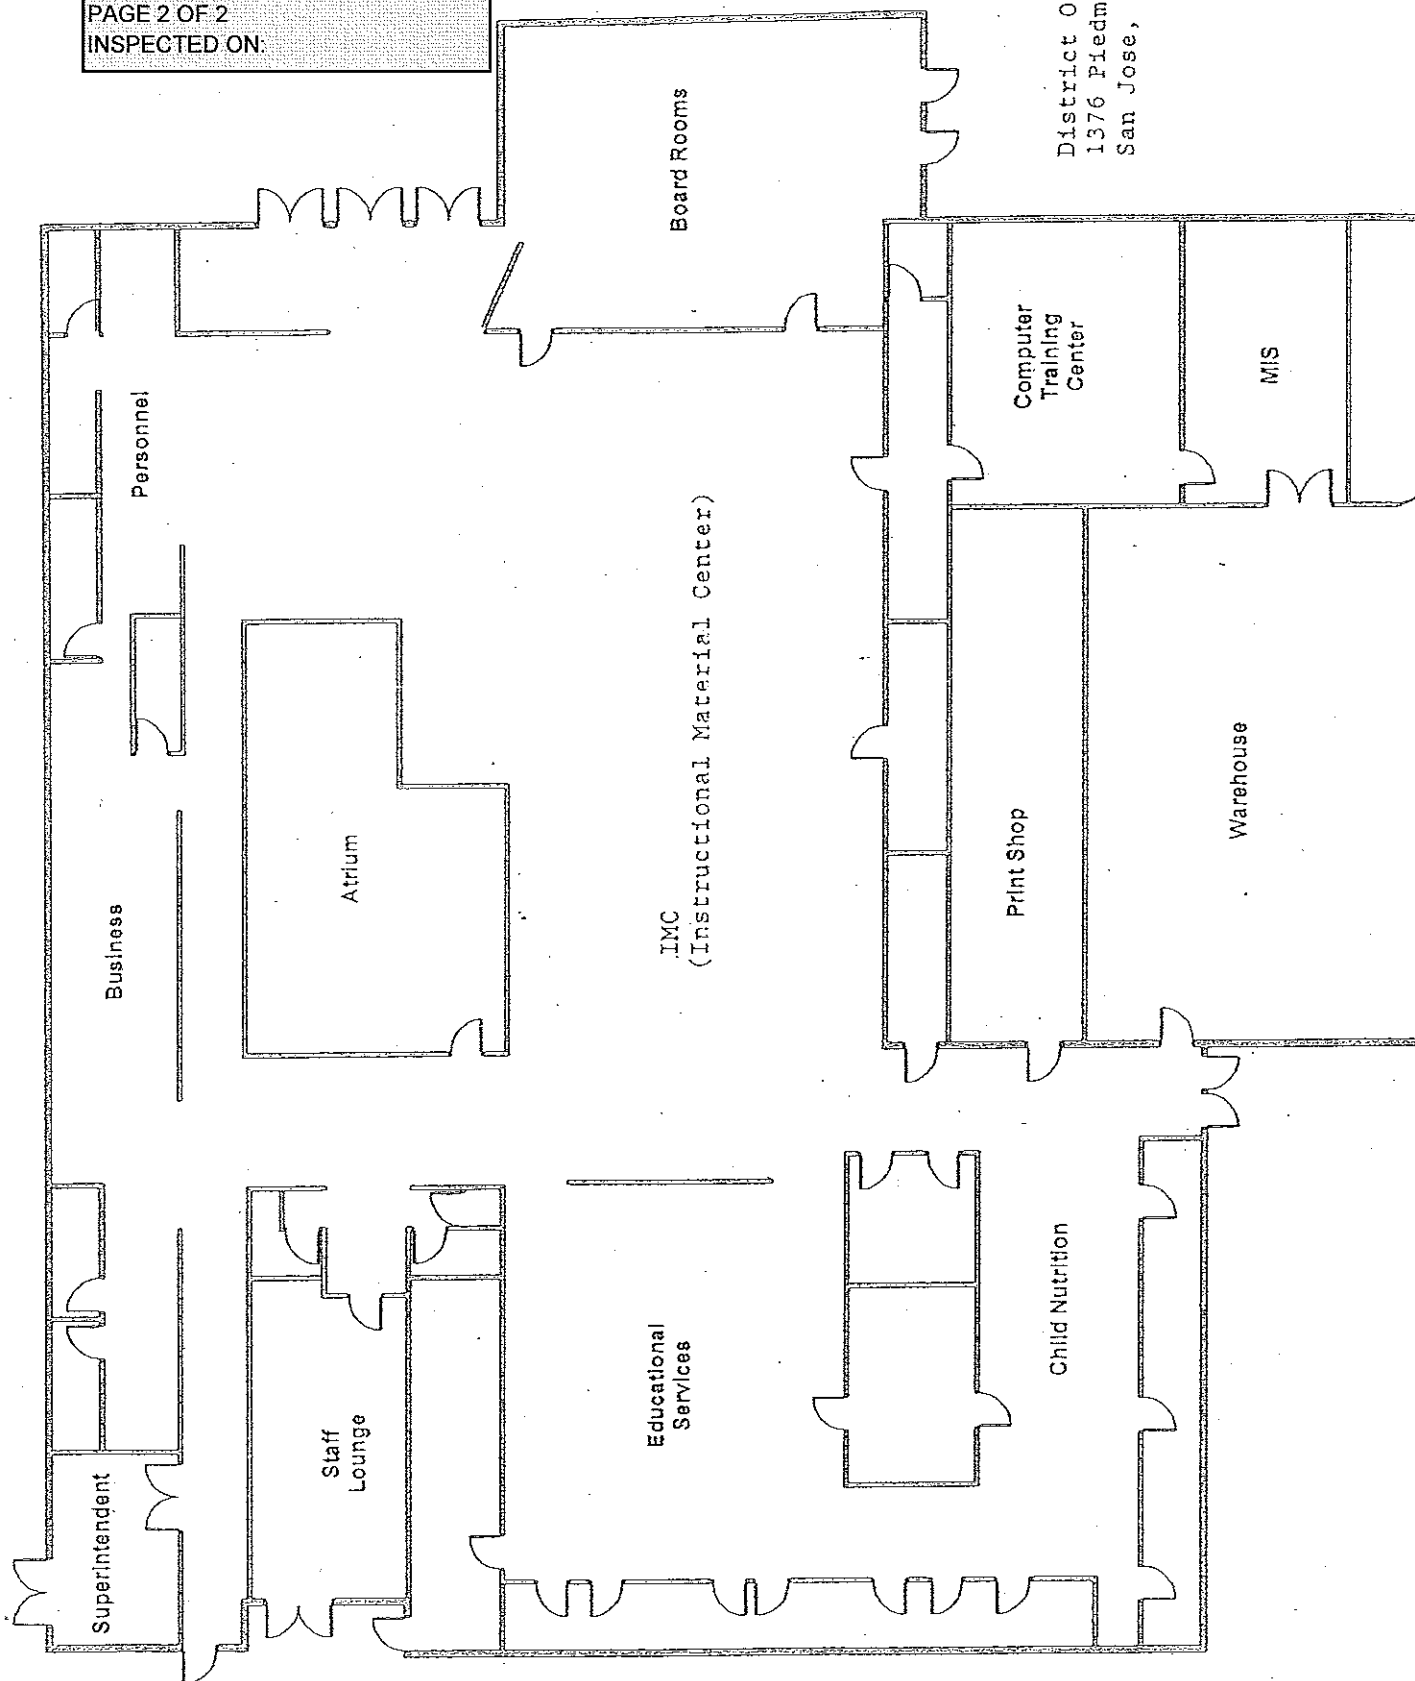

BUESD DISTRICT OFFICES

PAGE 1 OF 2

INSPECTED ON 11-09-07

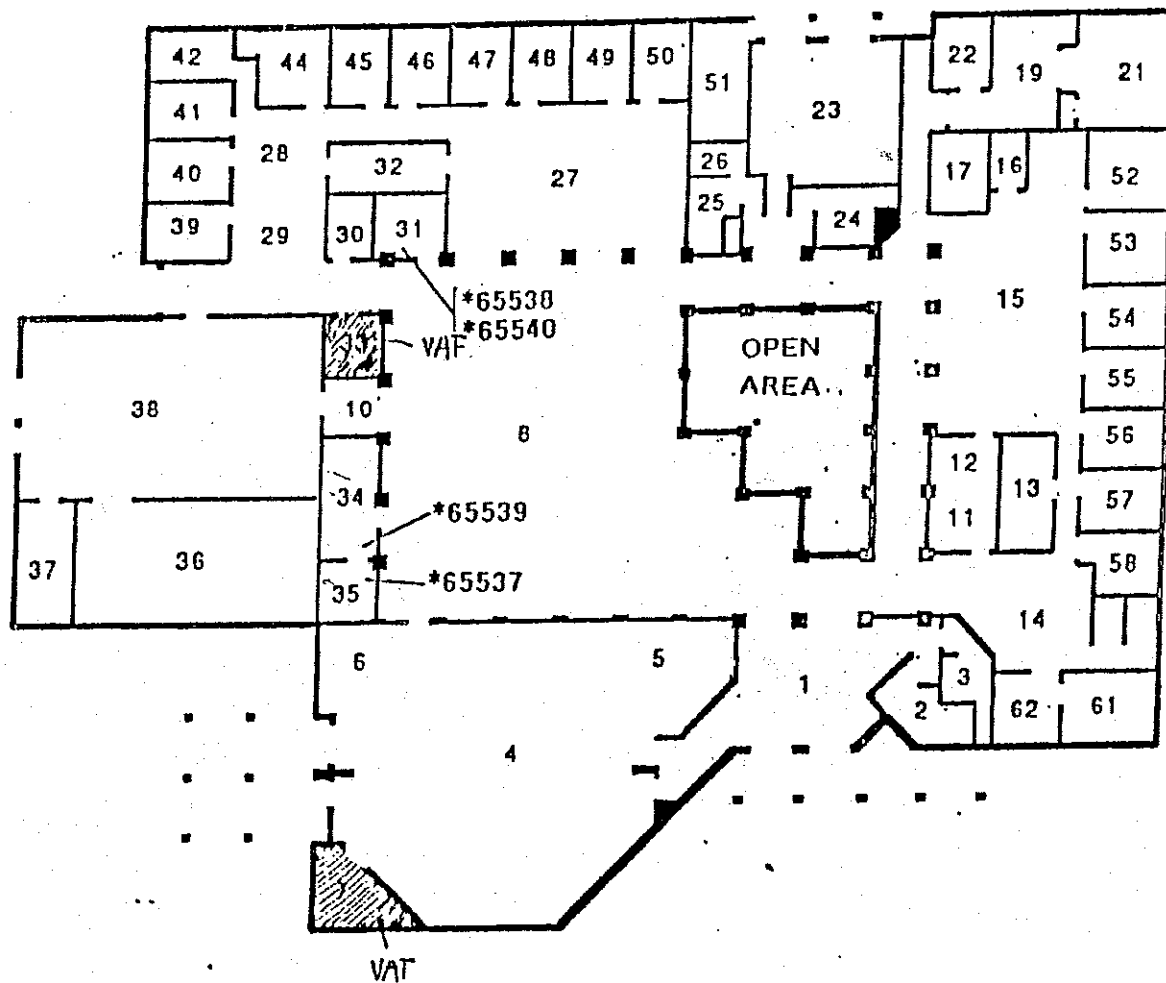

NORTH

0 10 25 50 100

SCALE: 1/30" = 1'-0"


BUSD

BERRYESSA UNION SCHOOL DISTRICT

DISTRICT OFFICE
1376 Piedmont Road
San Jose, CA


FIGURE #1

BUESD DISTRICT OFFICES
PAGE 2 OF 2
INSPECTED ON:

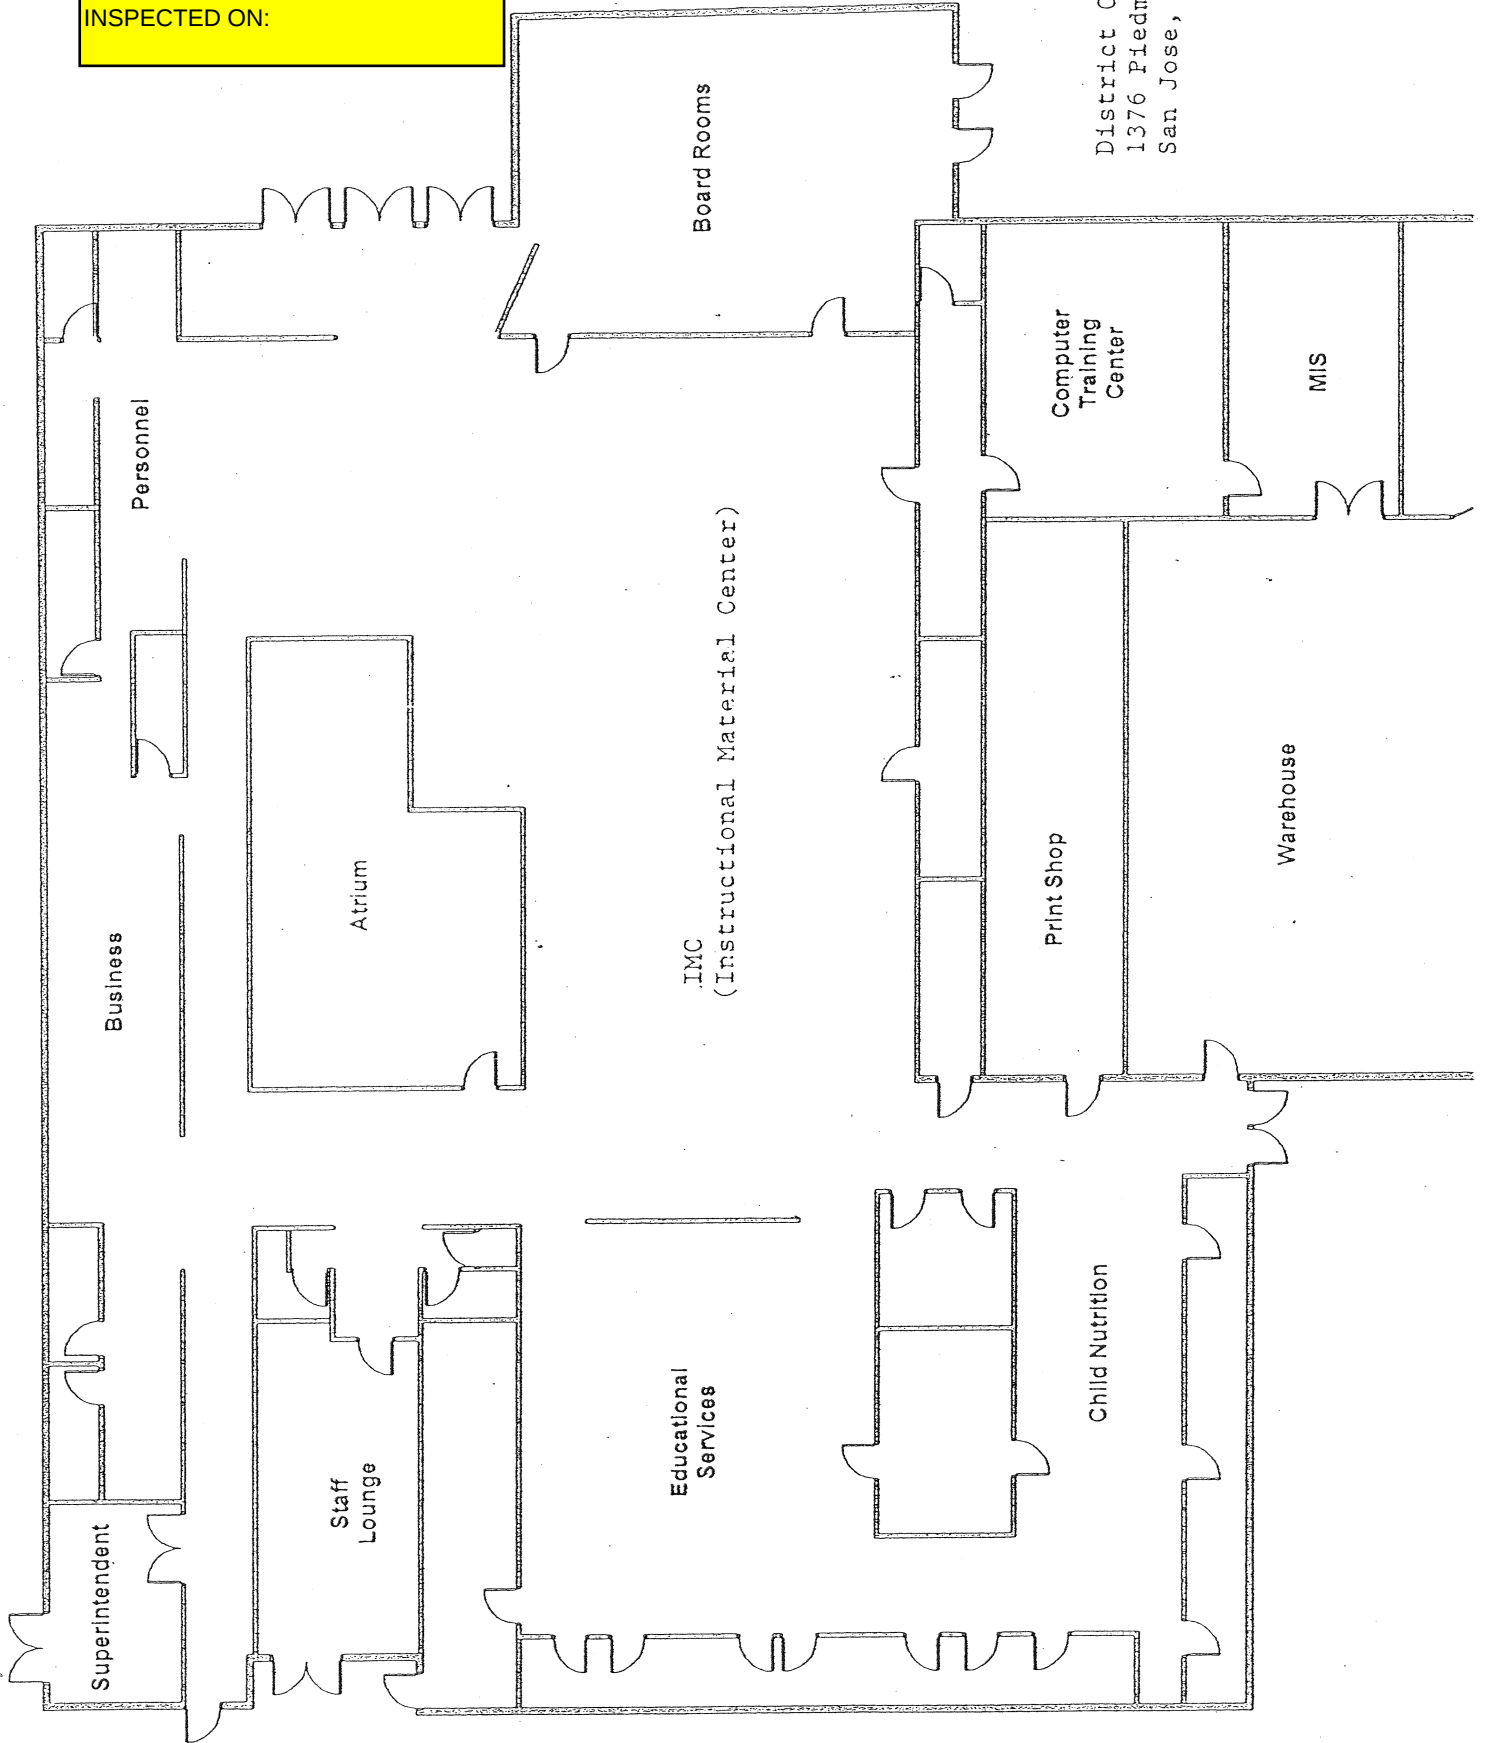

District Office
1376 Piedmont Rd.
San Jose, Ca. 95132

BUSD DISTRICT OFFICES
INSPECTED ON: 03/06/07

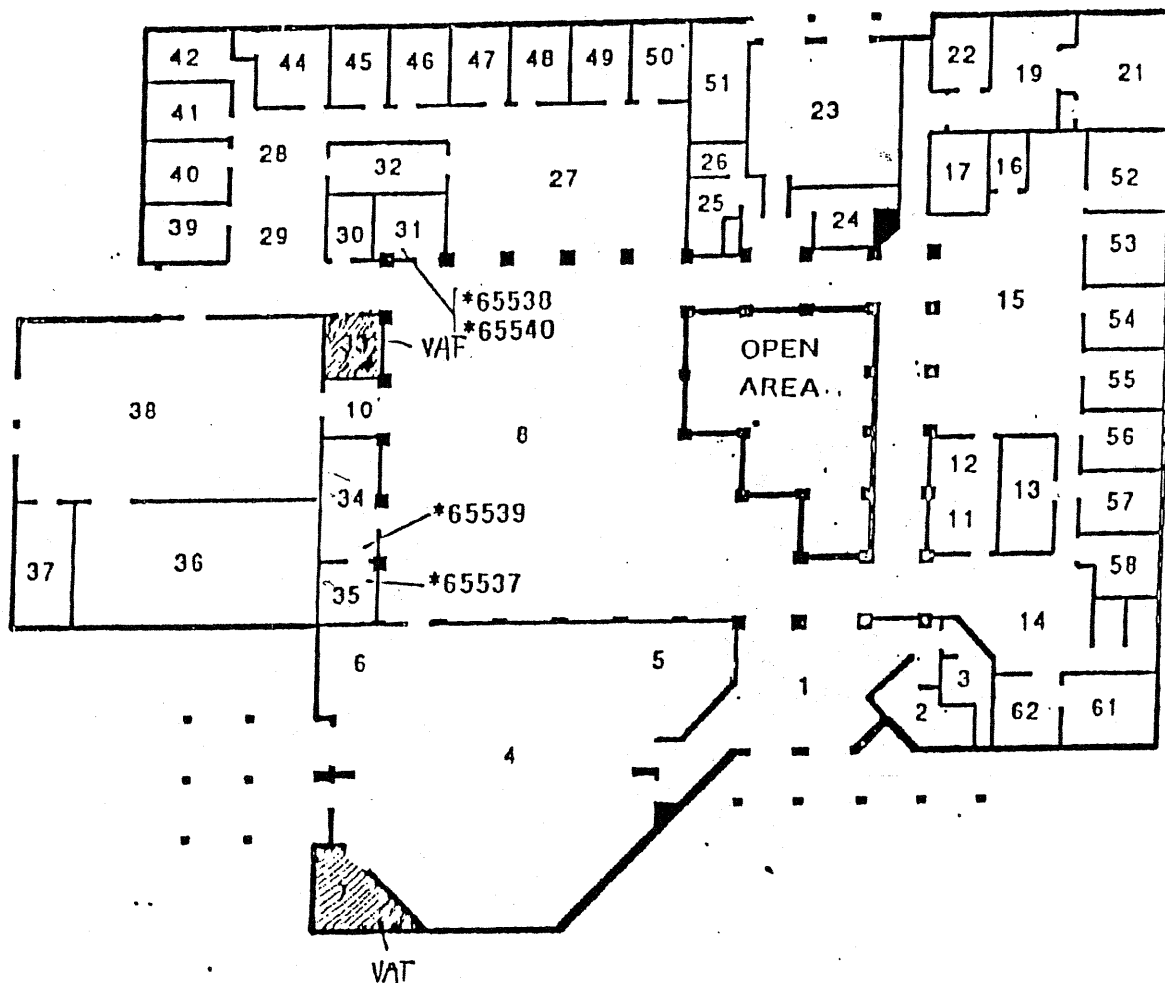

NORTH

0 10 25 50 100

SCALE: 1/30" = 1'-0"

BUSD

BERRYESSA UNION SCHOOL DISTRICT


DISTRICT OFFICE
1376 Piedmont Road
San Jose, CA

FIGURE #1

P02
06 223

BUSD DISTRICT OFFICES

INSPECTED ON: 08-23-06

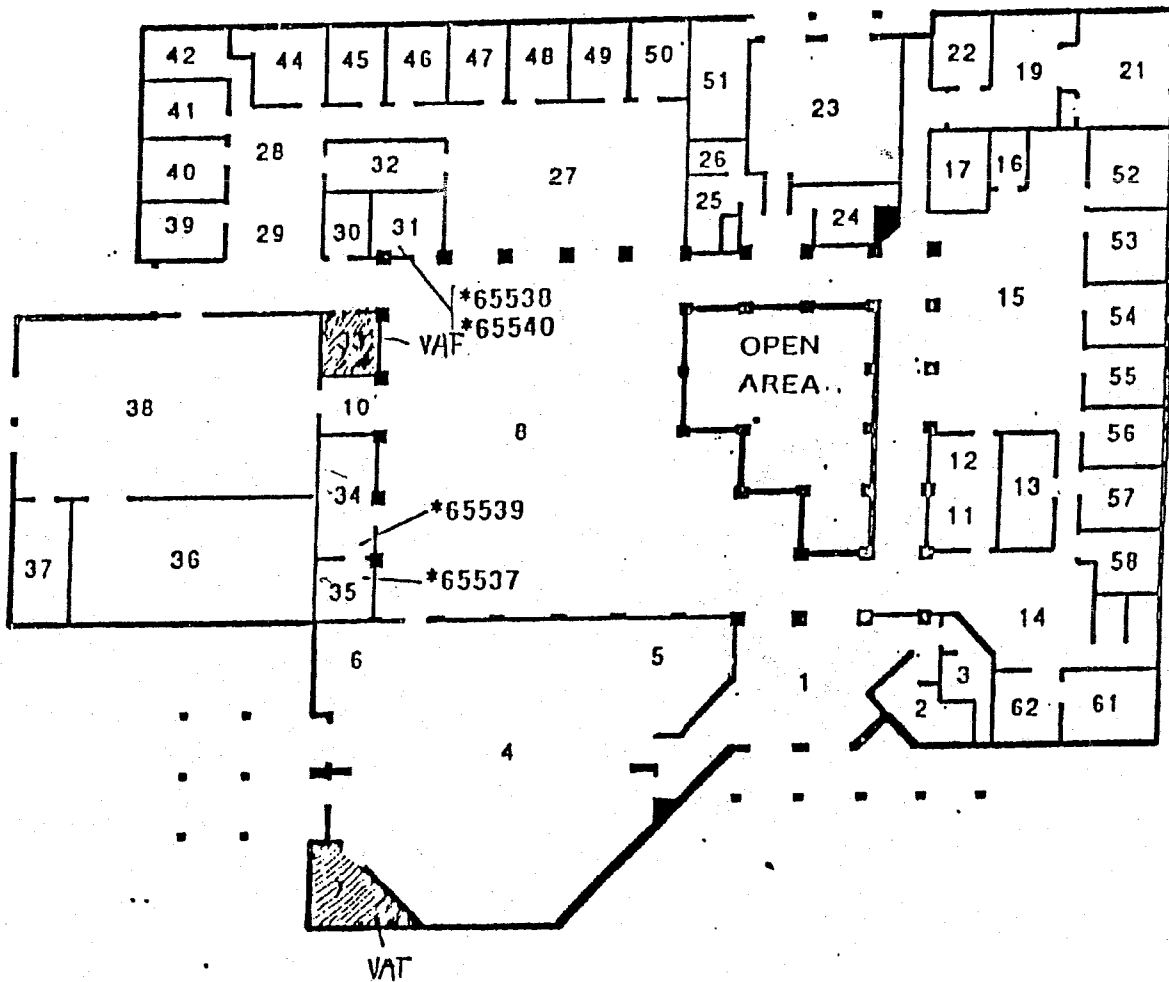

NORTH

0 10 25 50 100

SCALE: 1/30" = 1'-0"


BUSD

BERRYESSA UNION SCHOOL DISTRICT


DISTRICT OFFICE
1376 Piedmont Road
San Jose, CA

FIGURE #1

BUSD DISTRICT OFFICES
INSPECTED ON: 04/18/06

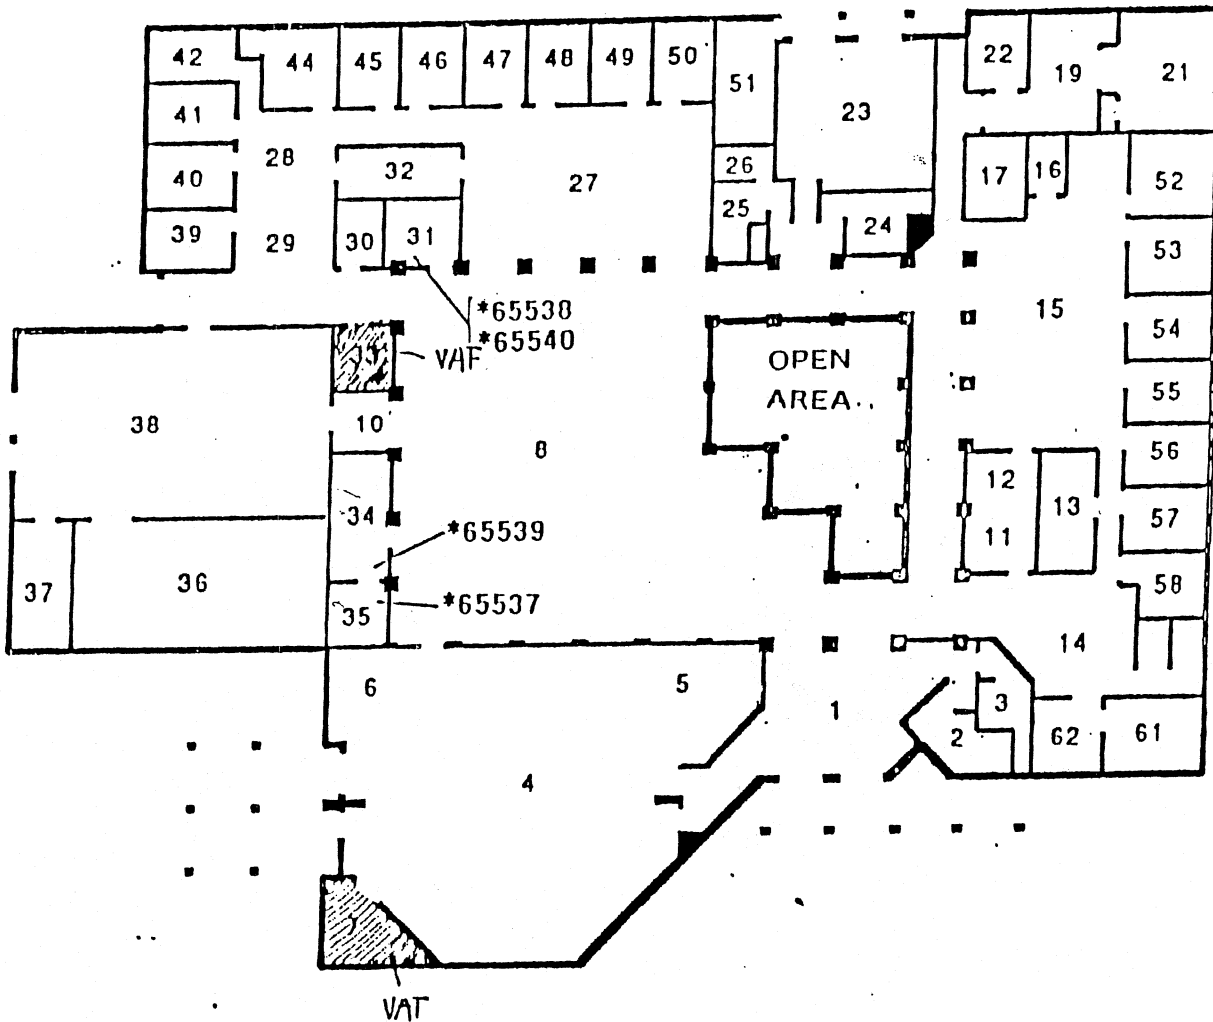

NORTH



SCALE: 1/30" = 1'-0"


BUSD

BERRYESSA UNION SCHOOL DISTRICT

DISTRICT OFFICE
1376 Piedmont Road
San Jose, CA

FIGURE #1

BUSD DISTRICT OFFICES
INSPECTED SEPTEMBER 2005

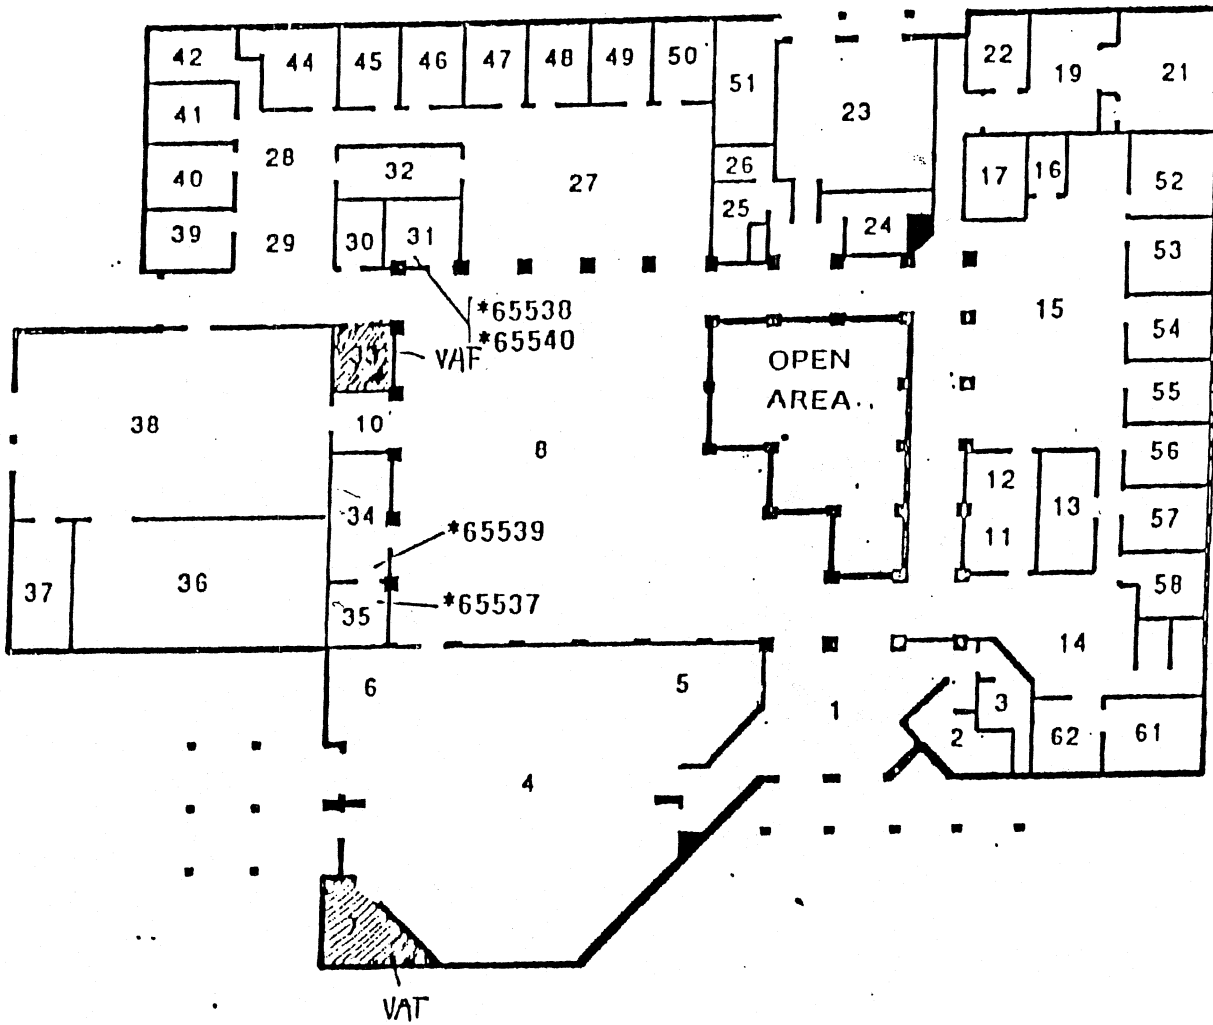

NORTH

0 10 25 50 100

SCALE: 1/30" = 1'-0"

BUSD

BERRYESSA UNION SCHOOL DISTRICT

DISTRICT OFFICE
1376 Piedmont Road
San Jose, CA

FIGURE #1