

SIX-MONTH SURVEILLANCE AHERA REPORT

**SUMMERDALE ELEMENTARY SCHOOL
1100 SUMMERDALE DRIVE
SAN JOSE, CA 95132**

**PREPARED FOR:
BERRYESSA UNION ELEMENTARY SCHOOL DISTRICT
981 RIDDER PARK DRIVE SAN JOSE, CA 95131
SAN JOSE, CA 95132**

**INSPECTED ON:
FEBRUARY 27, 2025**

HAZMAT DOC PROJECT #25-036

**PREPARED BY:
HAZMAT DOC
3080 OLCOTT STREET • SUITE D135
SANTA CLARA, CA 95054
Tel: 408.748.0055**

BERRYESSA UNION ELEMENTARY SCHOOL DISTRICT
SUMMERDALE ELEMENTARY SCHOOL

INSPECTED ON:
FEBRUARY 27, 2025

INSPECTED BY:



Leland Kafeyan
Cal/OSHA Certified Site Surveillance Technician
Certification Number 06-4110

REPORTED BY:

Maheen B. Doctor

Maheen B. Doctor
Cal/OSHA Certified Asbestos Consultant
Certification Number 95-1798

CONTENTS

PART - I

LEGEND AND GLOSSARY OF TERMS

PART - II

AHERA REPORT A – LIST OF BUILDINGS

PART - III

AHERA REPORT B – SURVEY REPORT

PART - IV

HOMOGENEOUS MATERIALS REPORT

PART - V

FRIABLE LOCATIONS REPORT

PART - VI

NON-FRIABLE LOCATIONS REPORT

PART - VII

RECOMMENDATIONS REPORT

PART - VIII

SAMPLES REPORT

PART - IX

DAMAGE REPORT

PART - X

SITE MAPS

LEGEND

THE FOLLOWING IS A LIST OF ABBREVIATIONS USED IN THIS REPORT:

Asbestos Sample Types

AC	=	ACTINOLITE
AM	=	AMOSITE
AN	=	ANTHOPHYLLITE
CH	=	CHRYBOTILE
CR	=	CROCIDOLITE
TR	=	TREMOLITE
ND	=	NONE DETECTED
NS	=	NO SAMPLE

Measurements

APPROX.	=	APPROXIMATELY
EA	=	EACH
I	=	INCHES
LF	=	LINEAR FEET
N	=	NUMBER
O.D.	=	OUTSIDE DIAMETER
SF	=	SQUARE FEET
TBD	=	TO BE DETERMINED

LIST OF BUILDINGS AT

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME BUILDING USED AS (#FLOORS) CONSTRUCTION		BUILDING AREA (APPROXIMATE)
CLASSROOMS 01 PORTABLE BUILDING		
Classroom		960 SF
(1)	Wood and Metal Portable	
CLASSROOMS 02 PORTABLE BUILDING		
Classroom		960 SF
(1)	Wood and Metal Portable	
CLASSROOMS 03 PORTABLE BUILDING		
Classroom		960 SF
(1)	Wood and Metal Portable	
CLASSROOMS 04-07 PORTABLE BUILDING		
Classrooms		3,840 SF
(1)	Wood and Metal Portables	
MAIN BUILDING		
Classrooms, Offices, Kitchen, Multi-Purpose Room, Library, Restrooms, Storages		29,700 SF
(1)	Wood, Metal, Plaster, Gypsum Wallboard System, Concrete	
METAL STORAGE CONTAINERS		
Storage		640 SF
(1)	Storage	
PLASTIC SHED STORAGE CONTAINER		
Storage		60 SF
(1)	Hard Plastic	
Total Number Of Buildings : 7		(Approximate) Total Sq Ft. : 37,120
End Of Report, Total Of 1 Pages		

SURVEY REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

CLASSROOMS 01 PORTABLE BUILDING

CLASSROOMS 01 PORTABLE BUILDING

09/08/2005	BUILDING NOTES:
09/08/2005	Manufacturer's TAG Info: BY DESIGN MOBILE SYSTEM INC; DATE: 07/94; OSA# 61920; SERIAL# 3282-1, 3282-2. This Entry for informational and tracking purposes.
03/05/2007	Building Name changed from PORTABLE 1 to CLASSROOMS 1 PORTABLE BUILDING. No other changes as of this date.

CLASSROOMS 01 PORTABLE BUILDING

PORTABLE 1

PORTABLE BUILDING

960 SF

09/08/2005	New 1994 Construction Relocatable Building per Manufacturer's Tag information.
03/05/2014	This Material is unchanged as of this date.
08/27/2014	This Material is unchanged as of this date.
03/17/2015	This Material is unchanged as of this date.
02/04/2020	This Material is unchanged as of this date.
08/28/2020	This Material is unchanged as of this date.
02/10/2021	This Material is unchanged as of this date.
08/11/2021	This Material is unchanged as of this date.
02/18/2022	This Material is unchanged as of this date.
08/17/2022	This Material is unchanged as of this date.
02/15/2023	This Material is unchanged as of this date.
08/16/2023	This Material is unchanged as of this date.
02/14/2024	This Material is unchanged as of this date.
08/14/2024	This Material is unchanged as of this date.
02/27/2025	This Material is unchanged as of this date.

SURVEY REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.

ASBESTOS CONTENT

ASBESTOS NAME

ASBESTOS CODE

CLASSROOMS 02 PORTABLE BUILDING

CLASSROOMS 02 PORTABLE BUILDING

09/08/2005 BUILDING NOTES:

09/08/2005 Manufacturer's TAG info: BY DESIGN MOBILE SYSTEM INC; DATE: 07/94; OSA# 61920; SERIAL# 3283-1, 3283-2. This entry for informational and tracking purposes.

03/05/2007 Building Name changed from PORTABLE 2 to CLASSROOMS 2 PORTABLE BUILDING. No other changes as of this date.

CLASSROOMS 02 PORTABLE BUILDING

PORTABLE 2

PORTABLE BUILDING

960 SF

09/08/2005 New 1994 Construction relocatable building per Manufacturer's Tag information.

02/04/2020 This Material is unchanged as of this date.

08/28/2020 This Material is unchanged as of this date.

02/10/2021 This Material is unchanged as of this date.

08/11/2021 This Material is unchanged as of this date.

02/18/2022 This Material is unchanged as of this date.

08/17/2022 This Material is unchanged as of this date.

02/15/2023 This Material is unchanged as of this date.

08/16/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

08/14/2024 This Material is unchanged as of this date.

02/27/2025 This Material is unchanged as of this date.

SURVEY REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

COMMENTS

QTY (APPROXIMATE)

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

CLASSROOMS 02 PORTABLE BUILDING

PORTABLE P2

BASEBOARD MASTIC

50 SF

02/08/2016 White Mastic/Adhesive for 4" Black Baseboard (Original Entry Updated 8/17/22). Sample 16-032-SA098 collected from Portable P2, Baseboard Beige White Mastic.

02/06/2019 Material Re-assessed. Quantity changed from 960 SF to 50 SF. No other changes as of this date.

02/04/2020 This Material is unchanged as of this date.

08/28/2020 This Material is unchanged as of this date.

02/10/2021 This Material is unchanged as of this date.

08/11/2021 This Material is unchanged as of this date.

08/17/2022 Material Re-Assessed. Material not observed, Material may exist behind current 4" Black Baseboard. No other changes as of this date.

02/15/2023 This Material is unchanged as of this date.

08/16/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

08/14/2024 This Material is unchanged as of this date.

02/27/2025 This Material is unchanged as of this date.

16-032-SA098	ND	NONE DETECTED	(ND)
--------------	----	---------------	--------

CLASSROOMS 02 PORTABLE BUILDING

PORTABLE P2

CARPET MASTIC

960 SF

02/08/2016 Yellow Brown Mastic/Adhesive for 95% Gray Black Carpet and 5% Brown Carpet by Entry (Original Entry Updated 8/17/22). Sample 16-032-SA099 collected from Portable P2, Yellow Brown Floor Carpet Mastic.

02/04/2020 This Material is unchanged as of this date.

08/28/2020 This Material is unchanged as of this date.

02/10/2021 This Material is unchanged as of this date.

08/11/2021 This Material is unchanged as of this date.

SURVEY REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
08/17/2022	Material Re-Assessed. Material not observed, Material may exist under current 95% Gray Black Carpet and 5% Brown Carpet by Entry. No other changes as of this date.		
02/15/2023	This Material is unchanged as of this date.		
08/16/2023	This Material is unchanged as of this date.		
02/14/2024	This Material is unchanged as of this date.		
08/14/2024	This Material is unchanged as of this date.		
02/27/2025	This Material is unchanged as of this date.		
16-032-SA099	ND	NONE DETECTED	(ND)

SURVEY REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

CLASSROOMS 03 PORTABLE BUILDING

CLASSROOMS 03 PORTABLE BUILDING

09/08/2005	BUILDING NOTES:
09/08/2005	Manufacturer's TAG Info: BY AMERICAN MODULAR SYSTEM; DATE: 07/96; OSA# 65132; SERIAL# 96-R243-003A, 96-R243-003B. Thsi entry for informational and tracking purposes.
03/05/2007	Building Name changed from PORTABLE 3 to CLASSROOMS 3 PORTABLE BUILDING. No other changes as of this date.

CLASSROOMS 03 PORTABLE BUILDING

PORTABLE 3

PORTABLE BUILDING

960 SF

09/08/2005	New 1996 Construction Relocatable Building per manufacturer's tag information.
02/04/2020	This Material is unchanged as of this date.
08/28/2020	This Material is unchanged as of this date.
02/10/2021	This Material is unchanged as of this date.
08/11/2021	This Material is unchanged as of this date.
02/18/2022	This Material is unchanged as of this date.
08/17/2022	This Material is unchanged as of this date.
02/15/2023	This Material is unchanged as of this date.
08/16/2023	This Material is unchanged as of this date.
02/14/2024	This Material is unchanged as of this date.
08/14/2024	This Material is unchanged as of this date.
02/27/2025	This Material is unchanged as of this date.

SURVEY REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

CLASSROOMS 03 PORTABLE BUILDING

PORTABLE P3

BASEBOARD MASTIC

960 SF

02/08/2016	Beige Green Mastic for 4" Black Baseboard (Original Entry Updated 8/17/22). Sample 16-032-SA100 collected from Portable P3, Baseboard Beige Green Mastic.
02/04/2020	This Material is unchanged as of this date.
08/28/2020	This Material is unchanged as of this date.
02/10/2021	This Material is unchanged as of this date.
08/11/2021	This Material is unchanged as of this date.
02/18/2022	This Material is unchanged as of this date.
08/17/2022	Material Re-Assessed. Material not observed, Material may exist behind current 4" Black Baseboard. No other changes as of this date.
02/15/2023	This Material is unchanged as of this date.
08/16/2023	This Material is unchanged as of this date.
02/14/2024	This Material is unchanged as of this date.
08/14/2024	This Material is unchanged as of this date.
02/27/2025	This Material is unchanged as of this date.

16-032-SA100	ND	NONE DETECTED	(ND)
--------------	----	---------------	--------

CLASSROOMS 03 PORTABLE BUILDING

PORTABLE P3

CARPET MASTIC

960 SF

02/08/2016	Yellow Brown Mastic for 95% Gray Black Carpet and 5% Brown Carpet by Entry (Original Entry Updated 8/17/22). Sample 16-032-SA101 collected from Portable P3, Carpet Yellow Brown Mastic.
02/04/2020	This Material is unchanged as of this date.
08/28/2020	This Material is unchanged as of this date.
02/10/2021	This Material is unchanged as of this date.
08/11/2021	This Material is unchanged as of this date.

SURVEY REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	Material Re-Assessed. Material not observed, Material may exist under current 95% Gray Black Carpet and 5% Brown Carpet by Entry. No other changes as of this date.		
02/15/2023	This Material is unchanged as of this date.		
08/16/2023	This Material is unchanged as of this date.		
02/14/2024	This Material is unchanged as of this date.		
08/14/2024	This Material is unchanged as of this date.		
02/27/2025	This Material is unchanged as of this date.		
16-032-SA101	ND	NONE DETECTED	(ND)

SURVEY REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME	
LOCATION	
MATERIAL TYPE	QTY (APPROXIMATE)
COMMENTS	

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

CLASSROOMS 04-07 PORTABLE BUILDING

CLASSROOMS 04-07 PORTABLE BUILDING

04/17/2006	BUILDING NOTES:
04/19/2006	Manufacturer's TAG Info: BY AMERICAN MODULAR SYSTEM; DATE: 05/05; OSA# 01-107067; SERIAL#'S Portable 4 = 05-107-003A, 05-107-003B; Portable 5 = 05-107-006A, 05-107-006B; Portable 6 = 05-107-004A, 05-107-004B; Portable 7 = 05-107-005A, 05-107-005B. This entry for informational and tracking purposes.
03/05/2007	Building Name changed from PORTABLES 4-7 to CLASSROOMS 4-7 PORTABLE BUILDING. No other changes as of this date.
11/30/2011	Portable 5 is now Portable 7; Portable 6, now Portable 5; Portable 7, now Portable 6.

CLASSROOMS 04-07 PORTABLE BUILDING

PORTABLE P7

BASEBOARD MASTIC

50 SF

02/08/2016	Mastic/Adhesive for 4" Black Baseboard (Original Entry Updated 8/17/22). Sample 16-032-SA102 collected from Portable P7, Baseboard Off-White Mastic.
02/06/2019	Material Re-assessed. Quantity changed from 960 SF to 50 SF. No other changes as of this date.
02/04/2020	This Material is unchanged as of this date.
08/28/2020	This Material is unchanged as of this date.
02/10/2021	This Material is unchanged as of this date.
08/11/2021	This Material is unchanged as of this date.
02/18/2022	This Material is unchanged as of this date.
08/17/2022	Material Re-Assessed. Material not observed, Material may exist behind current 4" Black Baseboard. No other changes as of this date.
02/15/2023	This Material is unchanged as of this date.
08/16/2023	This Material is unchanged as of this date.
02/14/2024	This Material is unchanged as of this date.
08/14/2024	This Material is unchanged as of this date.

SURVEY REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/27/2025 This Material is unchanged as of this date.

16-032-SA102	ND	NONE DETECTED	(ND)
--------------	----	---------------	--------

CLASSROOMS 04-07 PORTABLE BUILDING

PORTABLE P7

CARPET MASTIC

960 SF

02/08/2016 Mastic/Adhesive for 95% Gray Black Carpet and 5% Brown Carpet by Entry (Original Entry Updated 8/17/22). Sample 16-032-SA103 collected from Portable P7, Carpet, Yellow Mastic.

02/04/2020 This Material is unchanged as of this date.

08/28/2020 This Material is unchanged as of this date.

02/10/2021 This Material is unchanged as of this date.

08/11/2021 This Material is unchanged as of this date.

02/18/2022 This Material is unchanged as of this date.

08/17/2022 Material Re-Assessed. Material not observed, Material may exist under current 95% Gray Black Carpet and 5% Brown Carpet by Entry. No other changes as of this date.

02/15/2023 This Material is unchanged as of this date.

08/16/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

08/14/2024 This Material is unchanged as of this date.

02/27/2025 This Material is unchanged as of this date.

16-032-SA103	ND	NONE DETECTED	(ND)
--------------	----	---------------	--------

CLASSROOMS 04-07 PORTABLE BUILDING

PORTABLES 4-7

PORTABLE BUILDING

3,840 SF

09/08/2005 New 2005 Construction Relocatable Buildings per Manufacturer's Tag information.

02/04/2020 This Material is unchanged as of this date.

08/28/2020 This Material is unchanged as of this date.

SURVEY REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/10/2021 This Material is unchanged as of this date.

08/11/2021 This Material is unchanged as of this date.

02/18/2022 This Material is unchanged as of this date.

08/17/2022 This Material is unchanged as of this date.

02/15/2023 This Material is unchanged as of this date.

08/16/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

08/14/2024 This Material is unchanged as of this date.

02/27/2025 This Material is unchanged as of this date.

SURVEY REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

COMMENTS

QTY (APPROXIMATE)

SAMPLE NO.

ASBESTOS CONTENT

ASBESTOS NAME

ASBESTOS CODE

MAIN BUILDING

MAIN BUILDING

11/30/2011 BUILDING NOTES:

11/30/2011 Following Classroom numbers have changed:

B-1 now B-6; B-2 now B-5; B-3 now B-4
C-1 now C-7; C-2 now C-8; C-3 now C-9
D-1 now D-12; D-2 now D-11; D-3 now D-10
E-1 now E-13; E-2 now E-14; E-3 now E-15
F-1 now F-18; F-2 now F-17; F-3 now F-16.

09/18/2015 Following Classroom numbers have changed:

B-4 is now B-1, B-5 is now B-2, B-6 is now B-3, C-7 is now C-1, C-8 is now C-2, C-9 is now C-3, C-10 is now D-1, C-11 is now D-2,, C-12 is now D-3, C-13 is now E-3, C-14 is now E-2, C-15 is now E-1, C-16 is now F-1, C-17 is now F-2, and C-18 is now F-3

MAIN BUILDING

2 STUDENT RESTROOMS(EXTERIOR ACCESS) AND 2 STAFF RESTROOMS(BY STAFF LOUNGE)

EPOXY COATING

456 SF

03/29/2017 Green Epoxy Floor Coating Material. This Material is in GOOD condition as of this date.

02/04/2020 This Material is unchanged as of this date.

08/28/2020 This Material is unchanged as of this date.

02/10/2021 This Material is unchanged as of this date.

08/11/2021 This Material is unchanged as of this date.

02/18/2022 This Material is unchanged as of this date.

08/17/2022 This Material is unchanged as of this date.

02/15/2023 This Material is unchanged as of this date.

08/16/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

08/14/2024 This Material is unchanged as of this date.

02/27/2025 This Material is unchanged as of this date.

SF= Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

HazMat Doc

AHERA Report B - Survey

SURVEY REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
17-059AAA	NEW	NONE DETECTED	(ND)

MAIN BUILDING

2 STUDENT RESTROOMS(EXTERIOR ACCESS) AND 2 STAFF RESTROOMS(BY STAFF LOUNGE)

MORTAR MISCELLANEOUS

162 SF

03/29/2017 Grout/Mortar 1'x1' Multi-Colored Wall Tiles. This Material is in GOOD condition as of this date.

02/04/2020 This Material is unchanged as of this date.

08/28/2020 This Material is unchanged as of this date.

02/10/2021 This Material is unchanged as of this date.

08/11/2021 This Material is unchanged as of this date.

02/18/2022 This Material is unchanged as of this date.

08/17/2022 This Material is unchanged as of this date.

02/15/2023 This Material is unchanged as of this date.

08/16/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

08/14/2024 This Material is unchanged as of this date.

02/27/2025 This Material is unchanged as of this date.

17-059AAA	NEW	NONE DETECTED	(ND)
-----------	-----	---------------	--------

MAIN BUILDING

2 STUDENT RESTROOMS(EXTERIOR ACCESS) AND 2 STAFF RESTROOMS(BY STAFF LOUNGE)

MORTAR MISCELLANEOUS

324 SF

03/29/2017 Grout/Mortar 6'x6' Multi-Colored Wall Tiles. This Material is in GOOD condition as of this date.

02/04/2020 This Material is unchanged as of this date.

08/28/2020 This Material is unchanged as of this date.

02/10/2021 This Material is unchanged as of this date.

08/11/2021 This Material is unchanged as of this date.

SURVEY REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/18/2022 This Material is unchanged as of this date.

08/17/2022 This Material is unchanged as of this date.

02/15/2023 This Material is unchanged as of this date.

08/16/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

08/14/2024 This Material is unchanged as of this date.

02/27/2025 This Material is unchanged as of this date.

17-059AAA	NEW	NONE DETECTED	(ND)
-----------	-----	---------------	--------

MAIN BUILDING

2 STUDENT RESTROOMS(EXTERIOR ACCESS) AND 2 STAFF RESTROOMS(BY STAFF LOUNGE)

WALL TILE

800 SF

03/29/2017 1'x2' Beige Wall Tile. This Material is in GOOD condition as of this date.

02/04/2020 This Material is unchanged as of this date.

08/28/2020 This Material is unchanged as of this date.

02/10/2021 This Material is unchanged as of this date.

08/11/2021 This Material is unchanged as of this date.

02/18/2022 This Material is unchanged as of this date.

08/17/2022 This Material is unchanged as of this date.

02/15/2023 This Material is unchanged as of this date.

08/16/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

08/14/2024 This Material is unchanged as of this date.

02/27/2025 This Material is unchanged as of this date.

17-059AAA	NEW	NONE DETECTED	(ND)
-----------	-----	---------------	--------

SURVEY REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

MAIN BUILDING

2 STUDENT RESTROOMS(EXTERIOR ACCESS) AND 2 STAFF RESTROOMS(BY STAFF LOUNGE)

WALL TILE

162 SF

03/29/2017 1'x1' Multi-Colored Wall Tiles. This Material is in GOOD condition as of this date.

02/04/2020 This Material is unchanged as of this date.

08/28/2020 This Material is unchanged as of this date.

02/10/2021 This Material is unchanged as of this date.

08/11/2021 This Material is unchanged as of this date.

02/18/2022 This Material is unchanged as of this date.

08/17/2022 This Material is unchanged as of this date.

02/15/2023 This Material is unchanged as of this date.

08/16/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

08/14/2024 This Material is unchanged as of this date.

02/27/2025 This Material is unchanged as of this date.

17-059AAA	NEW	NONE DETECTED	(ND)
-----------	-----	---------------	--------

MAIN BUILDING

2 STUDENT RESTROOMS(EXTERIOR ACCESS) AND 2 STAFF RESTROOMS(BY STAFF LOUNGE)

WALL TILE

324 SF

03/29/2017 6'x6' Multi-Colored Wall Tiles. This Material is in GOOD condition as of this date.

02/04/2020 This Material is unchanged as of this date.

08/28/2020 This Material is unchanged as of this date.

02/10/2021 This Material is unchanged as of this date.

08/11/2021 This Material is unchanged as of this date.

02/18/2022 This Material is unchanged as of this date.

08/17/2022 This Material is unchanged as of this date.

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

HazMat Doc

AHERA Report B - Survey

SURVEY REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
02/15/2023	This Material is unchanged as of this date.		
08/16/2023	This Material is unchanged as of this date.		
02/14/2024	This Material is unchanged as of this date.		
08/14/2024	This Material is unchanged as of this date.		
02/27/2025	This Material is unchanged as of this date.		
17059AAA	NEW	NONE DETECTED	(ND)

MAIN BUILDING

2 STUDENT RESTROOMS(EXTERIOR ACCESS) AND 2 STAFF RESTROOMS(BY STAFF LOUNGE)

WALL TILE MASTIC

800 SF

03/29/2017	Mastic/Adhesive for 1'x2' Beige Wall Tile. This Material is in GOOD condition as of this date.		
02/04/2020	This Material is unchanged as of this date.		
08/28/2020	This Material is unchanged as of this date.		
02/10/2021	This Material is unchanged as of this date.		
08/11/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	This Material is unchanged as of this date.		
02/15/2023	This Material is unchanged as of this date.		
08/16/2023	This Material is unchanged as of this date.		
02/14/2024	This Material is unchanged as of this date.		
08/14/2024	This Material is unchanged as of this date.		
02/27/2025	This Material is unchanged as of this date.		

SURVEY REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

MAIN BUILDING

ADMIN SECTION, ALL OFFICES, MULTI-PURPOSE ROOM, LIBRARY, AND STORAGE ROOM

BASEBOARD MASTIC

3,800 SF

09/13/2016	Mastic/Adhesive for 4" and 6 " Dark Brown BASEBOARDS. Baseboard is 4" throughout exception in the Multi-Purpose Room where it is 6". Material installed as part of the 2016 Modernization. This Material is in good condition as of this date.
02/04/2020	This Material is unchanged as of this date.
08/28/2020	This Material is unchanged as of this date.
02/10/2021	Damage Observed. <5% Physical Damage - in the form of 1 LF Peeling Baseboard in Library near Hallway to Faculty Room. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.
08/11/2021	This Material is unchanged as of this date.
02/18/2022	This Material is unchanged as of this date.
08/17/2022	This Material is unchanged as of this date.
02/15/2023	Additioanla Damage Observed. 1 SF of Torn and Missing Baseboard, Brown Mastic Exposed in Electrical Room next to Office E. No other changes as of this date.
08/16/2023	This Material is unchanged as of this date.
02/14/2024	This Material is unchanged as of this date.
08/14/2024	This Material is unchanged as of this date.
02/27/2025	This Material is unchanged as of this date.

16-213AAA

NEW

NO SAMPLE

(NS)

MAIN BUILDING

ALL ADMIN HALLWAYS, BOILER ROOM, KITCHEN, ELECTRICAL ROOM, MUSIC ROOM, STAGE, AND SDC ROOM

FIRE DOOR CORE INSULATION

525 SF

09/08/2005	FIRE DOOR CORE INSULATION (25 EA FIRE DOORS). This Material is in GOOD condition as of this date.
02/08/2016	Sample 16-032-SA043 collected from Main Building, Activity 69, Fire Door Core, White Insulation.
09/13/2016	Repairs Observed. Damages to Activity Room 67 (Interior), Lobby 1, and the Doorway between Hall 77 and Entry 16 Doors have been repaired during the Summer 2016 Modernization project. No other changes as of this date.

SF= Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

16

HazMat Doc

AHERA Report B - Survey

SURVEY REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
02/04/2020	This Material is unchanged as of this date.		
08/28/2020	This Material is unchanged as of this date.		
02/10/2021	This Material is unchanged as of this date.		
08/11/2021	This Material is unchanged as of this date.		
02/18/2022	Damage Observed. <5% Physical Damage - in the form of 1 EA Missing Screw White Core Insulation Exposed on Double Door to Main Entrance to Pod A. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.		
08/17/2022	Additional Damage Observed. <5% Physical Damage in the form of 4 (EA) Small Screws Missing with White Core Insulation Exposed at Reading Room and Electrical Room Door. Double Door Gate House of Pod F has an Inside Cover Piece Missing with White Core Insulation Exposed. No other changes as of this date.		
02/15/2023	This Material is unchanged as of this date.		
08/16/2023	Partial Repairs and Additional Damage Observed. The Damage to the Double Door Gate House of Pod F has been repaired. Additional Damage in the form of 2" Gouge with White Core Insulation Exposed due to the Chair Racks going in and out of the Chair Storage Room. Material remains in FAIR condition overall. No other changes as of this date.		
02/14/2024	This Material is unchanged as of this date.		
08/14/2024	This Material is unchanged as of this date.		
02/27/2025	This Material is unchanged as of this date.		
16-032-SA043	26%	CHRYSTOTILE	(CH)

MAIN BUILDING

ALL CLASSROOMS AND WORK ROOMS

CARPET MASTIC

21,200 SF

09/13/2016	Mastic/Adhesive for Gray Black Carpet (Original Entry Updated 8/17/22). New Material installed as part of the 2016 Modernization.		
02/04/2020	This Material is unchanged as of this date.		
08/28/2020	This Material is unchanged as of this date.		
02/10/2021	This Material is unchanged as of this date.		
08/11/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		

SURVEY REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
08/17/2022	Material Re-Assessed. Material not observed, Material may exist under current Gray Black Carpet. No other changes as of this date.		
02/15/2023	This Material is unchanged as of this date.		
08/16/2023	This Material is unchanged as of this date.		
02/14/2024	This Material is unchanged as of this date.		
08/14/2024	This Material is unchanged as of this date.		
02/27/2025	This Material is unchanged as of this date.		

MAIN BUILDING

ALL OFFICES, STORAGE ROOMS, LIBRARY, MULTI-PURPOSE ROOM, AND COURTYARD STORAGE CLOSETS (LOCATED OUTSIDE PODS A-F)

SMOOTH WALL MISCELLANEOUS

34,860 SF

09/08/2005	GYPSUM WALLBOARD SYSTEM WALLS AND CEILINGS. This Material is in GOOD condition as of this date.		
04/16/2008	Water Damage observed in Pods C and D under 1'x1' Ceiling Tiles as of this date.		
05/13/2009	Additional Damage observed. Pod A also has <10% Water Damage. No other changes as of this date.		
09/04/2009	Material remains in FAIR condition overall. This Material is unchanged as of this date.		
03/10/2010	Location Description changed from ALL OFFICES, STORAGE ROOMS, LIBRARY, AND MULTI-PURPOSE ROOM to ALL OFFICES, STORAGE ROOMS, LIBRARY, MULTI-PURPOSE ROOM, AND COURTYARD STORAGE CLOSETS (LOCATED OUTSIDE PODS A-F). Quantity changed from 34,400 SF to 34,860 SF. Additional Damage: <5% Physical Damage - in the form of approx. 1 SF of the Wall has been cut and removed in Electrical Room of Pod D. Friability changed from Low to Moderate to reflect this change.		
09/01/2010	Some Walls have a Vinyl Cover. No other changes as of this date.		

SURVEY REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
02/08/2016	Sample 16-032-SA003 collected from Main Building, Classroom 38, Wall Joint Tape and Mud for Gypsum Board. Sample 16-032-SA004 collected from Main Building, Classroom 38, Wall Gypsum Board. Sample 16-032-SA013 collected from Main Building, Classroom 55, Wall Joint Tape and Mud. Sample 16-032-SA014 collected from Main Building, Classroom 55, Wall Gypsum Board. Sample 16-032-SA026 collected from Main Building, Toilet-59, Wall Joint Tape and Mud for Gypsum Board. Sample 16-032-SA027 collected from Main Building, Toilet-59, Ceiling Gypsum Board. Sample 16-032-SA035 collected from Main Building, Classroom 70, Wall Joint Tape and Mud for Gypsum Board. Sample 16-032-SA036 collected from Main Building, Classroom 70, Wall Gypsum Board. Sample 16-032-SA053 collected from Main Building, Girls Restroom 88, Upper Wall Joint Tape and Mud for Gypsum Board. Sample 16-032-SA054 collected from Girls Restroom 88, Upper Wall Gypsum Board. Sample 16-032-SA067 Main Building, Platform-93, Wall Joint Tape and Mud for Gypsum Board. Sample 16-032-SA068 Main Building, Platform-93, Wall Gypsum Board. Sample 16-032-SA083, Main Building, Janitor-4, Wall Joint Tape and Mud for Gypsum Board. Sample 16-032-SA084, Main Building, Janitor-4, Wall Gypsum Board. Sample 16-032-SA021 collected from Main Building, Activity 53, Ceiling Gypsum Board.		
03/17/2016	Additional Damage observed. 1 SF of Damage observed in Chair Storage Room off Multi-Purpose Room; and 1 SF of Physical Damage in Multi-Purpose Room. No other changes as of this date.		
09/13/2016	Repairs Observed. Damages in Chair Storage Room have been repaired as of this date. Material remains in FAIR condition. No other changes as of this date.		
08/29/2017	Additional Damage Observed. Ceiling Tiles now have Water Damage. No other changes as of this date.		
02/04/2020	This Material is unchanged as of this date.		
08/28/2020	This Material is unchanged as of this date.		
02/10/2021	This Material is unchanged as of this date.		
08/11/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	This Material is unchanged as of this date.		
02/15/2023	This Material is unchanged as of this date.		
08/16/2023	This Material is unchanged as of this date.		
02/14/2024	This Material is unchanged as of this date.		
08/14/2024	This Material is unchanged as of this date.		
02/27/2025	This Material is unchanged as of this date.		

16-032-SA003	ND	NONE DETECTED	(ND)
16-032-SA004	ND	NONE DETECTED	(ND)
16-032-SA003	ND	NONE DETECTED	(ND)
16-032-SA013	ND	NONE DETECTED	(ND)

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
16-032-SA013	ND	NONE DETECTED	(ND)
16-032-SA014	ND	NONE DETECTED	(ND)
16-032-SA026	ND	NONE DETECTED	(ND)
16-032-SA026	ND	NONE DETECTED	(ND)
16-032-SA036	ND	NONE DETECTED	(ND)
16-032-SA027	ND	NONE DETECTED	(ND)
16-032-SA035	ND	NONE DETECTED	(ND)
16-032-SA035	ND	NONE DETECTED	(ND)
16-032-SA053	ND	NONE DETECTED	(ND)
16-032-SA053	ND	NONE DETECTED	(ND)
16-032-SA054	ND	NONE DETECTED	(ND)
16-032-SA067	ND	NONE DETECTED	(ND)
16-032-SA067	ND	NONE DETECTED	(ND)
16-032-SA068	ND	NONE DETECTED	(ND)
16-032-SA083	ND	NONE DETECTED	(ND)
16-032-SA083	ND	NONE DETECTED	(ND)
16-032-SA084	ND	NONE DETECTED	(ND)
16-032-SA021	ND	NONE DETECTED	(ND)

MAIN BUILDING

ALL OFFICES, STORAGE ROOMS, LIBRARY, MULTI-PURPOSE ROOM, AND COURTYARD STORAGE CLOSETS
(LOCATED OUTSIDE PODS A-F)

SMOOTH WALL SURFACING

34,860 SF

08/24/2006	SKIM COAT FOR GYPSUM WALLBOARD SYSTEM WALLS AND CEILINGS. This Material is in GOOD condition as of this date.
04/16/2008	Water Damage observed in Pods C and D under 1'x1' Ceiling Tiles as of this date.
05/13/2009	Additional damage observed. <10% Water Damage includes Pod A. No other changes as of this date.
09/04/2009	Material remains in FAIR condition overall. This Material is unchanged as of this date.
03/10/2010	Location Description changed from ALL OFFICES, STORAGE ROOMS, LIBRARY, AND MULTI-PURPOSE ROOM to ALL OFFICES, STORAGE ROOMS, LIBRARY, MULTI-PURPOSE ROOM, AND COURTYARD STORAGE CLOSETS (LOCATED OUTSIDE PODS A-F). Quantity changed from 34,400 SF to 34,860 SF. Additional damage: <5% Physical Damage - in the form of approx. 1 SF of the wall has been cut and removed in electrical Room of Pod D.

SURVEY REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
02/08/2016	Sample 16-032-SA002 collected from Main Building, Classroom 38, Wall Skim Coat and Paint for Gypsum Board. Sample 16-032-SA012 collected from Main Building, Classroom 55, Wall Skimcoat and Paint for Gypsum Board. Sample 16-032-SA025 collected from Main Building, Toilet-59, Ceiling Skimcoat and Paint for Gypsum Board. Sample 16-032-SA034 collected from Main Building Classroom 70, Wall Skimcoat and Paint for Gypsum Board. Sample 16-032-SA052 collected from Main Building, Girls Restroom-88, Upper Wall Skimcoat Skimcoat and Paint for Gypsum Board. Sample 16-032-SA060 collected from Main Building, Boys Restroom-89, Wall Old Skimcoat and Paint for Wood Panel. Sample 16-032-SA066 Main Building, Platform-93, Wall Skimcoat and Paint for Gypsum Board. Sample 16-032-SA082 Main Building, Janitor-4, Wall Skimcoat and Paint for Gypsum Board.		
03/17/2016	Additional Damage observed. 1 SF of Damage observed in Chair Storage Room off Multi-Purpose Room; and 1 SF of Physical Damage in Multi-Purpose Room. No other changes as of this date.		
09/13/2016	Repairs Observed. Damages in Chair Storage Room have been repaired as of this date. Material remains in FAIR condition. No other changes as of this date.		
08/29/2017	Additional Damage Observed. Ceiling Tiles now have Water Damage. No other changes as of this date.		
02/04/2020	This Material is unchanged as of this date.		
08/28/2020	This Material is unchanged as of this date.		
02/10/2021	This Material is unchanged as of this date.		
08/11/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	This Material is unchanged as of this date.		
02/15/2023	This Material is unchanged as of this date.		
08/16/2023	This Material is unchanged as of this date.		
02/14/2024	This Material is unchanged as of this date.		
08/14/2024	This Material is unchanged as of this date.		
02/27/2025	This Material is unchanged as of this date.		

16-032-SA002	ND	NONE DETECTED	(ND)
16-032-SA012	ND	NONE DETECTED	(ND)
16-032-SA025	ND	NONE DETECTED	(ND)
16-032-SA034	ND	NONE DETECTED	(ND)
16-032-SA052	ND	NONE DETECTED	(ND)
16-032-SA060	ND	NONE DETECTED	(ND)
16-032-SA082	ND	NONE DETECTED	(ND)
16-032-SA099	ND	NONE DETECTED	(ND)

SF= Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
16-032-SAU66	ND	NONE DETECTED	(ND)

MAIN BUILDING

ALL POD AREAS, PREP AREAS, MULTI-PURPOSE ROOM, STAGE, SDC ROOM, AND HALLWAYS TO MULTI-PURPOSE ROOM

CEILING MASTIC

7,650 SF

09/08/2005	MASTIC/ADHESIVE FOR 1'X1' GLUED-ON CEILING TILE. This Material is in GOOD condition as of this date.
11/05/2007	Material Re-Assessed. Damage: <5% Physical Damage - due to 1 Tile missing in Pod "C", and 4 Tiles missing in Pod "D". Material condition changed from GOOD to FAIR overall. No other changes as of this date.
04/16/2008	8 additional Tiles are Water Damage observed in Pod C and these Tiles are coming loose as of this date.
05/13/2009	Material Re-Assessed. Pod A has 2 Tiles that are becoming loose. Physical Damage in Pod C has been repaired. Missing Tiles from Pod D has changed from 4 Tiles to 1. <10% Water Damage due to Pod A has 3 Tiles with Water stains. Pod C has 7 Tiles Water stained. Material remains in FAIR condition overall as of this date.
03/10/2010	Additional Damage observed in the form of E Pod has 1 Tile Water Damaged. Also, several Tiles are Physically Damaged in a Classroom in Multi-Purpose room. No other changes as of this date.
09/01/2010	Additional Damage observed. 6 SF Tiles missing on Hatch Door by Boiler Room exposing the Mastic/Adhesive. 2 Tiles Damaged in the Hallway to the Multi-Purpose Room by the Kitchen. Previously missing Tiles in Pod D have been replaced. 1 Tile is Missing in the Teachers Work Room in Pod D, exposing the Mastic/Adhesive. No other changes as of this date.
11/30/2011	Additional Damage - in the form of Multipurpose Room has 32 Tiles with holes. Pod C has an additional 2 Tiles with Water Damage. Pod A, previously had 3 Tiles with Water stains, now has 1 Tile only Water stained. Friability changed from Low to High to reflect this change.
10/10/2012	Additional Damage - in the form of Pod D has 4 Water Damaged Ceiling Tiles. Also, holes have been repaired in Multipurpose Room - in the form of 32 Tiles previously damaged, now only 2 Tiles damaged. No other changes as of this date.
03/17/2015	POD A & D each have 1 Ceiling Tile missing, and Brown Mastic/Adhesive is exposed. No other changes as of this date.
09/18/2015	Additional Damage observed, Hallway outside of Kitchen has 2 Tiles Physically Damaged. No other changes as of this date.
02/08/2016	Sample 16-032-SA020 collected from Main Building, Activity 53, Brown Mastic for 1'x1' Ceiling Tile. Sample 16-032-SA045 collected from Main Building, Activity 61, 1'x1' Ceiling Tile Brown Mastic. Sample 16-032-SA081 collected from Main Building, Entry-82, 1'x1' Pitted Mark Ceiling Tile, Brown Mastic. Sample 16-032-SA093 collected from Main Building, Activity-29, 1'x1' Pitted Mark Ceiling Tile, Brown Mastic.

SURVEY REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
03/17/2016	Additional Damage observed. 1 Tile is missing in A Pod Work Room exposing Mastic/Adhesive. C Pod Work Room has 10 Tiles with Water Damage; E Pod Work Room has 1 Tile with Water Damage. F Pod Work Room has 1 Tile loose. No other changes as of this date.		
09/13/2016	Additional Damage observed. <10% Water Damage - in the form of 10 Tiles with Water Damage in the Multi-Purpose Room. No other changes as of this date.		
03/29/2017	Material Re-assessed. Water Damage painted over. Additional Damage Observed. 7 Tiles loose and 7 Tiles have Water Stains in the Multi-Purpose Room. No other changes as of this date.		
08/29/2017	Additional Damage Observed. C-Pod now has 9 Tiles with Water Damage. Access Door has 1 Tile with Physical Damage. No other changes as of this date.		
08/08/2018	Additional Damage Observed. F-Pod now has 1Tile Missing on Hatch Door and 12 Tiles have Surface Damage. No other changes as of this date.		
08/14/2019	Additional Damage Observed. <5% Physical Damage in the form of 1 SF of Tiles with Stains in each one of the Activity Rooms of Pod A and Pod C. Material Condition remains in FAIR condition overall. No other changes as of this date.		
02/04/2020	Additional Damage Observed. 1 Tile Missing Mastic Exposed in Pod A. No other changes as of this date.		
08/28/2020	This Material is unchanged as of this date.		
02/10/2021	This Material is unchanged as of this date.		
08/11/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	This Material is unchanged as of this date.		
02/15/2023	This Material is unchanged as of this date.		
08/16/2023	This Material is unchanged as of this date.		
02/14/2024	This Material is unchanged as of this date.		
08/14/2024	This Material is unchanged as of this date.		
02/27/2025	This Material is unchanged as of this date.		
16-032-SA020	ND	NONE DETECTED	(ND)
16-032-SA045	ND	NONE DETECTED	(ND)
16-032-SA081	ND	NONE DETECTED	(ND)
16-032-SA093	ND	NONE DETECTED	(ND)

SURVEY REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

COMMENTS

QTY (APPROXIMATE)

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

MAIN BUILDING

ALL POD AREAS, PREP AREAS, MULTI-PURPOSE ROOM, STAGE, SDC ROOM, AND HALLWAYS TO MULTI-PURPOSE ROOM

CEILING TILE

7,650 SF

09/08/2005	1'X1' White with a Pitted mark Form Pattern GLUED-ON CEILING TILE. This Material is in GOOD condition as of this date. (Original entry updated 03/17/15).		
11/05/2007	Material Re-Assessed. Damage: <5% Physical Damage - due to 1 Tile missing in Pod "C", and 4 Tiles missing in Pod "D"; <10% Water Damage - 2 loose and water damage Tiles in Pod "C". Friability changed from Low to Moderate. Material condition changed from GOOD to FAIR overall. No other changes as of this date.		
04/16/2008	8 additional Tiles are Water Damage observed in Pod C and these Tiles are coming loose as of this date.		
05/13/2009	Material Re-Assessed. Pod A has 2 Tiles that are becoming loose. Physical Damage in Pod C has been Repaired. Missing Tiles from Pod D has changed from 4 tiles to 1. <10% Water Damage due to Pod A has 3 Tiles with Water stains. Pod C has 7 Tiles Water stained. Material remains in FAIR condition overall as of this date.		
03/10/2010	Additional Damage observed in the form of E Pod has 1 Tile Water Damaged. Also, several Tiles are Physically Damaged in a Classroom in Multi-Purpose room, also called Title 1. No other changes as of this date.		
09/01/2010	Additional Damage observed. 6 SF Tiles missing on Hatch Door by Boiler Room exposing the Mastic/Adhesive. 2 Tiles Damaged in the Hallway to the Multi-Purpose Room by the Kitchen. Previously missing Tiles in Pod D have been replaced. 1 Tile is Missing in the Teachers Work Room in Pod D, exposing the Mastic/Adhesive. No other changes as of this date.		
11/30/2011	Additional Damage - in the form of Multipurpose Room has 32 Tiles with holes. Pod C has an additional 2 Tiles with Water Damage. Pod A, previously had 3 Tiles with Water stains, now has 1 Tile only Water stained. Friability changed from Low to High to reflect this change.		
10/10/2012	Additional Damage - in the form of Pod D has 4 Water Damaged Ceiling Tiles. Also, holes have been Repaired in Multipurpose Room - in the form of 32 Tiles previously damaged, now only 2 Tiles damaged. No other changes as of this date.		
03/17/2015	Tiles are White with a Pitted mark Form Pattern. Original Entry updated. POD A & D each have 1 Ceiling Tile missing, and Brown Mastic/Adhesive is exposed. No other changes as of this date.		
09/18/2015	Additional Damage observed, Hallway outside of Kitchen has 2 Tiles Physically Damaged. No other change as of this date.		
02/08/2016	Sample 16-032-SA19 collected from Main Building, Activity 53, 1'x1' Ceiling Tile. Sample 16-032-SA044 collected from Main Building, Activity 61, 1'x1' Ceiling Tile. Sample 16-032-SA080 collected from Main Building, Entry-82, 1'x1' Pitted Mark Ceiling Tile. Sample 16-032-SA092 collected from Main Building, Activity-29, 1'x1' Pitted Mark Ceiling Tile.		

SURVEY REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
03/17/2016	Additional Damage observed. 1 Tile is missing in A Pod Work Room exposing Mastic/Adhesive. C Pod Work Room has 10 Tiles with Water Damage; E Pod Work Room has 1 Tile with Water Damage. F Pod Work Room has 1 Tile loose. No other changes as of this date.		
09/13/2016	Additional Damage Observed. <10% Water Damage - in the form of 10 Tiles with Water Damage in the Multi-Purpose Room. No other changes as of this date.		
03/29/2017	Material Re-assessed. Water Damage painted over. Additional Damage Observed. 7 Tiles loose and 7 Tiles have Water Stains in the Multi-Purpose Room. No other changes as of this date.		
08/29/2017	Additional Damage Observed. C-Pod now has 9 Tiles with Water Damage. Access Door has 1 Tile with Physical Damage. No other changes as of this date.		
08/08/2018	Additional Damage Observed. F-Pod now has 1Tile Missing on Hatch Door and 12 Tiles have Surface Damage. No other changes as of this date.		
08/14/2019	Additional Damage Observed. <5% Physical Damage in the form of 1 SF of Tiles with Stains in each one of the Activity Rooms of Pod A and Pod C. Material Condition remains in FAIR condition overall. No other changes as of this date.		
02/04/2020	Additional Damage Observed. 1 Tile Missing Mastic Exposed in Pod A. No other changes as of this date.		
08/28/2020	This Material is unchanged as of this date.		
02/10/2021	This Material is unchanged as of this date.		
08/11/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	This Material is unchanged as of this date.		
02/15/2023	This Material is unchanged as of this date.		
08/16/2023	This Material is unchanged as of this date.		
02/14/2024	This Material is unchanged as of this date.		
08/14/2024	This Material is unchanged as of this date.		
02/27/2025	This Material is unchanged as of this date.		
16-032-SA019	ND	NONE DETECTED	(ND)
16-032-SA080	ND	NONE DETECTED	(ND)
16-032-SA092	ND	NONE DETECTED	(ND)

SURVEY REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

MAIN BUILDING

ALL PODS, PREP AREAS, SDC ROOM, STAGE AND ALL CLASSROOMS

PRESSED WOOD WALL PANEL

22,000 SF

09/08/2005 4'X8' Pressed Wood Walls (with Vinyl Cover). This Material is in GOOD condition as of this date.

09/08/2005 This Material is unchanged as of this date.

02/04/2020 This Material is unchanged as of this date.

08/28/2020 Damage Observed. <5% Physical Damage in the form of 2 LF of Broken Wall Panel in Prep Areare of D-Pod. Material condition changed from GOOD to FAIR overall. Friability updated from Non-Friable to Friable. No other changes as of this date.

02/10/2021 This Material is unchanged as of this date.

08/11/2021 This Material is unchanged as of this date.

02/18/2022 This Material is unchanged as of this date.

08/17/2022 This Material is unchanged as of this date.

02/15/2023 This Material is unchanged as of this date.

08/16/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

08/14/2024 This Material is unchanged as of this date.

05/212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

MAIN BUILDING

ALL PODS, PREP AREAS, SDC ROOM, STAGE AND ALL CLASSROOMS

PRESSED WOOD WALL PANEL MASTIC

22,000 SF

09/08/2005 Mastic/Adhesive for 4'x8' Pressed Wood Walls (with Vinyl Cover). This Material is in GOOD condition as of this date.

02/04/2020 This Material is unchanged as of this date.

08/28/2020 Damage Observed. <5% Physical Damage in the form of 2 LF of Broken Wall Panel in Prep Areare of D-Pod. Material condition changed from GOOD to FAIR overall. Friability updated from Non-Friable to Friable. No other changes as of this date.

SURVEY REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
02/10/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	This Material is unchanged as of this date.		
02/15/2023	This Material is unchanged as of this date.		
08/16/2023	This Material is unchanged as of this date.		
02/14/2024	This Material is unchanged as of this date.		
08/14/2024	This Material is unchanged as of this date.		
02/27/2025	This Material is unchanged as of this date.		
05-212AAA	ASSUMED	NO SAMPLE	(NS)

MAIN BUILDING

ALL PODS, PREP AREAS, SDC ROOM, STAGE AND ALL CLASSROOMS

VINYL COVERED WALL

22,000 SF

09/08/2005	4'X8' VINYL COVER (on PRESSED WOOD WALLS). This Material is in GOOD condition as of this date.		
02/08/2016	Sample 16-032-SA005 collected from Main Building, Classroom 38, Wall Vinyl Wall Covered. Sample 16-032-SA015 collected from Main Building, Classroom 55, Wall Vinyl Wall Covered. Sample 16-032-SA037 collected from Main Building, Classroom 70, Wall Vinyl Wall Covered only.		
02/04/2020	This Material is unchanged as of this date.		
08/28/2020	Damage Observed. <5% Physical Damage in the form of 2 LF of Broken Wall Panel in Prep Areare of D-Pod. Material condition changed from GOOD to FAIR overall. Friability updated from Non-Friable to Friable. No other changes as of this date.		
02/10/2021	This Material is unchanged as of this date.		
08/11/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	This Material is unchanged as of this date.		
02/15/2023	This Material is unchanged as of this date.		
08/16/2023	This Material is unchanged as of this date.		

SURVEY REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/14/2024 This Material is unchanged as of this date.

08/14/2024 This Material is unchanged as of this date.

02/27/2025 This Material is unchanged as of this date.

16-032-SA005	ND	NONE DETECTED	(ND)
16-032-SA015	ND	NONE DETECTED	(ND)
16-032-SA037	ND	NONE DETECTED	(ND)

MAIN BUILDING

ALL PODS, PREP AREAS, SDC ROOM, STAGE AND ALL CLASSROOMS

VINYL WALL COVER MASTIC

22,000 SF

09/08/2005 MASTIC/ADHESIVE FOR VINYL COVERING ON 4'X8' VINYL COVERED PRESSED WOOD WALLS. This Material is in GOOD condition as of this date.

02/08/2016 Sample 16-032-SA006 collected from Main Building, Classroom 38, Wall Vinyl Wall Covered Mastic and Fiberboard. Sample 16-032-SA016 collected from Main Building, Classroom 55, Wall Vinyl Wall Covered Yellow Mastic and Fiberboard. Sample 16-032-SA038 collected from Main Building, Classroom 70, Wall Vinyl Wall Covered, Fiberboard and Mastic only. Sample 16-032-SA070 collected from Main Building, SDC-96, Wall Vinyl Wall Covered Adhesive and Compound only.

02/04/2020 This Material is unchanged as of this date.

08/28/2020 Damage Observed. <5% Physical Damage in the form of 2 LF of Broken Wall Panel in Prep Areare of D-Pod. Material condition changed from GOOD to FAIR overall. Friability updated from Non-Friable to Friable. No other changes as of this date.

02/10/2021 This Material is unchanged as of this date.

08/11/2021 This Material is unchanged as of this date.

02/18/2022 This Material is unchanged as of this date.

08/17/2022 This Material is unchanged as of this date.

02/15/2023 This Material is unchanged as of this date.

08/16/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

08/14/2024 This Material is unchanged as of this date.

02/27/2025 This Material is unchanged as of this date.

16-032-SA005

ND NONE DETECTED

(ND)

SF= Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
16-032-SA006	ND	NONE DETECTED	(ND)
16-032-SA006	ND	NONE DETECTED	(ND)
16-032-SA016	ND	NONE DETECTED	(ND)
16-032-SA016	ND	NONE DETECTED	(ND)
16-032-SA038	ND	NONE DETECTED	(ND)
16-032-SA070	ND	NONE DETECTED	(ND)
16-032-SA070	ND	NONE DETECTED	(ND)

MAIN BUILDING

CLASSROOMS, SDC ROOM, FACULTY ROOM, AND ADMINISTRATION OFFICES

SUSPENDED CEILING TILE

17,200 SF

09/08/2005	2'X2' AND 2'X4' White with a Pitted Mark form pattern SUSPENDED CEILING TILE. This Material is in GOOD condition as of this date. (Original entry updated 03/17/15).
03/05/2006	Damage Observed. <5% Physical Damage - in the form of approximately 10 SF of degradation above the double entry Door in Hallway next to Kitchen.; <10% Water Damage - in the form of approximately 10 SF of stains above the double entry Door in Hallways and Administration Offices next to Kitchen. This Material is in FAIR Condition as of this date.
11/05/2007	Damages Re-Assessed. Additional Damages identified in the form of 14 Tiles in Classroom A1, 8 Tiles in Classroom B1, 9 Tiles in Classroom C1, 3 Tiles in Classroom D1, 2 Tiles in Classroom E1, and 6 Tiles in Classroom F1. No other changes as of this date.
05/13/2009	Damages Re-Assessed and identified as follows: Pod A1 has 5 Tiles Water stained, changed from 14. Pods B-F have been Repaired. Material condition remains in FAIR condition overall as of this date.
03/10/2010	Material Re-Assessed. Classroom B-1 has been Repaired. Classroom C-1 has 1 Tile with Water Damage, and Classroom F-1 has 1 Tile Water Damaged. Material remains in FAIR condition overall as of this date.
09/01/2010	Additional Damage observed. 3 Tiles Water stained in the Conference Room, 1 Tile water stained in the Hallway to Pods D-E, and 1 Tile broken in the Hallway of Pod C. No other changes as of this date.
11/30/2011	Damages Re-Assessed and Repairs observed in Pod A1 - 3. Water stained Tiles have been Repaired, and 2 remain Water Damaged. Classroom C-7, 1 Tile previously noted with Water Damage has been repaired. Also, Classroom D-12 has 1 Tile Water Damaged, and Classroom F-16 has 1 hole in Ceiling. Material remains in FAIR condition overall as of this date.
03/17/2015	Tiles are White with a Pitted Mark form pattern. Location changed from ALL CLASSROOMS AND SDC ROOM to CLASSROOMS, SDC ROOM, FACULTY ROOM, AND ADMINISTRATION OFFICES. Original entry updated. No other changes as of this date.

SURVEY REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
02/08/2016	Sample 16-032-SA001 collected from Main Building, Classroom 38, 2'x4' Suspended Ceiling Tile. Sample 16-032-SA011 collected from Main Building, Classroom 55, 2'x4' Suspended Ceiling Tile. Sample 16-032-SA033 collected from Main Building, Classroom 70, 2'x4' Suspended Ceiling Tile. Sample 16-032-SA062 collected from Main Building, Music-91, 2'x2' Pitted Mark Suspended Ceiling Tile. Sample 16-032-SA069 collected from Main Building, SDC-96, 2'x4' Pitted Mark Suspended Ceiling Tile. Sample 16-032-SA094 collected from Main Building, Office-3, 2'x4' Pitted Mark Suspended Ceiling Tile. Sample 16-032-SA089 collected from Main Building, Entry-16, 2'x2' Popcorn Pattern Texture Suspended Ceiling Tile.		
03/17/2016	Partial Repairs made and Damage Re-Assessed. Some Tiles have been Replaced in various locations. Current Damage: A1 has 2 Tiles Water Damaged; Office Conference Room has 3 Tiles Water Damaged; C Staff Room has 1 Tile Water Damaged; E Staff Room has 4 Tiles Water Damaged; D Staff Room has 3 Tiles Water Damaged; D3 has 1 Tile Water Damaged; and F Pod Staff Room has 5 Tiles Water Damaged. No other changes as of this date.		
09/13/2016	Pod D is currently Under Renovation no Access availbale.		
03/06/2017	Damages Observed. <5% Physical Damage - in the form of 1 Tile Damaged in Princepal's Office. 1 Tile Missing in Classroom B2. 1 Tile Missing in Facutly Lounge. 1 Tile Missing in Work Room. No other changes as of this date.		
08/29/2017	Additional Damage and Partial Repairs Observed. B-Pod Staff Room now has 1 Tile Missing. F-Pod now has 1 Tile Missing by the Hallway. E-Pod has 4 Tiles with Water Damage by the Hallway. All the locations have Small Cuts and Holes. Classroom B2 has replaced its Missing Tile. Faculty Lounge Missing Tile has been Replaced. No other changes as of this date.		
08/08/2018	Additional Damage Observed. 4 Tiles have Water Dmage and 4 Tiles Cracks in Music Room. No other changes as of this date.		
02/04/2020	Additonal Damage Observed. 1 Tile Missing in Library Office. No other changes as of this date.		
08/28/2020	Additional Damage Observed. <5% Physical Damage in the form of 1 Tile Missing in B Staff Office. 1 Tile with Water Stains in Faculty Lounge, above the stove. Material remains in FAIR condition overall. No other changes as of this date.		
02/10/2021	This Material is unchanged as of this date.		
08/11/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	Additional Damage Observed. <5% Physical Damage and <10% Water Damage in the form of 1 (EA) 2'x2' Tile is Missing in B Staff Office and 1 (EA) 2'x2' Tile with Water Stains in F Staff Office. No other changes as of this date.		
02/15/2023	This Material is unchanged as of this date.		
08/16/2023	This Material is unchanged as of this date.		

SURVEY REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/14/2024 Additional Damage Observed. 4 Tiles with Water Stains in MDF Room. No other changes as of this date.

08/14/2024 This Material is unchanged as of this date.

02/27/2025 This Material is unchanged as of this date.

16-032-SA001	ND	NONE DETECTED	(ND)
16-032-SA011	ND	NONE DETECTED	(ND)
16-032-SA033	ND	NONE DETECTED	(ND)
16-032-SA062	ND	NONE DETECTED	(ND)
16-032-SA069	ND	NONE DETECTED	(ND)
16-032-SA094	ND	NONE DETECTED	(ND)
16-032-SA089	ND	NONE DETECTED	(ND)

MAIN BUILDING

COURTYARDS (LOCATED OUTSIDE PODS A-F)

SINK UNDERCOATING

30 SF

03/10/2010 Beige Thermal Undercoating on Sink. (6 EA Sinks). (No cabinets present). This Material is in GOOD condition as of this date. (Original entry updated on 10/10/12.)

09/01/2010 This Material is unchanged as of this date. Some sinks are in cabinets.

10/10/2012 Undercoating is Beige. Original entry updated. No other changes as of this date.

02/04/2020 This Material is unchanged as of this date.

08/28/2020 This Material is unchanged as of this date.

02/10/2021 This Material is unchanged as of this date.

08/11/2021 This Material is unchanged as of this date.

02/18/2022 This Material is unchanged as of this date.

08/17/2022 This Material is unchanged as of this date.

02/15/2023 This Material is unchanged as of this date.

08/16/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

08/14/2024 This Material is unchanged as of this date.

02/27/2025 This Material is unchanged as of this date.

SURVEY REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
10-052AAA	ASSUMED	NO SAMPLE	(NS)

MAIN BUILDING

ENTIRE ADMINISTRATION SECTION, ALL OFFICES, HALLWAYS, LOUNGE, AND NURSES ROOM

CARPET MASTIC

4,100 SF

09/13/2016	Mastic/Adhesive for Gray Black Carpet (Original Entry Updated 8/17/22).
02/04/2020	This Material is unchanged as of this date.
08/28/2020	This Material is unchanged as of this date.
02/10/2021	This Material is unchanged as of this date.
08/11/2021	This Material is unchanged as of this date.
02/18/2022	This Material is unchanged as of this date.
08/17/2022	Material Re-Assessed. Material not observed, Material may exist under current Gray Black Carpet. No other changes as of this date.
02/15/2023	This Material is unchanged as of this date.
08/16/2023	This Material is unchanged as of this date.
02/14/2024	This Material is unchanged as of this date.
08/14/2024	This Material is unchanged as of this date.
02/27/2025	This Material is unchanged as of this date.

16-213AAA	NEW	NO SAMPLE	(NS)
-----------	-----	-----------	--------

MAIN BUILDING

ENTIRE BUILDING

SEALANT

90 SF

02/18/2022	Gray-Black Sealant on Door Frame. This Material is in GOOD condition as of this date.
08/17/2022	This Material is unchanged as of this date.
02/15/2023	This Material is unchanged as of this date.
08/16/2023	This Material is unchanged as of this date.
02/14/2024	This Material is unchanged as of this date.

SURVEY REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

08/14/2024 This Material is unchanged as of this date.

02/27/2025 This Material is unchanged as of this date.

22-025.NS NEW NO SAMPLE (NS)

MAIN BUILDING

EXTERIOR RESTROOMS (2 EA)

EPOXY COATING

287 SF

02/15/2023 Green Epoxy Floor Coating Material. This Material is in GOOD condition as of this date.

08/16/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

08/14/2024 This Material is unchanged as of this date.

02/27/2025 This Material is unchanged as of this date.

23-026.NS NEW NO SAMPLE (NS)

MAIN BUILDING

EXTERIOR WALLS

ROUGH WALL

21,750 SF

09/08/2005 STUCCO WALLS. This Material is in good condition as of this date.

02/04/2020 This Material is unchanged as of this date.

08/28/2020 Damage Observed. <5% Physical Damage in the form of 1 Inch Hole in Wall near Rear Entry into D-2. Material condition changed from GOOD to FAIR overall. Friability updated from Non-Friable to Friable. No other changes as of this date.

02/10/2021 Additional Damage Observed. 3 LF of Cracks near Entry to Kitchen. No other changes as of this date.

08/11/2021 This Material is unchanged as of this date.

02/18/2022 This Material is unchanged as of this date.

08/17/2022 This Material is unchanged as of this date.

02/15/2023 This Material is unchanged as of this date.

08/16/2023 This Material is unchanged as of this date.

SURVEY REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/14/2024 This Material is unchanged as of this date.

08/14/2024 This Material is unchanged as of this date.

02/27/2025 This Material is unchanged as of this date.

MAIN BUILDING

EXTERIOR WALLS

ROUGH WALL SURFACING

21,750 SF

09/08/2005 SKIM COAT FOR STUCCO WALLS. This Material is in good condition as of this date.

02/04/2020 This Material is unchanged as of this date.

08/28/2020 Damage Observed. <5% Physical Damage in the form of 1 Inch Hole in Wall near Rear Entry into D-2. Material condition changed from GOOD to FAIR overall. Friability updated from Non-Friable to Friable. No other changes as of this date.

02/10/2021 Additional Damage Observed. 3 LF of Cracks near Entry to Kitchen. No other changes as of this date.

08/11/2021 This Material is unchanged as of this date.

02/18/2022 This Material is unchanged as of this date.

08/17/2022 This Material is unchanged as of this date.

02/15/2023 This Material is unchanged as of this date.

08/16/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

08/14/2024 This Material is unchanged as of this date.

02/27/2025 This Material is unchanged as of this date.

MAIN BUILDING

KITCHEN AND KITCHEN STORAGE ROOM

VINYL FLOOR TILE

790 SF

09/01/2010 12"x12" Beige Vinyl Floor Tile. This Material is in GOOD condition as of this date.

10/10/2012 Damage Observed. <5% Physical Damage - in the form of 1 Tile is broken and Mastic is exposed in Kitchen. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.

SURVEY REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
02/08/2016	Sample 16-032-SA009 collected from Main Building, Activity 37, 12"x12" Beige Vinyl Floor Tile. Sample 16-032-SA047 collected from Main Building, Kitchen-83, 12"x12" Beige with Gray Vinyl Floor Tile.		
03/29/2017	Additional Damage Observed. Kitchen has 3 Cracked and Broken Tiles. No other changes as of this date.		
02/14/2018	Additional Damage Observed. Kitchen has 4 Cracked and Broken Tiles. No other changes as of this date.		
02/04/2020	This Material is unchanged as of this date.		
08/28/2020	This Material is unchanged as of this date.		
02/10/2021	This Material is unchanged as of this date.		
08/11/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	This Material is unchanged as of this date.		
02/15/2023	This Material is unchanged as of this date.		
08/16/2023	This Material is unchanged as of this date.		
02/14/2024	This Material is unchanged as of this date.		
08/14/2024	This Material is unchanged as of this date.		
02/27/2025	This Material is unchanged as of this date.		
10-174AAA	ASSUMED	NO SAMPLE	(NS)
16-032-SA009	ND	NONE DETECTED	(ND)
16-032-SA047	ND	NONE DETECTED	(ND)

MAIN BUILDING

KITCHEN AND KITCHEN STORAGE ROOM

VINYL FLOOR TILE MASTIC

790 SF

09/01/2010	Mastic/Adhesive for 12"x12" Beige Vinyl Floor Tile. This Material is in GOOD condition as of this date.
10/10/2012	Damage: <5% Physical Damage - in the form of 1 Tile is broken and Mastic is exposed in Kitchen. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.
02/08/2016	Sample 16-032-SA009 collected from Main Building, Activity 37, 12"x12" Beige Vinyl Floor Tile. Sample 16-032-SA048 collected from Main Building, Kitchen-83, 12"x12" Beige with Gray Vinyl Floor Tile, Yellow Mastic and White Leveling Compound.

SURVEY REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
03/29/2017	Additional Damage Observed. Kitchen has 3 Cracked and Broken Tiles. No other changes as of this date.		
02/14/2018	Additional Damage Observed. Kitchen has 4 Cracked and Broken Tiles. No other changes as of this date.		
02/04/2020	This Material is unchanged as of this date.		
08/28/2020	This Material is unchanged as of this date.		
02/10/2021	This Material is unchanged as of this date.		
08/11/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	This Material is unchanged as of this date.		
02/15/2023	This Material is unchanged as of this date.		
08/16/2023	This Material is unchanged as of this date.		
02/14/2024	This Material is unchanged as of this date.		
08/14/2024	This Material is unchanged as of this date.		
02/27/2025	This Material is unchanged as of this date.		

10-174AAA	ASSUMED	NO SAMPLE	(NS)
16-032-SA010	ND	NONE DETECTED	(ND)
16-032-SA010	ND	NONE DETECTED	(ND)
16-032-SA048	ND	NONE DETECTED	(ND)
16-032-SA048	ND	NONE DETECTED	(ND)

MAIN BUILDING

LIBRARY OFFICE

CHALK BOARD

16 SF

03/10/2010	Brown Cementitious Chalkboard. (1 EA). This Material is in GOOD condition as of this date.
09/25/2013	Friability changed from Low to Non. No other changes as of this date.
02/04/2020	This Material is unchanged as of this date.
08/28/2020	This Material is unchanged as of this date.
02/10/2021	This Material is unchanged as of this date.

SURVEY REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
08/11/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	This Material is unchanged as of this date.		
02/15/2023	This Material is unchanged as of this date.		
08/16/2023	This Material is unchanged as of this date.		
02/14/2024	This Material is unchanged as of this date.		
08/14/2024	This Material is unchanged as of this date.		
02/27/2025	This Material is unchanged as of this date.		
10-052AAA	ASSUMED	NO SAMPLE	(NS)

MAIN BUILDING

LIBRARY OFFICE

WALL MASTIC

16 SF

03/10/2010	Mastic/Adhesive for Brown Cementitious Chalkboard. (1 EA). This Material is in GOOD condition as of this date.		
02/04/2020	This Material is unchanged as of this date.		
08/28/2020	This Material is unchanged as of this date.		
02/10/2021	This Material is unchanged as of this date.		
08/11/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	This Material is unchanged as of this date.		
02/15/2023	This Material is unchanged as of this date.		
08/16/2023	This Material is unchanged as of this date.		
02/14/2024	This Material is unchanged as of this date.		
08/14/2024	This Material is unchanged as of this date.		
02/27/2025	This Material is unchanged as of this date.		
10-052AAA	ASSUMED	NO SAMPLE	(NS)

SURVEY REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

MAIN BUILDING

LOUNGE, HALLWAY, OFFICES, LOBBY, STAGE, CLASSROOMS

VINYL WALL COVER

4,000 SF

09/01/2010	Vinyl Wall Cover (over Sheetrock Walls). This Material is in GOOD condition as of this date.
09/25/2013	Friability changed from LOW to NON. No other changes as of this date.
02/04/2020	This Material is unchanged as of this date.
08/28/2020	Damage Observed. <5% Physical Damage in the form of 1 Inch Hole in Wall near Rear Entry into D-2. Material condition changed from GOOD to FAIR overall. Friability updated from Non-Friable to Friable. No other changes as of this date.
02/10/2021	This Material is unchanged as of this date.
08/11/2021	This Material is unchanged as of this date.
02/18/2022	This Material is unchanged as of this date.
08/17/2022	Repairs Observed. All Damages Repaired. Material Condition changed from FAIR to GOOD. Friability updated from Friable to Non-Friable. No other changes as of this date.
02/15/2023	This Material is unchanged as of this date.
08/16/2023	This Material is unchanged as of this date.
02/14/2024	This Material is unchanged as of this date.
08/14/2024	Damage Observed. <5% Physical Damage - in the form of 1 SF Peeling with Light Brown Mastic Exposed in Kitchen and Multipurpose Room. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.
02/27/2025	This Material is unchanged as of this date.

10-174AAA

ASSUMED

NO SAMPLE

(NS)

MAIN BUILDING

LOUNGE, HALLWAY, OFFICES, LOBBY, STAGE, CLASSROOMS

VINYL WALL COVER MASTIC

4,000 SF

09/01/2010	Mastic/Adhesive for Vinyl Wall Cover (over Sheetrock Walls). This Material is in GOOD condition as of this date.
02/04/2020	This Material is unchanged as of this date.

SURVEY REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
08/28/2020	Damage Observed. <5% Physical Damage in the form of 1 Inch Hole in Wall near Rear Entry into D-2. Material condition changed from GOOD to FAIR overall. Friability updated from Non-Friable to Friable. No other changes as of this date.		
02/10/2021	This Material is unchanged as of this date.		
08/11/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	Repairs Observed. All Damages Repaired. Material Condition changed from FAIR to GOOD. Friability updated from Friable to Non-Friable. No other changes as of this date.		
02/15/2023	This Material is unchanged as of this date.		
08/16/2023	This Material is unchanged as of this date.		
02/14/2024	This Material is unchanged as of this date.		
08/14/2024	Damage Observed. <5% Physical Damage - in the form of 1 SF Peeling with Light Brown Mastic Exposed in Kitchen and Multipurpose Room. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.		
02/27/2025	This Material is unchanged as of this date.		
10-174AAA	ASSUMED	NO SAMPLE	(NS)

MAIN BUILDING

MAIN ELECTRICAL PANEL ROOM

PIPE FITTING INSULATION

2 LF

11/05/2007	Thermal System Insulation on Pipe Fittings. (2 EA Fittings Type). Damage: <50% Physical Damage - due to 1 fitting being in POOR condition. This Material is in FAIR condition as of this date.		
04/16/2008	This Material is unchanged as of this date. Damaged fitting has been sealed and wrapped with duct tape as a temporary measure.		
05/13/2009	Material reassessed. Additional Fittings may be located in the Planum, Attic, and other inaccessible area/spaces. This Material is unchanged as of this date.		
02/04/2020	This Material is unchanged as of this date.		
08/28/2020	This Material is unchanged as of this date.		
02/10/2021	This Material is unchanged as of this date.		
08/11/2021	This Material is unchanged as of this date.		

SURVEY REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/18/2022 This Material is unchanged as of this date.

08/17/2022 This Material is unchanged as of this date.

02/15/2023 This Material is unchanged as of this date.

08/16/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

08/14/2024 This Material is unchanged as of this date.

02/27/2025 This Material is unchanged as of this date.

07-043AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

MAIN BUILDING

MECHANICAL ROOPM(PARKING LOT SIDE)

SEALANT

6 SF

02/18/2022 Black Sealant for Joint Cooling Tower. This Material is in GOOD condition as of this date.

08/17/2022 This Material is unchanged as of this date.

02/15/2023 This Material is unchanged as of this date.

08/16/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

08/14/2024 This Material is unchanged as of this date.

02/27/2025 This Material is unchanged as of this date.

22-025.NS	NEW	NO SAMPLE	(NS)
-----------	-----	-----------	--------

MAIN BUILDING

MULTI-PURPOSE ROOM, STAGE, HALLWAYS, SDC ROOM, MUSIC ROOM, KITCHEN, PE CLOSET, RSP ROOM, REC. ROOM, AND BOILER ROOM

SMOOTH WALL SURFACING

7,320 SF

09/08/2005 SKIM COAT/ TEXTURE ON CONCRETE WALLS. This Material is in good condition as of this date.

02/08/2016 Sample 16-032-SA051 collected from Main Building, Girls Restroom-88, Wall Skimcoat and Paint for Concrete. Sample 16-032-SA061 collected from Main Building, Girls Restroom, Exterior Wall Skimcoat and Paint for Concrete. Sample 16-032-SA065 collected from Main Building, Platform-93, Wall Skimcoat and Paint for Concrete.

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

40

HazMat Doc

AHERA Report B - Survey

SURVEY REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
02/04/2020	This Material is unchanged as of this date.		
08/28/2020	This Material is unchanged as of this date.		
02/10/2021	This Material is unchanged as of this date.		
08/11/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	This Material is unchanged as of this date.		
02/15/2023	This Material is unchanged as of this date.		
08/16/2023	This Material is unchanged as of this date.		
02/14/2024	This Material is unchanged as of this date.		
08/14/2024	This Material is unchanged as of this date.		
02/27/2025	This Material is unchanged as of this date.		
16-032-SA051	ND	NONE DETECTED	(ND)
16-032-SA065	ND	NONE DETECTED	(ND)
16-032-SA061	ND	NONE DETECTED	(ND)

MAIN BUILDING

MULTI-USE ROOM, HALLWAYS, TEACHERS WORK ROOM

VINYL FLOOR TILE

8,450 SF

08/08/2018	12"x12" Beige and Blue Vinyl Floor Tile. This Material is in GOOD condition as of this date.		
02/04/2020	This Material is unchanged as of this date.		
08/28/2020	This Material is unchanged as of this date.		
02/10/2021	This Material is unchanged as of this date.		
08/11/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	This Material is unchanged as of this date.		
02/15/2023	This Material is unchanged as of this date.		
08/16/2023	This Material is unchanged as of this date.		

SURVEY REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/14/2024 This Material is unchanged as of this date.

08/14/2024 This Material is unchanged as of this date.

02/27/2025 This Material is unchanged as of this date.

18-127AAA	NEW	NONE DETECTED	(ND)
-----------	-----	---------------	--------

MAIN BUILDING

MULTI-USE ROOM, HALLWAYS, TEACHERS WORK ROOM

VINYL FLOOR TILE MASTIC

8,450 SF

08/08/2018 Mastic/Adhesive for 12"x12" Beige and Blue Vinyl Floor Tile. This Material is in GOOD condition as of this date.

02/04/2020 This Material is unchanged as of this date.

08/28/2020 This Material is unchanged as of this date.

02/10/2021 This Material is unchanged as of this date.

08/11/2021 This Material is unchanged as of this date.

02/18/2022 This Material is unchanged as of this date.

08/17/2022 This Material is unchanged as of this date.

02/15/2023 This Material is unchanged as of this date.

08/16/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

08/14/2024 This Material is unchanged as of this date.

02/27/2025 This Material is unchanged as of this date.

18-127AAA	NEW	NONE DETECTED	(ND)
-----------	-----	---------------	--------

MAIN BUILDING

MULTI-USE ROOM, HALLWAYS TO PODS, TEACHERS WORK ROOMS, AND ENTRIES TO CLASSROOMS

VINYL FLOOR TILE

8,100 SF

09/01/2010 12"x12" Light Brown Vinyl Floor Tile. This Material is in GOOD condition as of this date.

SURVEY REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
11/30/2011	Damage: <5% Physical Damage - in the form of Classroom F-17 has 1 Tile broken and Mastic/Adhesive is exposed. Material condition changed from GOOD to FAIR overall as of this date. Friability changed from Non-Friable to Friable to reflect this change.		
09/18/2015	Damage Re-Assessed. Additional Damage observed, Pod-B has 5 Tiles cracked and Classroom F-1 has 2 cracked. Damage noted on 11/30/11 of 1 Tile broken is in F-2. No other changes as of this date.		
02/08/2016	Sample 16-032-SA022 collected from Main Building, Activity 53, 12"x12" Beige Vinyl Floor Tile. Sample 16-032-SA041 collected from Main Building, Activity 69, 12"x12" Beige Vinyl Floor Tile. Sample 16-032-SA077 collected from Main Building, Multi-Purpose-81, 12"x12" Gray Vinyl Floor Tile. Sample 16-032-SA078 collected from Main Building, Multi-Purpose-81, 12"x12" Beige Vinyl Floor Tile.		
02/04/2020	This Material is unchanged as of this date.		
08/28/2020	This Material is unchanged as of this date.		
02/10/2021	This Material is unchanged as of this date.		
08/11/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	This Material is unchanged as of this date.		
02/15/2023	This Material is unchanged as of this date.		
08/16/2023	This Material is unchanged as of this date.		
02/14/2024	This Material is unchanged as of this date.		
08/14/2024	This Material is unchanged as of this date.		
02/27/2025	This Material is unchanged as of this date.		

10-174AAA	ASSUMED	NO SAMPLE	(NS)
16-032-SA022	ND	NONE DETECTED	(ND)
16-032-SA041	ND	NONE DETECTED	(ND)
16-032-SA077	ND	NONE DETECTED	(ND)
16-032-SA078	ND	NONE DETECTED	(ND)

MAIN BUILDING

MULTI-USE ROOM, HALLWAYS TO PODS, TEACHERS WORK ROOMS, AND ENTRIES TO CLASSROOMS

VINYL FLOOR TILE MASTIC

8,100 SF

09/01/2010 Mastic / Adhesive for 12"x12" Light Brown Vinyl Floor Tile. This Material is in GOOD condition as of this date.

SURVEY REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
11/30/2011	Damage Observed. <5% Physical Damage - in the form of Classroom F-17 has 1 Tile broken and Mastic is exposed. Material condition changed from GOOD to FAIR overall as of this date. Friability changed from Non-Friable to Friable. No other changes as of this date.		
09/18/2015	Damage Re-Assessed. Additional Damage observed, Pod-B has 5 Tiles cracked and Classroom F-1 has 2 cracked. Damage noted on 11/30/11 of 1 Tile broken is in F-2. No other change as of this date.		
02/08/2016	Sample 16-032-SA023 collected from Main Building, Activity 53, Yellow Mastic and Gray Leveling Compound 12"x12" Beige Vinyl Floor Tile. Sample 16-032-SA042 collected from Main Building, Activity 69, Yellow Mastic and Gray Leveling Compound for 12"x12" Beige Vinyl Floor Tile. Sample 16-032-SA079 collected from Main Building, Multi-Purpose-81, 12"x12" Beige and Gray Vinyl Floor Tile, Yellow Mastic only.		
02/04/2020	This Material is unchanged as of this date.		
08/28/2020	This Material is unchanged as of this date.		
02/10/2021	This Material is unchanged as of this date.		
08/11/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	This Material is unchanged as of this date.		
02/15/2023	This Material is unchanged as of this date.		
08/16/2023	This Material is unchanged as of this date.		
02/14/2024	This Material is unchanged as of this date.		
08/14/2024	This Material is unchanged as of this date.		
02/27/2025	This Material is unchanged as of this date.		

10-174AAA	ASSUMED	NO SAMPLE	(NS)
16-032-SA023	ND	NONE DETECTED	(ND)
16-032-SA023	ND	NONE DETECTED	(ND)
16-032-SA042	ND	NONE DETECTED	(ND)
16-032-SA042	ND	NONE DETECTED	(ND)
16-032-SA079	ND	NONE DETECTED	(ND)

MAIN BUILDING

POD A, B, C, E, AND F

BASEBOARD MASTIC

1,300 LF

02/27/2025 Mastic/Adhesive for 4" and 6" Dark Brown Baseboard. This Material is in GOOD condition as of this date.

SURVEY REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
25-036.NS	NEW	NO SAMPLE	(NS)

MAIN BUILDING

POD D (FIS)

BASEBOARD MASTIC

260 LF

03/29/2017 Mastic/Adhesive for 4" Green Baseboard. This Material is in GOOD condition as of this date.

02/04/2020 This Material is unchanged as of this date.

08/28/2020 This Material is unchanged as of this date.

02/10/2021 This Material is unchanged as of this date.

08/11/2021 This Material is unchanged as of this date.

02/18/2022 This Material is unchanged as of this date.

08/17/2022 This Material is unchanged as of this date.

02/15/2023 This Material is unchanged as of this date.

08/16/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

08/14/2024 This Material is unchanged as of this date.

02/27/2025 This Material is unchanged as of this date.

17-059AAA	NEW	NONE DETECTED	(ND)
-----------	-----	---------------	--------

MAIN BUILDING

POD D (FIS)

MORTAR MISCELLANEOUS

500 SF

03/29/2017 Grout/Mortar for 1'x2' Gray Stone Colored Wall Tiles. This Material is in GOOD condition as of this date.

02/04/2020 This Material is unchanged as of this date.

08/28/2020 This Material is unchanged as of this date.

02/10/2021 This Material is unchanged as of this date.

08/11/2021 This Material is unchanged as of this date.

02/18/2022 This Material is unchanged as of this date.

SURVEY REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

08/17/2022 This Material is unchanged as of this date.

02/15/2023 This Material is unchanged as of this date.

08/16/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

08/14/2024 This Material is unchanged as of this date.

02/27/2025 This Material is unchanged as of this date.

17-059AAA	NEW	NONE DETECTED	(ND)
-----------	-----	---------------	--------

MAIN BUILDING

POD D (FIS)

SINK UNDERCOATING

12 SF

03/29/2017 Light Grey Thermal Undercoating on Sink. (4 EA Sink). This Material is in GOOD condition as of this date.

02/04/2020 This Material is unchanged as of this date.

08/28/2020 This Material is unchanged as of this date.

02/10/2021 This Material is unchanged as of this date.

08/11/2021 This Material is unchanged as of this date.

02/18/2022 This Material is unchanged as of this date.

08/17/2022 This Material is unchanged as of this date.

02/15/2023 This Material is unchanged as of this date.

08/16/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

08/14/2024 This Material is unchanged as of this date.

02/27/2025 This Material is unchanged as of this date.

17-059AAA	NEW	NONE DETECTED	(ND)
-----------	-----	---------------	--------

SURVEY REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

MAIN BUILDING

POD D (FIS)

SUSPENDED CEILING TILE

1,050 SF

03/29/2017	2'x2' Suspended Ceiling Tile (Blue and Green Pattern). This Material is in GOOD condition as of this date.		
02/04/2020	This Material is unchanged as of this date.		
08/28/2020	This Material is unchanged as of this date.		
02/10/2021	This Material is unchanged as of this date.		
08/11/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	This Material is unchanged as of this date.		
02/15/2023	This Material is unchanged as of this date.		
08/16/2023	This Material is unchanged as of this date.		
02/14/2024	This Material is unchanged as of this date.		
08/14/2024	This Material is unchanged as of this date.		
02/27/2025	This Material is unchanged as of this date.		

17-059AAA	NEW	NONE DETECTED	(ND)
-----------	-----	---------------	--------

MAIN BUILDING

POD D (FIS)

VINYL SHEETING

1,200 SF

03/29/2017	Green and Blue Vinyl Floor Sheeting. This Material is in GOOD condition as of this date.		
02/04/2020	This Material is unchanged as of this date.		
08/28/2020	This Material is unchanged as of this date.		
02/10/2021	This Material is unchanged as of this date.		
08/11/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	This Material is unchanged as of this date.		

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

47

HazMat Doc

AHERA Report B - Survey

SURVEY REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/15/2023 This Material is unchanged as of this date.

08/16/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

08/14/2024 This Material is unchanged as of this date.

02/27/2025 This Material is unchanged as of this date.

17-059AAA	NEW	NONE DETECTED	(ND)
-----------	-----	---------------	--------

MAIN BUILDING

POD D (FIS)

VINYL SHEETING BACKING PAPER/MASTIC

1,200 SF

03/29/2017 Backing Paper/Adhesive for Green and Blue Vinyl Floor Sheeting. This Material is in GOOD condition as of this date.

02/04/2020 This Material is unchanged as of this date.

08/28/2020 This Material is unchanged as of this date.

02/10/2021 This Material is unchanged as of this date.

08/11/2021 This Material is unchanged as of this date.

02/18/2022 This Material is unchanged as of this date.

08/17/2022 This Material is unchanged as of this date.

02/15/2023 This Material is unchanged as of this date.

08/16/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

08/14/2024 This Material is unchanged as of this date.

02/27/2025 This Material is unchanged as of this date.

17-059AAA	NEW	NONE DETECTED	(ND)
-----------	-----	---------------	--------

SURVEY REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

COMMENTS

QTY (APPROXIMATE)

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

MAIN BUILDING

POD D (FIS)

VINYL SHEETING BACKING PAPER/MASTIC

554 SF

03/29/2017	Mastic/Adhesive for Red Vinyl Wall Cover (on 4'x10' Pressed-Wood Wall Panel). This Material is in GOOD condition as of this date.		
02/04/2020	This Material is unchanged as of this date.		
08/28/2020	This Material is unchanged as of this date.		
02/10/2021	This Material is unchanged as of this date.		
08/11/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	This Material is unchanged as of this date.		
02/15/2023	This Material is unchanged as of this date.		
08/16/2023	This Material is unchanged as of this date.		
02/14/2024	This Material is unchanged as of this date.		
08/14/2024	This Material is unchanged as of this date.		
02/27/2025	This Material is unchanged as of this date.		

MAIN BUILDING

POD D (FIS)

VINYL WALL COVER

554 SF

03/29/2017	Vinyl Wall Red (on 4'x10' Pressed-Wood Wall Panel). This Material is in GOOD condition as of this date.		
02/04/2020	This Material is unchanged as of this date.		
08/28/2020	This Material is unchanged as of this date.		
02/10/2021	This Material is unchanged as of this date.		
08/11/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	This Material is unchanged as of this date.		

SURVEY REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/15/2023 This Material is unchanged as of this date.

08/16/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

08/14/2024 This Material is unchanged as of this date.

02/27/2025 This Material is unchanged as of this date.

MAIN BUILDING

POD D (FIS)

WALL TILE

500 SF

03/29/2017 1'x2' Gray Stone Colored Wall Tile. This Material is in GOOD condition as of this date.

02/04/2020 This Material is unchanged as of this date.

08/28/2020 This Material is unchanged as of this date.

02/10/2021 This Material is unchanged as of this date.

08/11/2021 This Material is unchanged as of this date.

02/18/2022 This Material is unchanged as of this date.

08/17/2022 This Material is unchanged as of this date.

02/15/2023 This Material is unchanged as of this date.

08/16/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

08/14/2024 This Material is unchanged as of this date.

02/27/2025 This Material is unchanged as of this date.

17-059AAA

NEW

NONE DETECTED

(ND)

MAIN BUILDING

RESTROOMS AND ALL DRINKING FOUNTAINS

MORTAR MISCELLANEOUS

500 SF

10/15/2008 Grout/Mortar for 4"x4" Multi-Colored Wall Tiles. This Material is in GOOD condition as of this date.

SURVEY REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
02/08/2016	Sample 16-032-SA028 collected from Main Building, Toilet 59, 4" Ceramic Wall Tile Brown Grout only. Sample 16-032-SA029 collected from Main Building, Toilet 59, 4" Ceramic Wall Tile Beige Glue. Sample 16-032-SA030 collected from Main Building, Toilet 59, 4" Ceramic wall Gray and White Backing Board. Sample 16-032-SA055 collected from Main Building, Girls Restroom-88, 4" Ceramic Wall Tile Light Brown Grout. Sample 16-032-SA056 collected from Main Building, Girls Restroom-88, Beige Glue. Sample 16-032-SA057 collected from Main Building, Girls Restroom-88, 4" Ceramic Wall Tile Gray and White Backing Board.		
03/29/2017	Material Re-assessed. Quantity changed from 3,500 SF to 500 SF. Material Removed from 2 Staff Restroom and 2 Exterior Student Restrooms. No other changes as of this date.		
02/04/2020	This Material is unchanged as of this date.		
08/28/2020	This Material is unchanged as of this date.		
02/10/2021	This Material is unchanged as of this date.		
08/11/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	This Material is unchanged as of this date.		
02/15/2023	This Material is unchanged as of this date.		
08/16/2023	This Material is unchanged as of this date.		
02/14/2024	This Material is unchanged as of this date.		
08/14/2024	This Material is unchanged as of this date.		
02/27/2025	This Material is unchanged as of this date.		

08-241AAA	ASSUMED	NO SAMPLE	(NS)
16-032-SA028	ND	NONE DETECTED	(ND)
16-032-SA029	ND	NONE DETECTED	(ND)
16-032-SA030	ND	NONE DETECTED	(ND)
16-032-SA055	ND	NONE DETECTED	(ND)
16-032-SA056	ND	NONE DETECTED	(ND)
16-032-SA057	ND	NONE DETECTED	(ND)

SURVEY REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

COMMENTS

QTY (APPROXIMATE)

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

MAIN BUILDING

STAFF RESTROOMS (3), AND STUDENT RESTROOMS (10)

MORTAR MISCELLANEOUS

420 SF

03/10/2010	Grout/Mortar for 12"x12" Tan Ceramic Floor Tiles. (Apparent New Material identified by the AHERA accredited Inspector). This Material is in GOOD condition as of this date.
02/08/2016	Sample 16-032-SA031 collected from Main Building, Toilet 59, 12" Ceramic Floor Tile Brown Grout. Sample 16-032-SA058 collected from Main Building, Girls Restroom-88, 12" Ceramic Floor Tile Brown Grout. Sample 16-032-SA059 collected from Main Building, Girls Restroom-88, 12" Ceramic Floor Tile Gray Mortar Bed.
03/29/2017	Material Re-assessed. Material Removed from 2 Staff Restroom and 2 Exterior Student Restrooms. No other changes as of this date.
02/04/2020	This Material is unchanged as of this date.
08/28/2020	This Material is unchanged as of this date.
02/10/2021	This Material is unchanged as of this date.
08/11/2021	This Material is unchanged as of this date.
02/18/2022	This Material is unchanged as of this date.
08/17/2022	This Material is unchanged as of this date.
02/15/2023	This Material is unchanged as of this date.
08/16/2023	This Material is unchanged as of this date.
02/14/2024	This Material is unchanged as of this date.
08/14/2024	This Material is unchanged as of this date.
02/27/2025	This Material is unchanged as of this date.

10-052AAA	ASSUMED	NO SAMPLE	(NS)
16-032-SA031	ND	NONE DETECTED	(ND)
16-032-SA058	ND	NONE DETECTED	(ND)
16-032-SA059	ND	NONE DETECTED	(ND)

SURVEY REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

MAIN BUILDING

STAGE

COLLAPSIBLE PARTITION WALL

300 SF

05/13/2009	Collapsible, (Accordian Type), Vinyl Wall Cover. This Material is in GOOD condition as of this date.
09/25/2013	Friability changed from LOW to NON. No other changes as of this date.
03/29/2017	Damage Observed. <5% Physical Damage - in the form of Vinyl Cover becoming Frayed and Torn at the Bottom. Damages Re-Assessed. Additional 2 Tiles are Water Damaged outside Classroom 9. No other changes as of this date.
02/04/2020	This Material is unchanged as of this date.
08/28/2020	This Material is unchanged as of this date.
02/10/2021	This Material is unchanged as of this date.
08/11/2021	This Material is unchanged as of this date.
02/18/2022	This Material is unchanged as of this date.
08/17/2022	This Material is unchanged as of this date.
02/15/2023	This Material is unchanged as of this date.
08/16/2023	This Material is unchanged as of this date.
02/14/2024	This Material is unchanged as of this date.
08/14/2024	This Material is unchanged as of this date.
02/27/2025	This Material is unchanged as of this date.

09-098AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

MAIN BUILDING

STAGE

WALL MASTIC

300 SF

05/13/2009	Mastic/Adhesive for Collapsible, (Accordian Type), Vinyl Wall Cover. This Material is in GOOD condition as of this date.
03/29/2017	Damage Observed. <5% Physical Damage - in the form of Vinyl Cover becoming Frayed and Torn at the Bottom. Damages Re-Assessed. Additional 2 Tiles are Water Damaged outside Classroom 9. No other changes as of this date.

SURVEY REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
02/04/2020	This Material is unchanged as of this date.		
08/28/2020	This Material is unchanged as of this date.		
02/10/2021	This Material is unchanged as of this date.		
08/11/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	This Material is unchanged as of this date.		
02/15/2023	This Material is unchanged as of this date.		
08/16/2023	This Material is unchanged as of this date.		
02/14/2024	This Material is unchanged as of this date.		
08/14/2024	This Material is unchanged as of this date.		
02/27/2025	This Material is unchanged as of this date.		
09-098AAA	ASSUMED	NO SAMPLE	(NS)

MAIN BUILDING

TEACHERS WORK AREA IN EACH POD, TEACHER LOUNGE, NURSE ROOM, KINDERGARTEN PRODUCTION ROOM, AND SPEECH ROOM

SINK UNDERCOATING

84 SF

10/15/2008	Thermal Undercoating on Sink. (21 EA Sink). This Material is in GOOD condition as of this date.		
09/01/2010	Location Re-Assessed, changed from ALL CLASSROOMS, TEACHER LOUNGE AND NURSE ROOM to TEACHERS WORK AREA IN EACH POD, TEACHER LOUNGE AND NURSE ROOM. No other changes as of this date.		
11/30/2011	Location Description changed from TEACHERS WORK AREA IN EACH POD, TEACHER LOUNGE AND NURSE ROOM to TEACHERS WORK AREA IN EACH POD, TEACHER LOUNGE, NURSE ROOM, KINDERGARTEN PRODUCTION ROOM, AND SPEECH ROOM. Material Description changed from ' Thermal Undercoating on Sink. (21 EA Sink). ' to ' Thermal Undercoating on Sink. (17 EA Sink). ' Undercoating is Grey. No other changes as of this date.		
02/08/2016	Sample 16-032-SA024 collected from Main Building, Activity 53, Stainless Metal Sink Black Undercoating. Sample 16-032-SA032 collected from Main Building, Atrium 57, Stainless Metal Sink Gray Undercoating.		
02/04/2020	This Material is unchanged as of this date.		
08/28/2020	This Material is unchanged as of this date.		

SURVEY REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/10/2021 This Material is unchanged as of this date.

08/11/2021 This Material is unchanged as of this date.

02/18/2022 This Material is unchanged as of this date.

08/17/2022 This Material is unchanged as of this date.

02/15/2023 This Material is unchanged as of this date.

08/16/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

08/14/2024 This Material is unchanged as of this date.

02/27/2025 This Material is unchanged as of this date.

08-241AAA	ASSUMED	NO SAMPLE	(NS)
16-032-SA024	ND	NONE DETECTED	(ND)
16-032-SA032	ND	NONE DETECTED	(ND)

SURVEY REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

METAL STORAGE CONTAINERS

METAL STORAGE CONTAINERS

05/13/2009 BUILDING NOTES:

05/13/2009 Metal Storage Containers. (2 EA Containers).

METAL STORAGE CONTAINERS

METAL STORAGE CONTAINERS (2)

STORAGE CONTAINER

640 SF

03/17/2016 Metal Storage Containers. 2 EA, approximately 320 SF EA.

02/04/2020 This Material is unchanged as of this date.

08/28/2020 This Material is unchanged as of this date.

08/11/2021 This Material is unchanged as of this date.

02/18/2022 This Material is unchanged as of this date.

08/17/2022 This Material is unchanged as of this date.

02/15/2023 This Material is unchanged as of this date.

08/16/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

08/14/2024 This Material is unchanged as of this date.

02/27/2025 This Material is unchanged as of this date.

16-074.NS	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

SURVEY REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.

ASBESTOS CONTENT

ASBESTOS NAME

ASBESTOS CODE

PLASTIC SHED STORAGE CONTAINER

PLASTIC SHED STORAGE CONTAINER

PLASTIC STORAGE CONTAINER (LOCATED NEXT TO 2 METAL STORAGE CONTAINERS)

STORAGE CONTAINER

60 SF

03/10/2010 Apparent New Plastic Storage Container identified by the AHERA Accredited inspector. This Material is in GOOD condition as of this date.

02/04/2020 This Material is unchanged as of this date.

08/28/2020 This Material is unchanged as of this date.

08/11/2021 This Material is unchanged as of this date.

02/18/2022 This Material is unchanged as of this date.

08/17/2022 This Material is unchanged as of this date.

02/15/2023 This Material is unchanged as of this date.

08/16/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

08/14/2024 This Material is unchanged as of this date.

02/27/2025 This Material is unchanged as of this date.

10-052.NS

NEW

NO SAMPLE

(NS)

End Of Report, Total Of 57 Pages

HOMOGENEOUS MATERIALS IN

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME

MATERIAL CATEGORY

LOCATION

MATERIAL TYPE

CLASSROOMS 01 PORTABLE BUILDING

MISCELLANEOUS MATERIAL

PORTABLE 1

PORTABLE BUILDING

CLASSROOMS 02 PORTABLE BUILDING

MISCELLANEOUS MATERIAL

PORTABLE 2

PORTABLE BUILDING

PORTABLE P2

BASEBOARD MASTIC

PORTABLE P2

CARPET MASTIC

CLASSROOMS 03 PORTABLE BUILDING

MISCELLANEOUS MATERIAL

PORTABLE 3

PORTABLE BUILDING

PORTABLE P3

BASEBOARD MASTIC

PORTABLE P3

CARPET MASTIC

CLASSROOMS 04-07 PORTABLE BUILDING

MISCELLANEOUS MATERIAL

PORTABLE P7

BASEBOARD MASTIC

PORTABLE P7

CARPET MASTIC

PORTABLES 4-7

PORTABLE BUILDING

MAIN BUILDING

MISCELLANEOUS MATERIAL

2 STUDENT RESTROOMS(EXTERIOR ACCESS) AND 2 STAFF RESTROOMS(BY STAFF LOUNGE)

EPOXY COATING

2 STUDENT RESTROOMS(EXTERIOR ACCESS) AND 2 STAFF RESTROOMS(BY STAFF LOUNGE)

MORTAR MISCELLANEOUS

2 STUDENT RESTROOMS(EXTERIOR ACCESS) AND 2 STAFF RESTROOMS(BY STAFF LOUNGE)

MORTAR MISCELLANEOUS

2 STUDENT RESTROOMS(EXTERIOR ACCESS) AND 2 STAFF RESTROOMS(BY STAFF LOUNGE)

WALL TILE

2 STUDENT RESTROOMS(EXTERIOR ACCESS) AND 2 STAFF RESTROOMS(BY STAFF LOUNGE)

WALL TILE

2 STUDENT RESTROOMS(EXTERIOR ACCESS) AND 2 STAFF RESTROOMS(BY STAFF LOUNGE)

WALL TILE

2 STUDENT RESTROOMS(EXTERIOR ACCESS) AND 2 STAFF RESTROOMS(BY STAFF LOUNGE)

WALL TILE MASTIC

ADMIN SECTION, ALL OFFICES, MULTI-PURPOSE ROOM, LIBRARY, AND STORAGE ROOM

BASEBOARD MASTIC

ALL ADMIN HALLWAYS, BOILER ROOM, KITCHEN, ELECTRICAL ROOM, MUSIC ROOM, STAGE, AND SDC ROOM

FIRE DOOR CORE INSULATION

ALL CLASSROOMS AND WORK ROOMS

CARPET MASTIC

HOMOGENEOUS MATERIALS IN SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME	MATERIAL CATEGORY	LOCATION	MATERIAL TYPE
		ALL OFFICES, STORAGE ROOMS, LIBRARY, MULTI-PURPOSE ROOM, AND COURTYARD STORAGE CLOSETS (LOCATED OUTSIDE PODS A-F)	SMOOTH WALL MISCELLANEOUS
		ALL POD AREAS, PREP AREAS, MULTI-PURPOSE ROOM, STAGE, SDC ROOM, AND HALLWAYS TO MULTI-PURPOSE ROOM	CEILING MASTIC
		ALL POD AREAS, PREP AREAS, MULTI-PURPOSE ROOM, STAGE, SDC ROOM, AND HALLWAYS TO MULTI-PURPOSE ROOM	CEILING TILE
		ALL PODS, PREP AREAS, SDC ROOM, STAGE AND ALL CLASSROOMS	PRESSED WOOD WALL PANEL
		ALL PODS, PREP AREAS, SDC ROOM, STAGE AND ALL CLASSROOMS	PRESSED WOOD WALL PANEL MASTIC
		ALL PODS, PREP AREAS, SDC ROOM, STAGE AND ALL CLASSROOMS	VINYL COVERED WALL
		ALL PODS, PREP AREAS, SDC ROOM, STAGE AND ALL CLASSROOMS	VINYL WALL COVER MASTIC
		CLASSROOMS, SDC ROOM, FACULTY ROOM, AND ADMINISTRATION OFFICES	SUSPENDED CEILING TILE
		COURTYARDS (LOCATED OUTSIDE PODS A-F)	SINK UNDERCOATING
		ENTIRE ADMINISTRATION SECTION, ALL OFFICES, HALLWAYS, LOUNGE, AND NURSES ROOM	CARPET MASTIC
		ENTIRE BUILDING	SEALANT
		EXTERIOR RESTROOMS (2 EA)	EPOXY COATING
		KITCHEN AND KITCHEN STORAGE ROOM	VINYL FLOOR TILE
		KITCHEN AND KITCHEN STORAGE ROOM	VINYL FLOOR TILE MASTIC
		LIBRARY OFFICE	CHALK BOARD
		LIBRARY OFFICE	WALL MASTIC
		LOUNGE, HALLWAY, OFFICES, LOBBY, STAGE, CLASSROOMS	VINYL WALL COVER
		LOUNGE, HALLWAY, OFFICES, LOBBY, STAGE, CLASSROOMS	VINYL WALL COVER MASTIC
		MECHANICAL ROOM(PARKING LOT SIDE)	SEALANT
		MULTI-USE ROOM, HALLWAYS, TEACHERS WORK ROOM	VINYL FLOOR TILE
		MULTI-USE ROOM, HALLWAYS, TEACHERS WORK ROOM	VINYL FLOOR TILE MASTIC
		MULTI-USE ROOM, HALLWAYS TO PODS, TEACHERS WORK ROOMS, AND ENTRIES TO CLASSROOMS	VINYL FLOOR TILE
		MULTI-USE ROOM, HALLWAYS TO PODS, TEACHERS WORK ROOMS, AND ENTRIES TO CLASSROOMS	VINYL FLOOR TILE MASTIC
		POD A, B, C, E, AND F	BASEBOARD MASTIC
		POD D (FIS)	BASEBOARD MASTIC
		POD D (FIS)	MORTAR MISCELLANEOUS
		POD D (FIS)	SINK UNDERCOATING
		POD D (FIS)	SUSPENDED CEILING TILE
		POD D (FIS)	VINYL SHEETING
		POD D (FIS)	VINYL SHEETING BACKING PAPER/MASTIC
		POD D (FIS)	VINYL SHEETING BACKING PAPER/MASTIC
		POD D (FIS)	VINYL WALL COVER
		POD D (FIS)	WALL TILE
		RESTROOMS AND ALL DRINKING FOUNTAINS	MORTAR MISCELLANEOUS
		STAFF RESTROOMS (3), AND STUDENT RESTROOMS (10)	MORTAR MISCELLANEOUS
		STAGE	COLLAPSIBLE PARTITION WALL
		STAGE	WALL MASTIC
		TEACHERS WORK AREA IN EACH POD, TEACHER LOUNGE, NURSE ROOM, KINDERGARTEN PRODUCTION ROOM, AND SPEECH ROOM	SINK UNDERCOATING

HOMOGENEOUS MATERIALS IN
SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME**MATERIAL CATEGORY****LOCATION****MATERIAL TYPE**

SURFACING MATERIAL

ALL OFFICES, STORAGE ROOMS, LIBRARY, MULTI-PURPOSE ROOM, AND
COURTYARD STORAGE CLOSETS (LOCATED OUTSIDE PODS A-F)

SMOOTH WALL SURFACING

EXTERIOR WALLS

ROUGH WALL

EXTERIOR WALLS

ROUGH WALL SURFACING

MULTI-PURPOSE ROOM, STAGE, HALLWAYS, SDC ROOM, MUSIC ROOM,
KITCHEN, PE CLOSET, RSP ROOM, REC. ROOM, AND BOILER ROOM

SMOOTH WALL SURFACING

THERMAL SYSTEM INSULATION

MAIN ELECTRICAL PANEL ROOM

PIPE FITTING INSULATION

METAL STORAGE CONTAINERS

MISCELLANEOUS MATERIAL

METAL STORAGE CONTAINERS (2)

STORAGE CONTAINER

PLASTIC SHED STORAGE CONTAINER

MISCELLANEOUS MATERIAL

PLASTIC STORAGE CONTAINER (LOCATED NEXT TO 2 METAL STORAGE
CONTAINERS)

STORAGE CONTAINER

End Of Report, Total Of 3 Pages

FRIABLE LOCATIONS IN SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	QTY (APPROXIMATE)	ASBESTOS CONTENT
MAIN BUILDING			
	ALL ADMIN HALLWAYS, BOILER ROOM, KITCHEN, ELECTRICAL ROOM, MUSIC ROOM, STAGE, AND SDC ROOM FIRE DOOR CORE INSULATION	525 SF	Greater Than 1%
	ALL OFFICES, STORAGE ROOMS, LIBRARY, MULTI-PURPOSE ROOM, AND COURTYARD STORAGE CLOSETS (LOCATED OUTSIDE PODS A-F) SMOOTH WALL MISCELLANEOUS	34,860 SF	Non Detected
	ALL OFFICES, STORAGE ROOMS, LIBRARY, MULTI-PURPOSE ROOM, AND COURTYARD STORAGE CLOSETS (LOCATED OUTSIDE PODS A-F) SMOOTH WALL SURFACING	34,860 SF	Non Detected
	ALL POD AREAS, PREP AREAS, MULTI-PURPOSE ROOM, STAGE, SDC ROOM, AND HALLWAYS TO MULTI-PURPOSE ROOM CEILING MASTIC	7,650 SF	Non Detected
	ALL POD AREAS, PREP AREAS, MULTI-PURPOSE ROOM, STAGE, SDC ROOM, AND HALLWAYS TO MULTI-PURPOSE ROOM CEILING TILE	7,650 SF	Non Detected
	ALL PODS, PREP AREAS, SDC ROOM, STAGE AND ALL CLASSROOMS PRESSED WOOD WALL PANEL	22,000 SF	Assumed
	CLASSROOMS, SDC ROOM, FACULTY ROOM, AND ADMINISTRATION OFFICES SUSPENDED CEILING TILE	17,200 SF	Non Detected
	ENTIRE BUILDING SEALANT	90 SF	New Material
	EXTERIOR WALLS ROUGH WALL	21,750 SF	Assumed
	EXTERIOR WALLS ROUGH WALL SURFACING	21,750 SF	Assumed
	KITCHEN AND KITCHEN STORAGE ROOM VINYL FLOOR TILE	790 SF	Non Detected
	KITCHEN AND KITCHEN STORAGE ROOM VINYL FLOOR TILE MASTIC	790 SF	Non Detected
	LOUNGE, HALLWAY, OFFICES, LOBBY, STAGE, CLASSROOMS VINYL WALL COVER	4,000 SF	Assumed
	LOUNGE, HALLWAY, OFFICES, LOBBY, STAGE, CLASSROOMS VINYL WALL COVER MASTIC	4,000 SF	Assumed
	MAIN ELECTRICAL PANEL ROOM PIPE FITTING INSULATION	2 LF	Assumed
	MULTI-USE ROOM, HALLWAYS TO PODS, TEACHERS WORK ROOMS, AND ENTRIES TO CLASSROOMS VINYL FLOOR TILE	8,100 SF	Assumed

S= Sq. Ft, I=Inches, L=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

**FRIABLE LOCATIONS IN
SUMMERDALE ELEMENTARY SCHOOL**

BUILDING NAME			
LOCATION		QTY	ASBESTOS
MATERIAL TYPE		(APPROXIMATE)	CONTENT
MULTI-USE ROOM, HALLWAYS TO PODS, TEACHERS WORK ROOMS, AND ENTRIES TO CLASSROOMS			
VINYL FLOOR TILE MASTIC		8,100 SF	Non Detected
STAGE			
COLLAPSIBLE PARTITION WALL		300 SF	Assumed
STAGE			
WALL MASTIC		300 SF	Assumed
End Of Report, Total Of 2 Pages			

Non- Friable Locations In SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	QTY (APPROXIMATE)	ASBESTOS CONTENT
	MATERIAL TYPE		
CLASSROOMS 02 PORTABLE BUILDING			
	PORTABLE P2		
	BASEBOARD MASTIC	50 SF	Assumed
	PORTABLE P2		
	CARPET MASTIC	960 SF	Assumed
CLASSROOMS 03 PORTABLE BUILDING			
	PORTABLE P3		
	BASEBOARD MASTIC	960 SF	Assumed
	PORTABLE P3		
	CARPET MASTIC	960 SF	Assumed
CLASSROOMS 04-07 PORTABLE BUILDING			
	PORTABLE P7		
	BASEBOARD MASTIC	50 SF	Non Detected
	PORTABLE P7		
	CARPET MASTIC	960 SF	Non Detected
MAIN BUILDING			
	2 STUDENT RESTROOMS(EXTERIOR ACCESS) AND 2 STAFF RESTROOMS(BY STAFF LOUNGE)		
	EPOXY COATING	456 SF	New Material
	2 STUDENT RESTROOMS(EXTERIOR ACCESS) AND 2 STAFF RESTROOMS(BY STAFF LOUNGE)		
	MORTAR MISCELLANEOUS	162 SF	New Material
	2 STUDENT RESTROOMS(EXTERIOR ACCESS) AND 2 STAFF RESTROOMS(BY STAFF LOUNGE)		
	MORTAR MISCELLANEOUS	324 SF	New Material
	2 STUDENT RESTROOMS(EXTERIOR ACCESS) AND 2 STAFF RESTROOMS(BY STAFF LOUNGE)		
	WALL TILE	800 SF	Non Detected
	2 STUDENT RESTROOMS(EXTERIOR ACCESS) AND 2 STAFF RESTROOMS(BY STAFF LOUNGE)		
	WALL TILE	162 SF	New Material
	2 STUDENT RESTROOMS(EXTERIOR ACCESS) AND 2 STAFF RESTROOMS(BY STAFF LOUNGE)		
	WALL TILE	324 SF	New Material
	2 STUDENT RESTROOMS(EXTERIOR ACCESS) AND 2 STAFF RESTROOMS(BY STAFF LOUNGE)		
	WALL TILE MASTIC	800 SF	New Material
	ADMIN SECTION, ALL OFFICES, MULTI-PURPOSE ROOM, LIBRARY, AND STORAGE ROOM		
	BASEBOARD MASTIC	3,800 SF	Assumed
	ALL CLASSROOMS AND WORK ROOMS		
	CARPET MASTIC	21,200 SF	Assumed
	ALL PODS, PREP AREAS, SDC ROOM, STAGE AND ALL CLASSROOMS		
	PRESSED WOOD WALL PANEL MASTIC	22,000 SF	Assumed
	ALL PODS, PREP AREAS, SDC ROOM, STAGE AND ALL CLASSROOMS		
	VINYL COVERED WALL	22,000 SF	Non Detected
	ALL PODS, PREP AREAS, SDC ROOM, STAGE AND ALL CLASSROOMS		
	VINYL WALL COVER MASTIC	22,000 SF	Non Detected
	COURTYARDS (LOCATED OUTSIDE PODS A-F)		
	SINK UNDERCOATING	30 SF	Assumed

S=Sq. Ft, I=Inches, L=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

Non- Friable Locations In SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	QTY (APPROXIMATE)	ASBESTOS CONTENT
	MATERIAL TYPE		
	ENTIRE ADMINISTRATION SECTION, ALL OFFICES, HALLWAYS, LOUNGE, AND NURSES ROOM		
	CARPET MASTIC	4,100 SF	Assumed
	EXTERIOR RESTROOMS (2 EA)		
	EPOXY COATING	287 SF	New Material
	LIBRARY OFFICE		
	CHALK BOARD	16 SF	Greater Than 1%
	LIBRARY OFFICE		
	WALL MASTIC	16 SF	Assumed
	MECHANICAL ROOPM(PARKING LOT SIDE)		
	SEALANT	6 SF	New Material
	MULTI-PURPOSE ROOM, STAGE, HALLWAYS, SDC ROOM, MUSIC ROOM, KITCHEN, PE CLOSET, RSP ROOM, REC. ROOM, AND BOILER ROOM		
	SMOOTH WALL SURFACING	7,320 SF	Non Detected
	MULTI-USE ROOM, HALLWAYS, TEACHERS WORK ROOM		
	VINYL FLOOR TILE	8,450 SF	New Material
	MULTI-USE ROOM, HALLWAYS, TEACHERS WORK ROOM		
	VINYL FLOOR TILE MASTIC	8,450 SF	New Material
	POD A, B, C, E, AND F		
	BASEBOARD MASTIC	1,300 LF	New Material
	POD D (FIS)		
	BASEBOARD MASTIC	260 LF	New Material
	POD D (FIS)		
	MORTAR MISCELLANEOUS	500 SF	New Material
	POD D (FIS)		
	SINK UNDERCOATING	12 SF	New Material
	POD D (FIS)		
	SUSPENDED CEILING TILE	1,050 SF	New Material
	POD D (FIS)		
	VINYL SHEETING	1,200 SF	New Material
	POD D (FIS)		
	VINYL SHEETING BACKING PAPER/MASTIC	1,200 SF	New Material
	POD D (FIS)		
	VINYL SHEETING BACKING PAPER/MASTIC	554 SF	New Material
	POD D (FIS)		
	VINYL WALL COVER	554 SF	New Material
	POD D (FIS)		
	WALL TILE	500 SF	Non Detected
	RESTROOMS AND ALL DRINKING FOUNTAINS		
	MORTAR MISCELLANEOUS	500 SF	Non Detected
	STAFF RESTROOMS (3), AND STUDENT RESTROOMS (10)		
	MORTAR MISCELLANEOUS	420 SF	Non Detected

Non- Friable Locations In
SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME**LOCATION****MATERIAL TYPE****QTY****(APPROXIMATE)****ASBESTOS****CONTENT**

TEACHERS WORK AREA IN EACH POD, TEACHER LOUNGE, NURSE ROOM, KINDERGARTEN PRODUCTION ROOM, AND
SPEECH ROOM

SINK UNDERCOATING

84 SF

Non Detected

End Of Report, Total Of 3 Pages

RECOMMENDATIONS FOR
SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

CLASSROOMS 01 PORTABLE BUILDING

PORTABLE 1

PORTABLE BUILDING

960 SF

- (a) This is a replacement/new material.
- (b) The district should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the district's AHERA records.

CLASSROOMS 02 PORTABLE BUILDING

PORTABLE 2

PORTABLE BUILDING

960 SF

- (a) This is a replacement/new material.
- (b) The district should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the district's AHERA records.

PORTABLE P2

BASEBOARD MASTIC

50 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

PORTABLE P2

CARPET MASTIC

960 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR
SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

CLASSROOMS 03 PORTABLE BUILDING

PORTABLE 3

PORTABLE BUILDING

960 SF

- (a) This is a replacement/new material.
- (b) The district should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the district's AHERA records.

PORTABLE P3

BASEBOARD MASTIC

960 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

PORTABLE P3

CARPET MASTIC

960 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR
SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

CLASSROOMS 04-07 PORTABLE BUILDING

PORTABLE P7

BASEBOARD MASTIC

50 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

PORTABLE P7

CARPET MASTIC

960 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

PORTABLES 4-7

PORTABLE BUILDING

3,840 SF

- (a) This is a replacement/new material.
- (b) The district should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the district's AHERA records.

RECOMMENDATIONS FOR
SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

MAIN BUILDING

2 STUDENT RESTROOMS(EXTERIOR ACCESS) AND 2 STAFF RESTROOMS(BY STAFF LOUNGE)

EPOXY COATING

456 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

2 STUDENT RESTROOMS(EXTERIOR ACCESS) AND 2 STAFF RESTROOMS(BY STAFF LOUNGE)

MORTAR MISCELLANEOUS

162 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

2 STUDENT RESTROOMS(EXTERIOR ACCESS) AND 2 STAFF RESTROOMS(BY STAFF LOUNGE)

MORTAR MISCELLANEOUS

324 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

2 STUDENT RESTROOMS(EXTERIOR ACCESS) AND 2 STAFF RESTROOMS(BY STAFF LOUNGE)

WALL TILE

800 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

2 STUDENT RESTROOMS(EXTERIOR ACCESS) AND 2 STAFF RESTROOMS(BY STAFF LOUNGE)

WALL TILE

162 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

RECOMMENDATIONS FOR
SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME**LOCATION****MATERIAL TYPE****RECOMMENDATION****QTY****(APPROXIMATE)**

2 STUDENT RESTROOMS(EXTERIOR ACCESS) AND 2 STAFF RESTROOMS(BY STAFF LOUNGE)**WALL TILE****324 SF**

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

2 STUDENT RESTROOMS(EXTERIOR ACCESS) AND 2 STAFF RESTROOMS(BY STAFF LOUNGE)**WALL TILE MASTIC****800 SF**

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

ADMIN SECTION, ALL OFFICES, MULTI-PURPOSE ROOM, LIBRARY, AND STORAGE ROOM**BASEBOARD MASTIC****3,800 SF**

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

ALL ADMIN HALLWAYS, BOILER ROOM, KITCHEN, ELECTRICAL ROOM, MUSIC ROOM, STAGE, AND SDC ROOM**FIRE DOOR CORE INSULATION****525 SF**

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

ALL CLASSROOMS AND WORK ROOMS**CARPET MASTIC****21,200 SF**

- (a) This is a replacement/new material.
 - (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
 - (c) This documentation is to be maintained with the District's AHERA records.
-

RECOMMENDATIONS FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

ALL OFFICES, STORAGE ROOMS, LIBRARY, MULTI-PURPOSE ROOM, AND COURTYARD STORAGE CLOSETS
(LOCATED OUTSIDE PODS A-F)

SMOOTH WALL MISCELLANEOUS 34,860 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

ALL OFFICES, STORAGE ROOMS, LIBRARY, MULTI-PURPOSE ROOM, AND COURTYARD STORAGE CLOSETS
(LOCATED OUTSIDE PODS A-F)

SMOOTH WALL SURFACING 34,860 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

ALL POD AREAS, PREP AREAS, MULTI-PURPOSE ROOM, STAGE, SDC ROOM, AND HALLWAYS TO
MULTI-PURPOSE ROOM

CEILING MASTIC 7,650 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

ALL POD AREAS, PREP AREAS, MULTI-PURPOSE ROOM, STAGE, SDC ROOM, AND HALLWAYS TO
MULTI-PURPOSE ROOM

CEILING TILE 7,650 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR
SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

ALL PODS, PREP AREAS, SDC ROOM, STAGE AND ALL CLASSROOMS

PRESSED WOOD WALL PANEL 22,000 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

ALL PODS, PREP AREAS, SDC ROOM, STAGE AND ALL CLASSROOMS

PRESSED WOOD WALL PANEL MASTIC 22,000 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

ALL PODS, PREP AREAS, SDC ROOM, STAGE AND ALL CLASSROOMS

VINYL COVERED WALL 22,000 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

ALL PODS, PREP AREAS, SDC ROOM, STAGE AND ALL CLASSROOMS

VINYL WALL COVER MASTIC 22,000 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

CLASSROOMS, SDC ROOM, FACULTY ROOM, AND ADMINISTRATION OFFICES

SUSPENDED CEILING TILE 17,200 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

COURTYARDS (LOCATED OUTSIDE PODS A-F)

SINK UNDERCOATING 30 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

ENTIRE ADMINISTRATION SECTION, ALL OFFICES, HALLWAYS, LOUNGE, AND NURSES ROOM

CARPET MASTIC 4,100 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

ENTIRE BUILDING

SEALANT 90 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

EXTERIOR RESTROOMS (2 EA)

EPOXY COATING 287 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

RECOMMENDATIONS FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

EXTERIOR WALLS

ROUGH WALL 21,750 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

EXTERIOR WALLS

ROUGH WALL SURFACING 21,750 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

KITCHEN AND KITCHEN STORAGE ROOM

VINYL FLOOR TILE 790 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

KITCHEN AND KITCHEN STORAGE ROOM

VINYL FLOOR TILE MASTIC 790 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

LIBRARY OFFICE

CHALK BOARD

16 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

LIBRARY OFFICE

WALL MASTIC

16 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

LOUNGE, HALLWAY, OFFICES, LOBBY, STAGE, CLASSROOMS

VINYL WALL COVER

4,000 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

LOUNGE, HALLWAY, OFFICES, LOBBY, STAGE, CLASSROOMS

VINYL WALL COVER MASTIC

4,000 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

MAIN ELECTRICAL PANEL ROOM

PIPE FITTING INSULATION

2 LF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

MECHANICAL ROOPM(PARKING LOT SIDE)

SEALANT

6 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

MULTI-PURPOSE ROOM, STAGE, HALLWAYS, SDC ROOM, MUSIC ROOM, KITCHEN, PE CLOSET, RSP ROOM, REC. ROOM, AND BOILER ROOM

SMOOTH WALL SURFACING

7,320 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

MULTI-USE ROOM, HALLWAYS, TEACHERS WORK ROOM

VINYL FLOOR TILE

8,450 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

MULTI-USE ROOM, HALLWAYS, TEACHERS WORK ROOM

VINYL FLOOR TILE MASTIC

8,450 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

RECOMMENDATIONS FOR
SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME**LOCATION****MATERIAL TYPE****RECOMMENDATION****QTY****(APPROXIMATE)**

MULTI-USE ROOM, HALLWAYS TO PODS, TEACHERS WORK ROOMS, AND ENTRIES TO CLASSROOMS**VINYL FLOOR TILE****8,100 SF**

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

MULTI-USE ROOM, HALLWAYS TO PODS, TEACHERS WORK ROOMS, AND ENTRIES TO CLASSROOMS**VINYL FLOOR TILE MASTIC****8,100 SF**

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

POD A, B, C, E, AND F**BASEBOARD MASTIC****1,300 LF**

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

POD D (FIS)**BASEBOARD MASTIC****260 LF**

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

POD D (FIS)**MORTAR MISCELLANEOUS****500 SF**

- (a) This is a replacement/new material.
 - (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
 - (c) This documentation is to be maintained with the District's AHERA records.
-

RECOMMENDATIONS FOR
SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

POD D (FIS)

SINK UNDERCOATING

12 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

POD D (FIS)

SUSPENDED CEILING TILE

1,050 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

POD D (FIS)

VINYL SHEETING

1,200 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

POD D (FIS)

VINYL SHEETING BACKING PAPER/MASTIC

1,200 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

POD D (FIS)

VINYL SHEETING BACKING PAPER/MASTIC

554 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

RECOMMENDATIONS FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

POD D (FIS)

VINYL WALL COVER 554 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

POD D (FIS)

WALL TILE 500 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

RESTROOMS AND ALL DRINKING FOUNTAINS

MORTAR MISCELLANEOUS 500 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

STAFF RESTROOMS (3), AND STUDENT RESTROOMS (10)

MORTAR MISCELLANEOUS 420 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

STAGE

COLLAPSIBLE PARTITION WALL 300 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR
SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

STAGE

WALL MASTIC

300 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

TEACHERS WORK AREA IN EACH POD, TEACHER LOUNGE, NURSE ROOM, KINDERGARTEN PRODUCTION ROOM, AND SPEECH ROOM

SINK UNDERCOATING

84 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

METAL STORAGE CONTAINERS

METAL STORAGE CONTAINERS (2)

STORAGE CONTAINER

640 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR
SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

PLASTIC SHED STORAGE CONTAINER

PLASTIC STORAGE CONTAINER (LOCATED NEXT TO 2 METAL STORAGE CONTAINERS)

STORAGE CONTAINER

60 SF

- (a) This is a replacement/new material.
 - (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
 - (c) This documentation is to be maintained with the District's AHERA records.
-

End Of Report, Total Of 16 Pages

SAMPLES REPORT FOR
SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE No.	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
COMMENTS					

CLASSROOMS 02 PORTABLE BUILDING

CLASSROOMS 02 PORTABLE BUILDING

PORTABLE P2

BASEBOARD MASTIC

16-032-SA098

2/8/2016

Negative

ND

NONE DETECTED

ND

Portable P2, Beige/White Mastic.

CLASSROOMS 02 PORTABLE BUILDING

PORTABLE P2

CARPET MASTIC

16-032-SA099

2/8/2016

Negative

ND

NONE DETECTED

ND

Portable P2, Yellow Brown Mastic.

SAMPLES REPORT FOR
SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE No.	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
COMMENTS					

CLASSROOMS 03 PORTABLE BUILDING

CLASSROOMS 03 PORTABLE BUILDING

PORTABLE P3

BASEBOARD MASTIC

16-032-SA100

2/8/2016

Negative

ND

NONE DETECTED

ND

Portable P3, Beige Green Mastic.

CLASSROOMS 03 PORTABLE BUILDING

PORTABLE P3

CARPET MASTIC

16-032-SA101

2/8/2016

Negative

ND

NONE DETECTED

ND

Portable P3, Yellow Brown Mastic.

SAMPLES REPORT FOR
SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE No.	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
COMMENTS					

CLASSROOMS 04-07 PORTABLE BUILDING

CLASSROOMS 04-07 PORTABLE BUILDING

PORTABLE P7

BASEBOARD MASTIC

16-032-SA102

2/8/2016

Negative

ND

NONE DETECTED

ND

Portable P7, Off-White Mastic.

CLASSROOMS 04-07 PORTABLE BUILDING

PORTABLE P7

CARPET MASTIC

16-032-SA103

2/8/2016

Negative

ND

NONE DETECTED

ND

Portable P7, Yellow Mastic.

SAMPLES REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

MAIN BUILDING

MAIN BUILDING

2 STUDENT RESTROOMS(EXTERIOR ACCESS) AND 2 STAFF RESTROOMS(BY STAFF LOUNGE)
 EPOXY COATING

<u>17-059AAA</u>	3/29/2017	Negative	NEW MATERIAL	NONE DETECTED	ND
-------------------------	-----------	----------	--------------	---------------	----

MAIN BUILDING

2 STUDENT RESTROOMS(EXTERIOR ACCESS) AND 2 STAFF RESTROOMS(BY STAFF LOUNGE)
 MORTAR MISCELLANEOUS

<u>17-059AAA</u>	3/29/2017	Negative	NEW MATERIAL	NONE DETECTED	ND
-------------------------	-----------	----------	--------------	---------------	----

MAIN BUILDING

2 STUDENT RESTROOMS(EXTERIOR ACCESS) AND 2 STAFF RESTROOMS(BY STAFF LOUNGE)
 MORTAR MISCELLANEOUS

<u>17-059AAA</u>	3/29/2017	Negative	NEW MATERIAL	NONE DETECTED	ND
-------------------------	-----------	----------	--------------	---------------	----

MAIN BUILDING

2 STUDENT RESTROOMS(EXTERIOR ACCESS) AND 2 STAFF RESTROOMS(BY STAFF LOUNGE)
 WALL TILE

<u>17-059AAA</u>	3/29/2017	Negative	NEW MATERIAL	NONE DETECTED	ND
-------------------------	-----------	----------	--------------	---------------	----

MAIN BUILDING

2 STUDENT RESTROOMS(EXTERIOR ACCESS) AND 2 STAFF RESTROOMS(BY STAFF LOUNGE)
 WALL TILE

<u>17-059AAA</u>	3/29/2017	Negative	NEW MATERIAL	NONE DETECTED	ND
-------------------------	-----------	----------	--------------	---------------	----

MAIN BUILDING

2 STUDENT RESTROOMS(EXTERIOR ACCESS) AND 2 STAFF RESTROOMS(BY STAFF LOUNGE)
 WALL TILE

<u>17059AAA</u>	3/29/2017	Negative	NEW MATERIAL	NONE DETECTED	ND
------------------------	-----------	----------	--------------	---------------	----

MAIN BUILDING

ADMIN SECTION, ALL OFFICES, MULTI-PURPOSE ROOM, LIBRARY, AND STORAGE ROOM
 BASEBOARD MASTIC

<u>16-213AAA</u>	9/13/2016	Negative	NEW MATERIAL	NO SAMPLE	NS
-------------------------	-----------	----------	--------------	-----------	----

SAMPLES REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

MAIN BUILDING

ALL ADMIN HALLWAYS, BOILER ROOM, KITCHEN, ELECTRICAL ROOM, MUSIC ROOM, STAGE, AND SDC ROOM
 FIRE DOOR CORE INSULATION

<u>16-032-SA043</u>	2/8/2016	Positive	26%	CHRYSTOLE	CH
----------------------------	----------	----------	-----	-----------	----

Main Building, Activity 69, Fire Door Core White Insulation.

MAIN BUILDING

ALL OFFICES, STORAGE ROOMS, LIBRARY, MULTI-PURPOSE ROOM, AND COURTYARD STORAGE CLOSETS (LOCATED OUTSIDE PODS A-F)
 SMOOTH WALL MISCELLANEOUS

<u>16-032-SA003</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

Main Building, Classroom 38, Wall Mud.

<u>16-032-SA003</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

Main Building, Classroom 38, Wall Joint Tape.

<u>16-032-SA004</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

Main Building, Classroom 38, Wall Gypsum Board.

<u>16-032-SA013</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

Main Building, Classroom 55, Wall Mud.

<u>16-032-SA013</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

Main Building, Classroom 55, Wall Joint Tape.

<u>16-032-SA014</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

Main Building, Classroom 55, Wall Gypsum Board.

<u>16-032-SA021</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

Main Building, Activity 53, Ceiling Gypsum Board.

<u>16-032-SA026</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

Main Building, Toilet 59, Wall Mud.

<u>16-032-SA026</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

Main Building, Toilet 59, Joint Tape.

<u>16-032-SA027</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

Main Building, Toilet 59, Ceiling Gypsum Board.

SAMPLES REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
<u>16-032-SA035</u> Main Building, Classroom 70, Wall Mud.	2/8/2016	Negative	ND	NONE DETECTED	ND
<u>16-032-SA035</u> Main Building, Classroom 70, Joint Tape.	2/8/2016	Negative	ND	NONE DETECTED	ND
<u>16-032-SA036</u> Main Building, Classroom 70, Wall Gypsum Board.	2/8/2016	Negative	ND	NONE DETECTED	ND
<u>16-032-SA053</u> Main Building, Girls Restroom, Upper Wall Mud.	2/8/2016	Negative	ND	NONE DETECTED	ND
<u>16-032-SA053</u> Main Building, Girls Restroom, Upper Wall Joint Tape.	2/8/2016	Negative	ND	NONE DETECTED	ND
<u>16-032-SA054</u> Main Building, Girls Restroom, Upper Wall Gypsum Board.	2/8/2016	Negative	ND	NONE DETECTED	ND
<u>16-032-SA067</u> Main Building, Platform-93, Wall Mud.	2/8/2016	Negative	ND	NONE DETECTED	ND
<u>16-032-SA067</u> Main Building, Platform-93, Joint Tape.	2/8/2016	Negative	ND	NONE DETECTED	ND
<u>16-032-SA068</u> Main Building, Platform-93, Wall Gypsum Board.	2/8/2016	Negative	ND	NONE DETECTED	ND
<u>16-032-SA083</u> Main Building, Janitor-4, Wall Mud.	2/8/2016	Negative	ND	NONE DETECTED	ND
<u>16-032-SA083</u> Main Building, Janitor-4, Wall Joint Tape.	2/8/2016	Negative	ND	NONE DETECTED	ND
<u>16-032-SA084</u> Main Building, Janitor-4, Wall Gypsum Board.	2/8/2016	Negative	ND	NONE DETECTED	ND

SAMPLES REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

MAIN BUILDING

ALL OFFICES, STORAGE ROOMS, LIBRARY, MULTI-PURPOSE ROOM, AND COURTYARD STORAGE CLOSETS (LOCATED OUTSIDE PODS A-F)

SMOOTH WALL SURFACING

<u>16-032-SA002</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

Main Building, Classroom 38, Wall Skimcoat and Paint for Gypsum Board.

<u>16-032-SA012</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

Main Building, Classroom 55, Wall Skimcoat and Paint for Gypsum Board.

<u>16-032-SA025</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

Main Building, Toilet-59, Ceiling Skimcoat and Paint for Gypsum Board.

<u>16-032-SA034</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

Main Building, Classroom 70, Wall Skimcoat and Paint for Gypsum Board.

<u>16-032-SA052</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

Main Building, Girls Restroom-88, Upper Wall, Skimcoat and Paint for Gypsum Board.

<u>16-032-SA060</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

Main Building, Boys Restroom-89, Wall Old Skimcoat and Paint for Wood Panel.

<u>16-032-SA066</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

Main Building, Platform-93, Wall Skimcoat and Paint for Gypsum Board.

<u>16-032-SA082</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

Main Building, Janitor-4, Wall Skimcoat and Paint for Gypsum Board.

MAIN BUILDING

ALL POD AREAS, PREP AREAS, MULTI-PURPOSE ROOM, STAGE, SDC ROOM, AND HALLWAYS TO MULTI-PURPOSE ROOM
 CEILING MASTIC

<u>16-032-SA020</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

Main Building, Activity 53, Brown Mastic.

<u>16-032-SA045</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

Main Building, Activity 61, Brown Mastic.

<u>16-032-SA081</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

Main Building, Entry 82, Brown Mastic.

SAMPLES REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

<u>16-032-SA093</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

Main Building, Activity-29, Brown Mastic.

MAIN BUILDING

ALL POD AREAS, PREP AREAS, MULTI-PURPOSE ROOM, STAGE, SDC ROOM, AND HALLWAYS TO MULTI-PURPOSE ROOM
 CEILING TILE

<u>16-032-SA019</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

Main Building, Activity 53, 1'x1' Ceiling Tile.

<u>16-032-SA080</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

Main Building, Entry 82, 1'x1' Pitted Mark Ceiling Tile.

<u>16-032-SA092</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

Main Building, Activity-29, 1'x1' Pitted Mark Ceiling Tile.

MAIN BUILDING

ALL PODS, PREP AREAS, SDC ROOM, STAGE AND ALL CLASSROOMS
 PRESSED WOOD WALL PANEL

<u>05/212AAA</u>	9/8/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

MAIN BUILDING

ALL PODS, PREP AREAS, SDC ROOM, STAGE AND ALL CLASSROOMS
 PRESSED WOOD WALL PANEL MASTIC

<u>05-212AAA</u>	9/8/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

MAIN BUILDING

ALL PODS, PREP AREAS, SDC ROOM, STAGE AND ALL CLASSROOMS
 VINYL COVERED WALL

<u>16-032-SA005</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

Main Building, Classroom 38, Wall Vinyl Wall Covered.

<u>16-032-SA015</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

Main Building, Classroom 55, Wall Vinyl Wall Covered.

<u>16-032-SA037</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

Main Building, Classroom 70, Wall Vinyl Wall Covered only.

SAMPLES REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

MAIN BUILDING

ALL PODS, PREP AREAS, SDC ROOM, STAGE AND ALL CLASSROOMS

VINYL WALL COVER MASTIC

<u>16-032-SA006</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

Main Building, Classroom 38, Mastic.

<u>16-032-SA006</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

Main Building, Classroom 38, Fiberboard.

<u>16-032-SA016</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

Main Building, Classroom 55, Yellow Mastic.

<u>16-032-SA016</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

Main Building, Classroom 55, Fiberboard.

<u>16-032-SA038</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

Main Building, Classroom 70, Wall Vinyl Wall Covered, Fiberboard and Mastic only.

<u>16-032-SA070</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

Main Building, SDC-96, Wall Vinyl Wall Covered Adhesive.

<u>16-032-SA070</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

Main Building, SDC-96, Wall Vinyl Wall Covered Compound only.

MAIN BUILDING

CLASSROOMS, SDC ROOM, FACULTY ROOM, AND ADMINISTRATION OFFICES

SUSPENDED CEILING TILE

<u>16-032-SA001</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

Main Building, Classroom 38, 2'x4' Suspended Ceiling Tile.

<u>16-032-SA011</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

Main Building, Classroom 55, 2'x4' Suspended Ceiling Tile.

<u>16-032-SA033</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

Main Building, Classroom 70, 2'x4' Suspended Ceiling Tile.

<u>16-032-SA062</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

Main Building, Music-91, 2'x2' Pitted Mark Suspended Ceiling Tile.

SAMPLES REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

<u>16-032-SA069</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
Main Building, SDC-96, 2'x4' Pitted Mark Suspended Ceiling Tile.					

<u>16-032-SA089</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
Main Building, Entry-16, 2'x2' Popcorn Pattern Texture Suspended Ceiling Tile.					

<u>16-032-SA094</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
Main Building, Office-3, 2'x4' Pitted Mark Suspended Ceiling Tile.					

MAIN BUILDING

COURTYARDS (LOCATED OUTSIDE PODS A-F)
 SINK UNDERCOATING

<u>10-052AAA</u>	3/10/2010	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

MAIN BUILDING

ENTIRE ADMINISTRATION SECTION, ALL OFFICES, HALLWAYS, LOUNGE, AND NURSES ROOM
 CARPET MASTIC

<u>16-213AAA</u>	2/8/2016	Negative	NEW MATERIAL	NO SAMPLE	NS
-------------------------	----------	----------	--------------	-----------	----

MAIN BUILDING

ENTIRE BUILDING
 SEALANT

<u>22-025.NS</u>	2/16/2022	Negative	NEW MATERIAL	NO SAMPLE	NS
-------------------------	-----------	----------	--------------	-----------	----

MAIN BUILDING

EXTERIOR RESTROOMS (2 EA)
 EPOXY COATING

<u>23-026.NS</u>	2/15/2023	Negative	NEW MATERIAL	NO SAMPLE	NS
-------------------------	-----------	----------	--------------	-----------	----

MAIN BUILDING

KITCHEN AND KITCHEN STORAGE ROOM
 VINYL FLOOR TILE

<u>10-174AAA</u>	9/1/2010	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

<u>16-032-SA009</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
Main Building, Activity 37, 12"x12" Beige Vinyl Floor Tile.					

SAMPLES REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

<u>16-032-SA047</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
Main Building, Kitchen-83, 12"x12" Beige with Gray Vinyl Floor Tile.					

MAIN BUILDING

KITCHEN AND KITCHEN STORAGE ROOM
 VINYL FLOOR TILE MASTIC

<u>10-174AAA</u>	9/1/2010	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

<u>16-032-SA010</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
Main Building, Activity 37, Yellow Mastic.					

<u>16-032-SA010</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
Main Building, Activity 37, Leveling Compound.					

<u>16-032-SA048</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
Main Building, Kitchen-83, Yellow Mastic.					

<u>16-032-SA048</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
Main Building, Kitchen-83, White Leveling Compound.					

MAIN BUILDING

LIBRARY OFFICE
 CHALK BOARD

<u>10-052AAA</u>	3/10/2010	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

MAIN BUILDING

LIBRARY OFFICE
 WALL MASTIC

<u>10-052AAA</u>	3/10/2010	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

MAIN BUILDING

LOUNGE, HALLWAY, OFFICES, LOBBY, STAGE, CLASSROOMS
 VINYL WALL COVER

<u>10-174AAA</u>	9/1/2010	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

SAMPLES REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

MAIN BUILDING

LOUNGE, HALLWAY, OFFICES, LOBBY, STAGE, CLASSROOMS

VINYL WALL COVER MASTIC

<u>10-174AAA</u>	9/1/2010	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

MAIN BUILDING

MAIN ELECTRICAL PANEL ROOM

PIPE FITTING INSULATION

<u>07-043AAA</u>	11/5/2007	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

MAIN BUILDING

MECHANICAL ROOPM(PARKING LOT SIDE)

SEALANT

<u>22-025.NS</u>	2/16/2022	Negative	NEW MATERIAL	NO SAMPLE	NS
-------------------------	-----------	----------	--------------	-----------	----

MAIN BUILDING

MULTI-PURPOSE ROOM, STAGE, HALLWAYS, SDC ROOM, MUSIC ROOM, KITCHEN, PE CLOSET, RSP ROOM, REC. ROOM, AND BOILER ROOM

SMOOTH WALL SURFACING

<u>16-032-SA051</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

Main Building, Girls Restroom-88, Wall Skimcoat and Paint for Concrete.

<u>16-032-SA061</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

Main Building, Girls Restroom-88, Exterior Wall Skimcoat and Paint for Concrete.

<u>16-032-SA065</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

Main Building, Platform-93, Wall Skimcoat and Paint for Concrete.

MAIN BUILDING

MULTI-USE ROOM, HALLWAYS, TEACHERS WORK ROOM

VINYL FLOOR TILE

<u>18-127AAA</u>	8/8/2018	Negative	NEW MATERIAL	NONE DETECTED	ND
-------------------------	----------	----------	--------------	---------------	----

MAIN BUILDING

MULTI-USE ROOM, HALLWAYS, TEACHERS WORK ROOM

VINYL FLOOR TILE MASTIC

<u>18-127AAA</u>	8/8/2018	Negative	NEW MATERIAL	NONE DETECTED	ND
-------------------------	----------	----------	--------------	---------------	----

SAMPLES REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

MAIN BUILDING

MULTI-USE ROOM, HALLWAYS TO PODS, TEACHERS WORK ROOMS, AND ENTRIES TO CLASSROOMS
 VINYL FLOOR TILE

<u>10-174AAA</u>	9/1/2010	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

<u>16-032-SA022</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

Main Building, Activity 53, 12"x12" Beige Vinyl Floor Tile.

<u>16-032-SA041</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

Main Building, Activity 69, 12"x12" Beige Vinyl Floor Tile.

<u>16-032-SA077</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

Main Building, Multi-Purpose-81, 12"x12" Gray Vinyl Floor Tile.

<u>16-032-SA078</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

Main Building, Multi-Purpose-81, 12"x12" Beige Vinyl Floor Tile.

MAIN BUILDING

MULTI-USE ROOM, HALLWAYS TO PODS, TEACHERS WORK ROOMS, AND ENTRIES TO CLASSROOMS
 VINYL FLOOR TILE MASTIC

<u>10-174AAA</u>	9/1/2010	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

<u>16-032-SA023</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

Main Building, Activity 53, Yellow Mastic.

<u>16-032-SA023</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

Main Building, Activity 53, Gray Leveling Compound.

<u>16-032-SA042</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

Main Building, Activity 69, Gray Leveling Compound.

<u>16-032-SA042</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

Main Building, Activity 69, Yellow Mastic.

<u>16-032-SA079</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

Main Building, Multi-Purpose-81, Yellow Mastic.

SAMPLES REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

MAIN BUILDING

POD A, B, C, E, AND F
 BASEBOARD MASTIC

<u>25-036.NS</u>	2/26/2025	Negative	NEW MATERIAL	NO SAMPLE	NS
-------------------------	-----------	----------	--------------	-----------	----

MAIN BUILDING

POD D (FIS)
 BASEBOARD MASTIC

<u>17-059AAA</u>	3/29/2017	Negative	NEW MATERIAL	NONE DETECTED	ND
-------------------------	-----------	----------	--------------	---------------	----

MAIN BUILDING

POD D (FIS)
 MORTAR MISCELLANEOUS

<u>17-059AAA</u>	3/29/2017	Negative	NEW MATERIAL	NONE DETECTED	ND
-------------------------	-----------	----------	--------------	---------------	----

MAIN BUILDING

POD D (FIS)
 SINK UNDERCOATING

<u>17-059AAA</u>	3/29/2017	Negative	NEW MATERIAL	NONE DETECTED	ND
-------------------------	-----------	----------	--------------	---------------	----

MAIN BUILDING

POD D (FIS)
 SUSPENDED CEILING TILE

<u>17-059AAA</u>	3/29/2017	Negative	NEW MATERIAL	NONE DETECTED	ND
-------------------------	-----------	----------	--------------	---------------	----

MAIN BUILDING

POD D (FIS)
 VINYL SHEETING

<u>17-059AAA</u>	3/29/2017	Negative	NEW MATERIAL	NONE DETECTED	ND
-------------------------	-----------	----------	--------------	---------------	----

MAIN BUILDING

POD D (FIS)
 VINYL SHEETING BACKING PAPER/MASTIC

<u>17-059AAA</u>	3/29/2017	Negative	NEW MATERIAL	NONE DETECTED	ND
-------------------------	-----------	----------	--------------	---------------	----

SAMPLES REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

MAIN BUILDING

POD D (FIS)
WALL TILE

<u>17-059AAA</u>	3/29/2017	Negative	NEW MATERIAL	NONE DETECTED	ND
-------------------------	-----------	----------	--------------	---------------	----

MAIN BUILDING

RESTROOMS AND ALL DRINKING FOUNTAINS
MORTAR MISCELLANEOUS

<u>08-241AAA</u>	10/15/2008	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	------------	----------	---------	-----------	----

<u>16-032-SA028</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

Main Building, Toilet 59, Brown Grout.

<u>16-032-SA029</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

Main Building, Toilet 59, Beige Glue.

<u>16-032-SA030</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

Main Building, Toilet 59, Gray and White Backing Board.

<u>16-032-SA055</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

Main Building, Girls Restroom-88, Light Brown Grout.

<u>16-032-SA056</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

Main Building, Girls Restroom-88, Beige Glue.

<u>16-032-SA057</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

Main Building, Girls Restroom-88, Gray and White Backing Board.

MAIN BUILDING

STAFF RESTROOMS (3), AND STUDENT RESTROOMS (10)
MORTAR MISCELLANEOUS

<u>10-052AAA</u>	3/10/2010	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

Apparent New Material as of this date.

<u>16-032-SA031</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

Main Building, Toilet 59, Brown Grout.

<u>16-032-SA058</u>	2/8/2016	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

Main Building, Girls Restroom-88, Brown Grout.

SAMPLES REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

16-032-SA059

2/8/2016

Negative

ND

NONE DETECTED

ND

Main Building, Girls Restroom-88, Gray Mortar Bed.

MAIN BUILDING

STAGE

COLLAPSIBLE PARTITION WALL

09-098AAA

5/13/2009

Positive

ASSUMED

NO SAMPLE

NS

MAIN BUILDING

STAGE

WALL MASTIC

09-098AAA

5/13/2009

Positive

ASSUMED

NO SAMPLE

NS

MAIN BUILDING

TEACHERS WORK AREA IN EACH POD, TEACHER LOUNGE, NURSE ROOM, KINDERGARTEN PRODUCTION ROOM, AND SPEECH ROOM

SINK UNDERCOATING

08-241AAA

10/15/2008

Positive

ASSUMED

NO SAMPLE

NS

16-032-SA024

2/8/2016

Negative

ND

NONE DETECTED

ND

Main Building, Activity 53, Stainless Metal Sink Black Undercoating.

16-032-SA032

2/8/2016

Negative

ND

NONE DETECTED

ND

Main Building, Atrium 57, Stainless Metal Sink Gray Undercoating.

SAMPLES REPORT FOR
SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE NO.	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
COMMENTS					

METAL STORAGE CONTAINERS

METAL STORAGE CONTAINERS

METAL STORAGE CONTAINERS (2)

STORAGE CONTAINER

<u>16-074.NS</u>	3/17/2016	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

SAMPLES REPORT FOR
SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE NO.	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
COMMENTS					

PLASTIC SHED STORAGE CONTAINER

PLASTIC SHED STORAGE CONTAINER

PLASTIC STORAGE CONTAINER (LOCATED NEXT TO 2 METAL STORAGE CONTAINERS)
STORAGE CONTAINER

10-052.NS	3/10/2010	Negative	NEW MATERIAL	NO SAMPLE	NS
------------------	-----------	----------	--------------	-----------	----

Plastic Storage Container.

End Of Report, Total Of 18 Pages

DAMAGE REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

MAIN BUILDING

MAIN BUILDING

ALL ADMIN HALLWAYS, BOILER ROOM, KITCHEN, ELECTRICAL ROOM, MUSIC ROOM, STAGE, AND SDC ROOM

FIRE DOOR CORE INSULATION

525 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/08/2005	FIRE DOOR CORE INSULATION (25 EA FIRE DOORS). This Material is in GOOD condition as of this date.
02/08/2016	Sample 16-032-SA043 collected from Main Building, Activity 69, Fire Door Core, White Insulation.
09/13/2016	Repairs Observed. Damages to Activity Room 67 (Interior), Lobby 1, and the Doorway between Hall 77 and Entry 16 Doors have been repaired during the Summer 2016 Modernization project. No other changes as of this date.
02/04/2020	This Material is unchanged as of this date.
08/28/2020	This Material is unchanged as of this date.
02/10/2021	This Material is unchanged as of this date.
08/11/2021	This Material is unchanged as of this date.
02/18/2022	Damage Observed. <5% Physical Damage - in the form of 1 EA Missing Screw White Core Insulation Exposed on Double Door to Main Entrance to Pod A. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.
08/17/2022	Additional Damage Observed. <5% Physical Damage in the form of 4 (EA) Small Screws Missing with White Core Insulation Exposed at Reading Room and Electrical Room Door. Double Door Gate House of Pod F has an Inside Cover Piece Missing with White Core Insulation Exposed. No other changes as of this date.
02/15/2023	This Material is unchanged as of this date.
08/16/2023	Partial Repairs and Additional Damage Observed. The Damage to the Double Door Gate House of Pod F has been repaired. Additional Damage in the form of 2" Gouge with White Core Insulation Exposed due to the Chair Racks going in and out of the Chair Storage Room. Material remains in FAIR condition overall. No other changes as of this date.
02/14/2024	This Material is unchanged as of this date.
08/14/2024	This Material is unchanged as of this date.
02/27/2025	This Material is unchanged as of this date.

DAMAGE REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESSMENT CATEGORY	COMMENTS
			QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)

MAIN BUILDING

ALL OFFICES, STORAGE ROOMS, LIBRARY, MULTI-PURPOSE ROOM, AND COURTYARD STORAGE CLOSETS
(LOCATED OUTSIDE PODS A-F)

SMOOTH WALL MISCELLANEOUS

34,860 SF

P: Less Than 5%

W: <10% Stains or Flaking

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/08/2005	GYPSUM WALLBOARD SYSTEM WALLS AND CEILINGS. This Material is in GOOD condition as of this date.
04/16/2008	Water Damage observed in Pods C and D under 1'x1' Ceiling Tiles as of this date.
05/13/2009	Additional Damage observed. Pod A also has <10% Water Damage. No other changes as of this date.
09/04/2009	Material remains in FAIR condition overall. This Material is unchanged as of this date.
03/10/2010	Location Description changed from ALL OFFICES, STORAGE ROOMS, LIBRARY, AND MULTI-PURPOSE ROOM to ALL OFFICES, STORAGE ROOMS, LIBRARY, MULTI-PURPOSE ROOM, AND COURTYARD STORAGE CLOSETS (LOCATED OUTSIDE PODS A-F). Quantity changed from 34,400 SF to 34,860 SF. Additional Damage: <5% Physical Damage - in the form of approx. 1 SF of the Wall has been cut and removed in Electrical Room of Pod D. Friability changed from Low to Moderate to reflect this change.
09/01/2010	Some Walls have a Vinyl Cover. No other changes as of this date.
02/08/2016	Sample 16-032-SA003 collected from Main Building, Classroom 38, Wall Joint Tape and Mud for Gypsum Board. Sample 16-032-SA004 collected from Main Building, Classroom 38, Wall Gypsum Board. Sample 16-032-SA013 collected from Main Building, Classroom 55, Wall Joint Tape and Mud. Sample 16-032-SA014 collected from Main Building, Classroom 55, Wall Gypsum Board. Sample 16-032-SA026 collected from Main Building, Toilet-59, Wall Joint Tape and Mud for Gypsum Board. Sample 16-032-SA027 collected from Main Building, Toilet-59, Ceiling Gypsum Board. Sample 16-032-SA035 collected from Main Building, Classroom 70, Wall Joint Tape and Mud for Gypsum Board. Sample 16-032-SA036 collected from Main Building, Classroom 70, Wall Gypsum Board. Sample 16-032-SA053 collected from Main Building.
03/17/2016	Additional Damage observed. 1 SF of Damage observed in Chair Storage Room off Multi-Purpose Room; and 1 SF of Physical Damage in Multi-Purpose Room. No other changes as of this date.
09/13/2016	Repairs Observed. Damages in Chair Storage Room have been repaired as of this date. Material remains in FAIR condition. No other changes as of this date.
08/29/2017	Additional Damage Observed. Ceiling Tiles now have Water Damage. No other changes as of this date.
02/04/2020	This Material is unchanged as of this date.
08/28/2020	This Material is unchanged as of this date.
02/10/2021	This Material is unchanged as of this date.
08/11/2021	This Material is unchanged as of this date.
02/18/2022	This Material is unchanged as of this date.
08/17/2022	This Material is unchanged as of this date.
02/15/2023	This Material is unchanged as of this date.

DAMAGE REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESSMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	--------------------------	----------	----------------------	---

08/16/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

08/14/2024 This Material is unchanged as of this date.

02/27/2025 This Material is unchanged as of this date.

MAIN BUILDING

ALL OFFICES, STORAGE ROOMS, LIBRARY, MULTI-PURPOSE ROOM, AND COURTYARD STORAGE CLOSETS (LOCATED OUTSIDE PODS A-F)

SMOOTH WALL SURFACING

34,860 SF

P: Less Than 5%

W: <10% Stains or Flaking

DAMAGED FRIABLE SURFACING ACM

08/24/2006 SKIM COAT FOR GYPSUM WALLBOARD SYSTEM WALLS AND CEILINGS. This Material is in GOOD condition as of this date.

04/16/2008 Water Damage observed in Pods C and D under 1'x1' Ceiling Tiles as of this date.

05/13/2009 Additional damage observed. <10% Water Damage includes Pod A. No other changes as of this date.

09/04/2009 Material remains in FAIR condition overall. This Material is unchanged as of this date.

03/10/2010 Location Description changed from ALL OFFICES, STORAGE ROOMS, LIBRARY, AND MULTI-PURPOSE ROOM to ALL OFFICES, STORAGE ROOMS, LIBRARY, MULTI-PURPOSE ROOM, AND COURTYARD STORAGE CLOSETS (LOCATED OUTSIDE PODS A-F). Quantity changed from 34,400 SF to 34,860 SF. Additional damage: <5% Physical Damage - in the form of approx. 1 SF of the wall has been cut and removed in electrical Room of Pod D.

02/08/2016 Sample 16-032-SA002 collected from Main Building, Classroom 38, Wall Skim Coat and Paint for Gypsum Board. Sample 16-032-SA012 collected from Main Building, Classroom 55, Wall Skimcoat and Paint for Gypsum Board. Sample 16-032-SA025 collected from Main Building, Toilet-59, Ceiling Skimcoat and Paint for Gypsum Board. Sample 16-032-SA034 collected from Main Building Classroom 70, Wall Skimcoat and Paint for Gypsum Board. Sample 16-032-SA052 collected from Main Building, Girls Restroom-88, Upper Wall Skimcoat Skimcoat and Paint for Gypsum Board. Sample 16-032-SA060 collected from Main Building, Boys Restroom-89, Wall Old Skimcoat and Paint for Wood Panel. Sample 16-032-SA066 Main Building, Platform-93 Wall Skimcoat and Paint for Gypsum Board. Sample 16-032-SA082 Main Building Janitor-4

03/17/2016 Additional Damage observed. 1 SF of Damage observed in Chair Storage Room off Multi-Purpose Room; and 1 SF of Physical Damage in Multi-Purpose Room. No other changes as of this date.

09/13/2016 Repairs Observed. Damages in Chair Storage Room have been repaired as of this date. Material remains in FAIR condition. No other changes as of this date.

08/29/2017 Additional Damage Observed. Ceiling Tiles now have Water Damage. No other changes as of this date.

02/04/2020 This Material is unchanged as of this date.

08/28/2020 This Material is unchanged as of this date.

02/10/2021 This Material is unchanged as of this date.

08/11/2021 This Material is unchanged as of this date.

DAMAGE REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

02/18/2022 This Material is unchanged as of this date.

08/17/2022 This Material is unchanged as of this date.

02/15/2023 This Material is unchanged as of this date.

08/16/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

08/14/2024 This Material is unchanged as of this date.

02/27/2025 This Material is unchanged as of this date.

MAIN BUILDING

ALL POD AREAS, PREP AREAS, MULTI-PURPOSE ROOM, STAGE, SDC ROOM, AND HALLWAYS TO MULTI-PURPOSE ROOM

CEILING MASTIC

7,650 SF

P: Less Than 5%

W: <10% Stains or Flaking

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/08/2005 MASTIC/ADHESIVE FOR 1'X1' GLUED-ON CEILING TILE. This Material is in GOOD condition as of this date.

11/05/2007 Material Re-Assessed. Damage: <5% Physical Damage - due to 1 Tile missing in Pod "C", and 4 Tiles missing in Pod "D". Material condition changed from GOOD to FAIR overall. No other changes as of this date.

04/16/2008 8 additional Tiles are Water Damage observed in Pod C and these Tiles are coming loose as of this date.

05/13/2009 Material Re-Assessed. Pod A has 2 Tiles that are becoming loose. Physical Damage in Pod C has been repaired. Missing Tiles from Pod D has changed from 4 Tiles to 1. <10% Water Damage due to Pod A has 3 Tiles with Water stains. Pod C has 7 Tiles Water stained. Material remains in FAIR condition overall as of this date.

03/10/2010 Additional Damage observed in the form of E Pod has 1 Tile Water Damaged. Also, several Tiles are Physically Damaged in a Classroom in Multi-Purpose room. No other changes as of this date.

09/01/2010 Additional Damage observed. 6 SF Tiles missing on Hatch Door by Boiler Room exposing the Mastic/Adhesive. 2 Tiles Damaged in the Hallway to the Multi-Purpose Room by the Kitchen. Previously missing Tiles in Pod D have been replaced. 1 Tile is Missing in the Teachers Work Room in Pod D, exposing the Mastic/Adhesive. No other changes as of this date.

11/30/2011 Additional Damage - in the form of Multipurpose Room has 32 Tiles with holes. Pod C has an additional 2 Tiles with Water Damage. Pod A, previously had 3 Tiles with Water stains, now has 1 Tile only Water stained. Friability changed from Low to High to reflect this change.

10/10/2012 Additional Damage - in the form of Pod D has 4 Water Damaged Ceiling Tiles. Also, holes have been repaired in Multipurpose Room - in the form of 32 Tiles previously damaged, now only 2 Tiles damaged. No other changes as of this date.

03/17/2015 POD A & D each have 1 Ceiling Tile missing, and Brown Mastic/Adhesive is exposed. No other changes as of this date.

DAMAGE REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
09/18/2015				Additional Damage observed, Hallway outside of Kitchen has 2 Tiles Physically Damaged. No other changes as of this date.		
02/08/2016				Sample 16-032-SA020 collected from Main Building, Activity 53, Brown Mastic for 1'x1' Ceiling Tile. Sample 16-032-SA045 collected from Main Building, Activity 61, 1'x1' Ceiling Tile Brown Mastic. Sample 16-032-SA081 collected from Main Building, Entry-82, 1'x1' Pitted Mark Ceiling Tile, Brown Mastic. Sample 16-032-SA093 collected from Main Building, Activity-29, 1'x1' Pitted Mark Ceiling Tile, Brown Mastic.		
03/17/2016				Additional Damage observed. 1 Tile is missing in A Pod Work Room exposing Mastic/Adhesive. C Pod Work Room has 10 Tiles with Water Damage; E Pod Work Room has 1 Tile with Water Damage. F Pod Work Room has 1 Tile loose. No other changes as of this date.		
09/13/2016				Additional Damage observed. <10% Water Damage - in the form of 10 Tiles with Water Damage in the Multi-Purpose Room. No other changes as of this date.		
03/29/2017				Material Re-assessed. Water Damage painted over. Additional Damage Observed. 7 Tiles loose and 7 Tiles have Water Stains in the Multi-Purpose Room. No other changes as of this date.		
08/29/2017				Additional Damage Observed. C-Pod now has 9 Tiles with Water Damage. Access Door has 1 Tile with Physical Damage. No other changes as of this date.		
08/08/2018				Additional Damage Observed. F-Pod now has 1Tile Missing on Hatch Door and 12 Tiles have Surface Damage. No other changes as of this date.		
08/14/2019				Additional Damage Observed. <5% Physical Damage in the form of 1 SF of Tiles with Stains in each one of the Activity Rooms of Pod A and Pod C. Material Condition remains in FAIR condition overall. No other changes as of this date.		
02/04/2020				Additional Damage Observed. 1 Tile Missing Mastic Exposed in Pod A. No other changes as of this date.		
08/28/2020				This Material is unchanged as of this date.		
02/10/2021				This Material is unchanged as of this date.		
08/11/2021				This Material is unchanged as of this date.		
02/18/2022				This Material is unchanged as of this date.		
08/17/2022				This Material is unchanged as of this date.		
02/15/2023				This Material is unchanged as of this date.		
08/16/2023				This Material is unchanged as of this date.		
02/14/2024				This Material is unchanged as of this date.		
08/14/2024				This Material is unchanged as of this date.		
02/27/2025				This Material is unchanged as of this date.		

DAMAGE REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P): WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

MAIN BUILDING

ALL POD AREAS, PREP AREAS, MULTI-PURPOSE ROOM, STAGE, SDC ROOM, AND HALLWAYS TO MULTI-PURPOSE ROOM

CEILING TILE

7,650 SF

P: Less Than 5%

W: <10% Stains or Flaking

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/08/2005	1'X1' White with a Pitted mark Form Pattern GLUED-ON CEILING TILE. This Material is in GOOD condition as of this date. (Original entry updated 03/17/15).
11/05/2007	Material Re-Assessed. Damage: <5% Physical Damage - due to 1 Tile missing in Pod "C", and 4 Tiles missing in Pod "D"; <10% Water Damage - 2 loose and water damage Tiles in Pod "C". Friability changed from Low to Moderate. Material condition changed from GOOD to FAIR overall. No other changes as of this date.
04/16/2008	8 additional Tiles are Water Damage observed in Pod C and these Tiles are coming loose as of this date.
05/13/2009	Material Re-Assessed. Pod A has 2 Tiles that are becoming loose. Physical Damage in Pod C has been Repaired. Missing Tiles from Pod D has changed from 4 tiles to 1. <10% Water Damage due to Pod A has 3 Tiles with Water stains. Pod C has 7 Tiles Water stained. Material remains in FAIR condition overall as of this date.
03/10/2010	Additional Damage observed in the form of E Pod has 1 Tile Water Damaged. Also, several Tiles are Physically Damaged in a Classroom in Multi-Purpose room, also called Title 1. No other changes as of this date.
09/01/2010	Additional Damage observed. 6 SF Tiles missing on Hatch Door by Boiler Room exposing the Mastic/Adhesive. 2 Tiles Damaged in the Hallway to the Multi-Purpose Room by the Kitchen. Previously missing Tiles in Pod D have been replaced. 1 Tile is Missing in the Teachers Work Room in Pod D, exposing the Mastic/Adhesive. No other changes as of this date.
11/30/2011	Additional Damage - in the form of Multipurpose Room has 32 Tiles with holes. Pod C has an additional 2 Tiles with Water Damage. Pod A, previously had 3 Tiles with Water stains, now has 1 Tile only Water stained. Friability changed from Low to High to reflect this change.
10/10/2012	Additional Damage - in the form of Pod D has 4 Water Damaged Ceiling Tiles. Also, holes have been Repaired in Multipurpose Room - in the form of 32 Tiles previously damaged, now only 2 Tiles damaged. No other changes as of this date.
03/17/2015	Tiles are White with a Pitted mark Form Pattern. Original Entry updated. POD A & D each have 1 Ceiling Tile missing, and Brown Mastic/Adhesive is exposed. No other changes as of this date.
09/18/2015	Additional Damage observed, Hallway outside of Kitchen has 2 Tiles Physically Damaged. No other change as of this date.
02/08/2016	Sample 16-032-SA19 collected from Main Building, Activity 53, 1'x1' Ceiling Tile. Sample 16-032-SA044 collected from Main Building, Activity 61, 1'x1' Ceiling Tile. Sample 16-032-SA080 collected from Main Building, Entry-82, 1'x1' Pitted Mark Ceiling Tile. Sample 16-032-SA092 collected from Main Building, Activity-29, 1'x1' Pitted Mark Ceiling Tile.
03/17/2016	Additional Damage observed. 1 Tile is missing in A Pod Work Room exposing Mastic/Adhesive. C Pod Work Room has 10 Tiles with Water Damage; E Pod Work Room has 1 Tile with Water Damage. F Pod Work Room has 1 Tile loose. No other changes as of this date.

DAMAGE REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESSMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
09/13/2016				Additional Damage Observed. <10% Water Damage - in the form of 10 Tiles with Water Damage in the Multi-Purpose Room. No other changes as of this date.		
03/29/2017				Material Re-assessed. Water Damage painted over. Additional Damage Observed. 7 Tiles loose and 7 Tiles have Water Stains in the Multi-Purpose Room. No other changes as of this date.		
08/29/2017				Additional Damage Observed. C-Pod now has 9 Tiles with Water Damage. Access Door has 1 Tile with Physical Damage. No other changes as of this date.		
08/08/2018				Additional Damage Observed. F-Pod now has 1Tile Missing on Hatch Door and 12 Tiles have Surface Damage. No other changes as of this date.		
08/14/2019				Additional Damage Observed. <5% Physical Damage in the form of 1 SF of Tiles with Stains in each one of the Activity Rooms of Pod A and Pod C. Material Condition remains in FAIR condition overall. No other changes as of this date.		
02/04/2020				Additional Damage Observed. 1 Tile Missing Mastic Exposed in Pod A. No other changes as of this date.		
08/28/2020				This Material is unchanged as of this date.		
02/10/2021				This Material is unchanged as of this date.		
08/11/2021				This Material is unchanged as of this date.		
02/18/2022				This Material is unchanged as of this date.		
08/17/2022				This Material is unchanged as of this date.		
02/15/2023				This Material is unchanged as of this date.		
08/16/2023				This Material is unchanged as of this date.		
02/14/2024				This Material is unchanged as of this date.		
08/14/2024				This Material is unchanged as of this date.		
02/27/2025				This Material is unchanged as of this date.		

MAIN BUILDING

CLASSROOMS, SDC ROOM, FACULTY ROOM, AND ADMINISTRATION OFFICES

SUSPENDED CEILING TILE

17,200 SF

P: Less Than 5%

W: <10% Stains or Flaking

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/08/2005	2'X2' AND 2'X4' White with a Pitted Mark form pattern SUSPENDED CEILING TILE. This Material is in GOOD condition as of this date. (Original entry updated 03/17/15).
03/05/2006	Damage Observed. <5% Physical Damage - in the form of approximately 10 SF of degradation above the double entry Door in Hallway next to Kitchen.; <10% Water Damage - in the form of approximately 10 SF of stains above the double entry Door in Hallways and Administration Offices next to Kitchen. This Material is in FAIR Condition as of this date.

DAMAGE REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME		QTY (APPROXIMATE)	PHYSICAL DAMAGE (P): WATER DAMAGE (W:)
LOCATION	MATERIAL TYPE		
RISK ASSESSMENT CATEGORY			
COMMENTS			
11/05/2007	Damages Re-Assessed. Additional Damages identified in the form of 14 Tiles in Classroom A1, 8 Tiles in Classroom B1, 9 Tiles in Classroom C1, 3 Tiles in Classroom D1, 2 Tiles in Classroom E1, and 6 Tiles in Classroom F1. No other changes as of this date.		
05/13/2009	Damages Re-Assessed and identified as follows: Pod A1 has 5 Tiles Water stained, changed from 14. Pods B-F have been Repaired. Material condition remains in FAIR condition overall as of this date.		
03/10/2010	Material Re-Assessed. Classroom B-1 has been Repaired. Classroom C-1 has 1 Tile with Water Damage, and Classroom F-1 has 1 Tile Water Damaged. Material remains in FAIR condition overall as of this date.		
09/01/2010	Additional Damage observed. 3 Tiles Water stained in the Conference Room, 1 Tile water stained in the Hallway to Pods D-E, and 1 Tile broken in the Hallway of Pod C. No other changes as of this date.		
11/30/2011	Damages Re-Assessed and Repairs observed in Pod A1 - 3. Water stained Tiles have been Repaired, and 2 remain Water Damaged. Classroom C-7, 1 Tile previously noted with Water Damage has been repaired. Also, Classroom D-12 has 1 Tile Water Damaged, and Classroom F-16 has 1 hole in Ceiling. Material remains in FAIR condition overall as of this date.		
03/17/2015	Tiles are White with a Pitted Mark form pattern. Location changed from ALL CLASSROOMS AND SDC ROOM to CLASSROOMS, SDC ROOM, FACULTY ROOM, AND ADMINISTRATION OFFICES. Original entry updated. No other changes as of this date.		
02/08/2016	Sample 16-032-SA001 collected from Main Building, Classroom 38, 2'x4' Suspended Ceiling Tile. Sample 16-032-SA011 collected from Main Building, Classroom 55, 2'x4' Suspended Ceiling Tile. Sample 16-032-SA033 collected from Main Building, Classroom 70, 2'x4' Suspended Ceiling Tile. Sample 16-032-SA062 collected from Main Building, Music-91, 2'x2' Pitted Mark Suspended Ceiling Tile. Sample 16-032-SA069 collected from Main Building, SDC-96, 2'x4' Pitted Mark Suspended Ceiling Tile. Sample 16-032-SA094 collected from Main Building, Office-3, 2'x4' Pitted Mark Suspended Ceiling Tile. Sample 16-032-SA089 collected from Main Building, Entry-16, 2'x2' Popcorn Pattern Texture Suspended Ceiling Tile		
03/17/2016	Partial Repairs made and Damage Re-Assessed. Some Tiles have been Replaced in various locations. Current Damage: A1 has 2 Tiles Water Damaged; Office Conference Room has 3 Tiles Water Damaged; C Staff Room has 1 Tile Water Damaged; E Staff Room has 4 Tiles Water Damaged; D Staff Room has 3 Tiles Water Damaged; D3 has 1 Tile Water Damaged; and F Pod Staff Room has 5 Tiles Water Damaged. No other changes as of this date.		
09/13/2016	Pod D is currently Under Renovation no Access available.		
03/06/2017	Damages Observed. <5% Physical Damage - in the form of 1 Tile Damaged in Principal's Office. 1 Tile Missing in Classroom B2. 1 Tile Missing in Faculty Lounge. 1 Tile Missing in Work Room. No other changes as of this date.		
08/29/2017	Additional Damage and Partial Repairs Observed. B-Pod Staff Room now has 1 Tile Missing. F-Pod now has 1 Tile Missing by the Hallway. E-Pod has 4 Tiles with Water Damage by the Hallway. All the locations have Small Cuts and Holes. Classroom B2 has replaced its Missing Tile. Faculty Lounge Missing Tile has been Replaced. No other changes as of this date.		
08/08/2018	Additional Damage Observed. 4 Tiles have Water Damage and 4 Tiles Cracks in Music Room. No other changes as of this date.		
02/04/2020	Additional Damage Observed. 1 Tile Missing in Library Office. No other changes as of this date.		
08/28/2020	Additional Damage Observed. <5% Physical Damage in the form of 1 Tile Missing in B Staff Office. 1 Tile with Water Stains in Faculty Lounge, above the stove. Material remains in FAIR condition overall. No other changes as of this date.		

DAMAGE REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESSMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	--------------------------	----------	----------------------	---

02/10/2021	This Material is unchanged as of this date.					
08/11/2021	This Material is unchanged as of this date.					
02/18/2022	This Material is unchanged as of this date.					
08/17/2022	Additional Damage Observed. <5% Physical Damage and <10% Water Damage in the form of 1 (EA) 2'x2' Tile is Missing in B Staff Office and 1 (EA) 2'x2' Tile with Water Stains in F Staff Office. No other changes as of this date.					
02/15/2023	This Material is unchanged as of this date.					
08/16/2023	This Material is unchanged as of this date.					
02/14/2024	Additional Damage Observed. 4 Tiles with Water Stains in MDF Room. No other changes as of this date.					
08/14/2024	This Material is unchanged as of this date.					
02/27/2025	This Material is unchanged as of this date.					

MAIN BUILDING

EXTERIOR WALLS

ROUGH WALL	21,750 SF	P: Less Than 5% W: No Evidence
------------	-----------	-----------------------------------

DAMAGED FRIABLE SURFACING ACM

09/08/2005	STUCCO WALLS. This Material is in good condition as of this date.					
02/04/2020	This Material is unchanged as of this date.					
08/28/2020	Damage Observed. <5% Physical Damage in the form of 1 Inch Hole in Wall near Rear Entry into D-2. Material condition changed from GOOD to FAIR overall. Friability updated from Non-Friable to Friable. No other changes as of this date.					
02/10/2021	Additional Damage Observed. 3 LF of Cracks near Entry to Kitchen. No other changes as of this date.					
08/11/2021	This Material is unchanged as of this date.					
02/18/2022	This Material is unchanged as of this date.					
08/17/2022	This Material is unchanged as of this date.					
02/15/2023	This Material is unchanged as of this date.					
08/16/2023	This Material is unchanged as of this date.					
02/14/2024	This Material is unchanged as of this date.					
08/14/2024	This Material is unchanged as of this date.					
02/27/2025	This Material is unchanged as of this date.					

DAMAGE REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESSMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	--------------------------	----------	----------------------	---

MAIN BUILDING

EXTERIOR WALLS

ROUGH WALL SURFACING

21,750 SF

P: Less Than 5%

W: No Evidence

DAMAGED FRIABLE SURFACING ACM

09/08/2005	SKIM COAT FOR STUCCO WALLS. This Material is in good condition as of this date.
02/04/2020	This Material is unchanged as of this date.
08/28/2020	Damage Observed. <5% Physical Damage in the form of 1 Inch Hole in Wall near Rear Entry into D-2. Material condition changed from GOOD to FAIR overall. Friability updated from Non-Friable to Friable. No other changes as of this date.
02/10/2021	Additional Damage Observed. 3 LF of Cracks near Entry to Kitchen. No other changes as of this date.
08/11/2021	This Material is unchanged as of this date.
02/18/2022	This Material is unchanged as of this date.
08/17/2022	This Material is unchanged as of this date.
02/15/2023	This Material is unchanged as of this date.
08/16/2023	This Material is unchanged as of this date.
02/14/2024	This Material is unchanged as of this date.
08/14/2024	This Material is unchanged as of this date.
02/27/2025	This Material is unchanged as of this date.

MAIN BUILDING

KITCHEN AND KITCHEN STORAGE ROOM

VINYL FLOOR TILE

790 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/01/2010	12"x12" Beige Vinyl Floor Tile. This Material is in GOOD condition as of this date.
10/10/2012	Damage Observed. <5% Physical Damage - in the form of 1 Tile is broken and Mastic is exposed in Kitchen. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.
02/08/2016	Sample 16-032-SA009 collected from Main Building, Activity 37, 12"x12" Beige Vinyl Floor Tile. Sample 16-032-SA047 collected from Main Building, Kitchen-83, 12"x12" Beige with Gray Vinyl Floor Tile.
03/29/2017	Additional Damage Observed. Kitchen has 3 Cracked and Broken Tiles. No other changes as of this date.
02/14/2018	Additional Damage Observed. Kitchen has 4 Cracked and Broken Tiles. No other changes as of this date.

DAMAGE REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

02/04/2020	This Material is unchanged as of this date.				
08/28/2020	This Material is unchanged as of this date.				
02/10/2021	This Material is unchanged as of this date.				
08/11/2021	This Material is unchanged as of this date.				
02/18/2022	This Material is unchanged as of this date.				
08/17/2022	This Material is unchanged as of this date.				
02/15/2023	This Material is unchanged as of this date.				
08/16/2023	This Material is unchanged as of this date.				
02/14/2024	This Material is unchanged as of this date.				
08/14/2024	This Material is unchanged as of this date.				
02/27/2025	This Material is unchanged as of this date.				

MAIN BUILDING

KITCHEN AND KITCHEN STORAGE ROOM

VINYL FLOOR TILE MASTIC

790 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/01/2010	Mastic/Adhesive for 12"x12" Beige Vinyl Floor Tile. This Material is in GOOD condition as of this date.				
10/10/2012	Damage: <5% Physical Damage - in the form of 1 Tile is broken and Mastic is exposed in Kitchen. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.				
02/08/2016	Sample 16-032-SA009 collected from Main Building, Activity 37, 12"x12" Beige Vinyl Floor Tile. Sample 16-032-SA048 collected from Main Building, Kitchen-83, 12"x12" Beige with Gray Vinyl Floor Tile, Yellow Mastic and White Leveling Compound.				
03/29/2017	Additional Damage Observed. Kitchen has 3 Cracked and Broken Tiles. No other changes as of this date.				
02/14/2018	Additional Damage Observed. Kitchen has 4 Cracked and Broken Tiles. No other changes as of this date.				
02/04/2020	This Material is unchanged as of this date.				
08/28/2020	This Material is unchanged as of this date.				
02/10/2021	This Material is unchanged as of this date.				
08/11/2021	This Material is unchanged as of this date.				
02/18/2022	This Material is unchanged as of this date.				
08/17/2022	This Material is unchanged as of this date.				
02/15/2023	This Material is unchanged as of this date.				

DAMAGE REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME		QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
LOCATION	MATERIAL TYPE		
RISK ASSESMENT CATEGORY			
COMMENTS			

08/16/2023 This Material is unchanged as of this date.
02/14/2024 This Material is unchanged as of this date.
08/14/2024 This Material is unchanged as of this date.
02/27/2025 This Material is unchanged as of this date.

MAIN BUILDING

LIBRARY OFFICE

CHALK BOARD

16 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

03/10/2010 Brown Cementitious Chalkboard. (1 EA). This Material is in GOOD condition as of this date.
09/25/2013 Friability changed from Low to Non. No other changes as of this date.
02/04/2020 This Material is unchanged as of this date.
08/28/2020 This Material is unchanged as of this date.
02/10/2021 This Material is unchanged as of this date.
08/11/2021 This Material is unchanged as of this date.
02/18/2022 This Material is unchanged as of this date.
08/17/2022 This Material is unchanged as of this date.
02/15/2023 This Material is unchanged as of this date.
08/16/2023 This Material is unchanged as of this date.
02/14/2024 This Material is unchanged as of this date.
08/14/2024 This Material is unchanged as of this date.
02/27/2025 This Material is unchanged as of this date.

MAIN BUILDING

LOUNGE, HALLWAY, OFFICES, LOBBY, STAGE, CLASSROOMS

VINYL WALL COVER

4,000 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/01/2010 Vinyl Wall Cover (over Sheetrock Walls). This Material is in GOOD condition as of this date.
09/25/2013 Friability changed from LOW to NON. No other changes as of this date.
02/04/2020 This Material is unchanged as of this date.

DAMAGE REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME		QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
LOCATION	MATERIAL TYPE		
RISK ASSESSMENT CATEGORY			
COMMENTS			

08/28/2020	Damage Observed. <5% Physical Damage in the form of 1 Inch Hole in Wall near Rear Entry into D-2. Material condition changed from GOOD to FAIR overall. Friability updated from Non-Friable to Friable. No other changes as of this date.
02/10/2021	This Material is unchanged as of this date.
08/11/2021	This Material is unchanged as of this date.
02/18/2022	This Material is unchanged as of this date.
08/17/2022	Repairs Observed. All Damages Repaired. Material Condition changed from FAIR to GOOD. Friability updated from Friable to Non-Friable. No other changes as of this date.
02/15/2023	This Material is unchanged as of this date.
08/16/2023	This Material is unchanged as of this date.
02/14/2024	This Material is unchanged as of this date.
08/14/2024	Damage Observed. <5% Physical Damage - in the form of 1 SF Peeling with Light Brown Mastic Exposed in Kitchen and Multipurpose Room. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.
02/27/2025	This Material is unchanged as of this date.

MAIN BUILDING

LOUNGE, HALLWAY, OFFICES, LOBBY, STAGE, CLASSROOMS

VINYL WALL COVER MASTIC

4,000 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/01/2010	Mastic/Adhesive for Vinyl Wall Cover (over Sheetrock Walls). This Material is in GOOD condition as of this date.
02/04/2020	This Material is unchanged as of this date.
08/28/2020	Damage Observed. <5% Physical Damage in the form of 1 Inch Hole in Wall near Rear Entry into D-2. Material condition changed from GOOD to FAIR overall. Friability updated from Non-Friable to Friable. No other changes as of this date.
02/10/2021	This Material is unchanged as of this date.
08/11/2021	This Material is unchanged as of this date.
02/18/2022	This Material is unchanged as of this date.
08/17/2022	Repairs Observed. All Damages Repaired. Material Condition changed from FAIR to GOOD. Friability updated from Friable to Non-Friable. No other changes as of this date.
02/15/2023	This Material is unchanged as of this date.
08/16/2023	This Material is unchanged as of this date.

DAMAGE REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME		QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
LOCATION	MATERIAL TYPE		
RISK ASSESSMENT CATEGORY			
COMMENTS			

02/14/2024	This Material is unchanged as of this date.
08/14/2024	Damage Observed. <5% Physical Damage - in the form of 1 SF Peeling with Light Brown Mastic Exposed in Kitchen and Multipurpose Room. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.
02/27/2025	This Material is unchanged as of this date.

MAIN BUILDING

MAIN ELECTRICAL PANEL ROOM

PIPE FITTING INSULATION

2 LF

P: Less Than 50% No Debris

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

11/05/2007	Thermal System Insulation on Pipe Fittings. (2 EA Fittings Type). Damage: <50% Physical Damage - due to 1 fitting being in POOR condition. This Material is in FAIR condition as of this date.
04/16/2008	This Material is unchanged as of this date. Damaged fitting has been sealed and wrapped with duct tape as a temporary measure.
05/13/2009	Material reassessed. Additional Fittings may be located in the Planum, Attic, and other inaccessible area/spaces. This Material is unchanged as of this date.
02/04/2020	This Material is unchanged as of this date.
08/28/2020	This Material is unchanged as of this date.
02/10/2021	This Material is unchanged as of this date.
08/11/2021	This Material is unchanged as of this date.
02/18/2022	This Material is unchanged as of this date.
08/17/2022	This Material is unchanged as of this date.
02/15/2023	This Material is unchanged as of this date.
08/16/2023	This Material is unchanged as of this date.
02/14/2024	This Material is unchanged as of this date.
08/14/2024	This Material is unchanged as of this date.
02/27/2025	This Material is unchanged as of this date.

MAIN BUILDING

MULTI-USE ROOM, HALLWAYS TO PODS, TEACHERS WORK ROOMS, AND ENTRIES TO CLASSROOMS

VINYL FLOOR TILE

8,100 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/01/2010	12"x12" Light Brown Vinyl Floor Tile. This Material is in GOOD condition as of this date.
------------	---

DAMAGE REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME		QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
LOCATION	MATERIAL TYPE		
RISK ASSESMENT CATEGORY			
COMMENTS			
11/30/2011	Damage: <5% Physical Damage - in the form of Classroom F-17 has 1 Tile broken and Mastic/Adhesive is exposed. Material condition changed from GOOD to FAIR overall as of this date. Friability changed from Non-Friable to Friable to reflect this change.		
09/18/2015	Damage Re-Assessed. Additional Damage observed, Pod-B has 5 Tiles cracked and Classroom F-1 has 2 cracked. Damage noted on 11/30/11 of 1 Tile broken is in F-2. No other changes as of this date.		
02/08/2016	Sample 16-032-SA022 collected from Main Building, Activity 53, 12"x12" Beige Vinyl Floor Tile. Sample 16-032-SA041 collected from Main Building, Activity 69, 12"x12" Beige Vinyl Floor Tile. Sample 16-032-SA077 collected from Main Building, Multi-Purpose-81, 12"x12" Gray Vinyl Floor Tile. Sample 16-032-SA078 collected from Main Building, Multi-Purpose-81, 12"x12" Beige Vinyl Floor Tile.		
02/04/2020	This Material is unchanged as of this date.		
08/28/2020	This Material is unchanged as of this date.		
02/10/2021	This Material is unchanged as of this date.		
08/11/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	This Material is unchanged as of this date.		
02/15/2023	This Material is unchanged as of this date.		
08/16/2023	This Material is unchanged as of this date.		
02/14/2024	This Material is unchanged as of this date.		
08/14/2024	This Material is unchanged as of this date.		
02/27/2025	This Material is unchanged as of this date.		

MAIN BUILDING

MULTI-USE ROOM, HALLWAYS TO PODS, TEACHERS WORK ROOMS, AND ENTRIES TO CLASSROOMS

VINYL FLOOR TILE MASTIC

8,100 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/01/2010	Mastic / Adhesive for 12"x12" Light Brown Vinyl Floor Tile. This Material is in GOOD condition as of this date.
11/30/2011	Damage Observed. <5% Physical Damage - in the form of Classroom F-17 has 1 Tile broken and Mastic is exposed. Material condition changed from GOOD to FAIR overall as of this date. Friability changed from Non-Friable to Friable. No other changes as of this date.
09/18/2015	Damage Re-Assessed. Additional Damage observed, Pod-B has 5 Tiles cracked and Classroom F-1 has 2 cracked. Damage noted on 11/30/11 of 1 Tile broken is in F-2. No other change as of this date.
02/08/2016	Sample 16-032-SA023 collected from Main Building, Activity 53, Yellow Mastic and Gray Leveling Compound 12"x12" Beige Vinyl Floor Tile. Sample 16-032-SA042 collected from Main Building, Activity 69, Yellow Mastic and Gray Leveling Compound for 12"x12" Beige Vinyl Floor Tile. Sample 16-032-SA079 collected from Main Building, Multi-Purpose-81, 12"x12" Beige and Gray Vinyl Floor Tile, Yellow Mastic only.

DAMAGE REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

02/04/2020	This Material is unchanged as of this date.				
08/28/2020	This Material is unchanged as of this date.				
02/10/2021	This Material is unchanged as of this date.				
08/11/2021	This Material is unchanged as of this date.				
02/18/2022	This Material is unchanged as of this date.				
08/17/2022	This Material is unchanged as of this date.				
02/15/2023	This Material is unchanged as of this date.				
08/16/2023	This Material is unchanged as of this date.				
02/14/2024	This Material is unchanged as of this date.				
08/14/2024	This Material is unchanged as of this date.				
02/27/2025	This Material is unchanged as of this date.				

MAIN BUILDING

STAGE

COLLAPSIBLE PARTITION WALL

300 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

05/13/2009	Collapsible, (Accordian Type), Vinyl Wall Cover. This Material is in GOOD condition as of this date.				
09/25/2013	Friability changed from LOW to NON. No other changes as of this date.				
03/29/2017	Damage Observed. <5% Physical Damage - in the form of Vinyl Cover becoming Frayed and Torn at the Bottom. Damages Re-Assessed. Additional 2 Tiles are Water Damaged outside Classroom 9. No other changes as of this date.				
02/04/2020	This Material is unchanged as of this date.				
08/28/2020	This Material is unchanged as of this date.				
02/10/2021	This Material is unchanged as of this date.				
08/11/2021	This Material is unchanged as of this date.				
02/18/2022	This Material is unchanged as of this date.				
08/17/2022	This Material is unchanged as of this date.				
02/15/2023	This Material is unchanged as of this date.				
08/16/2023	This Material is unchanged as of this date.				
02/14/2024	This Material is unchanged as of this date.				
08/14/2024	This Material is unchanged as of this date.				

DAMAGE REPORT FOR

SUMMERDALE ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RISK ASSESSMENT CATEGORY

COMMENTS

QTY
(APPROXIMATE)

PHYSICAL DAMAGE (P:)
WATER DAMAGE (W:)

02/27/2025 This Material is unchanged as of this date.

MAIN BUILDING

STAGE

WALL MASTIC

300 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

05/13/2009 Mastic/Adhesive for Collapsible, (Accordian Type), Vinyl Wall Cover. This Material is in GOOD condition as of this date.

03/29/2017 Damage Observed. <5% Physical Damage - in the form of Vinyl Cover becoming Frayed and Torn at the Bottom. Damages Re-Assessed. Additional 2 Tiles are Water Damaged outside Classroom 9. No other changes as of this date.

02/04/2020 This Material is unchanged as of this date.

08/28/2020 This Material is unchanged as of this date.

02/10/2021 This Material is unchanged as of this date.

08/11/2021 This Material is unchanged as of this date.

02/18/2022 This Material is unchanged as of this date.

08/17/2022 This Material is unchanged as of this date.

02/15/2023 This Material is unchanged as of this date.

08/16/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

08/14/2024 This Material is unchanged as of this date.

02/27/2025 This Material is unchanged as of this date.

End Of Report, Total Of 17 Pages

25-076

Summerdale Elementary School
1100 Summerdale Drive
San Jose, CA 95132
(408) 923-1960


Helmsey Drive

SUMMERDALE ELEMENTARY SCHOOL
INSPECTED ON: 5-2-12

Portable 7
Portable 6
Portable 5
Portable 4

Portable 3

Portable 2 Portable 1

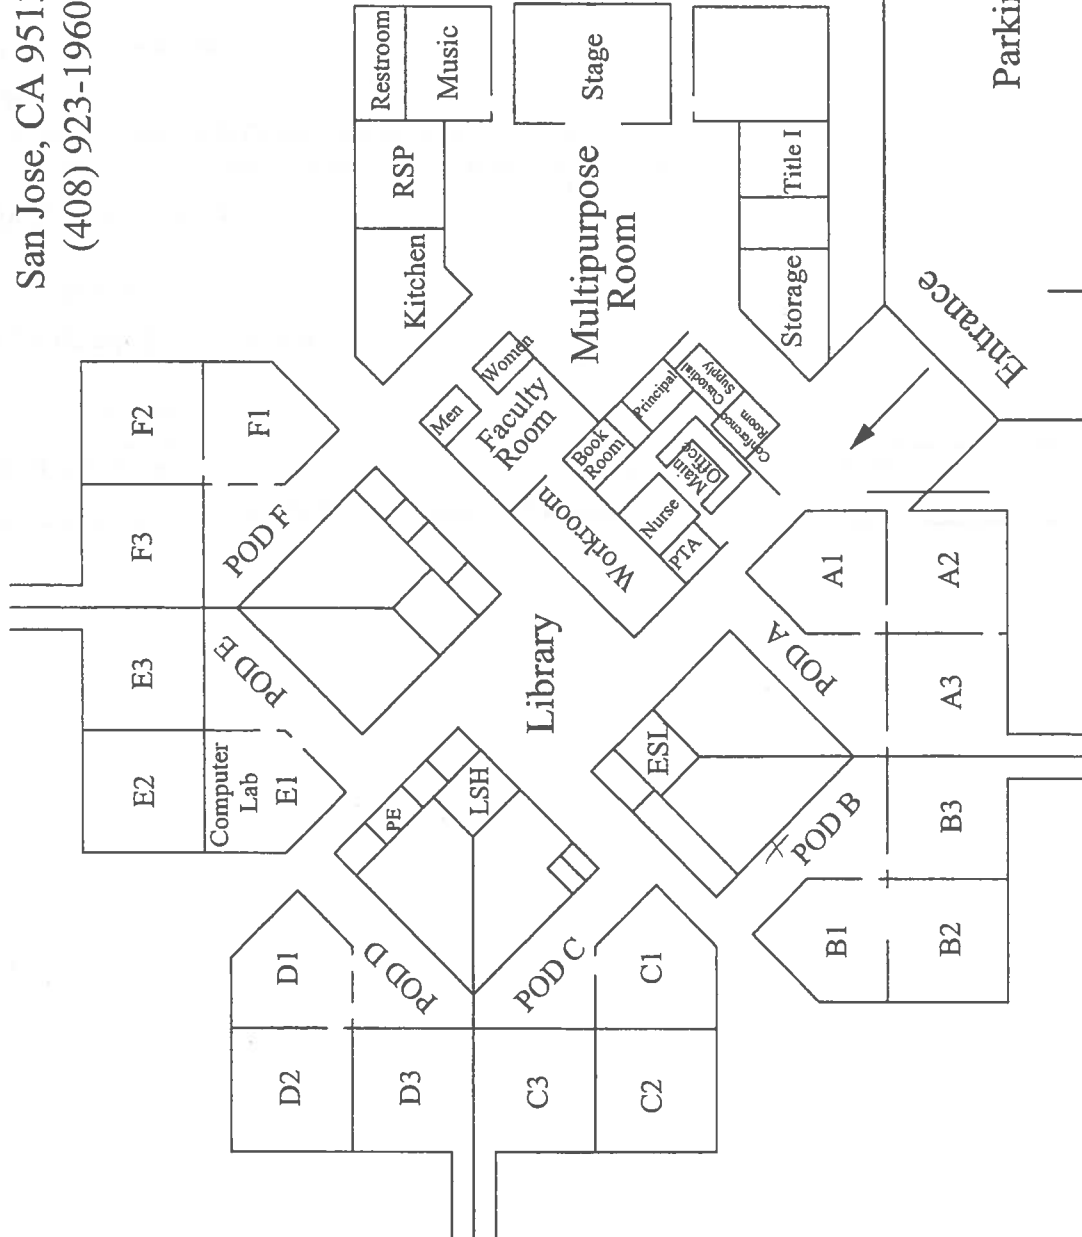

Parking Lot

Entrance

Summerdale Drive

Summerdale Elementary School
 1100 Summerdale Drive
 San Jose, CA 95132
 (408) 923-1960


Helmsley Drive

SUMMERDALE ELEMENTARY SCHOOL
 INSPECTED ON: 42-41-8

Portable 7
Portable 6
Portable 5
Portable 4

Portable 3

Portable 2	Portable 1
------------	------------

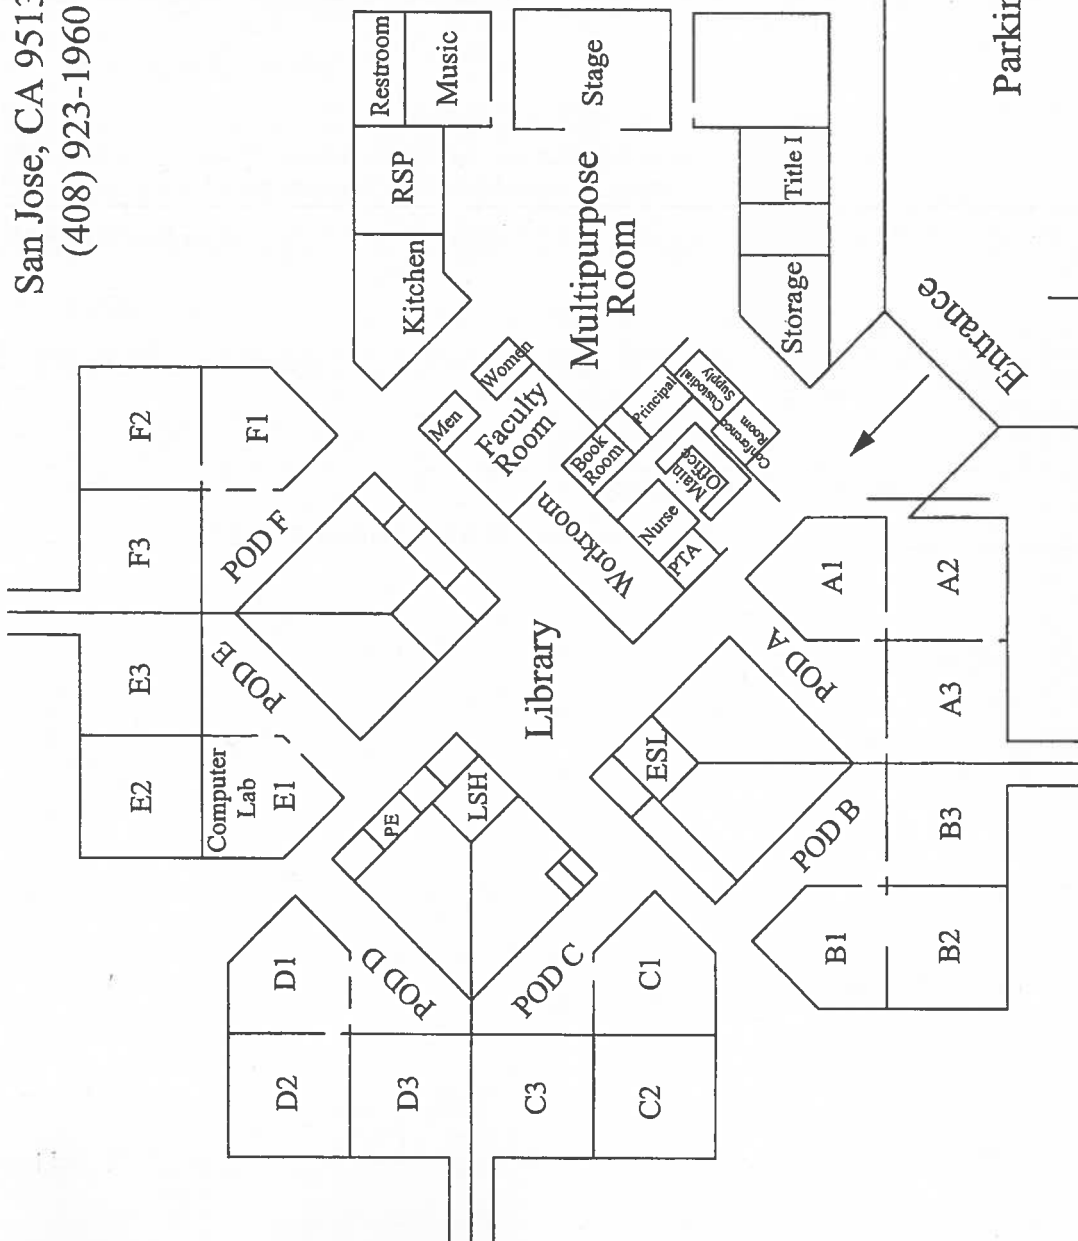

Parking Lot

Summerdale Drive

Summerdale Elementary School
 1100 Summerdale Drive
 San Jose, CA 95132
 (408) 923-1960


Helmsey Drive

SUMMERDALE ELEMENTARY SCHOOL
INSPECTED ON: 2-14-24

Portable 7
 Portable 6
 Portable 5
 Portable 4

Portable 3

Portable 2
 Portable 1

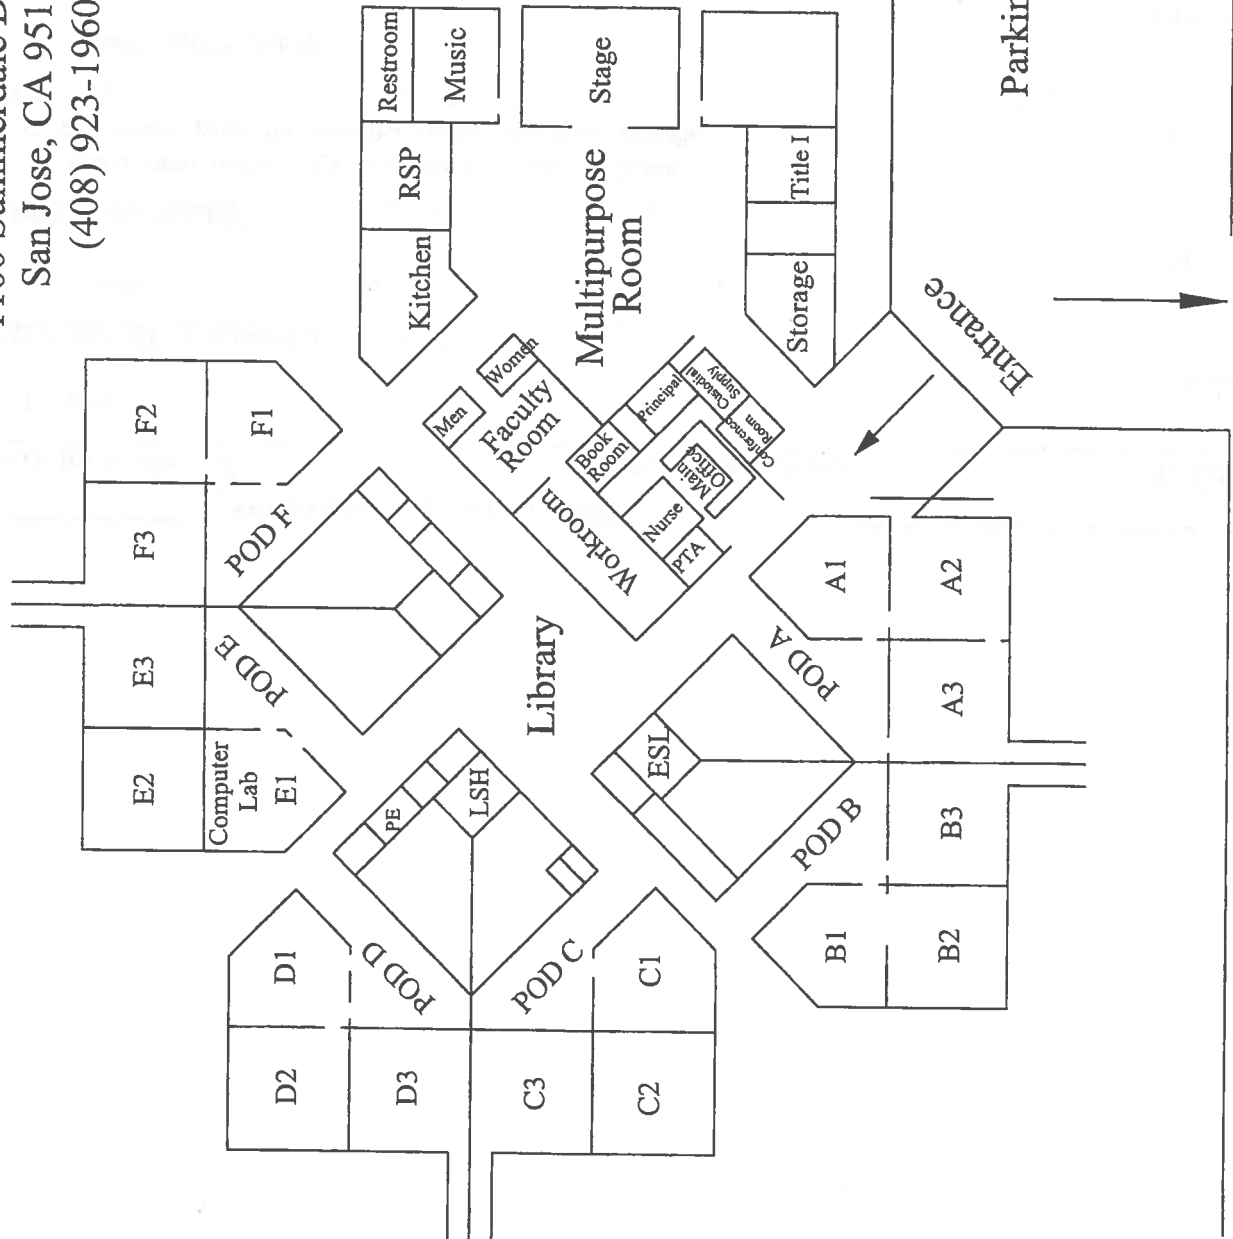

Summerdale Elementary School
 1100 Summerdale Drive
 San Jose, CA 95132
 (408) 923-1960


Helmsley Drive

SUMMERDALE ELEMENTARY SCHOOL
 INSPECTED ON: 08-16-2023

Portable 7
 Portable 6
 Portable 5
 Portable 4

Portable 3

Portable 2 Portable 1

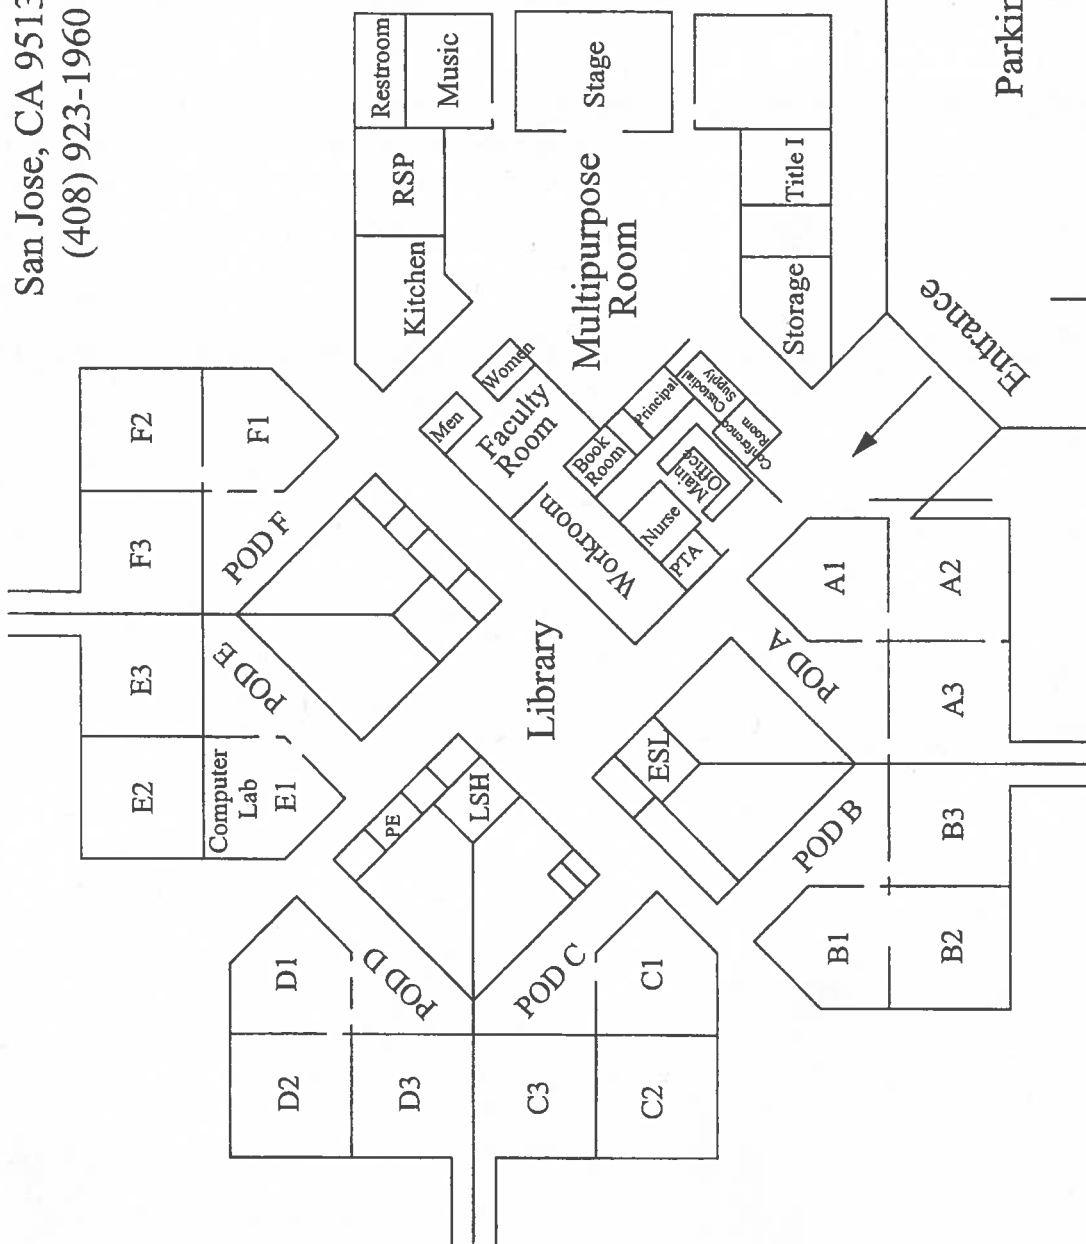

Parking Lot

Summerdale Drive

Summerdale Elementary School
 1100 Summerdale Drive
 San Jose, CA 95132
 (408) 923-1960


Helmley Drive

SUMMERDALE ELEMENTARY SCHOOL
INSPECTED ON: 5/13/23

Portable 7
 Portable 6
 Portable 5
 Portable 4

Portable 3

Portable 2
 Portable 1

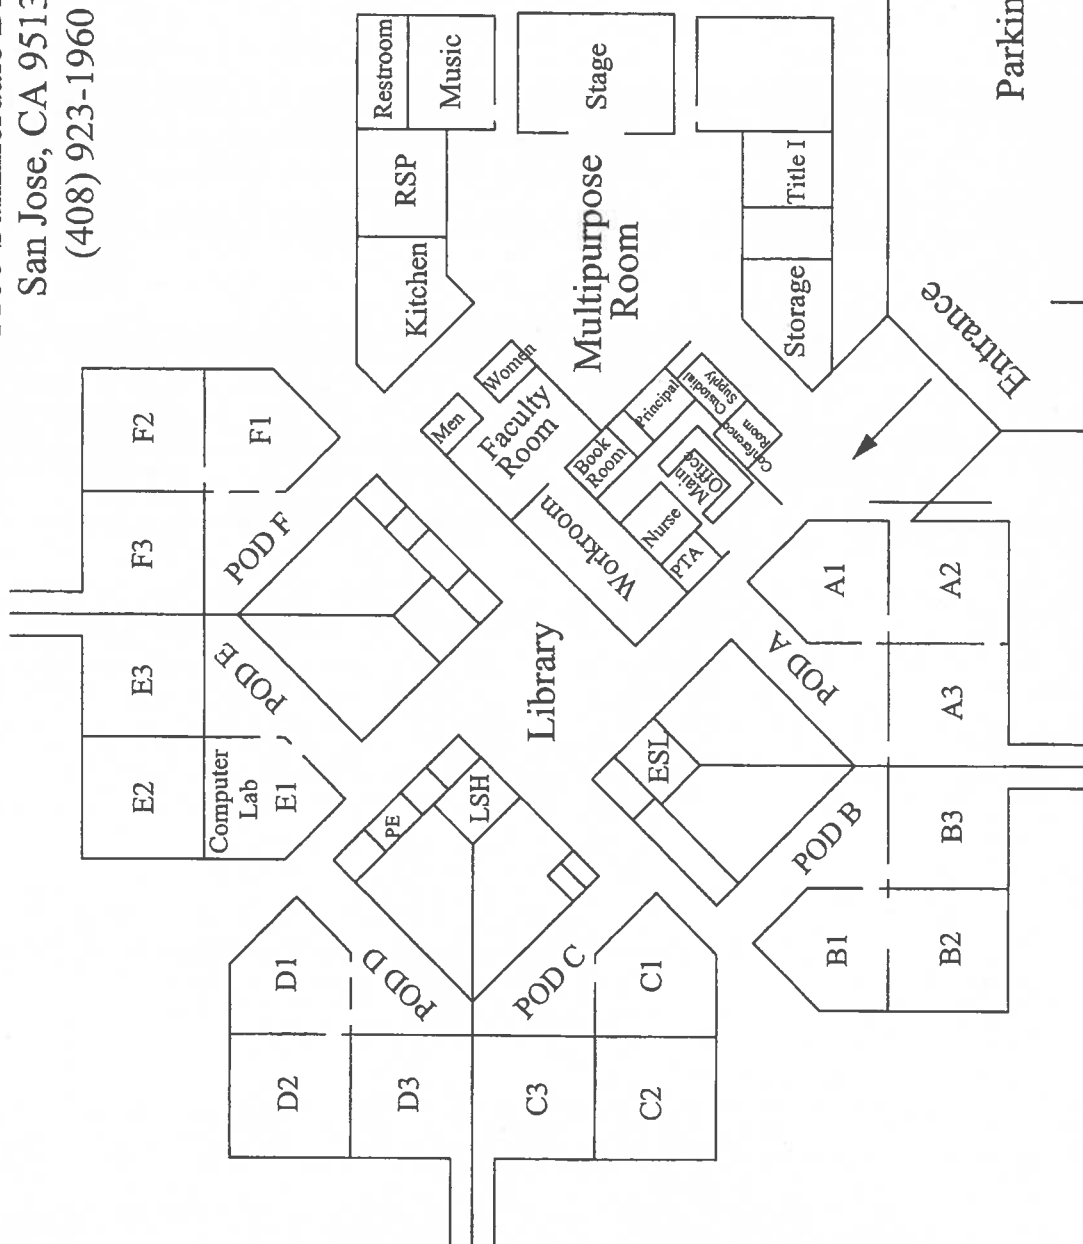

Summerdale Elementary School
 1100 Summerdale Drive
 San Jose, CA 95132
 (408) 923-1960


Helmsley Drive

SUMMERDALE ELEMENTARY SCHOOL
 INSPECTED ON: 02-18-2022

Portable 7
 Portable 6
 Portable 5
 Portable 4

Portable 3

Portable 2
 Portable 1

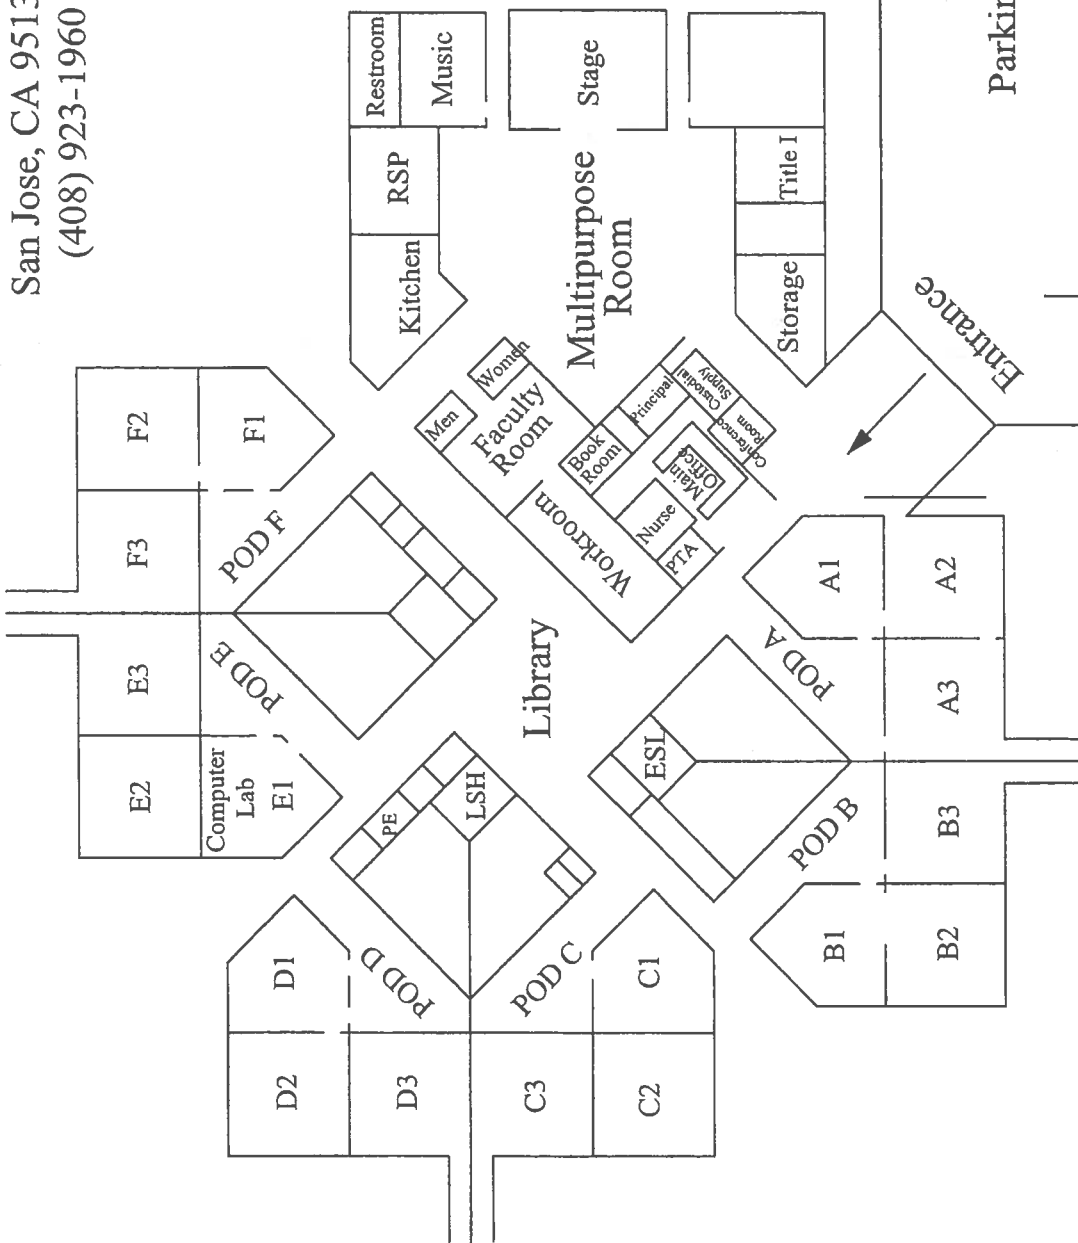

Summerdale Elementary School
 1100 Summerdale Drive
 San Jose, CA 95132
 (408) 923-1960


Helmsey Drive

SUMMERDALE ELEMENTARY SCHOOL
INSPECTED ON: 12/11/18

Portable 7
 Portable 6
 Portable 5
 Portable 4

Portable 3

Portable 2 Portable 1

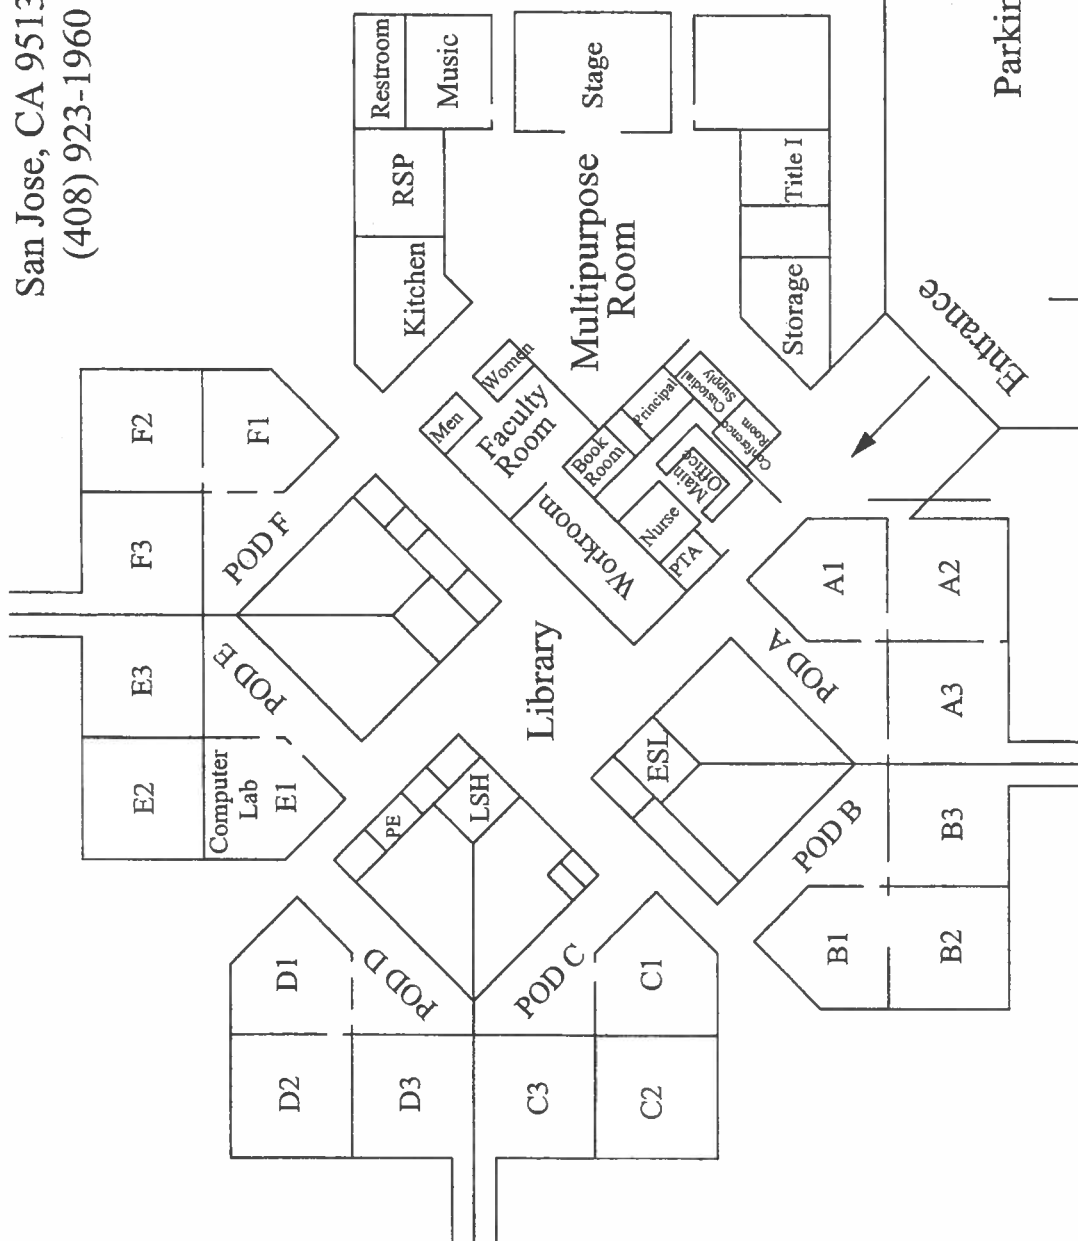

Parking Lot

Summerdale Drive

Entrance

Summerdale Elementary School
 1100 Summerdale Drive
 San Jose, CA 95132
 (408) 923-1960


Helmley Drive

SUMMERDALE ELEMENTARY SCHOOL
INSPECTED ON: 12/01/21

Portable 7
 Portable 6
 Portable 5
 Portable 4

Portable 3

Portable 2
 Portable 1

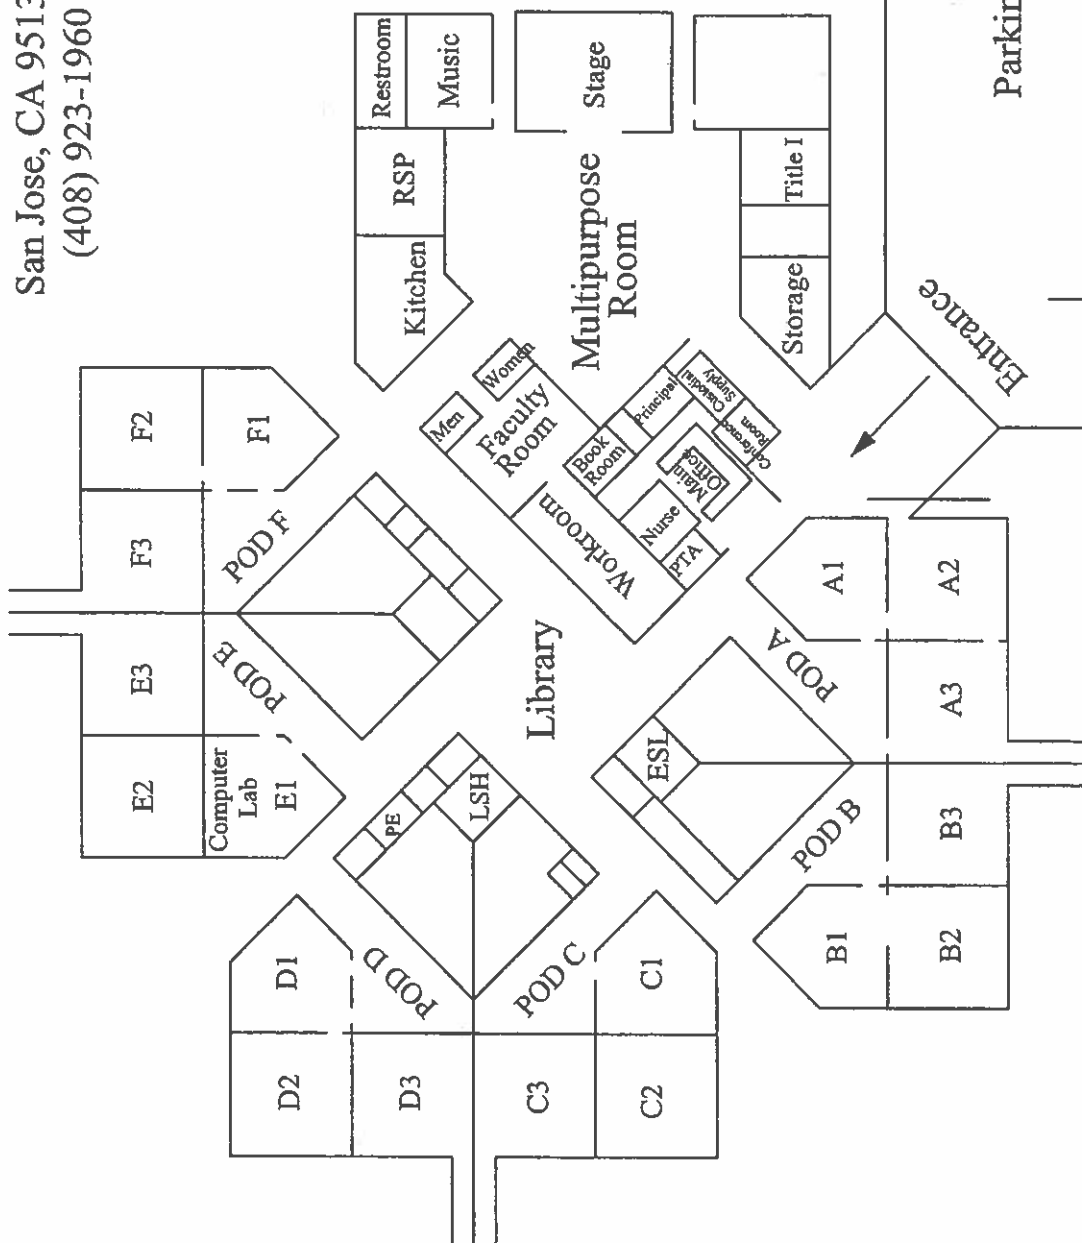

Parking Lot

Entrance

Summerdale Drive

Summerdale Elementary School
 1100 Summerdale Drive
 San Jose, CA 95132
 (408) 923-1960


Helmley Drive

SUMMERDALE ELEMENTARY SCHOOL
INSPECTED ON: 02/28/88

Portable 7
 Portable 6
 Portable 5
 Portable 4

Portable 3

Portable 2
 Portable 1

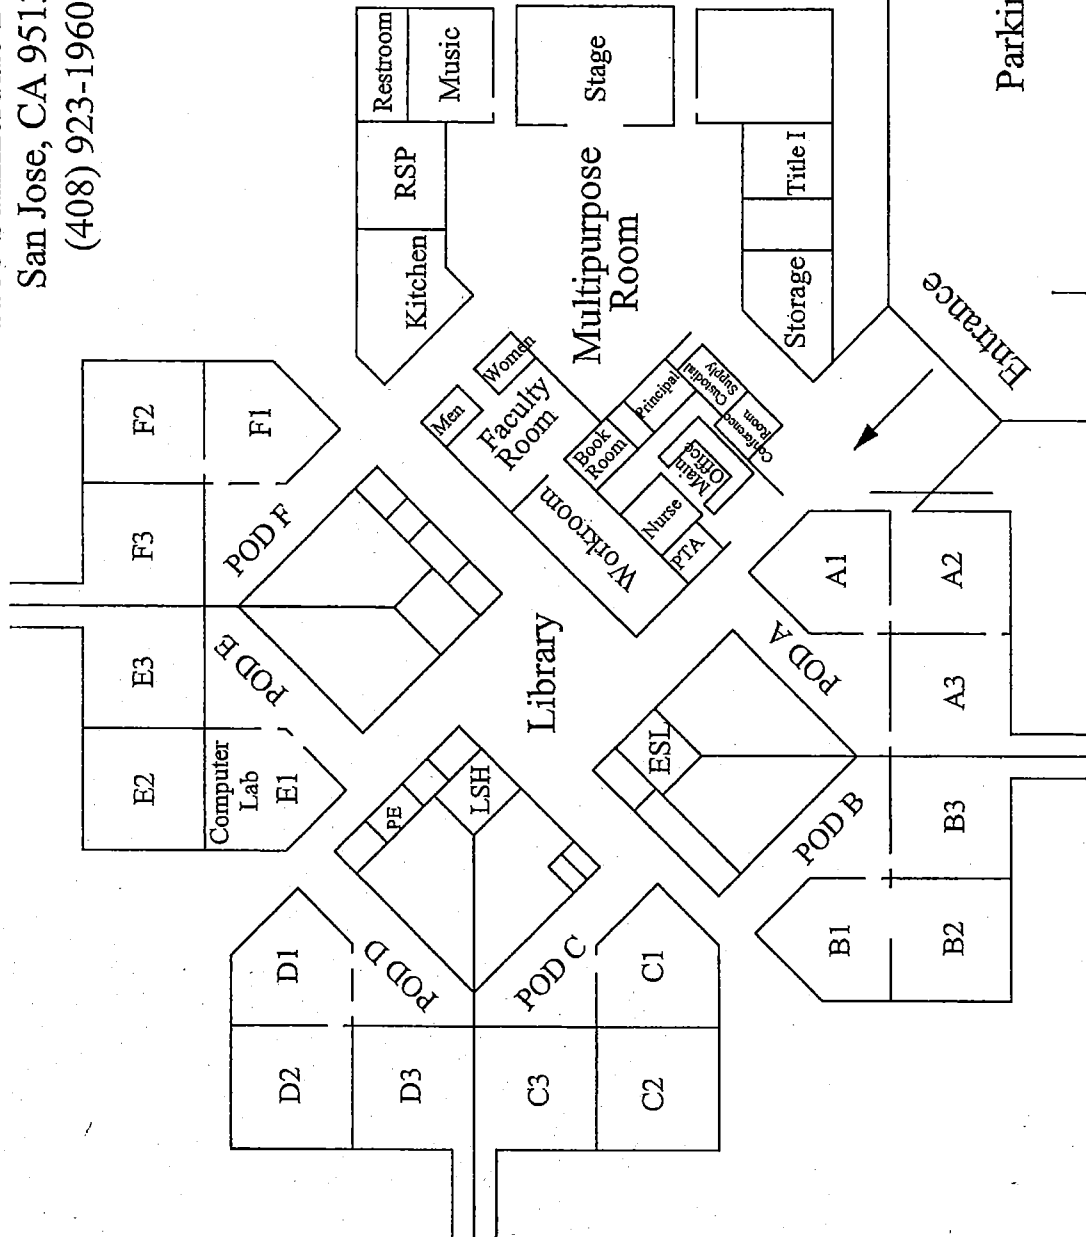

Summerdale Elementary School
 1100 Summerdale Drive
 San Jose, CA 95132
 (408) 923-1960

Helmsey Drive


SUMMERDALE ELEMENTARY SCHOOL
 INSPECTED ON: 0202-4-20

Portable 7
 Portable 6
 Portable 5
 Portable 4

Portable 3

Portable 2
 Portable 1

MISS Lib 92

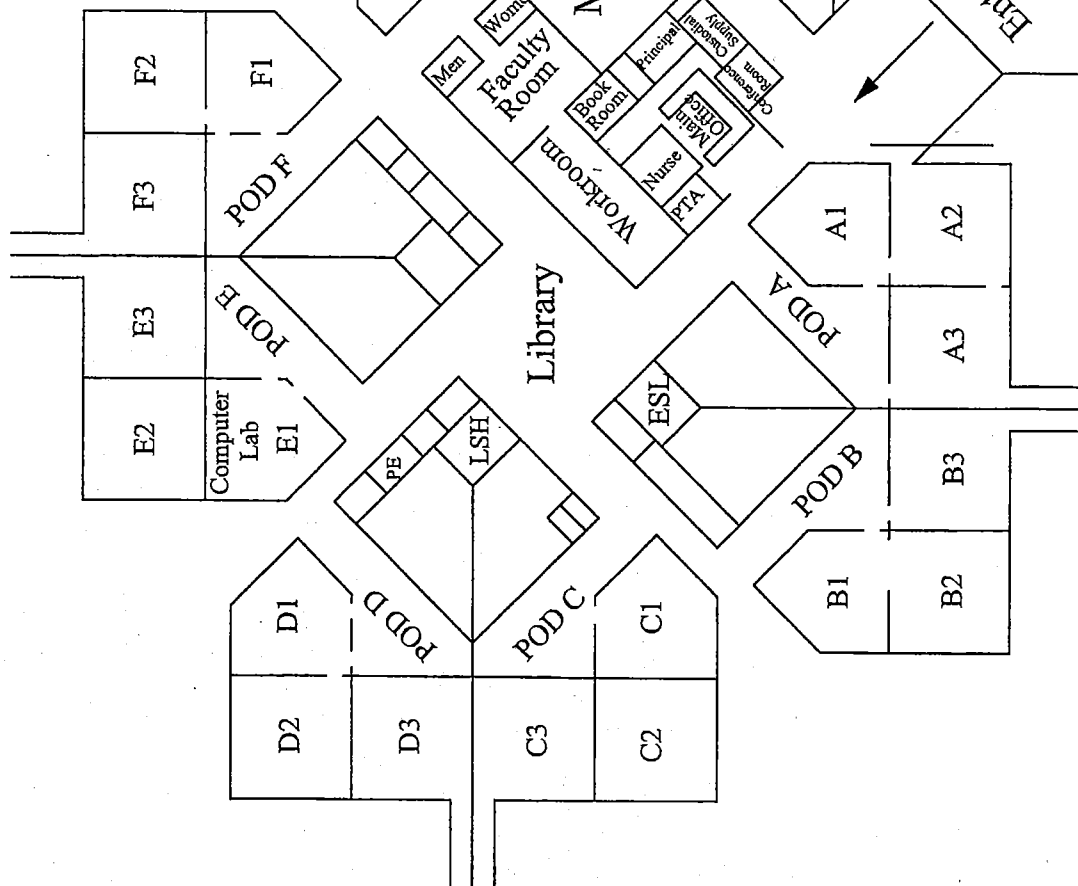

Parking Lot

Summerdale Drive

Summerdale Elementary School
 1100 Summerdale Drive
 San Jose, CA 95132
 (408) 923-1960


Helmsley Drive

SUMMERDALE ELEMENTARY SCHOOL
 INSPECTED ON: 6-14-8

Portable 7
 Portable 6
 Portable 5
 Portable 4

Portable 3

Portable 2
 Portable 1

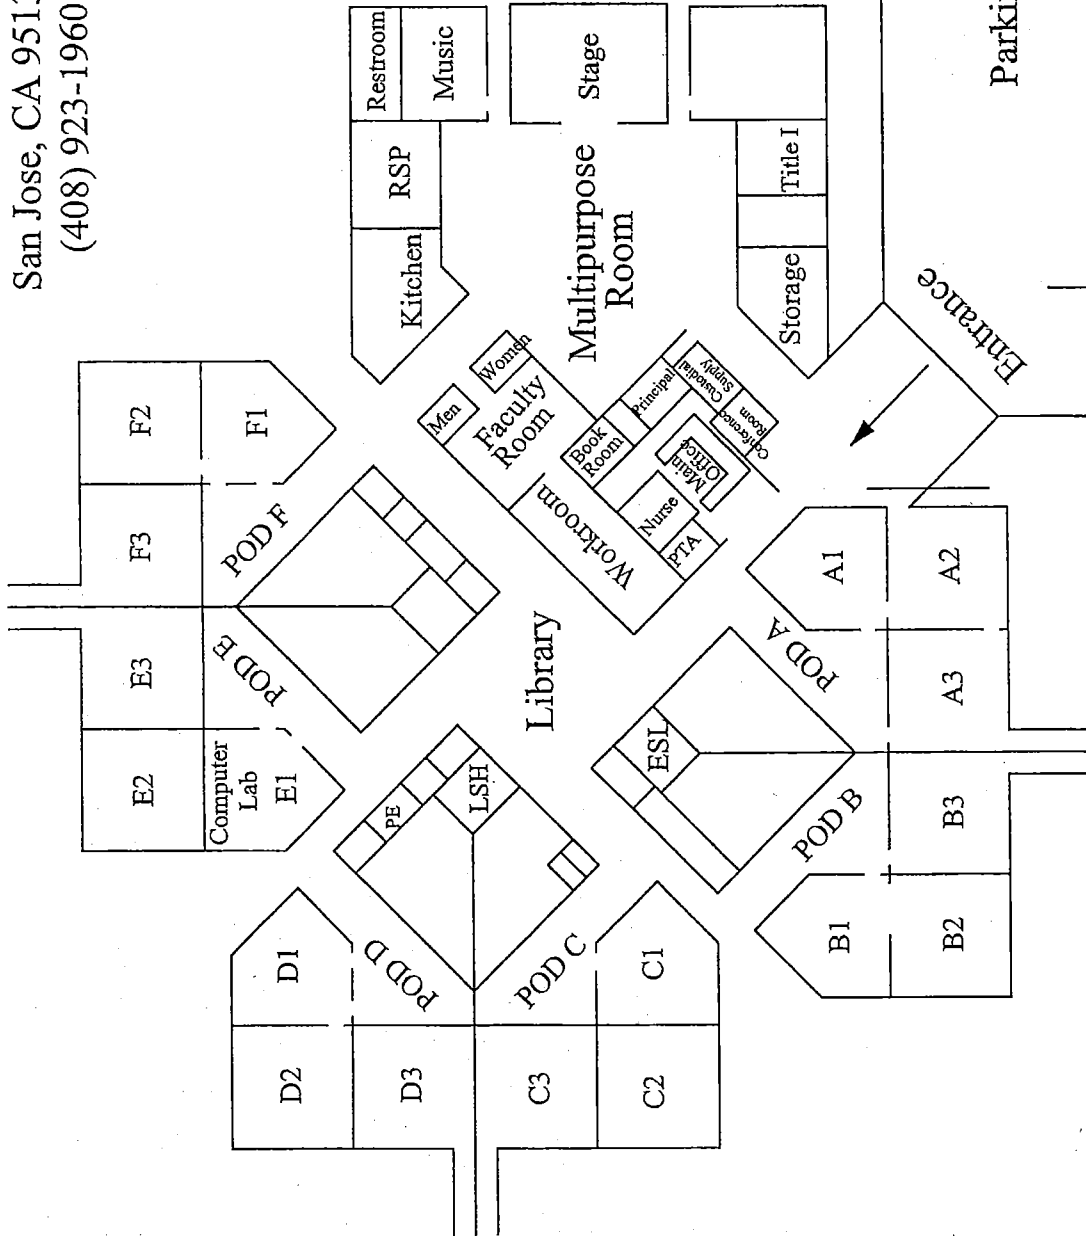

Parking Lot

Summerdale Drive

Summerdale Elementary School
 1100 Summerdale Drive
 San Jose, CA 95132
 (408) 923-1960


Helmsley Drive

SUMMERDALE ELEMENTARY SCHOOL
 INSPECTED ON: 6/02-90-2019

Portable 7
 Portable 6
 Portable 5
 Portable 4

Portable 3

Portable 2
 Portable 1

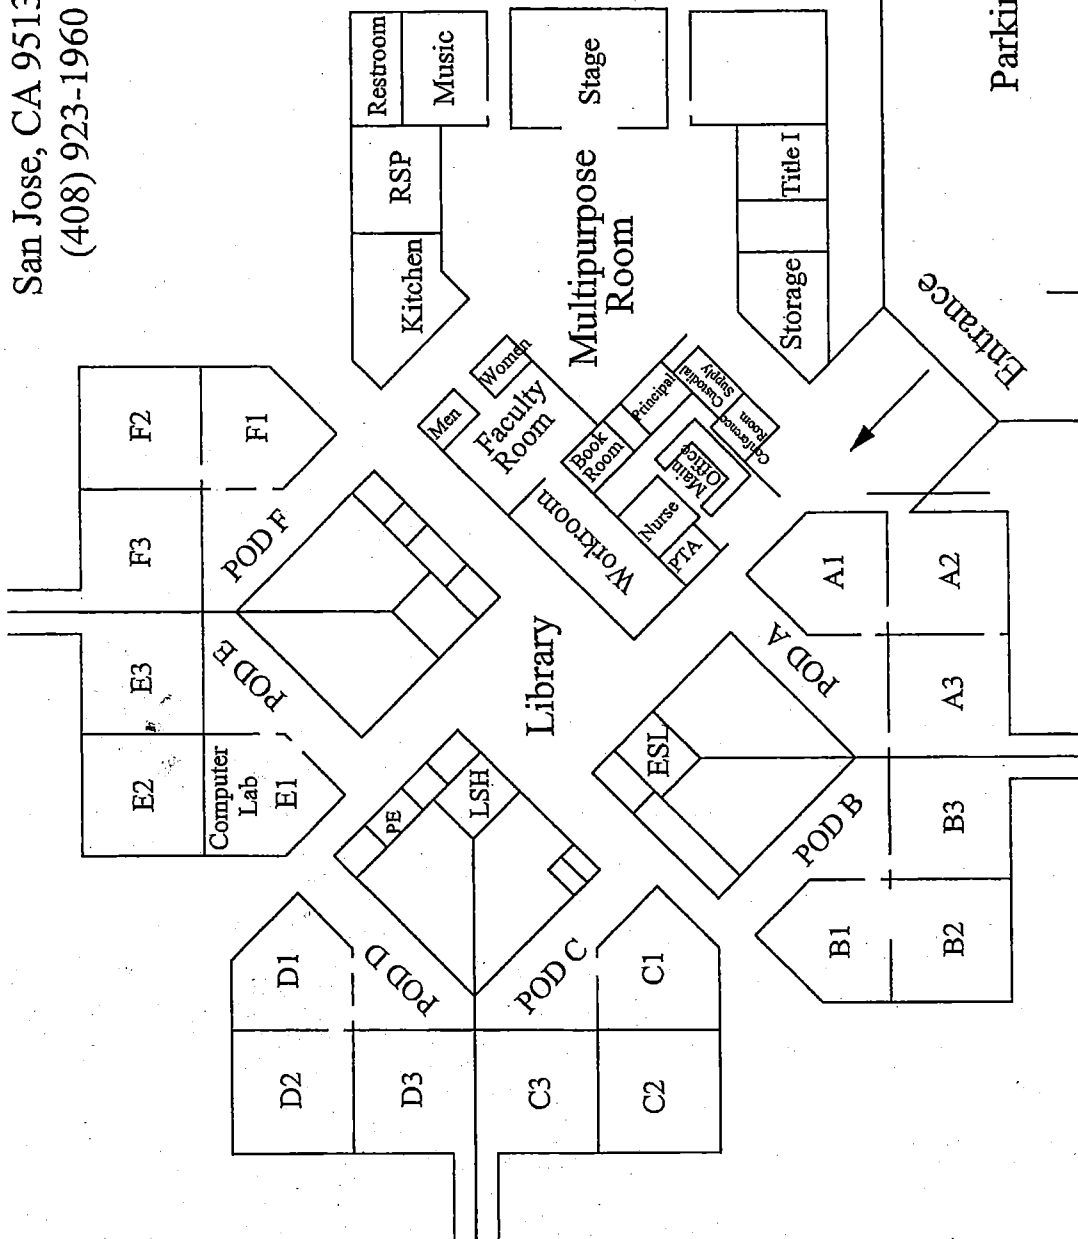

Summerdale Elementary School
 1100 Summerdale Drive
 San Jose, CA 95132
 (408) 923-1960


Helmsley Drive

SUMMERDALE ELEMENTARY SCHOOL
 INSPECTED ON: 8/8/18

Portable 7
 Portable 6
 Portable 5
 Portable 4

Portable 3

Portable 2 Portable 1

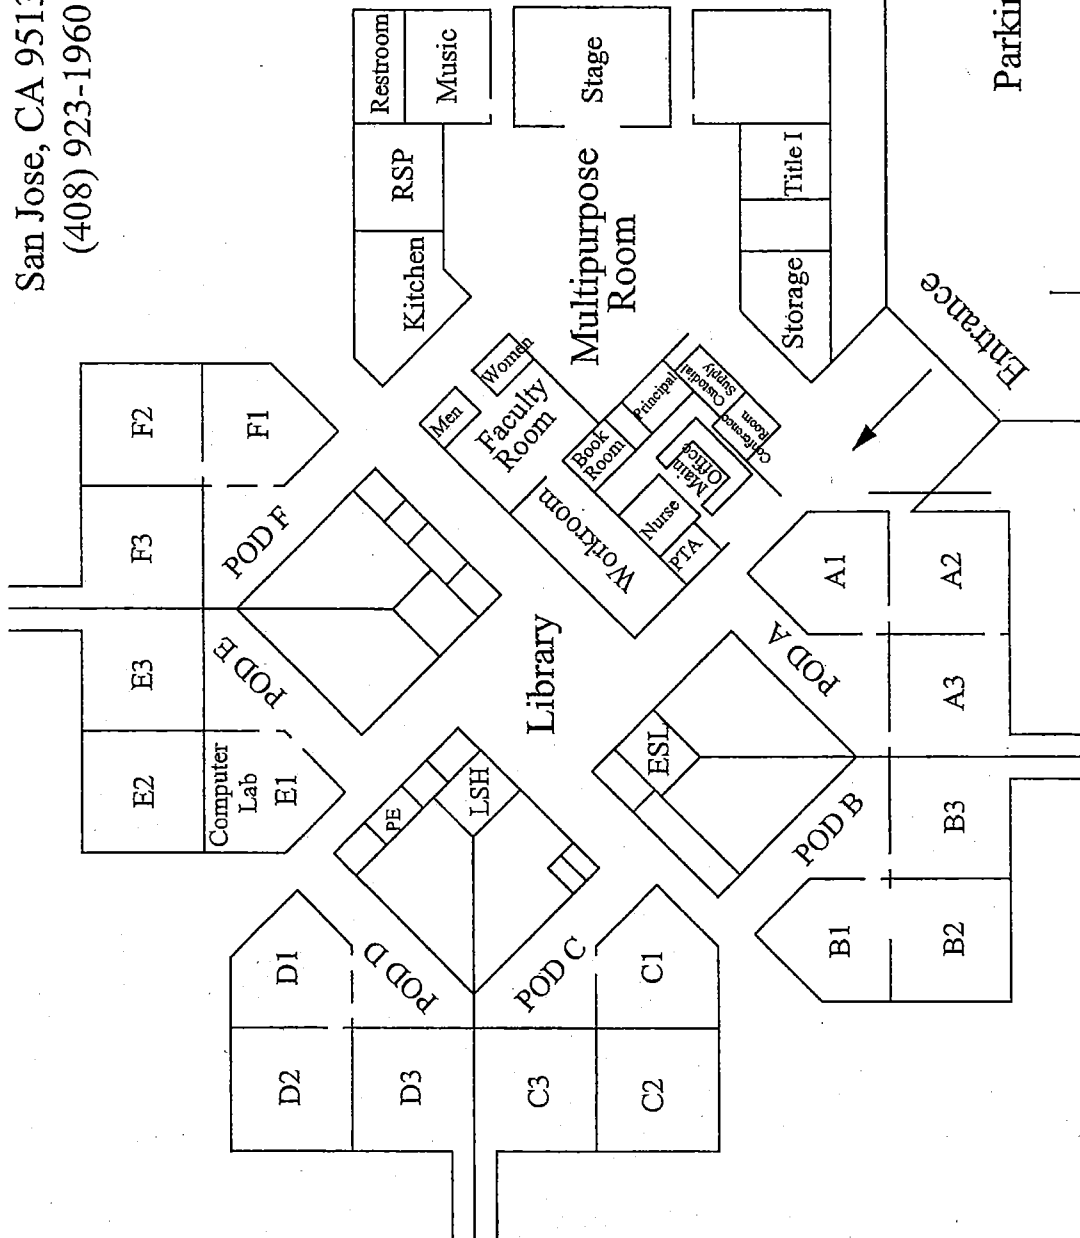

Parking Lot

Summerdale Drive

Summerdale Elementary School
 1100 Summerdale Drive
 San Jose, CA 95132
 (408) 923-1960


Helmsley Drive

SUMMERDALE ELEMENTARY SCHOOL
 INSPECTED ON: 2/14/18

Portable 7
 Portable 6
 Portable 5
 Portable 4

Portable 3

Portable 2 Portable 1

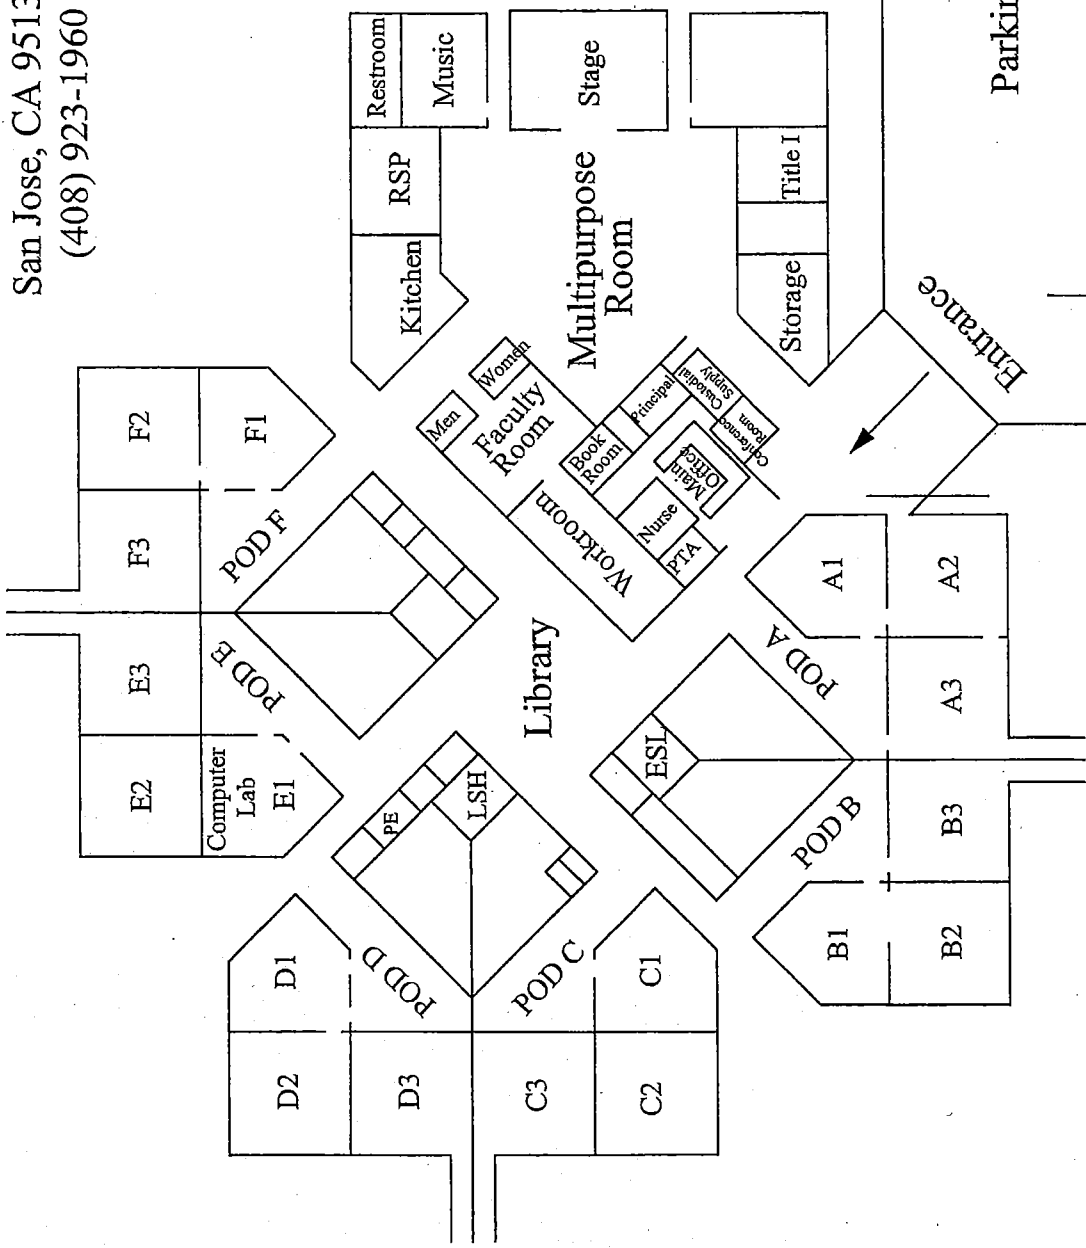

Parking Lot

Entrance

Summerdale Drive

Summerdale Elementary School
 1100 Summerdale Drive
 San Jose, CA 95132
 (408) 923-1960


Helmsley Drive

SUMMERDALE ELEMENTARY SCHOOL
 INSPECTED ON: 8/22/17

Portable 7
 Portable 6
 Portable 5
 Portable 4

Portable 3

Portable 2
 Portable 1

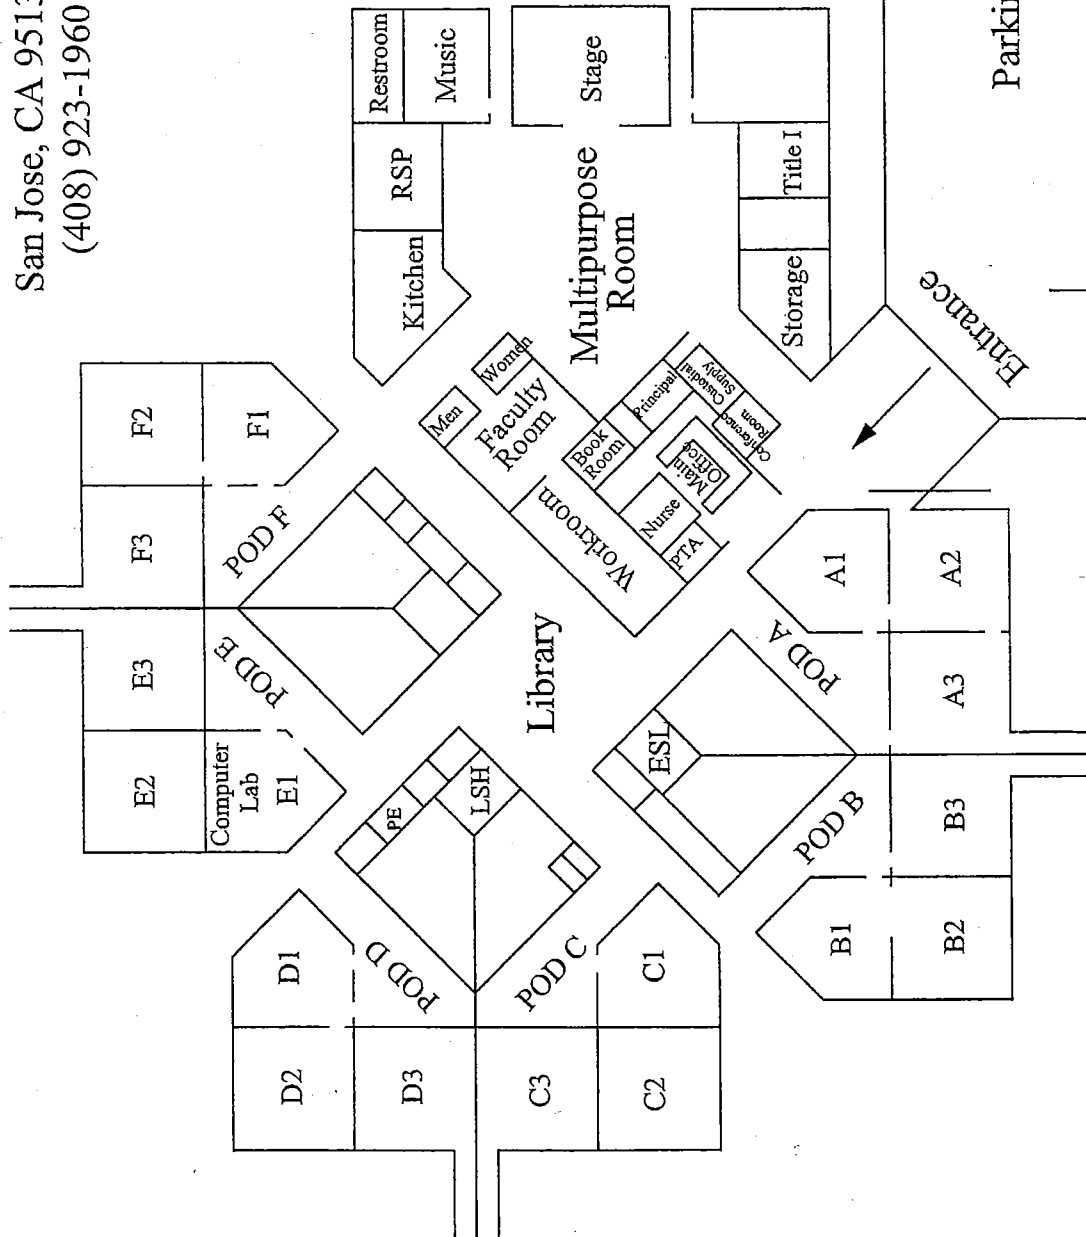

Parking Lot

Summerdale Drive

Summerdale Elementary School
 1100 Summerdale Drive
 San Jose, CA 95132
 (408) 923-1960


Helmsley Drive

SUMMERDALE ELEMENTARY SCHOOL
 INSPECTED ON: 3/29/17

Portable 7
 Portable 6
 Portable 5
 Portable 4

Portable 3

Portable 2 Portable 1

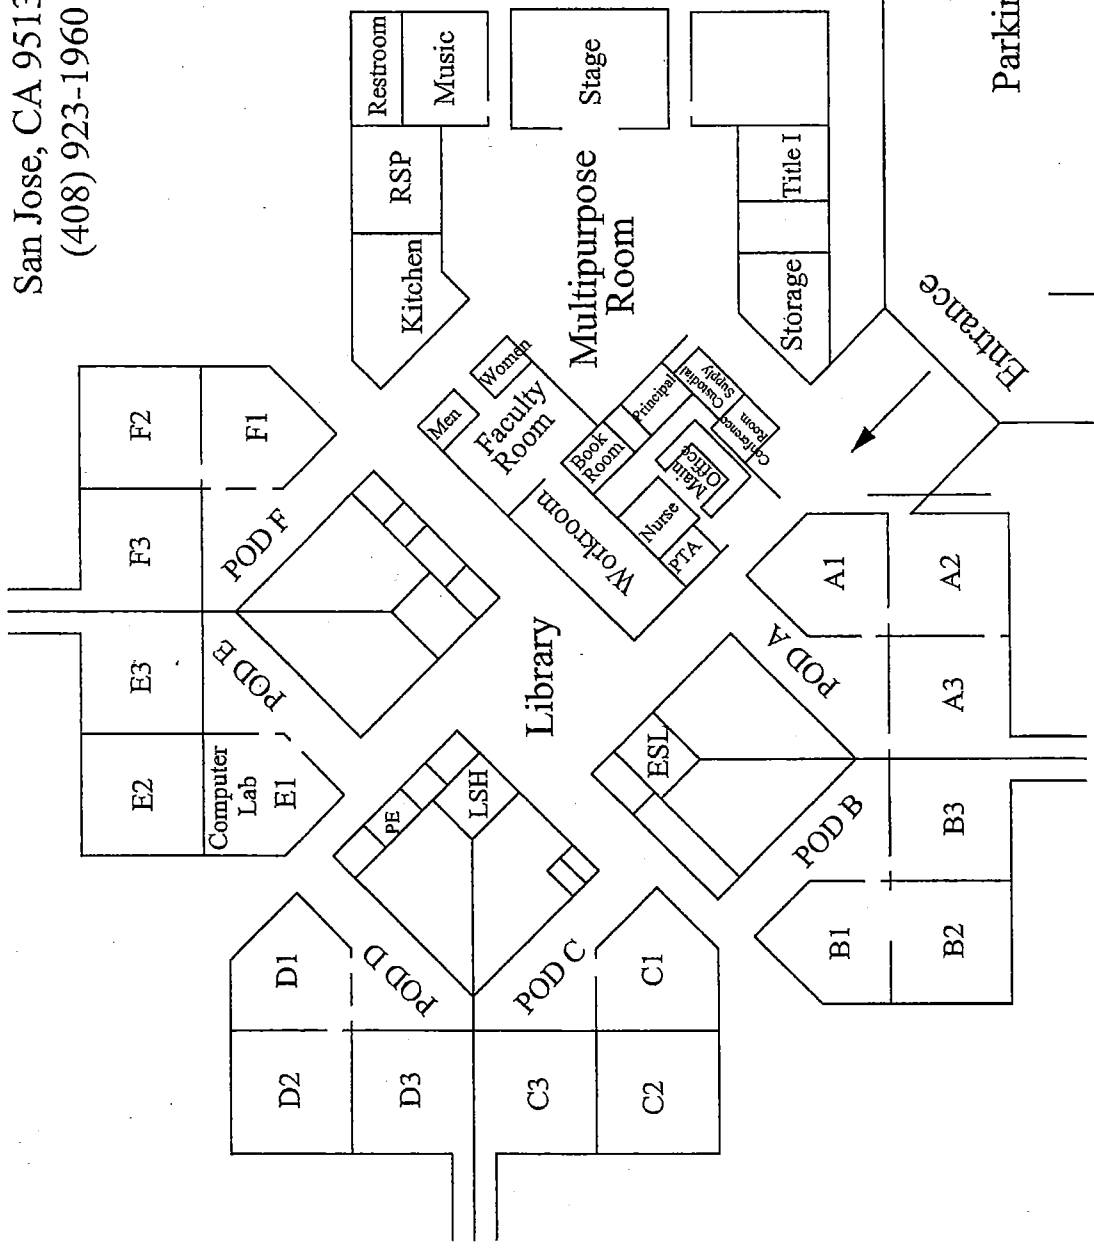

Parking Lot

Summerdale Drive

Entrance

Summerdale Elementary School
 1100 Summerdale Drive
 San Jose, CA 95132
 (408) 923-1960


Helmsley Drive

SUMMERDALE ELEMENTARY SCHOOL
 INSPECTED ON: 9-13-16

Portable 7
 Portable 6
 Portable 5
 Portable 4

Portable 3

Portable 2
 Portable 1

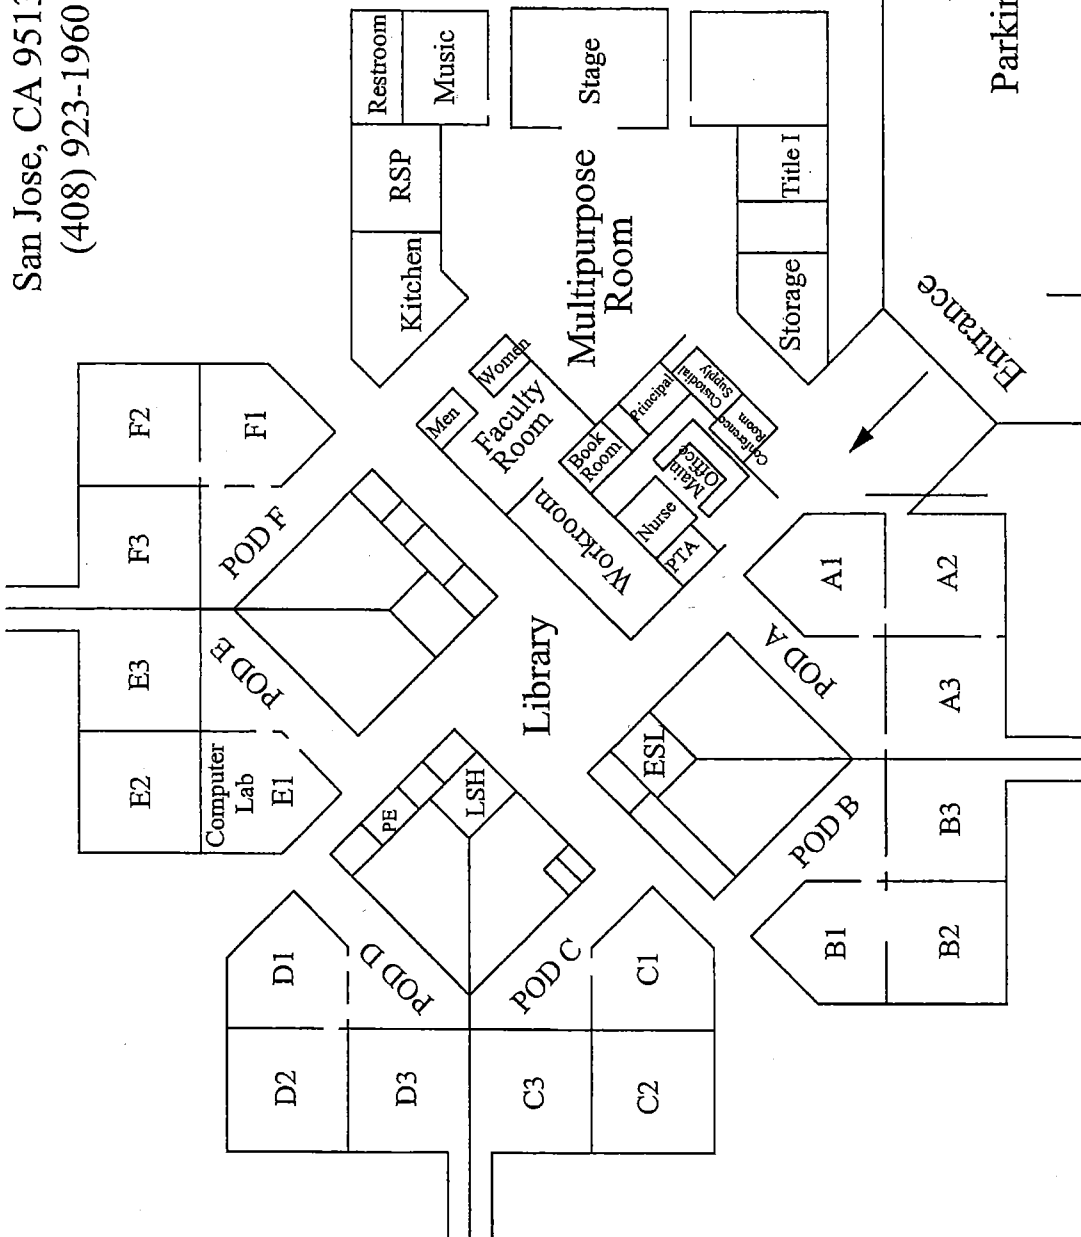

Parking Lot

Summerdale Drive

Summerdale Elementary School
 1100 Summerdale Drive
 San Jose, CA 95132
 (408) 923-1960


Helmsley Drive

SUMMERDALE ELEMENTARY SCHOOL
INSPECTED ON: 3-17-16

Portable 7
 Portable 6
 Portable 5
 Portable 4

Portable 3

Portable 2
 Portable 1

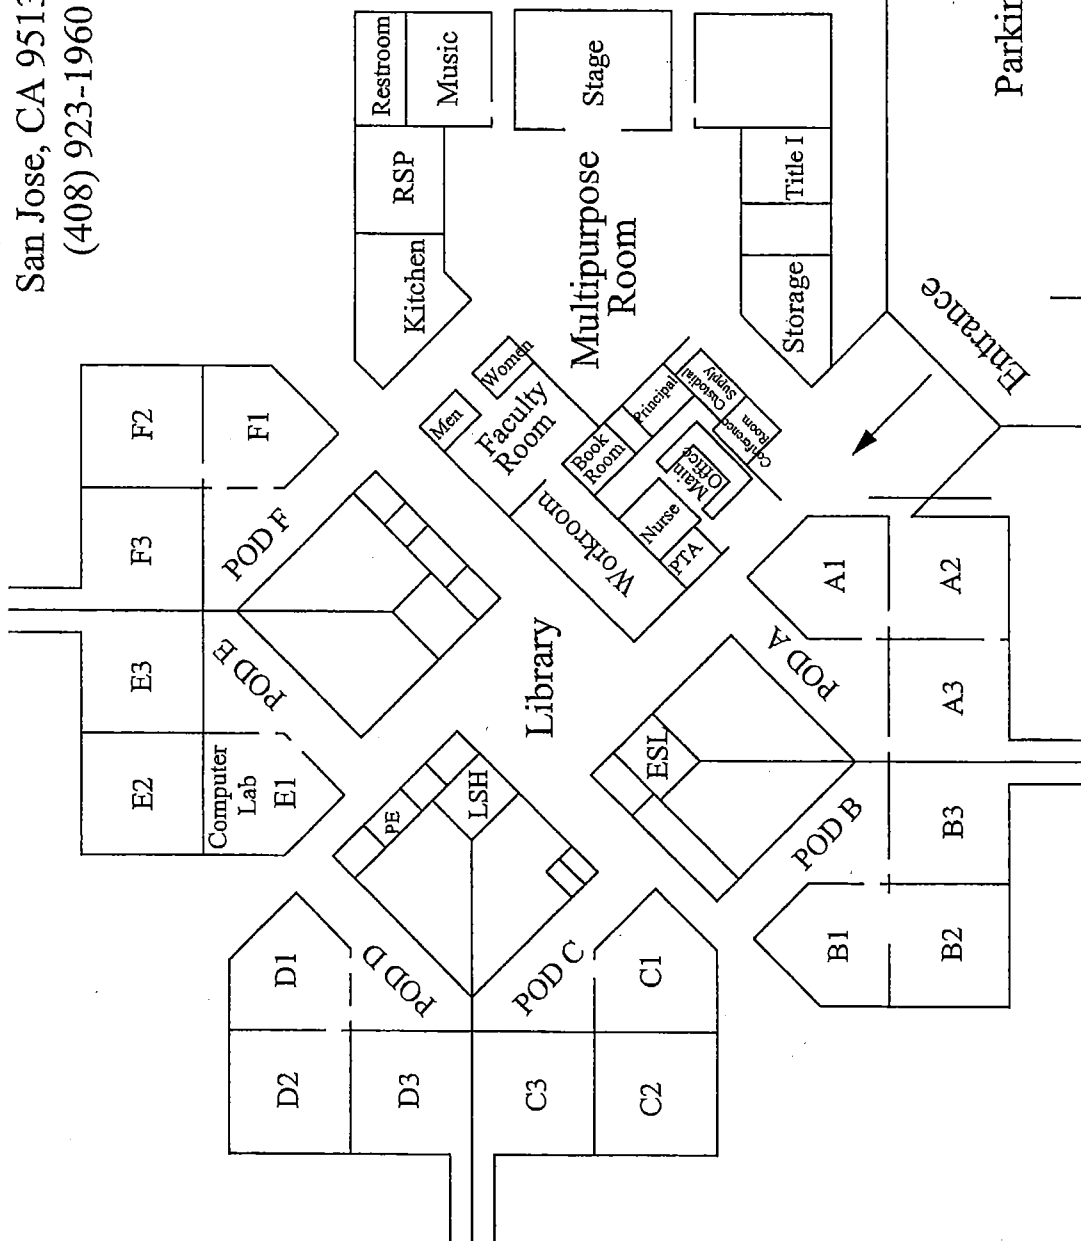

Summerdale Elementary School
 1100 Summerdale Drive
 San Jose, CA 95132
 (408) 923-1960


Helmley Drive

SUMMERDALE ELEMENTARY SCHOOL
INSPECTED ON: 8/18/18

Portable 7
 Portable 6
 Portable 5
 Portable 4

Portable 3

Portable 2
 Portable 1

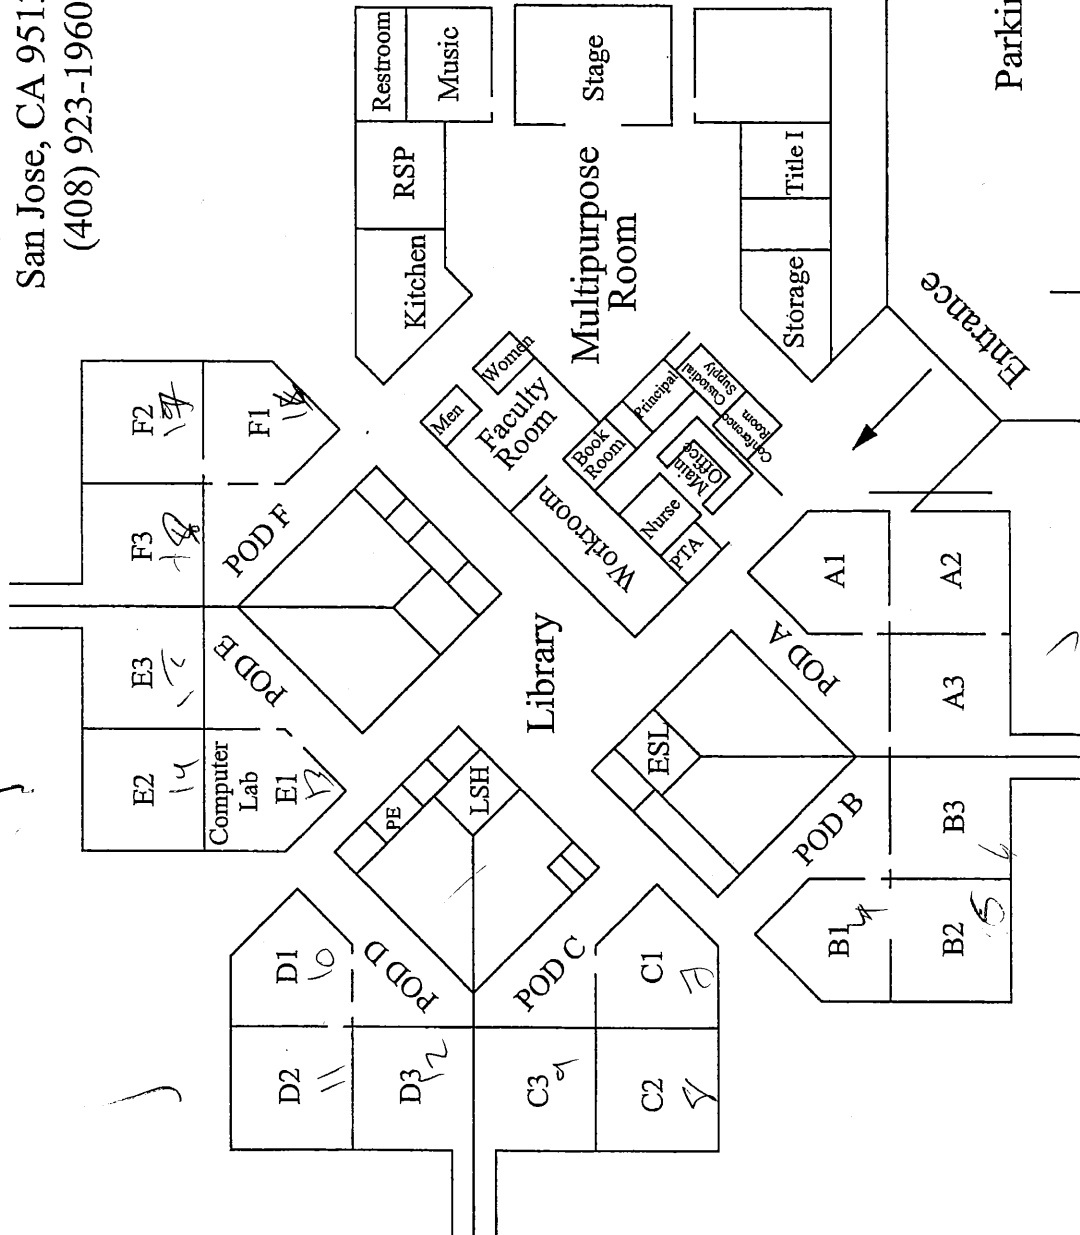

Summerdale Drive

Summerdale Elementary School
 1100 Summerdale Drive
 San Jose, CA 95132
 (408) 923-1960


Helmley Drive

SUMMERDALE ELEMENTARY SCHOOL
 INSPECTED ON: 03-17-2015


Portable 7
 Portable 6
 Portable 5
 Portable 4

Portable 3

Portable 2
 Portable 1

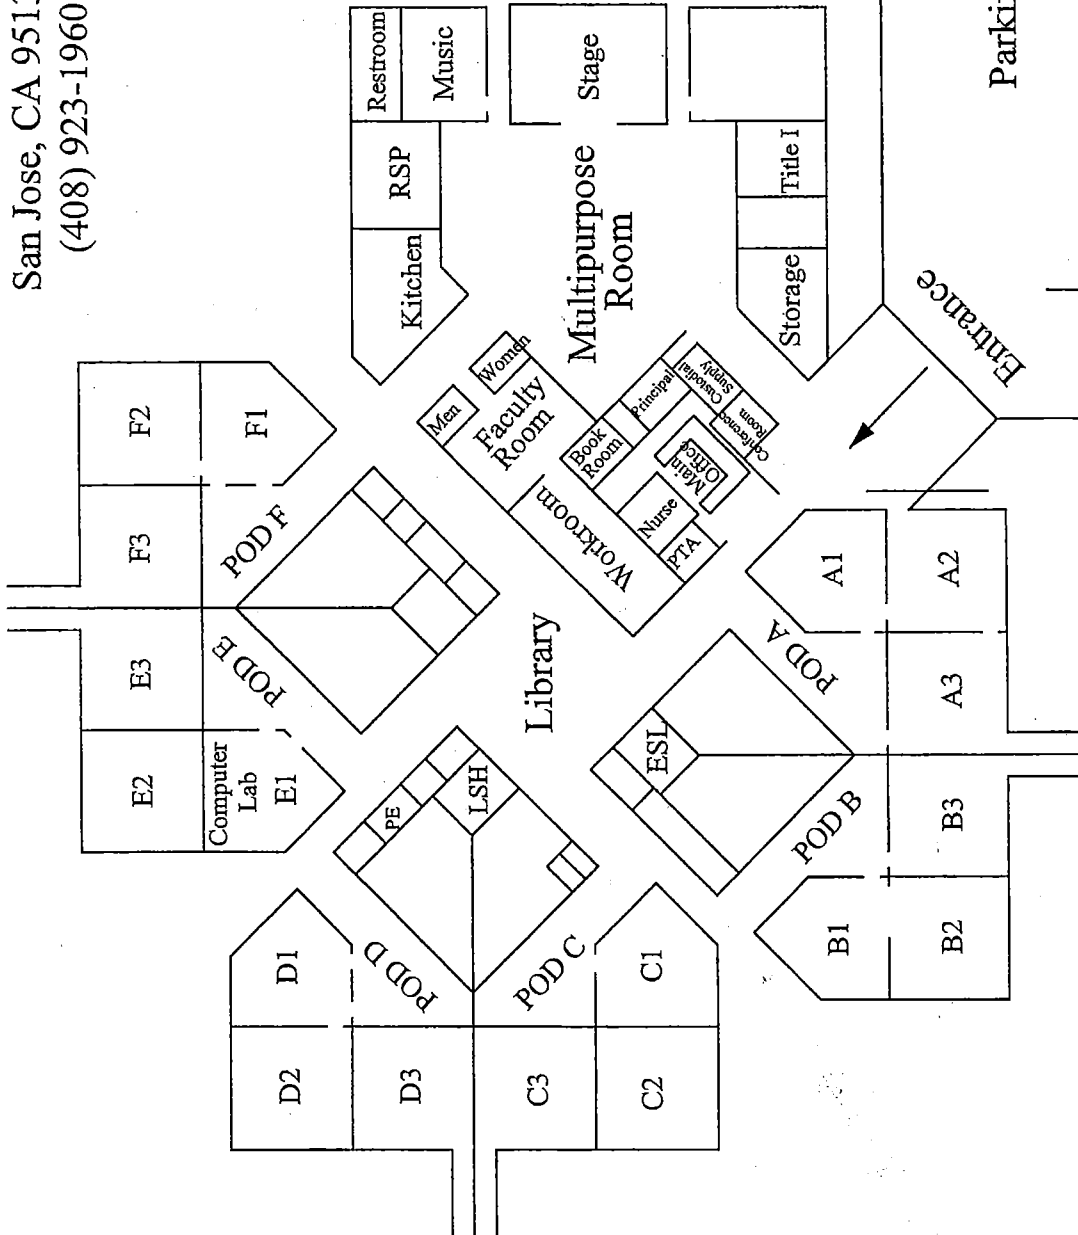

Summerdale Drive

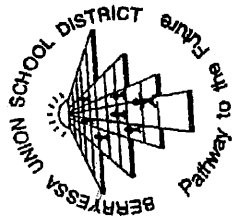

Summerdale Elementary School

1100 Summerdale Drive
San Jose, CA 95132
(408) 923-1960
(408) 937-4923 (fax)

Patty McDonald, Principal

Tran

P-6

King

P-5


Labrador

P-4

P-3


Hopes

SUMMERDALE ELEMENTARY SCHOOL
INSPECTED ON: 08-27-2014

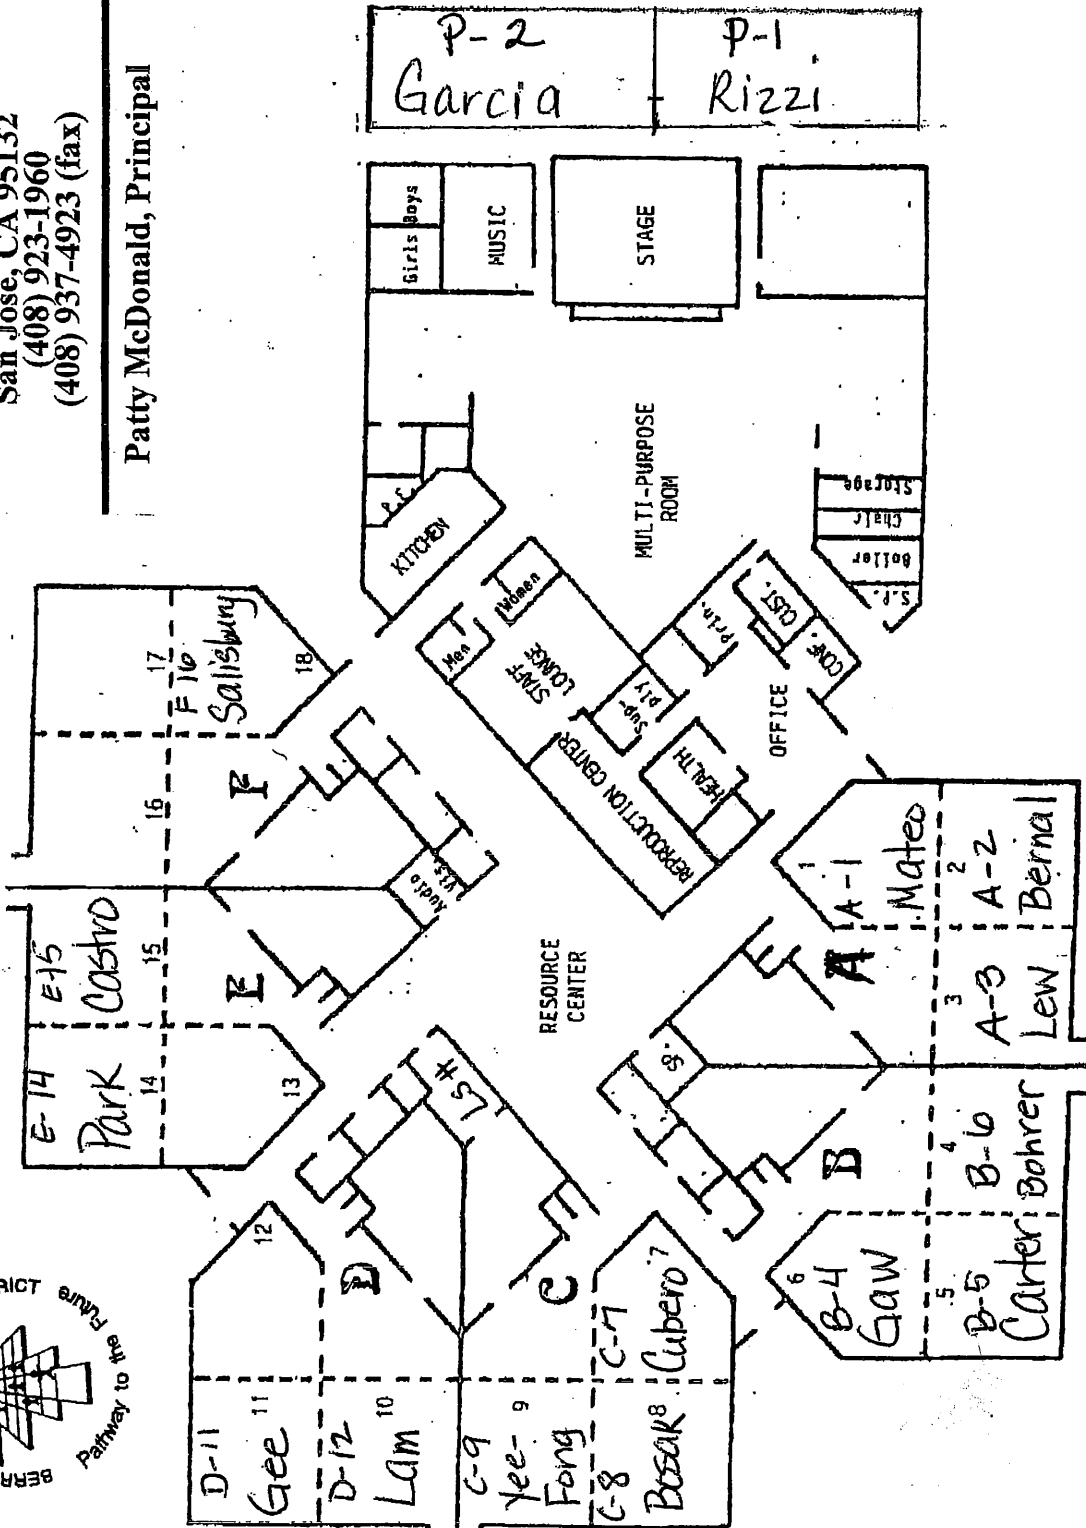

P-2
Garcia

P-1
Rizzi

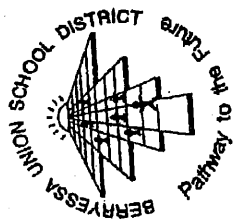

Summerdale Elementary School

1100 Summerdale Drive
 San Jose, CA 95132
 (408) 923-1960
 (408) 937-4923 (fax)

Patty McDonald, Principal

Tran

P-6

King

P-5


Labrador

P-4

P-3

Hopes


SUMMERDALE ELEMENTARY SCHOOL
 INSPECTED ON: 3-5-14

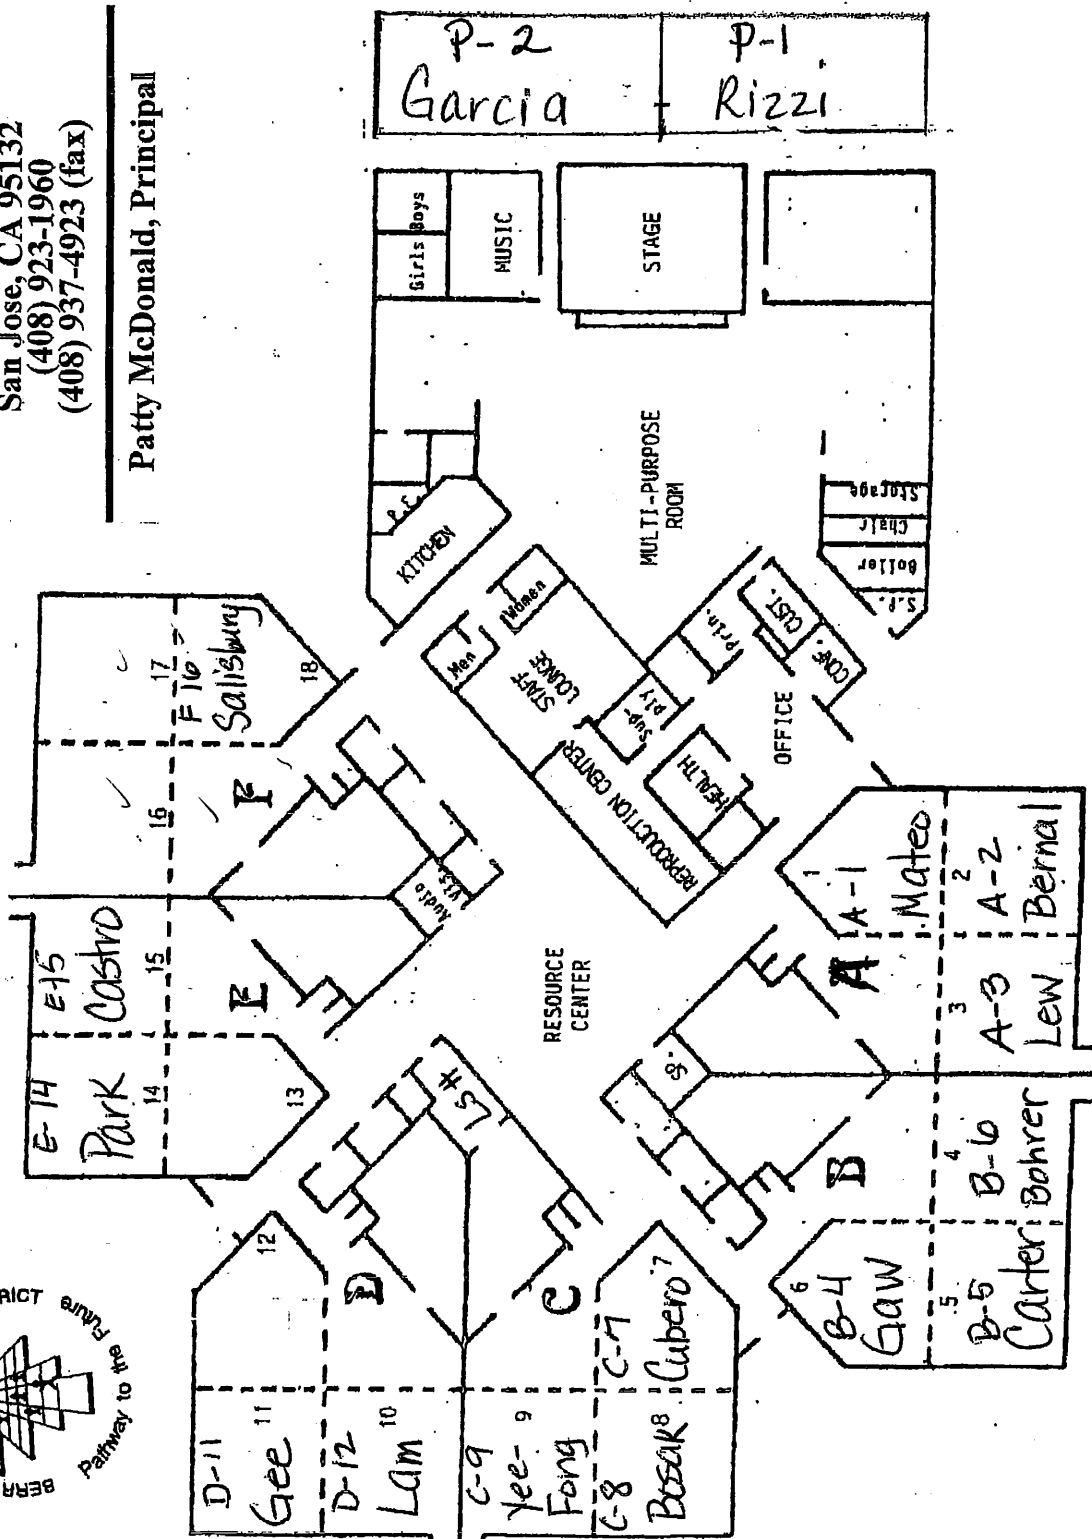

Summerdale Elementary School

**1100 Summerdale Drive
San Jose, CA 95132
(408) 923-1960
(408) 937-4923 (fax)**

Patty McDonald, Principal

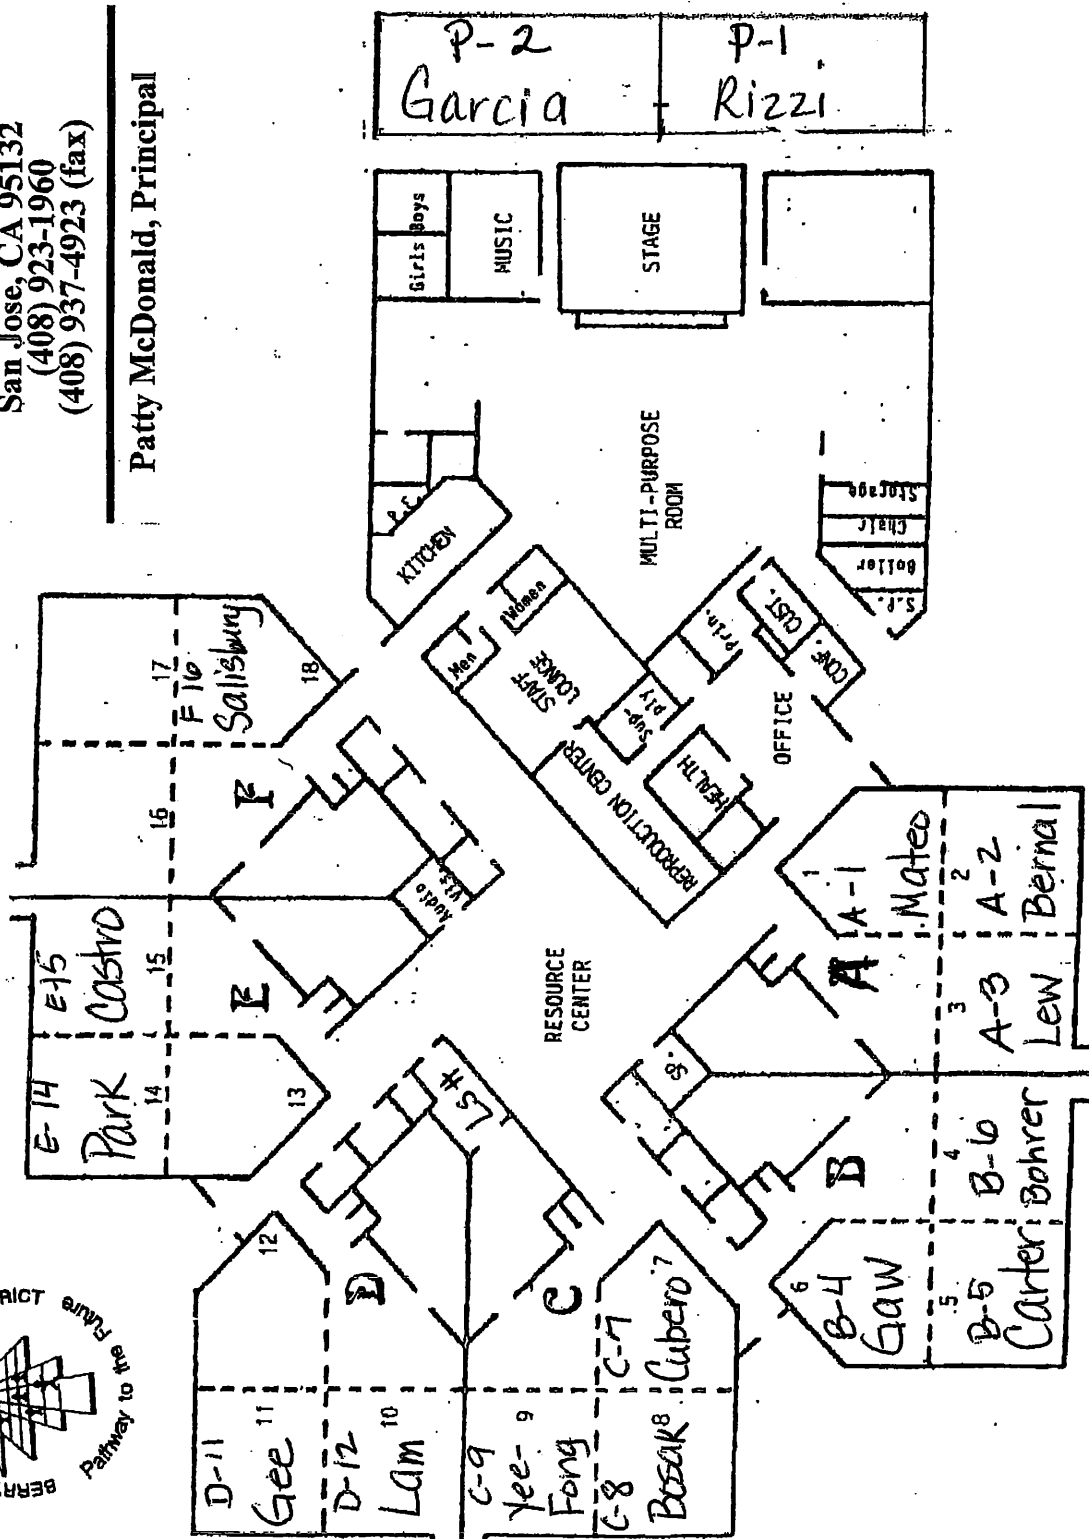

Tran

Fig 2

King

5-A


Labrador

51

2-3

Hopes

SUMMERDALE ELEMENTARY SCHOOL
INSPECTED ON: 09-25-2013

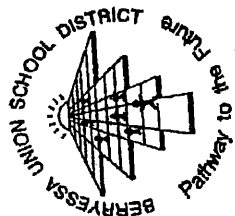

Summerdale Elementary School

1100 Summerdale Drive
 San Jose, CA 95132
 (408) 923-1960
 (408) 937-4923 (fax)

Patty McDonald, Principal

Tran

P-6

King

P-5


Labrador


P-4

P-3

Hopes

SUMMERDALE ELEMENTARY SCHOOL
 INSPECTED ON: 04-03-13

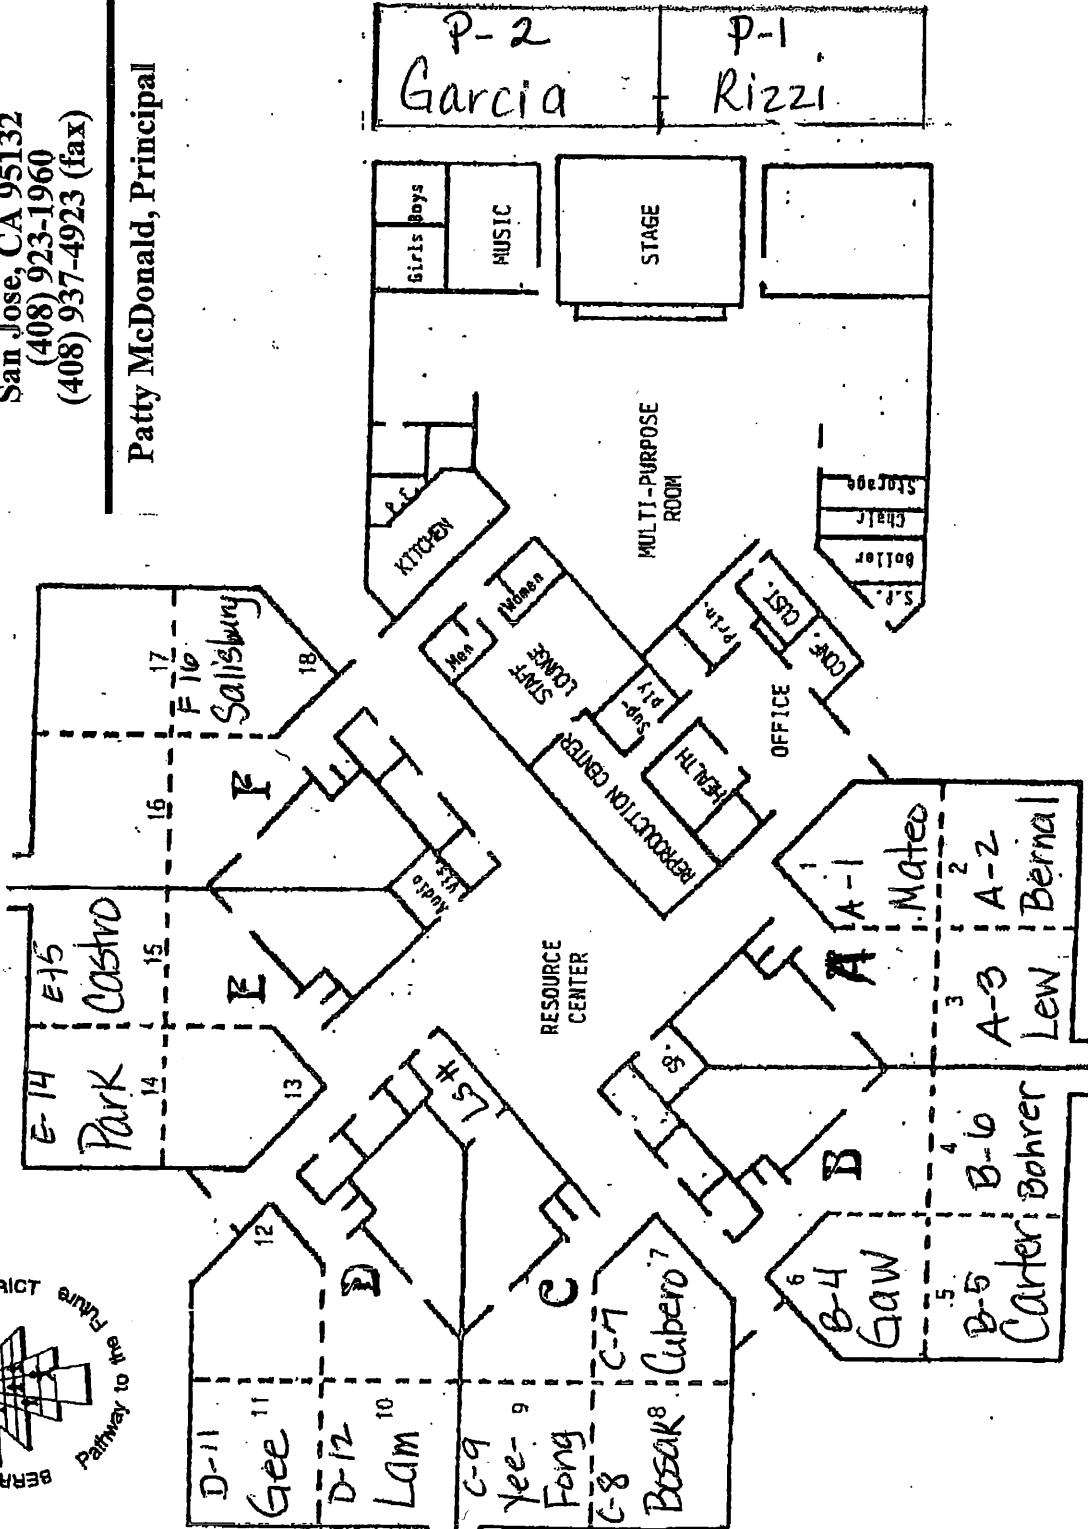

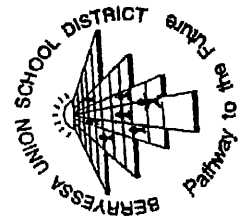

Summerdale Elementary School

1100 Summerdale Drive
 San Jose, CA 95132
 (408) 923-1960
 (408) 937-4923 (fax)

Patty McDonald, Principal

Tran

P-6

King

P-5


Labrador

P-4

P-3


Hopes

SUMMERDALE ELEMENTARY SCHOOL
 INSPECTED ON: 10-10-12

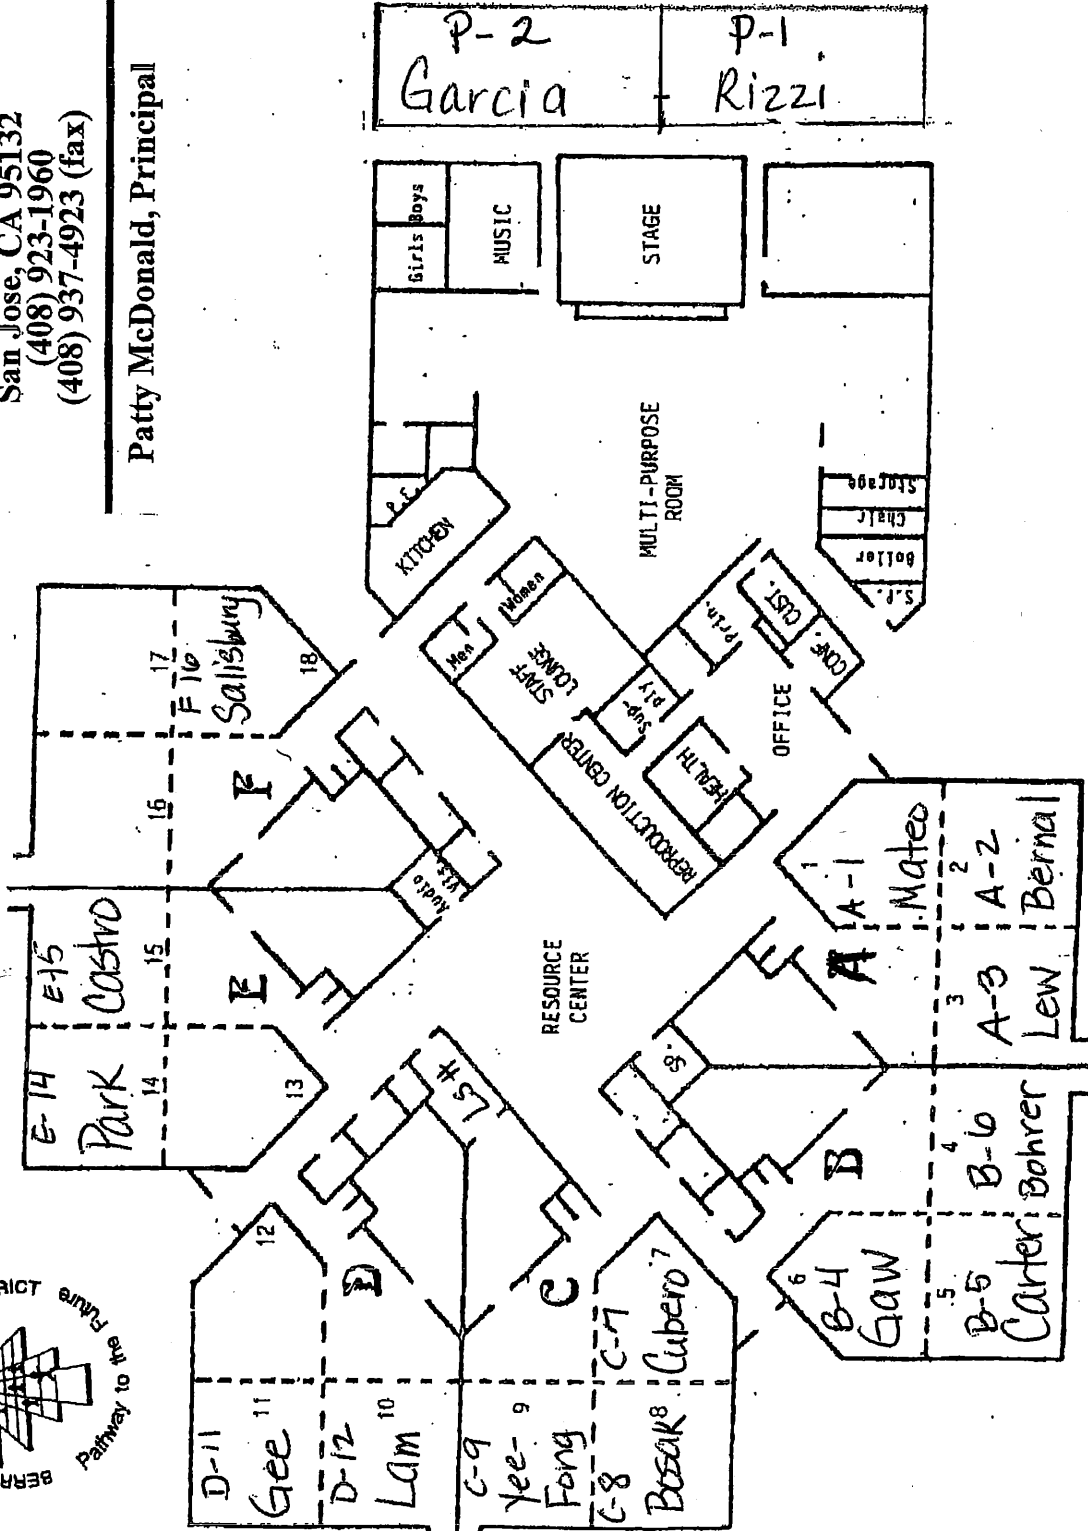

P-2
 Garcia

P-1
 Rizzi

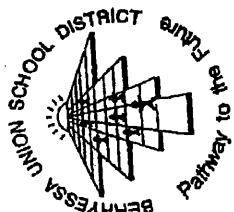

Summerdale Elementary School

1100 Summerdale Drive
San Jose, CA 95132
(408) 923-1960
(408) 937-4923 (fax)


Patty McDonald, Principal


Tran
P-6
King
P-5
Labrador
P-4

P-3
Hopes

SUMMERDALE ELEMENTARY SCHOOL
INSPECTED ON: 04-09-12

NO SCALE MAP

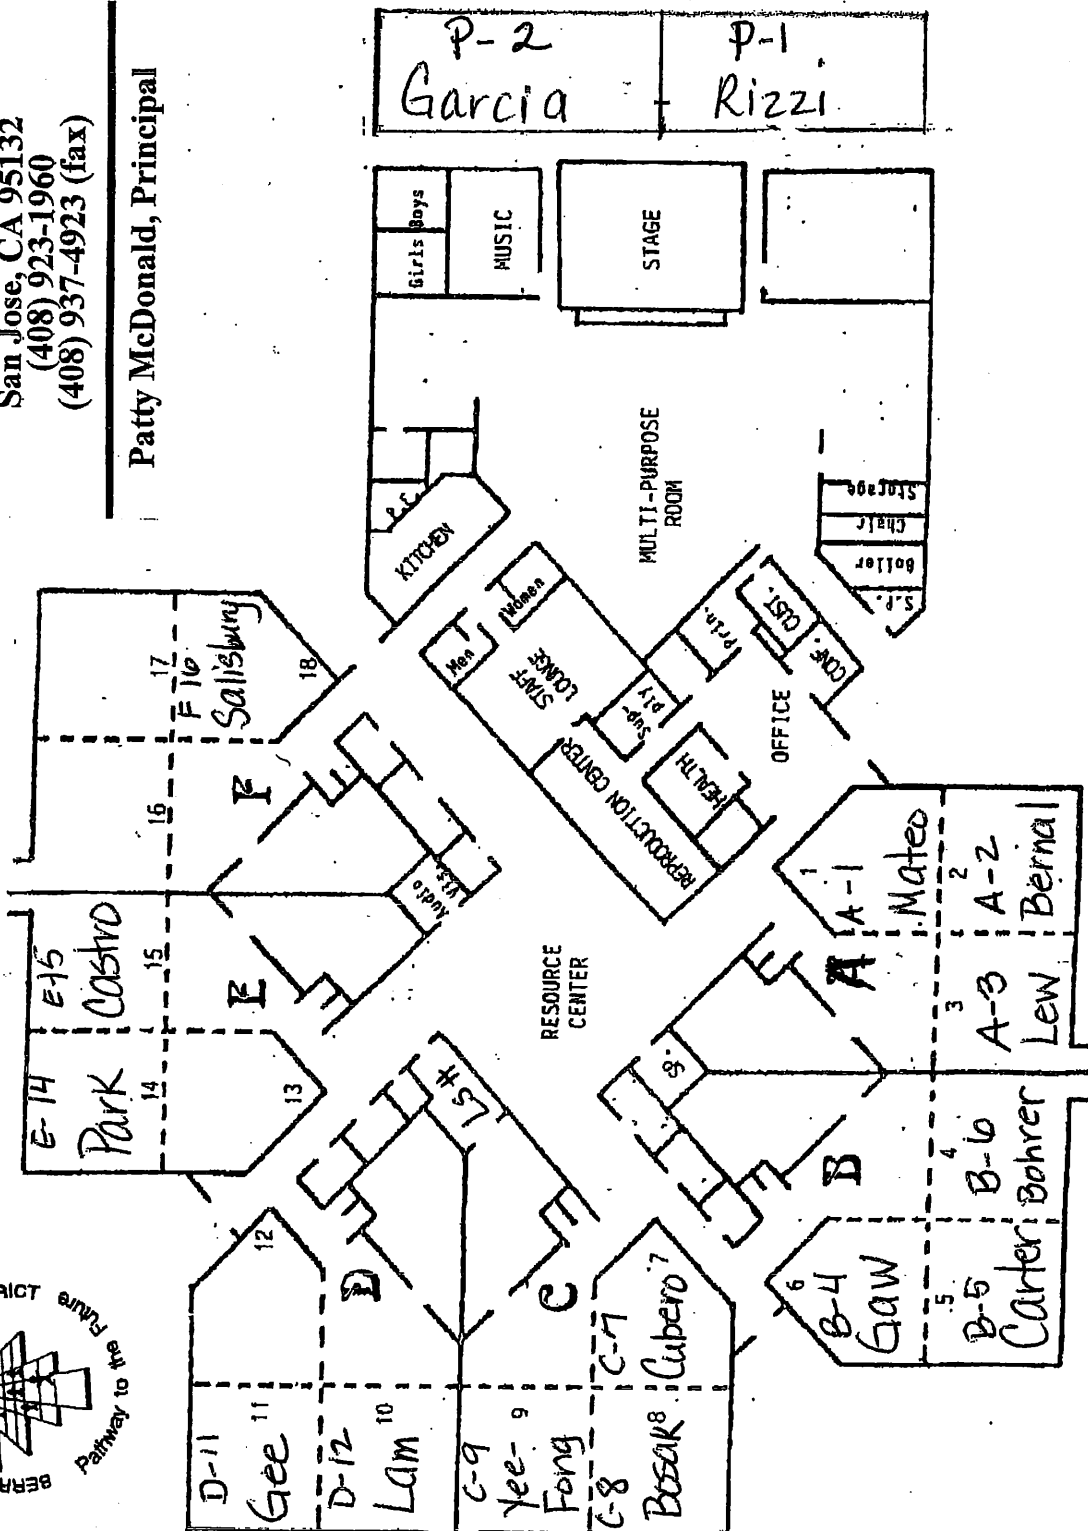

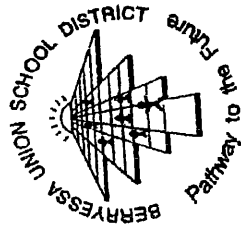

Summerdale Elementary School

1100 Summerdale Drive
 San Jose, CA 95132
 (408) 923-1960
 (408) 937-4923 (fax)

Patty McDonald, Principal

Tran

P-6

King


P-5

Labrador

P-4

P-3

Hopes

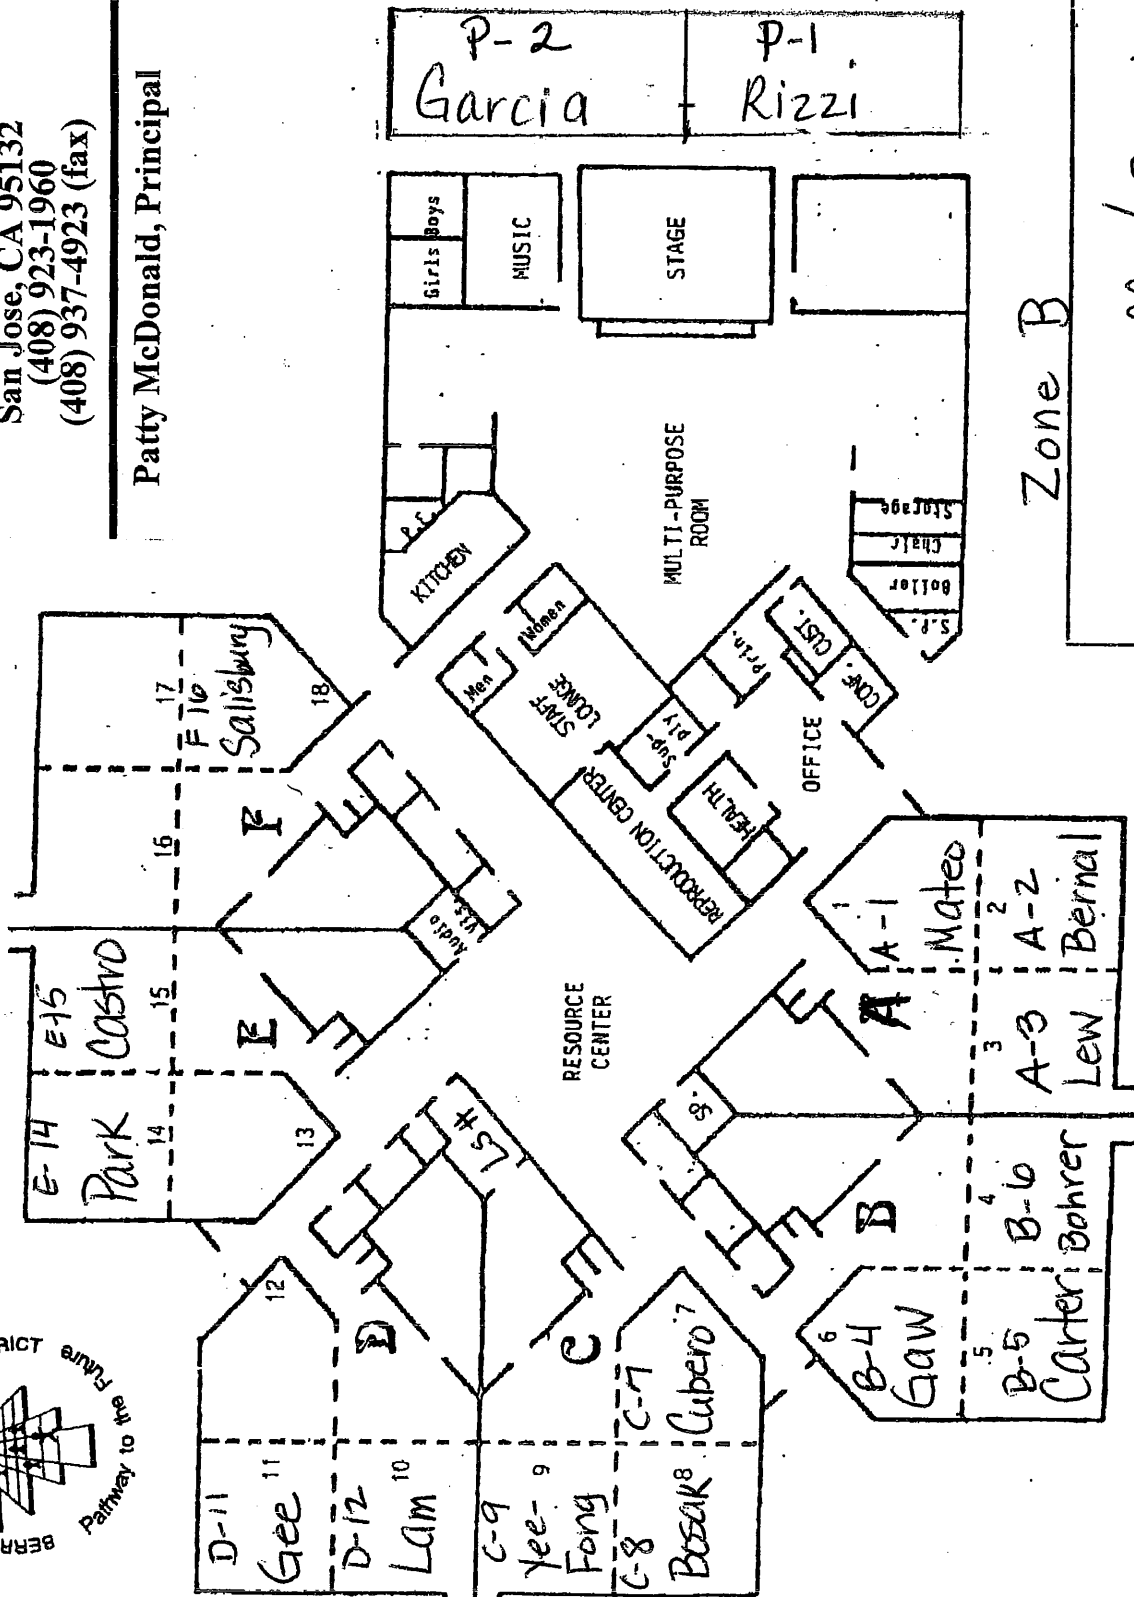

Drop off / Pick Up Area

Zone A

Summerdale School

1100 Summerdale Drive

San Jose, CA 95132

P. 1


408-261-1183

Rob LaPore

Nov 14 06 08:49a


Portable 7 SMITH
Portable 6 WAGNER
Portable 5 GORT
Portable 4 SAUNDERS

Portable 3 HOVES

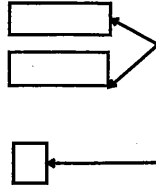

Plastic
Shed
Metal
Containers

SUMMERDALE ELEMENTARY SCHOOL
INSPECTED ON: 11-30-11

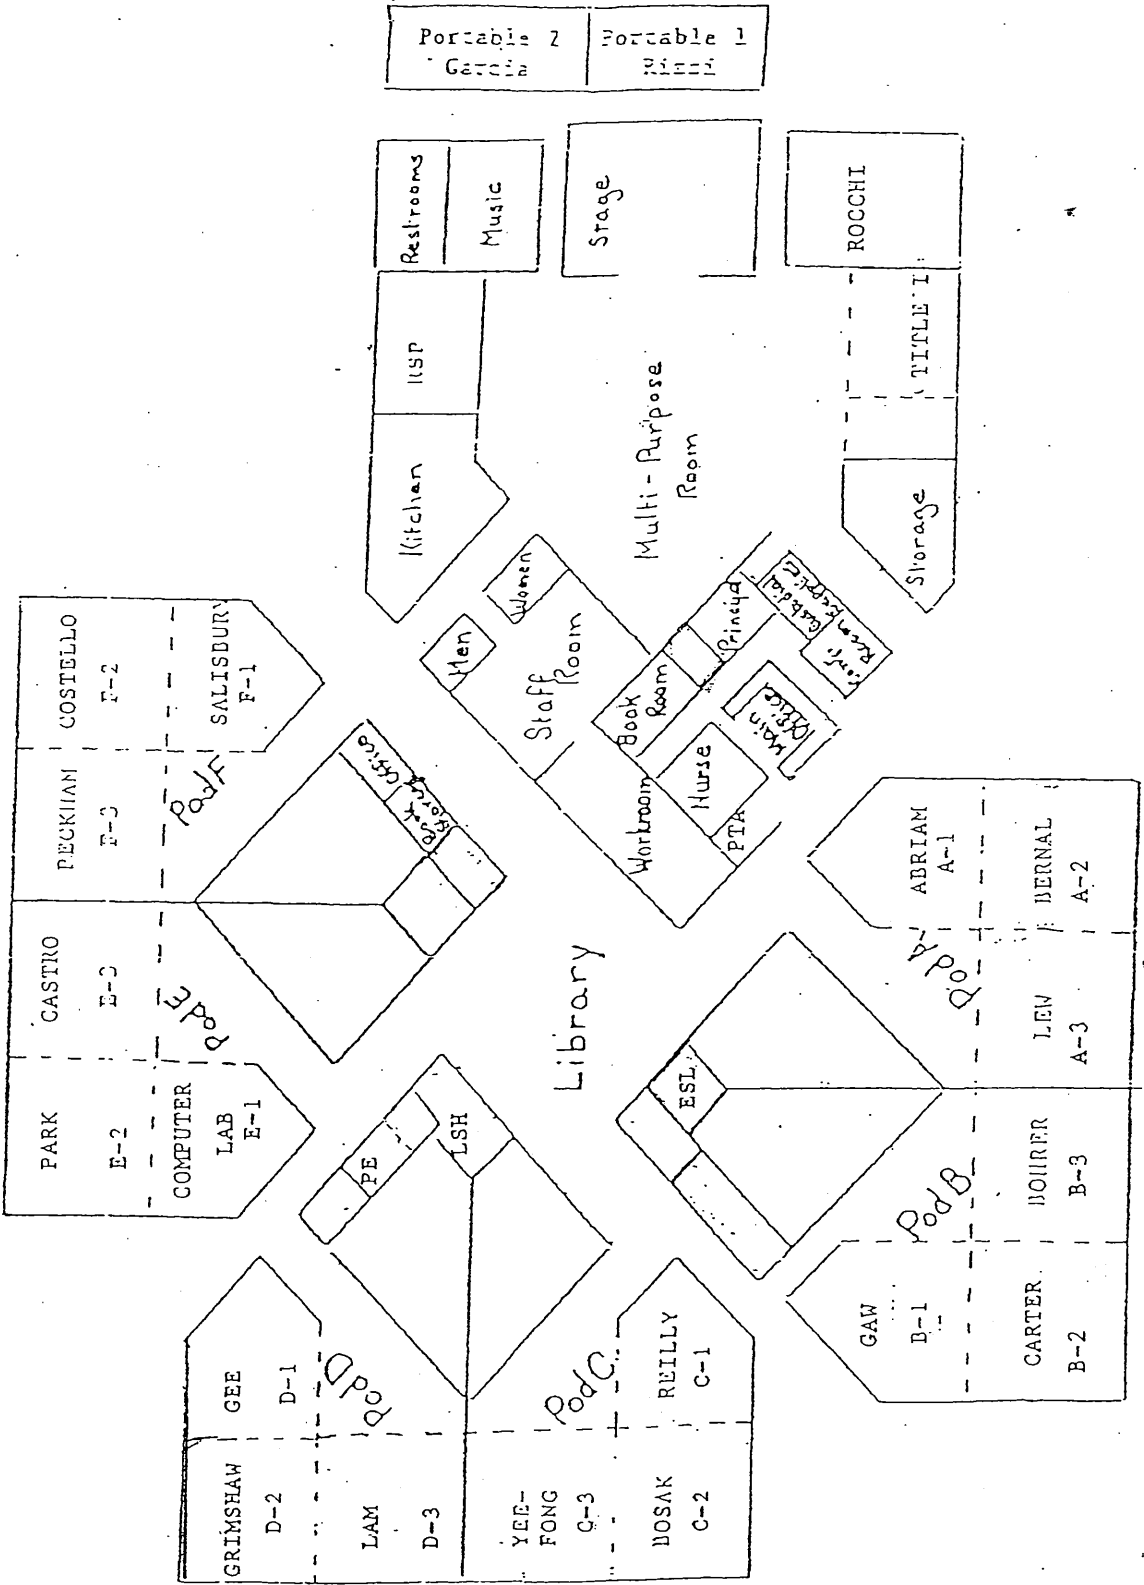

Portable 2 GORT	Portable 1 SMITH
--------------------	---------------------

Summerdale School

1100 Summerdale Drive

San Jose, CA 95132

P. 1


408-261-1183

Rob LaPore

Nov 14 06 08:49a


Portable 7
SMITH
Portable 6
WAGNER
Portable 5
CORT
Portable 4
SAUNDERS

Portable 3
HOPES

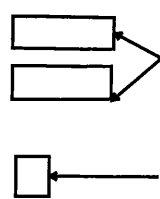

SUMMERDALE ELEMENTARY SCHOOL
INSPECTED ON: 9/1/10

Portable 2 GARCIA
Portable 1 MARTIN

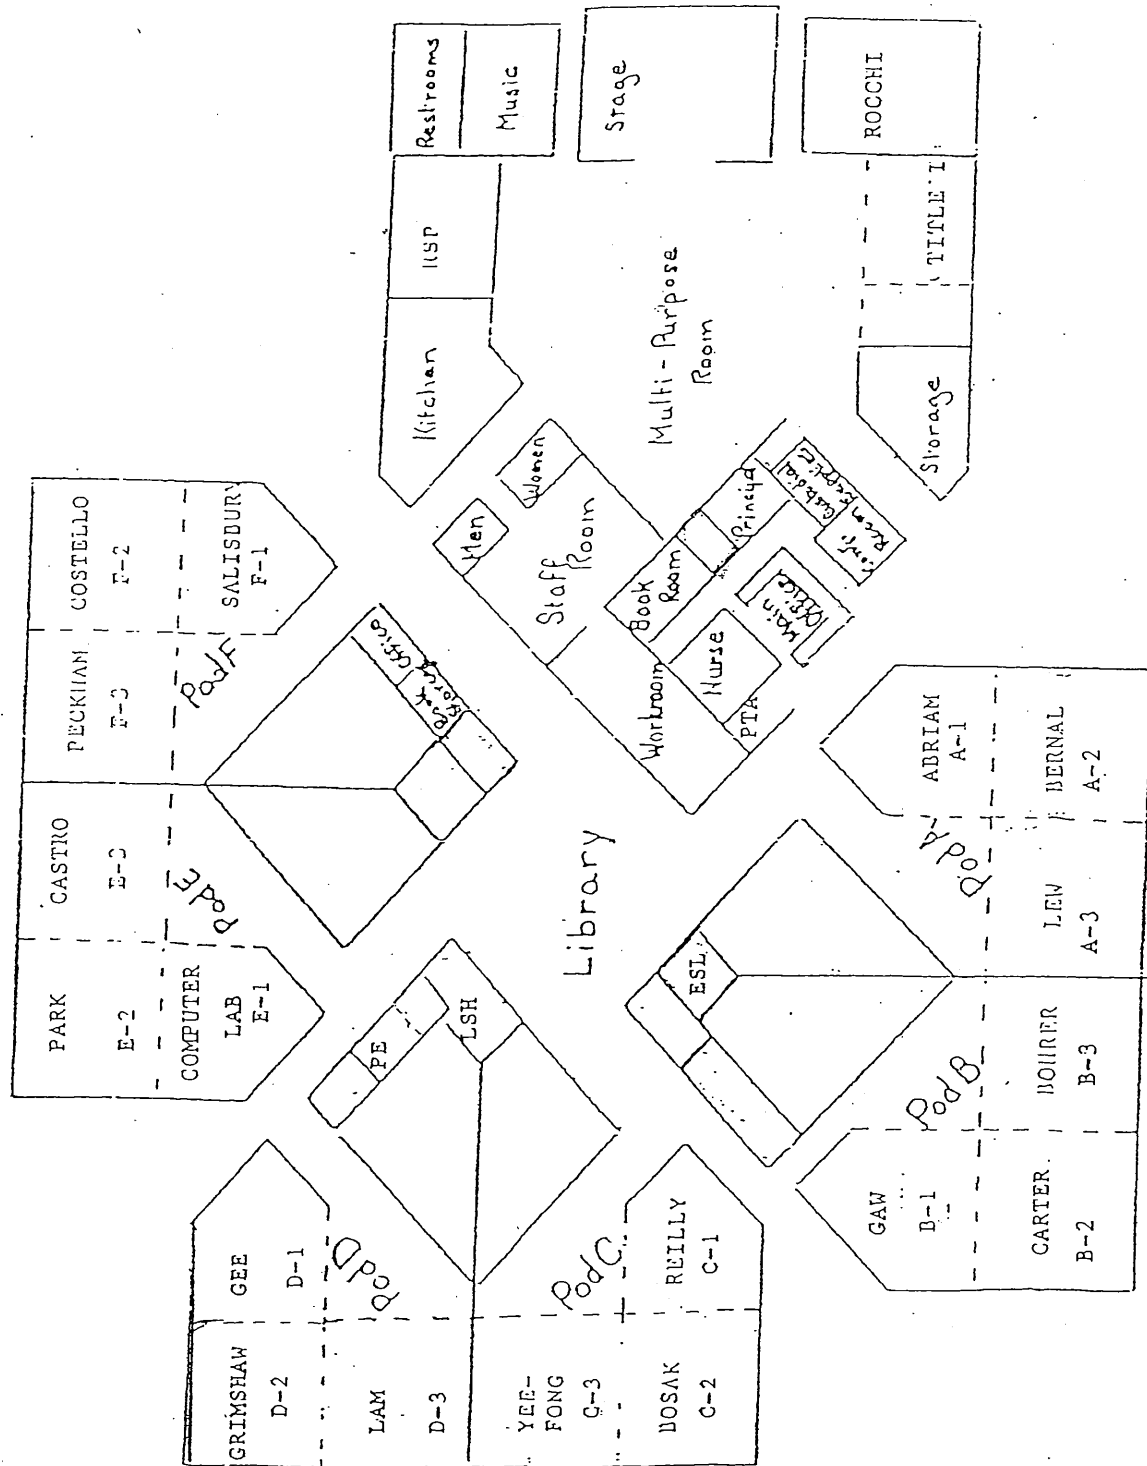


Summerdale School

1100 Summerdale Drive
 San Jose, CA 95132


Portable 7
SMITH
Portable 6
WAGNER
Portable 5
GORT
Portable 4
SAUNDERS

Portable 3
HOPES

Portable 2
Garcia
Portable 1
Winters

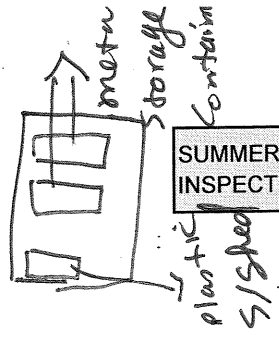

SUMMERDALE ELEMENTARY SCHOOL
 INSPECTED ON: 3/10/10

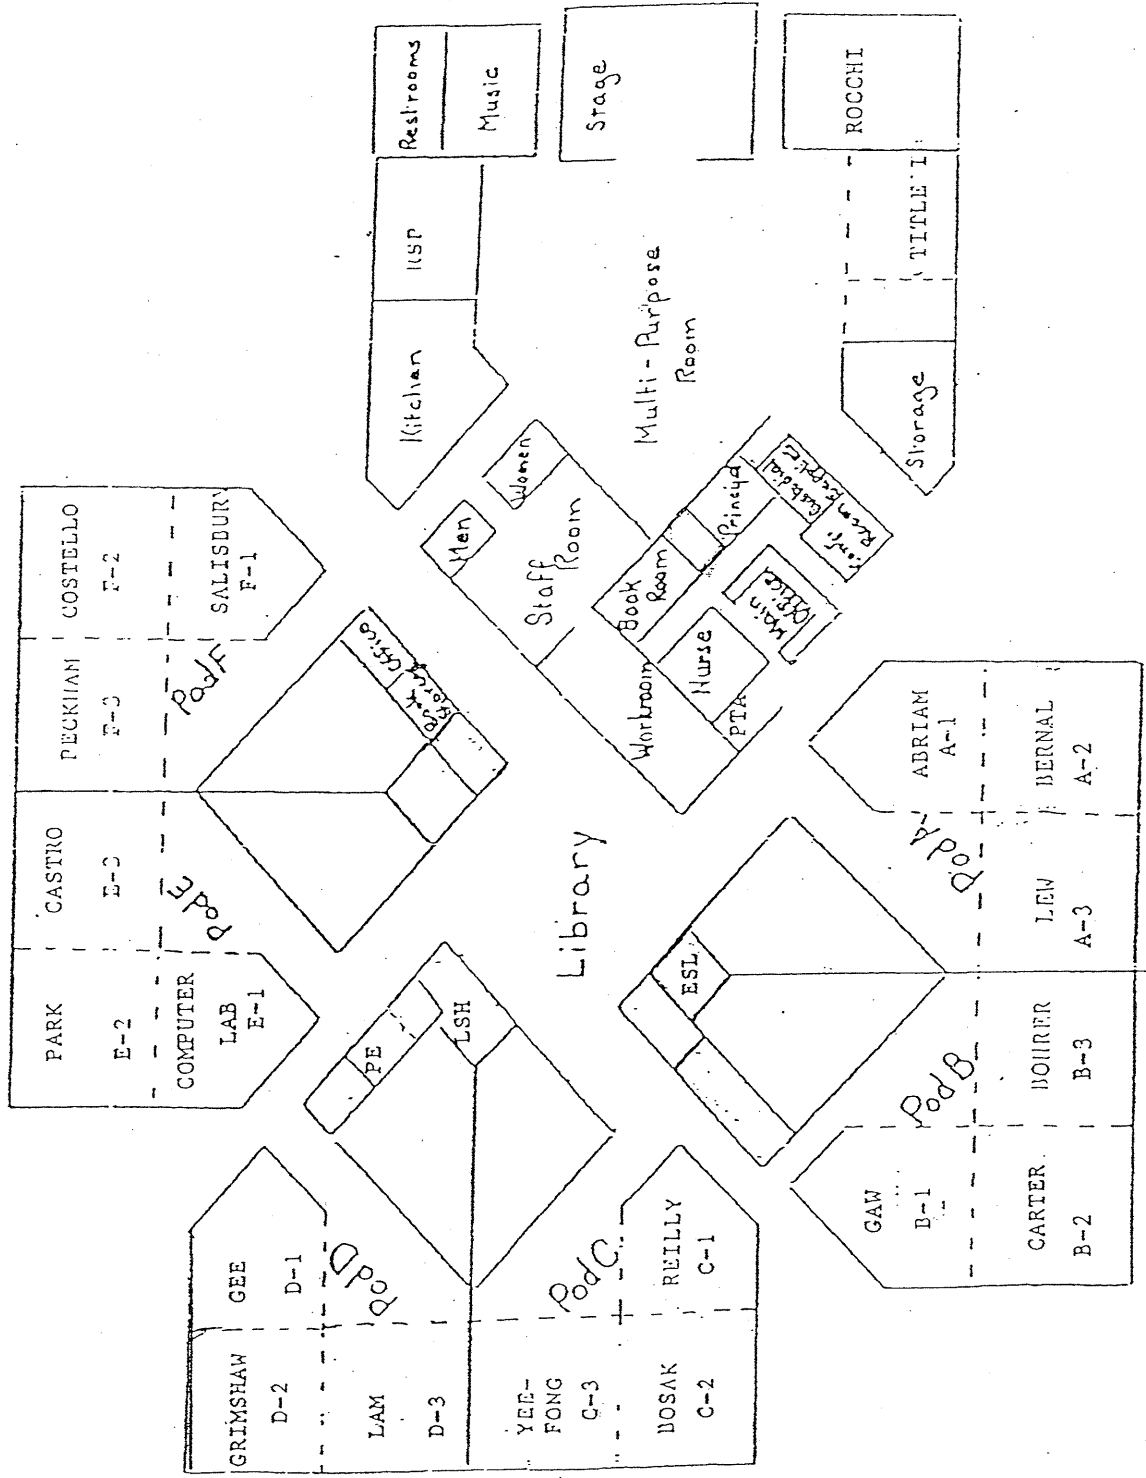

Summerdale School


1100 Summerdale Drive
San Jose, CA 95132

Portable 7 SMITH
Portable 6 WAGNER
Portable 5 CORT
Portable 4 SAUNDERS

Portable 3 HOPES

Portable 2 GARCIA
Portable 1 MANN


SUMMERDALE ELEMENTARY SCHOOL
INSPECTED ON: 09-04-09

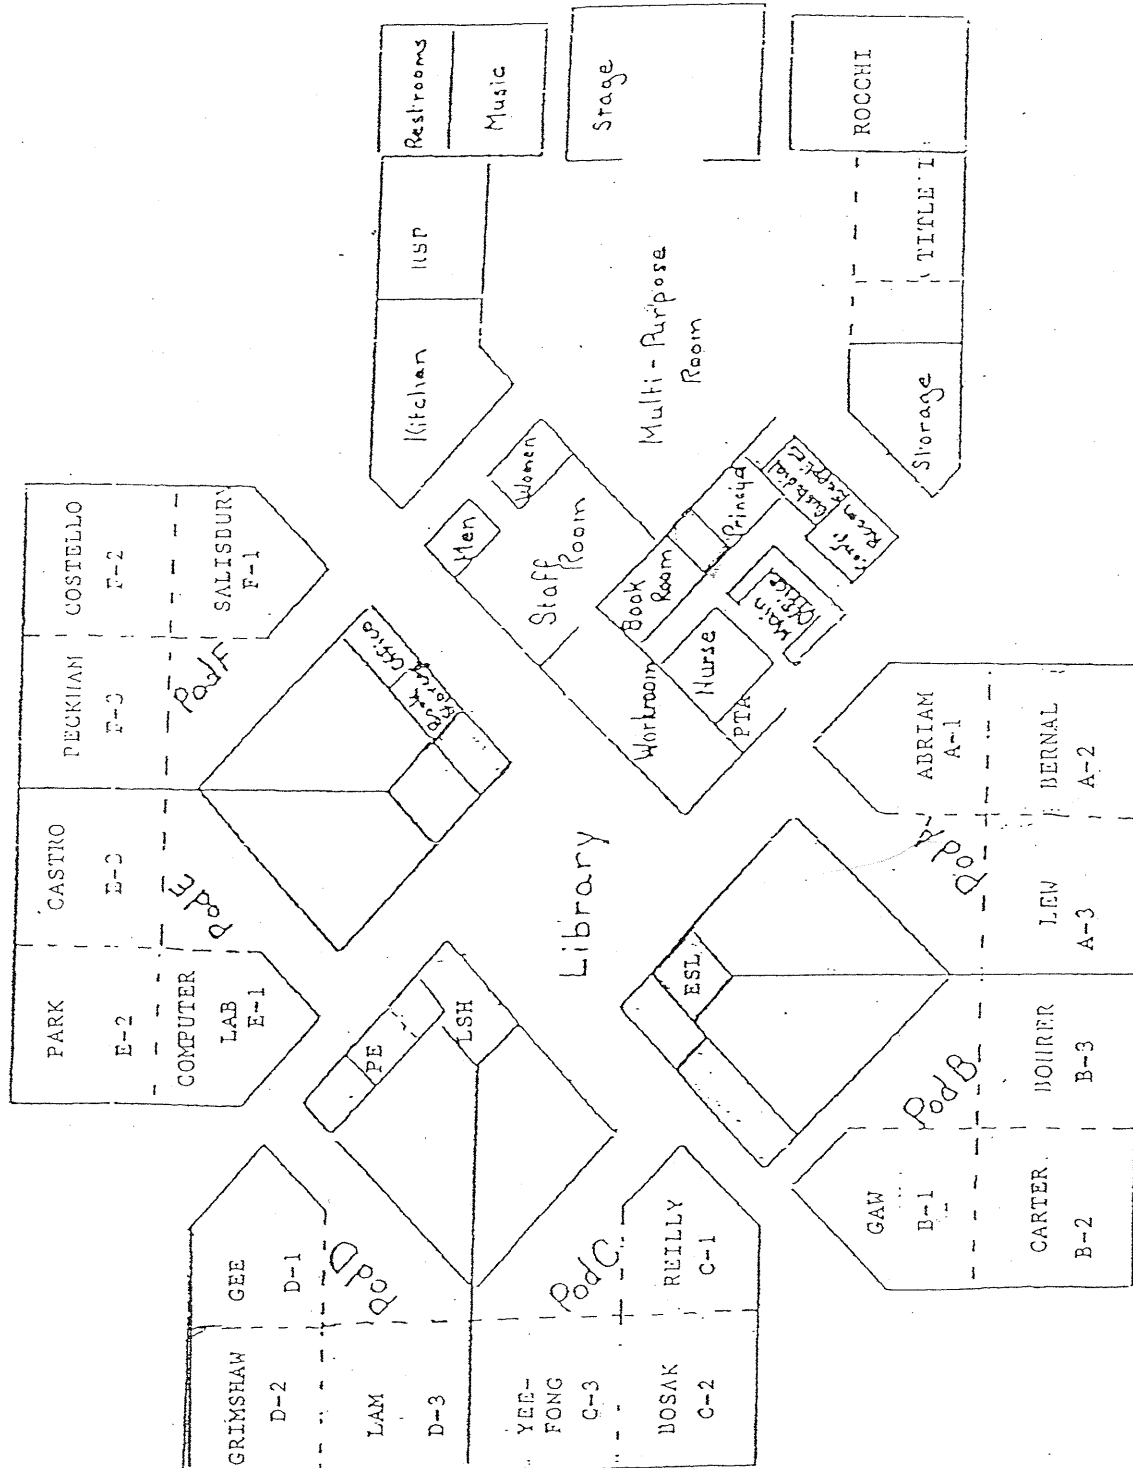

San Jose, CA 95132

Portable 2	Portable 1
Garcia	Rios

SUMMERDALE ELEMENTARY SCHOOL
INSPECTED ON: 5-13-08

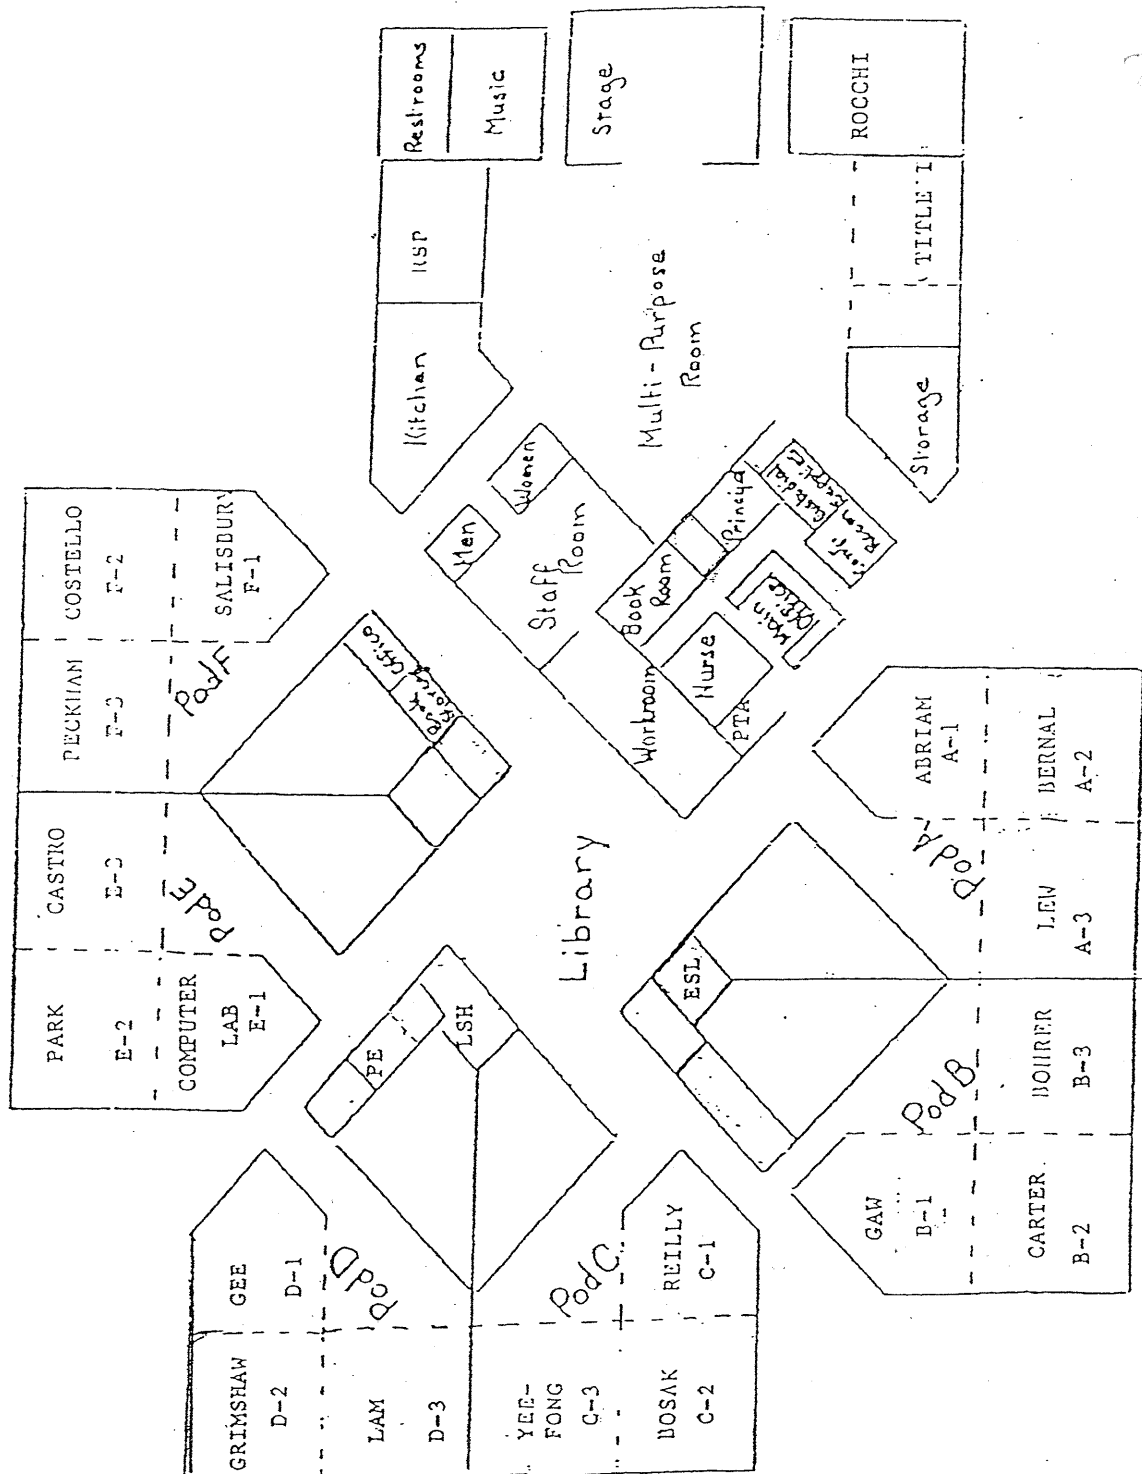

Summerdale School

1100 Summerdale Drive


San Jose, CA 95132

Portable 7
SMITH
Portable 6
WAGNER
Portable 5
CORT
Portable 4
SAUNDERS


Portable 3
HOPES

SUMMERDALE ELEMENTARY SCHOOL
INSPECTED ON: 6/15/08

Portable 2
GARCIA
Portable 1
WILLIAMS

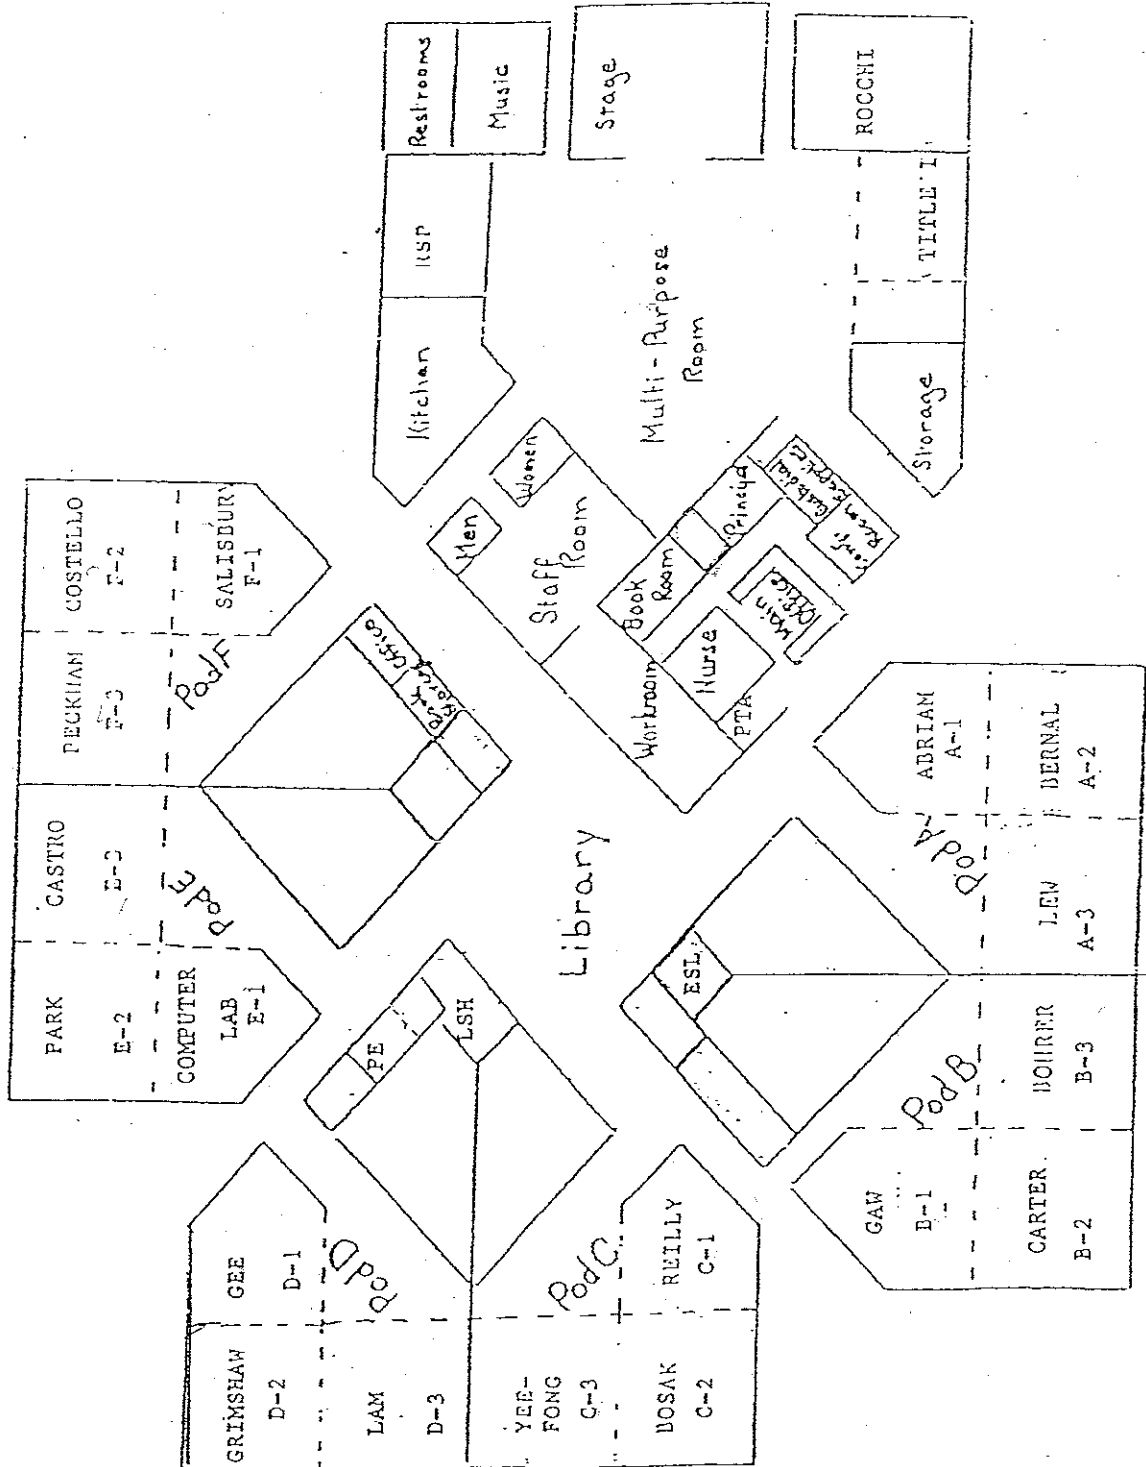

Summerdale School
 1100 Summerdale Drive
 San Jose, CA 95132

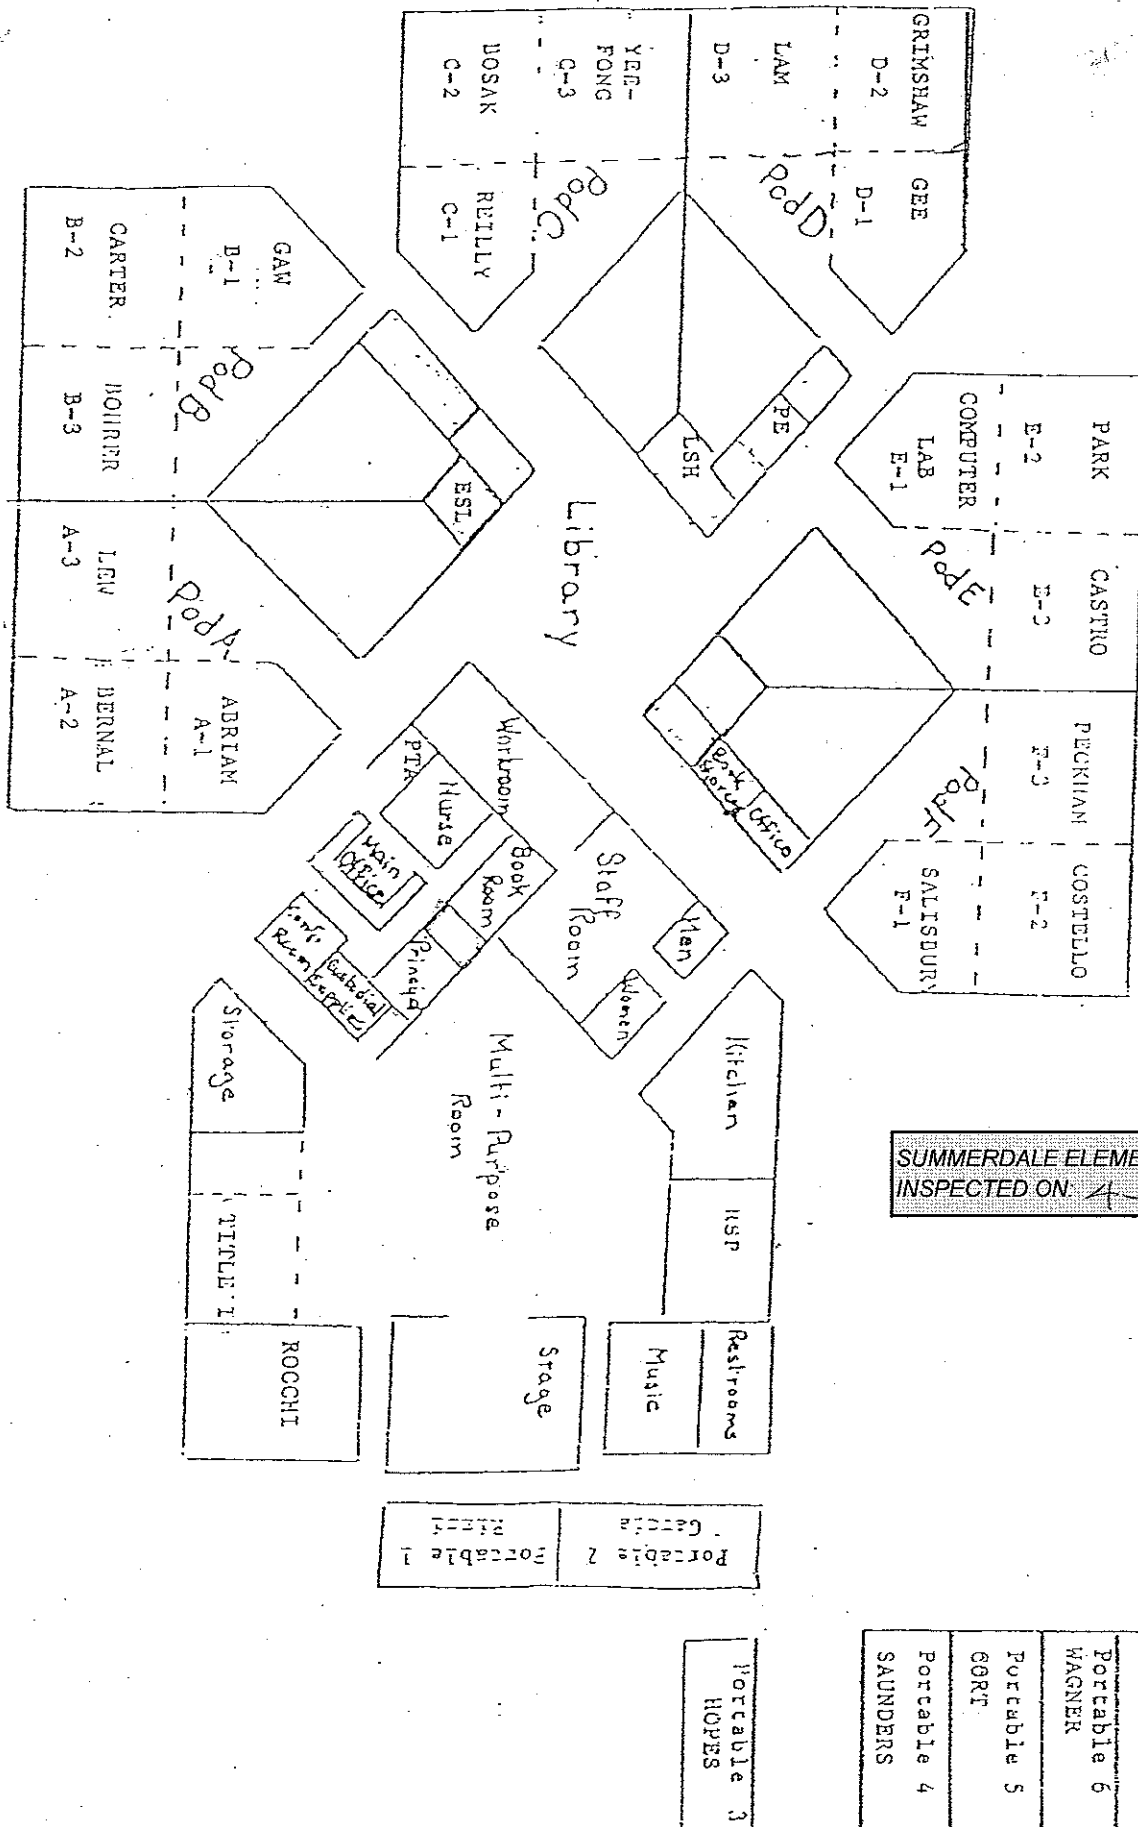


SUMMERDALE ELEMENTARY SCHOOL
 INSPECTED ON 4-16-08

Portable 7
SMITH
Portable 6
WAGNER
Portable 5
GORT
Portable 4
SAUNDERS

Portable 3
HOPES

Portable 2
GORT
Portable 1
WAGNER

Summerdale School 1100 Summerdale Drive San Jose, CA 95132

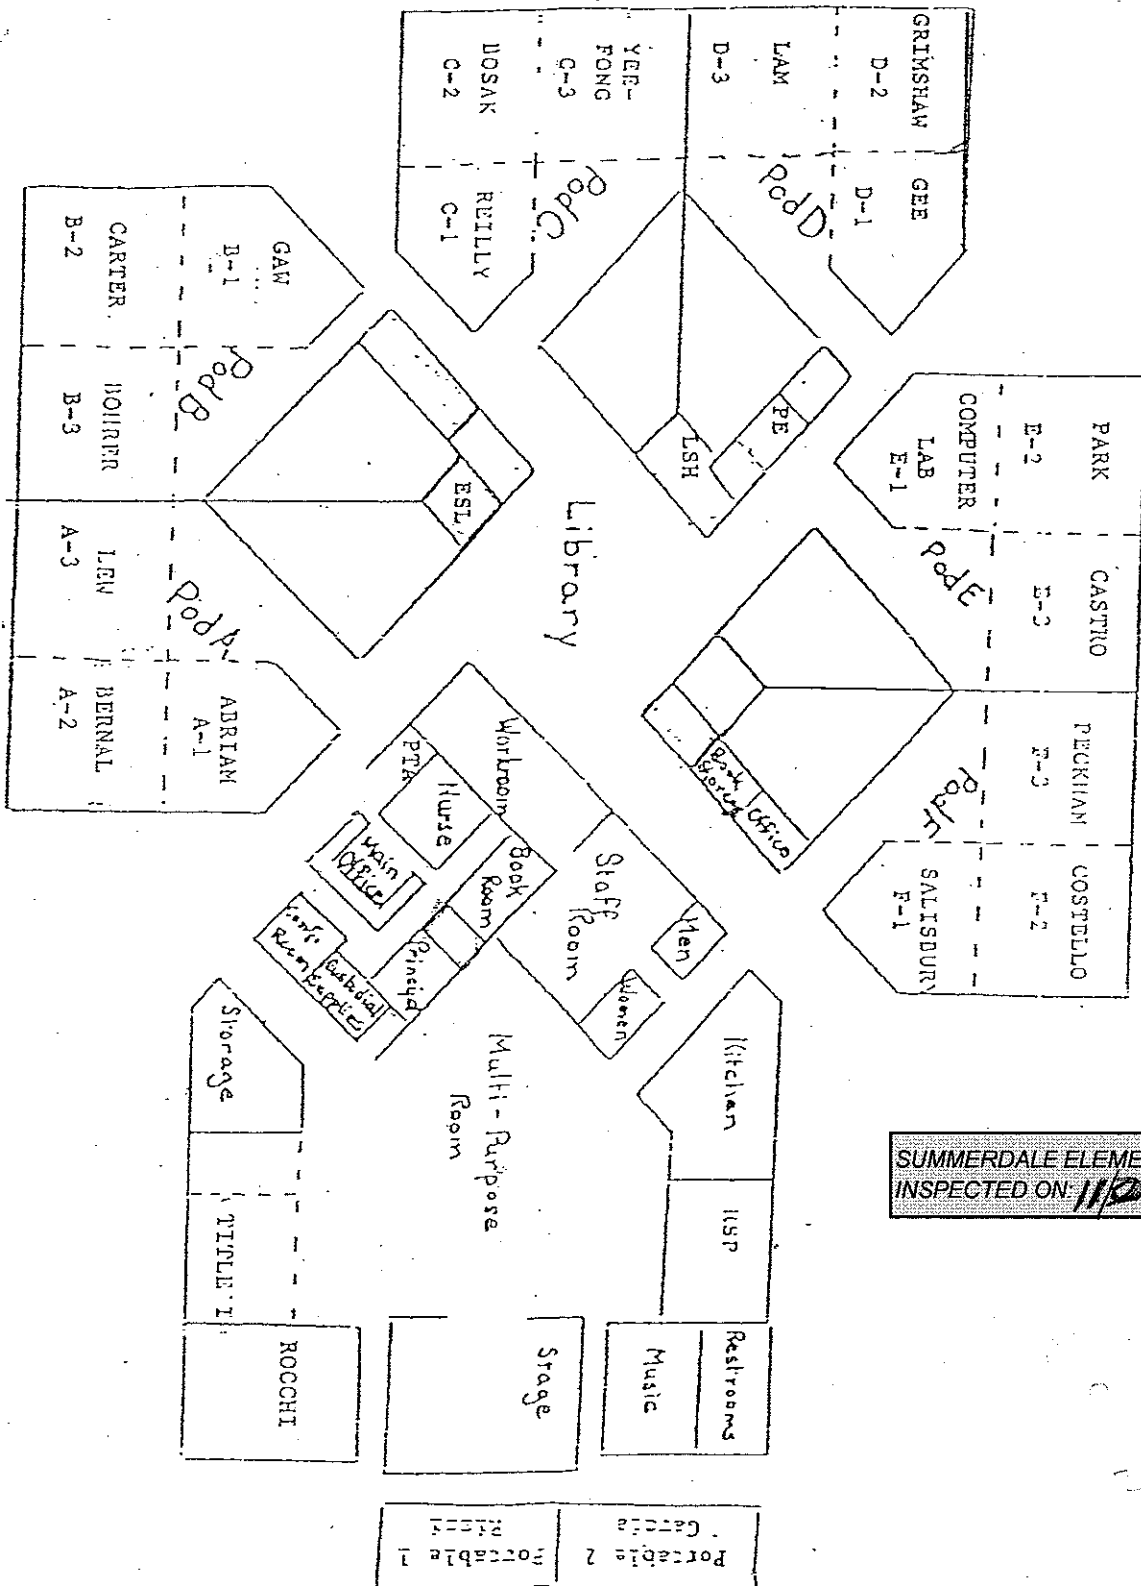


SUMMERDALE ELEMENTARY SCHOOL
INSPECTED ON 11/25/07

Portable 7	SMITH
Portable 6	WAGNER
Portable 5	GORT
Portable 4	SAUNDERS

Portable 3	HOPES
------------	-------

Portable 2	CARROLL
Portable 1	STOCK

SUMMERDALE ELEMENTARY SCHOOL
INSPECTED SEPTEMBER 2005

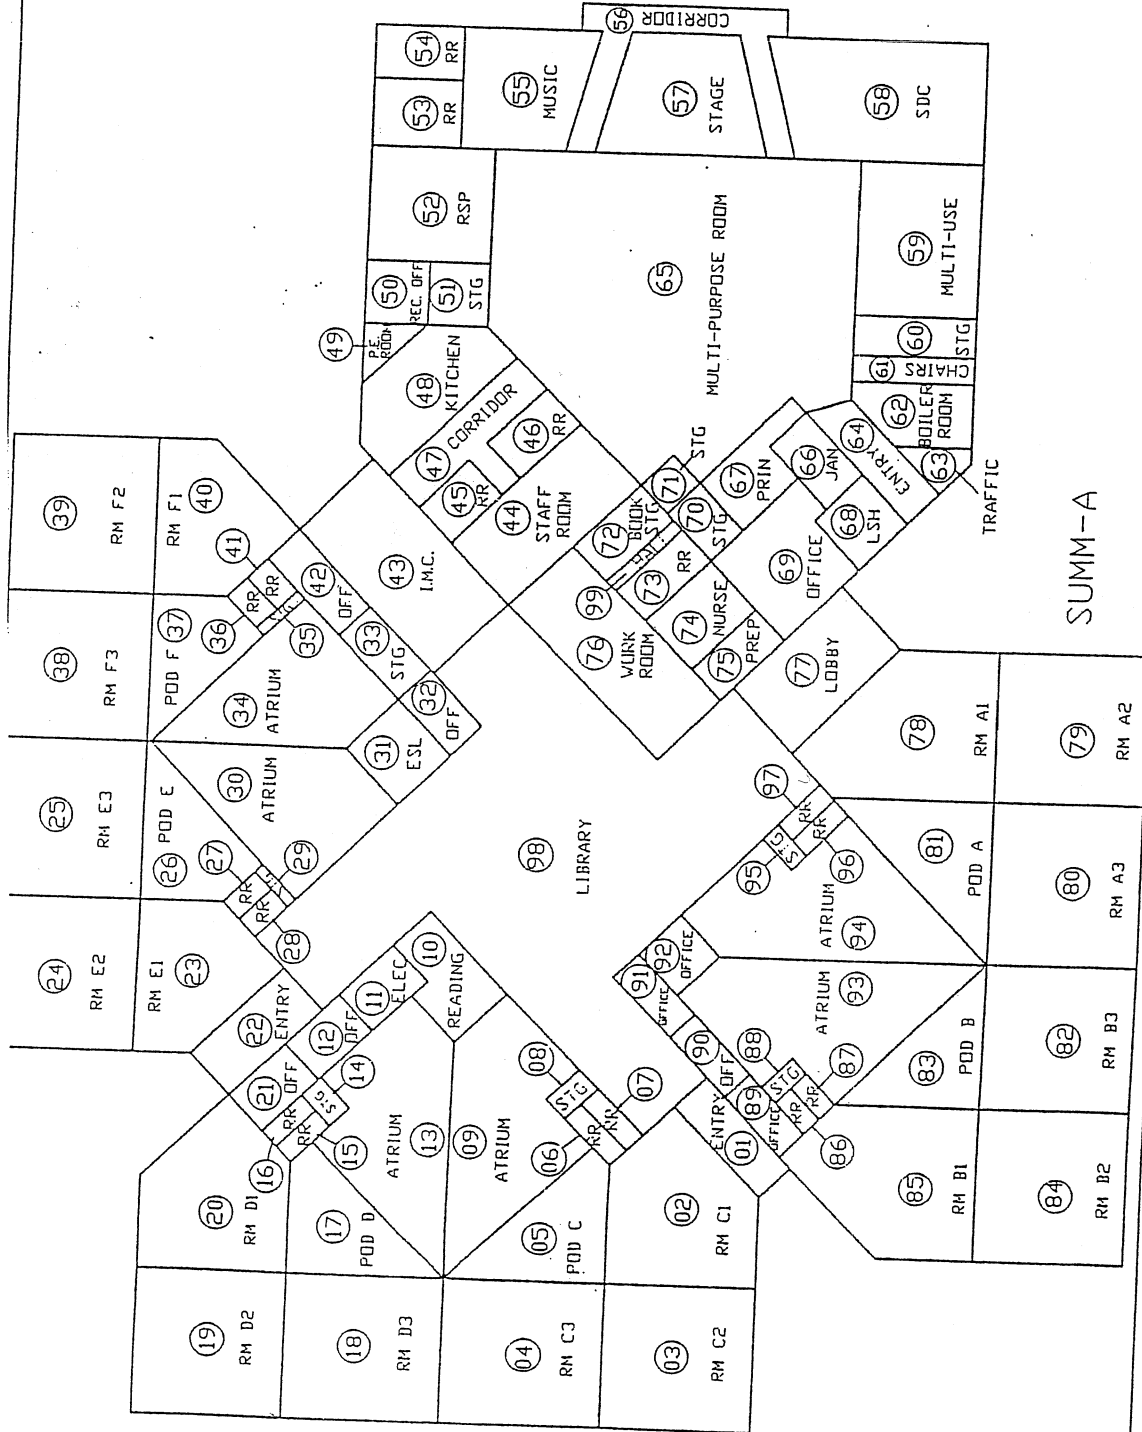

SUMM-P05
SUMM-P04

SUMM-P03

SUMM-P02
SUMM-P01



NOT TO SCALE

NAMING CONVENTION SITEPLAN

BERRYESSA UNIFIED
1376 PIEDMONT RD
SAN JOSE, CA 95132

SCHOOL NAME: SUMMERDALE ELEMENTARY
ADDRESS: 1100 SUMMERDALE DR.
SCHOOL DISTRICT: BERRYESSA UNIFIED

COUNTY: SANTA CLARA
ACREAGE: N/A
REV. DATE: 01/25/99

SUMM-A