

SIX-MONTH SURVEILLANCE AHERA REPORT

**RUSKIN ELEMENTARY SCHOOL
1401 TURLOCK LANE
SAN JOSE, CA 95132**

**PREPARED FOR:
BERRYESSA UNION ELEMENTARY SCHOOL DISTRICT
981 RIDDER PARK DRIVE
SAN JOSE, CA 95131**

**INSPECTED ON:
SEPTEMBER 17, 2025**

HAZMAT DOC PROJECT #25-101

**PREPARED BY:
HAZMAT DOC
3080 OLCOTT STREET • SUITE D135
SANTA CLARA, CA 95054
Tel: 408.748.0055**

BERRYESSA UNION ELEMENTARY SCHOOL DISTRICT
RUSKIN ELEMENTARY SCHOOL

INSPECTED ON:
SEPTEMBER 17, 2025

INSPECTED BY:



Leland Kafeyan
Cal/OSHA Certified Site Surveillance Technician
Certification Number 06-4110

REPORTED BY:



Maheen B. Doctor
Cal/OSHA Certified Asbestos Consultant
Certification Number 95-1798

CONTENTS

PART - I

LEGEND AND GLOSSARY OF TERMS

PART – II

AHERA REPORT A – LIST OF BUILDINGS

PART – III

AHERA REPORT B – SURVEY REPORT

PART – IV

HOMOGENEOUS MATERIALS REPORT

PART – V

FRIABLE LOCATIONS REPORT

PART – VI

NON-FRIABLE LOCATIONS REPORT

PART – VII

RECOMMENDATIONS REPORT

PART – VIII

SAMPLES REPORT

PART – IX

DAMAGE REPORT

PART - X

SITE MAPS

LEGEND

THE FOLLOWING IS A LIST OF ABBREVIATIONS USED IN THIS REPORT:

Asbestos Sample Types

AC	=	ACTINOLITE
AM	=	AMOSITE
AN	=	ANTHOPHYLLITE
CH	=	CHRYSTILE
CR	=	CROCIDOLITE
TR	=	TREMOLITE
ND	=	NONE DETECTED
NS	=	NO SAMPLE

Measurements

APPROX.	=	APPROXIMATELY
EA	=	EACH
I	=	INCHES
LF	=	LINEAR FEET
N	=	NUMBER
O.D.	=	OUTSIDE DIAMETER
SF	=	SQUARE FEET
TBD	=	TO BE DETERMINED

LIST OF BUILDINGS AT

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME	BUILDING AREA (APPROXIMATE)
BUILDING USED AS (#FLOORS) CONSTRUCTION	
ADMINISTRATION BUILDING	
Offices (1) Wood, Metal, Plaster, Gypsum Wallboard System, Concrete	1,200 SF
CLASSROOMS I1-I2 TECHNOLOGY PORTABLES BUILDING	
Classrooms (1) Wood, Metal, Plaster, Gypsum Wallboard System, Concrete	1,440 SF
CLASSROOMS J1 PORTABLE BUILDING (MUSIC ROOM)	
Classroom (1) Wood Frame, Metal, Preformed Material	960 SF
CLASSROOMS J2 PORTABLE BUILDING	
Classroom (1) Wood and Metal	960 SF
CLASSROOMS J3 PORTABLE BUILDING (GYM)	
Classroom (1) Wood and Metal Portable	960 SF
CLASSROOMS K1-K2 BUILDING	
Classrooms, Restrooms (1) Wood, Metal, Plaster, Gypsum Wallboard System, Concrete	3,100 SF
CLASSROOMS PODS A-F, LIBRARY, AND MULTI-PURPOSE ROOM BUILDING	
Classrooms, Library, Multi-Purpose Room, Lounge, Hallways, Mechanical Rooms (1.5) Wood, Metal, Plaster, Gypsum Wallboard System, Concrete	34,500 SF
CLASSROOMS PODS G-H, AND MUSIC BUILDING	
Classrooms (1) Wood, Metal, Plaster, Gypsum Wallboard System, Concrete	5,500 SF
CUSTODIAL SHED	
Storage (1) Wood, Metal, Concrete	350 SF
GARDEN SHED	
Storage (1) Wood	40 SF
KITCHEN, RESTROOMS AND STORAGE ROOMS BUILDING	
Kitchen, Lounge, Storage Rooms, Hallways, Mechanical Rooms, Restrooms (1) Wood, Metal, Plaster, Gypsum Wallboard System, Concrete	2,000 SF
METAL STORAGE CONTAINER (1 EA)	
Storage (1) Metal	336 SF
WOOD STORAGE SHED	
Storage (1) Wood	30 SF

LIST OF BUILDINGS AT

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME

BUILDING USED AS

(#FLOORS) CONSTRUCTION

BUILDING AREA

(APPROXIMATE)

Total Number Of Buildings : 13

(Approximate) Total Sq Ft. :

51,376

End Of Report, Total Of 2 Pages

SURVEY REPORT FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME	
LOCATION	
MATERIAL TYPE	QTY (APPROXIMATE)
COMMENTS	

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

ADMINISTRATION BUILDING

ADMINISTRATION BUILDING

09/12/2005	BUILDING NOTES:
09/12/2005	Existing Gypsum Wallboard Systems Removed and Replaced with new in-kind in Path-of-Construction. Existing Plaster Systems Removed and Replaced with new in-kind in Path-of-Construction. New Flooring Finishes per information received from the BUESD. New Suspended Ceiling Tiles installed.
04/17/2008	New Sinks with Thermal Undercoating installed in Health Office and Kitchenette.
02/14/2018	New Flooring Finishes installed Summer 2017 per information received from the BUESD. New Suspended Ceiling Tiles installed.

ADMINISTRATION BUILDING

ENTIRE BUILDING

FIRE DOOR CORE INSULATION 168 SF

02/18/2022	Fire Door Core Insulation. (8 EA Doors). This Material is in GOOD condition as of this date.
08/17/2022	This Material is unchanged as of this date.
02/15/2023	This Material is unchanged as of this date.
08/16/2023	This Material is unchanged as of this date.
02/14/2024	This Material is unchanged as of this date.
08/14/2024	This Material is unchanged as of this date.
02/27/2025	This Material is unchanged as of this date.
09/17/2025	This Material is unchanged as of this date.

22-025AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

ADMINISTRATION BUILDING

ENTIRE BUILDING

SMOOTH WALL MISCELLANEOUS 3,500 SF

09/12/2005	Gypsum Wallboard System Walls and Ceilings, (with Skim Coat, behind other finishes). Existing Gypsum Wallboard Systems Removed and Replaced with new in-kind in Path-of-Construction. This Material is in GOOD condition as of this date.
01/31/2020	This Material is unchanged as of this date.

SURVEY REPORT FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
08/28/2020	This Material is unchanged as of this date.		
02/10/2021	This Material is unchanged as of this date.		
08/11/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	This Material is unchanged as of this date.		
02/15/2023	This Material is unchanged as of this date.		
08/16/2023	This Material is unchanged as of this date.		
02/14/2024	This Material is unchanged as of this date.		
08/14/2024	This Material is unchanged as of this date.		
02/27/2025	This Material is unchanged as of this date.		
09/17/2025	This Material is unchanged as of this date.		
05-212AAA	ASSUMED	NO SAMPLE	(NS)

ADMINISTRATION BUILDING

ENTIRE BUILDING

SMOOTH WALL SURFACING

3,500 SF

08/24/2006	Skim Coat for Gypsum Wallboard System Walls and Ceilings, (behind other finishes). Existing Gypsum Wallboard Systems Removed and Replaced with new in-kind in Path-of-Construction. This Material is in GOOD condition as of this date.		
01/31/2020	This Material is unchanged as of this date.		
08/28/2020	This Material is unchanged as of this date.		
02/10/2021	This Material is unchanged as of this date.		
08/11/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	This Material is unchanged as of this date.		
02/15/2023	This Material is unchanged as of this date.		
08/16/2023	This Material is unchanged as of this date.		

SURVEY REPORT FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/14/2024 This Material is unchanged as of this date.

08/14/2024 This Material is unchanged as of this date.

02/27/2025 This Material is unchanged as of this date.

09/17/2025 This Material is unchanged as of this date.

06-223AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

ADMINISTRATION BUILDING

EXTERIOR WALLS AND OVERHANGS

ROUGH WALL

2,800 SF

09/12/2005 Stucco Walls and Overhangs. This Material is in good condition as of this date.

08/14/2019 Damages Observed. <5% Physical Damage in the form of 2 LF of cracks by Entry to Office. Material condition changed from GOOD to FAIR overall. Friability updated from Non-Friable to Friable. No other changes as of this date.

01/31/2020 This Material is unchanged as of this date.

08/28/2020 Additional Damage Observed. <5% Physical Damage in the form of 3 LF of Cracks on East Wall near Principal's Office. No other changes as of this date.

02/10/2021 Repairs observed. Damages repaired as of this date. Material Condition changed from FAIR to GOOD. No other changes as of this date.

08/11/2021 This Material is unchanged as of this date.

02/18/2022 This Material is unchanged as of this date.

08/17/2022 This Material is unchanged as of this date.

02/15/2023 This Material is unchanged as of this date.

08/16/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

08/14/2024 This Material is unchanged as of this date.

02/27/2025 This Material is unchanged as of this date.

09/17/2025 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

SURVEY REPORT FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME	
LOCATION	
MATERIAL TYPE	QTY (APPROXIMATE)
COMMENTS	

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

ADMINISTRATION BUILDING

EXTERIOR WALLS AND OVERHANGS

ROUGH WALL SURFACING 2,800 SF

09/12/2005	Skim Coat for Stucco Walls and Overhangs. This Material is in good condition as of this date.
08/14/2019	Damages Observed. <5% Physical Damage in the form of 2 LF of cracks by Entry to Office. Material condition changed from GOOD to FAIR overall. Friability updated from Non-Friable to Friable. No other changes as of this date.
01/31/2020	This Material is unchanged as of this date.
08/28/2020	Additional Damage Observed. <5% Physical Damage in the form of 3 LF of Cracks on East Wall near Principals Office. Material remains in FAIR condition overall. No other changes as of this date.
02/10/2021	Repairs observed. Damages repaired as of this date. Material Condition changed from FAIR to GOOD. No other changes as of this date.
08/11/2021	This Material is unchanged as of this date.
02/18/2022	This Material is unchanged as of this date.
08/17/2022	This Material is unchanged as of this date.
02/15/2023	This Material is unchanged as of this date.
08/16/2023	This Material is unchanged as of this date.
02/14/2024	This Material is unchanged as of this date.
08/14/2024	This Material is unchanged as of this date.
02/27/2025	This Material is unchanged as of this date.
09/17/2025	This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

ADMINISTRATION BUILDING

OFFICES, AND HALLWAY

VINYL WALL COVER MASTIC 2,200 SF

08/24/2006	Mastic/adhesive for Vinyl Wall Cover (over Gypsum Wallboard). This Material is in good condition as of this date.
01/31/2020	This Material is unchanged as of this date.

SURVEY REPORT FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
08/28/2020	This Material is unchanged as of this date.		
02/10/2021	This Material is unchanged as of this date.		
08/11/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	This Material is unchanged as of this date.		
02/15/2023	This Material is unchanged as of this date.		
08/16/2023	This Material is unchanged as of this date.		
02/14/2024	This Material is unchanged as of this date.		
08/14/2024	This Material is unchanged as of this date.		
02/27/2025	This Material is unchanged as of this date.		
09/17/2025	This Material is unchanged as of this date.		
06-223AAA	ASSUMED	NO SAMPLE	(NS)

SURVEY REPORT FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

CLASSROOMS I1-I2 TECHNOLOGY PORTABLES BUILDING

CLASSROOMS I1-I2 TECHNOLOGY PORTABLES BUILDING

03/06/2007 BUILDING NOTES:

03/06/2007 Manufacturer's Tag Info: By Saramrk, Inc.; Portable #'s 1002-008 & 1002-009; DSA/ORS# 69013; Serial# CA 9799000. No Manufacture Dates.

12/02/2011 Building Name changed from CLASSROOMS L1-L2 TECHNOLOGY BUILDING to CLASSROOMS I1-I2 TECHNOLOGY BUILDING.

CLASSROOMS I1-I2 TECHNOLOGY PORTABLES BUILDING

CLASSROOMS I1-I2

BASEBOARD MASTIC

180 LF

09/12/2005 Mastic/Adhesive for 4" Black and Blue Baseboard. This Material is in GOOD condition as of this date. (Original Entry updated on 09/03/10.)

03/07/2017 Sample 17-049-19 collected from Unit I, I2, White Mastic for Dark Blue 4" Baseboard.

01/31/2020 This Material is unchanged as of this date.

08/28/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/11/2021 This Material is unchanged as of this date.

02/18/2022 This Material is unchanged as of this date.

08/17/2022 This Material is unchanged as of this date.

02/15/2023 Additional Damage Observed. <5% Physical Damage in the form of 1 LF of Missing Baseboard and 1 LF Detached Baseboard with Gray Mastic Exposed in Southwest Corner of Classroom I2. Material remains in FAIR condition overall. No other changes as of this date.

08/08/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

08/14/2024 This Material is unchanged as of this date.

02/27/2025 This Material is unchanged as of this date.

SURVEY REPORT FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

09/17/2025 This Material is unchanged as of this date.

17-049-19	ND	NONE DETECTED	(ND)
05-212AAA	ASSUMED	NO SAMPLE	(NS)

CLASSROOMS I1-I2 TECHNOLOGY PORTABLES BUILDING

CLASSROOMS I1-I2

CARPET MASTIC

1,180 SF

09/12/2005 Mastic/Adhesive for Grey Carpet. This Material is in GOOD condition as of this date.

09/13/2016 Damage observed. Damage: <5% Physical Damage - approximately 10 LF in each room the Carpet is coming loose. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.

03/07/2017 Sample 17-049-18 collected from Unit I, I2, Yellow Mastic for Carpet on Concrete.

01/31/2020 This Material is unchanged as of this date.

08/28/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/11/2021 This Material is unchanged as of this date.

02/18/2022 This Material is unchanged as of this date.

08/17/2022 This Material is unchanged as of this date.

02/15/2023 Additional Damage Observed. <5% Physical Damage in the form of 8 SF of Wavy and Detatched Carpet in Various Locations in Classroom I2. No other changes as of this date.

08/08/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

08/14/2024 This Material is unchanged as of this date.

02/27/2025 This Material is unchanged as of this date.

09/17/2025 This Material is unchanged as of this date.

17-049-18	ND	NONE DETECTED	(ND)
05-212AAA	ASSUMED	NO SAMPLE	(NS)

SURVEY REPORT FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

CLASSROOMS I1-I2 TECHNOLOGY PORTABLES BUILDING

CLASSROOMS I1-I2

SMOOTH WALL MISCELLANEOUS

3,800 SF

08/24/2006	Gypsum Wallboard System, (with Vinyl Wall Cover). This Material is in GOOD condition as of this date.
01/31/2020	This Material is unchanged as of this date.
08/28/2020	This Material is unchanged as of this date.
02/08/2021	This Material is unchanged as of this date.
08/11/2021	This Material is unchanged as of this date.
02/18/2022	This Material is unchanged as of this date.
08/17/2022	This Material is unchanged as of this date.
02/15/2023	This Material is unchanged as of this date.
08/08/2023	This Material is unchanged as of this date.
02/14/2024	This Material is unchanged as of this date.
08/14/2024	This Material is unchanged as of this date.
02/27/2025	This Material is unchanged as of this date.
09/17/2025	This Material is unchanged as of this date.

06-223AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS I1-I2 TECHNOLOGY PORTABLES BUILDING

CLASSROOMS I1-I2

SUSPENDED CEILING TILE

1,824 SF

09/12/2005	2'x 4' White Suspended Ceiling Tiles, with Gouged and Pin Hole Pattern. This Material is in GOOD condition as of this date. (Original entry updated 03/17/15).
12/02/2011	Damage: <10% Water Damage - in the form of 1 Tile Water Damaged in Classroom I2; <5% Physical Damage - in the form of 2 Tiles loose in Classroom I1. Material condition changed from GOOD to FAIR overall as of this date. No other changes as of this date.
03/21/2016	Material Quantity Re-Assessed. Material Quantity changed from 1,440 SF to 1,824 SF. No other changes as of this date.

SURVEY REPORT FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
03/29/2017	Additional Damage Observed. 3 Tiles with Water Damage in Classroom I2. Both Classrooms have several Tiles with Broken and Chipped Edges. No other changes as of this date.		
02/14/2018	Additional Damage Observed. 2 Tiles have Water Damage in Classroom I1. No oter changes as of this date.		
01/31/2020	This Material is unchanged as of this date.		
08/28/2020	This Material is unchanged as of this date.		
02/08/2021	This Material is unchanged as of this date.		
08/11/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	This Material is unchanged as of this date.		
02/15/2023	This Material is unchanged as of this date.		
08/08/2023	This Material is unchanged as of this date.		
02/14/2024	This Material is unchanged as of this date.		
08/14/2024	This Material is unchanged as of this date.		
02/27/2025	This Material is unchanged as of this date.		
09/17/2025	This Material is unchanged as of this date.		
05-212AAA	ASSUMED	NO SAMPLE	(NS)

CLASSROOMS I1-I2 TECHNOLOGY PORTABLES BUILDING

CLASSROOMS I1-I2

VINYL WALL COVER MASTIC

3,800 SF

08/24/2006	Mastic/Adhesive for Vinyl Wall Cover (on Gypsum Wallboard System). This Material is in GOOD condition as of this date.		
01/31/2020	This Material is unchanged as of this date.		
08/28/2020	This Material is unchanged as of this date.		
02/08/2021	This Material is unchanged as of this date.		
08/11/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		

SURVEY REPORT FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME	
LOCATION	
MATERIAL TYPE	QTY (APPROXIMATE)
COMMENTS	

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
-------------------	-------------------------	----------------------	----------------------

08/17/2022 This Material is unchanged as of this date.

02/15/2023 This Material is unchanged as of this date.

08/08/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

08/14/2024 This Material is unchanged as of this date.

02/27/2025 This Material is unchanged as of this date.

09/17/2025 This Material is unchanged as of this date.

06-223AAA	ASSUMED	NO SAMPLE	(NS)
------------------	----------------	------------------	---------------

CLASSROOMS I1-I2 TECHNOLOGY PORTABLES BUILDING

CLASSROOMS I1-I2 WET / SINK AREAS, AND ENTRYWAYS

VINYL FLOOR TILE

260 SF

09/12/2005 12"x 12" Off-White Vinyl Floor Tile. This Material is in GOOD condition as of this date.

12/02/2011 Damage: <5% Physical Damage - in the form of 3 Vinyl Floor Tiles are broken and cracked next to Entry Door. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.

09/13/2016 Additional Damage Observed. 8 Tiles near the Sink area in I-2 are Water Damaged. There are also 2 cracked Tiles in the Doorway of I-1. No other changes as of this date.

02/14/2018 Additional Damage Observed. 3 Tiles Cracked in the Doorway of I1. No other changes as of this date.

01/31/2020 This Material is unchanged as of this date.

08/28/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/11/2021 This Material is unchanged as of this date.

02/18/2022 This Material is unchanged as of this date.

08/17/2022 This Material is unchanged as of this date.

02/15/2023 This Material is unchanged as of this date.

08/08/2023 This Material is unchanged as of this date.

SURVEY REPORT FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/14/2024 This Material is unchanged as of this date.

08/14/2024 This Material is unchanged as of this date.

02/27/2025 This Material is unchanged as of this date.

09/17/2025 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS I1-I2 TECHNOLOGY PORTABLES BUILDING

CLASSROOMS I1-I2 WET / SINK AREAS, AND ENTRYWAYS

VINYL FLOOR TILE MASTIC

260 SF

09/12/2005 Mastic/Adhesive for 12"x 12" Off-White Vinyl Floor Tile. This Material is in GOOD condition as of this date.

12/02/2011 Damage: <5% Physical Damage - in the form of 3 Vinyl Floor Tiles are broken and cracked next to Entry Door. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.

09/13/2016 Additional Damage Observed. 8 Tiles near the Sink area in I-2 are Water Damaged. There are also 2 cracked Tiles in the Doorway of I-1. No other changes as of this date.

02/14/2018 Additional Damage Observed. 3 Tiles Cracked in the Dooryway of I1. No other changes as of this date.

01/31/2020 This Material is unchanged as of this date.

08/28/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/11/2021 This Material is unchanged as of this date.

02/18/2022 This Material is unchanged as of this date.

08/17/2022 This Material is unchanged as of this date.

02/15/2023 This Material is unchanged as of this date.

08/08/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

08/14/2024 This Material is unchanged as of this date.

02/27/2025 This Material is unchanged as of this date.

09/17/2025 This Material is unchanged as of this date.

SURVEY REPORT FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME	
LOCATION	
MATERIAL TYPE	QTY (APPROXIMATE)
COMMENTS	

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS 11-12 TECHNOLOGY PORTABLES BUILDING

EXTERIOR WALLS

ROUGH WALL 2,600 SF

09/12/2005 Stucco Walls. This Material is in GOOD condition as of this date.

01/31/2020 This Material is unchanged as of this date.

08/11/2021 This Material is unchanged as of this date.

02/18/2022 This Material is unchanged as of this date.

08/17/2022 This Material is unchanged as of this date.

02/15/2023 This Material is unchanged as of this date.

08/08/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

08/14/2024 This Material is unchanged as of this date.

02/27/2025 This Material is unchanged as of this date.

09/17/2025 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS 11-12 TECHNOLOGY PORTABLES BUILDING

EXTERIOR WALLS

ROUGH WALL SURFACING 2,600 SF

09/12/2005 Skim Coat for Stucco Walls. This Material is in GOOD condition as of this date.

01/31/2020 This Material is unchanged as of this date.

08/11/2021 This Material is unchanged as of this date.

02/18/2022 This Material is unchanged as of this date.

08/17/2022 This Material is unchanged as of this date.

02/15/2023 This Material is unchanged as of this date.

08/08/2023 This Material is unchanged as of this date.

SURVEY REPORT FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
02/14/2024	This Material is unchanged as of this date.		
08/14/2024	This Material is unchanged as of this date.		
02/27/2025	This Material is unchanged as of this date.		
09/17/2025	This Material is unchanged as of this date.		
05-212AAA	ASSUMED	NO SAMPLE	(NS)

SURVEY REPORT FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

CLASSROOMS J1 PORTABLE BUILDING (MUSIC ROOM)

CLASSROOMS J1 PORTABLE BUILDING (MUSIC ROOM)

09/18/2015 BUILDING NOTES:

09/18/2015 Tag information is painted over.

CLASSROOMS J1 PORTABLE BUILDING (MUSIC ROOM)

CLASSROOM J-1 MUSIC ROOM

BASEBOARD MASTIC

121 LF

09/18/2015 Mastic/Adhesive for 4" Black Baseboard. This Material is in GOOD condition as of this date.

03/07/2017 Sample 17-049-21 collected from Unit J, J1, White Mastic for Brown 4" Baseboard.

01/31/2020 This Material is unchanged as of this date.

08/28/2020 This Material is unchanged as of this date.

02/10/2021 This Material is unchanged as of this date.

08/11/2021 This Material is unchanged as of this date.

02/18/2022 This Material is unchanged as of this date.

08/17/2022 This Material is unchanged as of this date.

02/15/2023 This Material is unchanged as of this date.

08/08/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

08/14/2024 This Material is unchanged as of this date.

02/27/2025 This Material is unchanged as of this date.

09/17/2025 This Material is unchanged as of this date.

15-174AAA	ASSUMED	NO SAMPLE	(NS)
17-049-21	ND	NONE DETECTED	(ND)

SURVEY REPORT FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME	
LOCATION	
MATERIAL TYPE	QTY (APPROXIMATE)
COMMENTS	

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

CLASSROOMS J1 PORTABLE BUILDING (MUSIC ROOM)

CLASSROOM J-1 MUSIC ROOM

CARPET MASTIC

960 SF

09/18/2015	Mastic/Adhesive for Gray Black Carpet (Original Enty Updated 8/17/22). This Material is in GOOD condition as of this date.
03/07/2017	Sample 17-049-20 collected from Unit J, J1, Yellow Mastic for Carpet on Wood.
01/31/2020	This Material is unchanged as of this date.
08/28/2020	This Material is unchanged as of this date.
02/10/2021	This Material is unchanged as of this date.
08/11/2021	This Material is unchanged as of this date.
02/18/2022	This Material is unchanged as of this date.
08/17/2022	Material Re-Assessed. Material not observed, Material may exist behind current Gray Black Carpet. No other changes as of this date.
02/15/2023	This Material is unchanged as of this date.
08/08/2023	This Material is unchanged as of this date.
02/14/2024	This Material is unchanged as of this date.
08/14/2024	This Material is unchanged as of this date.
02/27/2025	This Material is unchanged as of this date.
09/17/2025	This Material is unchanged as of this date.

15-174AAA	ASSUMED	NO SAMPLE	(NS)
17-049-20	ND	NONE DETECTED	(ND)

CLASSROOMS J1 PORTABLE BUILDING (MUSIC ROOM)

CLASSROOM J-1 MUSIC ROOM

FIRE DOOR CORE INSULATION

21 SF

09/18/2015	Fire Door Core Insulation (1 EA Doors). This Material is in GOOD condition as of this date.
01/31/2020	This Material is unchanged as of this date.
08/28/2020	This Material is unchanged as of this date.

SURVEY REPORT FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/10/2021 This Material is unchanged as of this date.

08/11/2021 This Material is unchanged as of this date.

02/18/2022 This Material is unchanged as of this date.

08/17/2022 This Material is unchanged as of this date.

02/15/2023 This Material is unchanged as of this date.

08/08/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

08/14/2024 This Material is unchanged as of this date.

02/27/2025 This Material is unchanged as of this date.

09/17/2025 This Material is unchanged as of this date.

15-174AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS J1 PORTABLE BUILDING (MUSIC ROOM)

CLASSROOM J-1 MUSIC ROOM

PRESSED WOOD WALL PANEL MASTIC

1,050 SF

09/18/2015 Mastic/Adhesive for 4'x9' Pressed Wood Wall Panel, (with Vinyl Wall Cover). This Material is in GOOD condition as of this date.

08/08/2018 Damage Observed. <5% Physical Damage - in the form of Small Holes and Tears in Scattered Locations to Wall System. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.

01/31/2020 This Material is unchanged as of this date.

08/28/2020 This Material is unchanged as of this date.

02/10/2021 This Material is unchanged as of this date.

08/11/2021 This Material is unchanged as of this date.

02/18/2022 This Material is unchanged as of this date.

08/17/2022 This Material is unchanged as of this date.

02/15/2023 This Material is unchanged as of this date.

08/08/2023 This Material is unchanged as of this date.

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

16

HazMat Doc

AHERA Report B - Survey

SURVEY REPORT FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/14/2024 This Material is unchanged as of this date.

08/14/2024 This Material is unchanged as of this date.

02/27/2025 This Material is unchanged as of this date.

09/17/2025 This Material is unchanged as of this date.

15-174AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS J1 PORTABLE BUILDING (MUSIC ROOM)

CLASSROOM J-1 MUSIC ROOM

PRESSED-WOOD WALL PANEL

1,050 SF

09/18/2015 4'x9 Pressed Wood Wall Panel, (with Vinyl Wall Cover). This Material is in GOOD condition as of this date.

08/08/2018 Damage Observed. <5% Physical Damage - in the form of Small Holes and Tears in Scattered Locations to Wall System. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.

01/31/2020 This Material is unchanged as of this date.

08/28/2020 This Material is unchanged as of this date.

02/10/2021 This Material is unchanged as of this date.

08/11/2021 This Material is unchanged as of this date.

02/18/2022 This Material is unchanged as of this date.

08/17/2022 This Material is unchanged as of this date.

02/15/2023 This Material is unchanged as of this date.

08/08/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

08/14/2024 This Material is unchanged as of this date.

02/27/2025 This Material is unchanged as of this date.

09/17/2025 This Material is unchanged as of this date.

15-174AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

SURVEY REPORT FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

CLASSROOMS J1 PORTABLE BUILDING (MUSIC ROOM)

CLASSROOM J-1 MUSIC ROOM

SUSPENDED CEILING TILE

960 SF

09/18/2015	2'x4' Vinyl Covered Fiberglass Suspended Ceiling Tile. This Material is in GOOD condition as of this date.		
03/29/2017	Damage Observed. <5% Physical Damage - in the form of 1 Tile is Warped, 2 Tiles have loose Vinyl and 11 Tiles have dark stains. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.		
08/29/2017	Additional Damaged Observed. 5 Tiles now have Loose Vinyl. No other changes as of this date.		
01/31/2020	This Material is unchanged as of this date.		
08/28/2020	This Material is unchanged as of this date.		
02/10/2021	This Material is unchanged as of this date.		
08/11/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	This Material is unchanged as of this date.		
02/15/2023	This Material is unchanged as of this date.		
08/08/2023	This Material is unchanged as of this date.		
02/14/2024	This Material is unchanged as of this date.		
08/14/2024	This Material is unchanged as of this date.		
02/27/2025	This Material is unchanged as of this date.		
09/17/2025	This Material is unchanged as of this date.		

15-174AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS J1 PORTABLE BUILDING (MUSIC ROOM)

CLASSROOM J-1 MUSIC ROOM

VINYL WALL COVER

1,050 SF

09/18/2015	Vinyl Wall Cover, (on 4'x9' Pressed Wood Wall Panel). This Material is in GOOD condition as of this date.		
08/08/2018	Damage Observed. <5% Physical Damage - in the form of Small Holes and Tears in Scattered Locations to Wall System. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.		

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

18

HazMat Doc

AHERA Report B - Survey

SURVEY REPORT FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
01/31/2020	This Material is unchanged as of this date.		
08/28/2020	This Material is unchanged as of this date.		
02/10/2021	This Material is unchanged as of this date.		
08/11/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	This Material is unchanged as of this date.		
02/15/2023	This Material is unchanged as of this date.		
08/08/2023	This Material is unchanged as of this date.		
02/14/2024	This Material is unchanged as of this date.		
08/14/2024	This Material is unchanged as of this date.		
02/27/2025	This Material is unchanged as of this date.		
09/17/2025	This Material is unchanged as of this date.		
15-174AAA	ASSUMED	NO SAMPLE	(NS)

CLASSROOMS J1 PORTABLE BUILDING (MUSIC ROOM)

CLASSROOM J-1 MUSIC ROOM

VINYL WALL COVER MASTIC

1,050 SF

09/18/2015	Mastic/Adhesive for Vinyl Wall Cover, (on 4'x9' Pressed Wood Wall Panel). This Material is in GOOD condition as of this date.
01/31/2020	This Material is unchanged as of this date.
08/28/2020	This Material is unchanged as of this date.
02/10/2021	This Material is unchanged as of this date.
08/11/2021	This Material is unchanged as of this date.
02/18/2022	This Material is unchanged as of this date.
08/17/2022	This Material is unchanged as of this date.
02/15/2023	This Material is unchanged as of this date.
08/08/2023	This Material is unchanged as of this date.

SF= Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR
RUSKIN ELEMENTARY SCHOOL

BUILDING NAME	
LOCATION	
MATERIAL TYPE	QTY (APPROXIMATE)
COMMENTS	

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/14/2024	This Material is unchanged as of this date.
08/14/2024	This Material is unchanged as of this date.
02/27/2025	This Material is unchanged as of this date.
09/17/2025	This Material is unchanged as of this date.

15-174AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

SURVEY REPORT FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME	
LOCATION	
MATERIAL TYPE	QTY (APPROXIMATE)
COMMENTS	

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

CLASSROOMS J2 PORTABLE BUILDING

CLASSROOMS J2 PORTABLE BUILDING

03/07/2015 BUILDING INFORMATION:

10/11/2012 By American Modular System; Date 01-12; DSA #01-112364; Serial #'s 12-812-001A, 12-812-001B.
This entry for informational and tracking purposes.

CLASSROOMS J2 PORTABLE BUILDING

PORTABLE J2

PORTABLE BUILDING

960 SF

10/11/2012 New 2012 Construction Relocatable Building per Manufacturer's Tag information.

01/31/2020 This Material is unchanged as of this date.

08/28/2020 This Material is unchanged as of this date.

02/10/2021 This Material is unchanged as of this date.

08/11/2021 This Material is unchanged as of this date.

02/18/2022 This Material is unchanged as of this date.

08/17/2022 This Material is unchanged as of this date.

02/15/2023 This Material is unchanged as of this date.

08/16/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

08/14/2024 This Material is unchanged as of this date.

02/27/2025 This Material is unchanged as of this date.

09/17/2025 This Material is unchanged as of this date.

12-185.NS	NEW	NO SAMPLE	(NS)
-----------	-----	-----------	--------

SURVEY REPORT FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

CLASSROOMS J3 PORTABLE BUILDING (GYM)

CLASSROOMS J3 PORTABLE BUILDING (GYM)

09/12/2005 BUILDING NOTES:

09/12/2005 MANUFACTURER'S TAG INFO: BY ENVIROPLEX INC; DATE: 2003; JOB# 03-010; OSA# 02105136; SERIAL# 6364, 6365. This entry for informational and tracking purposes.

CLASSROOMS J3 PORTABLE BUILDING (GYM)

PORTABLE J3

PORTABLE BUILDING

960 SF

09/12/2005 New 2003 Construction Relocatable Building per Manufacturer's Tag information.

01/31/2020 This Material is unchanged as of this date.

08/28/2020 This Material is unchanged as of this date.

02/10/2021 This Material is unchanged as of this date.

08/11/2021 This Material is unchanged as of this date.

02/18/2022 This Material is unchanged as of this date.

08/17/2022 This Material is unchanged as of this date.

02/15/2023 This Material is unchanged as of this date.

08/16/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

08/14/2024 This Material is unchanged as of this date.

02/27/2025 This Material is unchanged as of this date.

09/17/2025 This Material is unchanged as of this date.

05-212.NS	NEW	NO SAMPLE	(NS)
-----------	-----	-----------	--------

SURVEY REPORT FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME	
LOCATION	
MATERIAL TYPE	
COMMENTS	QTY (APPROXIMATE)

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

CLASSROOMS K1-K2 BUILDING

CLASSROOMS K1-K2 BUILDING

09/12/2005	BUILDING NOTES:
09/12/2005	Existing Gypsum Wallboard Systems Removed and Replaced with new in-kind in Path-of-Construction. Existing Plaster Systems Removed and Replaced with new in-kind in Path-of-Construction. New Flooring Finishes per information received from the BUESD.
10/17/2008	New Sinks with Thermal Undercoating installed. New Ceramic Floor Tiles installed in Restrooms and Classrooms Wet Areas per information received from BUESD. New Ceramic Wall Tiles installed in Restrooms.
02/14/2018	New Flooring Finishes installed Summer 2017 per information received from the BUESD.

CLASSROOMS K1-K2 BUILDING

CLASSROOMS, STORAGE ROOMS, AND RESTROOMS

SMOOTH WALL MISCELLANEOUS 5,910 SF

09/12/2005	Gypsum Wallboard System Walls and Ceilings, (with Skim Coat, behind other finishes). Existing Gypsum Wallboard Systems Removed and Replaced with new in-kind in Path-of-Construction. This Material is in GOOD condition as of this date.
01/31/2020	This Material is unchanged as of this date.
08/28/2020	This Material is unchanged as of this date.
02/10/2021	This Material is unchanged as of this date.
08/11/2021	This Material is unchanged as of this date.
02/18/2022	This Material is unchanged as of this date.
08/17/2022	Partial Repairs Observed. All Damages have been Repaired except in Custodial Closet. Material remains in FAIR condition overall. No other changes as of this date.
02/15/2023	This Material is unchanged as of this date.
02/14/2024	This Material is unchanged as of this date.
08/14/2024	This Material is unchanged as of this date.
02/27/2025	This Material is unchanged as of this date.
09/17/2025	This Material is unchanged as of this date.

SURVEY REPORT FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
05-212AAA	ASSUMED	NO SAMPLE	(NS)

CLASSROOMS K1-K2 BUILDING

CLASSROOMS, STORAGE ROOMS, AND RESTROOMS

SMOOTH WALL SURFACING

5,910 SF

08/24/2006	Skim Coat for Gypsum Wallboard System Walls and Ceilings, (behind other finishes). Existing Gypsum Wallboard Systems Removed and Replaced with new in-kind in Path-of-Construction. This Material is in GOOD condition as of this date.
01/31/2020	This Material is unchanged as of this date.
08/28/2020	This Material is unchanged as of this date.
02/10/2021	This Material is unchanged as of this date.
08/11/2021	This Material is unchanged as of this date.
02/18/2022	This Material is unchanged as of this date.
08/17/2022	Partial Repairs Observed. All Damages have been Repaired except in Custodial Closet. Material remains in FAIR condition overall. No other changes as of this date.
02/15/2023	This Material is unchanged as of this date.
02/14/2024	This Material is unchanged as of this date.
08/14/2024	This Material is unchanged as of this date.
02/27/2025	This Material is unchanged as of this date.
09/17/2025	This Material is unchanged as of this date.

06-223AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS K1-K2 BUILDING

ENTIRE BUILDING

FIRE DOOR CORE INSULATION

189 SF

09/12/2005	Fire Door Core Insulation. (9 EA). This Material is in GOOD condition as of this date.
01/31/2020	This Material is unchanged as of this date.
08/28/2020	This Material is unchanged as of this date.
02/10/2021	This Material is unchanged as of this date.
08/11/2021	This Material is unchanged as of this date.

SF= Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/18/2022 This Material is unchanged as of this date.

08/17/2022 This Material is unchanged as of this date.

02/15/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

08/14/2024 This Material is unchanged as of this date.

02/27/2025 This Material is unchanged as of this date.

09/17/2025 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS K1-K2 BUILDING

EXTERIOR WALLS AND OVERHANGS

ROUGH WALL

4,400 SF

09/12/2005 Stucco Walls and Overhangs. This Material is in GOOD condition as of this date.

01/31/2020 This Material is unchanged as of this date.

08/28/2020 This Material is unchanged as of this date.

02/10/2021 This Material is unchanged as of this date.

08/11/2021 This Material is unchanged as of this date.

02/18/2022 This Material is unchanged as of this date.

08/17/2022 This Material is unchanged as of this date.

02/15/2023 This Material is unchanged as of this date.

08/14/2024 This Material is unchanged as of this date.

02/27/2025 This Material is unchanged as of this date.

09/17/2025 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

SURVEY REPORT FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

CLASSROOMS K1-K2 BUILDING

EXTERIOR WALLS AND OVERHANGS

ROUGH WALL SURFACING

4,400 SF

09/12/2005 Skim Coat for Stucco Walls and Overhangs. This Material is in GOOD condition as of this date.

01/31/2020 This Material is unchanged as of this date.

08/28/2020 This Material is unchanged as of this date.

02/10/2021 This Material is unchanged as of this date.

08/11/2021 This Material is unchanged as of this date.

02/18/2022 This Material is unchanged as of this date.

08/17/2022 This Material is unchanged as of this date.

02/15/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

08/14/2024 This Material is unchanged as of this date.

02/27/2025 This Material is unchanged as of this date.

09/17/2025 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS K1-K2 BUILDING

K1 AND K2 CLASSROOMS

CEMENTITIOUS WINDOW PANEL

40 SF

09/12/2005 Cementitious Window Panels. This Material is in good condition as of this date.

01/31/2020 This Material is unchanged as of this date.

08/28/2020 This Material is unchanged as of this date.

02/10/2021 This Material is unchanged as of this date.

08/11/2021 This Material is unchanged as of this date.

02/18/2022 This Material is unchanged as of this date.

08/17/2022 This Material is unchanged as of this date.

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/15/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

08/14/2024 This Material is unchanged as of this date.

02/27/2025 This Material is unchanged as of this date.

09/17/2025 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS K1-K2 BUILDING

K1 AND K2 CLASSROOMS

PRESSED WOOD WALL PANEL

3,200 SF

09/12/2005 4'x 10' Pressed Wood Wall Panels, (with Vinyl Wall Cover and Joint Compound). This Material is in GOOD condition as of this date.

01/31/2020 This Material is unchanged as of this date.

08/28/2020 This Material is unchanged as of this date.

02/10/2021 This Material is unchanged as of this date.

08/11/2021 This Material is unchanged as of this date.

02/18/2022 This Material is unchanged as of this date.

08/17/2022 This Material is unchanged as of this date.

02/15/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

08/14/2024 This Material is unchanged as of this date.

02/27/2025 This Material is unchanged as of this date.

09/17/2025 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

SURVEY REPORT FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME	
LOCATION	
MATERIAL TYPE	QTY (APPROXIMATE)
COMMENTS	

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

CLASSROOMS K1-K2 BUILDING

K1 AND K2 CLASSROOMS

PRESSED WOOD WALL PANEL MASTIC 3,200 SF

05/14/2009	Mastic/Adhesive for 4'x 10' Pressed Wood Wall Panels, (with Vinyl Wall Cover and Joint Compound). This Material is in GOOD condition as of this date.
01/31/2020	This Material is unchanged as of this date.
08/28/2020	This Material is unchanged as of this date.
02/10/2021	This Material is unchanged as of this date.
08/11/2021	This Material is unchanged as of this date.
02/18/2022	This Material is unchanged as of this date.
08/17/2022	This Material is unchanged as of this date.
02/15/2023	This Material is unchanged as of this date.
02/14/2024	This Material is unchanged as of this date.
08/14/2024	This Material is unchanged as of this date.
02/27/2025	This Material is unchanged as of this date.
09/17/2025	This Material is unchanged as of this date.

09-098AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS K1-K2 BUILDING

K1 AND K2 CLASSROOMS

VINYL WALL COVER MASTIC 3,200 SF

09/12/2005	Mastic/Adhesive for Vinyl Wall Cover on 4'x 10' Pressed Wood Wall Panels, (with Joint Compound). This Material is in GOOD condition as of this date.
01/31/2020	This Material is unchanged as of this date.
08/28/2020	This Material is unchanged as of this date.
02/10/2021	This Material is unchanged as of this date.
08/11/2021	This Material is unchanged as of this date.
02/18/2022	This Material is unchanged as of this date.

SURVEY REPORT FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
08/17/2022	This Material is unchanged as of this date.		
02/15/2023	This Material is unchanged as of this date.		
02/14/2024	This Material is unchanged as of this date.		
08/14/2024	This Material is unchanged as of this date.		
02/27/2025	This Material is unchanged as of this date.		
09/17/2025	This Material is unchanged as of this date.		
05-212AAA	ASSUMED	NO SAMPLE	(NS)

SURVEY REPORT FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

CLASSROOMS PODS A-F, LIBRARY, AND MULTI-PURPOSE ROOM BUILDING

CLASSROOMS PODS A-F, LIBRARY, AND MULTI-PURPOSE ROOM BUILDING

03/06/2007 BUILDING NOTES:

03/06/2007 Building Name changed from CLASSROOMS IN PODS A-F, LIBRARY, AND MULTI-PURPOSE ROOM to CLASSROOMS PODS A-F, LIBRARY, AND MULTI-PURPOSE ROOM BUILDING. No other changes as of this date.

10/17/2008 New Sinks with Thermal Undercoating installed in CLASSROOMS IN PODS A-F, TEACHER LOUNGE, AND LIBRARY OFFICE. New Ceramic Wall Tiles installed in Restrooms per information received from BUESD. New Ceramic Floor Tiles installed in ALL CLASSROOMS, WET AREAS, ENTRY AREAS, AND RESTROOMS FLOORS.

CLASSROOMS PODS A-F, LIBRARY, AND MULTI-PURPOSE ROOM BUILDING

BOOK STORAGE / ELECTRICAL ROOM, AND CUSTODIAL ROOM

VINYL FLOOR TILE

240 SF

09/12/2005 9"x 9" Vinyl Floor Tile. This Material is in GOOD condition as of this date.

08/24/2006 <5% Physical Damage. 1 tile is missing and 2 are chipped in Custodian Closet. Friability changed from NON to FRIABLE. Material Condition changed from GOOD to FAIR overall. No other changes as of this date.

03/06/2007 Additional Damage in the form of approximately 2 Tiles are missing. 5 other Tiles are chipped in both rooms. No other changes as of this date.

12/02/2011 Location Description changed from ELECTRICAL ROOM, AND CUSTODIAL ROOM to BOOK STORAGE / ELECTRICAL ROOM, AND CUSTODIAL ROOM. Additional Damage observed - in the form of 1 Tile is broken in Custodial Room, and 2 Tiles broken in Book Storage/Electrical Room with Black Mastic/Adhesive exposed. No other changes as of this date.

01/31/2020 This Material is unchanged as of this date.

08/28/2020 This Material is unchanged as of this date.

02/10/2021 This Material is unchanged as of this date.

08/11/2021 This Material is unchanged as of this date.

02/18/2022 This Material is unchanged as of this date.

08/17/2022 This Material is unchanged as of this date.

02/15/2023 This Material is unchanged as of this date.

02/15/2023 This Material is unchanged as of this date.

SURVEY REPORT FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

08/16/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

08/14/2024 This Material is unchanged as of this date.

02/27/2025 This Material is unchanged as of this date.

09/17/2025 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS PODS A-F, LIBRARY, AND MULTI-PURPOSE ROOM BUILDING

BOOK STORAGE / ELECTRICAL ROOM, AND CUSTODIAL ROOM

VINYL FLOOR TILE MASTIC

240 SF

09/12/2005 Mastic/Adhesive for 9"x 9" Vinyl Floor Tile. This Material is in GOOD condition as of this date.

08/24/2006 <5% Physical Damage. 1 tile is missing and 2 are chipped in Custodian Closet. Friability changed from NON to FRIABLE. Material Condition changed from GOOD to FAIR overall. No other changes as of this date.

03/06/2007 Additional Damage in the form of approximately 2 Tiles are missing. 5 other Tiles are chipped in both rooms. No other changes as of this date.

12/02/2011 Location Description changed from ELECTRICAL ROOM, AND CUSTODIAL ROOM to BOOK STORAGE / ELECTRICAL ROOM, AND CUSTODIAL ROOM. Additional Damage observed - in the form of 1 Tile is broken in Custodial Room, and 2 Tiles broken in Book Storage/Electrical Room with Black Mastic/Adhesive exposed. No other changes as of this date.

01/31/2020 This Material is unchanged as of this date.

08/28/2020 This Material is unchanged as of this date.

02/10/2021 This Material is unchanged as of this date.

08/11/2021 This Material is unchanged as of this date.

02/18/2022 This Material is unchanged as of this date.

08/17/2022 This Material is unchanged as of this date.

02/15/2023 This Material is unchanged as of this date.

08/16/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

08/14/2024 This Material is unchanged as of this date.

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

31

HazMat Doc

AHERA Report B - Survey

SURVEY REPORT FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/27/2025 This Material is unchanged as of this date.

09/17/2025 This Material is unchanged as of this date.

05-212AAA ASSUMED NO SAMPLE (NS)

CLASSROOMS PODS A-F, LIBRARY, AND MULTI-PURPOSE ROOM BUILDING

CLASSROOMS IN PODS A-F

PRESSED WOOD WALL PANEL

6,800 SF

05/14/2009 4'x 8' Pressed Wood Wall Panels with Vinyl Wall Cover and Joint Compound on all Panels, (over Gypsum Wallboard System). This Material is in GOOD condition as of this date.

01/31/2020 This Material is unchanged as of this date.

08/28/2020 This Material is unchanged as of this date.

02/10/2021 This Material is unchanged as of this date.

08/11/2021 This Material is unchanged as of this date.

02/18/2022 This Material is unchanged as of this date.

08/17/2022 This Material is unchanged as of this date.

02/15/2023 This Material is unchanged as of this date.

08/16/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

08/14/2024 This Material is unchanged as of this date.

02/27/2025 This Material is unchanged as of this date.

09/17/2025 This Material is unchanged as of this date.

09-098AAA ASSUMED NO SAMPLE (NS)

CLASSROOMS PODS A-F, LIBRARY, AND MULTI-PURPOSE ROOM BUILDING

CLASSROOMS IN PODS A-F

PRESSED WOOD WALL PANEL MASTIC

6,800 SF

05/14/2009 Mastic/Adhesive for 4'x 8' Pressed Wood Wall Panels with Vinyl Wall Cover and Joint Compound on all Panels, (over Gypsum Wallboard System). This Material is in GOOD condition as of this date.

01/31/2020 This Material is unchanged as of this date.

SF= Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
08/28/2020	This Material is unchanged as of this date.		
02/10/2021	This Material is unchanged as of this date.		
08/11/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	This Material is unchanged as of this date.		
02/15/2023	This Material is unchanged as of this date.		
08/16/2023	This Material is unchanged as of this date.		
02/14/2024	This Material is unchanged as of this date.		
08/14/2024	This Material is unchanged as of this date.		
02/27/2025	This Material is unchanged as of this date.		
09/17/2025	This Material is unchanged as of this date.		
09-098AAA	ASSUMED	NO SAMPLE	(NS)

CLASSROOMS PODS A-F, LIBRARY, AND MULTI-PURPOSE ROOM BUILDING

CLASSROOMS IN PODS A-F, ALL HALLWAYS, MULTI-USE ROOM, STAGE, AND LIBRARY

VINYL WALL COVER MASTIC

19,000 SF

09/12/2005	Mastic/Adhesive for Vinyl Covering on Gypsum Wallboard System and Pressed Wood Wall Panels. This Material is in GOOD condition as of this date.
09/03/2010	Location Description changed from CLASSROOMS IN PODS A-F to CLASSROOMS IN PODS A-F, ALL HALLWAYS, MULTIUSE ROOM, STAGE, AND LIBRARY. Quantity changed from 6,800 SF to 19,000 SF. No other changes as of this date.
09/18/2015	Damage observed, Hallway between Pods B and C has 15 LF of Material with Physical Damage. Material condition changed from GOOD to FAIR overall. Friability changed from NON to FRIABLE. No other changes as of this date.
01/31/2020	This Material is unchanged as of this date.
08/28/2020	Additional Damage Observed. <5% Physical Damage in the form of 1 SF of Torn Wall Cover on Lower wall in Hallway near West Entrance into Library. Material remains in FAIR condition overall. No other changes as of this date.
02/10/2021	This Material is unchanged as of this date.
08/11/2021	This Material is unchanged as of this date.

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

33

HazMat Doc

AHERA Report B - Survey

SURVEY REPORT FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

COMMENTS

QTY (APPROXIMATE)

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/18/2022 This Material is unchanged as of this date.

08/17/2022 This Material is unchanged as of this date.

02/15/2023 This Material is unchanged as of this date.

08/16/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

08/14/2024 This Material is unchanged as of this date.

02/27/2025 This Material is unchanged as of this date.

09/17/2025 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS PODS A-F, LIBRARY, AND MULTI-PURPOSE ROOM BUILDING

CLASSROOMS IN PODS A-F, LIBRARY, AND MEDIA CENTER

SMOOTH WALL MISCELLANEOUS

57,500 SF

09/12/2005 Gypsum Wallboard System Walls and Ceilings, (with Skim Coat, behind other finishes). Existing Gypsum Wallboard Systems Removed and Replaced with new in-kind in Path-of-Construction. This Material is in GOOD condition as of this date.

10/17/2008 No Skim Coat present in Storage Room on Second Floor. No other changes as of this date.

01/31/2020 This Material is unchanged as of this date.

08/28/2020 This Material is unchanged as of this date.

02/10/2021 This Material is unchanged as of this date.

08/11/2021 This Material is unchanged as of this date.

02/18/2022 This Material is unchanged as of this date.

08/17/2022 This Material is unchanged as of this date.

02/15/2023 This Material is unchanged as of this date.

08/16/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

08/14/2024 This Material is unchanged as of this date.

SURVEY REPORT FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME	
LOCATION	
MATERIAL TYPE	QTY (APPROXIMATE)
COMMENTS	

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/27/2025 This Material is unchanged as of this date.

09/17/2025 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
------------------	----------------	------------------	---------------

CLASSROOMS PODS A-F, LIBRARY, AND MULTI-PURPOSE ROOM BUILDING

CLASSROOMS IN PODS A-F, LIBRARY, AND MEDIA CENTER

SMOOTH WALL SURFACING 57,500 SF

08/24/2006 Skim Coat for Gypsum Wallboard System Walls and Ceilings, (behind other finishes). Existing Gypsum Wallboard Systems Removed and Replaced with new in-kind in Path-of-Construction. This Material is in GOOD condition as of this date.

10/17/2008 No Skim Coat present in Storage Room on Second Floor. No other changes as of this date.

01/31/2020 This Material is unchanged as of this date.

08/28/2020 This Material is unchanged as of this date.

02/10/2021 This Material is unchanged as of this date.

08/11/2021 This Material is unchanged as of this date.

02/18/2022 This Material is unchanged as of this date.

08/17/2022 This Material is unchanged as of this date.

02/15/2023 This Material is unchanged as of this date.

08/16/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

08/14/2024 This Material is unchanged as of this date.

02/27/2025 This Material is unchanged as of this date.

09/17/2025 This Material is unchanged as of this date.

06-223AAA	ASSUMED	NO SAMPLE	(NS)
------------------	----------------	------------------	---------------

CLASSROOMS PODS A-F, LIBRARY, AND MULTI-PURPOSE ROOM BUILDING

ENTIRE BUILDING

FIRE DOOR CORE INSULATION 1,260 SF

10/17/2008 Fire Door Core Insulation. (60 EA Doors). This Material is in GOOD condition as of this date.

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
01/31/2020	This Material is unchanged as of this date.		
08/28/2020	This Material is unchanged as of this date.		
02/10/2021	This Material is unchanged as of this date.		
08/11/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	This Material is unchanged as of this date.		
02/15/2023	This Material is unchanged as of this date.		
08/16/2023	This Material is unchanged as of this date.		
02/14/2024	This Material is unchanged as of this date.		
08/14/2024	This Material is unchanged as of this date.		
02/27/2025	This Material is unchanged as of this date.		
09/17/2025	This Material is unchanged as of this date.		
08-241AAA	ASSUMED	NO SAMPLE	(NS)

CLASSROOMS PODS A-F, LIBRARY, AND MULTI-PURPOSE ROOM BUILDING

EXTERIOR WALLS AND OVERHANGS

ROUGH WALL

9,200 SF

09/12/2005	Stucco Walls and Overhangs. This Material is in GOOD condition as of this date.		
01/31/2020	This Material is unchanged as of this date.		
08/28/2020	This Material is unchanged as of this date.		
02/10/2021	This Material is unchanged as of this date.		
08/11/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	This Material is unchanged as of this date.		
02/15/2023	This Material is unchanged as of this date.		
08/16/2023	This Material is unchanged as of this date.		

SURVEY REPORT FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/14/2024 This Material is unchanged as of this date.

08/14/2024 This Material is unchanged as of this date.

02/27/2025 This Material is unchanged as of this date.

09/17/2025 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS PODS A-F, LIBRARY, AND MULTI-PURPOSE ROOM BUILDING

EXTERIOR WALLS AND OVERHANGS

ROUGH WALL SURFACING

9,200 SF

09/12/2005 Skim Coat for Stucco Walls and Overhangs. This Material is in GOOD condition as of this date.

01/31/2020 This Material is unchanged as of this date.

08/28/2020 This Material is unchanged as of this date.

02/10/2021 This Material is unchanged as of this date.

08/11/2021 This Material is unchanged as of this date.

02/18/2022 This Material is unchanged as of this date.

08/17/2022 This Material is unchanged as of this date.

02/15/2023 This Material is unchanged as of this date.

08/16/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

08/14/2024 This Material is unchanged as of this date.

02/27/2025 This Material is unchanged as of this date.

09/17/2025 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

SURVEY REPORT FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME	
LOCATION	
MATERIAL TYPE	QTY (APPROXIMATE)
COMMENTS	

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

CLASSROOMS PODS A-F, LIBRARY, AND MULTI-PURPOSE ROOM BUILDING

EXTERIOR WINDOWS, AND CORRIDOR

CEMENTITIOUS WINDOW PANEL 830 SF

09/12/2005	Cementitious Window Panels, 30 SF in Corridor. This Material is in GOOD condition as of this date.
01/31/2020	This Material is unchanged as of this date.
08/28/2020	This Material is unchanged as of this date.
02/10/2021	This Material is unchanged as of this date.
08/11/2021	This Material is unchanged as of this date.
02/18/2022	This Material is unchanged as of this date.
08/17/2022	This Material is unchanged as of this date.
02/15/2023	This Material is unchanged as of this date.
08/16/2023	This Material is unchanged as of this date.
02/14/2024	This Material is unchanged as of this date.
08/14/2024	This Material is unchanged as of this date.
02/27/2025	This Material is unchanged as of this date.
09/17/2025	This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS PODS A-F, LIBRARY, AND MULTI-PURPOSE ROOM BUILDING

STORAGE AND UTILITY ROOMS AT MEZZANINE LEVEL 2

SMOOTH WALL MISCELLANEOUS 4,000 SF

05/14/2009	Gypsum Wallboard System Walls and Ceilings. No Skim Coat on this Material. This Material is in GOOD condition as of this date.
01/31/2020	This Material is unchanged as of this date.
08/28/2020	This Material is unchanged as of this date.
02/10/2021	This Material is unchanged as of this date.
08/11/2021	This Material is unchanged as of this date.

SURVEY REPORT FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/18/2022 This Material is unchanged as of this date.

08/17/2022 This Material is unchanged as of this date.

02/15/2023 This Material is unchanged as of this date.

08/16/2023 This Material is unchanged as of this date.

08/14/2024 This Material is unchanged as of this date.

02/27/2025 This Material is unchanged as of this date.

09/17/2025 This Material is unchanged as of this date.

09-098AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS PODS A-F, LIBRARY, AND MULTI-PURPOSE ROOM BUILDING

THERMAL SYSTEM INSULATION IN CONCEALED LOCATIONS

PIPE FITTING INSULATION

(TBD) LF

09/12/2005 Thermal System Insulation on Pipe Fittings and Pipe Runs in Concealed Locations. This Material is in GOOD condition as of this date.

01/31/2020 This Material is unchanged as of this date.

08/28/2020 This Material is unchanged as of this date.

02/10/2021 This Material is unchanged as of this date.

08/11/2021 This Material is unchanged as of this date.

02/18/2022 This Material is unchanged as of this date.

08/17/2022 This Material is unchanged as of this date.

02/15/2023 This Material is unchanged as of this date.

08/16/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

08/14/2024 This Material is unchanged as of this date.

02/27/2025 This Material is unchanged as of this date.

09/17/2025 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR
RUSKIN ELEMENTARY SCHOOL

BUILDING NAME			
LOCATION			
MATERIAL TYPE		QTY (APPROXIMATE)	
COMMENTS			
SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE

SURVEY REPORT FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

CLASSROOMS PODS G-H, AND MUSIC BUILDING

CLASSROOMS PODS G-H, AND MUSIC BUILDING

09/12/2005	BUILDING NOTES:
09/12/2005	Existing Gypsum Wallboard Systems Removed and Replaced with new in-kind in Path-of-Construction. Existing Plaster Systems Removed and Replaced with new in-kind in Path-of-Construction. New Flooring Finishes per information received from the BUESD. New Suspended Ceiling Tiles installed.
04/07/2008	New Sinks with Thermal Undercoating installed in Classrooms. New Ceramic Floor Tiles installed in PODS G-H Classrooms and Music Rooms Wet Areas and Entry Areas per information received from BUESD.
09/03/2010	Building Name changed from CLASSROOMS G-H BUILDING to CLASSROOMS PODS G-H, AND MUSIC BUILDING.
02/14/2018	New Flooring Finishes installed Summer 2017 per information received from the BUESD. New Suspended Ceiling Tiles installed.

CLASSROOMS PODS G-H, AND MUSIC BUILDING

CLASSROOMS PODS G-H, AND MUSIC ROOMS

PRESSED WOOD WALL PANEL

2,640 SF

09/12/2005	4'x 8' Pressed Wood Wall Panels (with Vinyl Cover and Joint Compound), over Gypsum Wallboard System. This Material is in GOOD condition as of this date.
01/31/2020	This Material is unchanged as of this date.
08/28/2020	This Material is unchanged as of this date.
02/10/2021	This Material is unchanged as of this date.
08/11/2021	This Material is unchanged as of this date.
02/18/2022	This Material is unchanged as of this date.
08/17/2022	Damage Observed. <5% Physical Damage in the form of 12 LF of Torn, Loose Edges with Cuts around the Electrical Panel with Mastic and Pressed Wood Exposed in Music Room. Material condition changed from GOOD to FAIR overall. Friability updated from Non-Friable to Friable. No other changes as of this date.
02/15/2023	This Material is unchanged as of this date.
08/08/2023	This Material is unchanged as of this date.
08/14/2024	This Material is unchanged as of this date.
02/27/2025	This Material is unchanged as of this date.

SURVEY REPORT FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME	
LOCATION	
MATERIAL TYPE	QTY (APPROXIMATE)
COMMENTS	

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

09/17/2025 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
------------------	----------------	------------------	---------------

CLASSROOMS PODS G-H, AND MUSIC BUILDING

CLASSROOMS PODS G-H, AND MUSIC ROOMS

PRESSED WOOD WALL PANEL MASTIC 2,640 SF

09/12/2005 Mastic/Adhesive for 4'x 8' Pressed Wood Wall Panels (with Vinyl Cover and Joint Compound), over Gypsum Wallboard System. This Material is in GOOD condition as of this date.

01/31/2020 This Material is unchanged as of this date.

08/28/2020 This Material is unchanged as of this date.

02/10/2021 This Material is unchanged as of this date.

08/11/2021 This Material is unchanged as of this date.

02/18/2022 This Material is unchanged as of this date.

08/17/2022 Damage Observed. <5% Physical Damage in the form of 12 LF of Torn, Loose Edges with Cuts around the Electrical Panel with Mastic and Pressed Wood Exposed. Material condition changed from GOOD to FAIR overall. Friability updated from Non-Friable to Friable. No other changes as of this date.

02/15/2023 This Material is unchanged as of this date.

08/08/2023 This Material is unchanged as of this date.

08/14/2024 This Material is unchanged as of this date.

02/27/2025 This Material is unchanged as of this date.

09/17/2025 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
05-212AAA	ASSUMED	NO SAMPLE	(NS)

CLASSROOMS PODS G-H, AND MUSIC BUILDING

CLASSROOMS PODS G-H, AND MUSIC ROOMS

VINYL WALL COVER MASTIC 2,640 SF

05/14/2009 Mastic/Adhesive for Vinyl Wall Cover (on 4'x 8' Pressed Wood Wall Panels (with Joint Compound), over Gypsum Wallboard System. This Material is in GOOD condition as of this date.

01/31/2020 This Material is unchanged as of this date.

SURVEY REPORT FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

COMMENTS

QTY (APPROXIMATE)

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
08/28/2020	This Material is unchanged as of this date.		
02/10/2021	This Material is unchanged as of this date.		
08/11/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	Damage Observed. <5% Physical Damage in the form of 12 LF of Torn, Loose Edges with Cuts around the Electrical Panel with Mastic and Pressed Wood Exposed. Material condition changed from GOOD to FAIR overall. Friability updated from Non-Friable to Friable. No other changes as of this date.		
02/15/2023	This Material is unchanged as of this date.		
08/08/2023	This Material is unchanged as of this date.		
08/14/2024	This Material is unchanged as of this date.		
02/27/2025	This Material is unchanged as of this date.		
09/17/2025	This Material is unchanged as of this date.		
05-212AAA	ASSUMED	NO SAMPLE	(NS)

CLASSROOMS PODS G-H, AND MUSIC BUILDING

ENTIRE BUILDING

BASEBOARD MASTIC

900 LF

02/14/2018	Mastic/Adhesive for 4" Dark Gray Baseboard. This Material is in GOOD condition as of this date.		
01/31/2020	This Material is unchanged as of this date.		
08/28/2020	Damage Observed. <5% Physical Damage in the form of 1 LF of Baseboard with Detached Edges on West Wall of Classroom G2. Material condition changed from GOOD to FAIR overall. Friability updated from Non-Friable to Friable. No other changes as of this date.		
02/10/2021	This Material is unchanged as of this date.		
08/11/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	This Material is unchanged as of this date.		
02/15/2023	This Material is unchanged as of this date.		
08/08/2023	This Material is unchanged as of this date.		

SURVEY REPORT FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/14/2024 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

08/14/2024 This Material is unchanged as of this date.

02/27/2025 This Material is unchanged as of this date.

09/17/2025 This Material is unchanged as of this date.

18-025AAA	NEW	NO SAMPLE	(NS)
-----------	-----	-----------	--------

CLASSROOMS PODS G-H, AND MUSIC BUILDING

ENTIRE BUILDING

FIRE DOOR CORE INSULATION

88 SF

10/17/2008 Fire Door Core Insulation. (8 EA Type Doors). This Material is in GOOD condition as of this date.

01/31/2020 This Material is unchanged as of this date.

08/28/2020 This Material is unchanged as of this date.

02/10/2021 This Material is unchanged as of this date.

08/11/2021 This Material is unchanged as of this date.

02/18/2022 This Material is unchanged as of this date.

08/17/2022 This Material is unchanged as of this date.

02/15/2023 This Material is unchanged as of this date.

08/08/2023 This Material is unchanged as of this date.

08/14/2024 This Material is unchanged as of this date.

02/27/2025 This Material is unchanged as of this date.

09/17/2025 This Material is unchanged as of this date.

08-241AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

SURVEY REPORT FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME	
LOCATION	
MATERIAL TYPE	QTY (APPROXIMATE)
COMMENTS	

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

CLASSROOMS PODS G-H, AND MUSIC BUILDING

ENTIRE BUILDING

SMOOTH WALL MISCELLANEOUS

12,160 SF

09/12/2005	Gypsum Wallboard System Walls and Ceilings, (with Skim Coat, behind other finishes). Existing Gypsum Wallboard Systems Removed and Replaced with new in-kind in Path-of-Construction. This Material is in GOOD condition as of this date.
03/05/2014	<5% Physical Damage in the form of 2 LF of Joint Tape and Joint Compound is Damaged in Office H3. Material changed from NON to FRIABLE. No other changes as of this date.
01/31/2020	This Material is unchanged as of this date.
08/28/2020	This Material is unchanged as of this date.
02/10/2021	This Material is unchanged as of this date.
08/11/2021	This Material is unchanged as of this date.
02/18/2022	This Material is unchanged as of this date.
08/17/2022	Additional Damage Observed. <5% Physical Damage in the form of 2 SF of Loose, Peling Skim Coat and Paint with Exposed Joint Tape and Mud on Ceiling of Music Room. No other changes as of this date.
02/15/2023	This Material is unchanged as of this date.
08/08/2023	This Material is unchanged as of this date.
08/14/2024	This Material is unchanged as of this date.
02/27/2025	This Material is unchanged as of this date.
09/17/2025	This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS PODS G-H, AND MUSIC BUILDING

ENTIRE BUILDING

SMOOTH WALL SURFACING

12,160 SF

08/24/2006	Skim Coat for Gypsum Wallboard System Walls and Ceilings, (behind other finishes). Existing Gypsum Wallboard Systems Removed and Replaced with new in-kind in Path-of-Construction. This Material is in GOOD condition as of this date.
03/05/2014	<5% Physical Damage in the form of 2 LF of Joint Tape and Joint Compound is Damaged in Office H3. Material changed from NON to FRIABLE. No other changes as of this date.
01/31/2020	This Material is unchanged as of this date.

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
08/28/2020	This Material is unchanged as of this date.		
02/10/2021	This Material is unchanged as of this date.		
08/11/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	Additional Damage Observed. <5% Physical Damage in the form of 2 SF of Loose, Peling Skim Coat and Paint with Exposed Joint Tape and Mud on Ceiling of Music Room. No other changes as of this date.		
02/15/2023	This Material is unchanged as of this date.		
08/08/2023	This Material is unchanged as of this date.		
02/14/2024	This Material is unchanged as of this date.		
08/14/2024	This Material is unchanged as of this date.		
02/27/2025	This Material is unchanged as of this date.		
09/17/2025	This Material is unchanged as of this date.		
06-223AAA	ASSUMED	NO SAMPLE	(NS)

CLASSROOMS PODS G-H, AND MUSIC BUILDING

EXTERIOR WALLS AND OVERHANGS

ROUGH WALL

2,200 SF

09/12/2005	Stucco Walls and Overhangs. This Material is in GOOD condition as of this date.		
01/31/2020	This Material is unchanged as of this date.		
08/28/2020	This Material is unchanged as of this date.		
02/10/2021	This Material is unchanged as of this date.		
08/11/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	This Material is unchanged as of this date.		
02/15/2023	This Material is unchanged as of this date.		
08/08/2023	This Material is unchanged as of this date.		
02/14/2024	This Material is unchanged as of this date.		

SF= Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

08/14/2024 This Material is unchanged as of this date.

02/27/2025 This Material is unchanged as of this date.

09/17/2025 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS PODS G-H, AND MUSIC BUILDING

EXTERIOR WALLS AND OVERHANGS

ROUGH WALL SURFACING

2,200 SF

09/12/2005 Skim Coat for Stucco Walls and Overhangs. This Material is in GOOD condition as of this date.

01/31/2020 This Material is unchanged as of this date.

08/28/2020 This Material is unchanged as of this date.

02/10/2021 This Material is unchanged as of this date.

08/11/2021 This Material is unchanged as of this date.

02/18/2022 This Material is unchanged as of this date.

08/17/2022 This Material is unchanged as of this date.

02/15/2023 This Material is unchanged as of this date.

08/08/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

08/14/2024 This Material is unchanged as of this date.

02/27/2025 This Material is unchanged as of this date.

09/17/2025 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS PODS G-H, AND MUSIC BUILDING

EXTERIOR WINDOWS

CEMENTITIOUS WINDOW PANEL

36 SF

09/12/2005 Cementitious Window Panels. This Material is in GOOD condition as of this date.

SURVEY REPORT FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
01/31/2020	This Material is unchanged as of this date.		
08/28/2020	This Material is unchanged as of this date.		
02/10/2021	This Material is unchanged as of this date.		
08/11/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	This Material is unchanged as of this date.		
02/15/2023	This Material is unchanged as of this date.		
08/08/2023	This Material is unchanged as of this date.		
02/14/2024	This Material is unchanged as of this date.		
08/14/2024	This Material is unchanged as of this date.		
02/27/2025	This Material is unchanged as of this date.		
09/17/2025	This Material is unchanged as of this date.		
05-212AAA	ASSUMED	NO SAMPLE	(NS)

SURVEY REPORT FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME	
LOCATION	
MATERIAL TYPE	QTY (APPROXIMATE)
COMMENTS	

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

CUSTODIAL SHED

CUSTODIAL SHED

03/07/2017 BUILDING NOTES:

03/07/2017 Wood Storage Shed (1 EA).

CUSTODIAL SHED

CUSTODIAL SHED

STORAGE BUILDING

350 SF

09/12/2005 All Wood Construction Shed.

01/31/2020 This Material is unchanged as of this date.

08/28/2020 This Material is unchanged as of this date.

02/10/2021 This Material is unchanged as of this date.

08/11/2021 This Material is unchanged as of this date.

02/18/2022 This Material is unchanged as of this date.

08/17/2022 This Material is unchanged as of this date.

02/15/2023 This Material is unchanged as of this date.

08/16/2023 This Material is unchanged as of this date.

04/14/2024 This Material is unchanged as of this date.

08/14/2024 This Material is unchanged as of this date.

02/27/2025 This Material is unchanged as of this date.

09/17/2025 This Material is unchanged as of this date.

05-212.NS	NEW	NO SAMPLE	(NS)
-----------	-----	-----------	--------

SURVEY REPORT FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME	
LOCATION	
MATERIAL TYPE	QTY (APPROXIMATE)
COMMENTS	

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

GARDEN SHED

GARDEN SHED

05/14/2009 BUILDING NOTES:

05/14/2009 Wood Storage Shed (1 EA).

12/02/2011 Building Name changed from TRAFFIC PATROL EQUIPMENT SHED to GARDEN SHED.

GARDEN SHED

GARDEN SHED

STORAGE BUILDING

40 SF

05/14/2009 All Wood Construction Shed.

12/02/2011 Location Description changed from TRAFFIC PATROL EQUIPMENT SHED to GARDEN SHED. No other changes as of this date.

01/31/2020 This Material is unchanged as of this date.

08/28/2020 This Material is unchanged as of this date.

02/10/2021 This Material is unchanged as of this date.

08/11/2021 This Material is unchanged as of this date.

02/18/2022 This Material is unchanged as of this date.

08/17/2022 This Material is unchanged as of this date.

02/15/2023 This Material is unchanged as of this date.

08/16/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

08/14/2024 This Material is unchanged as of this date.

02/27/2025 This Material is unchanged as of this date.

09/17/2025 This Material is unchanged as of this date.

09-098.NS	NEW	NO SAMPLE	(NS)
-----------	-----	-----------	--------

SURVEY REPORT FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME	
LOCATION	
MATERIAL TYPE	QTY (APPROXIMATE)
COMMENTS	

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

KITCHEN, RESTROOMS AND STORAGE ROOMS BUILDING

KITCHEN, RESTROOMS AND STORAGE ROOMS BUILDING

09/12/2005	BUILDING NOTES:
09/12/2005	Existing Gypsum Wallboard Systems Removed and Replaced with new in-kind in Path-of-Construction. Existing Plaster Systems Removed and Replaced with new in-kind in Path-of-Construction. New Flooring Finishes per information received from the BUESD.
10/17/2008	New Ceramic Wall and Floor Tiles installed in Restrooms per information received from BUESD.

KITCHEN, RESTROOMS AND STORAGE ROOMS BUILDING

ENTIRE BUILDING

FIRE DOOR CORE INSULATION 231 SF

09/12/2005	Fire Door Core Insulation (11 EA Fire Doors). This Material is in GOOD condition as of this date.
01/31/2020	This Material is unchanged as of this date.
08/28/2020	This Material is unchanged as of this date.
02/10/2021	This Material is unchanged as of this date.
08/11/2021	This Material is unchanged as of this date.
02/18/2022	This Material is unchanged as of this date.
08/17/2022	This Material is unchanged as of this date.
02/15/2023	This Material is unchanged as of this date.
08/16/2023	This Material is unchanged as of this date.
02/14/2024	This Material is unchanged as of this date.
08/14/2024	This Material is unchanged as of this date.
02/27/2025	This Material is unchanged as of this date.
09/17/2025	This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

SURVEY REPORT FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME	
LOCATION	
MATERIAL TYPE	QTY (APPROXIMATE)
COMMENTS	

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

KITCHEN, RESTROOMS AND STORAGE ROOMS BUILDING

ENTIRE BUILDING

SMOOTH WALL MISCELLANEOUS

5,650 SF

09/12/2005	Gypsum Wallboard System Walls and Ceilings, (with Skim Coat, behind other finishes). Existing Gypsum Wallboard Systems Removed and Replaced with new in-kind in Path-of-Construction. <5% Physical Damage. Approximately 5 SF damaged in Exterior Storage Closet. This Material is in FAIR condition overall as of this date.
05/14/2009	Physical Damages in the form of cuts, holes and gouges observed in the Kitchen next to the Food Serving Room, Storage Room ceiling and Kitchen next to the sink. <10% Water Damage. Water Damage observed on the Ceiling of the Storage Room. No other changes as of this date.
12/02/2011	Additional Damage - in the form of approximately 5 SF of Damage on Wall in Kitchen. No other changes as of this date.
08/29/2017	Additional Damage and Partial Repairs Observed. Kitchen Storage Room now has 12 SF of Scattered Damages in the form of Stains and Peeled Skim Coat. No other changes as of this date.
01/31/2020	This Material is unchanged as of this date.
08/28/2020	This Material is unchanged as of this date.
02/10/2021	This Material is unchanged as of this date.
08/11/2021	This Material is unchanged as of this date.
02/18/2022	This Material is unchanged as of this date.
08/17/2022	This Material is unchanged as of this date.
02/15/2023	This Material is unchanged as of this date.
08/16/2023	This Material is unchanged as of this date.
02/14/2024	This Material is unchanged as of this date.
08/14/2024	This Material is unchanged as of this date.
02/27/2025	This Material is unchanged as of this date.
09/17/2025	This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

SURVEY REPORT FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME	
LOCATION	
MATERIAL TYPE	QTY (APPROXIMATE)
COMMENTS	

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

KITCHEN, RESTROOMS AND STORAGE ROOMS BUILDING

ENTIRE BUILDING

SMOOTH WALL SURFACING

5,650 SF

08/24/2006	Skim Coat for Gypsum Wallboard System Walls and Ceilings, (behind other finishes). Existing Gypsum Wallboard Systems Removed and Replaced with new in-kind in Path-of-Construction. Approximately 5 SF damaged in Exterior Storage Closet. This Material is in fair condition overall as of this date.
05/14/2009	Physical Damages in the form of cuts, holes and gouges observed in the Kitchen next to the Food Serving Room, Storage Room Ceiling and Kitchen next to the sink. Water Damage observed on the Ceiling of the Storage Room. No other changes as of this date.
09/09/2009	Material remains in <5% Physical Damage. This Material is unchanged as of this date.
12/02/2011	Additional Damage - in the form of approximately 5 SF of Damage on Wall in Kitchen. No other changes as of this date.
08/29/2017	Additional Damage and Partial Repairs Observed. Kitchen Storage Room now has 12 SF of Scattered Damages in the form of Stains and Peeled Skim Coat. No other changes as of this date.
01/31/2020	This Material is unchanged as of this date.
08/28/2020	This Material is unchanged as of this date.
02/10/2021	This Material is unchanged as of this date.
08/11/2021	This Material is unchanged as of this date.
02/18/2022	This Material is unchanged as of this date.
08/17/2022	This Material is unchanged as of this date.
02/15/2023	This Material is unchanged as of this date.
08/16/2023	This Material is unchanged as of this date.
02/14/2024	This Material is unchanged as of this date.
08/14/2024	This Material is unchanged as of this date.
02/27/2025	This Material is unchanged as of this date.
09/17/2025	This Material is unchanged as of this date.

06-223AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

SURVEY REPORT FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME	
LOCATION	
MATERIAL TYPE	QTY (APPROXIMATE)
COMMENTS	

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

KITCHEN, RESTROOMS AND STORAGE ROOMS BUILDING

EXTERIOR WALLS AND OVERHANGS

ROUGH WALL 1,800 SF

08/24/2006 Stucco Walls and Overhangs. This Material is in GOOD condition as of this date.

01/31/2020 This Material is unchanged as of this date.

08/28/2020 This Material is unchanged as of this date.

02/10/2021 This Material is unchanged as of this date.

08/11/2021 This Material is unchanged as of this date.

02/18/2022 This Material is unchanged as of this date.

08/17/2022 This Material is unchanged as of this date.

02/15/2023 This Material is unchanged as of this date.

08/16/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

08/14/2024 This Material is unchanged as of this date.

02/27/2025 This Material is unchanged as of this date.

09/17/2025 This Material is unchanged as of this date.

06-223AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

KITCHEN, RESTROOMS AND STORAGE ROOMS BUILDING

EXTERIOR WALLS AND OVERHANGS

ROUGH WALL SURFACING 1,800 SF

08/24/2006 Skim Coat for Stucco Walls and Overhangs. This Material is in GOOD condition as of this date.

05/14/2009 This Material is in unchanged as of this date.

01/31/2020 This Material is unchanged as of this date.

08/28/2020 This Material is unchanged as of this date.

02/10/2021 This Material is unchanged as of this date.

08/11/2021 This Material is unchanged as of this date.

SF= Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR
RUSKIN ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	This Material is unchanged as of this date.		
02/15/2023	This Material is unchanged as of this date.		
08/16/2023	This Material is unchanged as of this date.		
02/14/2024	This Material is unchanged as of this date.		
08/14/2024	This Material is unchanged as of this date.		
02/27/2025	This Material is unchanged as of this date.		
09/17/2025	This Material is unchanged as of this date.		
06-223AAA	ASSUMED	NO SAMPLE	(NS)

SURVEY REPORT FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

METAL STORAGE CONTAINER (1 EA)

METAL STORAGE CONTAINER (1 EA)

05/14/2009 BUILDING NOTES:

05/14/2009 Metal Storage Container (1 EA).

METAL STORAGE CONTAINER (1 EA)

METAL STORAGE CONTAINER (1 EA)

STORAGE CONTAINER

336 SF

03/21/2016 Metal Storage Container. 1 EA, 336 SF.

01/31/2020 This Material is unchanged as of this date.

08/28/2020 This Material is unchanged as of this date.

02/10/2021 This Material is unchanged as of this date.

08/11/2021 This Material is unchanged as of this date.

02/18/2022 This Material is unchanged as of this date.

08/17/2022 This Material is unchanged as of this date.

02/15/2023 This Material is unchanged as of this date.

08/16/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

08/14/2024 This Material is unchanged as of this date.

02/27/2025 This Material is unchanged as of this date.

09/17/2025 This Material is unchanged as of this date.

16-074.NS	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

SURVEY REPORT FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME	
LOCATION	
MATERIAL TYPE	QTY (APPROXIMATE)
COMMENTS	

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
-------------------	-------------------------	----------------------	----------------------

WOOD STORAGE SHED

WOOD STORAGE SHED

09/09/2009 BUILDING NOTES:

09/09/2009 All Wood Construction Shed. Wood Shed is located next to Administration Building.

WOOD STORAGE SHED

WOOD STORAGE SHED

STORAGE BUILDING

30 SF

09/09/2009 All Wood Construction Shed.

03/05/2014 This Material is unchanged as of this date.

01/31/2020 This Material is unchanged as of this date.

08/28/2020 This Material is unchanged as of this date.

02/10/2021 This Material is unchanged as of this date.

08/11/2021 This Material is unchanged as of this date.

02/18/2022 This Material is unchanged as of this date.

02/15/2023 This Material is unchanged as of this date.

08/16/2023 This Material is unchanged as of this date.

02/14/2024 This Material is unchanged as of this date.

08/14/2024 This Material is unchanged as of this date.

02/27/2025 This Material is unchanged as of this date.

09/17/2025 This Material is unchanged as of this date.

09-212.NS	NEW	NO SAMPLE	(NS)
------------------	------------	------------------	---------------

End Of Report, Total Of 57 Pages

HOMOGENEOUS MATERIALS IN RUSKIN ELEMENTARY SCHOOL

BUILDING NAME		MATERIAL TYPE
MATERIAL CATEGORY	LOCATION	
ADMINISTRATION BUILDING		
MISCELLANEOUS MATERIAL		
ENTIRE BUILDING		FIRE DOOR CORE INSULATION
ENTIRE BUILDING		SMOOTH WALL
		MISCELLANEOUS
OFFICES, AND HALLWAY		VINYL WALL COVER MASTIC
SURFACING MATERIAL		
ENTIRE BUILDING		SMOOTH WALL SURFACING
EXTERIOR WALLS AND OVERHANGS		ROUGH WALL
EXTERIOR WALLS AND OVERHANGS		ROUGH WALL SURFACING
CLASSROOMS I1-I2 TECHNOLOGY PORTABLES BUILDING		
MISCELLANEOUS MATERIAL		
CLASSROOMS I1-I2		BASEBOARD MASTIC
CLASSROOMS I1-I2		CARPET MASTIC
CLASSROOMS I1-I2		SMOOTH WALL
		MISCELLANEOUS
CLASSROOMS I1-I2		SUSPENDED CEILING TILE
CLASSROOMS I1-I2		VINYL WALL COVER MASTIC
CLASSROOMS I1-I2 WET / SINK AREAS, AND ENTRYWAYS		VINYL FLOOR TILE
CLASSROOMS I1-I2 WET / SINK AREAS, AND ENTRYWAYS		VINYL FLOOR TILE MASTIC
SURFACING MATERIAL		
EXTERIOR WALLS		ROUGH WALL
EXTERIOR WALLS		ROUGH WALL SURFACING
CLASSROOMS J1 PORTABLE BUILDING (MUSIC ROOM)		
MISCELLANEOUS MATERIAL		
CLASSROOM J-1 MUSIC ROOM		BASEBOARD MASTIC
CLASSROOM J-1 MUSIC ROOM		CARPET MASTIC
CLASSROOM J-1 MUSIC ROOM		FIRE DOOR CORE INSULATION
CLASSROOM J-1 MUSIC ROOM		PRESSED WOOD WALL PANEL MASTIC
CLASSROOM J-1 MUSIC ROOM		PRESSED-WOOD WALL PANEL
CLASSROOM J-1 MUSIC ROOM		SUSPENDED CEILING TILE
CLASSROOM J-1 MUSIC ROOM		VINYL WALL COVER
CLASSROOM J-1 MUSIC ROOM		VINYL WALL COVER MASTIC
CLASSROOMS J2 PORTABLE BUILDING		
MISCELLANEOUS MATERIAL		
PORTABLE J2		PORTABLE BUILDING
CLASSROOMS J3 PORTABLE BUILDING (GYM)		

HOMOGENEOUS MATERIALS IN RUSKIN ELEMENTARY SCHOOL

BUILDING NAME		MATERIAL CATEGORY		LOCATION		MATERIAL TYPE	
		MISCELLANEOUS MATERIAL		PORTABLE J3		PORTABLE BUILDING	
CLASSROOMS K1-K2 BUILDING							
		MISCELLANEOUS MATERIAL					
		CLASSROOMS, STORAGE ROOMS, AND RESTROOMS				SMOOTH WALL MISCELLANEOUS	
		ENTIRE BUILDING				FIRE DOOR CORE INSULATION	
		K1 AND K2 CLASSROOMS				CEMENTITIOUS WINDOW PANEL	
		K1 AND K2 CLASSROOMS				PRESSED WOOD WALL PANEL	
		K1 AND K2 CLASSROOMS				PRESSED WOOD WALL PANEL MASTIC	
		K1 AND K2 CLASSROOMS				VINYL WALL COVER MASTIC	
		SURFACING MATERIAL					
		CLASSROOMS, STORAGE ROOMS, AND RESTROOMS				SMOOTH WALL SURFACING	
		EXTERIOR WALLS AND OVERHANGS				ROUGH WALL	
		EXTERIOR WALLS AND OVERHANGS				ROUGH WALL SURFACING	
		CLASSROOMS PODS A-F, LIBRARY, AND MULTI-PURPOSE ROOM BUILDING					
		MISCELLANEOUS MATERIAL					
		BOOK STORAGE / ELECTRICAL ROOM, AND CUSTODIAL ROOM				VINYL FLOOR TILE	
		BOOK STORAGE / ELECTRICAL ROOM, AND CUSTODIAL ROOM				VINYL FLOOR TILE MASTIC	
		CLASSROOMS IN PODS A-F				PRESSED WOOD WALL PANEL	
		CLASSROOMS IN PODS A-F				PRESSED WOOD WALL PANEL MASTIC	
		CLASSROOMS IN PODS A-F, ALL HALLWAYS, MULTI-USE ROOM, STAGE, AND LIBRARY				VINYL WALL COVER MASTIC	
		CLASSROOMS IN PODS A-F, LIBRARY, AND MEDIA CENTER				SMOOTH WALL MISCELLANEOUS	
		ENTIRE BUILDING				FIRE DOOR CORE INSULATION	
		EXTERIOR WINDOWS, AND CORRIDOR				CEMENTITIOUS WINDOW PANEL	
		STORAGE AND UTILITY ROOMS AT MEZZANINE LEVEL 2				SMOOTH WALL MISCELLANEOUS	
		SURFACING MATERIAL					
		CLASSROOMS IN PODS A-F, LIBRARY, AND MEDIA CENTER				SMOOTH WALL SURFACING	
		EXTERIOR WALLS AND OVERHANGS				ROUGH WALL	
		EXTERIOR WALLS AND OVERHANGS				ROUGH WALL SURFACING	
		THERMAL SYSTEM INSULATION					
		THERMAL SYSTEM INSULATION IN CONCEALED LOCATIONS				PIPE FITTING INSULATION	
		CLASSROOMS PODS G-H, AND MUSIC BUILDING					

HOMOGENEOUS MATERIALS IN RUSKIN ELEMENTARY SCHOOL

BUILDING NAME		
MATERIAL CATEGORY	LOCATION	MATERIAL TYPE
MISCELLANEOUS MATERIAL		
	CLASSROOMS PODS G-H, AND MUSIC ROOMS	PRESSED WOOD WALL PANEL
	CLASSROOMS PODS G-H, AND MUSIC ROOMS	PRESSED WOOD WALL PANEL MASTIC
	CLASSROOMS PODS G-H, AND MUSIC ROOMS	VINYL WALL COVER MASTIC
	ENTIRE BUILDING	BASEBOARD MASTIC
	ENTIRE BUILDING	FIRE DOOR CORE INSULATION
	ENTIRE BUILDING	SMOOTH WALL MISCELLANEOUS
	EXTERIOR WINDOWS	CEMENTITIOUS WINDOW PANEL
SURFACING MATERIAL		
	ENTIRE BUILDING	SMOOTH WALL SURFACING
	EXTERIOR WALLS AND OVERHANGS	ROUGH WALL
	EXTERIOR WALLS AND OVERHANGS	ROUGH WALL SURFACING
CUSTODIAL SHED		
MISCELLANEOUS MATERIAL		
	CUSTODIAL SHED	STORAGE BUILDING
GARDEN SHED		
MISCELLANEOUS MATERIAL		
	GARDEN SHED	STORAGE BUILDING
KITCHEN, RESTROOMS AND STORAGE ROOMS BUILDING		
MISCELLANEOUS MATERIAL		
	ENTIRE BUILDING	FIRE DOOR CORE INSULATION
	ENTIRE BUILDING	SMOOTH WALL MISCELLANEOUS
SURFACING MATERIAL		
	ENTIRE BUILDING	SMOOTH WALL SURFACING
	EXTERIOR WALLS AND OVERHANGS	ROUGH WALL
	EXTERIOR WALLS AND OVERHANGS	ROUGH WALL SURFACING
METAL STORAGE CONTAINER (1 EA)		
MISCELLANEOUS MATERIAL		
	METAL STORAGE CONTAINER (1 EA)	STORAGE CONTAINER
WOOD STORAGE SHED		

HOMOGENEOUS MATERIALS IN
RUSKIN ELEMENTARY SCHOOL

BUILDING NAME

MATERIAL CATEGORY

LOCATION

MATERIAL TYPE

MISCELLANEOUS MATERIAL

WOOD STORAGE SHED

STORAGE BUILDING

End Of Report, Total Of 4 Pages

FRIABLE LOCATIONS IN RUSKIN ELEMENTARY SCHOOL

BUILDING NAME			
LOCATION		QTY	ASBESTOS
MATERIAL TYPE		(APPROXIMATE)	CONTENT
ADMINISTRATION BUILDING			
ENTIRE BUILDING			
FIRE DOOR CORE INSULATION		168 SF	Assumed
ENTIRE BUILDING			
SMOOTH WALL MISCELLANEOUS		3,500 SF	Assumed
ENTIRE BUILDING			
SMOOTH WALL SURFACING		3,500 SF	Assumed
CLASSROOMS I1-I2 TECHNOLOGY PORTABLES BUILDING			
CLASSROOMS I1-I2			
CARPET MASTIC		1,180 SF	Assumed
CLASSROOMS I1-I2			
SMOOTH WALL MISCELLANEOUS		3,800 SF	Assumed
CLASSROOMS I1-I2			
SUSPENDED CEILING TILE		1,824 SF	Assumed
CLASSROOMS I1-I2 WET / SINK AREAS, AND ENTRYWAYS			
VINYL FLOOR TILE		260 SF	Assumed
CLASSROOMS I1-I2 WET / SINK AREAS, AND ENTRYWAYS			
VINYL FLOOR TILE MASTIC		260 SF	Assumed
CLASSROOMS J1 PORTABLE BUILDING (MUSIC ROOM)			
CLASSROOM J-1 MUSIC ROOM			
FIRE DOOR CORE INSULATION		21 SF	Assumed
CLASSROOM J-1 MUSIC ROOM			
PRESSED WOOD WALL PANEL MASTIC		1,050 SF	Assumed
CLASSROOM J-1 MUSIC ROOM			
PRESSED-WOOD WALL PANEL		1,050 SF	Assumed
CLASSROOM J-1 MUSIC ROOM			
SUSPENDED CEILING TILE		960 SF	Assumed
CLASSROOM J-1 MUSIC ROOM			
VINYL WALL COVER		1,050 SF	Assumed
CLASSROOMS K1-K2 BUILDING			
CLASSROOMS, STORAGE ROOMS, AND RESTROOMS			
SMOOTH WALL MISCELLANEOUS		5,910 SF	Assumed
CLASSROOMS, STORAGE ROOMS, AND RESTROOMS			
SMOOTH WALL SURFACING		5,910 SF	Assumed

FRIABLE LOCATIONS IN RUSKIN ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	QTY (APPROXIMATE)	ASBESTOS CONTENT
	ENTIRE BUILDING			
		FIRE DOOR CORE INSULATION	189 SF	Assumed
	K1 AND K2 CLASSROOMS			
		PRESSED WOOD WALL PANEL	3,200 SF	Assumed
CLASSROOMS PODS A-F, LIBRARY, AND MULTI-PURPOSE ROOM BUILDING				
	BOOK STORAGE / ELECTRICAL ROOM, AND CUSTODIAL ROOM			
		VINYL FLOOR TILE	240 SF	Assumed
	BOOK STORAGE / ELECTRICAL ROOM, AND CUSTODIAL ROOM			
		VINYL FLOOR TILE MASTIC	240 SF	Assumed
	CLASSROOMS IN PODS A-F			
		PRESSED WOOD WALL PANEL	6,800 SF	Assumed
	CLASSROOMS IN PODS A-F, ALL HALLWAYS, MULTI-USE ROOM, STAGE, AND LIBRARY			
		VINYL WALL COVER MASTIC	19,000 SF	Assumed
	CLASSROOMS IN PODS A-F, LIBRARY, AND MEDIA CENTER			
		SMOOTH WALL SURFACING	57,500 SF	Assumed
	ENTIRE BUILDING			
		FIRE DOOR CORE INSULATION	1,260 SF	Assumed
	STORAGE AND UTILITY ROOMS AT MEZZANINE LEVEL 2			
		SMOOTH WALL MISCELLANEOUS	4,000 SF	Assumed
	THERMAL SYSTEM INSULATION IN CONCEALED LOCATIONS			
		PIPE FITTING INSULATION	(TBD) LF	Assumed
CLASSROOMS PODS G-H, AND MUSIC BUILDING				
	CLASSROOMS PODS G-H, AND MUSIC ROOMS			
		PRESSED WOOD WALL PANEL	2,640 SF	Assumed
	CLASSROOMS PODS G-H, AND MUSIC ROOMS			
		PRESSED WOOD WALL PANEL MASTIC	2,640 SF	Assumed
	CLASSROOMS PODS G-H, AND MUSIC ROOMS			
		VINYL WALL COVER MASTIC	2,640 SF	Assumed
	ENTIRE BUILDING			
		BASEBOARD MASTIC	900 LF	Assumed
	ENTIRE BUILDING			
		FIRE DOOR CORE INSULATION	88 SF	Assumed
	ENTIRE BUILDING			
		SMOOTH WALL MISCELLANEOUS	12,160 SF	Assumed

**FRIABLE LOCATIONS IN
RUSKIN ELEMENTARY SCHOOL**

BUILDING NAME			
LOCATION		QTY (APPROXIMATE)	ASBESTOS CONTENT
MATERIAL TYPE			
ENTIRE BUILDING			
SMOOTH WALL SURFACING		12,160 SF	Assumed
KITCHEN, RESTROOMS AND STORAGE ROOMS BUILDING			
ENTIRE BUILDING			
FIRE DOOR CORE INSULATION		231 SF	Assumed
ENTIRE BUILDING			
SMOOTH WALL MISCELLANEOUS		5,650 SF	Assumed
ENTIRE BUILDING			
SMOOTH WALL SURFACING		5,650 SF	Assumed
End Of Report, Total Of 3 Pages			

Non- Friable Locations In RUSKIN ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	QTY (APPROXIMATE)	ASBESTOS CONTENT
	MATERIAL TYPE		
ADMINISTRATION BUILDING			
	EXTERIOR WALLS AND OVERHANGS ROUGH WALL	2,800 SF	Assumed
	EXTERIOR WALLS AND OVERHANGS ROUGH WALL SURFACING	2,800 SF	Assumed
	OFFICES, AND HALLWAY VINYL WALL COVER MASTIC	2,200 SF	Assumed
CLASSROOMS I1-I2 TECHNOLOGY PORTABLES BUILDING			
	CLASSROOMS I1-I2 BASEBOARD MASTIC	180 LF	Assumed
	CLASSROOMS I1-I2 VINYL WALL COVER MASTIC	3,800 SF	Assumed
	EXTERIOR WALLS ROUGH WALL	2,600 SF	Assumed
	EXTERIOR WALLS ROUGH WALL SURFACING	2,600 SF	Assumed
CLASSROOMS J1 PORTABLE BUILDING (MUSIC ROOM)			
	CLASSROOM J-1 MUSIC ROOM BASEBOARD MASTIC	121 LF	Assumed
	CLASSROOM J-1 MUSIC ROOM CARPET MASTIC	960 SF	Assumed
	CLASSROOM J-1 MUSIC ROOM VINYL WALL COVER MASTIC	1,050 SF	Assumed
CLASSROOMS K1-K2 BUILDING			
	EXTERIOR WALLS AND OVERHANGS ROUGH WALL	4,400 SF	Assumed
	EXTERIOR WALLS AND OVERHANGS ROUGH WALL SURFACING	4,400 SF	Assumed
	K1 AND K2 CLASSROOMS CEMENTITIOUS WINDOW PANEL	40 SF	Assumed
	K1 AND K2 CLASSROOMS PRESSED WOOD WALL PANEL MASTIC	3,200 SF	Assumed
	K1 AND K2 CLASSROOMS VINYL WALL COVER MASTIC	3,200 SF	Assumed
CLASSROOMS PODS A-F, LIBRARY, AND MULTI-PURPOSE ROOM BUILDING			
	CLASSROOMS IN PODS A-F PRESSED WOOD WALL PANEL MASTIC	6,800 SF	Assumed
	CLASSROOMS IN PODS A-F, LIBRARY, AND MEDIA CENTER SMOOTH WALL MISCELLANEOUS	57,500 SF	Assumed
	EXTERIOR WALLS AND OVERHANGS ROUGH WALL	9,200 SF	Assumed

Non- Friable Locations In RUSKIN ELEMENTARY SCHOOL

BUILDING NAME			
LOCATION		QTY (APPROXIMATE)	ASBESTOS CONTENT
MATERIAL TYPE			
EXTERIOR WALLS AND OVERHANGS			
ROUGH WALL SURFACING		9,200 SF	Assumed
EXTERIOR WINDOWS, AND CORRIDOR			
CEMENTITIOUS WINDOW PANEL		830 SF	Assumed
CLASSROOMS PODS G-H, AND MUSIC BUILDING			
EXTERIOR WALLS AND OVERHANGS			
ROUGH WALL		2,200 SF	Assumed
EXTERIOR WALLS AND OVERHANGS			
ROUGH WALL SURFACING		2,200 SF	Assumed
EXTERIOR WINDOWS			
CEMENTITIOUS WINDOW PANEL		36 SF	Assumed
KITCHEN, RESTROOMS AND STORAGE ROOMS BUILDING			
EXTERIOR WALLS AND OVERHANGS			
ROUGH WALL		1,800 SF	Assumed
EXTERIOR WALLS AND OVERHANGS			
ROUGH WALL SURFACING		1,800 SF	Assumed
METAL STORAGE CONTAINER (1 EA)			

End Of Report, Total Of 2 Pages

RECOMMENDATIONS FOR
RUSKIN ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

ADMINISTRATION BUILDING

ENTIRE BUILDING

FIRE DOOR CORE INSULATION 168 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

ENTIRE BUILDING

SMOOTH WALL MISCELLANEOUS 3,500 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

ENTIRE BUILDING

SMOOTH WALL SURFACING 3,500 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

EXTERIOR WALLS AND OVERHANGS

ROUGH WALL 2,800 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR
RUSKIN ELEMENTARY SCHOOL

BUILDING NAME**LOCATION****MATERIAL TYPE****RECOMMENDATION****QTY****(APPROXIMATE)**

EXTERIOR WALLS AND OVERHANGS**ROUGH WALL SURFACING****2,800 SF**

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

OFFICES, AND HALLWAY**VINYL WALL COVER MASTIC****2,200 SF**

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOMS I1-I2 TECHNOLOGY PORTABLES BUILDING

CLASSROOMS I1-I2**BASEBOARD MASTIC****180 LF**

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOMS I1-I2**CARPET MASTIC****1,180 SF**

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR
RUSKIN ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

CLASSROOMS I1-I2

SMOOTH WALL MISCELLANEOUS 3,800 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOMS I1-I2

SUSPENDED CEILING TILE 1,824 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOMS I1-I2

VINYL WALL COVER MASTIC 3,800 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOMS I1-I2 WET / SINK AREAS, AND ENTRYWAYS

VINYL FLOOR TILE 260 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR
RUSKIN ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

CLASSROOMS I1-I2 WET / SINK AREAS, AND ENTRYWAYS

VINYL FLOOR TILE MASTIC

260 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

EXTERIOR WALLS

ROUGH WALL

2,600 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

EXTERIOR WALLS

ROUGH WALL SURFACING

2,600 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR
RUSKIN ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

CLASSROOMS J1 PORTABLE BUILDING (MUSIC ROOM)

CLASSROOM J-1 MUSIC ROOM

BASEBOARD MASTIC

121 LF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOM J-1 MUSIC ROOM

CARPET MASTIC

960 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOM J-1 MUSIC ROOM

FIRE DOOR CORE INSULATION

21 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOM J-1 MUSIC ROOM

PRESSED WOOD WALL PANEL MASTIC

1,050 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

CLASSROOM J-1 MUSIC ROOM

PRESSED-WOOD WALL PANEL

1,050 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOM J-1 MUSIC ROOM

SUSPENDED CEILING TILE

960 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOM J-1 MUSIC ROOM

VINYL WALL COVER

1,050 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOM J-1 MUSIC ROOM

VINYL WALL COVER MASTIC

1,050 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR
RUSKIN ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

CLASSROOMS J2 PORTABLE BUILDING

PORTABLE J2

PORTABLE BUILDING

960 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

CLASSROOMS J3 PORTABLE BUILDING (GYM)

PORTABLE J3

PORTABLE BUILDING

960 SF

- (a) This is a replacement/new material.
- (b) The district should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the district's AHERA records.

CLASSROOMS K1-K2 BUILDING

CLASSROOMS, STORAGE ROOMS, AND RESTROOMS

SMOOTH WALL MISCELLANEOUS

5,910 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

CLASSROOMS, STORAGE ROOMS, AND RESTROOMS

SMOOTH WALL SURFACING

5,910 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

ENTIRE BUILDING

FIRE DOOR CORE INSULATION

189 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

EXTERIOR WALLS AND OVERHANGS

ROUGH WALL

4,400 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

EXTERIOR WALLS AND OVERHANGS

ROUGH WALL SURFACING

4,400 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

K1 AND K2 CLASSROOMS

CEMENTITIOUS WINDOW PANEL

40 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

K1 AND K2 CLASSROOMS

PRESSED WOOD WALL PANEL

3,200 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

K1 AND K2 CLASSROOMS

PRESSED WOOD WALL PANEL MASTIC

3,200 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

K1 AND K2 CLASSROOMS

VINYL WALL COVER MASTIC

3,200 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

CLASSROOMS PODS A-F, LIBRARY, AND MULTI-PURPOSE ROOM BUILDING

BOOK STORAGE / ELECTRICAL ROOM, AND CUSTODIAL ROOM

VINYL FLOOR TILE 240 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

BOOK STORAGE / ELECTRICAL ROOM, AND CUSTODIAL ROOM

VINYL FLOOR TILE MASTIC 240 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOMS IN PODS A-F

PRESSED WOOD WALL PANEL 6,800 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOMS IN PODS A-F

PRESSED WOOD WALL PANEL MASTIC 6,800 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

CLASSROOMS IN PODS A-F, ALL HALLWAYS, MULTI-USE ROOM, STAGE, AND LIBRARY

VINYL WALL COVER MASTIC 19,000 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOMS IN PODS A-F, LIBRARY, AND MEDIA CENTER

SMOOTH WALL MISCELLANEOUS 57,500 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOMS IN PODS A-F, LIBRARY, AND MEDIA CENTER

SMOOTH WALL SURFACING 57,500 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

ENTIRE BUILDING

FIRE DOOR CORE INSULATION 1,260 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR
RUSKIN ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

EXTERIOR WALLS AND OVERHANGS

ROUGH WALL

9,200 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

EXTERIOR WALLS AND OVERHANGS

ROUGH WALL SURFACING

9,200 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

EXTERIOR WINDOWS, AND CORRIDOR

CEMENTITIOUS WINDOW PANEL

830 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

STORAGE AND UTILITY ROOMS AT MEZZANINE LEVEL 2

SMOOTH WALL MISCELLANEOUS

4,000 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

THERMAL SYSTEM INSULATION IN CONCEALED LOCATIONS

PIPE FITTING INSULATION

(TBD) LF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOMS PODS G-H, AND MUSIC BUILDING

CLASSROOMS PODS G-H, AND MUSIC ROOMS

PRESSED WOOD WALL PANEL

2,640 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOMS PODS G-H, AND MUSIC ROOMS

PRESSED WOOD WALL PANEL MASTIC

2,640 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOMS PODS G-H, AND MUSIC ROOMS

VINYL WALL COVER MASTIC

2,640 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

ENTIRE BUILDING

BASEBOARD MASTIC

900 LF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

ENTIRE BUILDING

FIRE DOOR CORE INSULATION

88 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

ENTIRE BUILDING

SMOOTH WALL MISCELLANEOUS

12,160 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

ENTIRE BUILDING

SMOOTH WALL SURFACING

12,160 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR
RUSKIN ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

EXTERIOR WALLS AND OVERHANGS

ROUGH WALL

2,200 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

EXTERIOR WALLS AND OVERHANGS

ROUGH WALL SURFACING

2,200 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

EXTERIOR WINDOWS

CEMENTITIOUS WINDOW PANEL

36 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR
RUSKIN ELEMENTARY SCHOOL

BUILDING NAME**LOCATION****MATERIAL TYPE****RECOMMENDATION****QTY****(APPROXIMATE)**

CUSTODIAL SHED

CUSTODIAL SHED

STORAGE BUILDING

350 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

GARDEN SHED

GARDEN SHED

STORAGE BUILDING

40 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

KITCHEN, RESTROOMS AND STORAGE ROOMS BUILDING

ENTIRE BUILDING

FIRE DOOR CORE INSULATION

231 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

ENTIRE BUILDING

SMOOTH WALL MISCELLANEOUS 5,650 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

ENTIRE BUILDING

SMOOTH WALL SURFACING 5,650 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

EXTERIOR WALLS AND OVERHANGS

ROUGH WALL 1,800 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

EXTERIOR WALLS AND OVERHANGS

ROUGH WALL SURFACING 1,800 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR
RUSKIN ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

METAL STORAGE CONTAINER (1 EA)

METAL STORAGE CONTAINER (1 EA)

STORAGE CONTAINER

336 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

WOOD STORAGE SHED

WOOD STORAGE SHED

STORAGE BUILDING

30 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

End Of Report, Total Of 18 Pages

SAMPLES REPORT FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

ADMINISTRATION BUILDING

ADMINISTRATION BUILDING

ENTIRE BUILDING

FIRE DOOR CORE INSULATION

<u>22-025AAA</u>	2/16/2022	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

ADMINISTRATION BUILDING

ENTIRE BUILDING

SMOOTH WALL MISCELLANEOUS

<u>05-212AAA</u>	9/12/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

ADMINISTRATION BUILDING

ENTIRE BUILDING

SMOOTH WALL SURFACING

<u>06-223AAA</u>	8/24/2006	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

ADMINISTRATION BUILDING

EXTERIOR WALLS AND OVERHANGS

ROUGH WALL

<u>05-212AAA</u>	9/12/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

ADMINISTRATION BUILDING

EXTERIOR WALLS AND OVERHANGS

ROUGH WALL SURFACING

<u>05-212AAA</u>	9/12/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

ADMINISTRATION BUILDING

OFFICES, AND HALLWAY

VINYL WALL COVER MASTIC

<u>06-223AAA</u>	8/24/2006	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

SAMPLES REPORT FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

CLASSROOMS I1-I2 TECHNOLOGY PORTABLES BUILDING

CLASSROOMS I1-I2 TECHNOLOGY PORTABLES BUILDING

CLASSROOMS I1-I2
 BASEBOARD MASTIC

<u>05-212AAA</u>	9/12/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

<u>17-049-19</u>	3/7/2017	Negative	ND	NONE DETECTED	ND
-------------------------	----------	----------	----	---------------	----

Unit I, I2, White Mastic for Dark Blue 4" Baseboard.

CLASSROOMS I1-I2 TECHNOLOGY PORTABLES BUILDING

CLASSROOMS I1-I2
 CARPET MASTIC

<u>05-212AAA</u>	9/12/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

<u>17-049-18</u>	3/7/2017	Negative	ND	NONE DETECTED	ND
-------------------------	----------	----------	----	---------------	----

Unit I, I2, Yellow Mastic for Carpet on Concrete.

CLASSROOMS I1-I2 TECHNOLOGY PORTABLES BUILDING

CLASSROOMS I1-I2
 SMOOTH WALL MISCELLANEOUS

<u>06-223AAA</u>	8/24/2006	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS I1-I2 TECHNOLOGY PORTABLES BUILDING

CLASSROOMS I1-I2
 SUSPENDED CEILING TILE

<u>05-212AAA</u>	9/12/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS I1-I2 TECHNOLOGY PORTABLES BUILDING

CLASSROOMS I1-I2
 VINYL WALL COVER MASTIC

<u>06-223AAA</u>	8/24/2006	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS I1-I2 TECHNOLOGY PORTABLES BUILDING

CLASSROOMS I1-I2 WET / SINK AREAS, AND ENTRYWAYS
 VINYL FLOOR TILE

<u>05-212AAA</u>	9/12/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

SAMPLES REPORT FOR
RUSKIN ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

CLASSROOMS I1-I2 TECHNOLOGY PORTABLES BUILDING

CLASSROOMS I1-I2 WET / SINK AREAS, AND ENTRYWAYS

VINYL FLOOR TILE MASTIC

<u>05-212AAA</u>	9/12/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS I1-I2 TECHNOLOGY PORTABLES BUILDING

EXTERIOR WALLS

ROUGH WALL

<u>05-212AAA</u>	9/12/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS I1-I2 TECHNOLOGY PORTABLES BUILDING

EXTERIOR WALLS

ROUGH WALL SURFACING

<u>05-212AAA</u>	9/12/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

SAMPLES REPORT FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

CLASSROOMS J1 PORTABLE BUILDING (MUSIC ROOM)

CLASSROOMS J1 PORTABLE BUILDING (MUSIC ROOM)

CLASSROOM J-1 MUSIC ROOM

BASEBOARD MASTIC

<u>15-174AAA</u>	9/18/2015	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

<u>17-049-21</u>	3/7/2017	Negative	ND	NONE DETECTED	ND
-------------------------	----------	----------	----	---------------	----

Unit J, J1, White Mastic for Brown 4" Baseboard.

CLASSROOMS J1 PORTABLE BUILDING (MUSIC ROOM)

CLASSROOM J-1 MUSIC ROOM

CARPET MASTIC

<u>15-174AAA</u>	9/18/2015	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

<u>17-049-20</u>	3/7/2017	Negative	ND	NONE DETECTED	ND
-------------------------	----------	----------	----	---------------	----

Unit J, J1, Yellow Mastic for Carpet on Wood.

CLASSROOMS J1 PORTABLE BUILDING (MUSIC ROOM)

CLASSROOM J-1 MUSIC ROOM

FIRE DOOR CORE INSULATION

<u>15-174AAA</u>	9/18/2015	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS J1 PORTABLE BUILDING (MUSIC ROOM)

CLASSROOM J-1 MUSIC ROOM

PRESSED WOOD WALL PANEL MASTIC

<u>15-174AAA</u>	9/18/2015	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS J1 PORTABLE BUILDING (MUSIC ROOM)

CLASSROOM J-1 MUSIC ROOM

PRESSED-WOOD WALL PANEL

<u>15-174AAA</u>	9/18/2015	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS J1 PORTABLE BUILDING (MUSIC ROOM)

CLASSROOM J-1 MUSIC ROOM

SUSPENDED CEILING TILE

<u>15-174AAA</u>	9/18/2015	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

SAMPLES REPORT FOR
RUSKIN ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
--------------------------------	-------------	---------------	-----------------------------	--------------------------	--------------------------

CLASSROOMS J1 PORTABLE BUILDING (MUSIC ROOM)

CLASSROOM J-1 MUSIC ROOM

VINYL WALL COVER

<u>15-174AAA</u>	9/18/2015	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS J1 PORTABLE BUILDING (MUSIC ROOM)

CLASSROOM J-1 MUSIC ROOM

VINYL WALL COVER MASTIC

<u>15-174AAA</u>	9/18/2015	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

SAMPLES REPORT FOR
RUSKIN ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE NO.	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
COMMENTS					

CLASSROOMS J2 PORTABLE BUILDING

CLASSROOMS J2 PORTABLE BUILDING

PORTABLE J2

PORTABLE BUILDING

12-185.NS

10/11/2012 Negative

NEW MATERIAL

NO SAMPLE

NS

New 2012 Construction Relocatable Building per Manufacturer's Tag information.

SAMPLES REPORT FOR
RUSKIN ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE NO.	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
COMMENTS					

CLASSROOMS J3 PORTABLE BUILDING (GYM)

CLASSROOMS J3 PORTABLE BUILDING (GYM)

PORTABLE J3

PORTABLE BUILDING

05-212.NS

9/12/2005

Negative

NEW MATERIAL

NO SAMPLE

NS

New 2003 Construction Relocatable Building per Manufacturer's Tag information.

SAMPLES REPORT FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE No. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

CLASSROOMS K1-K2 BUILDING

CLASSROOMS K1-K2 BUILDING

CLASSROOMS, STORAGE ROOMS, AND RESTROOMS
 SMOOTH WALL MISCELLANEOUS

<u>05-212AAA</u>	9/12/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS K1-K2 BUILDING

CLASSROOMS, STORAGE ROOMS, AND RESTROOMS
 SMOOTH WALL SURFACING

<u>06-223AAA</u>	8/24/2006	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS K1-K2 BUILDING

ENTIRE BUILDING
 FIRE DOOR CORE INSULATION

<u>05-212AAA</u>	9/12/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS K1-K2 BUILDING

EXTERIOR WALLS AND OVERHANGS
 ROUGH WALL

<u>05-212AAA</u>	9/12/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS K1-K2 BUILDING

EXTERIOR WALLS AND OVERHANGS
 ROUGH WALL SURFACING

<u>05-212AAA</u>	9/12/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS K1-K2 BUILDING

K1 AND K2 CLASSROOMS
 CEMENTITIOUS WINDOW PANEL

<u>05-212AAA</u>	9/12/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS K1-K2 BUILDING

K1 AND K2 CLASSROOMS
 PRESSED WOOD WALL PANEL

<u>05-212AAA</u>	9/12/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

SAMPLES REPORT FOR
RUSKIN ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE No.	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
COMMENTS					

CLASSROOMS K1-K2 BUILDING

K1 AND K2 CLASSROOMS

PRESSED WOOD WALL PANEL MASTIC

<u>09-098AAA</u>	5/14/2009	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS K1-K2 BUILDING

K1 AND K2 CLASSROOMS

VINYL WALL COVER MASTIC

<u>05-212AAA</u>	9/12/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

SAMPLES REPORT FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

CLASSROOMS PODS A-F, LIBRARY, AND MULTI-PURPOSE ROOM BUILDING

CLASSROOMS PODS A-F, LIBRARY, AND MULTI-PURPOSE ROOM BUILDING

BOOK STORAGE / ELECTRICAL ROOM, AND CUSTODIAL ROOM
 VINYL FLOOR TILE

<u>05-212AAA</u>	9/12/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS PODS A-F, LIBRARY, AND MULTI-PURPOSE ROOM BUILDING

BOOK STORAGE / ELECTRICAL ROOM, AND CUSTODIAL ROOM
 VINYL FLOOR TILE MASTIC

<u>05-212AAA</u>	9/12/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS PODS A-F, LIBRARY, AND MULTI-PURPOSE ROOM BUILDING

CLASSROOMS IN PODS A-F
 PRESSED WOOD WALL PANEL

<u>09-098AAA</u>	5/14/2009	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS PODS A-F, LIBRARY, AND MULTI-PURPOSE ROOM BUILDING

CLASSROOMS IN PODS A-F
 PRESSED WOOD WALL PANEL MASTIC

<u>09-098AAA</u>	5/14/2009	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS PODS A-F, LIBRARY, AND MULTI-PURPOSE ROOM BUILDING

CLASSROOMS IN PODS A-F, ALL HALLWAYS, MULTI-USE ROOM, STAGE, AND LIBRARY
 VINYL WALL COVER MASTIC

<u>05-212AAA</u>	9/12/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS PODS A-F, LIBRARY, AND MULTI-PURPOSE ROOM BUILDING

CLASSROOMS IN PODS A-F, LIBRARY, AND MEDIA CENTER
 SMOOTH WALL MISCELLANEOUS

<u>05-212AAA</u>	9/12/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS PODS A-F, LIBRARY, AND MULTI-PURPOSE ROOM BUILDING

CLASSROOMS IN PODS A-F, LIBRARY, AND MEDIA CENTER
 SMOOTH WALL SURFACING

<u>06-223AAA</u>	8/24/2006	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

SAMPLES REPORT FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

CLASSROOMS PODS A-F, LIBRARY, AND MULTI-PURPOSE ROOM BUILDING

ENTIRE BUILDING

FIRE DOOR CORE INSULATION

<u>08-241AAA</u>	10/17/2008	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	------------	----------	---------	-----------	----

CLASSROOMS PODS A-F, LIBRARY, AND MULTI-PURPOSE ROOM BUILDING

EXTERIOR WALLS AND OVERHANGS

ROUGH WALL

<u>05-212AAA</u>	9/12/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS PODS A-F, LIBRARY, AND MULTI-PURPOSE ROOM BUILDING

EXTERIOR WALLS AND OVERHANGS

ROUGH WALL SURFACING

<u>05-212AAA</u>	9/12/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS PODS A-F, LIBRARY, AND MULTI-PURPOSE ROOM BUILDING

EXTERIOR WINDOWS, AND CORRIDOR

CEMENTITIOUS WINDOW PANEL

<u>05-212AAA</u>	9/12/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS PODS A-F, LIBRARY, AND MULTI-PURPOSE ROOM BUILDING

STORAGE AND UTILITY ROOMS AT MEZZANINE LEVEL 2

SMOOTH WALL MISCELLANEOUS

<u>09-098AAA</u>	5/14/2009	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS PODS A-F, LIBRARY, AND MULTI-PURPOSE ROOM BUILDING

THERMAL SYSTEM INSULATION IN CONCEALED LOCATIONS

PIPE FITTING INSULATION

<u>05-212AAA</u>	9/12/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

SAMPLES REPORT FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

CLASSROOMS PODS G-H, AND MUSIC BUILDING

CLASSROOMS PODS G-H, AND MUSIC BUILDING

CLASSROOMS PODS G-H, AND MUSIC ROOMS
 PRESSED WOOD WALL PANEL

<u>05-212AAA</u>	9/12/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS PODS G-H, AND MUSIC BUILDING

CLASSROOMS PODS G-H, AND MUSIC ROOMS
 PRESSED WOOD WALL PANEL MASTIC

<u>05-212AAA</u>	9/12/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

<u>05-212AAA</u>	9/12/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS PODS G-H, AND MUSIC BUILDING

CLASSROOMS PODS G-H, AND MUSIC ROOMS
 VINYL WALL COVER MASTIC

<u>05-212AAA</u>	9/12/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS PODS G-H, AND MUSIC BUILDING

ENTIRE BUILDING
 BASEBOARD MASTIC

<u>18-025AAA</u>	2/14/2018	Negative	NEW MATERIAL	NO SAMPLE	NS
-------------------------	-----------	----------	--------------	-----------	----

CLASSROOMS PODS G-H, AND MUSIC BUILDING

ENTIRE BUILDING
 FIRE DOOR CORE INSULATION

<u>08-241AAA</u>	10/17/2008	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	------------	----------	---------	-----------	----

CLASSROOMS PODS G-H, AND MUSIC BUILDING

ENTIRE BUILDING
 SMOOTH WALL MISCELLANEOUS

<u>05-212AAA</u>	9/12/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS PODS G-H, AND MUSIC BUILDING

ENTIRE BUILDING
 SMOOTH WALL SURFACING

<u>06-223AAA</u>	8/24/2006	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

SAMPLES REPORT FOR
RUSKIN ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE No. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

CLASSROOMS PODS G-H, AND MUSIC BUILDING

EXTERIOR WALLS AND OVERHANGS

ROUGH WALL

<u>05-212AAA</u>	9/12/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS PODS G-H, AND MUSIC BUILDING

EXTERIOR WALLS AND OVERHANGS

ROUGH WALL SURFACING

<u>05-212AAA</u>	9/12/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS PODS G-H, AND MUSIC BUILDING

EXTERIOR WINDOWS

CEMENTITIOUS WINDOW PANEL

<u>05-212AAA</u>	9/12/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

SAMPLES REPORT FOR
RUSKIN ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE NO.	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
COMMENTS					

CUSTODIAL SHED

CUSTODIAL SHED

CUSTODIAL SHED

STORAGE BUILDING

05-212.NS

9/12/2005

Negative

NEW MATERIAL

NO SAMPLE

NS

Wood Shed.

SAMPLES REPORT FOR
RUSKIN ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE NO.	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
COMMENTS					

GARDEN SHED

GARDEN SHED

GARDEN SHED

STORAGE BUILDING

09-098.NS

5/14/2009

Negative

NEW MATERIAL

NO SAMPLE

NS

Wood Shed.

SAMPLES REPORT FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

KITCHEN, RESTROOMS AND STORAGE ROOMS BUILDING

KITCHEN, RESTROOMS AND STORAGE ROOMS BUILDING

ENTIRE BUILDING

FIRE DOOR CORE INSULATION

<u>05-212AAA</u>	9/12/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

KITCHEN, RESTROOMS AND STORAGE ROOMS BUILDING

ENTIRE BUILDING

SMOOTH WALL MISCELLANEOUS

<u>05-212AAA</u>	9/12/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

KITCHEN, RESTROOMS AND STORAGE ROOMS BUILDING

ENTIRE BUILDING

SMOOTH WALL SURFACING

<u>06-223AAA</u>	8/24/2006	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

KITCHEN, RESTROOMS AND STORAGE ROOMS BUILDING

EXTERIOR WALLS AND OVERHANGS

ROUGH WALL

<u>06-223AAA</u>	8/24/2006	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

KITCHEN, RESTROOMS AND STORAGE ROOMS BUILDING

EXTERIOR WALLS AND OVERHANGS

ROUGH WALL SURFACING

<u>06-223AAA</u>	8/24/2006	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

SAMPLES REPORT FOR
RUSKIN ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE NO.	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
COMMENTS					

METAL STORAGE CONTAINER (1 EA)

METAL STORAGE CONTAINER (1 EA)

METAL STORAGE CONTAINER (1 EA)

STORAGE CONTAINER

16-074.NS

3/21/2016

Positive

ASSUMED

NO SAMPLE

NS

Metal Storage Structure.

SAMPLES REPORT FOR
RUSKIN ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE NO.	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
COMMENTS					

WOOD STORAGE SHED

WOOD STORAGE SHED

WOOD STORAGE SHED

STORAGE BUILDING

09-212.NS

9/9/2009

Negative

NEW MATERIAL

NO SAMPLE

NS

Wood Storage Shed.

End Of Report, Total Of 18 Pages

DAMAGE REPORT FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
RISK ASSESMENT CATEGORY	COMMENTS			

CLASSROOMS I1-I2 TECHNOLOGY PORTABLES BUILDING

CLASSROOMS I1-I2 TECHNOLOGY PORTABLES BUILDING

CLASSROOMS I1-I2

CARPET MASTIC	1,180 SF	P: Less Than 5% W: No Evidence
---------------	----------	---

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/12/2005	Mastic/Adhesive for Grey Carpet. This Material is in GOOD condition as of this date.
09/13/2016	Damage observed. Damage: <5% Physical Damage - approximately 10 LF in each room the Carpet is coming loose. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.
03/07/2017	Sample 17-049-18 collected from Unit I, I2, Yellow Mastic for Carpet on Concrete.
01/31/2020	This Material is unchanged as of this date.
08/28/2020	This Material is unchanged as of this date.
02/08/2021	This Material is unchanged as of this date.
08/11/2021	This Material is unchanged as of this date.
02/18/2022	This Material is unchanged as of this date.
08/17/2022	This Material is unchanged as of this date.
02/15/2023	Additional Damage Observed. <5% Physical Damage in the form of 8 SF of Wavy and Detatched Carpet in Various Locations in Classroom I2. No other changes as of this date.
08/08/2023	This Material is unchanged as of this date.
02/14/2024	This Material is unchanged as of this date.
08/14/2024	This Material is unchanged as of this date.
02/27/2025	This Material is unchanged as of this date.
09/17/2025	This Material is unchanged as of this date.

CLASSROOMS I1-I2 TECHNOLOGY PORTABLES BUILDING

CLASSROOMS I1-I2

SUSPENDED CEILING TILE	1,824 SF	P: Less Than 5% W: <10% Stains or Flaking
------------------------	----------	--

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/12/2005	2'x 4' White Suspended Ceiling Tiles, with Gouged and Pin Hole Pattern. This Material is in GOOD condition as of this date. (Original entry updated 03/17/15).
------------	--

DAMAGE REPORT FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

12/02/2011	Damage: <10% Water Damage - in the form of 1 Tile Water Damaged in Classroom I2; <5% Physical Damage - in the form of 2 Tiles loose in Classroom I1. Material condition changed from GOOD to FAIR overall as of this date. No other changes as of this date.					
03/21/2016	Material Quantity Re-Assessed. Material Quantity changed from 1,440 SF to 1,824 SF. No other changes as of this date.					
03/29/2017	Additional Damage Observed. 3 Tiles with Water Damage in Classroom I2. Both Classrooms have several Tiles with Broken and Chipped Edges. No other changes as of this date.					
02/14/2018	Additional Damage Observed. 2 Tiles have Water Damage in Classroom I1. No oter changes as of this date.					
01/31/2020	This Material is unchanged as of this date.					
08/28/2020	This Material is unchanged as of this date.					
02/08/2021	This Material is unchanged as of this date.					
08/11/2021	This Material is unchanged as of this date.					
02/18/2022	This Material is unchanged as of this date.					
08/17/2022	This Material is unchanged as of this date.					
02/15/2023	This Material is unchanged as of this date.					
08/08/2023	This Material is unchanged as of this date.					
02/14/2024	This Material is unchanged as of this date.					
08/14/2024	This Material is unchanged as of this date.					
02/27/2025	This Material is unchanged as of this date.					
09/17/2025	This Material is unchanged as of this date.					

CLASSROOMS I1-I2 TECHNOLOGY PORTABLES BUILDING

CLASSROOMS I1-I2 WET / SINK AREAS, AND ENTRYWAYS

VINYL FLOOR TILE	260 SF	P: Less Than 5% W: No Evidence
------------------	--------	-----------------------------------

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/12/2005	12"x 12" Off-White Vinyl Floor Tile. This Material is in GOOD condition as of this date.					
12/02/2011	Damage: <5% Physical Damage - in the form of 3 Vinyl Floor Tiles are broken and cracked next to Entry Door. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.					
09/13/2016	Additional Damage Observed. 8 Tiles near the Sink area in I-2 are Water Damaged. There are also 2 cracked Tiles in the Doorway of I-1. No other changes as of this date.					
02/14/2018	Additional Damage Observed. 3 Tiles Cracked in the Dooryway of I1. No other changes as of this date.					
01/31/2020	This Material is unchanged as of this date.					

DAMAGE REPORT FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RISK ASSESMENT CATEGORY

COMMENTS

QTY
(APPROXIMATE)

PHYSICAL DAMAGE (P:)
WATER DAMAGE (W:)

08/28/2020 This Material is unchanged as of this date.
02/08/2021 This Material is unchanged as of this date.
08/11/2021 This Material is unchanged as of this date.
02/18/2022 This Material is unchanged as of this date.
08/17/2022 This Material is unchanged as of this date.
02/15/2023 This Material is unchanged as of this date.
08/08/2023 This Material is unchanged as of this date.
02/14/2024 This Material is unchanged as of this date.
08/14/2024 This Material is unchanged as of this date.
02/27/2025 This Material is unchanged as of this date.
09/17/2025 This Material is unchanged as of this date.

CLASSROOMS I1-I2 TECHNOLOGY PORTABLES BUILDING

CLASSROOMS I1-I2 WET / SINK AREAS, AND ENTRYWAYS

VINYL FLOOR TILE MASTIC

260 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/12/2005 Mastic/Adhesive for 12"x 12" Off-White Vinyl Floor Tile. This Material is in GOOD condition as of this date.
12/02/2011 Damage: <5% Physical Damage - in the form of 3 Vinyl Floor Tiles are broken and cracked next to Entry Door. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.
09/13/2016 Additional Damage Observed. 8 Tiles near the Sink area in I-2 are Water Damaged. There are also 2 cracked Tiles in the Doorway of I-1. No other changes as of this date.
02/14/2018 Additional Damage Observed. 3 Tiles Cracked in the Doorway of I1. No other changes as of this date.
01/31/2020 This Material is unchanged as of this date.
08/28/2020 This Material is unchanged as of this date.
02/08/2021 This Material is unchanged as of this date.
08/11/2021 This Material is unchanged as of this date.
02/18/2022 This Material is unchanged as of this date.
08/17/2022 This Material is unchanged as of this date.
02/15/2023 This Material is unchanged as of this date.
08/08/2023 This Material is unchanged as of this date.

DAMAGE REPORT FOR
RUSKIN ELEMENTARY SCHOOL

BUILDING NAME		QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
LOCATION	MATERIAL TYPE		
RISK ASSESMENT CATEGORY			
COMMENTS			

02/14/2024	This Material is unchanged as of this date.
08/14/2024	This Material is unchanged as of this date.
02/27/2025	This Material is unchanged as of this date.
09/17/2025	This Material is unchanged as of this date.

DAMAGE REPORT FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P: WATER DAMAGE (W:)
RISK ASSESSMENT CATEGORY	COMMENTS			

CLASSROOMS J1 PORTABLE BUILDING (MUSIC ROOM)

CLASSROOMS J1 PORTABLE BUILDING (MUSIC ROOM)

CLASSROOM J-1 MUSIC ROOM

PRESSED WOOD WALL PANEL MASTIC	1,050 SF	P: Less Than 5%
		W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/18/2015	Mastic/Adhesive for 4'x9' Pressed Wood Wall Panel, (with Vinyl Wall Cover). This Material is in GOOD condition as of this date.
08/08/2018	Damage Observed. <5% Physical Damage - in the form of Small Holes and Tears in Scattered Locations to Wall System. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.
01/31/2020	This Material is unchanged as of this date.
08/28/2020	This Material is unchanged as of this date.
02/10/2021	This Material is unchanged as of this date.
08/11/2021	This Material is unchanged as of this date.
02/18/2022	This Material is unchanged as of this date.
08/17/2022	This Material is unchanged as of this date.
02/15/2023	This Material is unchanged as of this date.
08/08/2023	This Material is unchanged as of this date.
02/14/2024	This Material is unchanged as of this date.
08/14/2024	This Material is unchanged as of this date.
02/27/2025	This Material is unchanged as of this date.
09/17/2025	This Material is unchanged as of this date.

CLASSROOMS J1 PORTABLE BUILDING (MUSIC ROOM)

CLASSROOM J-1 MUSIC ROOM

SUSPENDED CEILING TILE	960 SF	P: Less Than 5%
		W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/18/2015	2'x4' Vinyl Covered Fiberglass Suspended Ceiling Tile. This Material is in GOOD condition as of this date.
03/29/2017	Damage Observed. <5% Physical Damage - in the form of 1 Tile is Warped, 2 Tiles have loose Vinyl and 11 Tiles have dark stains. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.
08/29/2017	Additional Damaged Observed. 5 Tiles now have Loose Vinyl. No other changes as of this date.

DAMAGE REPORT FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

01/31/2020	This Material is unchanged as of this date.
08/28/2020	This Material is unchanged as of this date.
02/10/2021	This Material is unchanged as of this date.
08/11/2021	This Material is unchanged as of this date.
02/18/2022	This Material is unchanged as of this date.
08/17/2022	This Material is unchanged as of this date.
02/15/2023	This Material is unchanged as of this date.
08/08/2023	This Material is unchanged as of this date.
02/14/2024	This Material is unchanged as of this date.
08/14/2024	This Material is unchanged as of this date.
02/27/2025	This Material is unchanged as of this date.
09/17/2025	This Material is unchanged as of this date.

CLASSROOMS J1 PORTABLE BUILDING (MUSIC ROOM)

CLASSROOM J-1 MUSIC ROOM

VINYL WALL COVER

1,050 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/18/2015	Vinyl Wall Cover, (on 4'x9' Pressed Wood Wall Panel). This Material is in GOOD condition as of this date.
08/08/2018	Damage Observed. <5% Physical Damage - in the form of Small Holes and Tears in Scattered Locations to Wall System. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.
01/31/2020	This Material is unchanged as of this date.
08/28/2020	This Material is unchanged as of this date.
02/10/2021	This Material is unchanged as of this date.
08/11/2021	This Material is unchanged as of this date.
02/18/2022	This Material is unchanged as of this date.
08/17/2022	This Material is unchanged as of this date.
02/15/2023	This Material is unchanged as of this date.
08/08/2023	This Material is unchanged as of this date.
02/14/2024	This Material is unchanged as of this date.
08/14/2024	This Material is unchanged as of this date.

DAMAGE REPORT FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME			
LOCATION			
MATERIAL TYPE		QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:)
RISK ASSESMENT CATEGORY			WATER DAMAGE (W:)
COMMENTS			

02/27/2025	This Material is unchanged as of this date.
09/17/2025	This Material is unchanged as of this date.

DAMAGE REPORT FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

CLASSROOMS PODS A-F, LIBRARY, AND MULTI-PURPOSE ROOM BUILDING

CLASSROOMS PODS A-F, LIBRARY, AND MULTI-PURPOSE ROOM BUILDING

BOOK STORAGE / ELECTRICAL ROOM, AND CUSTODIAL ROOM

VINYL FLOOR TILE

240 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/12/2005	9"x 9" Vinyl Floor Tile. This Material is in GOOD condition as of this date.
08/24/2006	<5% Physical Damage. 1 tile is missing and 2 are chipped in Custodian Closet. Friability changed from NON to FRIABLE. Material Condition changed from GOOD to FAIR overall. No other changes as of this date.
03/06/2007	Additional Damage in the form of approximately 2 Tiles are missing. 5 other Tiles are chipped in both rooms. No other changes as of this date.
12/02/2011	Location Description changed from ELECTRICAL ROOM, AND CUSTODIAL ROOM to BOOK STORAGE / ELECTRICAL ROOM, AND CUSTODIAL ROOM. Additional Damage observed - in the form of 1 Tile is broken in Custodial Room, and 2 Tiles broken in Book Storage/Electrical Room with Black Mastic/Adhesive exposed. No other changes as of this date.
01/31/2020	This Material is unchanged as of this date.
08/28/2020	This Material is unchanged as of this date.
02/10/2021	This Material is unchanged as of this date.
08/11/2021	This Material is unchanged as of this date.
02/18/2022	This Material is unchanged as of this date.
08/17/2022	This Material is unchanged as of this date.
02/15/2023	This Material is unchanged as of this date.
02/15/2023	This Material is unchanged as of this date.
08/16/2023	This Material is unchanged as of this date.
02/14/2024	This Material is unchanged as of this date.
08/14/2024	This Material is unchanged as of this date.
02/27/2025	This Material is unchanged as of this date.
09/17/2025	This Material is unchanged as of this date.

DAMAGE REPORT FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
RISK ASSESSMENT CATEGORY	COMMENTS			

CLASSROOMS PODS A-F, LIBRARY, AND MULTI-PURPOSE ROOM BUILDING

BOOK STORAGE / ELECTRICAL ROOM, AND CUSTODIAL ROOM

VINYL FLOOR TILE MASTIC	240 SF	P: Less Than 5% W: No Evidence
-------------------------	--------	-----------------------------------

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/12/2005	Mastic/Adhesive for 9"x 9" Vinyl Floor Tile. This Material is in GOOD condition as of this date.
08/24/2006	<5% Physical Damage. 1 tile is missing and 2 are chipped in Custodian Closet. Friability changed from NON to FRIABLE. Material Condition changed from GOOD to FAIR overall. No other changes as of this date.
03/06/2007	Additional Damage in the form of approximately 2 Tiles are missing. 5 other Tiles are chipped in both rooms. No other changes as of this date.
12/02/2011	Location Description changed from ELECTRICAL ROOM, AND CUSTODIAL ROOM to BOOK STORAGE / ELECTRICAL ROOM, AND CUSTODIAL ROOM. Additional Damage observed - in the form of 1 Tile is broken in Custodial Room, and 2 Tiles broken in Book Storage/Electrical Room with Black Mastic/Adhesive exposed. No other changes as of this date.
01/31/2020	This Material is unchanged as of this date.
08/28/2020	This Material is unchanged as of this date.
02/10/2021	This Material is unchanged as of this date.
08/11/2021	This Material is unchanged as of this date.
02/18/2022	This Material is unchanged as of this date.
08/17/2022	This Material is unchanged as of this date.
02/15/2023	This Material is unchanged as of this date.
08/16/2023	This Material is unchanged as of this date.
02/14/2024	This Material is unchanged as of this date.
08/14/2024	This Material is unchanged as of this date.
02/27/2025	This Material is unchanged as of this date.
09/17/2025	This Material is unchanged as of this date.

CLASSROOMS PODS A-F, LIBRARY, AND MULTI-PURPOSE ROOM BUILDING

CLASSROOMS IN PODS A-F, ALL HALLWAYS, MULTI-USE ROOM, STAGE, AND LIBRARY

VINYL WALL COVER MASTIC	19,000 SF	P: Less Than 5% W: No Evidence
-------------------------	-----------	-----------------------------------

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/12/2005	Mastic/Adhesive for Vinyl Covering on Gypsum Wallboard System and Pressed Wood Wall Panels. This Material is in GOOD condition as of this date.
------------	---

DAMAGE REPORT FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME		QTY (APPROXIMATE)	PHYSICAL DAMAGE (P): WATER DAMAGE (W:)
LOCATION	MATERIAL TYPE		
RISK ASSESMENT CATEGORY			
COMMENTS			
09/03/2010	Location Description changed from CLASSROOMS IN PODS A-F to CLASSROOMS IN PODS A-F, ALL HALLWAYS, MULTIUSE ROOM, STAGE, AND LIBRARY. Quantity changed from 6,800 SF to 19,000 SF. No other changes as of this date.		
09/18/2015	Damage observed, Hallway between Pods B and C has 15 LF of Material with Physical Damage. Material condition changed from GOOD to FAIR overall. Friability changed from NON to FRIABLE. No other changes as of this date.		
01/31/2020	This Material is unchanged as of this date.		
08/28/2020	Additional Damage Observed. <5% Physical Damage in the form of 1 SF of Torn Wall Cover on Lower wall in Hallway near West Enterance into Library. Material remains in FAIR condition overall. No other changes as of this date.		
02/10/2021	This Material is unchanged as of this date.		
08/11/2021	This Material is unchanged as of this date.		
02/18/2022	This Material is unchanged as of this date.		
08/17/2022	This Material is unchanged as of this date.		
02/15/2023	This Material is unchanged as of this date.		
08/16/2023	This Material is unchanged as of this date.		
02/14/2024	This Material is unchanged as of this date.		
08/14/2024	This Material is unchanged as of this date.		
02/27/2025	This Material is unchanged as of this date.		
09/17/2025	This Material is unchanged as of this date.		

DAMAGE REPORT FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESSMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	--------------------------	----------	----------------------	---

CLASSROOMS PODS G-H, AND MUSIC BUILDING

CLASSROOMS PODS G-H, AND MUSIC BUILDING

CLASSROOMS PODS G-H, AND MUSIC ROOMS

PRESSED WOOD WALL PANEL	2,640 SF	P: Less Than 5% W: No Evidence
-------------------------	----------	---

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/12/2005	4'x 8' Pressed Wood Wall Panels (with Vinyl Cover and Joint Compound), over Gypsum Wallboard System. This Material is in GOOD condition as of this date.
01/31/2020	This Material is unchanged as of this date.
08/28/2020	This Material is unchanged as of this date.
02/10/2021	This Material is unchanged as of this date.
08/11/2021	This Material is unchanged as of this date.
02/18/2022	This Material is unchanged as of this date.
08/17/2022	Damage Observed. <5% Physical Damage in the form of 12 LF of Torn, Loose Edges with Cuts around the Electrical Panel with Mastic and Pressed Wood Exposed in Music Room. Material condition changed from GOOD to FAIR overall. Friability updated from Non-Friable to Friable. No other changes as of this date.
02/15/2023	This Material is unchanged as of this date.
08/08/2023	This Material is unchanged as of this date.
08/14/2024	This Material is unchanged as of this date.
02/27/2025	This Material is unchanged as of this date.
09/17/2025	This Material is unchanged as of this date.

CLASSROOMS PODS G-H, AND MUSIC BUILDING

CLASSROOMS PODS G-H, AND MUSIC ROOMS

PRESSED WOOD WALL PANEL MASTIC	2,640 SF	P: Less Than 5% W: No Evidence
--------------------------------	----------	---

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/12/2005	Mastic/Adhesive for 4'x 8' Pressed Wood Wall Panels (with Vinyl Cover and Joint Compound), over Gypsum Wallboard System. This Material is in GOOD condition as of this date.
01/31/2020	This Material is unchanged as of this date.
08/28/2020	This Material is unchanged as of this date.
02/10/2021	This Material is unchanged as of this date.
08/11/2021	This Material is unchanged as of this date.
02/18/2022	This Material is unchanged as of this date.

DAMAGE REPORT FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME		QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
LOCATION	MATERIAL TYPE		
RISK ASSESMENT CATEGORY			
COMMENTS			

08/17/2022	Damage Observed. <5% Physical Damage in the form of 12 LF of Torn, Loose Edges with Cuts around the Electrical Panel with Mastic and Pressed Wood Exposed. Material condition changed from GOOD to FAIR overall. Friability updated from Non-Friable to Friable. No other changes as of this date.
02/15/2023	This Material is unchanged as of this date.
08/08/2023	This Material is unchanged as of this date.
08/14/2024	This Material is unchanged as of this date.
02/27/2025	This Material is unchanged as of this date.
09/17/2025	This Material is unchanged as of this date.

CLASSROOMS PODS G-H, AND MUSIC BUILDING

CLASSROOMS PODS G-H, AND MUSIC ROOMS

VINYL WALL COVER MASTIC	2,640 SF	P: Less Than 5% W: No Evidence
-------------------------	----------	-----------------------------------

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

05/14/2009	Mastic/Adhesive for Vinyl Wall Cover (on 4'x 8' Pressed Wood Wall Panels (with Joint Compound), over Gypsum Wallboard System. This Material is in GOOD condition as of this date.
01/31/2020	This Material is unchanged as of this date.
08/28/2020	This Material is unchanged as of this date.
02/10/2021	This Material is unchanged as of this date.
08/11/2021	This Material is unchanged as of this date.
02/18/2022	This Material is unchanged as of this date.
08/17/2022	Damage Observed. <5% Physical Damage in the form of 12 LF of Torn, Loose Edges with Cuts around the Electrical Panel with Mastic and Pressed Wood Exposed. Material condition changed from GOOD to FAIR overall. Friability updated from Non-Friable to Friable. No other changes as of this date.
02/15/2023	This Material is unchanged as of this date.
08/08/2023	This Material is unchanged as of this date.
08/14/2024	This Material is unchanged as of this date.
02/27/2025	This Material is unchanged as of this date.
09/17/2025	This Material is unchanged as of this date.

DAMAGE REPORT FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

CLASSROOMS PODS G-H, AND MUSIC BUILDING

ENTIRE BUILDING

BASEBOARD MASTIC

900 LF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

02/14/2018	Mastic/Adhesive for 4" Dark Gray Baseboard. This Material is in GOOD condition as of this date.
01/31/2020	This Material is unchanged as of this date.
08/28/2020	Damage Observed. <5% Physical Damage in the form of 1 LF of Baseboard with Detached Edges on West Wall of Classroom G2. Material condition changed from GOOD to FAIR overall. Friability updated from Non-Friable to Friable. No other changes as of this date.
02/10/2021	This Material is unchanged as of this date.
08/11/2021	This Material is unchanged as of this date.
02/18/2022	This Material is unchanged as of this date.
08/17/2022	This Material is unchanged as of this date.
02/15/2023	This Material is unchanged as of this date.
08/08/2023	This Material is unchanged as of this date.
02/14/2024	This Material is unchanged as of this date.
02/14/2024	This Material is unchanged as of this date.
08/14/2024	This Material is unchanged as of this date.
02/27/2025	This Material is unchanged as of this date.
09/17/2025	This Material is unchanged as of this date.

CLASSROOMS PODS G-H, AND MUSIC BUILDING

ENTIRE BUILDING

SMOOTH WALL MISCELLANEOUS

12,160 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/12/2005	Gypsum Wallboard System Walls and Ceilings, (with Skim Coat, behind other finishes). Existing Gypsum Wallboard Systems Removed and Replaced with new in-kind in Path-of-Construction. This Material is in GOOD condition as of this date.
03/05/2014	<5% Physical Damage in the form of 2 LF of Joint Tape and Joint Compound is Damaged in Office H3. Material changed from NON to FRIABLE. No other changes as of this date.
01/31/2020	This Material is unchanged as of this date.
08/28/2020	This Material is unchanged as of this date.

DAMAGE REPORT FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

02/10/2021	This Material is unchanged as of this date.					
08/11/2021	This Material is unchanged as of this date.					
02/18/2022	This Material is unchanged as of this date.					
08/17/2022	Additional Damage Observed. <5% Physical Damage in the form of 2 SF of Loose, Peling Skim Coat and Paint with Exposed Joint Tape and Mud on Ceiling of Music Room. No other changes as of this date.					
02/15/2023	This Material is unchanged as of this date.					
08/08/2023	This Material is unchanged as of this date.					
08/14/2024	This Material is unchanged as of this date.					
02/27/2025	This Material is unchanged as of this date.					
09/17/2025	This Material is unchanged as of this date.					

CLASSROOMS PODS G-H, AND MUSIC BUILDING

ENTIRE BUILDING

SMOOTH WALL SURFACING	12,160 SF	P: Less Than 5% W: No Evidence
-----------------------	-----------	-----------------------------------

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

08/24/2006	Skim Coat for Gypsum Wallboard System Walls and Ceilings, (behind other finishes). Existing Gypsum Wallboard Systems Removed and Replaced with new in-kind in Path-of-Construction. This Material is in GOOD condition as of this date.					
03/05/2014	<5% Physical Damage in the form of 2 LF of Joint Tape and Joint Compound is Damaged in Office H3. Material changed from NON to FRIABLE. No other changes as of this date.					
01/31/2020	This Material is unchanged as of this date.					
08/28/2020	This Material is unchanged as of this date.					
02/10/2021	This Material is unchanged as of this date.					
08/11/2021	This Material is unchanged as of this date.					
02/18/2022	This Material is unchanged as of this date.					
08/17/2022	Additional Damage Observed. <5% Physical Damage in the form of 2 SF of Loose, Peling Skim Coat and Paint with Exposed Joint Tape and Mud on Ceiling of Music Room. No other changes as of this date.					
02/15/2023	This Material is unchanged as of this date.					
08/08/2023	This Material is unchanged as of this date.					
02/14/2024	This Material is unchanged as of this date.					
08/14/2024	This Material is unchanged as of this date.					
02/27/2025	This Material is unchanged as of this date.					

DAMAGE REPORT FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RISK ASSESMENT CATEGORY

COMMENTS

QTY
(APPROXIMATE)

PHYSICAL DAMAGE (P:)
WATER DAMAGE (W:)

09/17/2025 This Material is unchanged as of this date.

DAMAGE REPORT FOR

RUSKIN ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

KITCHEN, RESTROOMS AND STORAGE ROOMS BUILDING

KITCHEN, RESTROOMS AND STORAGE ROOMS BUILDING

ENTIRE BUILDING

SMOOTH WALL MISCELLANEOUS

5,650 SF

P: Less Than 5%

W: <10% Stains or Flaking

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/12/2005	Gypsum Wallboard System Walls and Ceilings, (with Skim Coat, behind other finishes). Existing Gypsum Wallboard Systems Removed and Replaced with new in-kind in Path-of-Construction. <5% Physical Damage. Approximately 5 SF damaged in Exterior Storage Closet. This Material is in FAIR condition overall as of this date.
05/14/2009	Physical Damages in the form of cuts, holes and gouges observed in the Kitchen next to the Food Serving Room, Storage Room ceiling and Kitchen next to the sink. <10% Water Damage. Water Damage observed on the Ceiling of the Storage Room. No other changes as of this date.
12/02/2011	Additional Damage - in the form of approximately 5 SF of Damage on Wall in Kitchen. No other changes as of this date.
08/29/2017	Additional Damage and Partial Repairs Observed. Kitchen Storage Room now has 12 SF of Scattered Damages in the form of Stains and Peeled Skim Coat. No other changes as of this date.
01/31/2020	This Material is unchanged as of this date.
08/28/2020	This Material is unchanged as of this date.
02/10/2021	This Material is unchanged as of this date.
08/11/2021	This Material is unchanged as of this date.
02/18/2022	This Material is unchanged as of this date.
08/17/2022	This Material is unchanged as of this date.
02/15/2023	This Material is unchanged as of this date.
08/16/2023	This Material is unchanged as of this date.
02/14/2024	This Material is unchanged as of this date.
08/14/2024	This Material is unchanged as of this date.
02/27/2025	This Material is unchanged as of this date.
09/17/2025	This Material is unchanged as of this date.

End Of Report, Total Of 16 Pages

Playground
and
Snack
Area

Garbage

Storage

Fire Lane -- Keep Clear

Parking

Parking

Parking

Landscape

Landscape



Turlock Lane

Fire Lane -- Keep Clear

Landscape

Parking

Playground

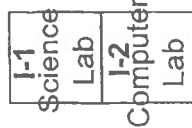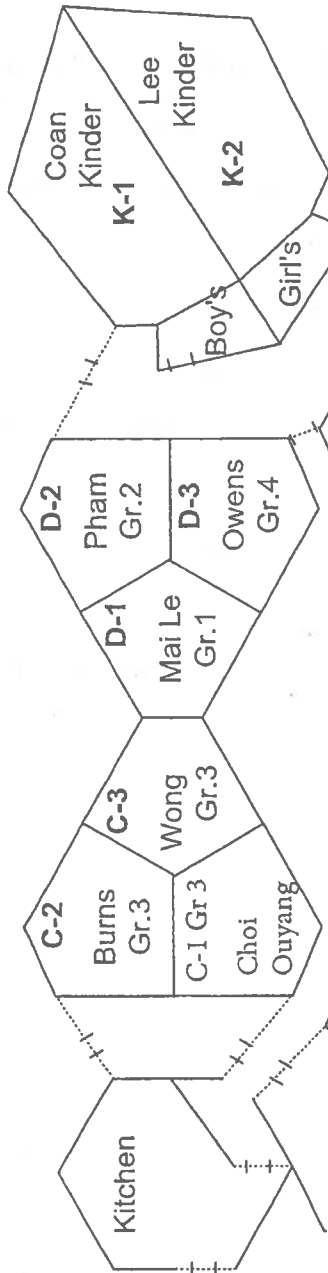

RUSKIN ELEMENTARY SCHOOL
INSPECTED ON: 9-17-25

Ruskin Elementary School

1401 Turlock Lane

San Jose, CA 95132

(408)923-1950

Fax: (408)937-4846

Principal: Parisa Nunez

Rev. 8/2014

Playground
and
Snack
Area

Garbage

Storage

Fire Lane — Keep Clear

Parking

Parking

Parking

Landscape

Landscape

Turlock Lane

Fire Lane — Keep Clear

Landscape

Parking

Rev.8/2014

RUSKIN ELEMENTARY SCHOOL
INSPECTED ON: **2-27-25**

Ruskin Elementary School

1401 Turlock Lane

San Jose, CA 95132

(408)923-1950

Fax: (408)937-4846

Principal: Parisa Nunez

Playground

I-1
Science
Lab


I-2
Computer
Lab

J-1
Music
Rm

J-2
Jie-ye
Gr 4

J-3
Gym

Garden
Shed

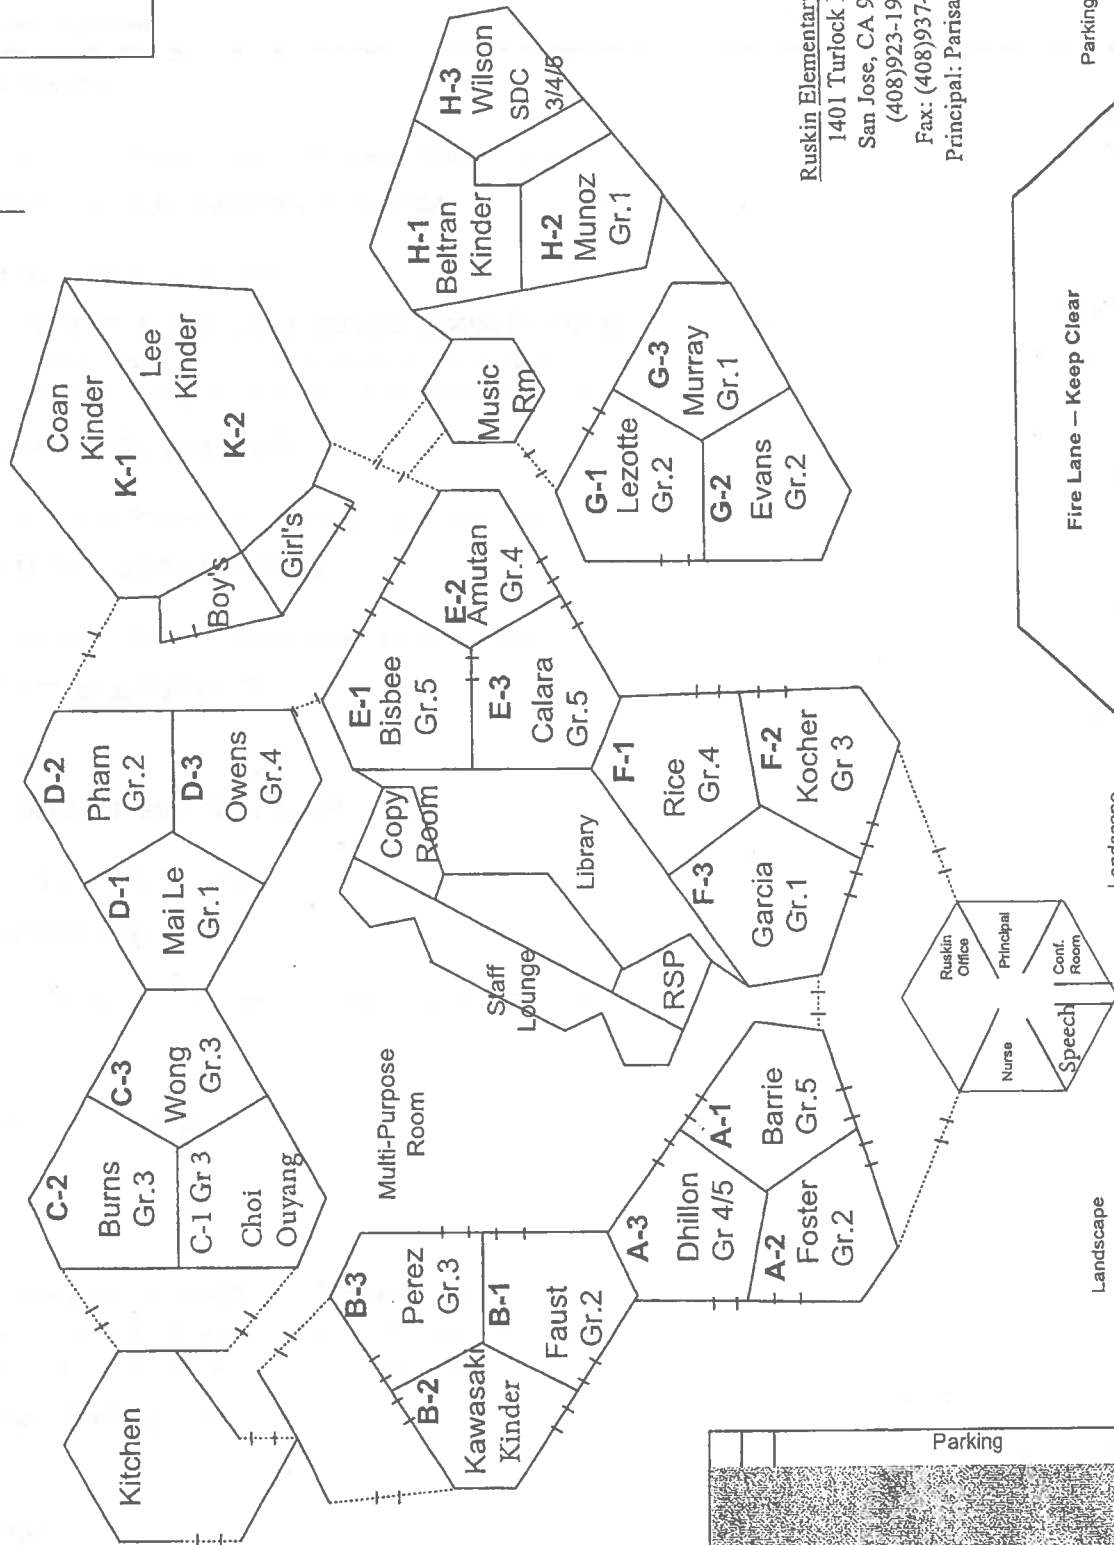

Playground
and
Snack
Area

Garbage

Storage

Fire Lane -- Keep Clear

Parking

Parking

Parking

Parking

Landscape

Landscape


Fire Lane -- Keep Clear

Landscape

Turlock Lane

Rev.8/2014

Playground

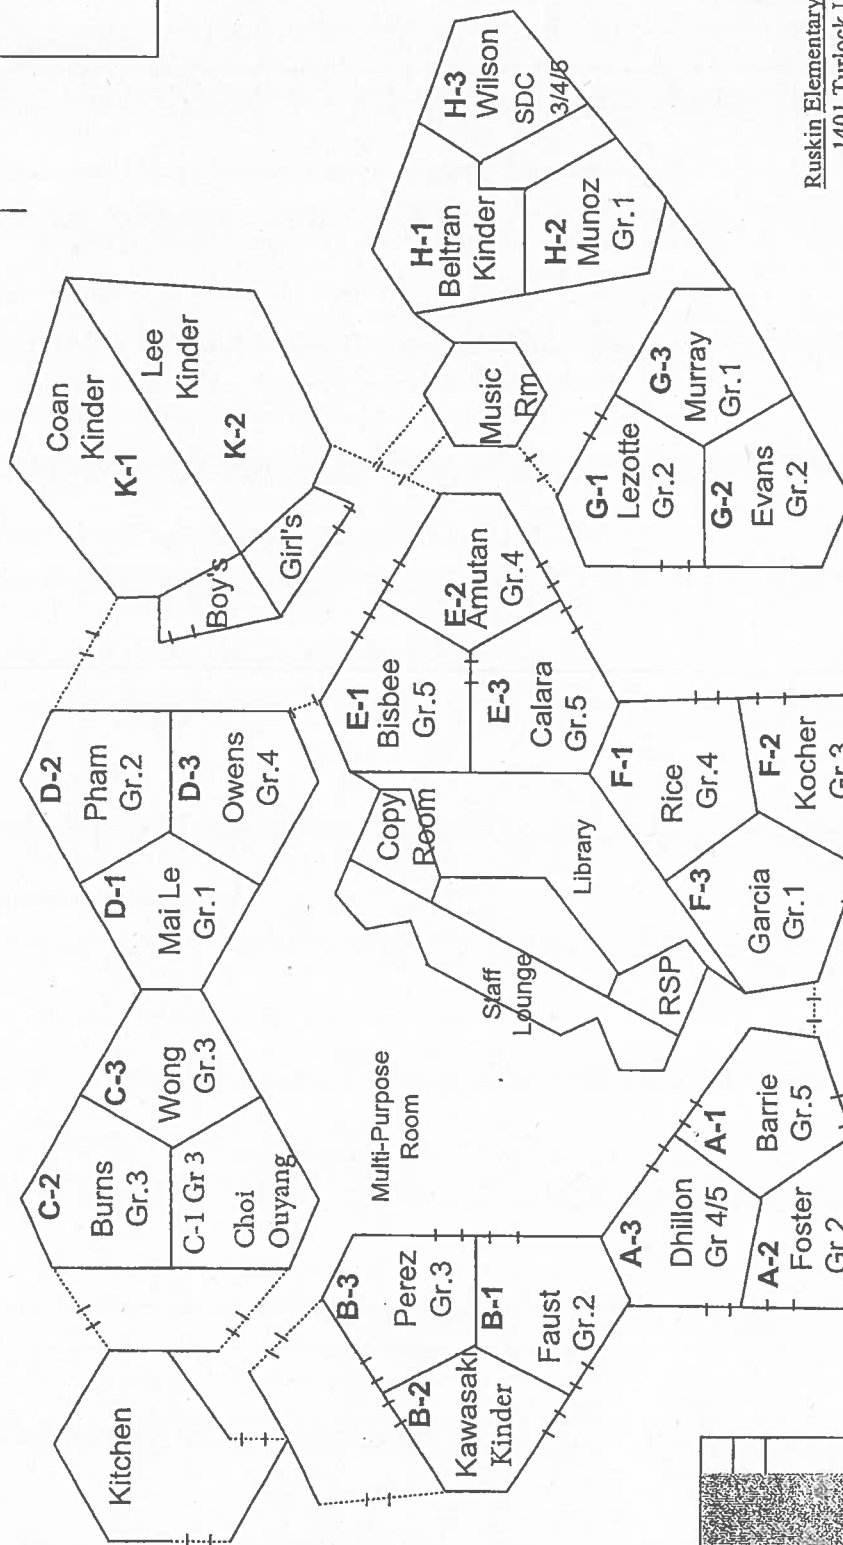


I-1 Science Lab
I-2 Computer Lab

J-1 Music Rm
J-2 Jie-ye Gr.4
J-3 Gym

Garden Shed

RUSKIN ELEMENTARY SCHOOL
INSPECTED ON 8-19-24

Ruskin Elementary School
1401 Turlock Lane
San Jose, CA 95132
(408)923-1950
Fax: (408)937-4846
Principal: Parisa Nunez

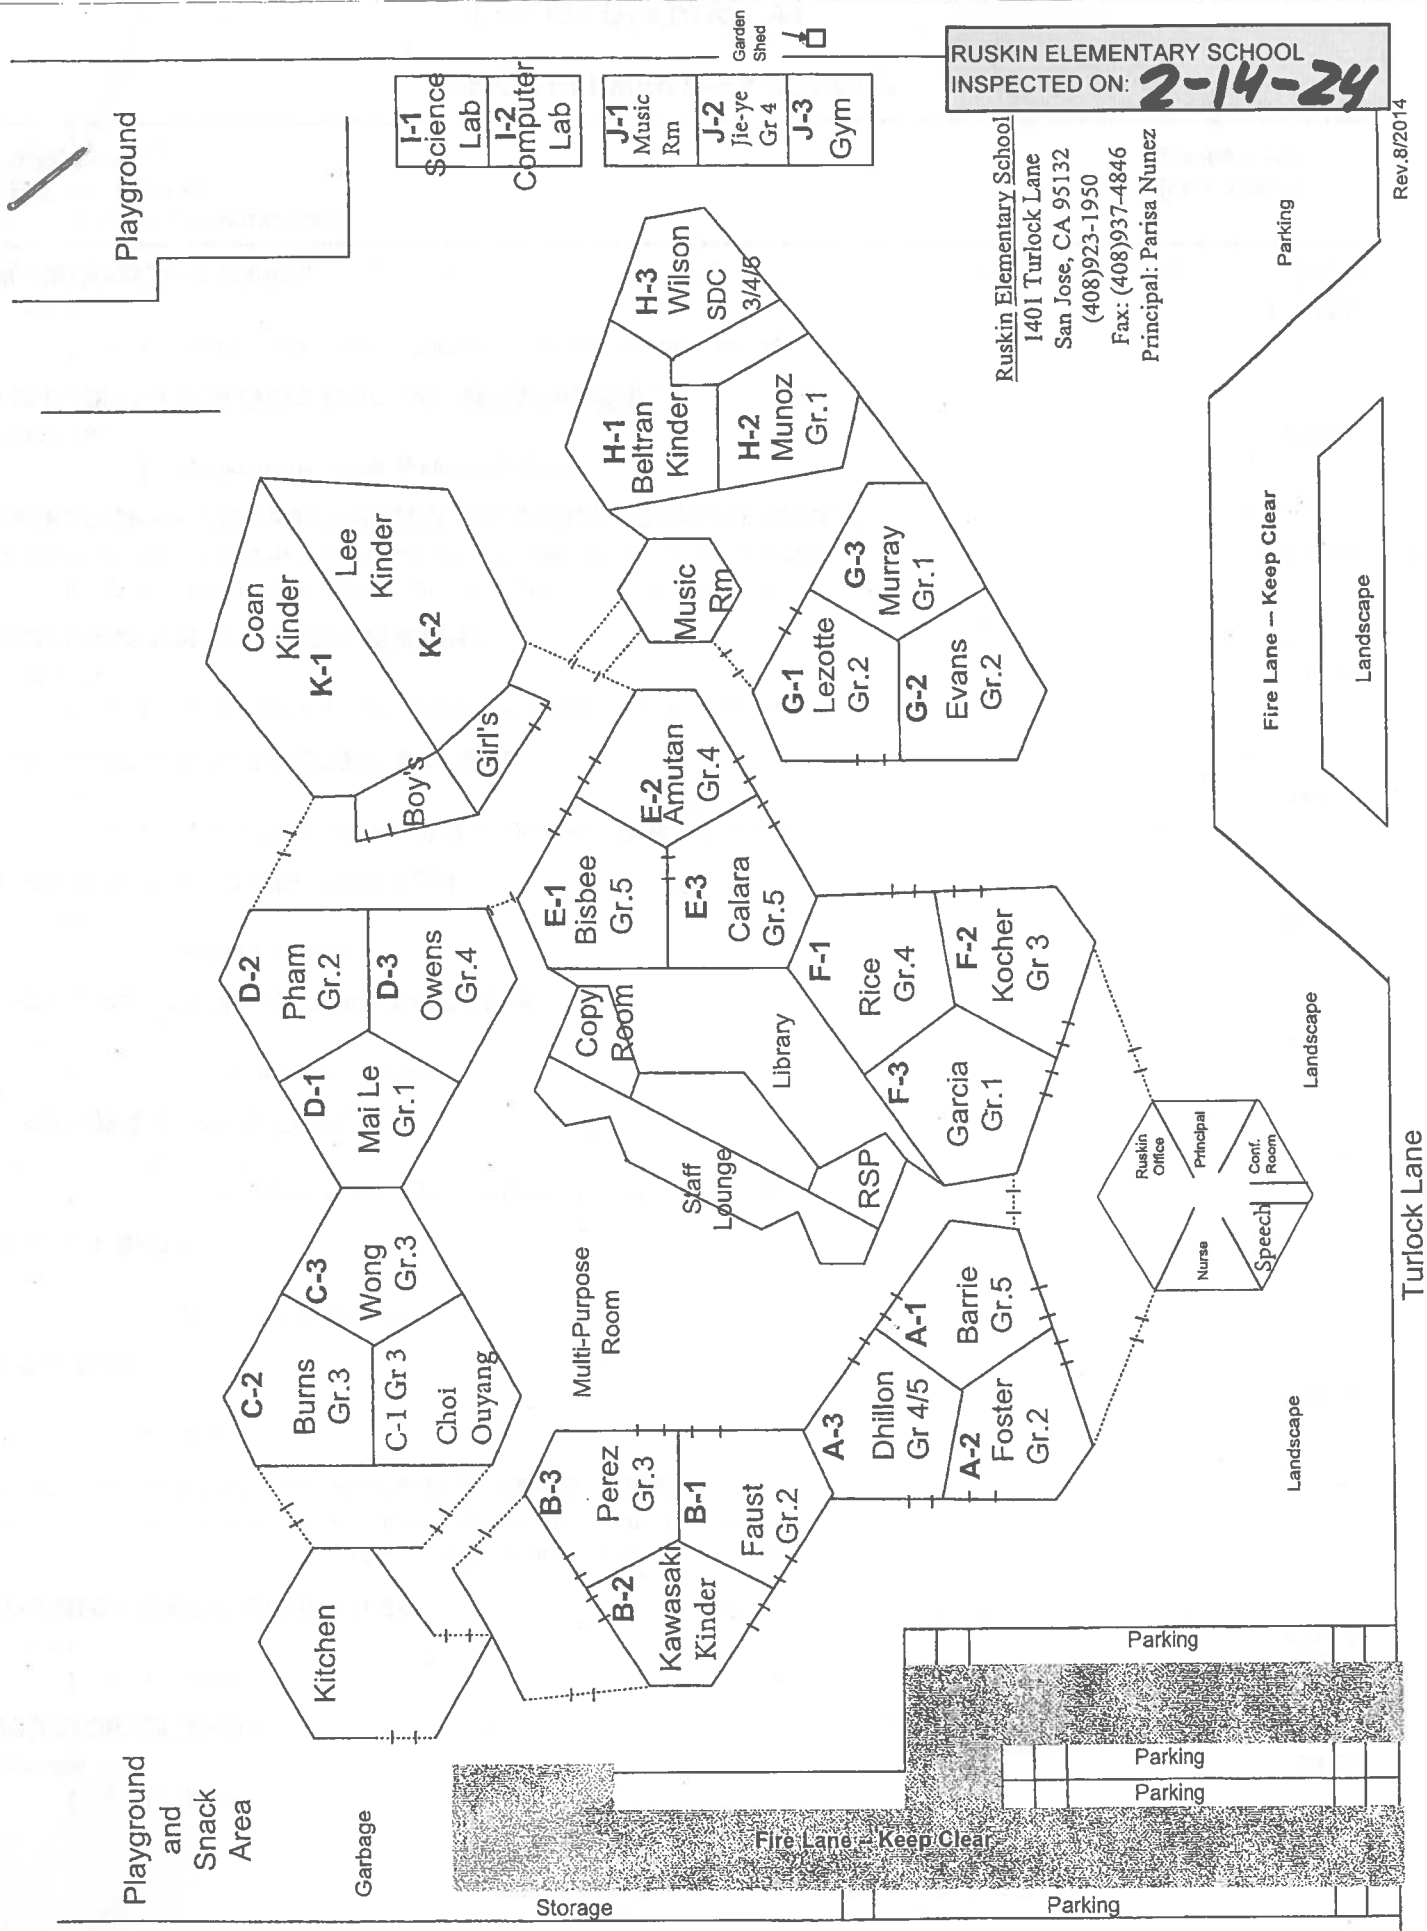

Playground and
Snack
Area

Garbage

Storage

Fire Lane - Keep Clear

Parking

Parking
Parking
Parking

Landscape

Landscape


Fire Lane - Keep Clear

Landscape

Turlock Lane

Rev. 8/2014

Playground

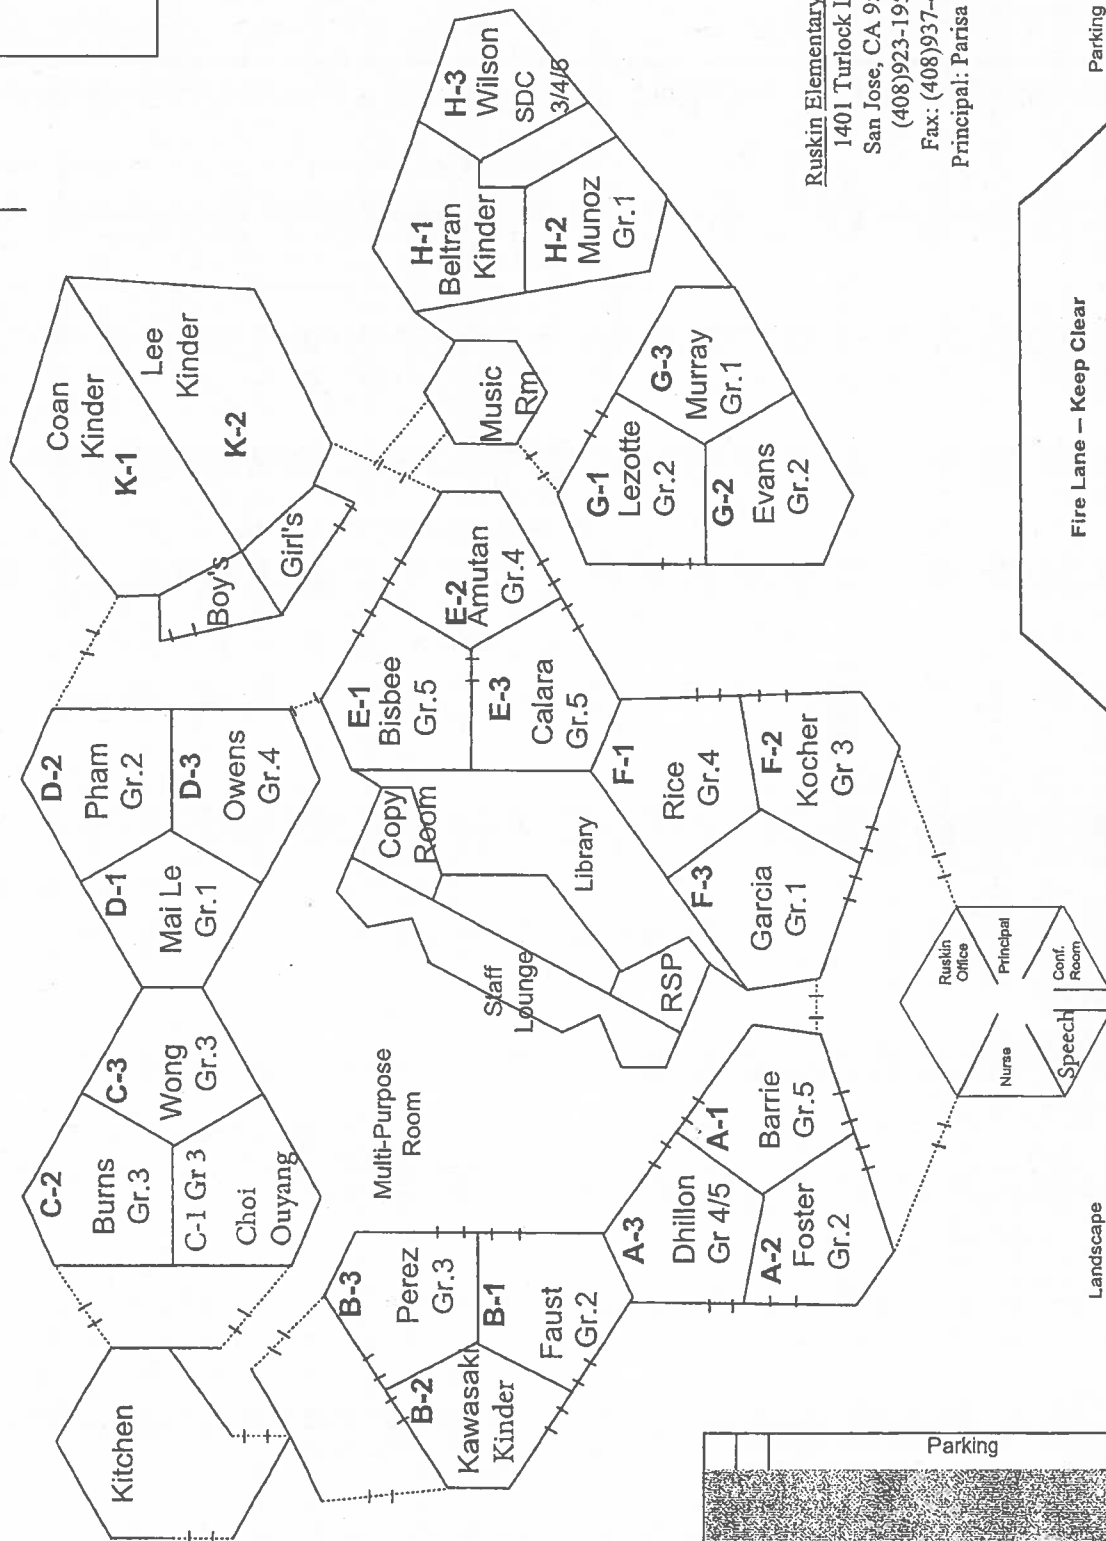

RUSKIN ELEMENTARY SCHOOL
INSPECTED ON: 08-16-2023

Ruskin Elementary School
1401 Turlock Lane
San Jose, CA 95132
(408)923-1950
Fax: (408)937-4846
Principal: Parisa Nunez

Playground
and
Snack
Area

Garbage

Storage

Fire Lane - Keep Clear

Parking

Parking

Parking

Parking

Landscape


Landscape

Fire Lane - Keep Clear

Landscape

Turlock Lane

Playground

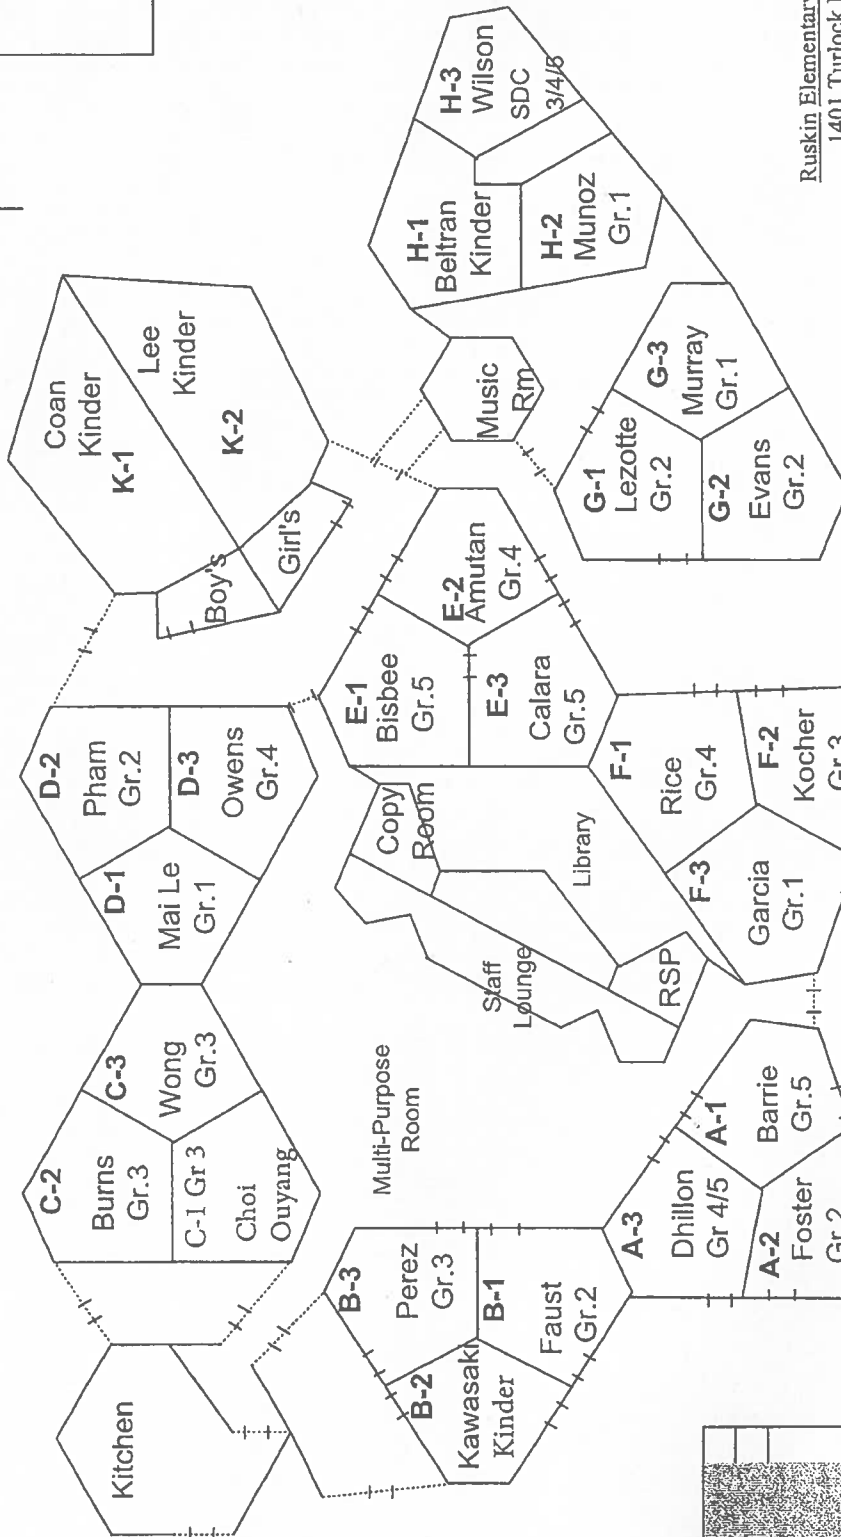

RUSKIN ELEMENTARY SCHOOL
INSPECTED ON: 2/15/23

Ruskin Elementary School
1401 Turlock Lane
San Jose, CA 95132
(408)923-1950
Fax: (408)937-4846
Principal: Parisa Nunez

Rev.8/2014

Playground and
Snack
Area

Garbage

Storage

Fire Lane - Keep Clear

Parking

Parking

Parking

Parking

Landscape

Landscape

Turlock Lane

Fire Lane - Keep Clear

Landscape

Parking

Rev. 8/2014

RUSKIN ELEMENTARY SCHOOL

INSPECTED ON: 08-17-2022

Ruskin Elementary School

1401 Turlock Lane

San Jose, CA 95132

(408)923-1950

Fax: (408)937-4846

Principal: Parisa Nunez

Playground

I-1
Science
Lab



I-2
Computer
Lab

J-1
Music
Rm

J-2
Jie-ye
Gr 4

J-3
Gym

Garden
Shed

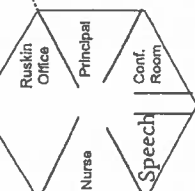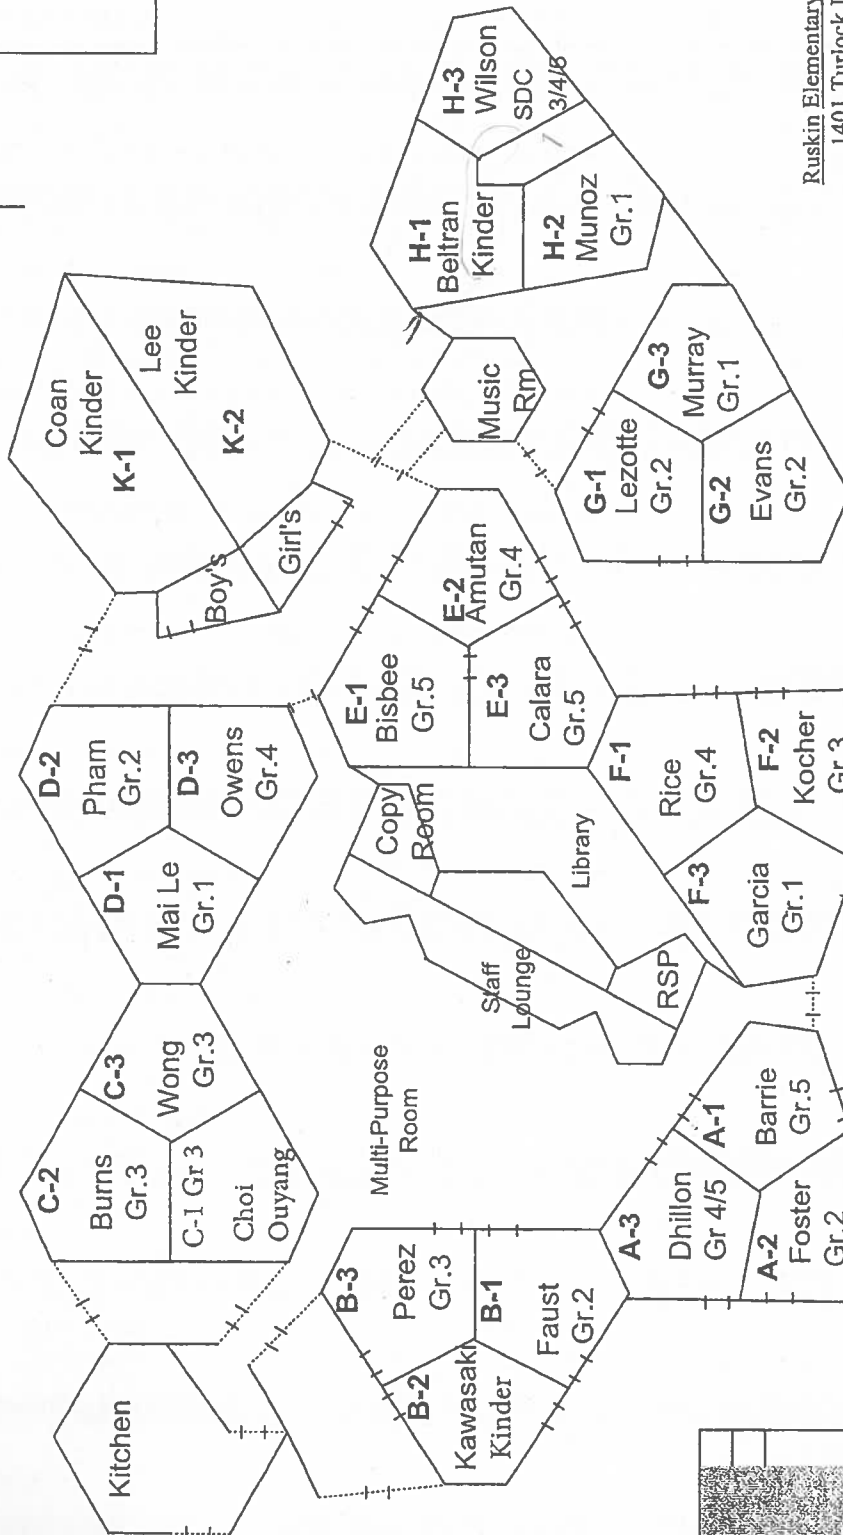

Playground
and
Snack
Area

Garbage

Storage

Fire Lane - Keep Clear


Parking

Parking

Parking

Parking

Playground

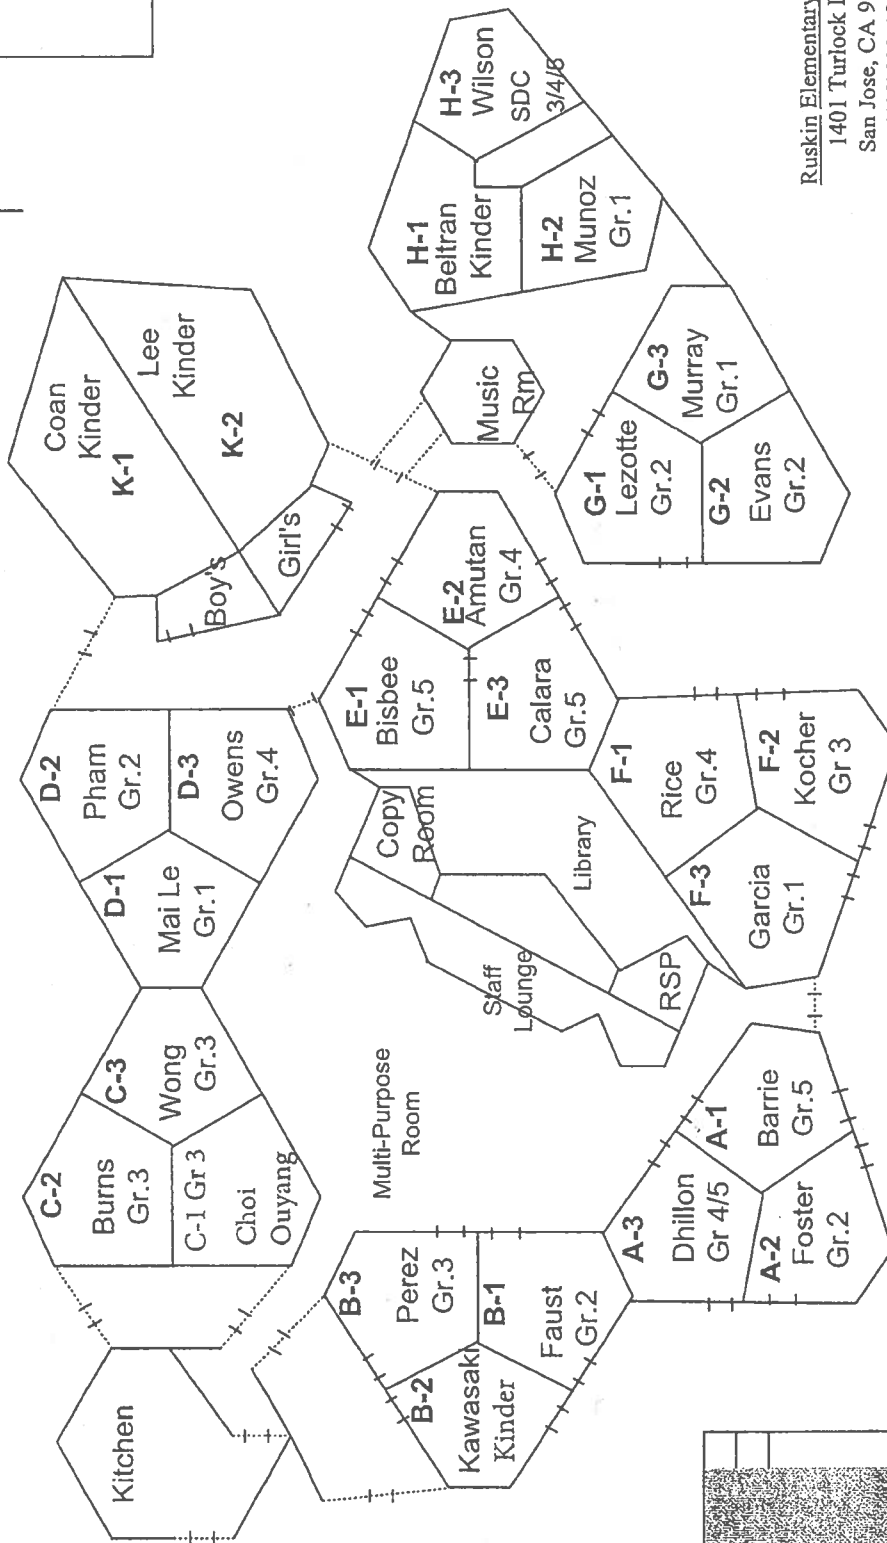

RUSKIN ELEMENTARY SCHOOL
INSPECTED ON: 02-18-2022

Ruskin Elementary School
1401 Turlock Lane
San Jose, CA 95132
(408)923-1950
Fax: (408)937-4846
Principal: Parisa Nunez

Fire Lane - Keep Clear

Landscaping

Landscaping

Landscaping

Turlock Lane

Rev.8/2014

Playground
and
Snack
Area

Garbage

Storage

Fire Lane - Keep Clear

Parking

Parking
Parking
Parking

Landscape

Landscape


Fire Lane - Keep Clear

Landscape

Turlock Lane

Rev. 8/20/14

Playground

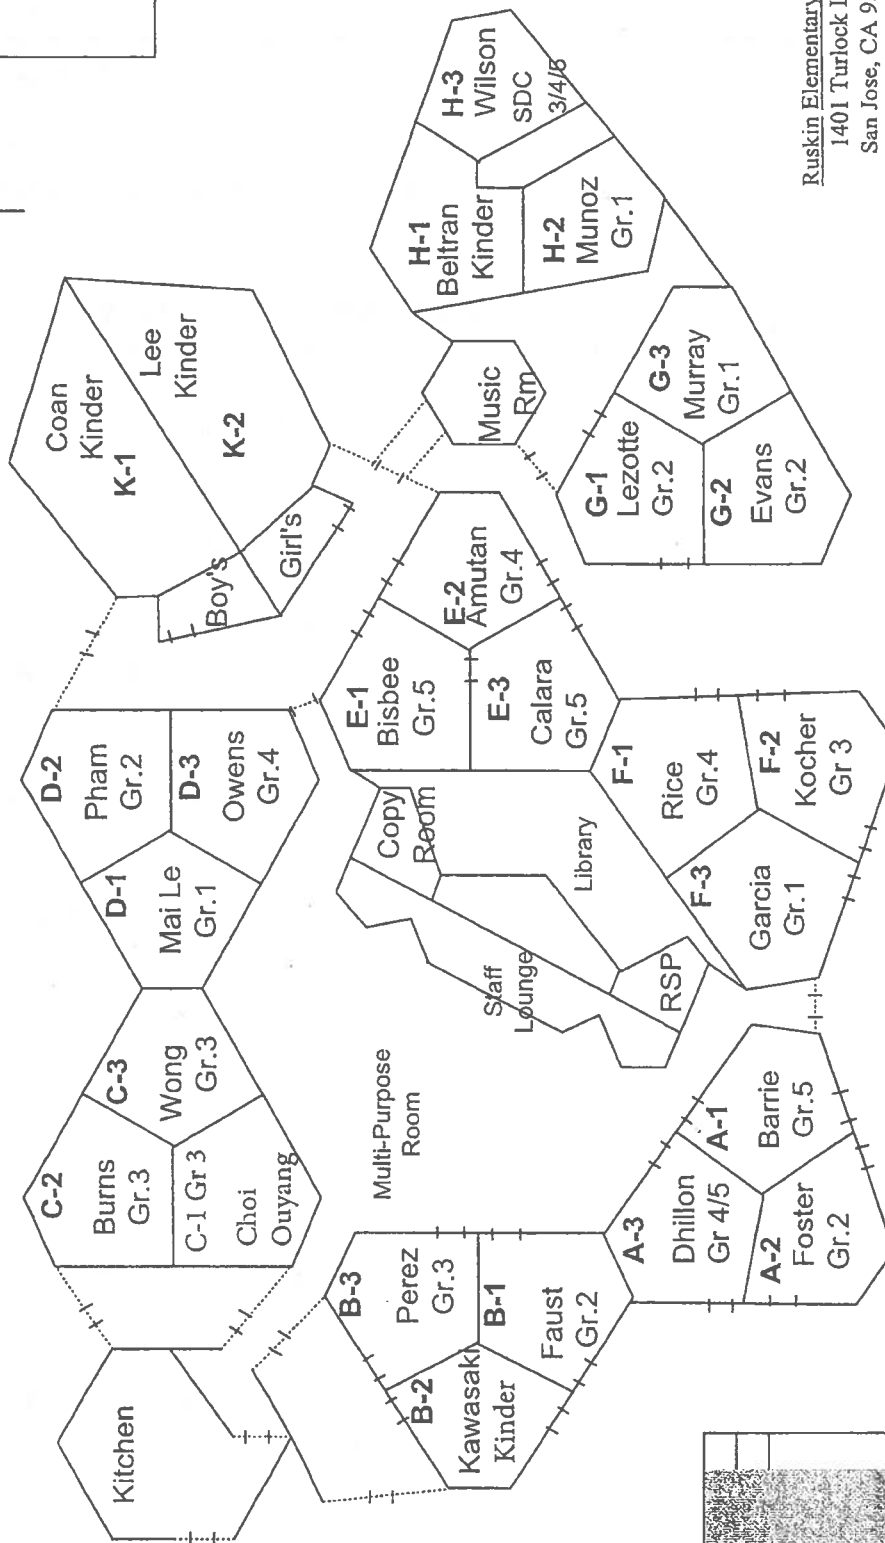

RUSKIN ELEMENTARY SCHOOL
INSPECTED ON: 8/11/21

Ruskin Elementary School

1401 Turlock Lane

San Jose, CA 95132

(408)923-1950

Fax: (408)937-4846

Principal: Parisa Nunez

Playground
and
Snack
Area

Garbage

Storage

Fire Lane -- Keep Clear

Parking

Parking
Parking
Parking

Landscape

Landscape

Landscape

Fire Lane -- Keep Clear

Parking

Turlock Lane

Rev.8/2014

Playground


I-1 Science Lab
I-2 Computer Lab

J-1 Music Rm
J-2 Jie-ye Gr 4
J-3 Gym

Garden Shed

RUSKIN ELEMENTARY SCHOOL
INSPECTED ON: 2/10/21

Ruskin Elementary School
1401 Turlock Lane
San Jose, CA 95132
(408)923-1950
Fax: (408)937-4846
Principal: Parisa Nunez

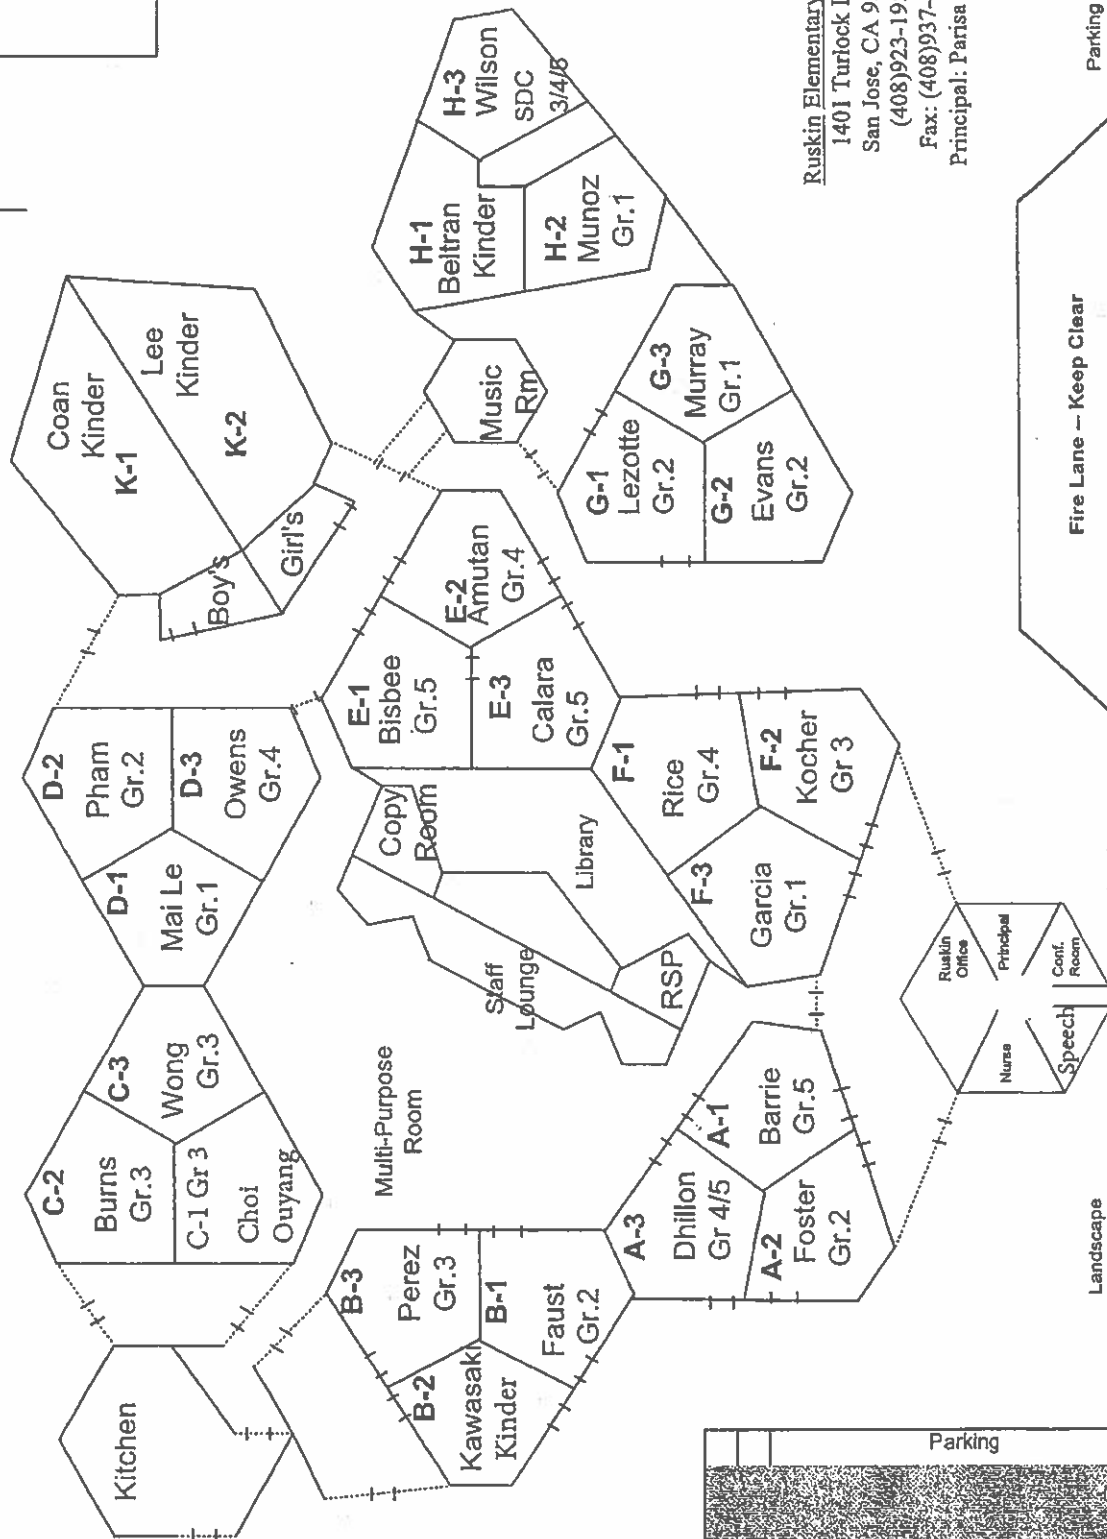

Playground
and
Snack
Area

Garbage

Storage

Fire Lane -- Keep Clear

Parking

Parking
Parking
Parking

Landscape

Landscape

Landscape

Fire Lane -- Keep Clear

Parking

Turlock Lane

Rev. 8/2014


Playground

I-1 Science Lab	I-2 Computer Lab	J-1 Music Rm	J-2 Jie-ye Gr 4	J-3 Gym
-----------------------	------------------------	--------------------	-----------------------	------------

Garden
Shed

RUSKIN ELEMENTARY SCHOOL
INSPECTED ON 8/28/20

Ruskin Elementary School
1401 Turlock Lane
San Jose, CA 95132
(408)923-1950
Fax: (408)937-4846
Principal: Parisa Nunez

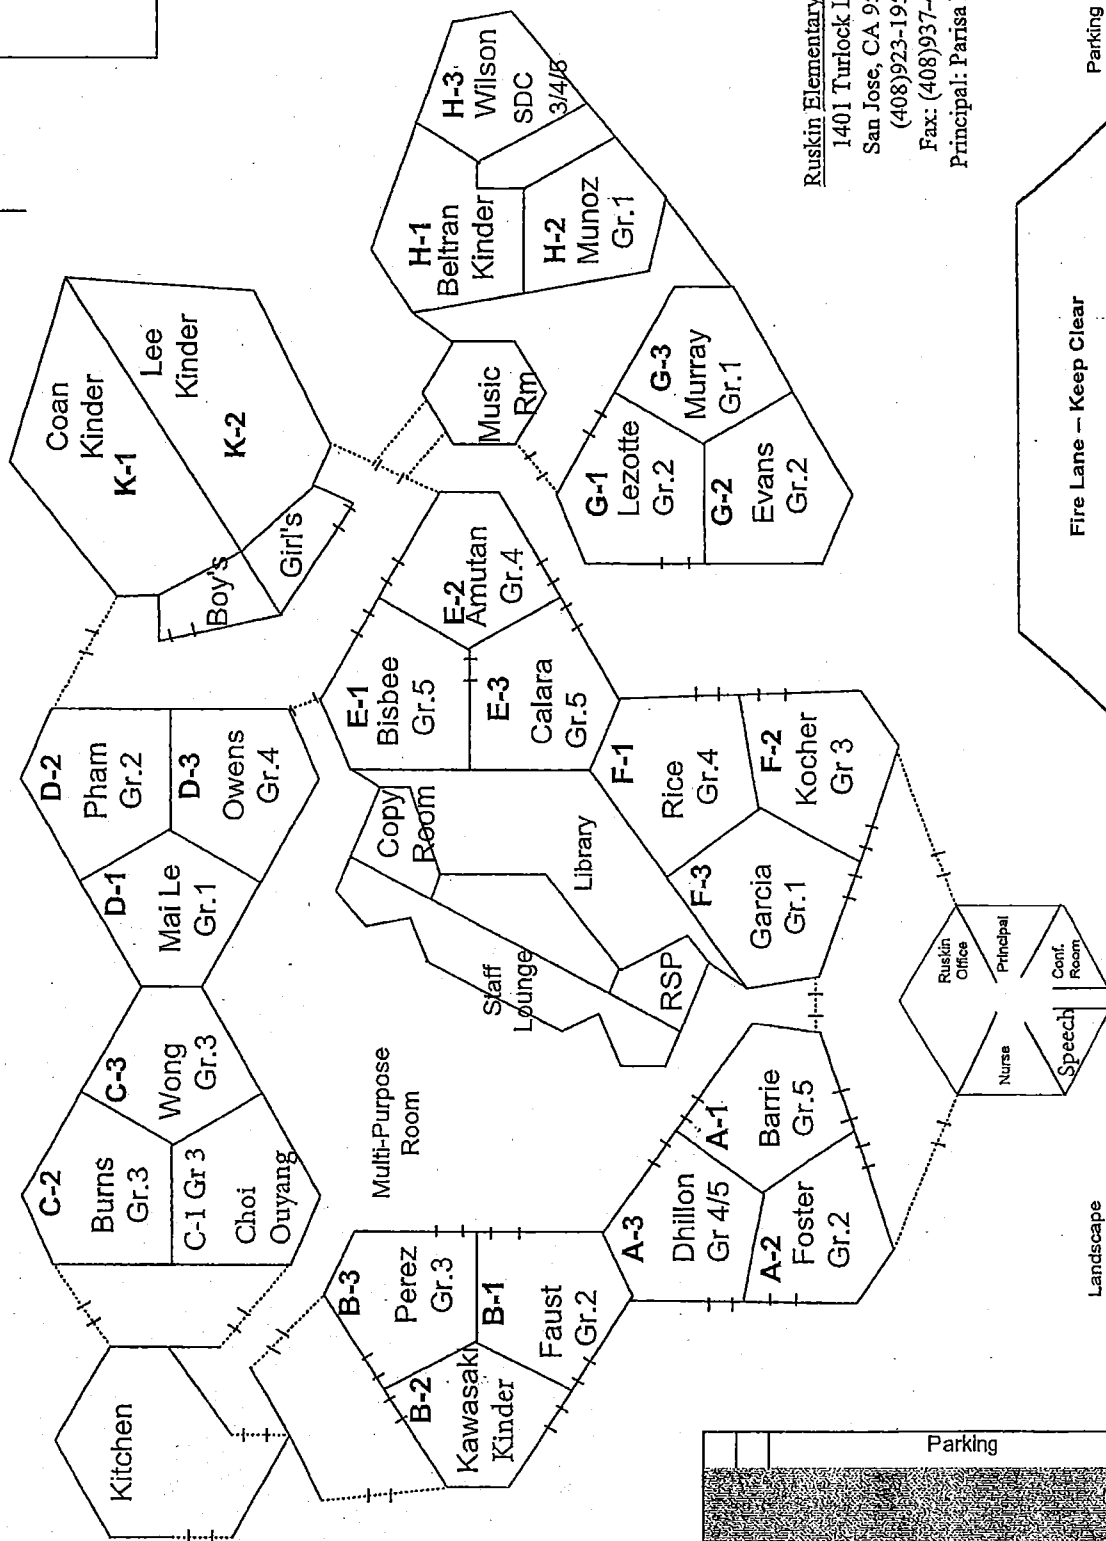

Playground and
Snack
Area

Garbage

Storage

Fire Lane - Keep Clear

Parking

Parking
Parking
Parking

Landscape

Landscape


Fire Lane - Keep Clear

Landscape

Turlock Lane

Rev. 8/2014

Playground

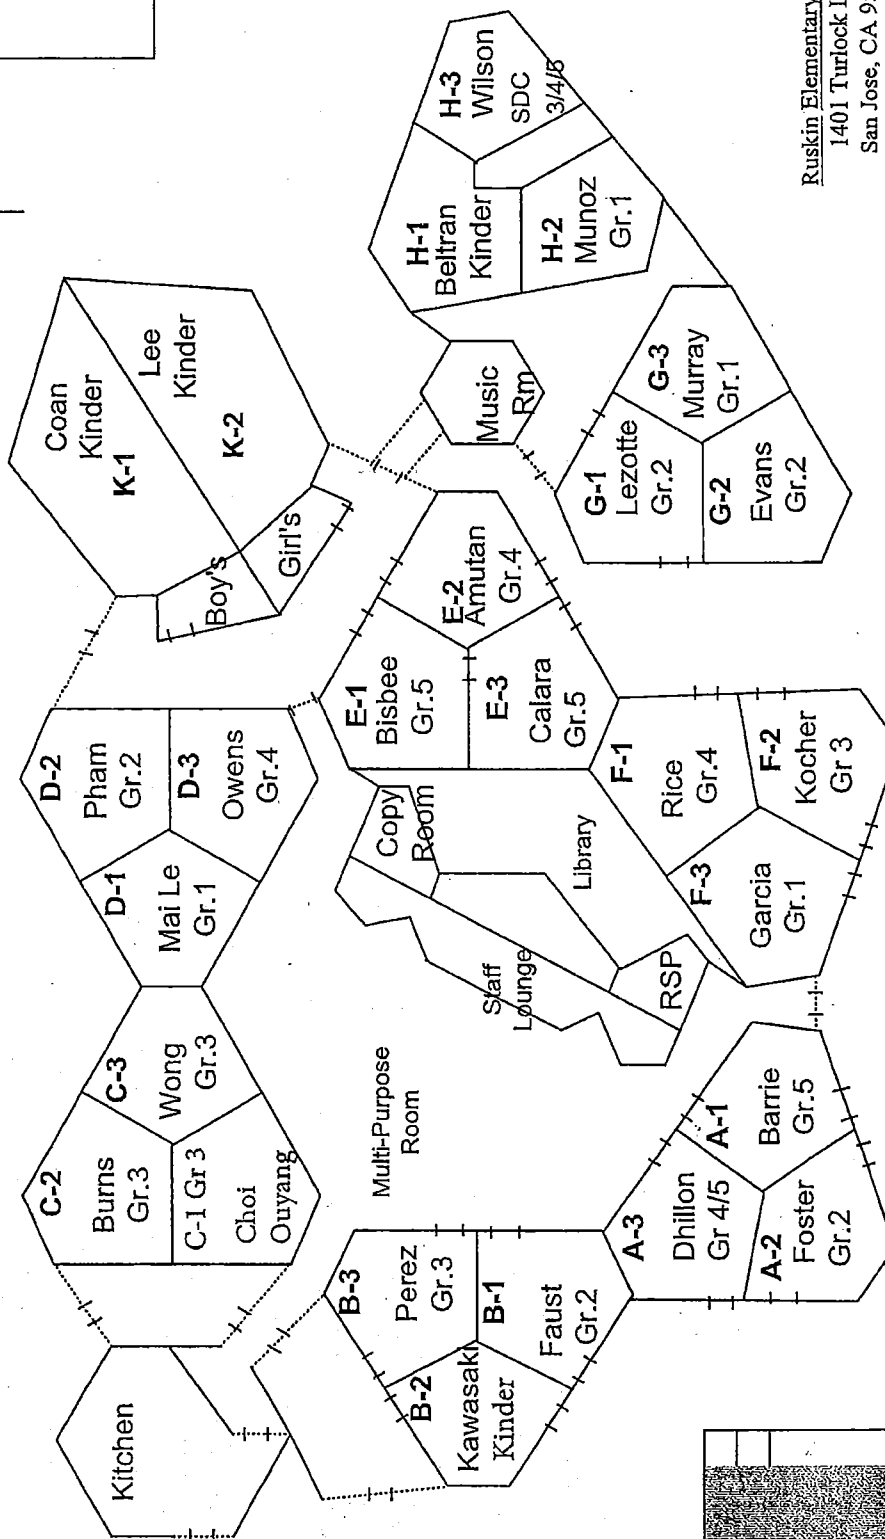

I-1 Science Lab
I-2 Computer Lab

J-1 Music Rm
J-2 Jie-ye Gr 4
J-3 Gym

Garden Shed

RUSKIN ELEMENTARY SCHOOL
INSPECTED ON: 1-31-2020

Ruskin Elementary School
1401 Turlock Lane
San Jose, CA 95132
(408)923-1950
Fax: (408)937-4846
Principal: Parisa Nunez

Parking

Playground and
Snack
Area

Garbage

Storage

Fire Lane - Keep Clear

Parking

Parking
Parking
Parking

Landscape

Landscape


Fire Lane - Keep Clear

Landscape

Turlock Lane

Rev. 8/2014

Playground

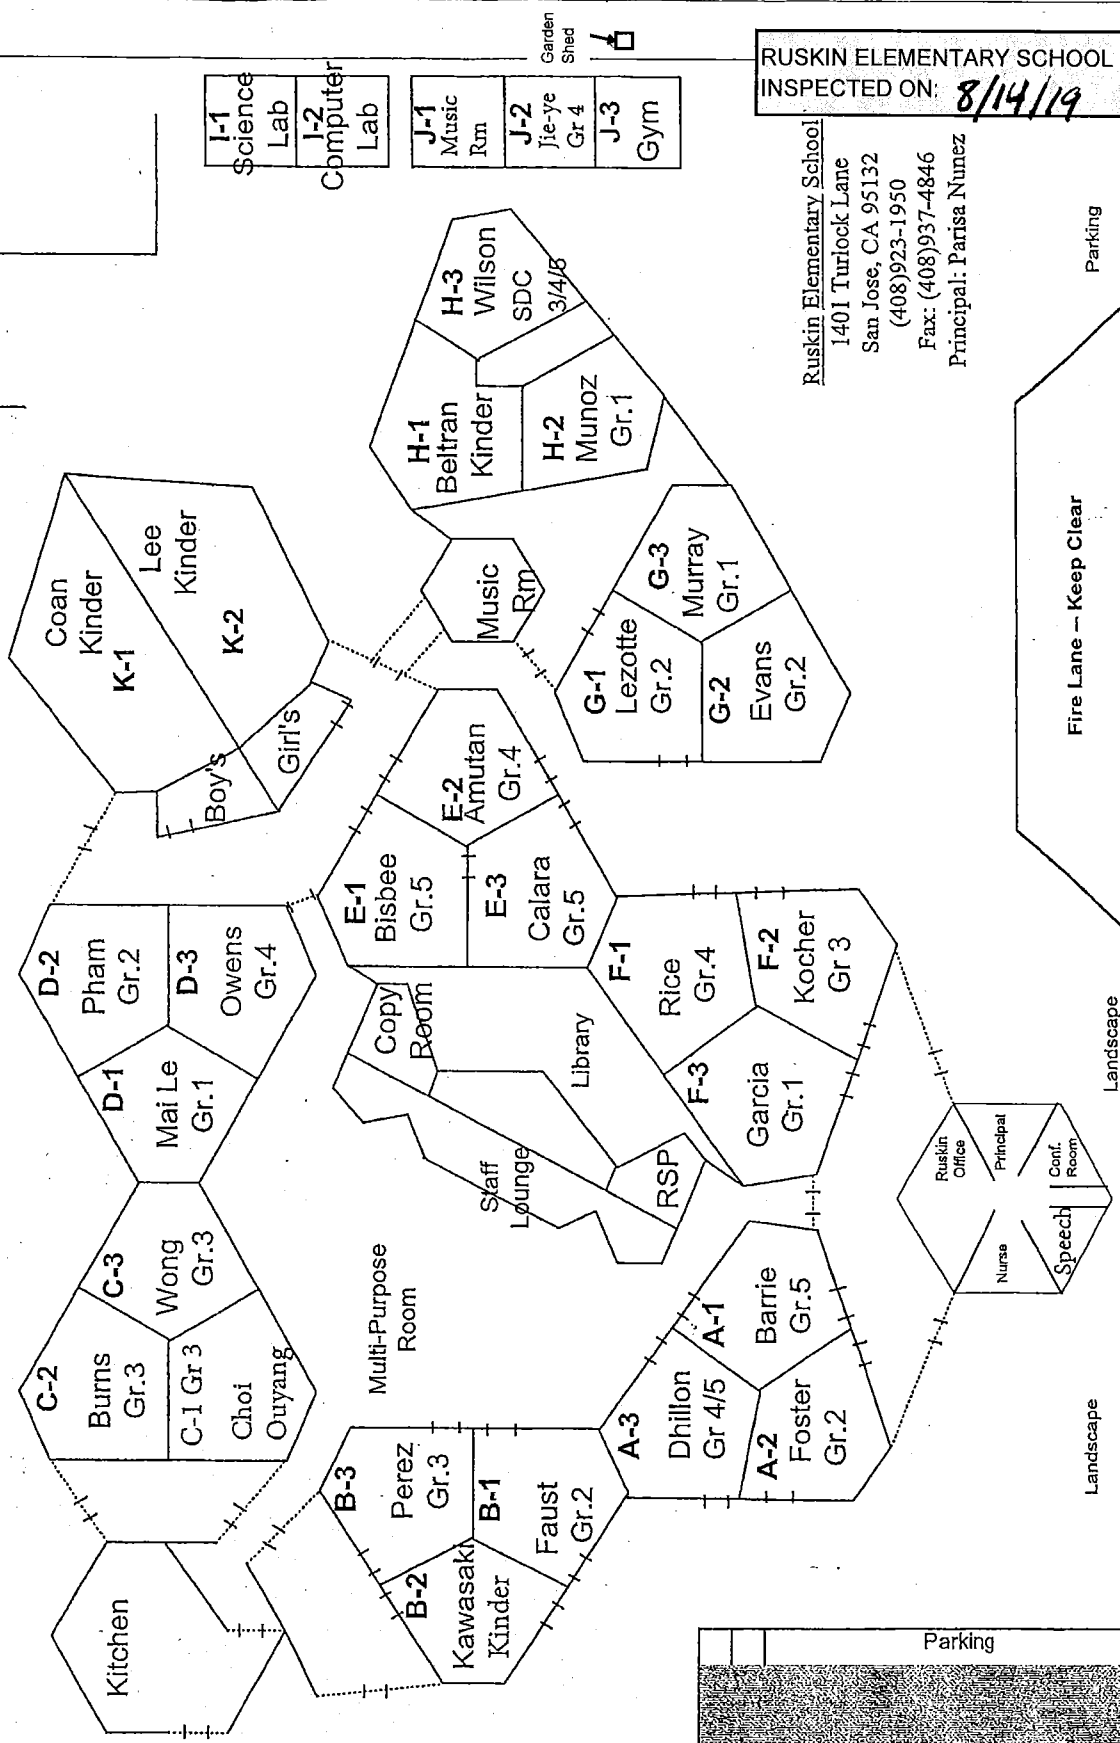

RUSKIN ELEMENTARY SCHOOL
INSPECTED ON: 8/14/19

Ruskin Elementary School
1401 Turlock Lane
San Jose, CA 95132
(408)923-1950
Fax: (408)937-4846
Principal: Parisa Nunez

Playground

Playground
and
Snack
Area

Garbage

Storage

Fire Lane - Keep Clear

Parking

Parking

Parking
Parking

Fire Lane - Keep Clear

Landscape

Landscape

Landscape

Turlock Lane

Rev.8/2014

I-1 Science Lab	I-2 Computer Lab	J-1 Music Rm	J-2 Jie-ye Gr 4	J-3 Gym
-----------------------	------------------------	--------------------	-----------------------	------------

Garden
Shed

RUSKIN ELEMENTARY SCHOOL

INSPECTED ON: 02-06-2019

Ruskin Elementary School


1401 Turlock Lane

San Jose, CA 95132

(408)923-1950

Fax: (408)937-4846

Principal: Parisa Nunez

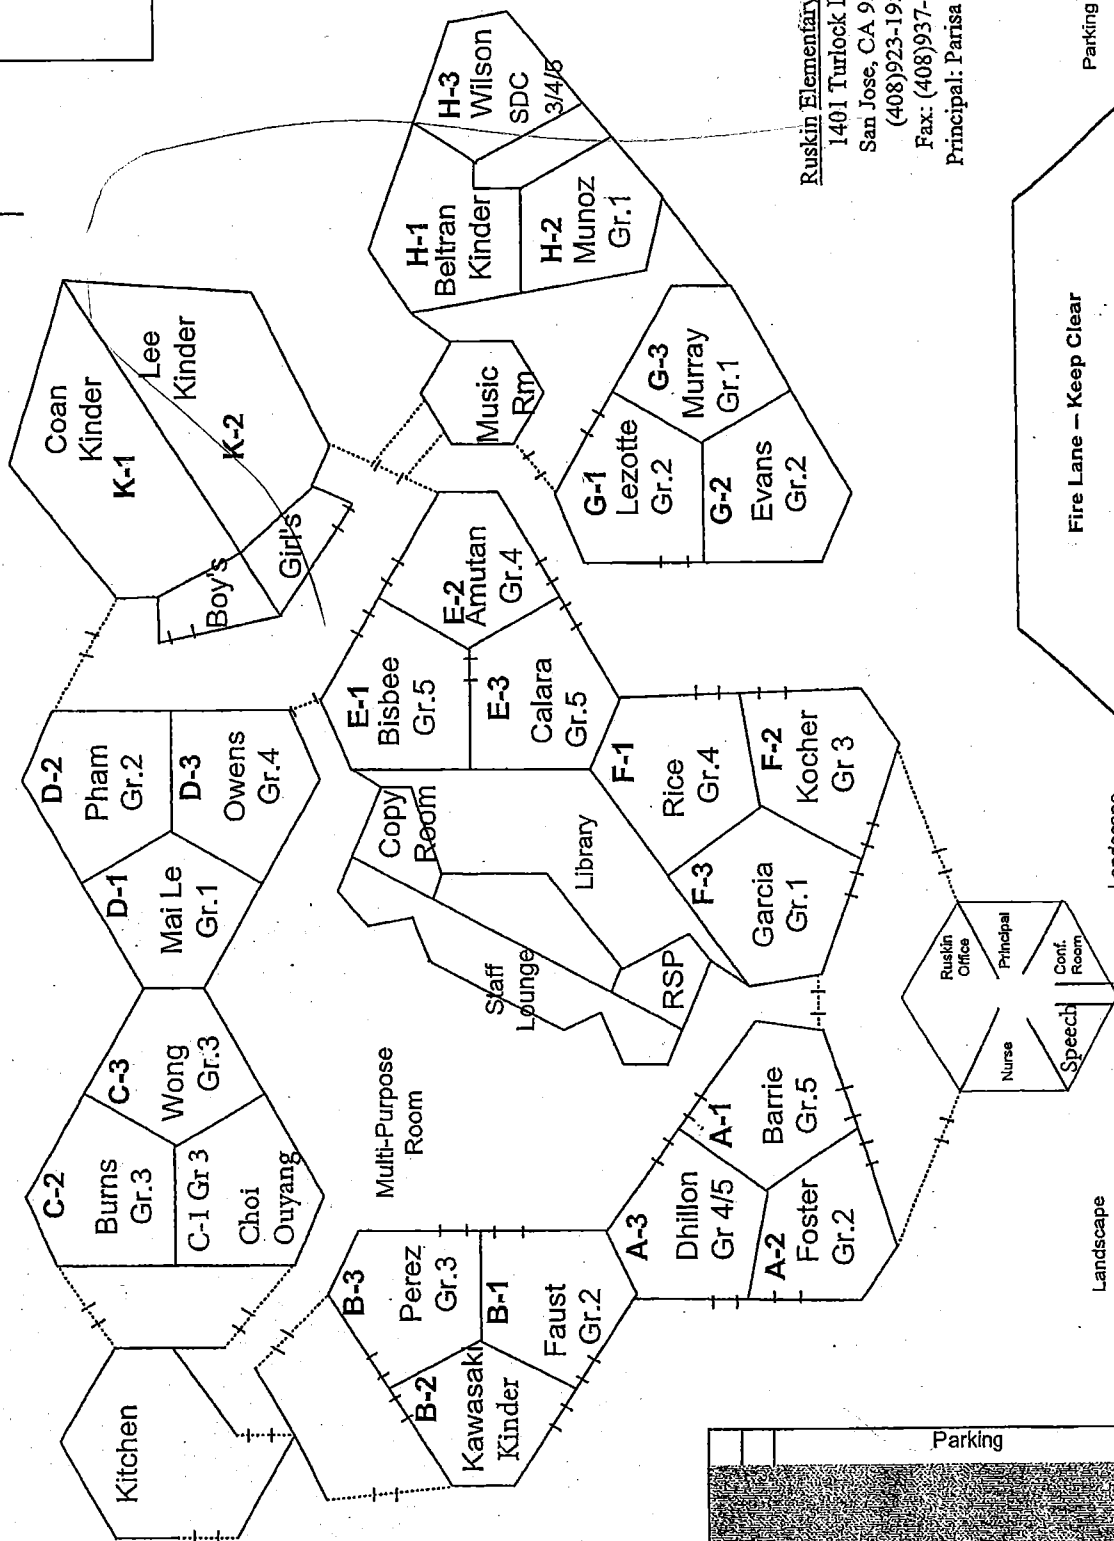

Playground
and
Snack
Area

Garbage

Storage

Fire Lane - Keep Clear

Parking

Parking

Parking

Landscape

Landscape

Fire Lane - Keep Clear

Landscape

Parking

Turlock Lane

Rev. 8/2014


RUSKIN ELEMENTARY SCHOOL
INSPECTED ON: 8/8/18

Ruskin Elementary School
1401 Turlock Lane
San Jose, CA 95132
(408)923-1950
Fax: (408)937-4846
Principal: Parisa Nunez

Playground

I-1 Science Lab	I-2 Computer Lab	J-1 Music Rm	J-2 Jie-ye Gr 4	J-3 Gym
-----------------------	------------------------	--------------------	-----------------------	------------

Garden
Shed

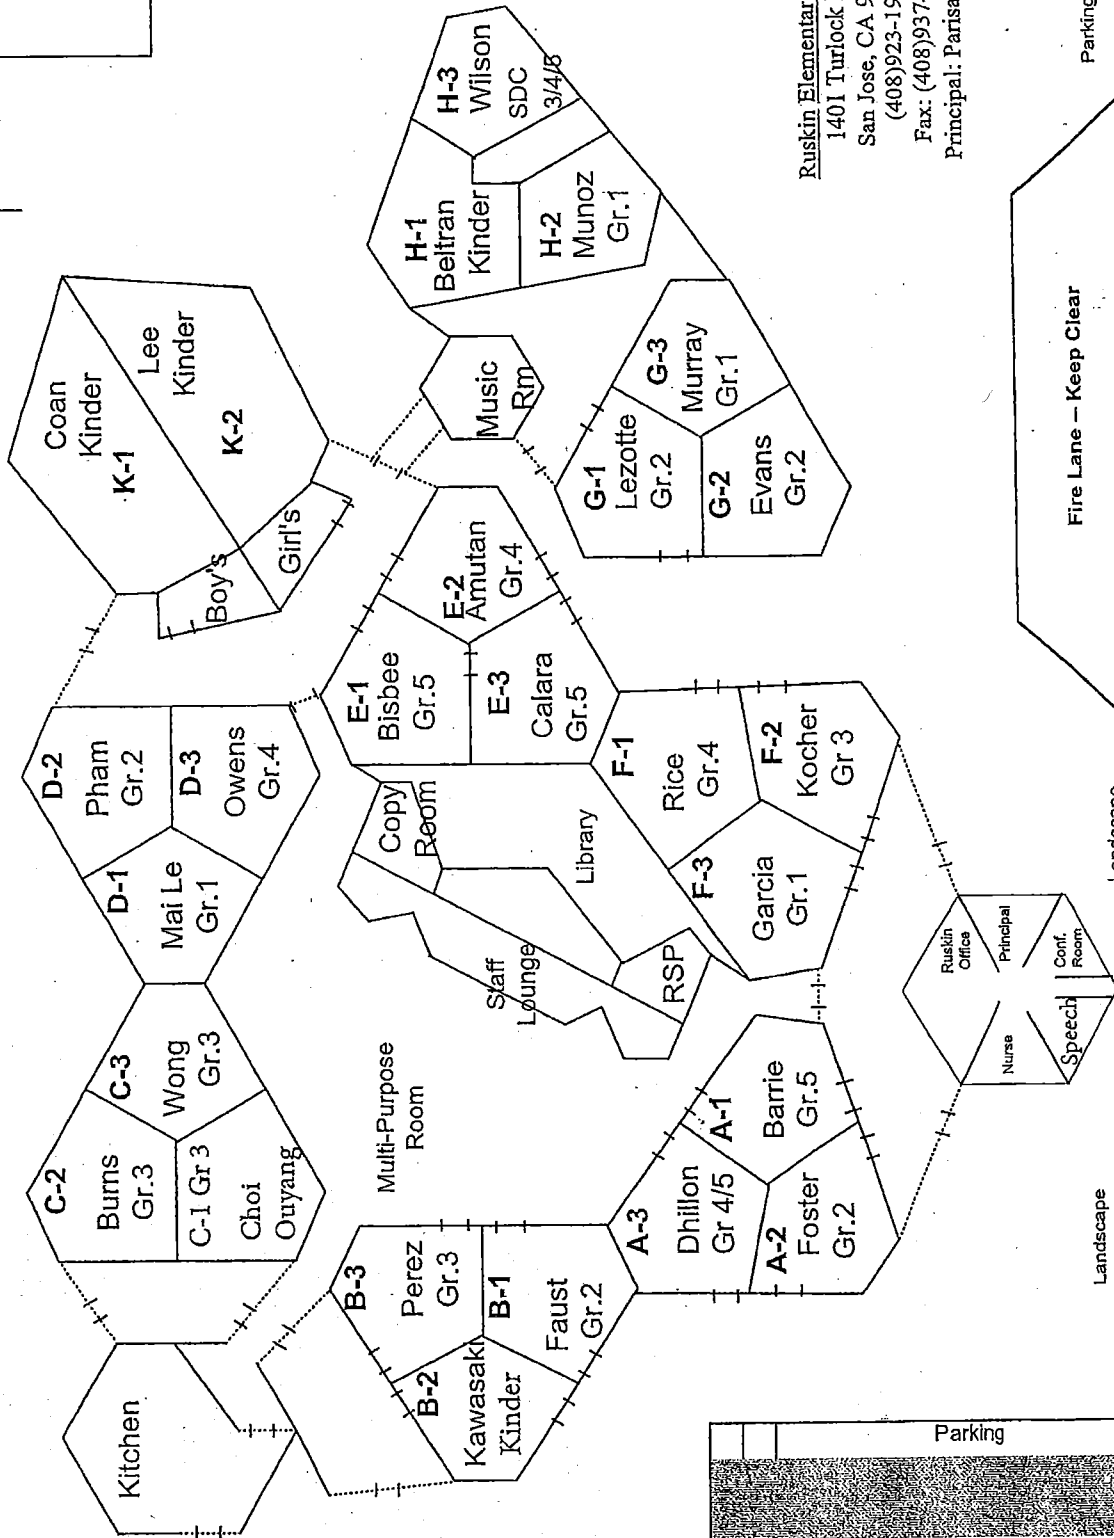

Playground and
Snack
Area

Garbage

Storage

Fire Lane - Keep Clear

Parking

Parking

Parking

Parking

Landscape

Landscape


Fire Lane - Keep Clear

Landscape

Turlock Lane

Rev. 8/2014

Playground

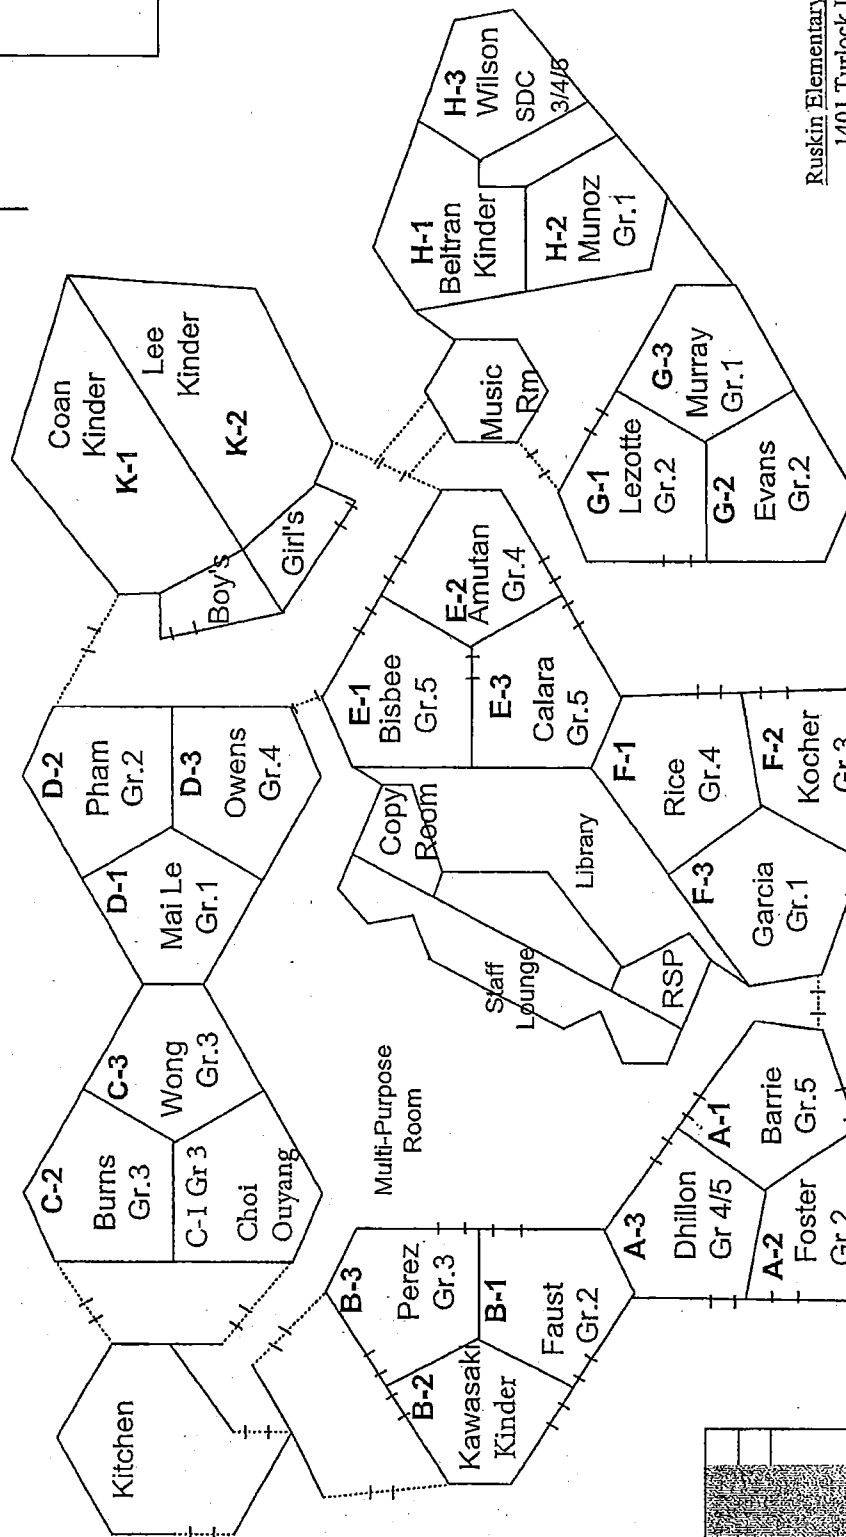


I-1 Science Lab
I-2 Computer Lab

J-1 Music Rm
J-2 Jie-ye Gr 4
J-3 Gym

RUSKIN ELEMENTARY SCHOOL
INSPECTED ON: 2/14/18

Ruskin Elementary School
1401 Turlock Lane
San Jose, CA 95132
(408)923-1950
Fax: (408)937-4846
Principal: Parisa Nunez

Parking

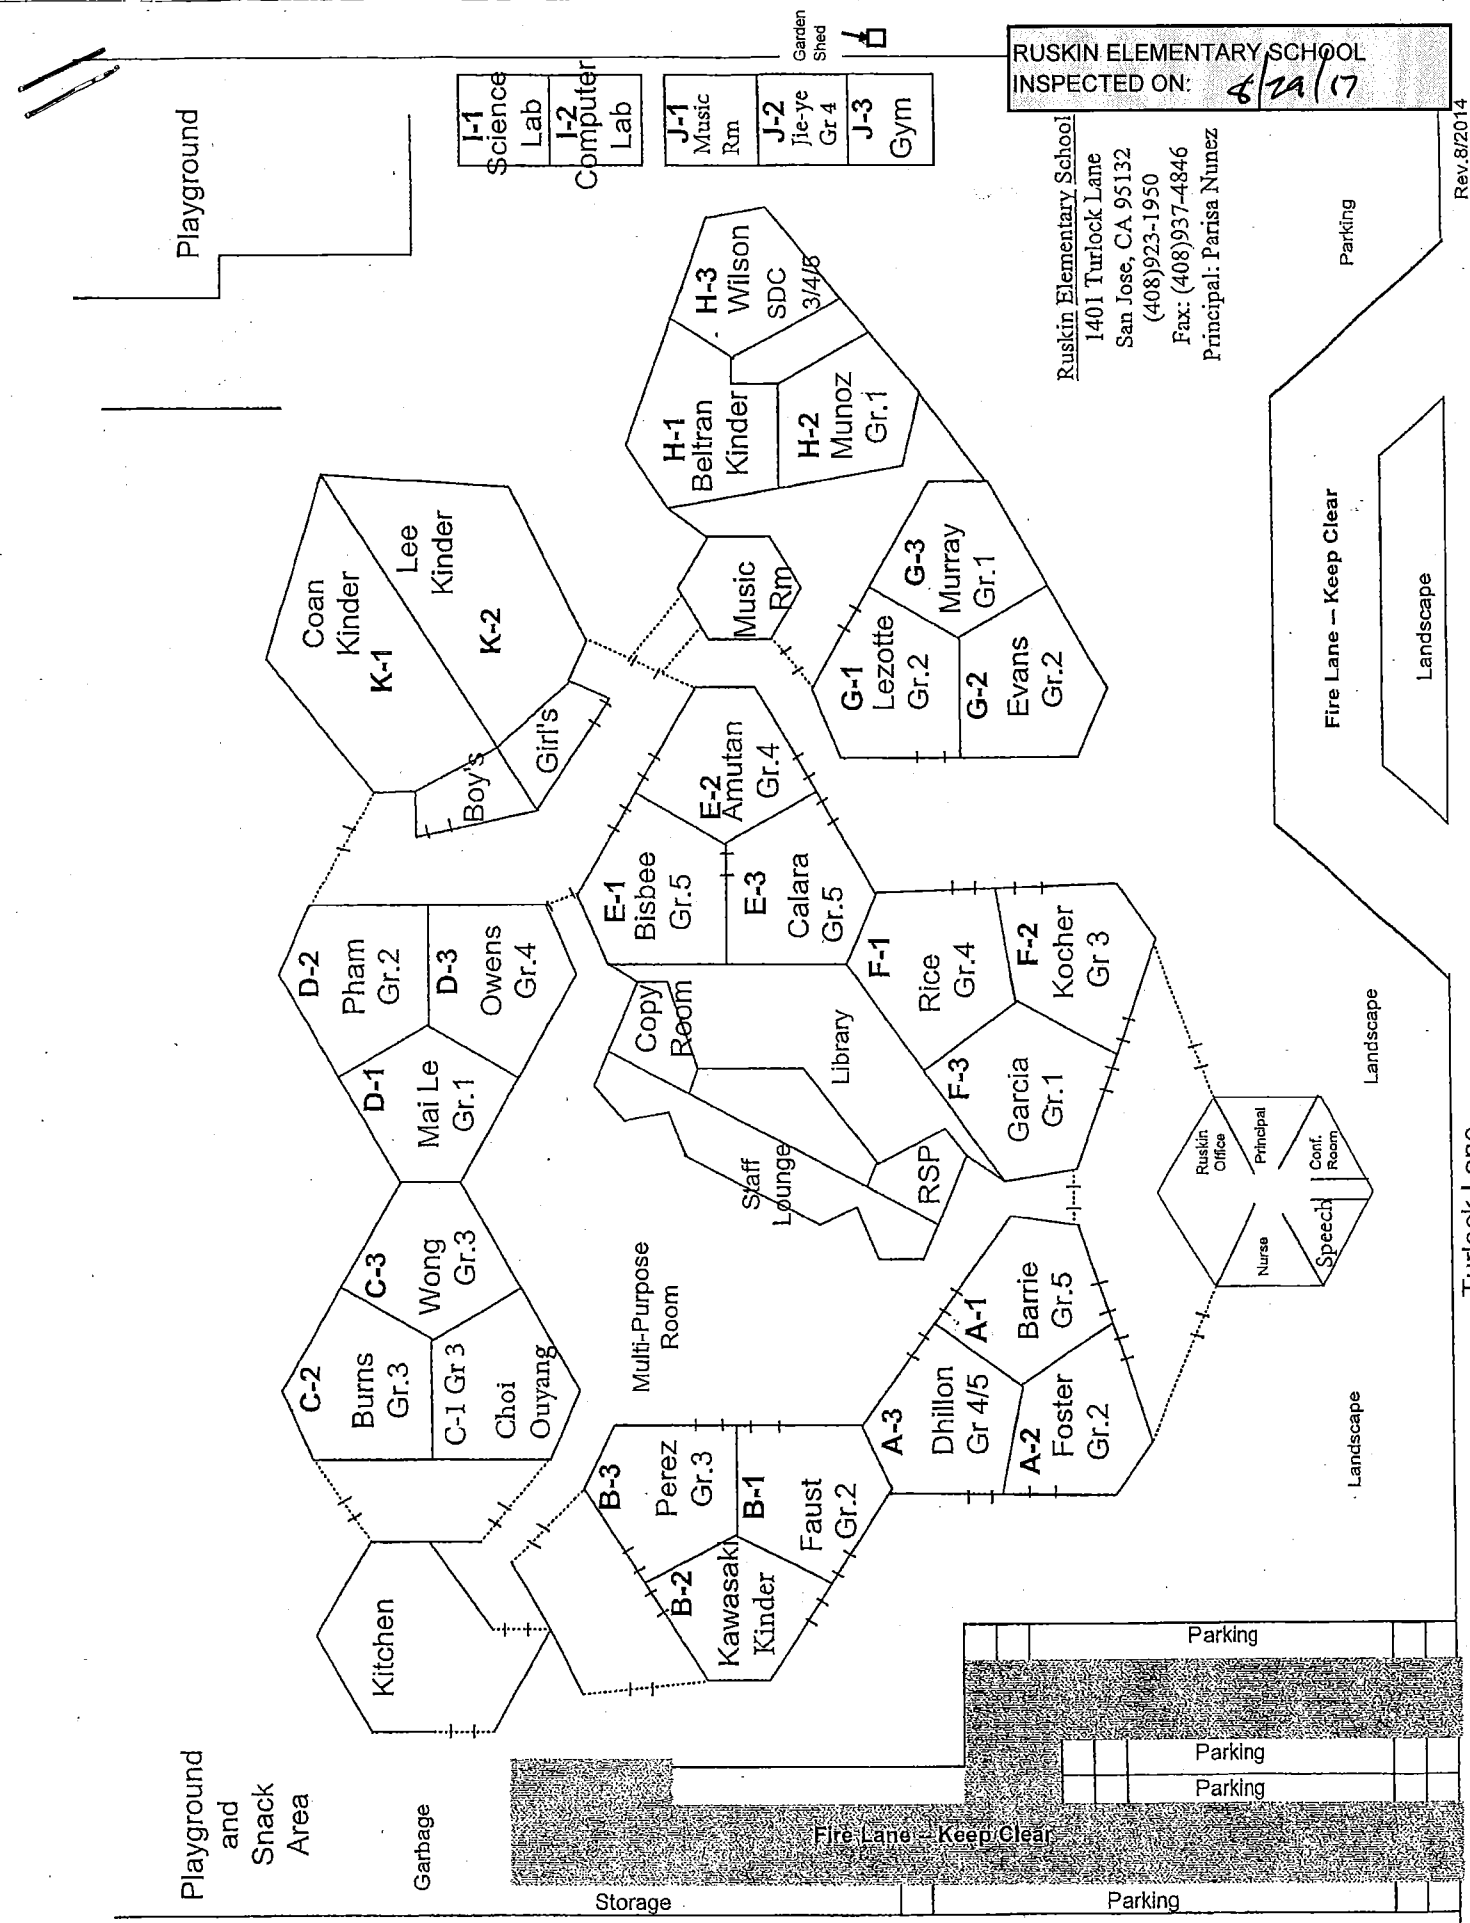

RUSKIN ELEMENTARY SCHOOL
 INSPECTED ON: 8/29/17

Ruskin Elementary School
 1401 Turlock Lane
 San Jose, CA 95132
 (408)923-1950
 Fax: (408)937-4846
 Principal: Parisa Nunez

Playground
and
Snack
Area

Garbage

Storage

Fire Lane -- Keep Clear

Parking

Parking
Parking
Parking

Landscape

Landscape


Fire Lane -- Keep Clear

Landscape

Turlock Lane

Rev.8/2014

Playground

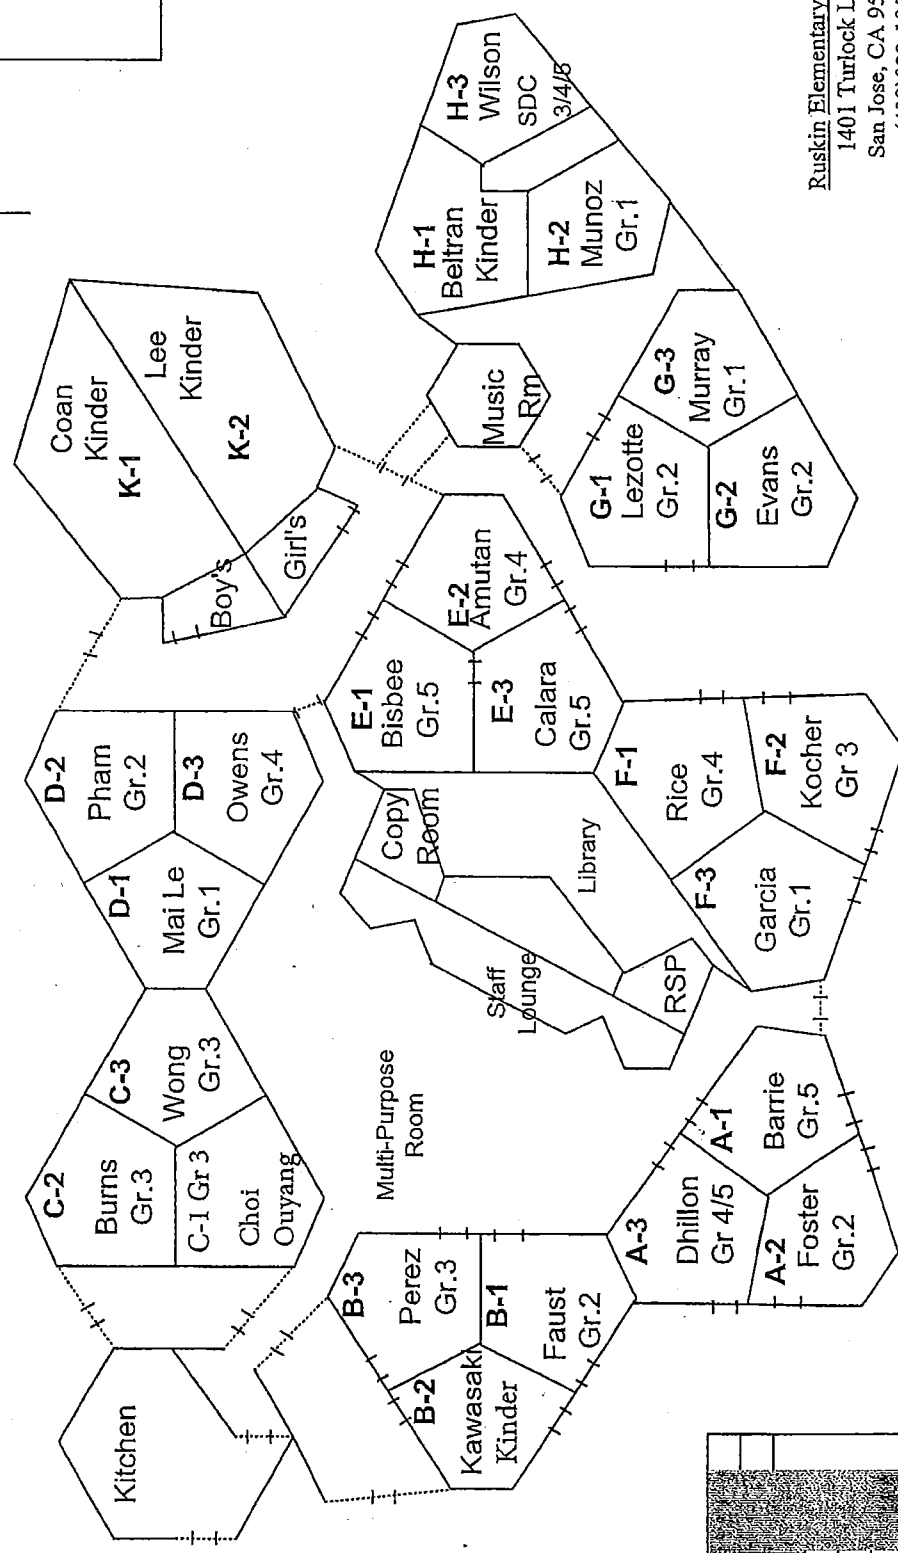

RUSKIN ELEMENTARY SCHOOL
INSPECTED ON: 3/29/17

Ruskin Elementary School
1401 Turlock Lane
San Jose, CA 95132
(408)923-1950
Fax: (408)937-4846
Principal: Parisa Nunez

Playground and
Snack
Area

Garbage

Storage

Fire Lane - Keep Clear

Parking

Parking
Parking
Parking

Landscape

Landscape


Fire Lane - Keep Clear

Landscape

Turlock Lane

Rev. 8/2014

Playground

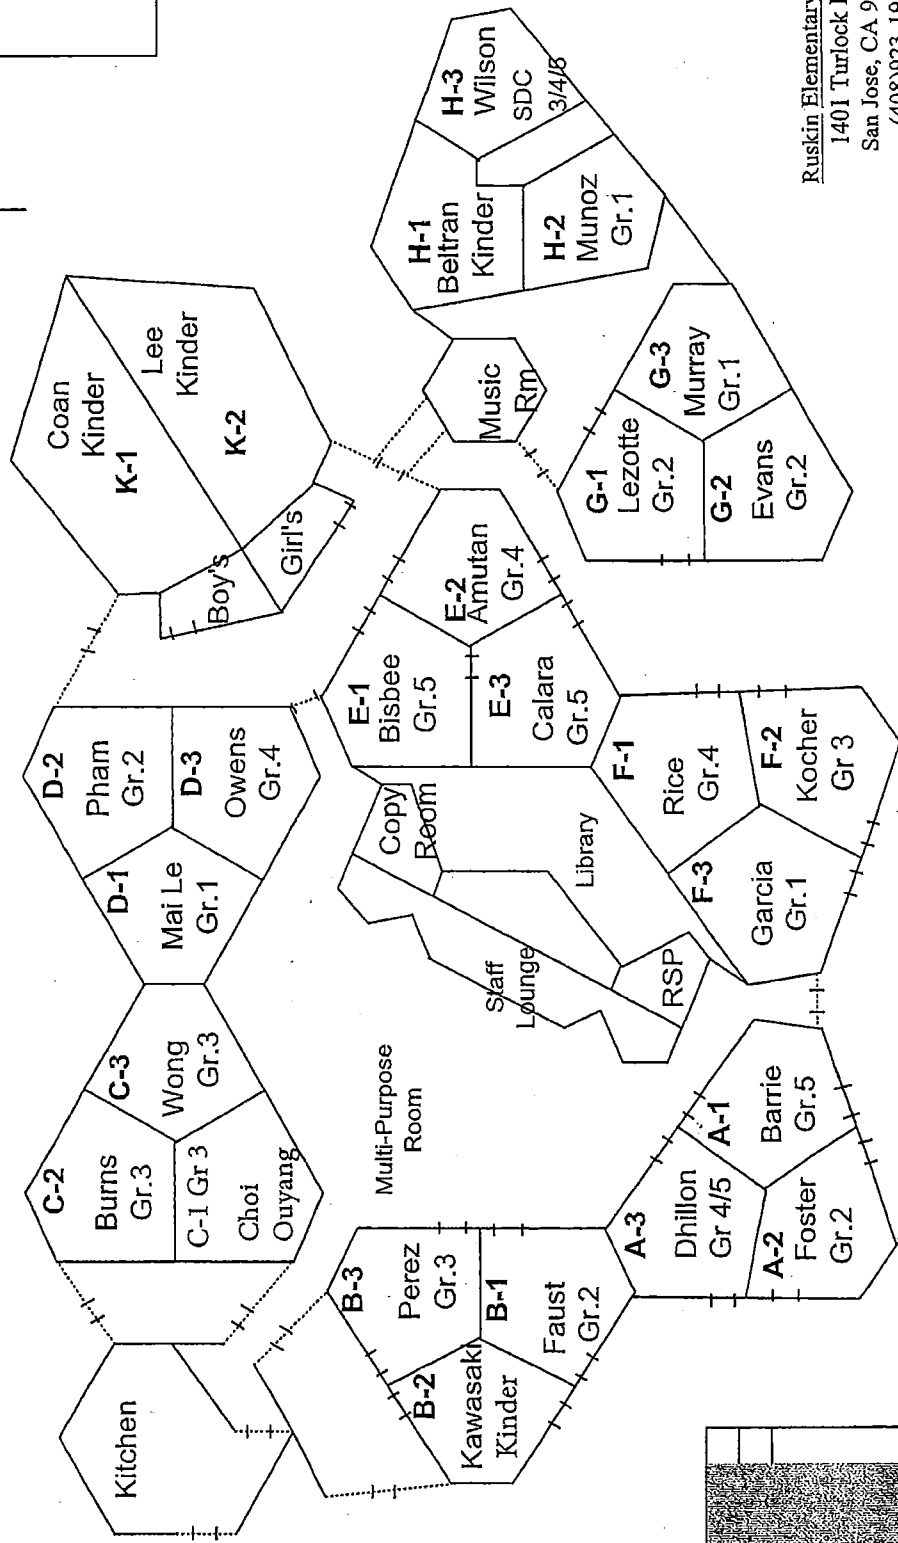

J-1 Science Lab	J-2 Computer Lab	J-1 Music Rm	J-2 Jie-ye Gr 4	J-3 Gym
-----------------------	------------------------	--------------------	-----------------------	------------

RUSKIN ELEMENTARY SCHOOL
INSPECTED ON: 9/13/16

Ruskin Elementary School
1401 Turlock Lane
San Jose, CA 95132
(408)923-1950
Fax: (408)937-4846
Principal: Patricia Nunez

Parking

11

Playground

Playground and
Snack Area

Garbage

Storage

Fire Lane - Keep Clear

Parking

Parking

Parking

Landscape

Landscape

Fire Lane - Keep Clear

Landscape

Turlock Lane

Rev. 8/2014


I-1 Science Lab
I-2 Computer Lab

J-1 Music Rm
J-2 Jie-ye Gr 4
J-3 Gym

Garden Shed

RUSKIN ELEMENTARY SCHOOL
INSPECTED ON: 03-21-2016

Ruskin Elementary School
1401 Turlock Lane
San Jose, CA 95132
(408)923-1950
Fax: (408)937-4846
Principal: Parisa Nunez

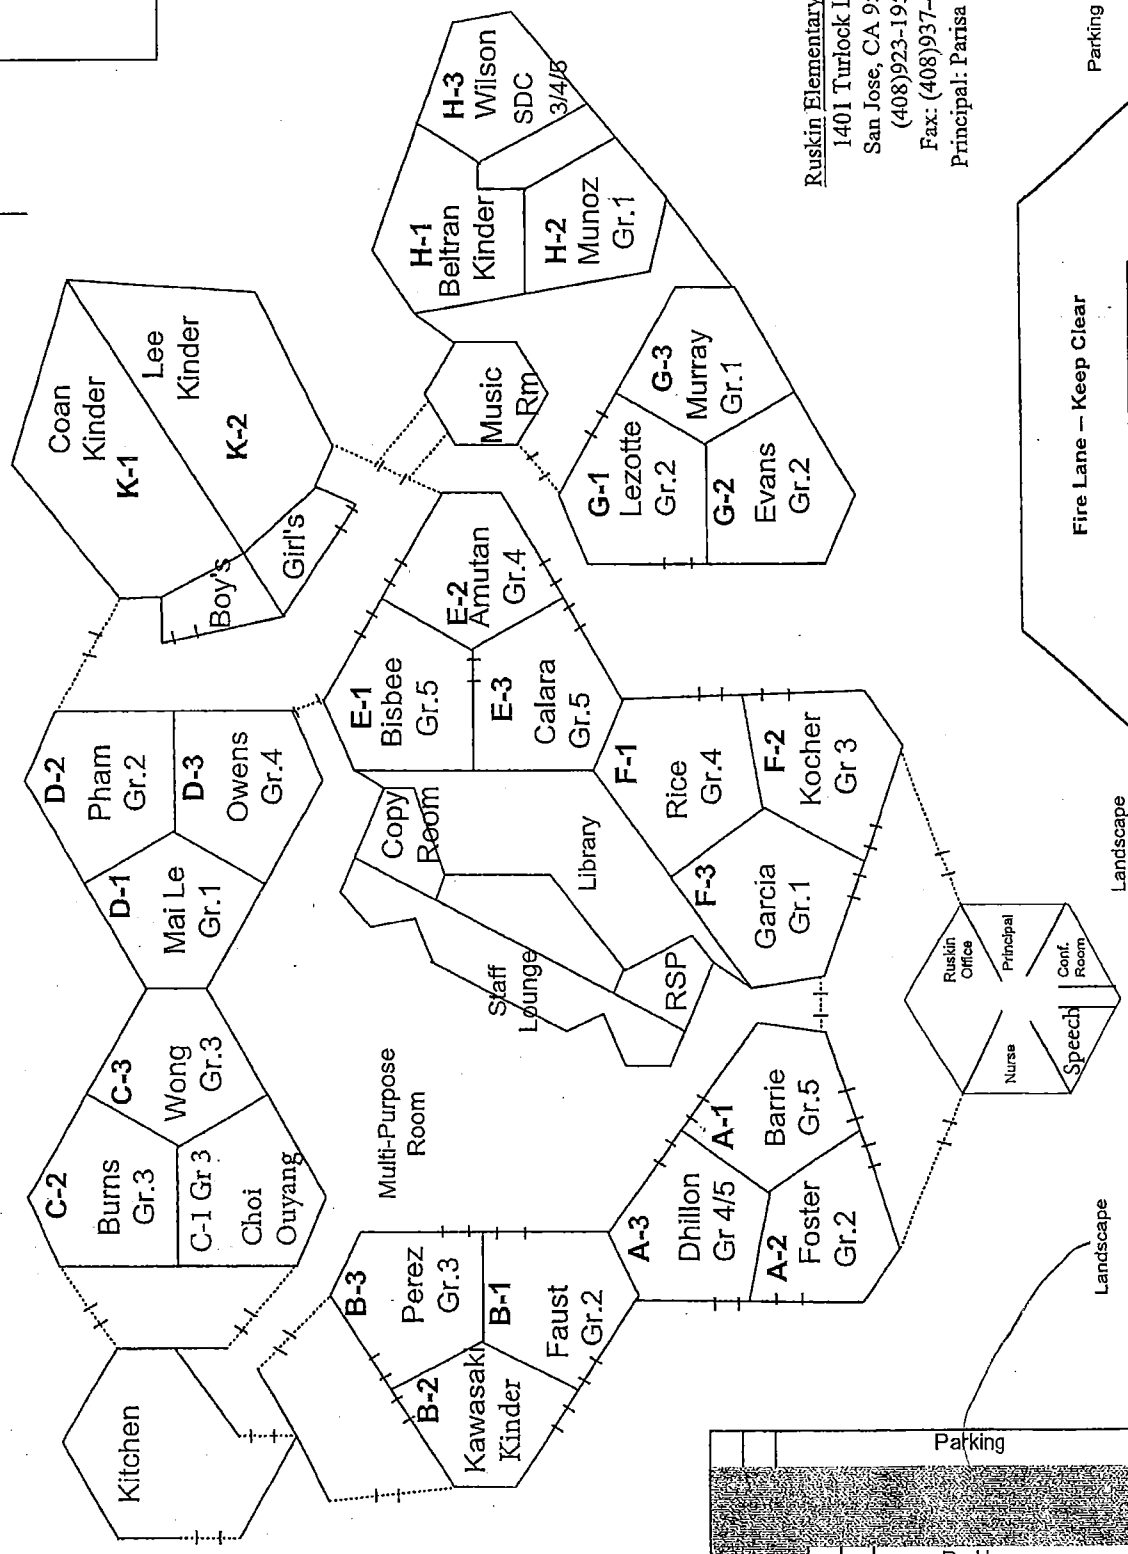

RUSKIN ELEMENTARY SCHOOL

INSPECTED ON: 9/18/15

Ruskin Elementary School
1401 Turlock Lane
San Jose, CA 95132
(408)923-1950
Fax: (408)937-4846
Principal: Parisa Nunez

Rev.8/2014

Playground

Playground and Snack Area

Garbage

Storage

Fire Lane -- Keep Clear

Parking

Parking

Parking

Parking

Fire Lane -- Keep Clear

Landscape


Landscape


Landscape

Parking

Turlock Lane


- I-1 Science Lab
- I-2 Computer Lab
- J-1 Music Rm
- J-2 Jie-ye Gr 4
- J-3 Gym

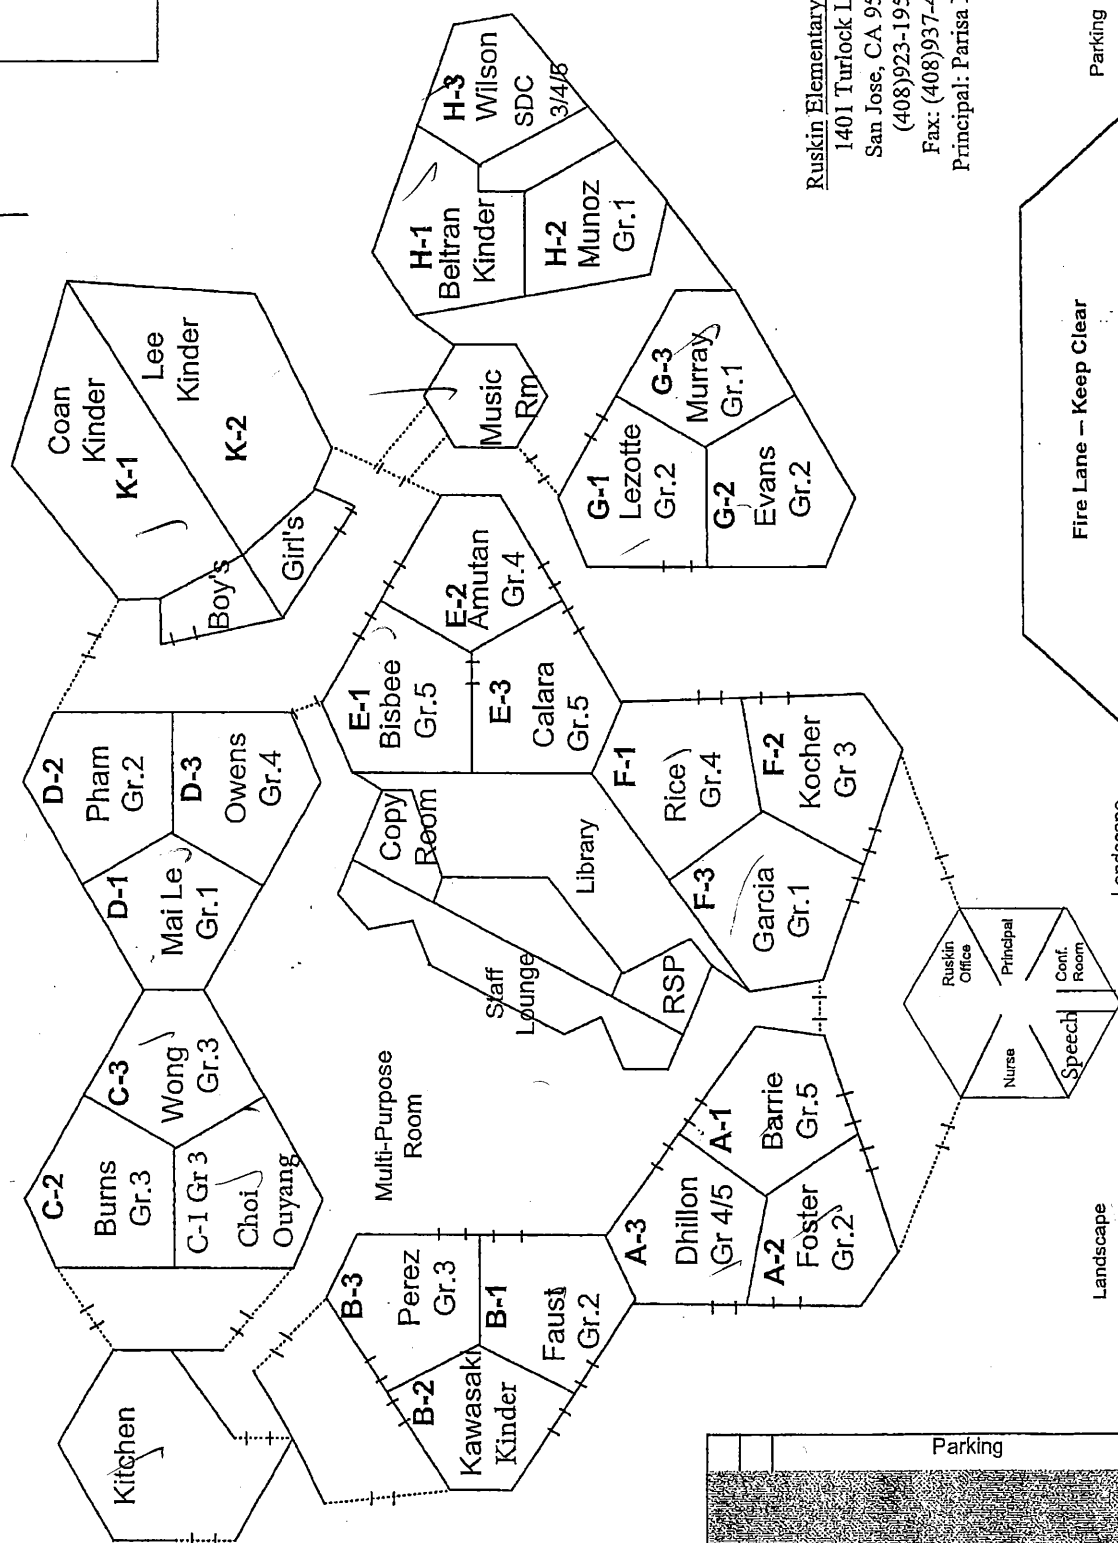

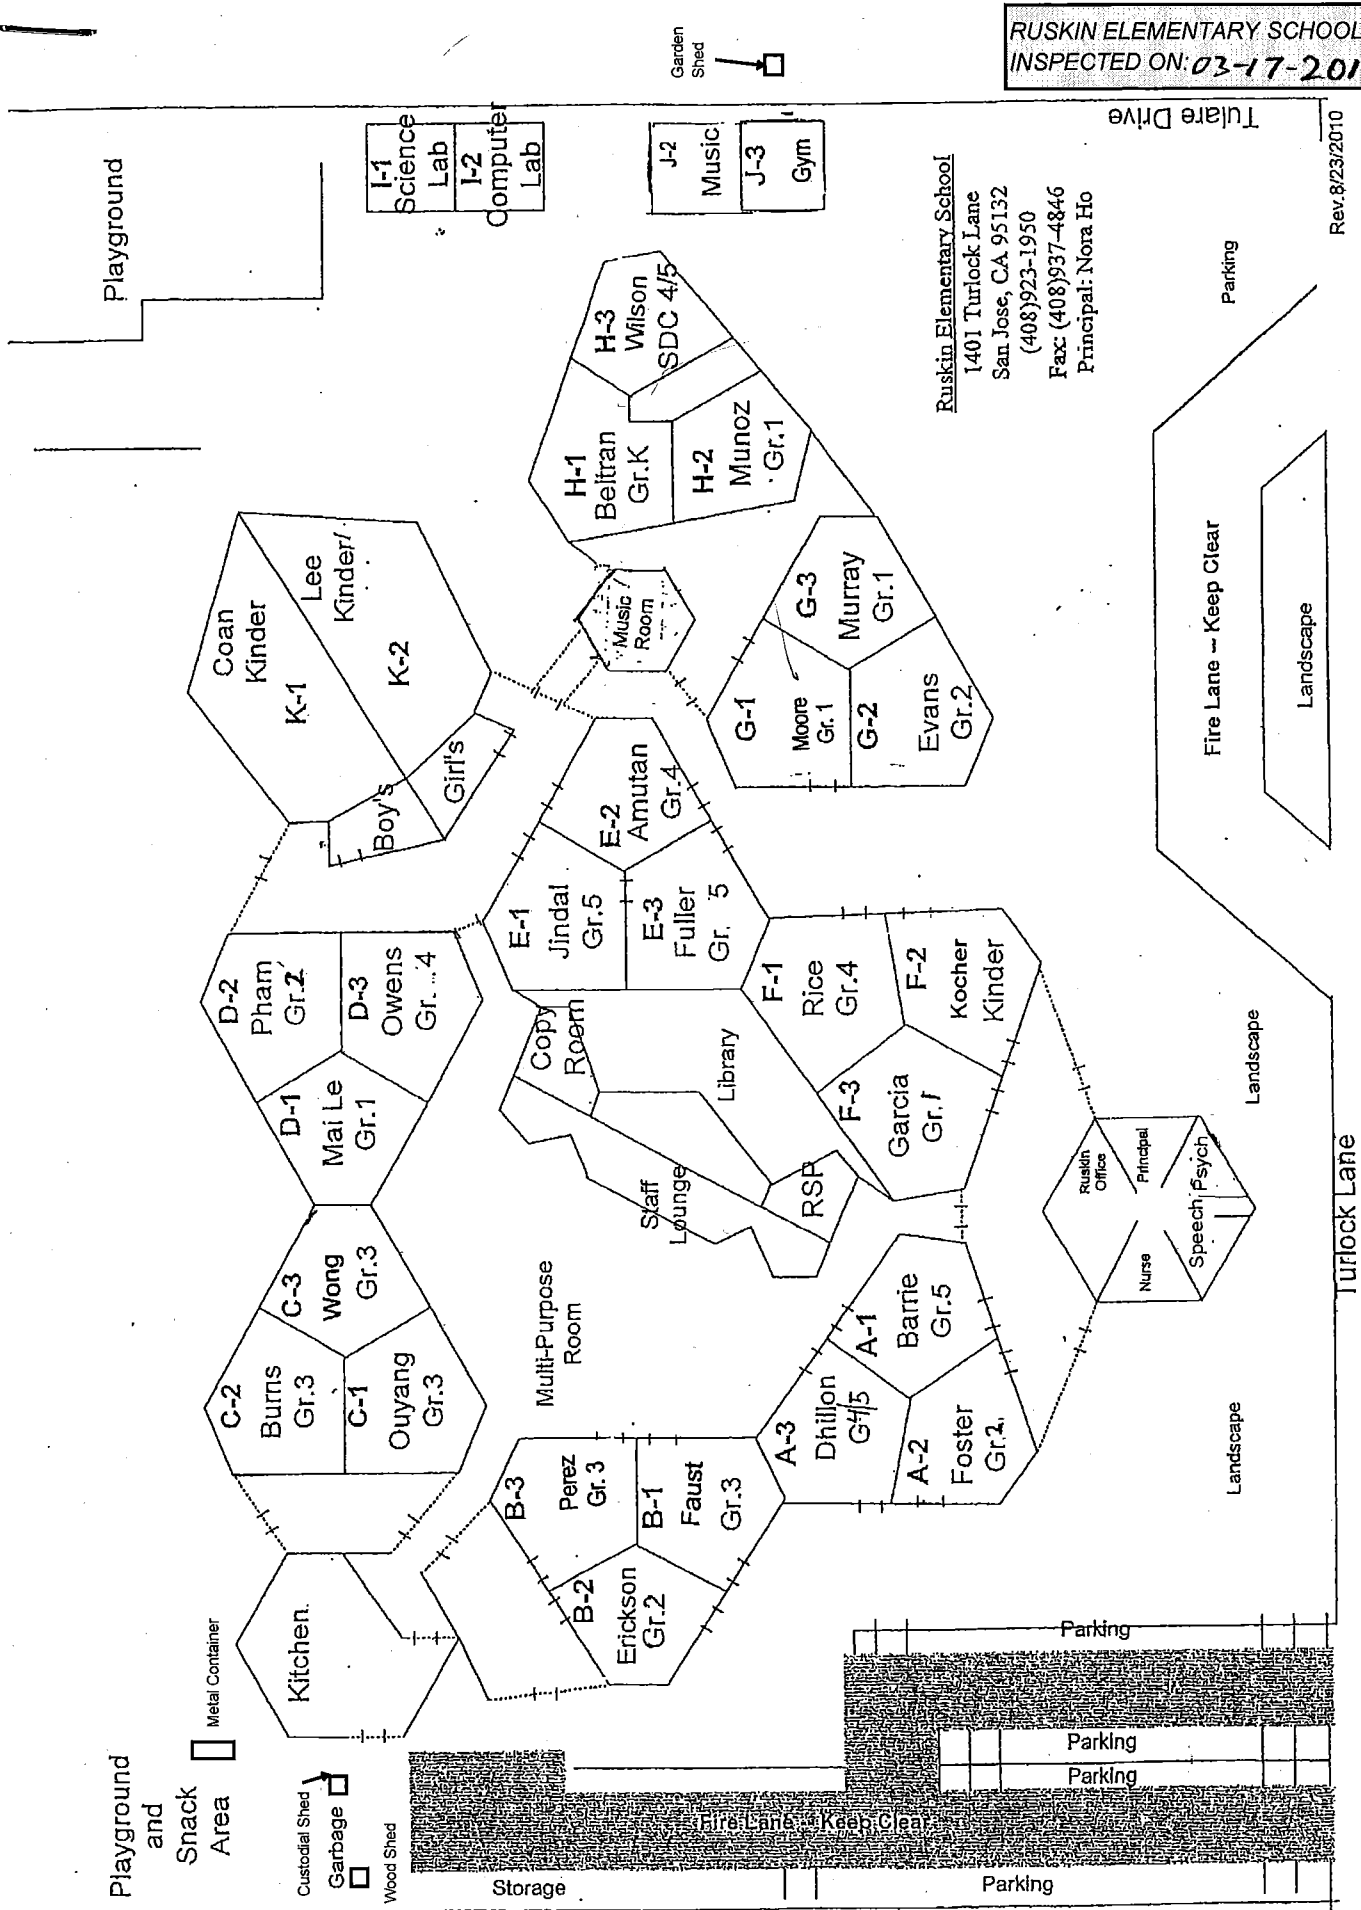


Ruskin Elementary School
1401 Turlock Lane
San Jose, CA 95132
(408)923-1950
Fax: (408)937-4846
Principal: Nora Ho

Rev.8/23/2010

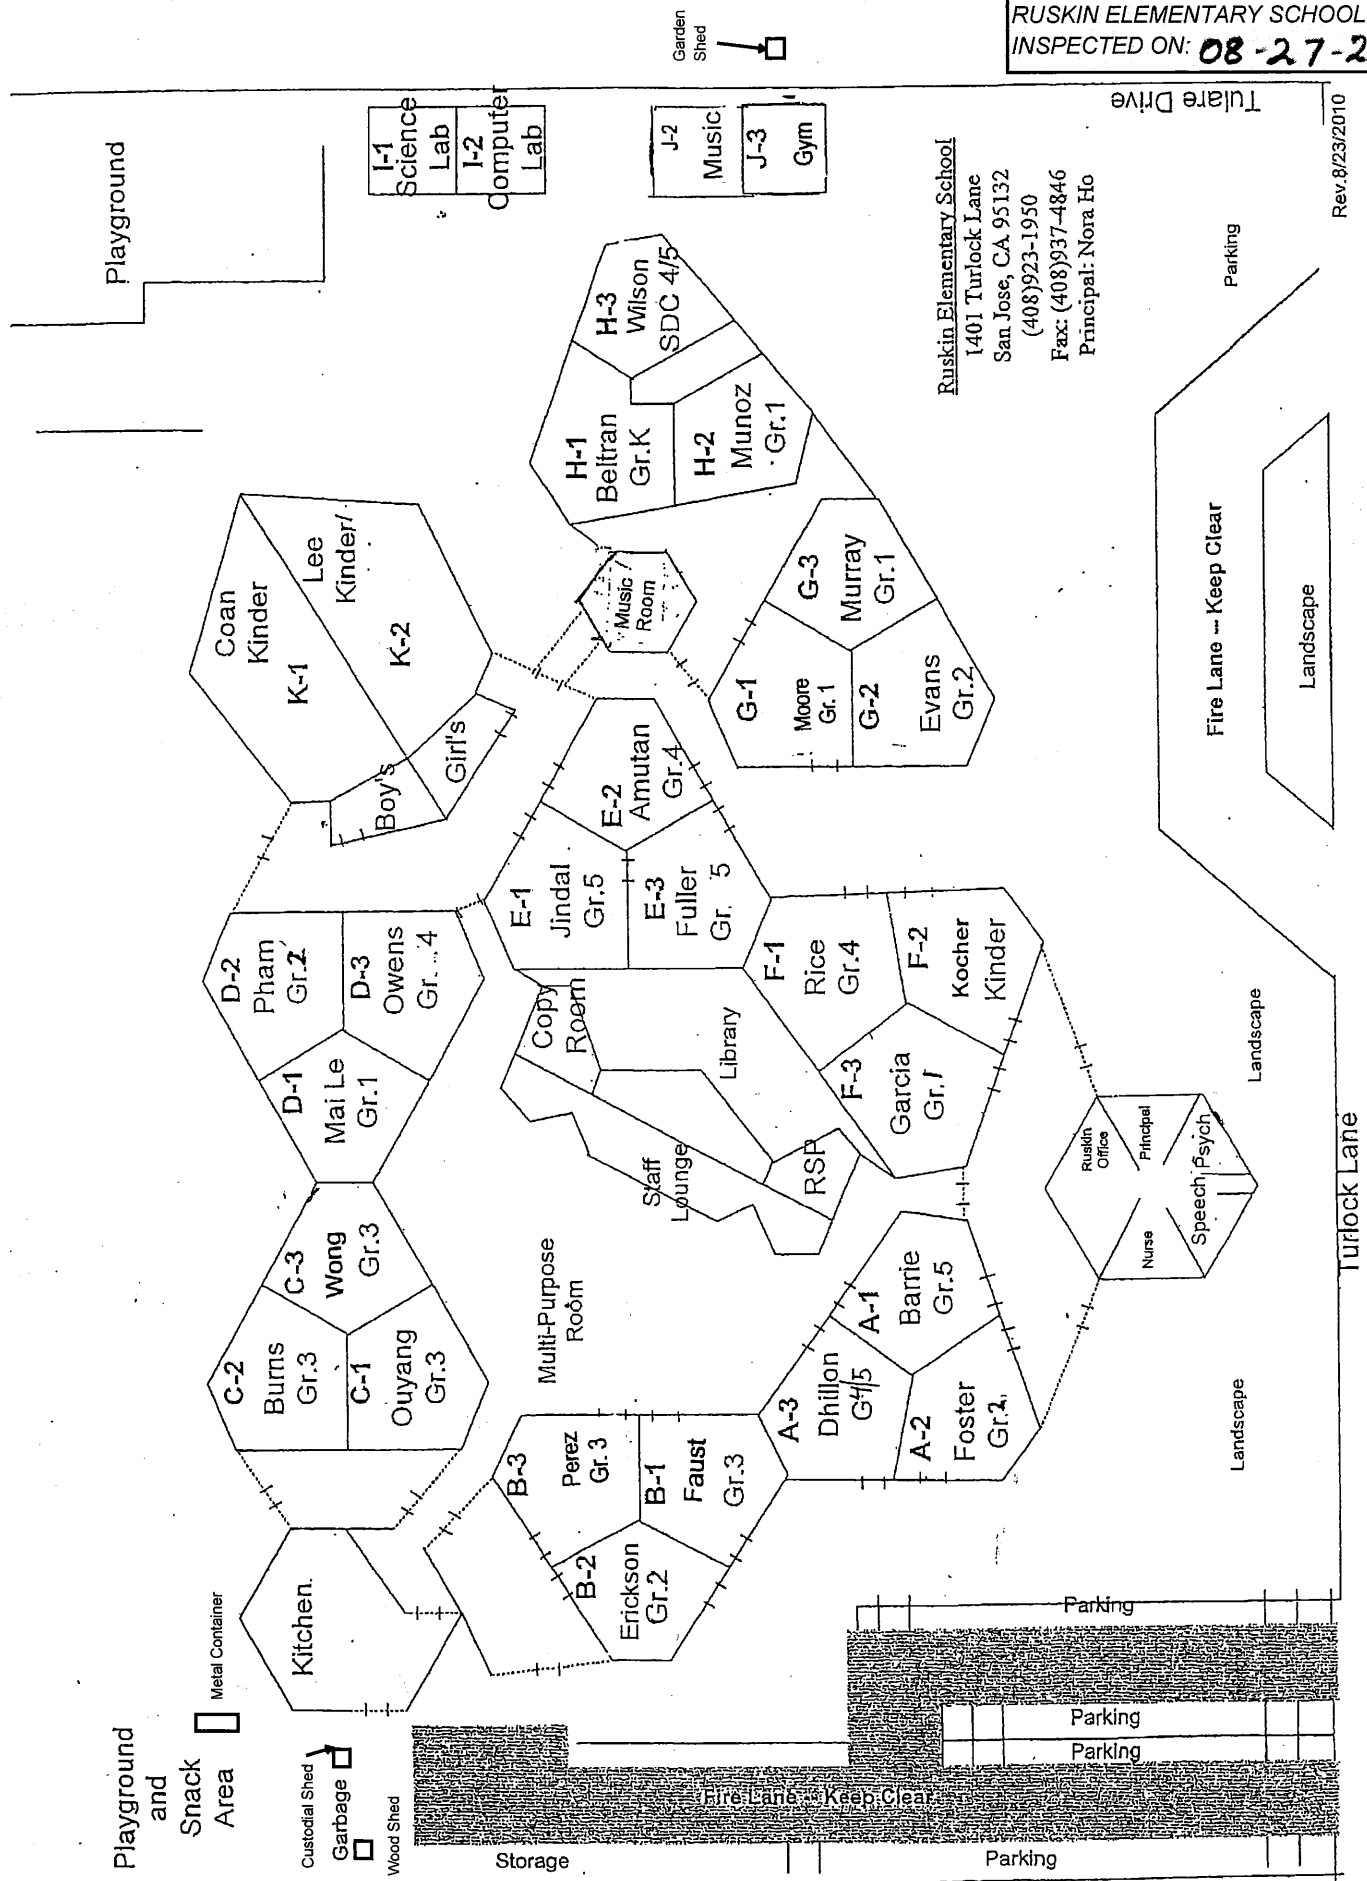


Rev.8/23/2010

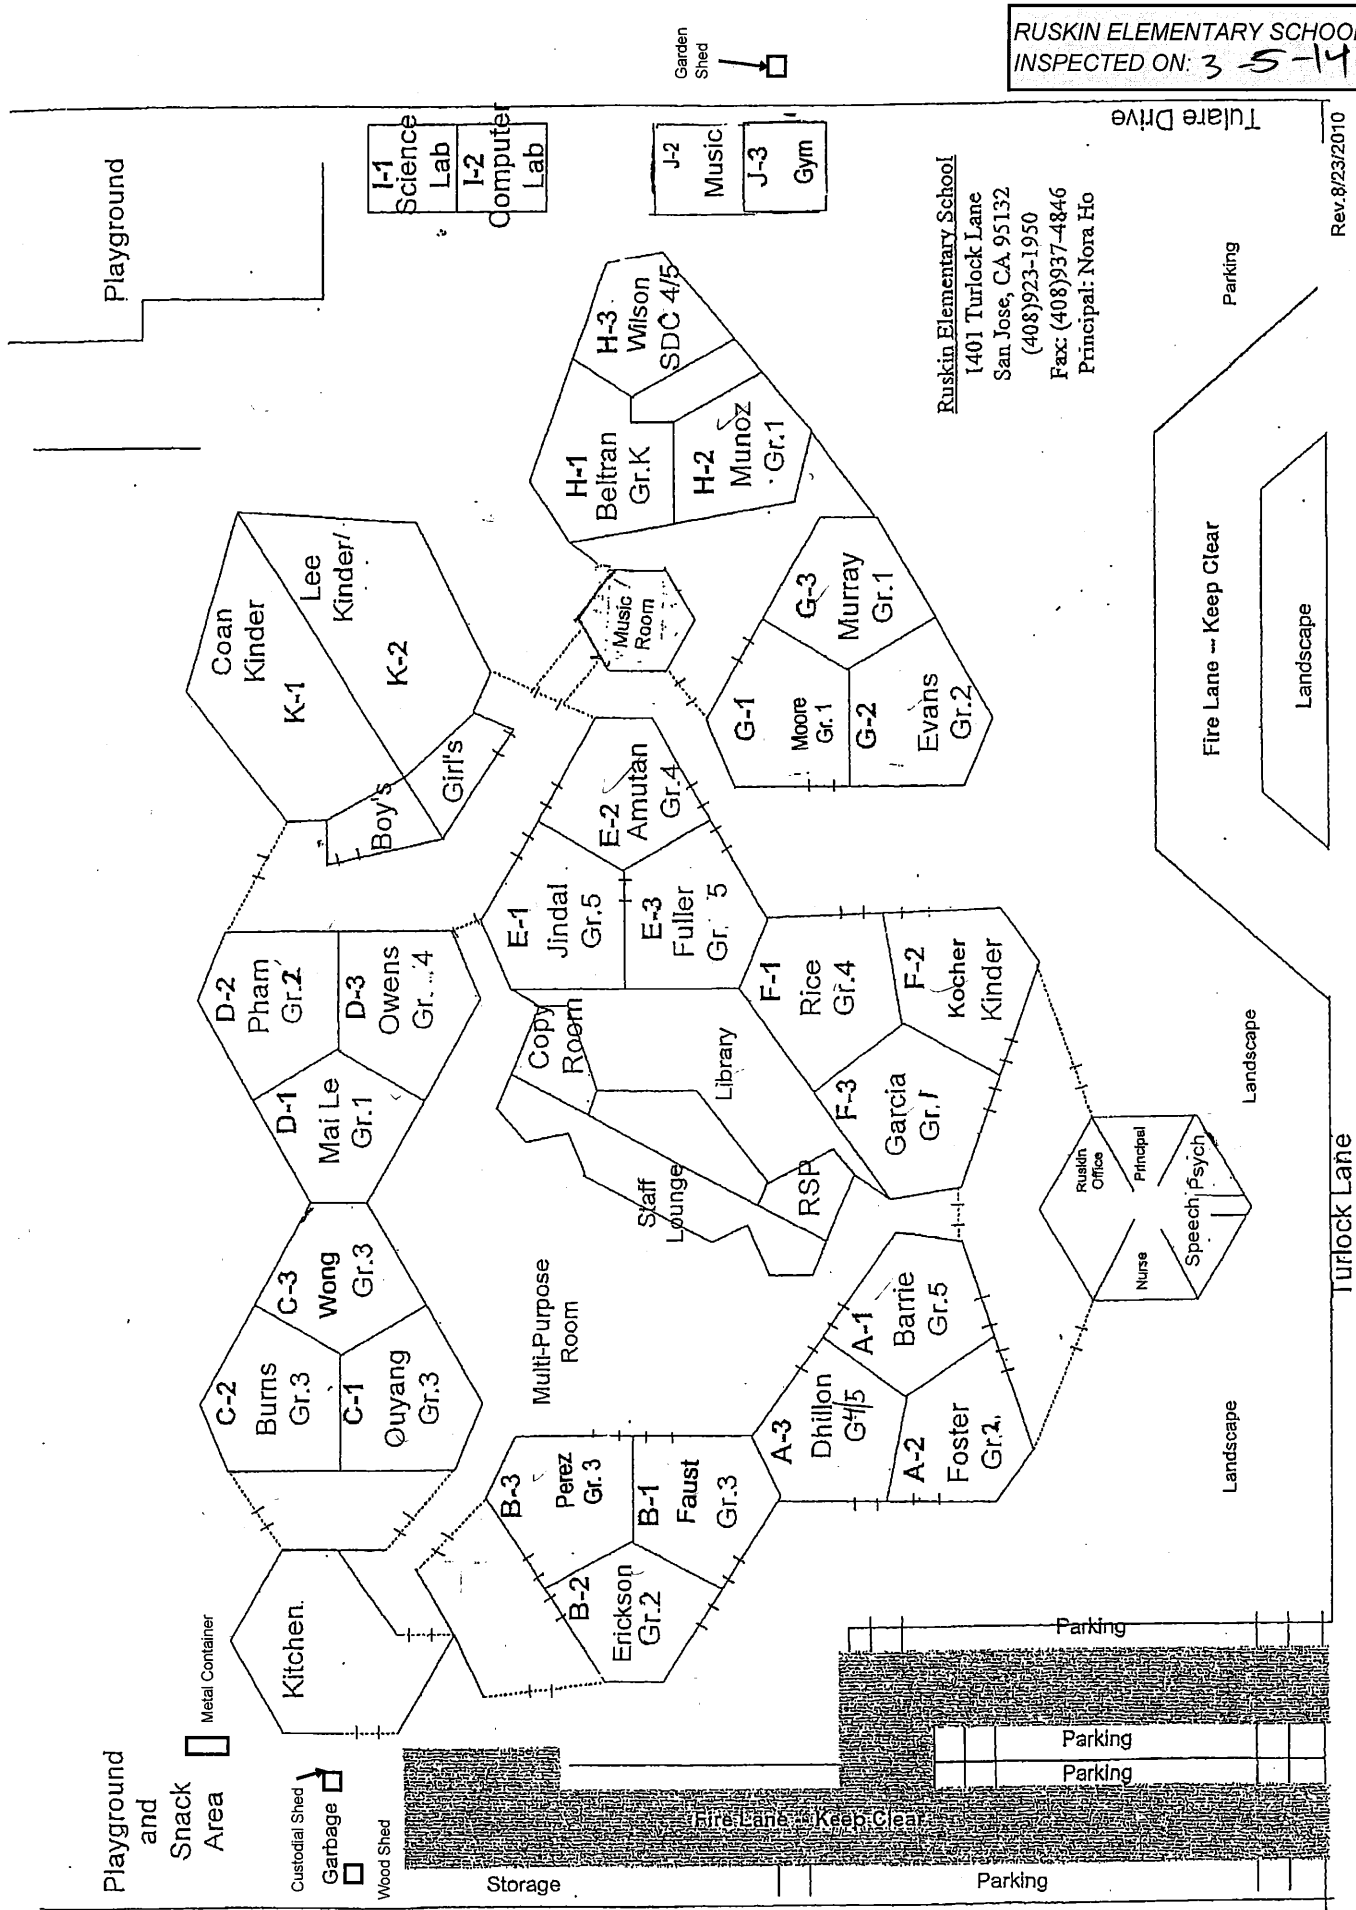


Ruskin Elementary School
 1401 Turlock Lane
 San Jose, CA 95132
 (408)923-1950
 Fax: (408)937-4846
 Principal: Nora Ho

Rev.8/23/2010

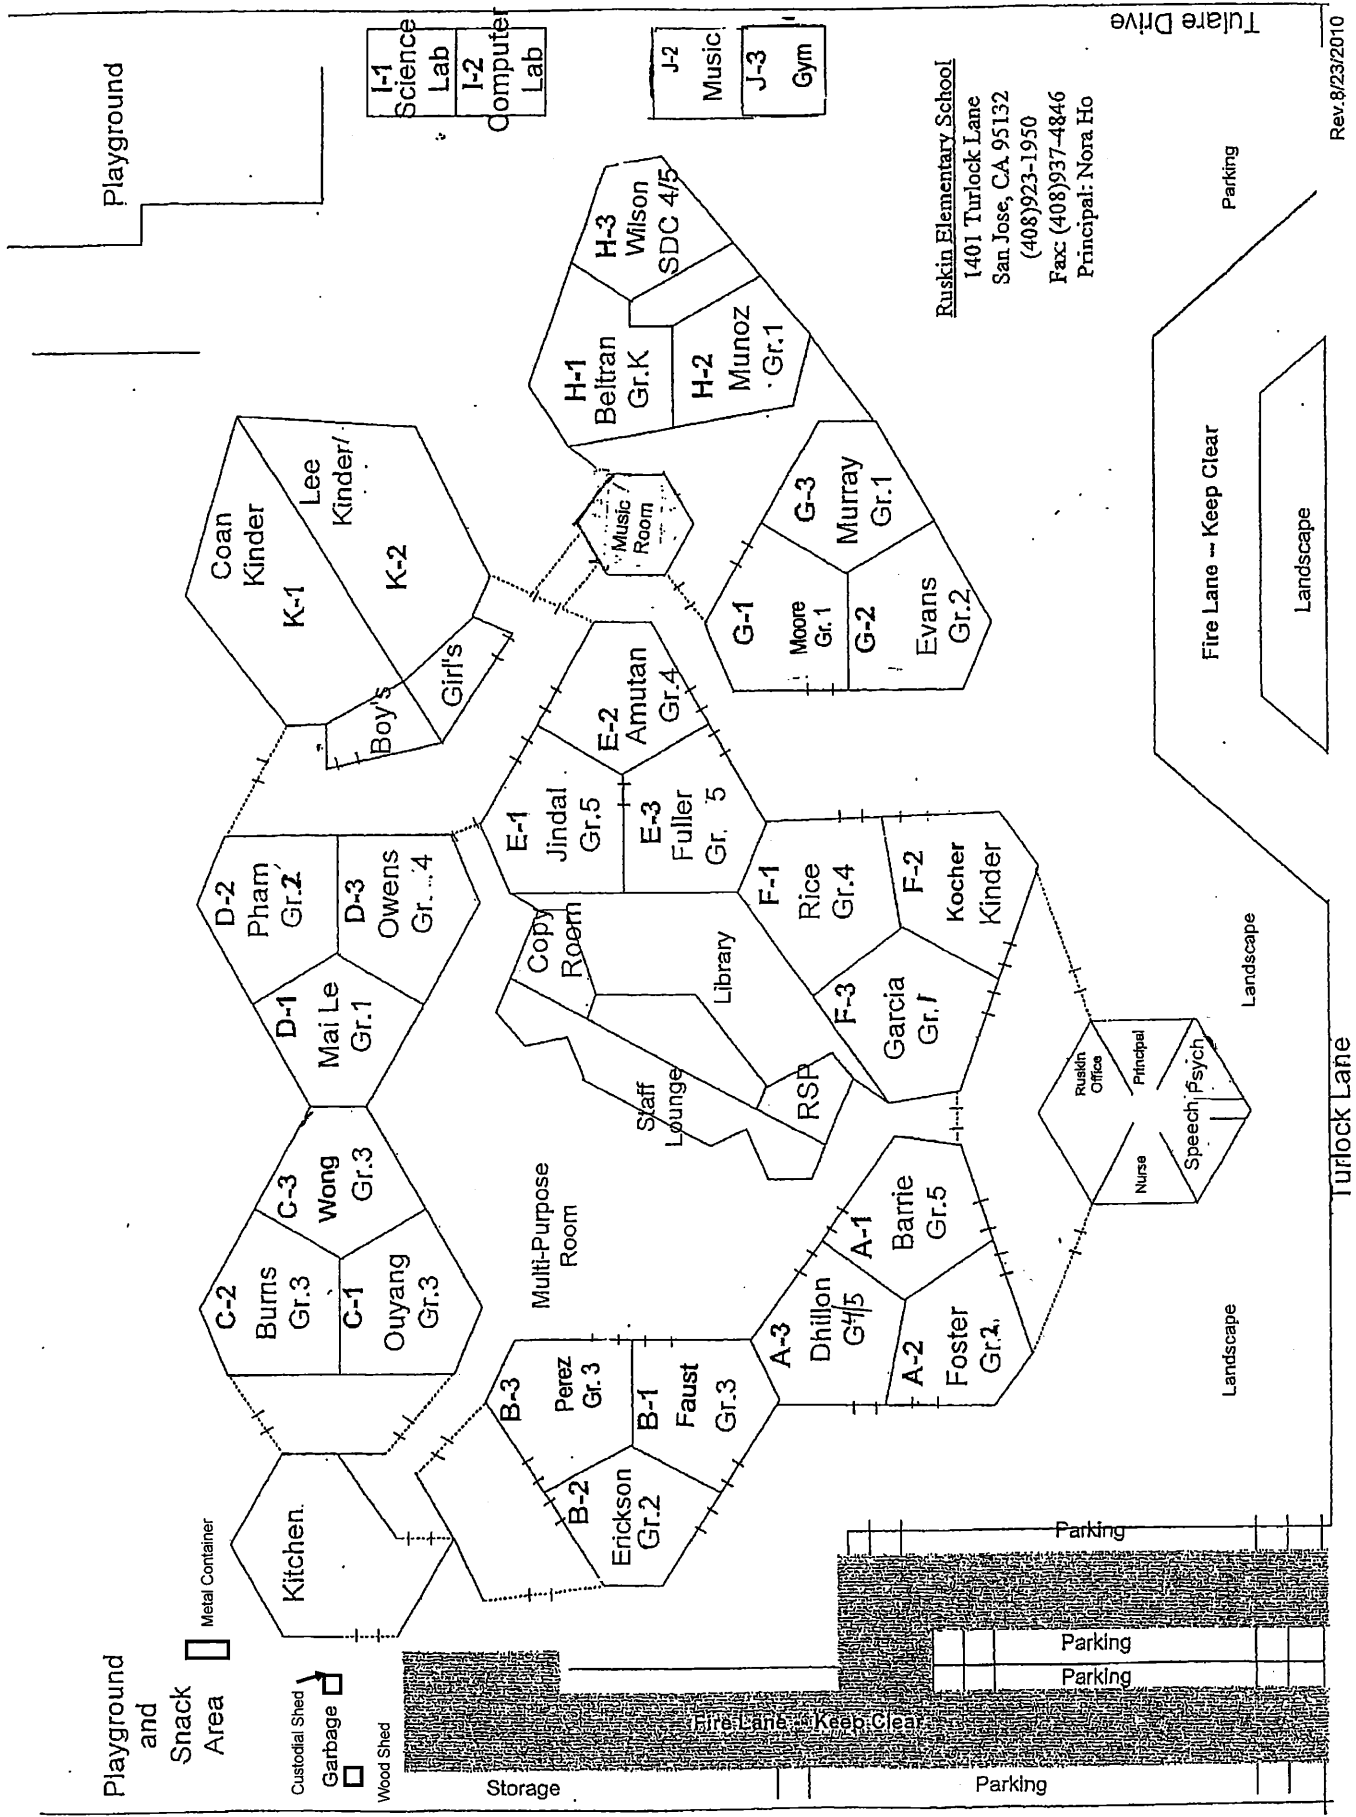

Rev.8/23/2010

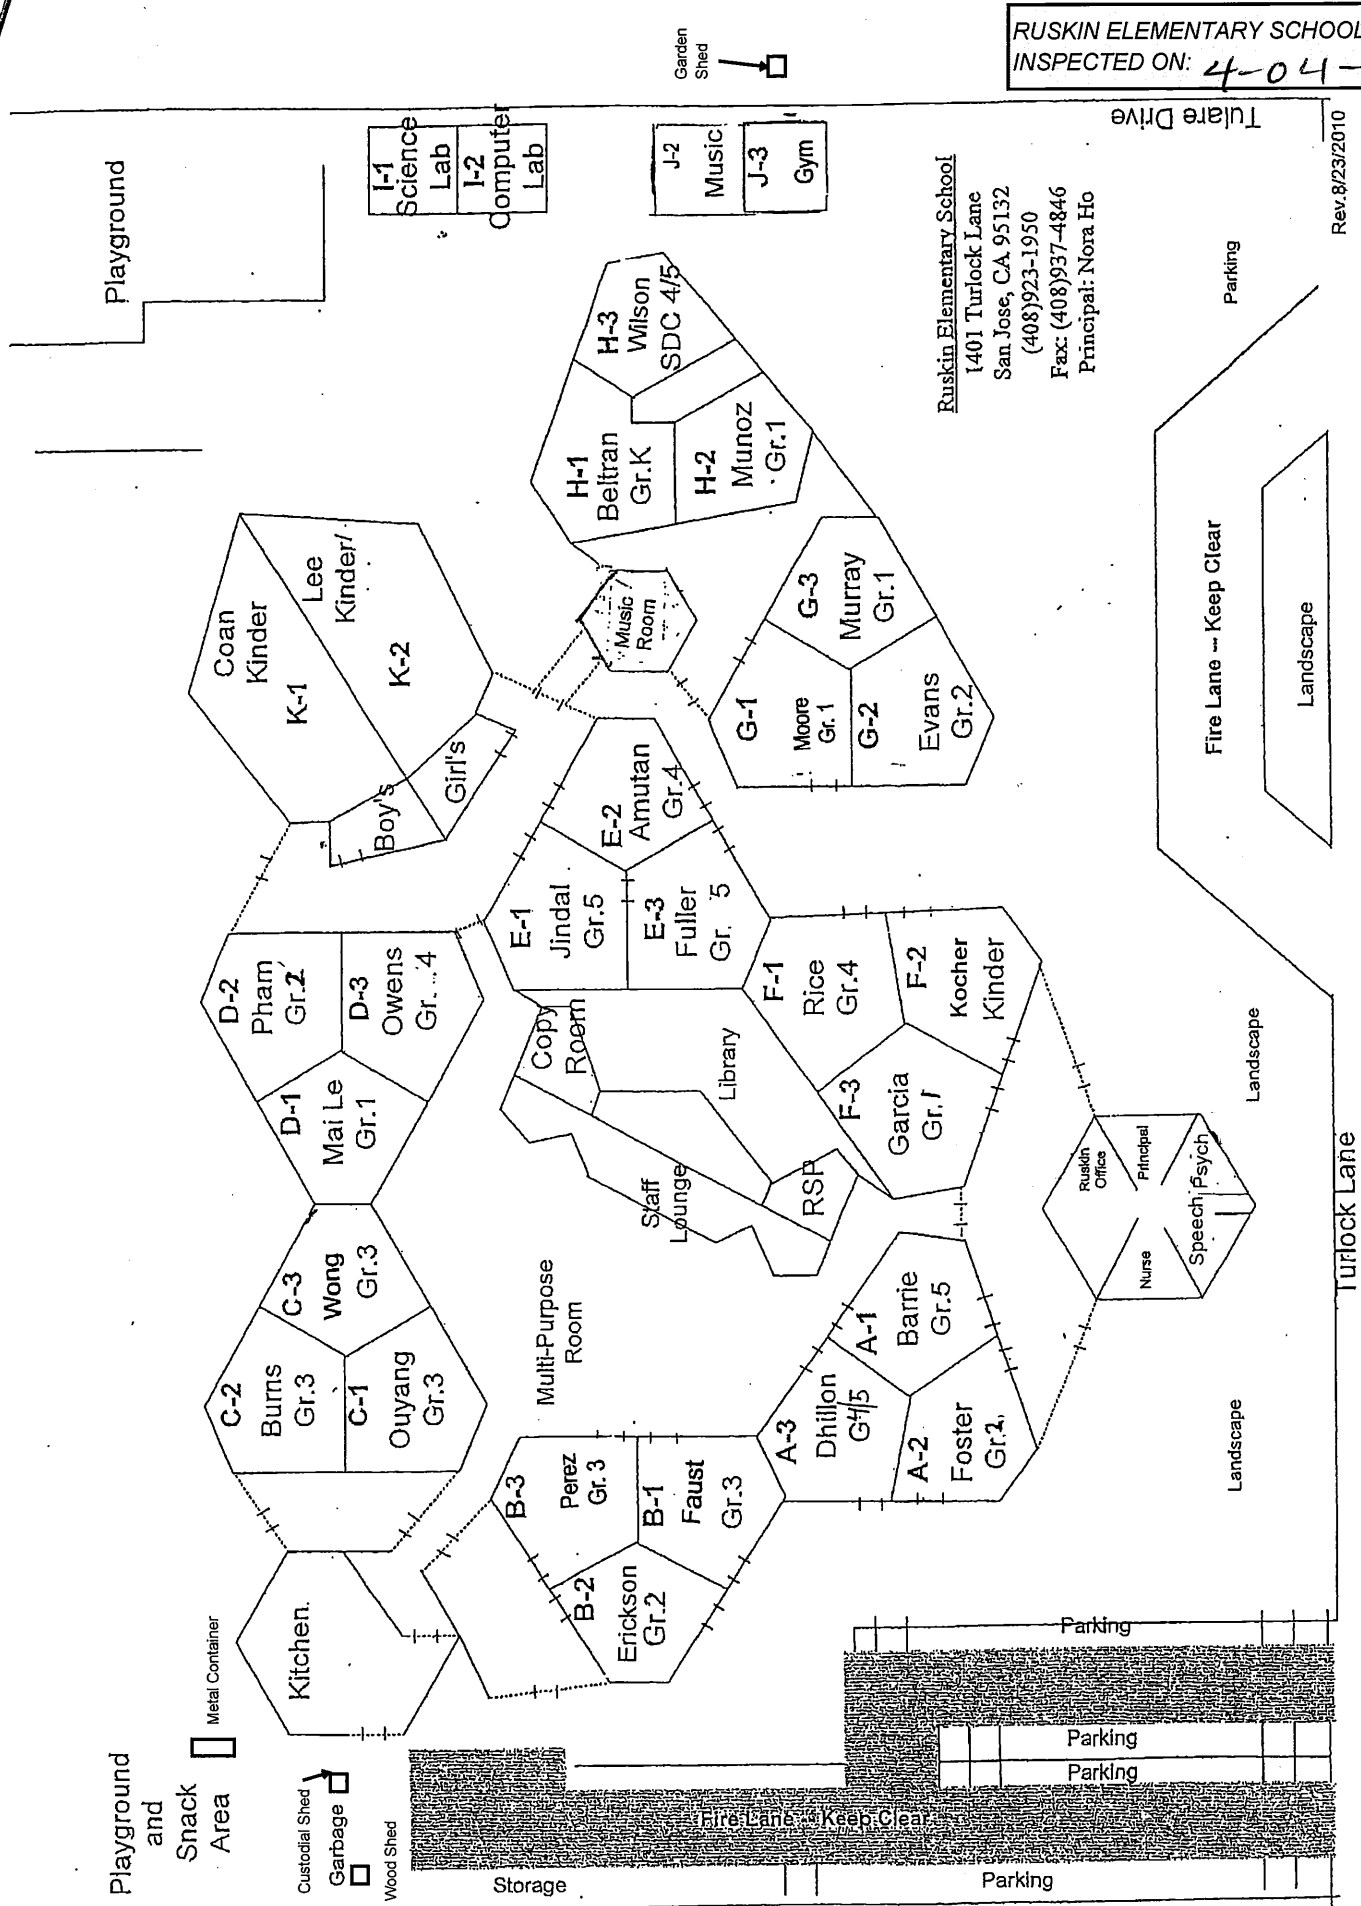

Ruskin Elementary School
 1401 Turlock Lane
 San Jose, CA 95132
 (408)923-1950
 Fax: (408)937-4846
 Principal: Nora Ho

Playground and

Snack Area



METAL CONTAINER

CUSTODIAL SHED

Garbage



WOOD SHED

Storage

Fire Lane -- Keep Clear

Parking

Parking

Parking

Landscape

Landscape

Fire Lane -- Keep Clear

Landscape

Turlock Lane

Rev. 8/2/2009

RUSKIN ELEMENTARY SCHOOL
INSPECTED ON: 10-11-12

Ruskin Elementary School

1401 Turlock Lane

San Jose, CA 95132

(408)923-1950

Fax: (408)937-4846

Principal: Nora Ho

Playground


I-1 Science Lab
I-2 Computer Lab

GARDEN

MUSIC

J-3 Music Rm

CYN

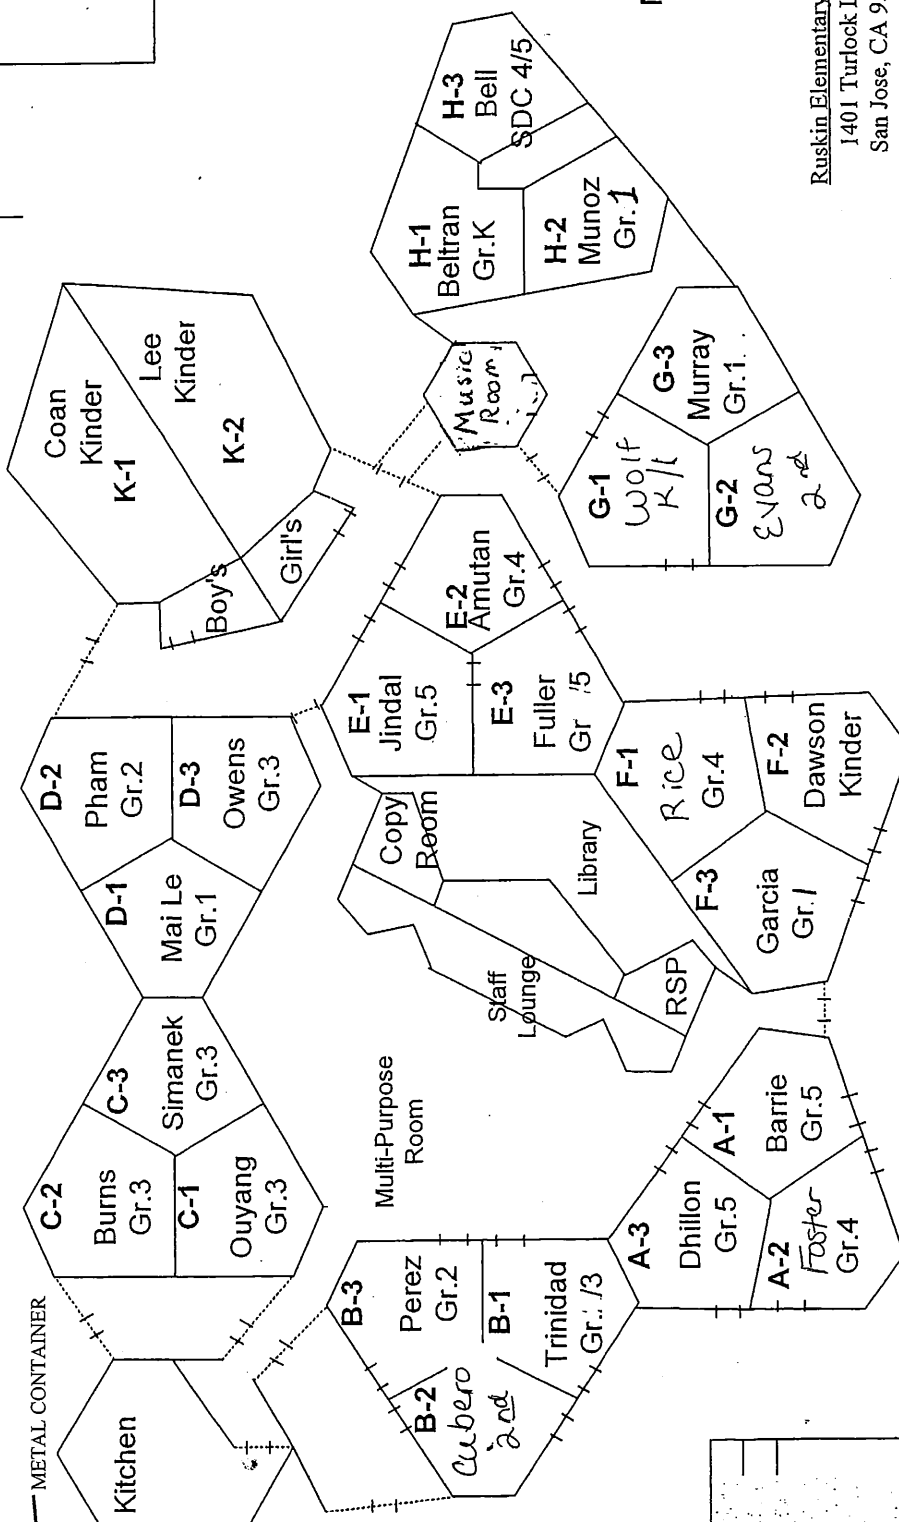

Playground and

Snack Area



METAL CONTAINER

CUSTODIAL SHED

Garbage



WOOD SHED

Storage

Fire Lane -- Keep Clear

Parking

Parking

Parking

Landscape

Landscape

Landscape

Fire Lane -- Keep Clear

Parking

Playground

I-1 Science Lab
I-2 Computer Lab

GARDEN SHED

J-3 Music Rm


Ruskin Elementary School

1401 Turlock Lane
San Jose, CA 95132
(408)923-1950
Fax: (408)937-4846
Principal: Nora Ho

RUSKIN ELEMENTARY SCHOOL
INSPECTED ON: 04-10-12

Rev. 8/21/2009

Turlock Lane

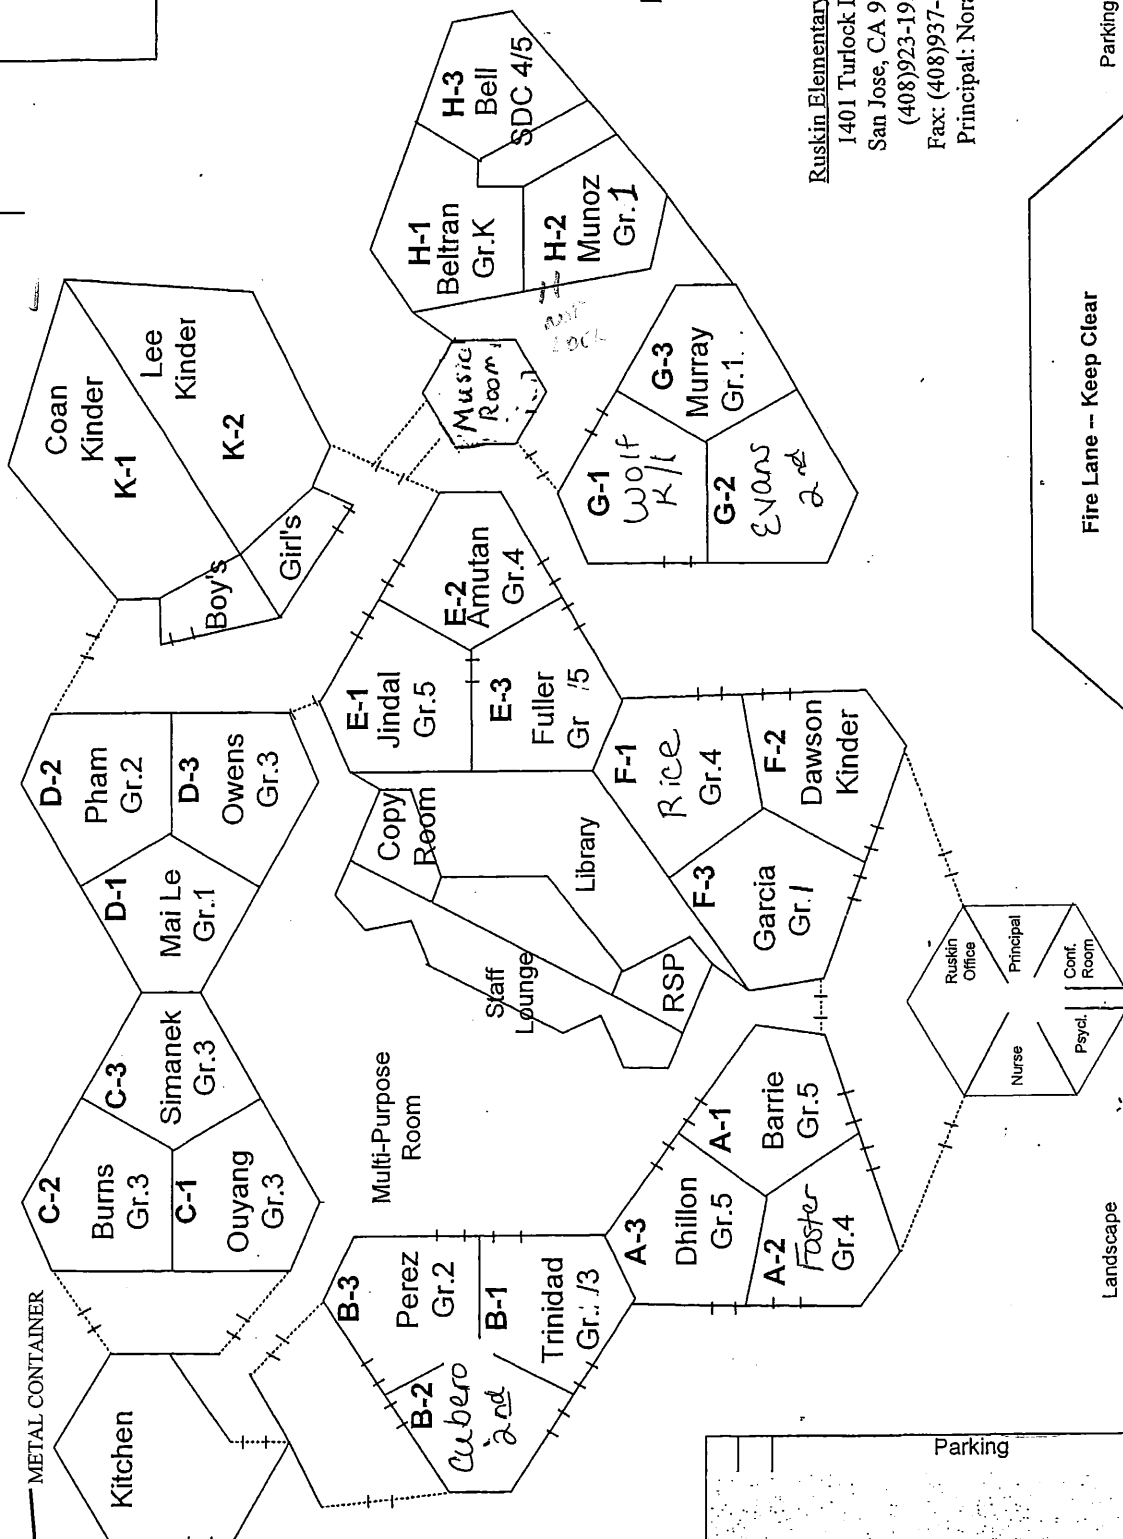

Playground
and
Snack
Area

Garbage

Storage

Fire Lane -- Keep Clear

Parking

Parking

Parking

Parking

Landscape

Landscape

Turlock Lane

Fire Lane -- Keep Clear

Landscape

Parking

Playground

Kitchen

Multi-Purpose
Room

Staff
Lounge

Library

RSP

Copy
Room

Boy's

Girl's

Music
Room

H-1
Beltran
Gr.K

H-2
Munoz
Gr.1

H-3
Bell
SDC 4/5

J-3
Music Rm

I-2
Computer
Lab

I-1
Science
Lab

Coan
Kinder
K-1

Lee
Kinder
K-2

D-2
Pham
Gr.2

D-3
Owens
Gr.3

D-1
Mai Le
Gr.1

C-3
Simanek
Gr.3

C-2
Burns
Gr.3

C-1
Ouyang
Gr.3

B-3
Perez
Gr.2

B-2
Cubero
Gr.1

B-1
Trinidad
Gr.1/3

E-2
Amutan
Gr.4

E-3
Fuller
Gr.5

E-1
Jindal
Gr.5

F-1
Rice
Gr.4

F-3
Garcia
Gr.1

F-2
Dawson
Kinder

A-3
Dhillon
Gr.5

A-2
Foster
Gr.4

A-1
Barrie
Gr.5

Ruskin
Office

Nurse

Principal

Conf.
Room

Psychol.
Room

RUSKIN ELEMENTARY SCHOOL
INSPECTED ON: 12-29-11


Ruskin Elementary School
1401 Turlock Lane
San Jose, CA 95132
(408)923-1950
Fax: (408)937-4846
Principal: Nora Ho

Rev.8/2/2009

RUSKIN ELEMENTARY SCHOOL
 INSPECTED ON: **9/13/16**

Ruskin Elementary School
 1401 Turlock Lane
 San Jose, CA 95132
 (408) 923-1950
 Fax: (408) 937-4846
 Principal: Nora Ho

Rev. 8/10/2016

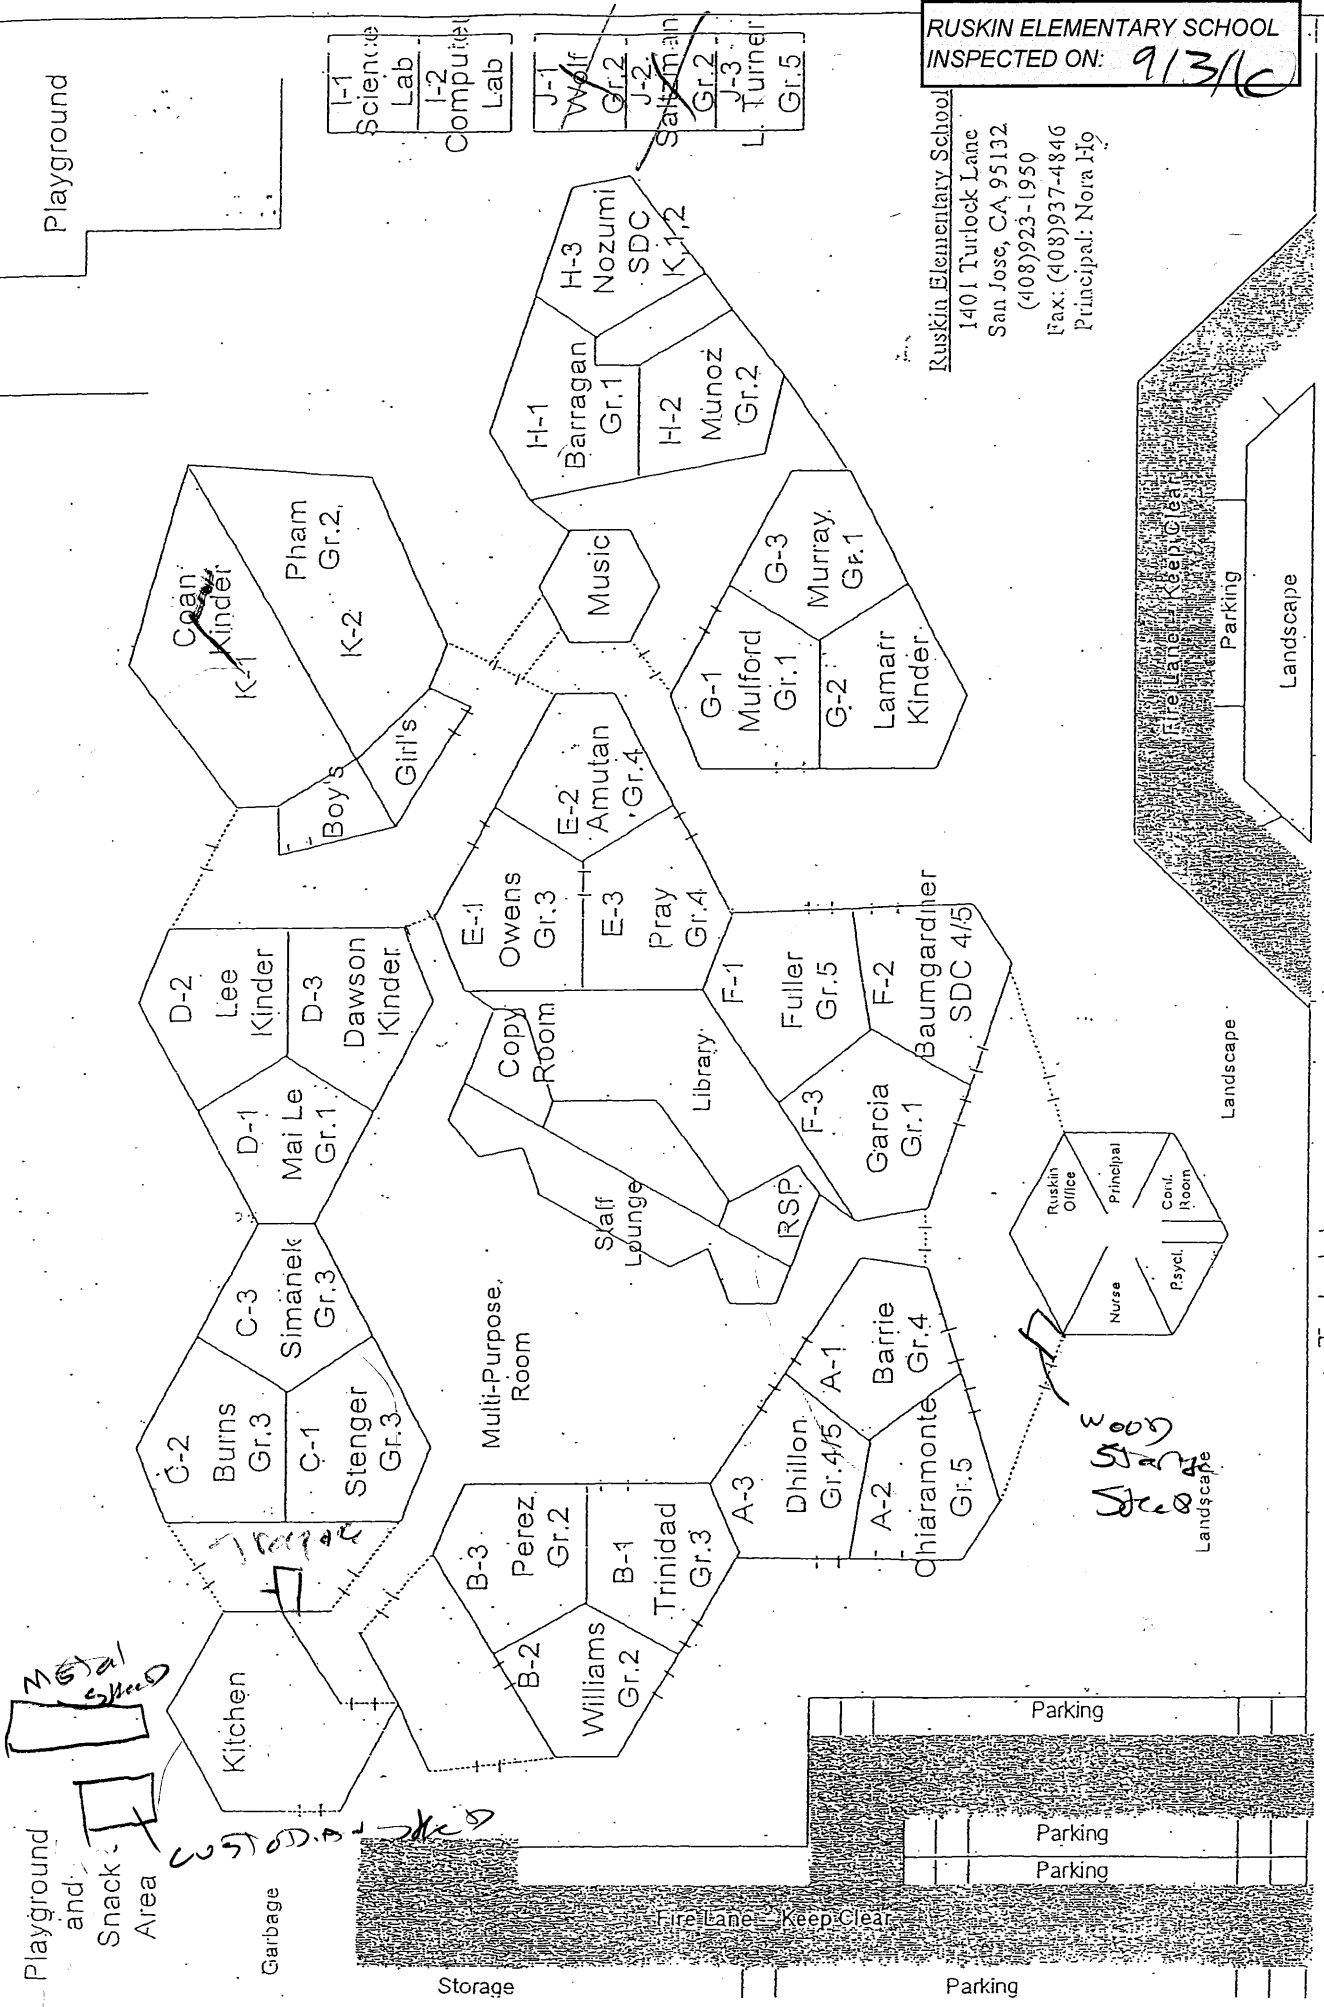

Turlock Lane

Playground
and
Snack
Area

Garbage

Storage

Fire Lane - Keep Clear

Parking

Parking

Parking

Parking

Landscape

Landscape

Landscape


Parking

Fire Lane - Keep Clear

Turlock Lane

Rev. 8/10/2016

Playground

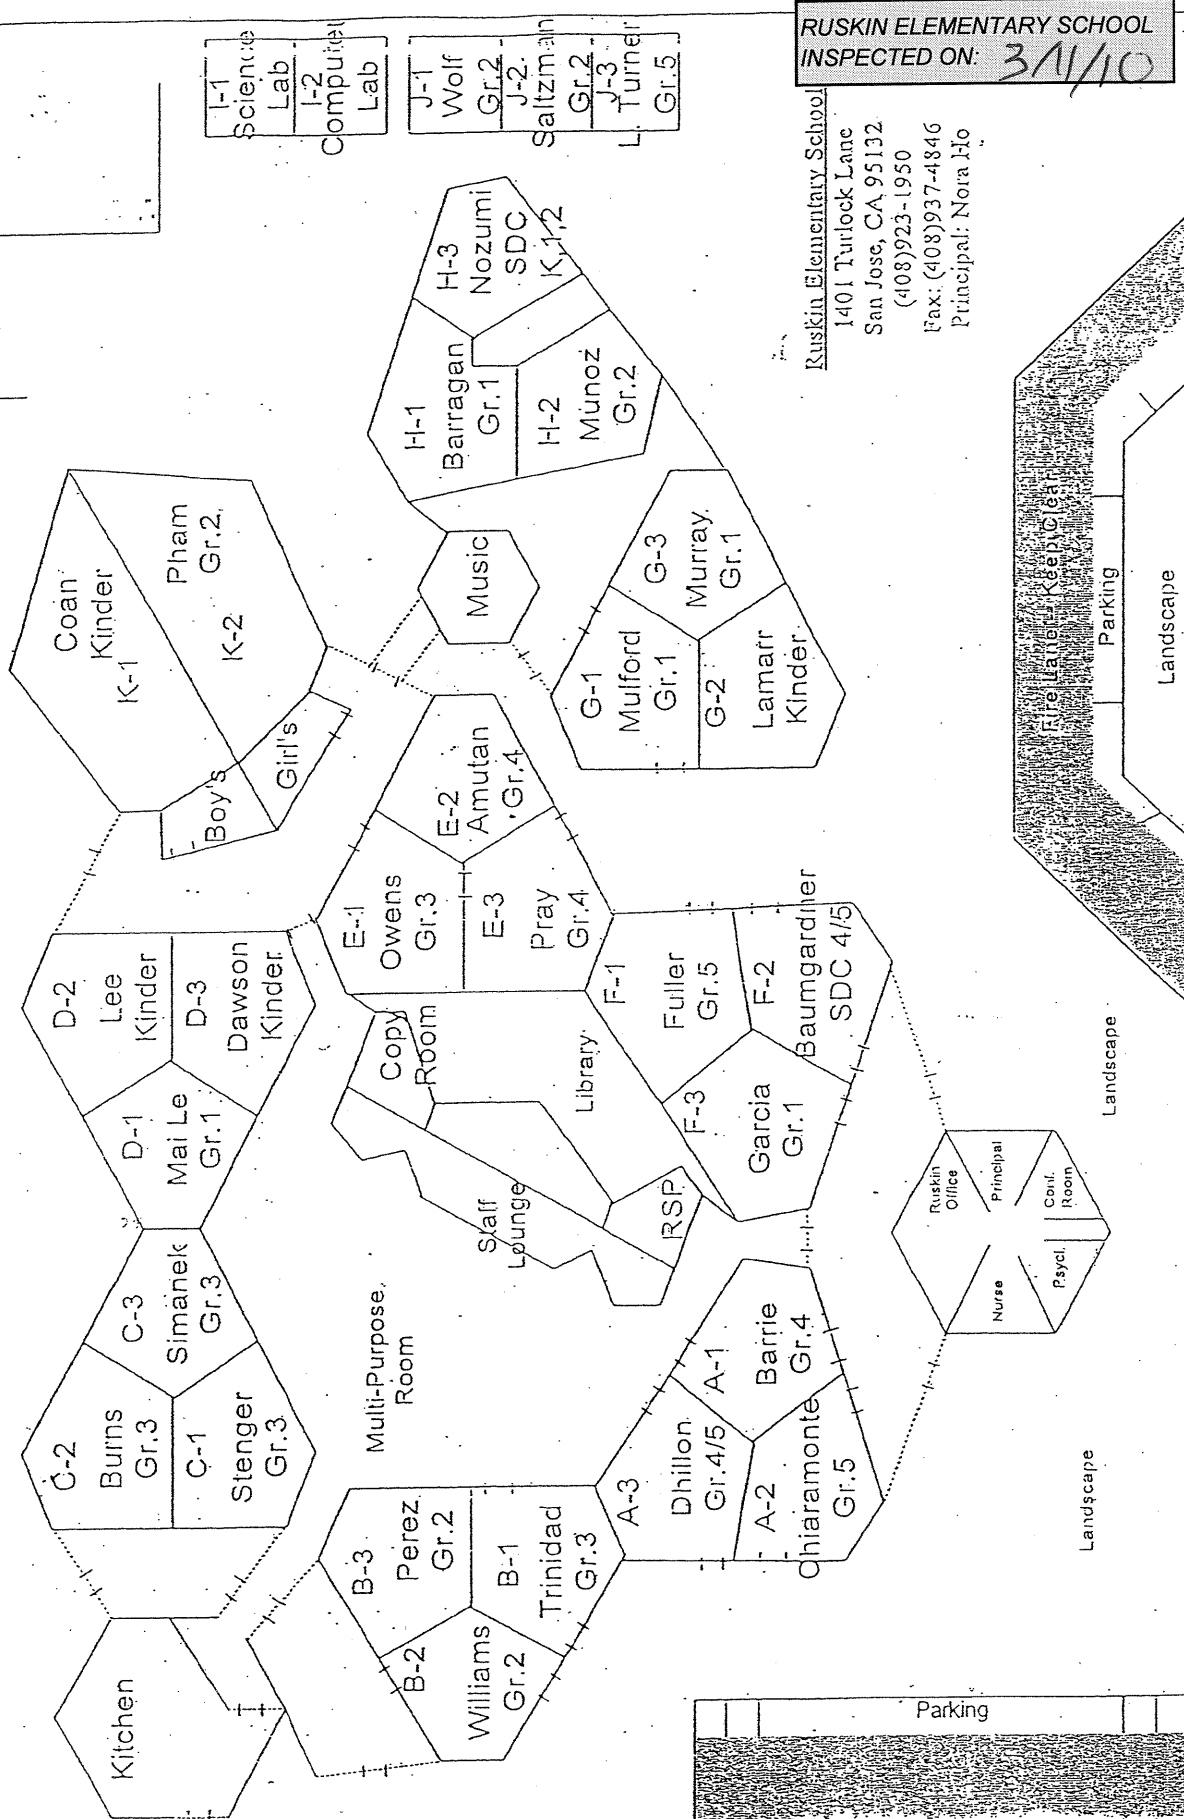

RUSKIN ELEMENTARY SCHOOL
INSPECTED ON: 3/1/10

Ruskin Elementary School
1401 Turlock Lane
San Jose, CA 95132
(408)923-1950
Fax: (408)937-4846
Principal: Nora Ho

Traffic
Parrot equip
g/s



↑ Meadow St
Container

Playground
and
Snack
Area

Garbage

Storage

Fire Lane - Keep Clear

Parking

Parking

Parking

Parking

Landscape

Landscape


Parking

Landscape

Turlock Lane

Rev. 8/10/2016

Playground

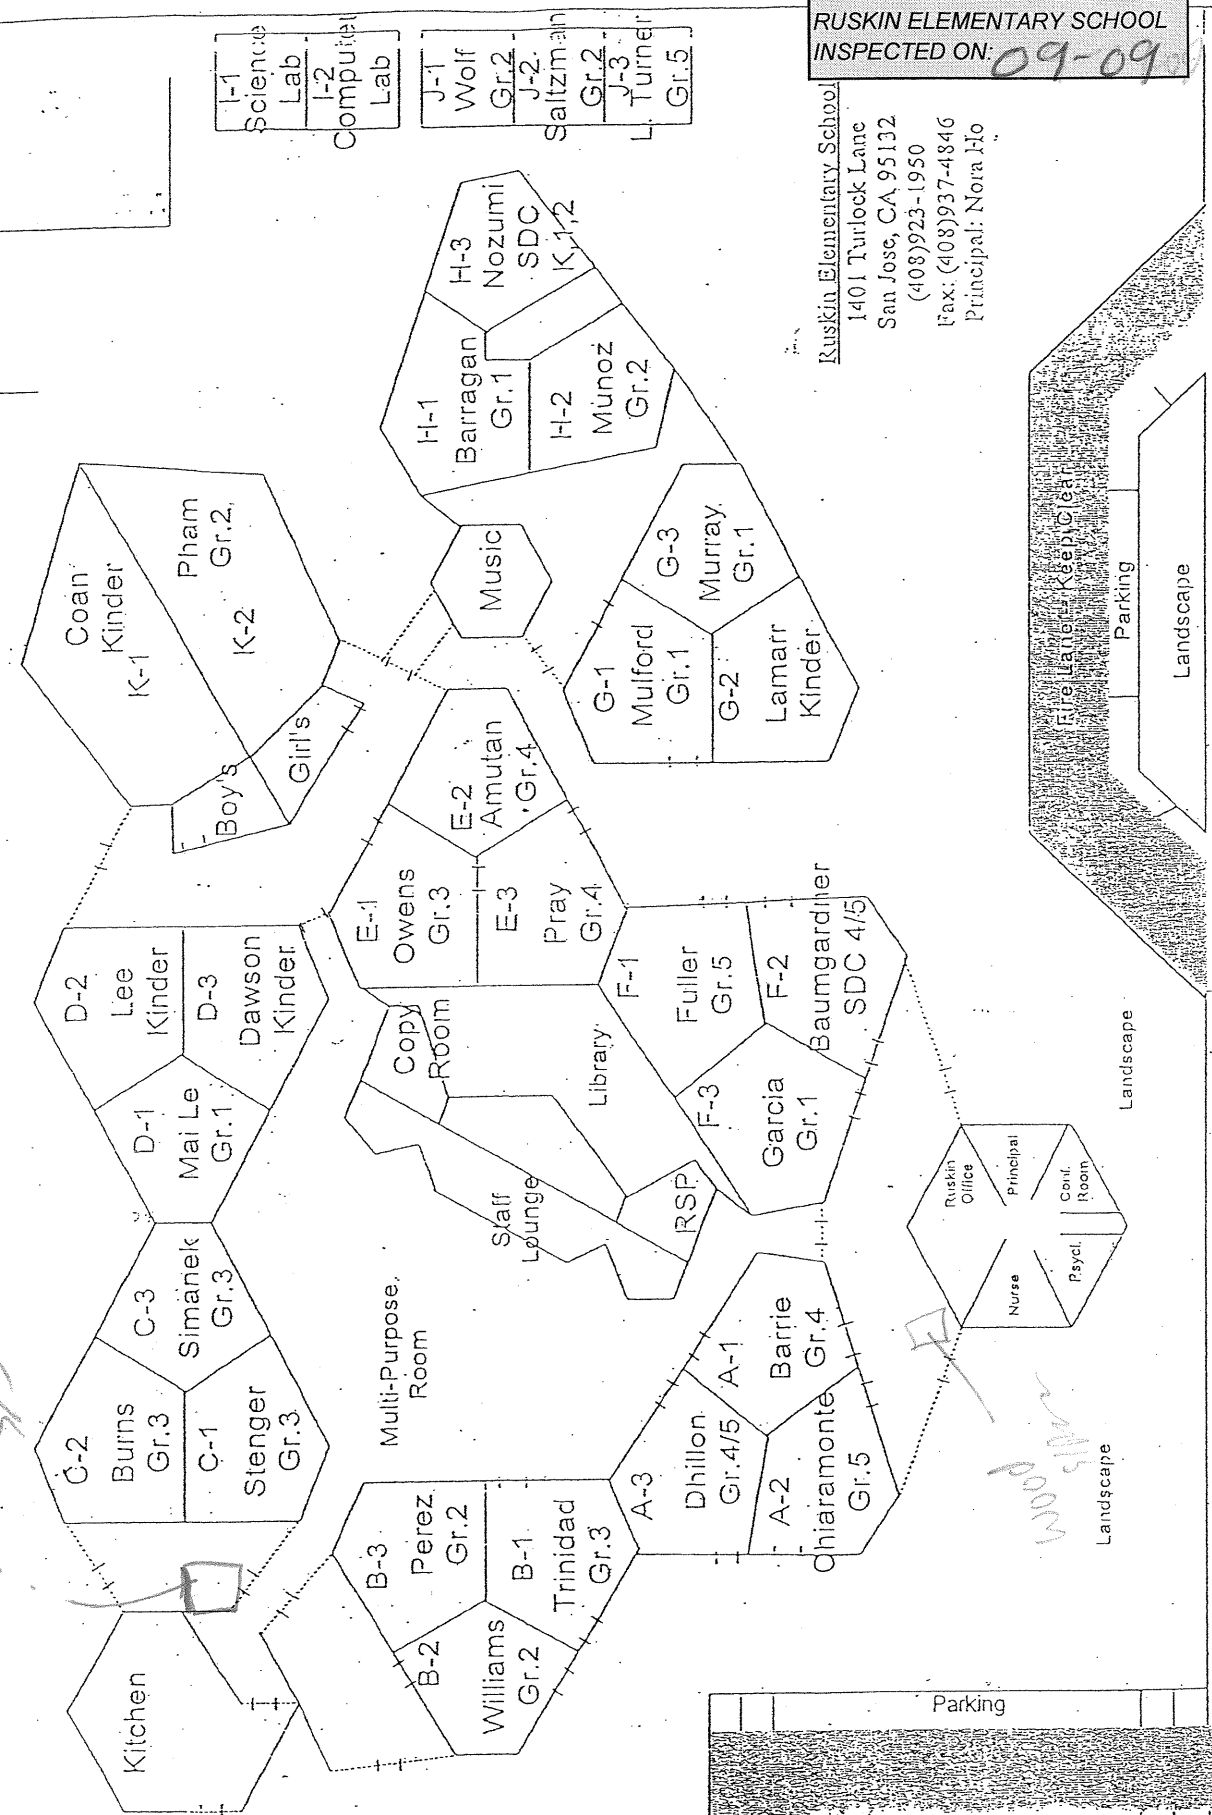

RUSKIN ELEMENTARY SCHOOL
INSPECTED ON: 09-09
 Ruskin Elementary School
 1401 Turlock Lane
 San Jose, CA 95132
 (408)923-1950
 Fax: (408)937-4846
 Principal: Nora Ho

Playground
and
Snack
Area

Garbage

Storage

Fire Lane - Keep Clear

Parking

Parking

Parking

Parking

Landscape

Landscape

Landscape

Turlock Lane

Rev. 8/10/2016

RUSKIN ELEMENTARY SCHOOL
INSPECTED ON: 5/14/09

Ruskin Elementary School

1401 Turlock Lane


San Jose, CA 95132

(408)923-1950

Fax: (408)937-4846



Principal: Nora Ho

Playground

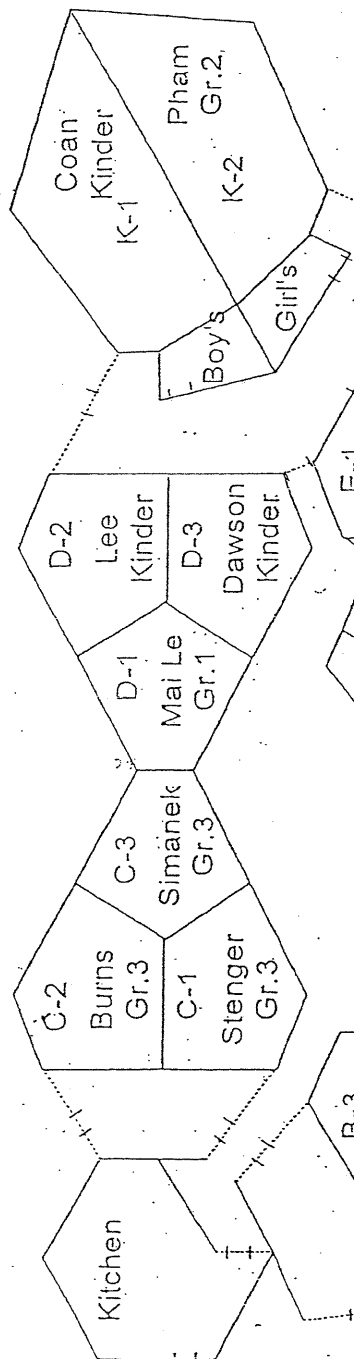

I-1
Science
Lab
I-2
Computer
Lab

J-1
Wolf
Gr.2
J-2
Saltzman
Gr.2
J-3
Turner
Gr.5

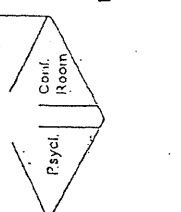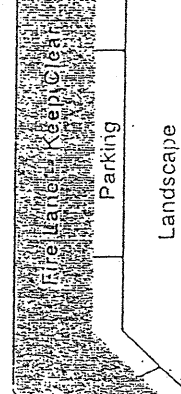

Playground
and
Snack
Area

Garbage

Storage

Fire Lane - Keep Clear

Parking

Parking

Parking

Parking

Landscape

Landscape


Turlock Lane

Rise Landscaping

Parking

Landscape

Playground

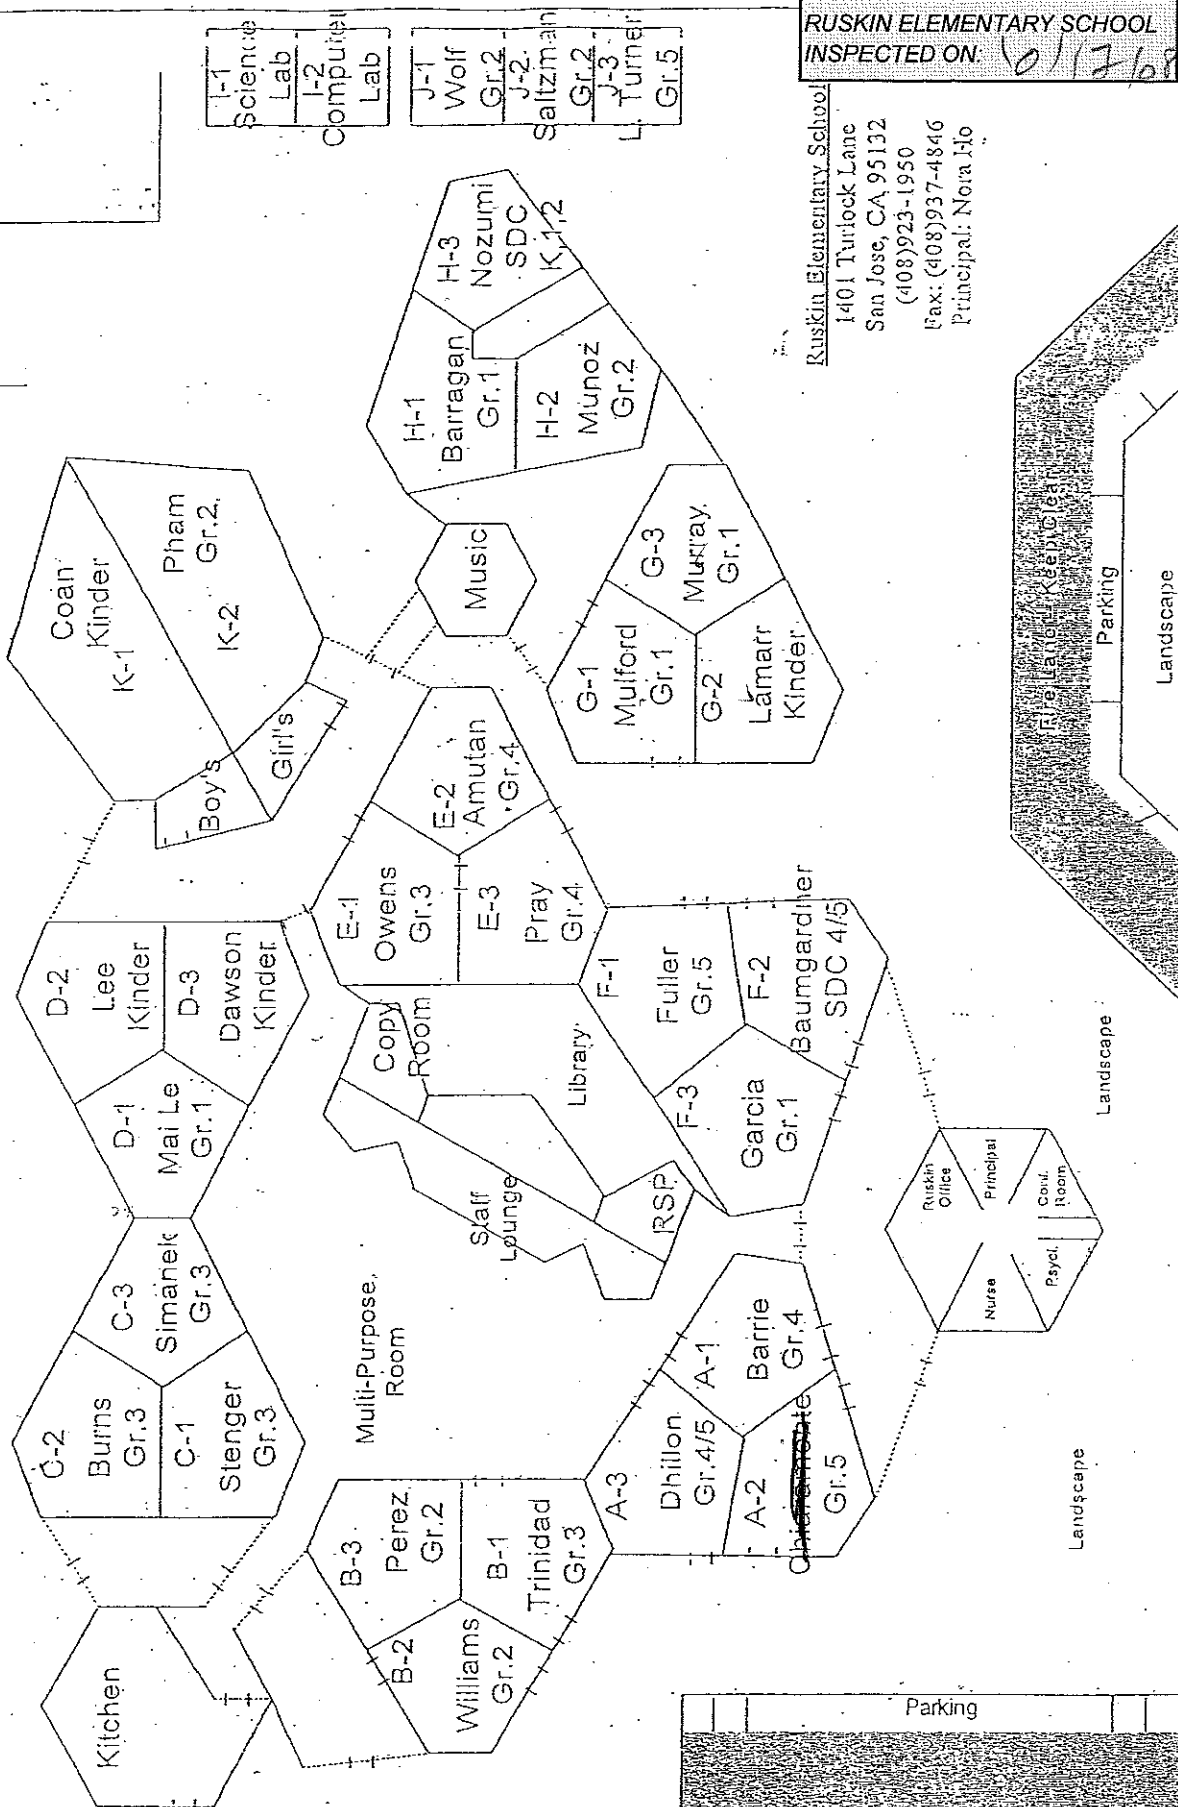

RUSKIN ELEMENTARY SCHOOL
INSPECTED ON: 6/17/08

Ruskin Elementary School
1401 Turlock Lane
San Jose, CA 95132
(408)923-1950
Fax: (408)937-4846
Principal: Nora Ho

Rev.8/10/2016

Playground
and
Snack
Area

Garbage

Storage

Fire Lane - Keep Clear

Parking

Parking

Parking

Landscape


Landscape

Turlock Lane

Rev. 8/10/2016

RUSKIN ELEMENTARY SCHOOL
INSPECTED ON: 4-17-08

Playground

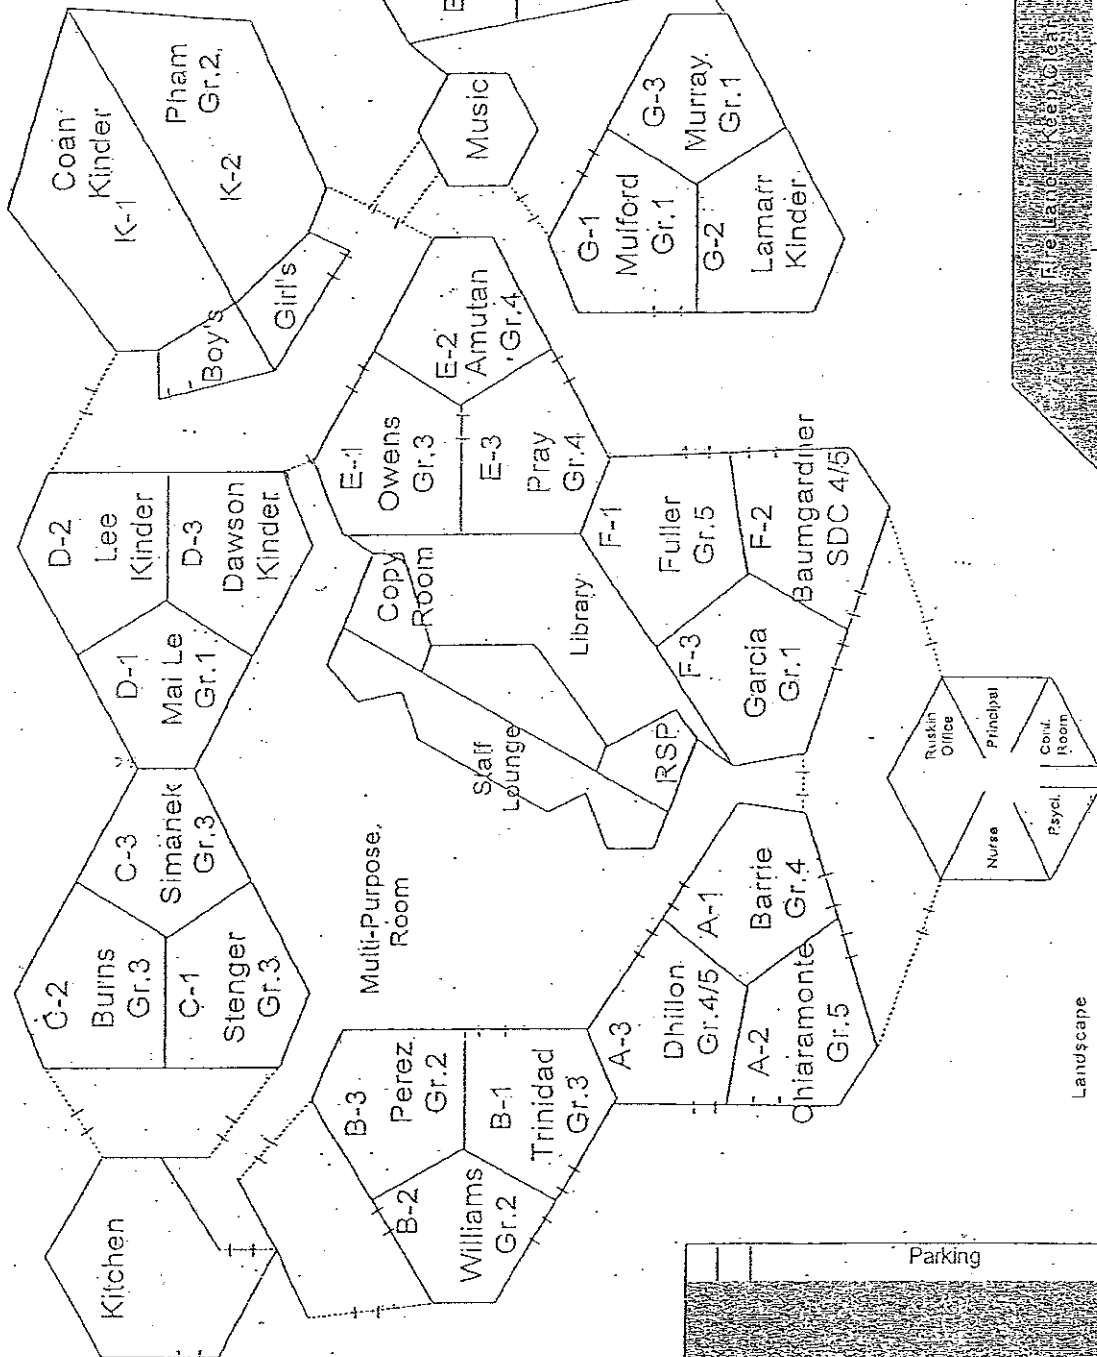

Ruskin Elementary School
1401 Turlock Lane
San Jose, CA 95132
(408)923-1950
Fax: (408)937-4846
Principal: Nora Ho

Tulare Drive

RUSKIN ELEMENTARY SCHOOL
INSPECTED ON 11-07-07

Playground

- I-1 Science Lab
- I-2 Computer Lab
- J-1 Wolf Gr.2
- J-2 Saltzman Gr.2
- J-3 Turner Gr.5

Ruskin Elementary School
1401 Turlock Lane
San Jose, CA 95132
(408)923-1950
Fax: (408)937-4846
Principal: Nora Ho

Rev. 8/10/2016

Playground and
Snack Area

Garbage

Storage

Fire Lane - Keep Clear

Parking

Parking

Parking

Parking


Landscape

Landscape

Parking

Landscape

Turlock Lane

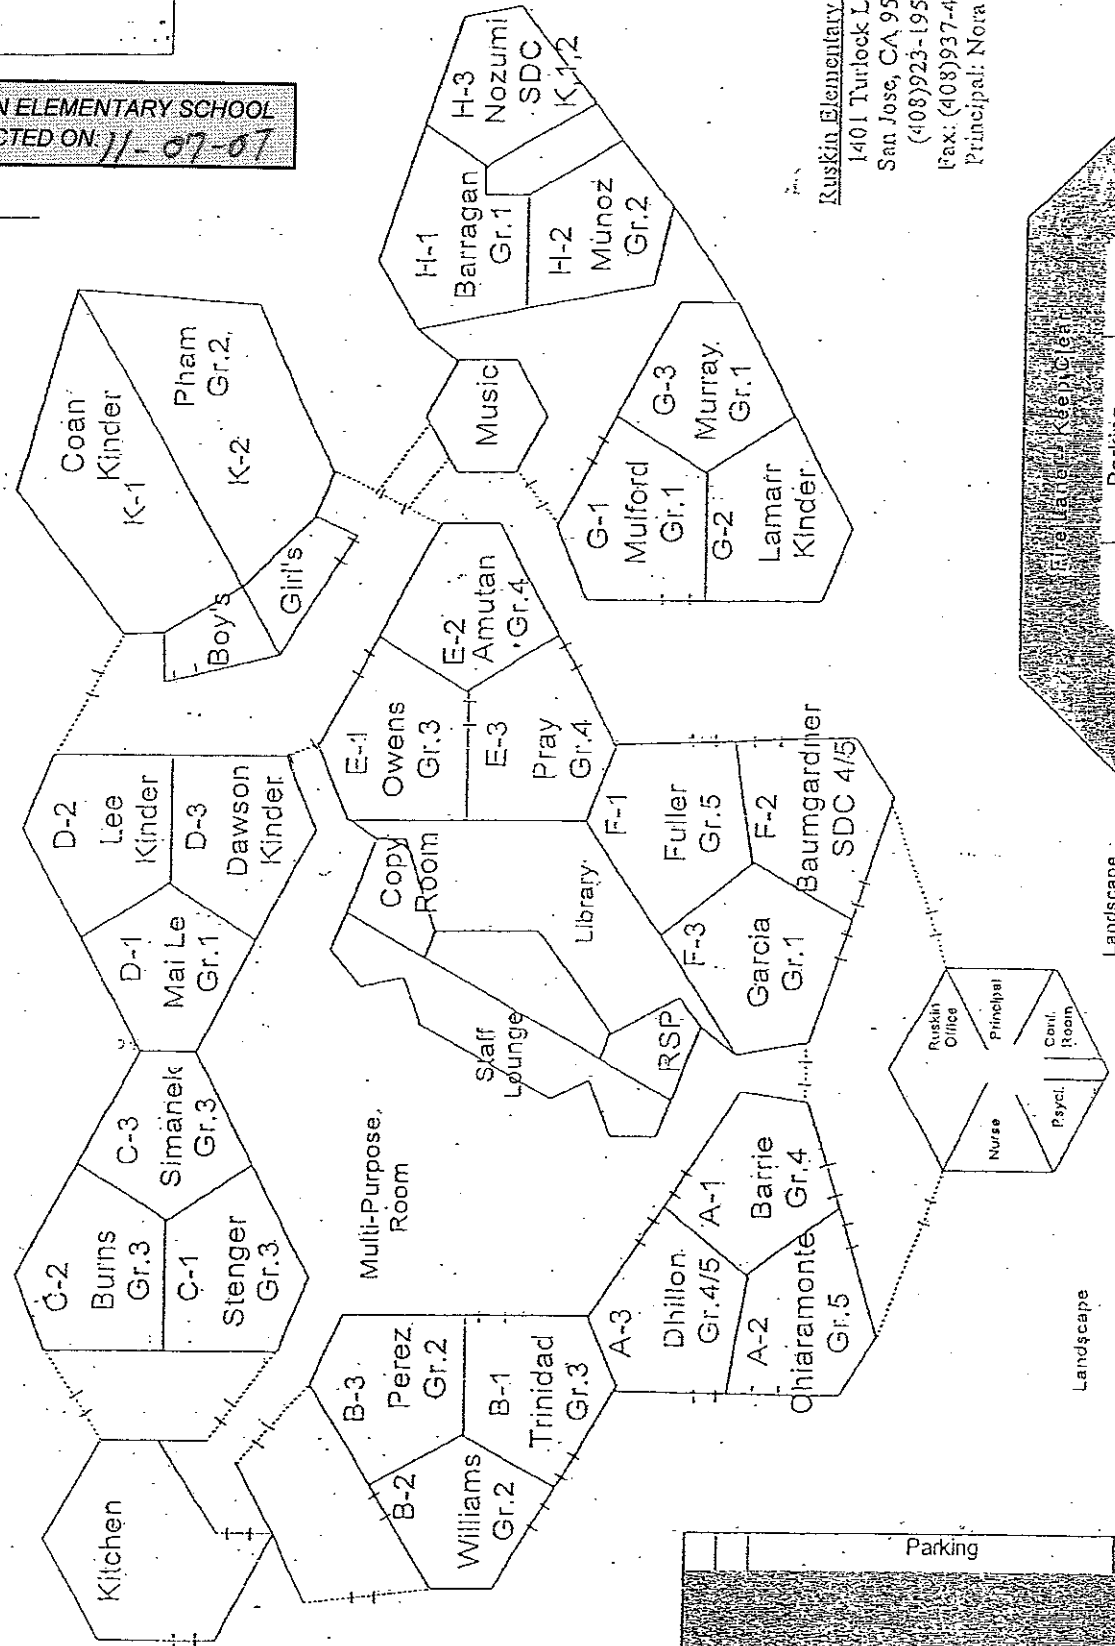

Playground
and
Snack
Area

Garbage

Storage

Fire Lane - Keep Clear

Parking

Parking
Parking

Parking

Landscape

0001

Landscape

Turlock Lane

Rev. 08/14/2004

Playground

0006


1-1 Science Lab
1-2 Computer Lab

J-1 Wolf 2nd
J-2 Paratore Kinder/1st
J-3 Gress 4th/5th

0008

RUSKIN ELEMENTARY SCHOOL
INSPECTED ON: 03-06-07

RUSKIN SCHOOL
1401 TURLOCK LANE
SAN JOSE, CA 95132
Phone: (408) 923-1950
Fax: (408) 937-4846
Principal: Nora Ho

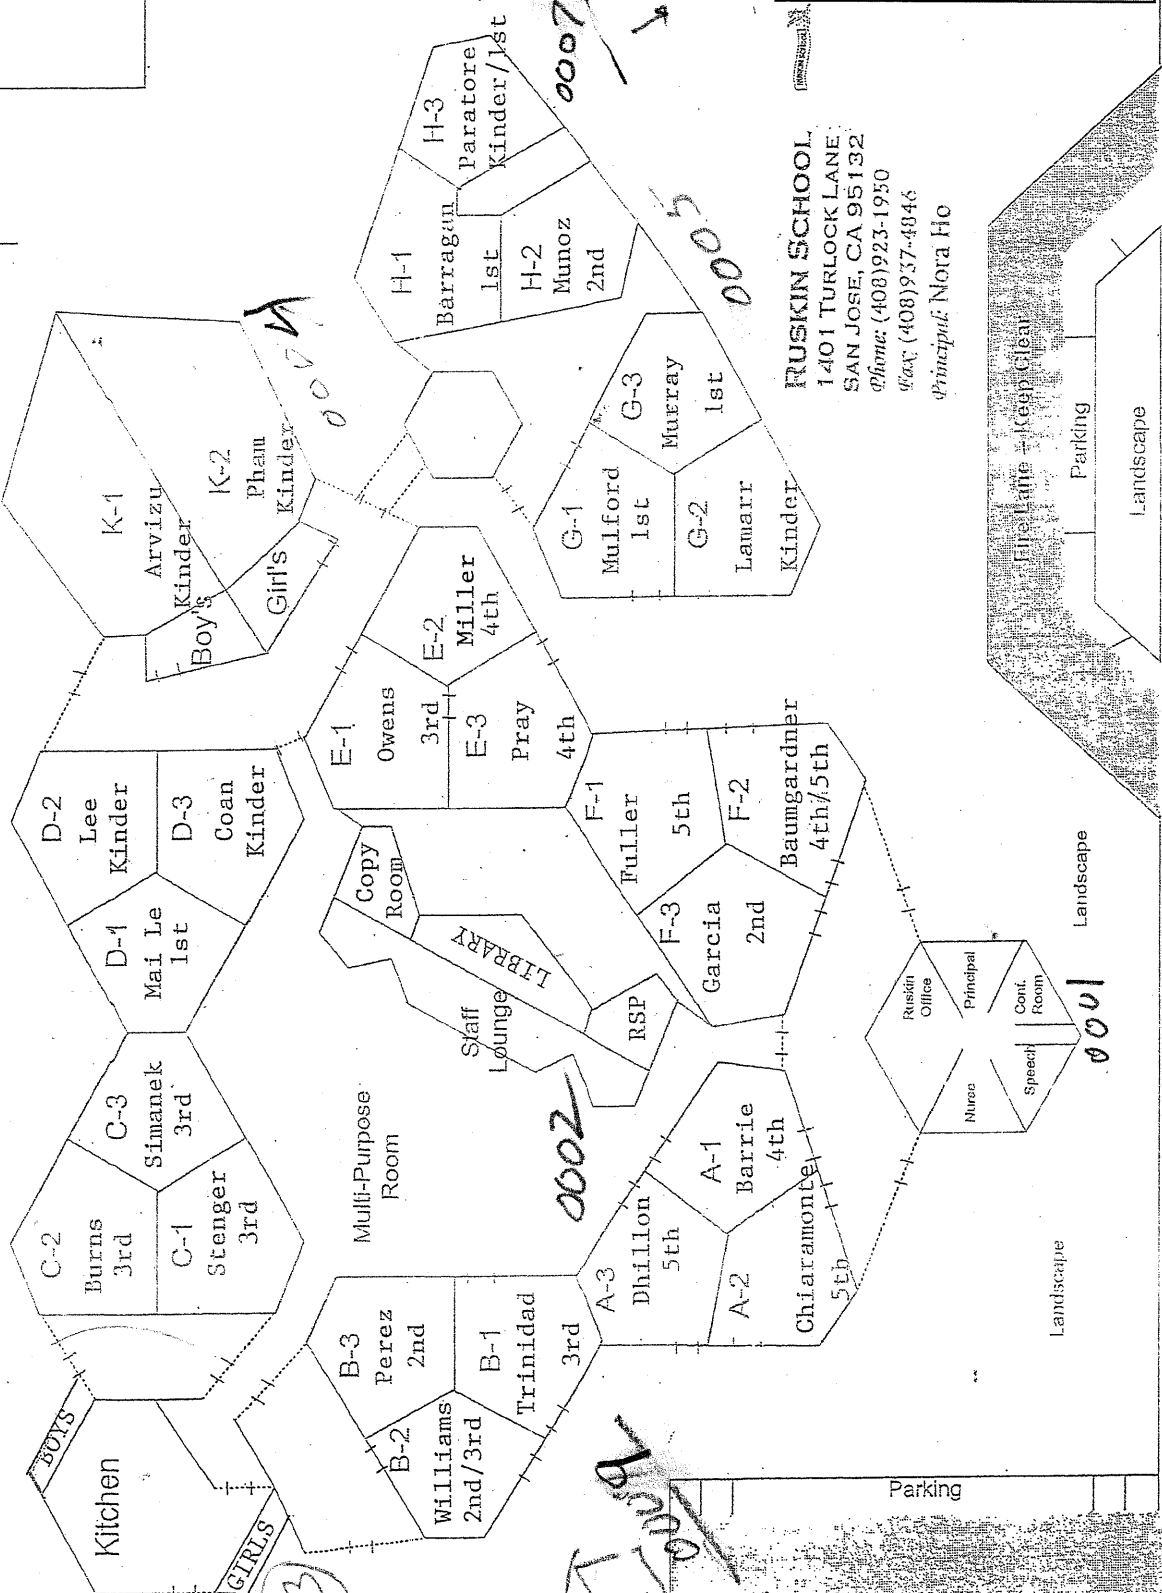

0003

0002

0004

0005

0007

11

Playground
and
Snack
Area

Garbage

Storage

Fire Lane - Keep Clear

Parking

Parking

Parking

Parking


Turlock Lane

Landscape

Landscape

Rev. 03/14/2004

Playground

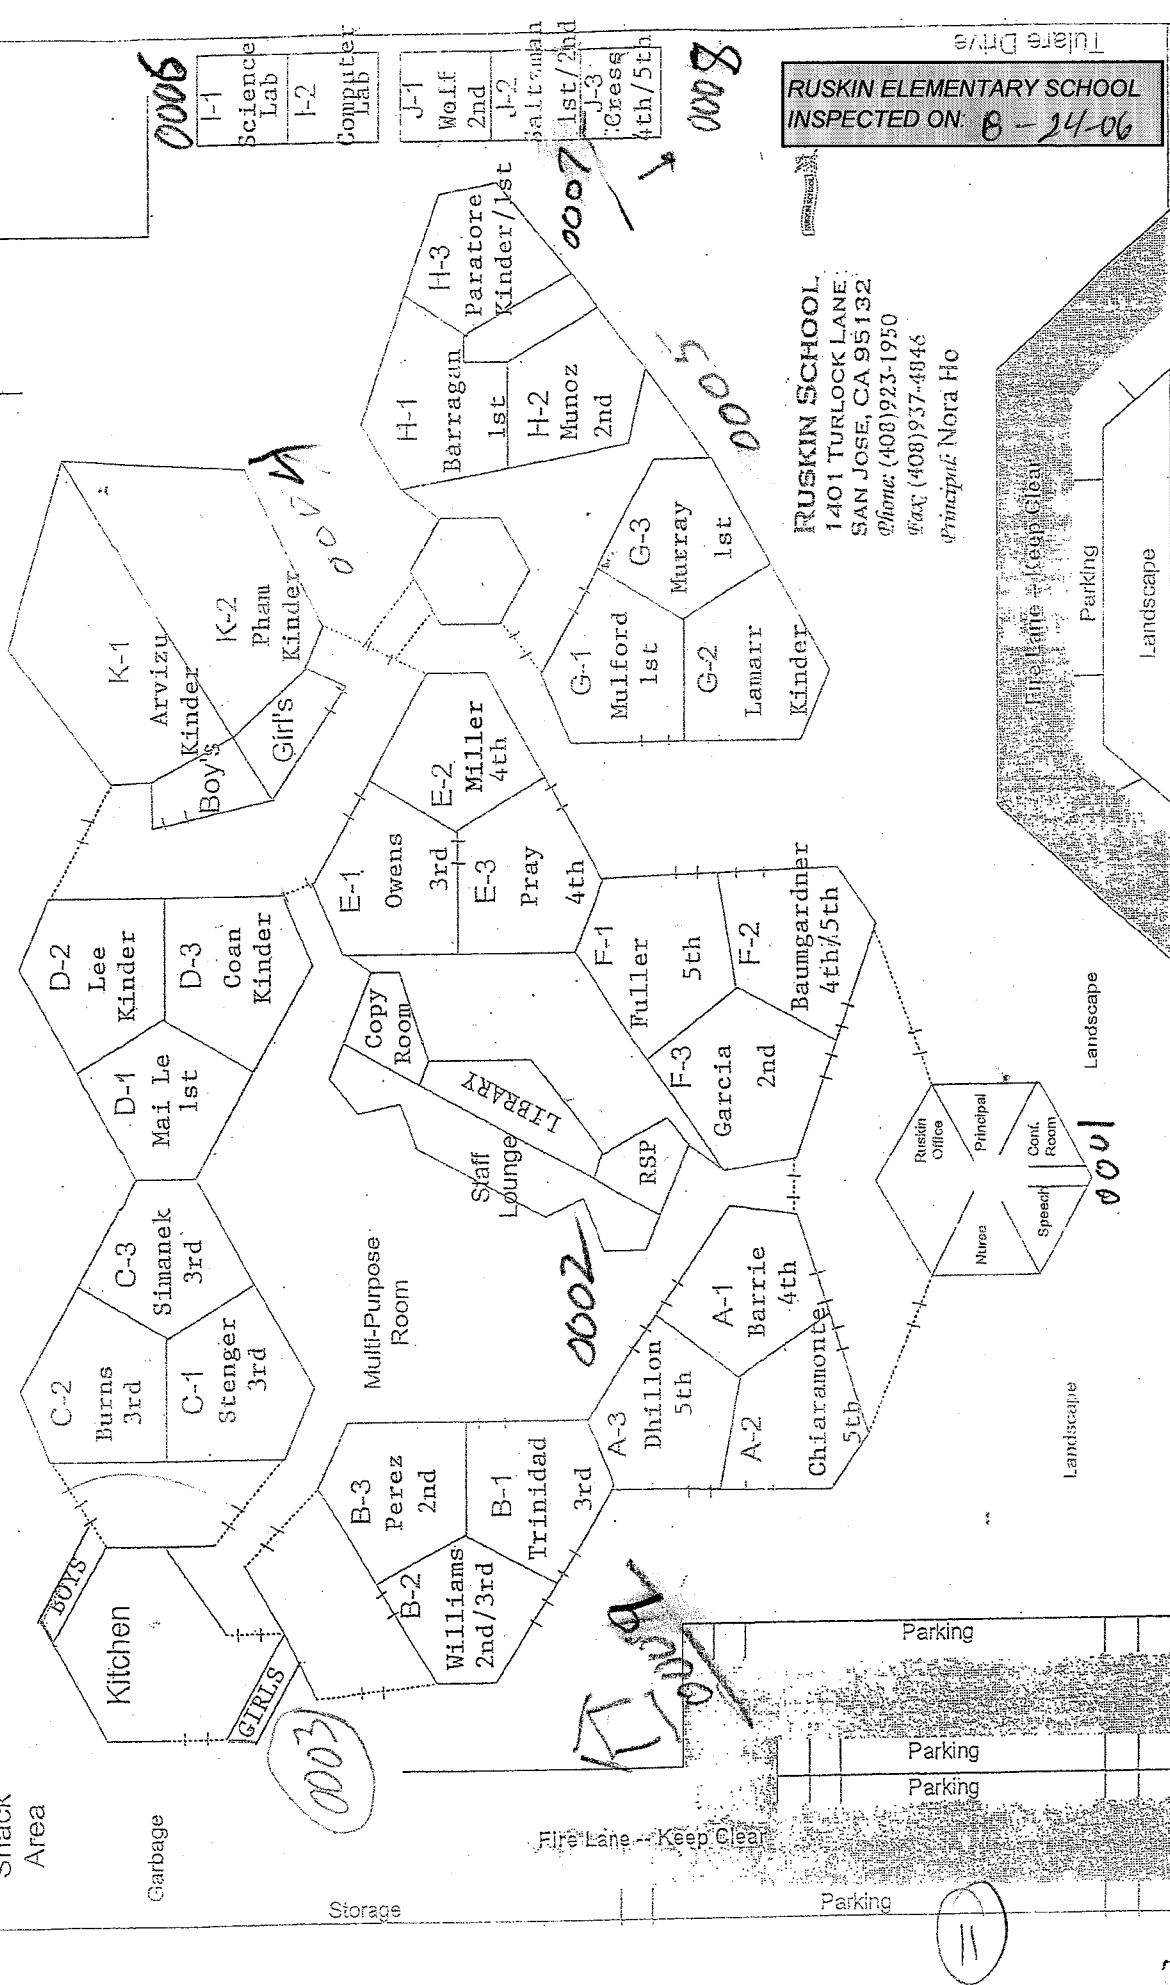

RUSKIN ELEMENTARY SCHOOL
INSPECTED ON: 8-14-06

RUSKIN SCHOOL
1401 TURLOCK LANE
SAN JOSE, CA 95132
Phone: (408) 923-1950
Fax: (408) 937-4846
Principal: Nora Ho

Tulane Drive

Playground
and
Snack
Area

Garbage

Storage

Fire Lane -- Keep Clear

Parking

Parking

Parking

Parking

Landscape

Landscape

Landscape

Parking


Fire Lane -- Keep Clear

Turlock Lane

Rev. 08/14/2004

RUSKIN ELEMENTARY SCHOOL
INSPECTED ON: 04/19/06

RUSKIN SCHOOL
1401 TURLOCK LANE
SAN JOSE, CA 95132
Phone: (408) 923-1950
Fax: (408) 937-4846
Principal: Nora Ho

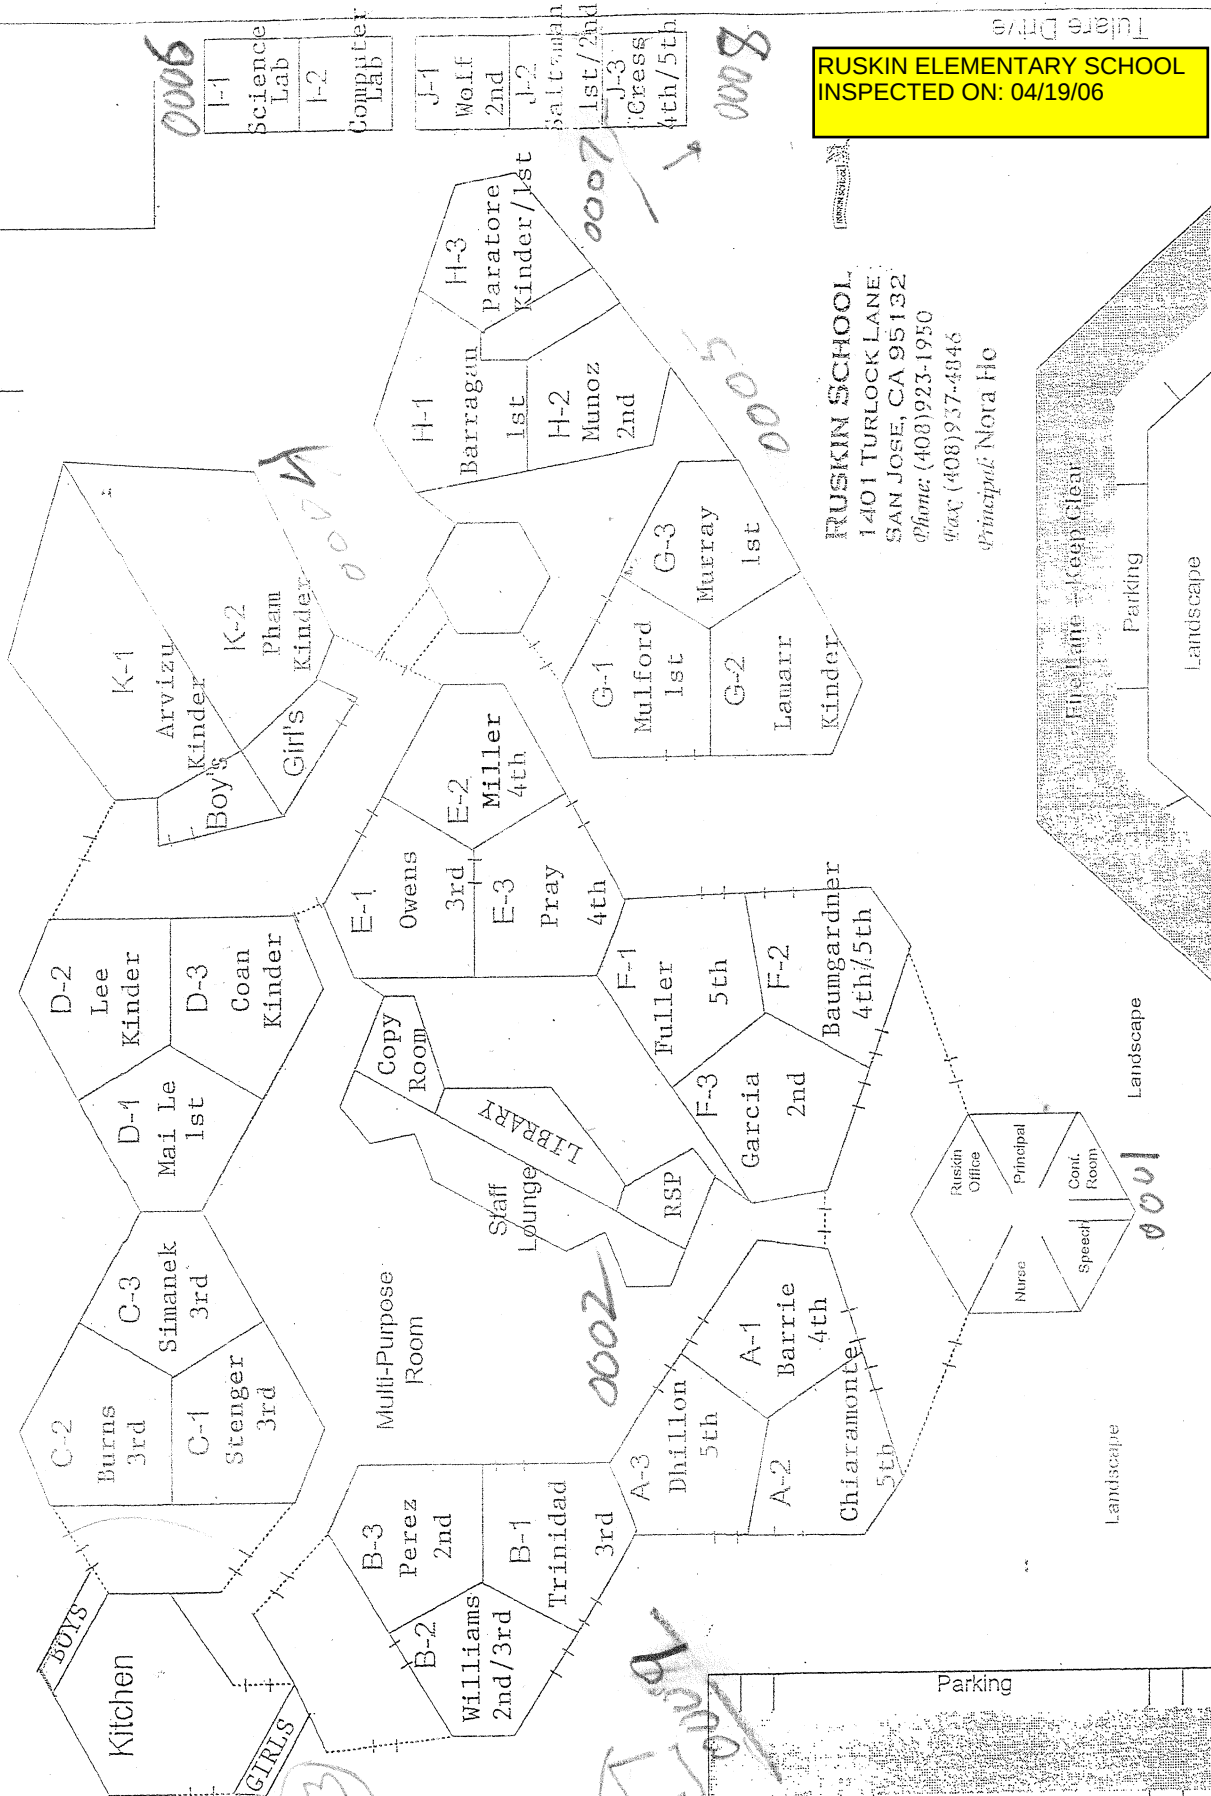

Playground
and
Snack
Area

Garbage

Storage

Fire Lane -- Keep Clear

Parking

Parking

Parking

Landscape

Landscape

Landscape

Parking

Fire Lane -- Keep Clear

Turlock Lane

Rev. 08/14/2004

RUSKIN ELEMENTARY SCHOOL
INSPECTED SEPTEMBER 2005

RUSKIN SCHOOL
1401 TURLOCK LANE
SAN JOSE, CA 95132
Phone: (408) 923-1950
Fax: (408) 937-4846
Principal: Nora Ho

