

SIX-MONTH SURVEILLANCE AHERA REPORT

**PIEDMONT MIDDLE SCHOOL
955 PIEDMONT ROAD
SAN JOSE, CA 95132**

**PREPARED FOR:
BERRYESSA UNION ELEMENTARY SCHOOL DISTRICT
981 RIDDER PARK DRIVE
SAN JOSE, CA 95131**

**INSPECTED ON:
SEPTEMBER 15, 2025**

HAZMAT DOC PROJECT #25-101

**PREPARED BY:
HAZMAT DOC
3080 OLCOTT STREET • SUITE D135
SANTA CLARA, CA 95054
Tel: 408.748.0055**

BERRYESSA UNION ELEMENTARY SCHOOL DISTRICT
PIEDMONT MIDDLE SCHOOL

INSPECTED ON:
SEPTEMBER 15, 2025

INSPECTED BY:



Leland Kafeyan
Cal/OSHA Certified Site Surveillance Technician
Certification Number 06-4110

REPORTED BY:

Maheen B. Doctor

Maheen B. Doctor
Cal/OSHA Certified Asbestos Consultant
Certification Number 95-1798

CONTENTS

PART - I

LEGEND AND GLOSSARY OF TERMS

PART – II

AHERA REPORT A – LIST OF BUILDINGS

PART – III

AHERA REPORT B – SURVEY REPORT

PART – IV

HOMOGENEOUS MATERIALS REPORT

PART – V

FRIABLE LOCATIONS REPORT

PART – VI

NON-FRIABLE LOCATIONS REPORT

PART – VII

RECOMMENDATIONS REPORT

PART – VIII

SAMPLES REPORT

PART – IX

DAMAGE REPORT

PART - X

SITE MAPS

LEGEND

THE FOLLOWING IS A LIST OF ABBREVIATIONS USED IN THIS REPORT:

Asbestos Sample Types

AC	=	ACTINOLITE
AM	=	AMOSITE
AN	=	ANTHOPHYLLITE
CH	=	CHRYBOTILE
CR	=	CROCIDOLITE
TR	=	TREMOLITE
ND	=	NONE DETECTED
NS	=	NO SAMPLE

Measurements

APPROX.	=	APPROXIMATELY
EA	=	EACH
I	=	INCHES
LF	=	LINEAR FEET
N	=	NUMBER
O.D.	=	OUTSIDE DIAMETER
SF	=	SQUARE FEET
TBD	=	TO BE DETERMINED

LIST OF BUILDINGS AT

PIEDMONT MIDDLE SCHOOL

BUILDING NAME BUILDING USED AS (#FLOORS) CONSTRUCTION	BUILDING AREA (APPROXIMATE)
ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDINGS J&K)	
Offices, Cafeteria, Band Room, Utility Rooms, Storage Rooms, Restrooms (1) Wood, Metal, Plaster, Gypsum Wallboard System, Concrete	15,000 SF
CLASSROOMS 01-03 AND RESTROOMS BUILDING (BUILDING A)	
Classrooms, Restrooms (1) Wood, Metal, Plaster, Gypsum Wallboard System, Concrete	4,000 SF
CLASSROOMS 04-09 BUILDING (BUILDING B)	
Classrooms (1) Wood, Metal, Plaster, Gypsum Wallboard System, Concrete	5,760 SF
CLASSROOMS 10-12 BUILDING (BUILDING C)	
Classrooms (1) Wood, Metal, Plaster, Gypsum Wallboard System, Concrete	3,120 SF
CLASSROOMS 13-15 AND RESTROOMS BUILDING (BUILDING D)	
Classrooms, Restrooms (1) Wood, Metal, Plaster, Gypsum Wallboard System, Concrete	4,000 SF
CLASSROOMS 16-18 BUILDING (BUILDING F)	
Classrooms (1) Wood, Metal, Plaster, Gypsum Wallboard System, Concrete	3,180 SF
CLASSROOMS 19-23 BUILDING (BUILDING G)	
Classrooms (1) Wood, Metal, Plaster, Gypsum Wallboard System, Concrete	5,640 SF
CLASSROOMS 24-37 - FLEXIBLE INSTRUCTIONAL SPACE (BUILDING I)	
Shops, Library, Classrooms, Offices (1) Wood, Metal, Plaster, Gypsum Wallboard System, Concrete	14,200 SF
CLASSROOMS P1, P4-P5 PORTABLES BUILDINGS	
Classrooms (1) Wood and Metal Portables	2,880 SF
CLASSROOMS P2 (BUILDING M)-P3 (BUILDING N) PORTABLE BUILDINGS	
Classrooms (1) Wood and Metal Portables	1,920 SF
GREEN HOUSE	
Agriculture Lab (1) Metal and Glass	270 SF
GYM BUILDING (BUILDING E)	
Gym, PE Classrooms, Offices, Locker Rooms, Showers, Storage Rooms, Boiler Room (1) Wood, Metal, Plaster, Gypsum Wallboard System, Concrete	15,200 SF
LANCER GYM (BUILDING L)	
Gymnasium and Classroom (1) Wood, Concrete, Metal	8,775 SF

LIST OF BUILDINGS AT

PIEDMONT MIDDLE SCHOOL

BUILDING NAME	BUILDING AREA (APPROXIMATE)
BUILDING USED AS (#FLOORS) CONSTRUCTION	

STORAGE CONTAINERS

Storage	504 SF
(1) Metal	

WOOD SHED

Storage	60 SF
(1) Wood	

Total Number Of Buildings : <u>15</u>	(Approximate) Total Sq Ft. : <u>84,509</u>
---------------------------------------	--

End Of Report, Total Of 2 Pages

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDINGS J&K)

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDINGS J&K)

09/06/2005	BUILDING NOTES:
09/06/2005	New Flooring installed Summer 2005 per info received from BUESD.
03/05/2007	New Suspended Ceiling Tiles installed in Entire Building per info received from BUESD.
05/13/2009	New Ceramic Wall and Floor Tiles installed in Staff and Kitchen Restrooms. New Carpet installed in Choir Room and 6 Offices, and Hallway to Stage per information received from BUESD.
10/10/2012	New Drywall Board System installed in 3 Mechanical Rooms and Storage per information received from BUESD. New Ducts installed with Duct Wrap Tape. Existing Gypsum Wallboard Systems Removed and Replaced with new in-kind in Path-of-Construction.
02/12/2018	All Flooring Removed Except Restrooms, Closets and Kitchens in 2017 Modernization Project per information received from BUESD.

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDINGS J&K)

ATTIC / PLENUM

PIPE FITTING INSULATION

10 LF

09/06/2005	Pipe Fitting Insulation, 10 Fittings. This Material is in good condition as of this date.
02/04/2020	This Material is unchanged as of this date.
08/26/2020	This Material is unchanged as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.
08/17/2022	Material Re-Assessed. Damages are still present in Kitchen Furnace/Storage Rooms. Material remains in FAIR condition overall. No other changes as of this date.
02/13/2023	This Material is unchanged as of this date.
08/14/2023	This Material is unchanged as of this date.
02/12/2024	This Material is unchanged as of this date.
08/12/2024	This Material is unchanged as of this date.

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/25/2025 This Material is unchanged as of this date.

09/15/2025 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDINGS J&K)

CHOIR ROOM

CEILING TILE

1,000 SF

09/06/2005 1'x1' Glued-On Ceiling Tile. This Material is in good condition as of this date.

02/04/2020 This Material is unchanged as of this date.

08/26/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/16/2022 This Material is unchanged as of this date.

08/17/2022 This Material is unchanged as of this date.

02/13/2023 This Material is unchanged as of this date.

08/14/2023 This Material is unchanged as of this date.

02/12/2024 This Material is unchanged as of this date.

08/12/2024 This Material is unchanged as of this date.

02/25/2025 This Material is unchanged as of this date.

09/15/2025 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDINGS J&K)

CHOIR ROOM

CEILING TILE MASTIC

1,000 SF

09/06/2005 Mastic/Adhesive for 1'x1' Glued-On Ceiling Tile. This Material is in good condition as of this date.

02/04/2020 This Material is unchanged as of this date.

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
08/26/2020	This Material is unchanged as of this date.		
02/08/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/16/2022	This Material is unchanged as of this date.		
08/17/2022	This Material is unchanged as of this date.		
02/13/2023	This Material is unchanged as of this date.		
08/14/2023	This Material is unchanged as of this date.		
02/12/2024	This Material is unchanged as of this date.		
08/12/2024	This Material is unchanged as of this date.		
02/25/2025	This Material is unchanged as of this date.		
09/15/2025	This Material is unchanged as of this date.		
05-212AAA	ASSUMED	NO SAMPLE	(NS)

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDINGS J&K)

COUNSELOR'S ROOM

VINYL WALL COVER

100 SF

11/30/2011	Vinyl Wall Cover on Accordion Wall. This Material is in GOOD condition as of this date.		
02/04/2020	This Material is unchanged as of this date.		
08/26/2020	This Material is unchanged as of this date.		
02/08/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/16/2022	This Material is unchanged as of this date.		
08/17/2022	This Material is unchanged as of this date.		
02/13/2023	This Material is unchanged as of this date.		
08/14/2023	This Material is unchanged as of this date.		
02/12/2024	This Material is unchanged as of this date.		

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

08/12/2024 This Material is unchanged as of this date.

02/25/2025 This Material is unchanged as of this date.

09/15/2025 This Material is unchanged as of this date.

11-202AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDINGS J&K)

COUNSELOR'S ROOM

VINYL WALL COVER MASTIC

100 SF

11/30/2011 Mastic/Adhesive for Vinyl Wall Cover on Accordion Wall. This Material is in GOOD condition as of this date.

02/04/2020 This Material is unchanged as of this date.

08/26/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/16/2022 This Material is unchanged as of this date.

08/17/2022 This Material is unchanged as of this date.

02/13/2023 This Material is unchanged as of this date.

08/14/2023 This Material is unchanged as of this date.

02/12/2024 This Material is unchanged as of this date.

08/12/2024 This Material is unchanged as of this date.

02/25/2025 This Material is unchanged as of this date.

09/15/2025 This Material is unchanged as of this date.

11-202AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDINGS J&K)

EXTERIOR

WINDOW CAULKING

78 LF

10/14/2008 Window Caulking. Some of this Material is damaged. This Material is in FAIR condition as of this date.

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

COMMENTS

QTY (APPROXIMATE)

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
05/13/2009	Damage: <5% Physical Damage due to cracked condition on South Side Windows. Material is in FAIR condition overall as of this date.		
09/03/2009	Entry passed in error. Damage incorrectly identified. Damage should be <10% water damage due to water, moisture, and heat damages. No other changes as of this date.		
02/04/2020	This Material is unchanged as of this date.		
08/26/2020	This Material is unchanged as of this date.		
02/08/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/16/2022	This Material is unchanged as of this date.		
08/17/2022	This Material is unchanged as of this date.		
02/13/2023	This Material is unchanged as of this date.		
08/14/2023	This Material is unchanged as of this date.		
02/12/2024	This Material is unchanged as of this date.		
08/12/2024	This Material is unchanged as of this date.		
02/25/2025	This Material is unchanged as of this date.		
09/15/2025	This Material is unchanged as of this date.		
08-241AAA	ASSUMED	NO SAMPLE	(NS)

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDINGS J&K)

EXTERIOR OVERHANG (SOUTH SIDE)

PIPE FITTING INSULATION

8 SF

08/23/2006	Pipe Fitting Insulation (4" Outside Diameter) on Overhead TSI, 8 Fittings total. This Material is in GOOD condition as of this date.		
02/04/2020	This Material is unchanged as of this date.		
08/26/2020	This Material is unchanged as of this date.		
02/08/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/16/2022	This Material is unchanged as of this date.		

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

08/17/2022 This Material is unchanged as of this date.

02/13/2023 This Material is unchanged as of this date.

08/14/2023 This Material is unchanged as of this date.

02/12/2024 This Material is unchanged as of this date.

08/12/2024 This Material is unchanged as of this date.

02/25/2025 This Material is unchanged as of this date.

09/15/2025 This Material is unchanged as of this date.

06-223AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDINGS J&K)

KITCHEN, RESTROOM, AND SNACK BAR

VINYL SHEETING

1,030 SF

09/06/2005 Vinyl Sheeting. This Material is in good condition as of this date.

04/17/2008 <5% Physical Damage. 2 SF is damaged by the Sink and Refrigerator, and this Material is in FAIR condition as of this date.

05/13/2009 Damages Re-Assessed. Additional Damages in the form of Vinyl Sheeting has been Damaged in several seam locations with separation. No other changes as of this date.

02/04/2020 This Material is unchanged as of this date.

08/26/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/16/2022 This Material is unchanged as of this date.

08/17/2022 This Material is unchanged as of this date.

02/13/2023 This Material is unchanged as of this date.

08/14/2023 This Material is unchanged as of this date.

02/12/2024 This Material is unchanged as of this date.

08/12/2024 This Material is unchanged as of this date.

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/25/2025 This Material is unchanged as of this date.

09/15/2025 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDINGS J&K)

KITCHEN, RESTROOM, AND SNACK BAR

VINYL SHEETING BACKING PAPER/MASTIC

1,030 SF

09/06/2005 Backing Paper/Adhesive for Vinyl Floor Sheeting. This Material is in good condition as of this date.

04/17/2008 <5% Physical Damage. 2 SF is damaged by the Sink and Refrigerator and this Material is in FAIR condition as of this date.

05/13/2009 Damages Re-Assessed. Additional Damages in the form of Vinyl Sheeting has been Damaged in several seam locations with separation. No other changes as of this date.

02/04/2020 This Material is unchanged as of this date.

08/26/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/16/2022 This Material is unchanged as of this date.

08/17/2022 This Material is unchanged as of this date.

02/13/2023 This Material is unchanged as of this date.

08/14/2023 This Material is unchanged as of this date.

02/12/2024 This Material is unchanged as of this date.

08/12/2024 This Material is unchanged as of this date.

02/25/2025 This Material is unchanged as of this date.

09/15/2025 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDINGS J&K)

MAIN MECHANICAL ROOM (BOILER ROOM), ELECTRICAL PANEL ROOM, AND FURNACE ROOMS

SMOOTH WALL MISCELLANEOUS

3,000 SF

05/13/2009	Gypsum Wallboard System Walls and Ceilings. Texture and Skim Coat is Yellow and Cream in Mechanical Room (Boiler Room), and Furnace Closets. Existing Gypsum Wallboard Systems Removed and Replaced with new in-kind in Path-of-Construction. This Material is in GOOD condition as of this date.
10/10/2012	Material condition reassessed. Ceiling has been removed and repaired in Mechanical Room (during construction of Summer 2012). Quantity changed from 3,300 SF to 3,000 SF. (A portion of Wall has been removed, and new Drywall with no Skim Coat has been installed). Several holes observed on Walls in Mechanical Room. Material is in FAIR condition overall as of this date.
08/26/2020	This Material is unchanged as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.
08/17/2022	Additional Damage Observed. <5% Physical Damage in the form of Cuts on Edges of Walls by Doors of Chair Storage under Stage. Mechanical Room, Electrical Room and Furnace Room still have Cuts, Hole and Crack Damage. Material remains in FAIR condition overall. No other changes as of this date.
02/13/2023	This Material is unchanged as of this date.
08/14/2023	This Material is unchanged as of this date.
02/12/2024	This Material is unchanged as of this date.
08/12/2024	This Material is unchanged as of this date.
02/25/2025	This Material is unchanged as of this date.
09/15/2025	This Material is unchanged as of this date.

09-098AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDINGS J&K)

MAIN MECHANICAL ROOM (BOILER ROOM), ELECTRICAL PANEL ROOM, AND FURNACE ROOMS

SMOOTH WALL SURFACING

3,000 SF

05/13/2009	Skim Coat for Gypsum Wallboard System Walls and Ceilings. Texture and Skim Coat is Yellow and Cream in Mechanical Room (Boiler Room), and Furnace Closets. Existing Gypsum Wallboard Systems Removed and Replaced with new in-kind in Path-of-Construction. This Material is in GOOD condition as of this date.
------------	---

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
10/10/2012	Material condition reassessed. Ceiling has been removed and repaired in Mechanical Room (during construction of Summer 2012). Quantity changed from 3,300 SF to 3,000 SF. (A portion of Wall has been removed, and new Drywall with no Skim Coat has been installed). Material is in GOOD condition overall as of this date.		
08/26/2020	This Material is unchanged as of this date.		
02/08/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/16/2022	This Material is unchanged as of this date.		
08/17/2022	This Material is unchanged as of this date.		
02/13/2023	This Material is unchanged as of this date.		
08/14/2023	This Material is unchanged as of this date.		
02/12/2024	This Material is unchanged as of this date.		
08/12/2024	This Material is unchanged as of this date.		
02/25/2025	This Material is unchanged as of this date.		
09/15/2025	This Material is unchanged as of this date.		

09-098AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDINGS J&K)

MAIN MECHANICAL ROOM, STAGE, FOOD STORAGE ROOM, BAND ROOM MECHANICAL ROOM, AND ALL ADMIN OFFICES

FIRE DOOR CORE INSULATION

1,008 SF

09/06/2005	Fire Door Core Insulation (48 EA Fire Doors). This Material is in good condition as of this date.		
02/04/2020	This Material is unchanged as of this date.		
08/26/2020	This Material is unchanged as of this date.		
02/08/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/16/2022	Material Re-assessed. Quantity changed from 630 SF to 1,008 SF. Number of doors changed from 30 EA to 48 EA. No other changes as of this date.		
08/17/2022	This Material is unchanged as of this date.		

SF= Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
02/13/2023	This Material is unchanged as of this date.		
08/14/2023	This Material is unchanged as of this date.		
02/12/2024	This Material is unchanged as of this date.		
08/12/2024	This Material is unchanged as of this date.		
02/25/2025	This Material is unchanged as of this date.		
09/15/2025	This Material is unchanged as of this date.		
05-212AAA	ASSUMED	NO SAMPLE	(NS)

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDINGS J&K)

ONE RESTROOM, FOOD STORAGE ROOM, AND KITCHEN

VINYL FLOOR TILE

200 SF

09/06/2005	9"x9" Beige Vinyl Floor Tile. This Material is in good condition as of this date.		
05/13/2009	Location Description changed from ONE RESTROOM AND FOOD STORAGE CLOSET to ONE RESTROOM AND FOOD STORAGE CLOSET IN FOOD STORAGE ROOM. Material has been Removed in Staff Restroom and Replaced with new 2"x2" Ceramic Floor Tile. Material is also present behind Stove and maybe under Red Vinyl Flooring. No other changes as of this date.		
09/03/2009	Damage: <5% Physical Damage due to 4 broken and chipped Tiles at Entrance Doorway. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.		
03/03/2014	Location changed from ONE RESTROOM AND FOOD STORAGE CLOSET IN FOOD STORAGE ROOM to ONE RESTROOM, FOOD STORAGE ROOM, AND KITCHEN. No other changes as of this date.		
03/16/2016	Additional Damage observed. 2 Tiles are broken in the Kitchen Storage Room exposing Mastic/Adhesive. No other changes as of this date.		
02/04/2020	This Material is unchanged as of this date.		
08/26/2020	This Material is unchanged as of this date.		
02/08/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/16/2022	This Material is unchanged as of this date.		
08/17/2022	Material not Observed in Multi-Purpose Room. Material may still exist under Tan Wood Design Vinyl Floor Sheeting. No other changes as of this date.		

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
02/13/2023	This Material is unchanged as of this date.		
08/14/2023	This Material is unchanged as of this date.		
02/12/2024	This Material is unchanged as of this date.		
08/12/2024	This Material is unchanged as of this date.		
02/25/2025	This Material is unchanged as of this date.		
09/15/2025	This Material is unchanged as of this date.		
05-212AAA	ASSUMED	NO SAMPLE	(NS)

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDINGS J&K)

ONE RESTROOM, FOOD STORAGE ROOM, AND KITCHEN

VINYL FLOOR TILE MASTIC

200 SF

09/06/2005	Mastic/Adhesive for 9"x9" Vinyl Floor Tile. This Material is in good condition as of this date.		
05/13/2009	Location Description changed from ONE RESTROOM AND FOOD STORAGE CLOSET to ONE RESTROOM AND FOOD STORAGE CLOSET IN FOOD STORAGE ROOM. Material has been Removed in Staff Restroom and Replaced with new 2"x2" Ceramic Floor Tile. Material is also present behind Stove and maybe under Red Vinyl Flooring. No other changes as of this date.		
09/03/2009	Damage: <5% Physical Damage due to 4 broken and chipped Tiles at Entrance Doorway. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.		
03/03/2014	Location changed from ONE RESTROOM AND FOOD STORAGE CLOSET IN FOOD STORAGE ROOM to ONE RESTROOM, FOOD STORAGE ROOM, AND KITCHEN. Quantity changed from 150 SF to 200 SF. No other changes as of this date.		
03/16/2016	Additional Damage observed. 2 Tiles are broken in the Kitchen Storage Room exposing Mastic/Adhesive. No other changes as of this date.		
02/04/2020	This Material is unchanged as of this date.		
08/26/2020	This Material is unchanged as of this date.		
02/08/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/16/2022	This Material is unchanged as of this date.		
08/17/2022	This Material is unchanged as of this date.		

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/13/2023 This Material is unchanged as of this date.

08/14/2023 This Material is unchanged as of this date.

02/12/2024 This Material is unchanged as of this date.

08/12/2024 This Material is unchanged as of this date.

02/25/2025 This Material is unchanged as of this date.

09/15/2025 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDINGS J&K)

SNACK BAR, AND ATTIC AREA

SPRAY ON CEILING

220 SF

09/06/2005 Spray-On Ceiling. This Material is in good condition as of this date.

03/05/2007 Damage: <5% Physical Damage - degradation in the form of a Wall-to-Wall crack and two areas with holes. Additional damage in the form of water stains. Material condition changed from GOOD to FAIR. No other changes as of this date.

02/04/2020 This Material is unchanged as of this date.

08/26/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/16/2022 This Material is unchanged as of this date.

08/17/2022 This Material is unchanged as of this date.

02/13/2023 This Material is unchanged as of this date.

08/14/2023 This Material is unchanged as of this date.

02/12/2024 This Material is unchanged as of this date.

08/12/2024 This Material is unchanged as of this date.

02/25/2025 This Material is unchanged as of this date.

09/15/2025 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

12

HazMat Doc

AHERA Report B - Survey

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
05-212AAA	ASSUMED	NO SAMPLE	NS

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDINGS J&K)

STAFF LOUNGE, NURSES' ROOM, AND SNACK BAR

SINK UNDERCOATING

15 SF

11/30/2011	Grey Thermal Undercoating on Sink. (3 EA Sinks). This Material is in GOOD condition as of this date.
02/04/2020	This Material is unchanged as of this date.
08/26/2020	This Material is unchanged as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.
08/17/2022	This Material is unchanged as of this date.
02/13/2023	This Material is unchanged as of this date.
08/14/2023	This Material is unchanged as of this date.
02/12/2024	This Material is unchanged as of this date.
08/12/2024	This Material is unchanged as of this date.
02/25/2025	This Material is unchanged as of this date.
09/15/2025	This Material is unchanged as of this date.

11-202AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDINGS J&K)

STAGE, KITCHEN, STORAGE ROOM, BAND ROOM, RESTROOMS, AND HALLWAY OFFICES

SMOOTH WALL MISCELLANEOUS

19,800 SF

09/06/2005	Gypsum Wallboard System Walls and Ceilings. This Material is in good condition as of this date.
08/23/2006	Hallway Offices added to location. 12,000 SF added to quantity. Material Quantity changed from 7,800 SF to 19,800 SF. <5% Physical Damage. Several damages observed in Bathroom Hallway. 2" O.D. hole noticed in Kitchen next to oven. Material Condition changed from GOOD to FAIR. No other changes as of this date.
05/13/2009	Damages Re-Assessed. Additional Damage observed in the form of several cuts, holes, and scratches in Food Storage Room, Hallways to Stage, and Food Serving locations. No other changes as of this date.
08/28/2014	Material Re-Assessed. Kitchen wall has 3 SF Damage on the Wall. No other changes as of this date.

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
08/06/2018	Additional Damage Observed. 1 SF of Physical Damage by Vice Principals Office and Administration Office. No other chnages as of this date.		
02/04/2020	This Material is unchanged as of this date.		
08/26/2020	This Material is unchanged as of this date.		
02/08/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/16/2022	This Material is unchanged as of this date.		
08/17/2022	Additional Damage Observed. <5% Physical Damage in the form of 2 LF Crack on Wall (Ceiling Level) of Social Worker Office. Material remains in FAIR condition overall. No other changes as of this date.		
02/13/2023	This Material is unchanged as of this date.		
08/14/2023	This Material is unchanged as of this date.		
02/12/2024	This Material is unchanged as of this date.		
08/12/2024	This Material is unchanged as of this date.		
02/25/2025	This Material is unchanged as of this date.		
09/15/2025	This Material is unchanged as of this date.		

05-212AAA

ASSUMED

NO SAMPLE

(NS)

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDINGS J&K)

STAGE, KITCHEN, STORAGE ROOM, BAND ROOM, RESTROOMS, AND HALLWAY OFFICES

SMOOTH WALL SURFACING

19,800 SF

08/23/2006	Skim Coat for Gypsum Wallboard System Walls and Ceilings. <5% Physical Damage. Several damages observed in Bathroom Hallway. 2" O.D. hole noticed in Kitchen next to oven. This Material is in FAIR condition as of this date.
05/13/2009	Damages Re-Assessed. Additional Damage observed in the form of several cuts, holes, and scratches in Food Storage Room, Hallways to Stage, and Food Serving locations. No other changes as of this date.
08/28/2014	Material Re-Assessed. Kitchen wall has 3 SF Damage on the Wall. No other changes as of this date.
08/06/2018	Additional Damage Observed. 1 SF of Physical Damage by Vice Principals Office and Administration Office. No other chnages as of this date.
02/04/2020	This Material is unchanged as of this date.

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
08/26/2020	This Material is unchanged as of this date.		
02/08/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/16/2022	This Material is unchanged as of this date.		
08/17/2022	Additional Damage Observed. <5% Physical Damage in the form of 2 LF Crack on Wall (Ceiling Level) of Social Worker Office. Material remains in FAIR condition overall. No other changes as of this date.		
02/13/2023	This Material is unchanged as of this date.		
08/14/2023	This Material is unchanged as of this date.		
02/12/2024	This Material is unchanged as of this date.		
08/12/2024	This Material is unchanged as of this date.		
02/25/2025	This Material is unchanged as of this date.		
09/15/2025	This Material is unchanged as of this date.		

06-223AAA

ASSUMED

NO SAMPLE

(NS)

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDINGS J&K)

WOOD WALLS, EXTERIOR UPPER LEVEL OVERHANG, AND COVERED WALKWAY

ROUGH CEILING

3,100 SF

09/06/2005	Stucco on Walls and Covered Walkway. This Material is in good condition as of this date.		
05/13/2009	Location Description changed from EXTERIOR WALLS, UPPER LEVEL OVERHANG, AND COVERED WALKWAY to WOOD WALLS, UPPER LEVEL OVERHANG, AND COVERED WALKWAY. Material Type changed from ROUGH WALL to ROUGH CEILING. Material Description changed from ' SKIM COAT FOR STUCCO ON WALLS AND COVERED WALKWAY.' to 'SKIM COAT FOR STUCCO ON Overhang AND COVERED WALKWAY'. Quantity changed from 14,300 SF to 3,100 SF. Damages Re-Assessed. 2 cracked surfaces observed on East and South Sides. No other changes as of this date.		
02/04/2020	This Material is unchanged as of this date.		
08/26/2020	This Material is unchanged as of this date.		
02/08/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/16/2022	This Material is unchanged as of this date.		

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

08/17/2022 This Material is unchanged as of this date.

02/13/2023 This Material is unchanged as of this date.

08/14/2023 This Material is unchanged as of this date.

02/12/2024 This Material is unchanged as of this date.

08/12/2024 This Material is unchanged as of this date.

02/25/2025 This Material is unchanged as of this date.

09/15/2025 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDINGS J&K)

WOOD WALLS, UPPER LEVEL OVERHANG, AND COVERED WALKWAY

ROUGH CEILING SURFACING

3,200 SF

09/06/2005 Skim Coat for Stucco on Walls and Covered Walkway. This Material is in good condition as of this date.

05/13/2009 Location Description changed from EXTERIOR WALLS, UPPER LEVEL OVERHANG, AND COVERED WALKWAY to WOOD WALLS, UPPER LEVEL OVERHANG, AND COVERED WALKWAY. Material Type changed from ROUGH WALL to ROUGH CEILING. Material Description changed from ' SKIM COAT FOR STUCCO ON WALLS AND COVERED WALKWAY.' to 'SKIM COAT FOR STUCCO ON Overhang AND COVERED WALKWAY'. Quantity changed from 14,300 SF to 3,100 SF. Damages Re-Assessed. 2 cracked surfaces observed on East and South Sides. No other changes as of this date.

02/04/2020 This Material is unchanged as of this date.

08/26/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/16/2022 This Material is unchanged as of this date.

08/17/2022 This Material is unchanged as of this date.

02/13/2023 This Material is unchanged as of this date.

08/14/2023 This Material is unchanged as of this date.

02/12/2024 This Material is unchanged as of this date.

08/12/2024 This Material is unchanged as of this date.

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/25/2025 This Material is unchanged as of this date.

09/15/2025 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

CLASSROOMS 01-03 AND RESTROOMS BUILDING (BUILDING A)

CLASSROOMS 01-03 AND RESTROOMS BUILDING (BUILDING A)

09/06/2005	BUILDING NOTES:
09/06/2005	Existing Gypsum Wallboard Systems Removed and Replaced with new in-kind in Path-of-Construction. New Flooring Finishes installed 2015 per information received from the BUESD.
03/05/2007	Building Name changed from CLASSROOMS 1-3 AND RESTROOMS to CLASSROOMS 01-03 AND RESTROOMS BUILDING.
03/10/2010	New Ceramic Wall and Floor Tiles installed in Staff Restrooms per information received from BUESD.
09/16/2015	New Flooring Finishes installed Summer 2015 per information received from the BUESD. New Suspended Ceiling Tiles installed.

CLASSROOMS 01-03 AND RESTROOMS BUILDING (BUILDING A)

CLASSROOMS 01-03

SPRAY ON CEILING

2,880 SF

09/06/2005	Sray-On Ceiling. This Material is in GOOD condition as of this date.
02/04/2020	This Material is unchanged as of this date.
08/26/2020	This Material is unchanged as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.
08/15/2022	This Material is unchanged as of this date.
02/13/2023	This Material is unchanged as of this date.
08/14/2023	This Material is unchanged as of this date.
02/12/2024	This Material is unchanged as of this date.
08/12/2024	This Material is unchanged as of this date.
02/25/2025	This Material is unchanged as of this date.
09/15/2025	This Material is unchanged as of this date.

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
05-212AAA	ASSUMED	NO SAMPLE	(NS)

CLASSROOMS 01-03 AND RESTROOMS BUILDING (BUILDING A)

CLASSROOMS 01-03, RESTROOMS, BOILER ROOM, AND STORAGE ROOM

SMOOTH WALL MISCELLANEOUS

15,115 SF

09/06/2005	Gypsum Wallboard System Walls and Ceilings. Existing Gypsum Wallboard Systems Removed and Replaced with new in-kind in Path-of-Construction. This Material is in GOOD condition as of this date.
08/23/2006	Boiler Room and Storage Room added to Location. 2,500 SF added to quantity. Quantity changed from 9,735 SF to 12,235 SF. No other changes as of this date.
04/17/2008	Quantity changed from 12,235 SF to 15,115 SF to include area above Sprayed-On Ceiling Material. This Material condition is unchanged as of this date.
03/10/2010	Damage: <5% Physical Damage - in the form of scratches, holes, and cuts observed on various surfaces in all Classrooms. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.
02/12/2018	Additional Damage Observed. 2 Cracks 1 LF each located above window in Classroom 1. No other changes as of this date.
02/04/2020	This Material is unchanged as of this date.
08/26/2020	This Material is unchanged as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.
08/15/2022	This Material is unchanged as of this date.
02/13/2023	This Material is unchanged as of this date.
08/14/2023	This Material is unchanged as of this date.
02/12/2024	This Material is unchanged as of this date.
08/12/2024	This Material is unchanged as of this date.
02/25/2025	This Material is unchanged as of this date.
09/15/2025	This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

CLASSROOMS 01-03 AND RESTROOMS BUILDING (BUILDING A)

CLASSROOMS 01-03, RESTROOMS, BOILER ROOM, AND STORAGE ROOM

SMOOTH WALL SURFACING

12,235 SF

08/23/2006	Skim Coat for Gypsum Wallboard System Walls and Ceilings. Existing Gypsum Wallboard Systems Removed and Replaced with new in-kind in Path-of-Construction. This Material is in GOOD condition as of this date.
03/10/2010	Damage Observed. <5% Physical Damage - in the form of scratches, holes, and cuts observed on various surfaces in all Classrooms. Material condition changed from GOOD to FAIR overall. No other changes as of this date.
02/12/2018	Additional Damage Observed. 2 Cracks 1 LF each located above window in Classroom 1. Remains in FAIR condition. No other changes as of this date.
02/04/2020	This Material is unchanged as of this date.
08/26/2020	This Material is unchanged as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.
08/15/2022	This Material is unchanged as of this date.
02/13/2023	This Material is unchanged as of this date.
08/14/2023	This Material is unchanged as of this date.
02/12/2024	This Material is unchanged as of this date.
08/12/2024	This Material is unchanged as of this date.
02/25/2025	This Material is unchanged as of this date.
09/15/2025	This Material is unchanged as of this date.

06-223AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS 01-03 AND RESTROOMS BUILDING (BUILDING A)

CLASSROOMS 1-3

SINK UNDERCOATING

12 SF

10/14/2008	Grey Sink Undercoating (3 EA Sinks). This Material is in GOOD condition as of this date. (Original Entry updated on 08/30/10.)
------------	--

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
02/04/2020	This Material is unchanged as of this date.		
08/26/2020	This Material is unchanged as of this date.		
02/08/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/16/2022	This Material is unchanged as of this date.		
08/15/2022	This Material is unchanged as of this date.		
02/13/2023	This Material is unchanged as of this date.		
08/14/2023	This Material is unchanged as of this date.		
02/12/2024	This Material is unchanged as of this date.		
08/12/2024	This Material is unchanged as of this date.		
02/25/2025	This Material is unchanged as of this date.		
09/15/2025	This Material is unchanged as of this date.		
08-241AAA	ASSUMED	NO SAMPLE	(NS)

CLASSROOMS 01-03 AND RESTROOMS BUILDING (BUILDING A)

ENTIRE BUILDING

FIRE DOOR CORE INSULATION

147 SF

09/06/2005	Fire Door Core Insulation (7 EA FIRE DOOR). This Material is in GOOD condition as of this date.		
02/04/2020	This Material is unchanged as of this date.		
08/26/2020	This Material is unchanged as of this date.		
02/08/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/16/2022	Material Re-assessed. Quantity changed from 21 SF to 147 SF, number of Doors change 1 EA to 7 EA. No longer located in BOILER ROOM changed to ENTIRE BUILDING. No other changes as of this date.		
08/15/2022	This Material is unchanged as of this date.		
02/13/2023	This Material is unchanged as of this date.		
08/14/2023	This Material is unchanged as of this date.		

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/12/2024 This Material is unchanged as of this date.

08/12/2024 This Material is unchanged as of this date.

02/25/2025 This Material is unchanged as of this date.

09/15/2025 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS 01-03 AND RESTROOMS BUILDING (BUILDING A)

EXTERIOR WINDOWS

WINDOW CAULKING

300 LF

10/14/2008 Window Caulking. This Material is in GOOD condition as of this date.

08/25/2017 Damage Observed. <5% Physical Damage - in the form of 6 Windows with Cracked and Dry Material. Material Condition changed from GOOD to FAIR. Friability changed from Non-Friable to Friable. No other changes as of this date.

02/04/2020 This Material is unchanged as of this date.

08/26/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/16/2022 This Material is unchanged as of this date.

08/15/2022 This Material is unchanged as of this date.

02/13/2023 This Material is unchanged as of this date.

08/14/2023 This Material is unchanged as of this date.

02/12/2024 This Material is unchanged as of this date.

08/12/2024 This Material is unchanged as of this date.

02/25/2025 This Material is unchanged as of this date.

09/15/2025 This Material is unchanged as of this date.

28-241AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

CLASSROOMS 01-03 AND RESTROOMS BUILDING (BUILDING A)

MECHANICAL ROOM, AND TWO STAFF RESTROOMS

PLASTER WALL

2,600 SF

09/06/2005	Plaster Walls and Ceiling. Damages noticed. <5% Physical Damage in the form of cuts and holes in various locations. Existing Plaster Systems Removed and Replaced with new in-kind in Path-of-Construction. This Material is in FAIR condition as of this date.
08/23/2006	Two Student Restrooms added to Location. 1,200 SF added to quantity. Quantity changed from 1,400 SF to 2,600 SF. No other changes as of this date.
03/16/2016	Location Description Re-Assessed. Restrooms are now Staff Restrooms. Location changed from BOILER ROOM, AND TWO STUDENT RESTROOMS to BOILER ROOM, AND TWO STAFF RESTROOMS. No other changes as of this date.
02/04/2020	This Material is unchanged as of this date.
08/26/2020	This Material is unchanged as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.
08/17/2022	Additional Damage Observed. <5% Physical Damage in the form of 2 SF of Cuts and Holes in Various Locations on Walls and Ceiling of Mechanical Room. Material remains in FAIR condition overall. No other changes as of this date.
02/13/2023	This Material is unchanged as of this date.
08/14/2023	This Material is unchanged as of this date.
02/12/2024	This Material is unchanged as of this date.
08/12/2024	This Material is unchanged as of this date.
02/25/2025	This Material is unchanged as of this date.
09/15/2025	This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

CLASSROOMS 01-03 AND RESTROOMS BUILDING (BUILDING A)

MECHANICAL ROOM, AND TWO STAFF RESTROOMS

PLASTER WALL SURFACING

2,600 SF

09/06/2005	Skim Coat for Plaster Walls and Ceiling. Damages noticed. <5% Physical Damage in the form of cuts and holes in various locations. Existing Plaster Systems Removed and Replaced with new in-kind in Path-of-Construction. This Material is in FAIR condition as of this date.
08/23/2006	Two Student Restrooms added to Location. 1,200 SF added to quantity. Quantity changed from 1,400 SF to 2,600 SF. No other changes as of this date.
03/16/2016	Location Description Re-Assessed. Restrooms are now Staff Restrooms. Location changed from BOILER ROOM, AND TWO STUDENT RESTROOMS to BOILER ROOM, AND TWO STAFF RESTROOMS. No other changes as of this date.
02/04/2020	This Material is unchanged as of this date.
08/26/2020	This Material is unchanged as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.
08/17/2022	Additional Damage Observed. <5% Physical Damage in the form of 2 SF of Cuts and Holes in Various Locations on Walls and Ceiling of Mechanical Room. Material remains in FAIR condition overall. No other changes as of this date.
02/13/2023	This Material is unchanged as of this date.
08/14/2023	This Material is unchanged as of this date.
02/12/2024	This Material is unchanged as of this date.
08/12/2024	This Material is unchanged as of this date.
02/25/2025	This Material is unchanged as of this date.
09/15/2025	This Material is unchanged as of this date.

05-215AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

COMMENTS

QTY (APPROXIMATE)

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

CLASSROOMS 01-03 AND RESTROOMS BUILDING (BUILDING A)

OVERHANG NEXT TO RESTROOMS

ROUGH CEILING

2,000 SF

09/06/2005 Stucco Overhang. This Material is in GOOD condition as of this date.

02/04/2020 This Material is unchanged as of this date.

08/26/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/16/2022 This Material is unchanged as of this date.

08/15/2022 This Material is unchanged as of this date.

02/13/2023 This Material is unchanged as of this date.

08/14/2023 This Material is unchanged as of this date.

02/12/2024 This Material is unchanged as of this date.

08/12/2024 This Material is unchanged as of this date.

02/25/2025 This Material is unchanged as of this date.

09/15/2025 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS 01-03 AND RESTROOMS BUILDING (BUILDING A)

OVERHANG NEXT TO RESTROOMS

ROUGH CEILING SURFACING

2,000 SF

09/06/2005 Skim Coat for Stucco Overhang. This Material is in GOOD condition as of this date.

02/04/2020 This Material is unchanged as of this date.

08/26/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/16/2022 This Material is unchanged as of this date.

SF= Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
08/15/2022	This Material is unchanged as of this date.		
02/13/2023	This Material is unchanged as of this date.		
08/14/2023	This Material is unchanged as of this date.		
02/12/2024	This Material is unchanged as of this date.		
08/12/2024	This Material is unchanged as of this date.		
02/25/2025	This Material is unchanged as of this date.		
09/15/2025	This Material is unchanged as of this date.		
05-212AAA	ASSUMED	NO SAMPLE	(NS)

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

CLASSROOMS 04-09 BUILDING (BUILDING B)

CLASSROOMS 04-09 BUILDING (BUILDING B)

09/06/2005 BUILDING NOTES:

09/06/2005 Existing Gypsum Wallboard Systems Removed and Replaced with new in-kind in Path-of-Construction. New Flooring Finishes per information received from the BUESD.

03/05/2007 Building Name changed from CLASSROOMS 4-9 to CLASSROOMS 04-09 BUILDING. No other changes as of this date.

CLASSROOMS 04-09 BUILDING (BUILDING B)

CLASSROOM 9

FIRE DOOR CORE INSULATION

189 SF

04/17/2008 Fire Door Core Insulation (9 EA Doors). This Material is in GOOD condition as of this date.

02/04/2020 This Material is unchanged as of this date.

08/26/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/16/2022 Material Re-assessed. Quantity changed from 25 SF to 189 and 1 Door EA to 9 Doors EA. No other changes as of this date.

08/15/2022 This Material is unchanged as of this date.

02/13/2023 This Material is unchanged as of this date.

08/14/2023 This Material is unchanged as of this date.

02/12/2024 This Material is unchanged as of this date.

08/12/2024 This Material is unchanged as of this date.

02/25/2025 This Material is unchanged as of this date.

09/15/2025 This Material is unchanged as of this date.

08-075AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

COMMENTS

QTY (APPROXIMATE)

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

CLASSROOMS 04-09 BUILDING (BUILDING B)

CLASSROOMS 4-9

SINK UNDERCOATING

24 SF

10/14/2008	Grey Sink Undercoating (6 EA Sinks). This Material is in GOOD condition as of this date (Original Entry updated on 08/30/10).
08/30/2010	Undercoating is Grey. Original entry updated. No other changes as of this date.
02/04/2020	This Material is unchanged as of this date.
08/26/2020	This Material is unchanged as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.
08/15/2022	This Material is unchanged as of this date.
02/13/2023	This Material is unchanged as of this date.
08/14/2023	This Material is unchanged as of this date.
02/12/2024	This Material is unchanged as of this date.
08/12/2024	This Material is unchanged as of this date.
02/25/2025	This Material is unchanged as of this date.
09/15/2025	This Material is unchanged as of this date.

08-241AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS 04-09 BUILDING (BUILDING B)

CLASSROOMS 4-9

SMOOTH WALL MISCELLANEOUS

20,430 SF

09/06/2005	Gypsum Wallboard System Walls and Ceilings. Existing Gypsum Wallboard Systems Removed and Replaced with new in-kind in Path-of-Construction. This Material is in GOOD condition as of this date.
04/17/2008	Material also present behind Spray-On Ceiling. Quantity changed from 14,670 SF to 20,430 SF. No other changes as of this date.
08/26/2020	This Material is unchanged as of this date.

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.
08/15/2022	This Material is unchanged as of this date.
02/13/2023	This Material is unchanged as of this date.
08/14/2023	This Material is unchanged as of this date.
02/12/2024	This Material is unchanged as of this date.
08/12/2024	This Material is unchanged as of this date.
02/25/2025	This Material is unchanged as of this date.
09/15/2025	This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS 04-09 BUILDING (BUILDING B)

CLASSROOMS 4-9

SMOOTH WALL SURFACING

14,670 SF

08/23/2006	Skim Coat for Gypsum Wallboard System Walls and Ceilings. Existing Gypsum Wallboard Systems Removed and Replaced with new in-kind in Path-of-Construction. This Material is in GOOD condition as of this date.
08/26/2020	This Material is unchanged as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.
08/15/2022	This Material is unchanged as of this date.
02/13/2023	This Material is unchanged as of this date.
08/14/2023	This Material is unchanged as of this date.
02/12/2024	This Material is unchanged as of this date.
08/12/2024	This Material is unchanged as of this date.

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/25/2025 This Material is unchanged as of this date.

09/15/2025 This Material is unchanged as of this date.

06-223AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS 04-09 BUILDING (BUILDING B)

CLASSROOMS 4-9

SPRAY ON CEILING

5,760 SF

09/06/2005 Spray-On Ceiling. This Material is in GOOD condition as of this date.

02/04/2020 This Material is unchanged as of this date.

08/26/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/16/2022 This Material is unchanged as of this date.

08/15/2022 This Material is unchanged as of this date.

02/13/2023 This Material is unchanged as of this date.

08/14/2023 This Material is unchanged as of this date.

02/12/2024 This Material is unchanged as of this date.

08/12/2024 This Material is unchanged as of this date.

02/25/2025 This Material is unchanged as of this date.

09/15/2025 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS 04-09 BUILDING (BUILDING B)

EXTERIOR WINDOWS ON NORTH AND SOUTH SIDE

WINDOW CAULKING

500 LF

03/03/2014 Window Caulking. This Material is in FAIR condition as of this date.

02/04/2020 This Material is unchanged as of this date.

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
08/26/2020	This Material is unchanged as of this date.		
02/08/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/16/2022	This Material is unchanged as of this date.		
08/15/2022	This Material is unchanged as of this date.		
02/13/2023	This Material is unchanged as of this date.		
08/14/2023	This Material is unchanged as of this date.		
02/12/2024	This Material is unchanged as of this date.		
08/12/2024	This Material is unchanged as of this date.		
02/25/2025	This Material is unchanged as of this date.		
09/15/2025	This Material is unchanged as of this date.		
14-051AAA	ASSUMED	NO SAMPLE	(NS)

CLASSROOMS 04-09 BUILDING (BUILDING B)

MECHANICAL ROOM B10 BY CLASSROOM 04

SMOOTH WALL MISCELLANEOUS

600 SF

09/25/2013	Drywall Board System Walls and Ceilings. Existing Gypsum Wallboard Systems Removed and Replaced with new in-kind in Path-of-Construction. This Material is in GOOD condition as of this date.		
02/04/2020	This Material is unchanged as of this date.		
08/26/2020	This Material is unchanged as of this date.		
02/08/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/16/2022	This Material is unchanged as of this date.		
08/15/2022	This Material is unchanged as of this date.		
02/13/2023	This Material is unchanged as of this date.		
08/14/2023	This Material is unchanged as of this date.		
02/12/2024	This Material is unchanged as of this date.		

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
08/12/2024	This Material is unchanged as of this date.		
02/25/2025	This Material is unchanged as of this date.		
09/15/2025	This Material is unchanged as of this date.		
13-182AAA	ASSUMED	NO SAMPLE	(NS)

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

CLASSROOMS 10-12 BUILDING (BUILDING C)

CLASSROOMS 10-12 BUILDING (BUILDING C)

09/06/2005	BUILDING NOTES:
09/06/2005	Existing Gypsum Wallboard Systems Removed and Replaced with new in-kind in Path-of-Construction. New Flooring Finishes per information received from the BUESD.
03/05/2007	Building Name changed from CLASSROOMS 10-12 to CLASSROOMS 10-12 BUILDING. No other changes as of this date.
08/06/2018	New Flooring Finishes installed Summer 2018 per information received from the BUESD.

CLASSROOMS 10-12 BUILDING (BUILDING C)

BOOK ROOM

FIRE DOOR CORE INSULATION

126 SF

08/28/2014	Fire Door Core Insulation (6 EA Single-Doors). This Material is in GOOD condition as of this date.
02/04/2020	This Material is unchanged as of this date.
08/26/2020	This Material is unchanged as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.
08/15/2022	This Material is unchanged as of this date.
02/13/2023	This Material is unchanged as of this date.
08/14/2023	This Material is unchanged as of this date.
02/12/2024	This Material is unchanged as of this date.
02/12/2024	This Material is unchanged as of this date.
08/12/2024	This Material is unchanged as of this date.
02/25/2025	This Material is unchanged as of this date.
09/15/2025	This Material is unchanged as of this date.

14-198AAA

ASSUMED

NO SAMPLE

(NS)

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

33

HazMat Doc

AHERA Report B - Survey

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

CLASSROOMS 10-12 BUILDING (BUILDING C)

BOOK / SUPPLIES ROOM

PLASTER WALL

1,250 SF

08/23/2006	Plaster Walls and Ceiling. Existing Plaster Systems Removed and Replaced with new in-kind in Path-of-Construction. This Material is in GOOD condition as of this date.
10/10/2012	Damage Observed. <5% Physical Damage - in the form of several holes observed on Walls and Ceiling. Material condition changed from GOOD to FAIR overall as of this date. Friability changed from Non-Friable to Friable.
02/04/2020	This Material is unchanged as of this date.
08/26/2020	This Material is unchanged as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.
08/15/2022	This Material is unchanged as of this date.
02/13/2023	This Material is unchanged as of this date.
08/14/2023	This Material is unchanged as of this date.
02/12/2024	This Material is unchanged as of this date.
08/12/2024	This Material is unchanged as of this date.
02/25/2025	This Material is unchanged as of this date.
09/15/2025	This Material is unchanged as of this date.

06-223AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS 10-12 BUILDING (BUILDING C)

BOOK / SUPPLIES ROOM

PLASTER WALL SURFACING

1,250 SF

08/23/2006	Skim Coat for Plaster Walls and Ceiling. Existing Plaster Systems Removed and Replaced with new in-kind in Path-of-Construction. This Material is in GOOD condition as of this date.
10/10/2012	Damage Observed. <5% Physical Damage - in the form of several holes observed on Walls and Ceiling. Material condition changed from GOOD to FAIR overall as of this date. Friability changed from Non-Friable to Friable to reflect this change.

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
02/04/2020	This Material is unchanged as of this date.		
08/26/2020	This Material is unchanged as of this date.		
02/08/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/16/2022	This Material is unchanged as of this date.		
08/15/2022	This Material is unchanged as of this date.		
02/13/2023	This Material is unchanged as of this date.		
08/14/2023	This Material is unchanged as of this date.		
02/12/2024	This Material is unchanged as of this date.		
08/12/2024	This Material is unchanged as of this date.		
02/25/2025	This Material is unchanged as of this date.		
09/15/2025	This Material is unchanged as of this date.		
06-223AAA	ASSUMED	NO SAMPLE	(NS)

CLASSROOMS 10-12 BUILDING (BUILDING C)

CLASSROOMS 10-12

SINK UNDERCOATING

18 SF

11/30/2011	Grey Thermal Undercoating on Sink (3 EA Sinks). This Material is in GOOD condition as of this date.		
02/04/2020	This Material is unchanged as of this date.		
08/26/2020	This Material is unchanged as of this date.		
02/08/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/16/2022	This Material is unchanged as of this date.		
08/15/2022	This Material is unchanged as of this date.		
02/13/2023	This Material is unchanged as of this date.		
08/14/2023	This Material is unchanged as of this date.		

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/12/2024 This Material is unchanged as of this date.

08/12/2024 This Material is unchanged as of this date.

02/25/2025 This Material is unchanged as of this date.

09/15/2025 This Material is unchanged as of this date.

11-202AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS 10-12 BUILDING (BUILDING C)

CLASSROOMS 10-12

SMOOTH WALL MISCELLANEOUS

11,380 SF

09/06/2005 Gypsum Wallboard System Walls and Ceilings. Existing Gypsum Wallboard Systems Removed and Replaced with new in-kind in Path-of-Construction. This Material is in GOOD condition as of this date.

04/17/2008 Material also present under Spray-On Ceiling. Quantity changed from 8,500 SF to 11,380 SF. This Material is unchanged as of this date.

08/26/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/16/2022 This Material is unchanged as of this date.

08/15/2022 This Material is unchanged as of this date.

02/13/2023 This Material is unchanged as of this date.

08/14/2023 This Material is unchanged as of this date.

02/12/2024 This Material is unchanged as of this date.

08/12/2024 This Material is unchanged as of this date.

02/25/2025 This Material is unchanged as of this date.

09/15/2025 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

CLASSROOMS 10-12 BUILDING (BUILDING C)

CLASSROOMS 10-12

SMOOTH WALL SURFACING

8,500 SF

08/23/2006	Skim Coat for Gypsum Wallboard System Walls and Ceilings. Existing Gypsum Wallboard Systems Removed and Replaced with new in-kind in Path-of-Construction. This Material is in GOOD condition as of this date.		
08/26/2020	This Material is unchanged as of this date.		
02/08/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/16/2022	This Material is unchanged as of this date.		
08/15/2022	This Material is unchanged as of this date.		
02/13/2023	This Material is unchanged as of this date.		
08/14/2023	This Material is unchanged as of this date.		
02/12/2024	This Material is unchanged as of this date.		
08/12/2024	This Material is unchanged as of this date.		
02/25/2025	This Material is unchanged as of this date.		
09/15/2025	This Material is unchanged as of this date.		

06-223AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS 10-12 BUILDING (BUILDING C)

CLASSROOMS 10-12

SPRAY ON CEILING

2,880 SF

09/06/2005	Spray-On Ceiling This Material is in GOOD condition as of this date.		
02/04/2020	This Material is unchanged as of this date.		
08/26/2020	This Material is unchanged as of this date.		
02/08/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/16/2022	This Material is unchanged as of this date.		

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

COMMENTS

QTY (APPROXIMATE)

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

08/15/2022 This Material is unchanged as of this date.

02/13/2023 This Material is unchanged as of this date.

08/14/2023 This Material is unchanged as of this date.

02/12/2024 This Material is unchanged as of this date.

08/12/2024 This Material is unchanged as of this date.

02/25/2025 This Material is unchanged as of this date.

09/15/2025 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS 10-12 BUILDING (BUILDING C)

EXTERIOR WINDOWS (NORTH AND SOUTH SIDES)

WINDOW CAULKING

300 LF

05/13/2009 Sealant/Caulking on Exterior Windows. Damage: <75% Physical Damage due to surfaces being cracked and in degradation condition. This Material is in FAIR condition as of this date.

02/04/2020 This Material is unchanged as of this date.

08/26/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/16/2022 This Material is unchanged as of this date.

08/15/2022 This Material is unchanged as of this date.

02/13/2023 This Material is unchanged as of this date.

08/14/2023 This Material is unchanged as of this date.

02/12/2024 This Material is unchanged as of this date.

08/12/2024 This Material is unchanged as of this date.

02/25/2025 This Material is unchanged as of this date.

09/15/2025 This Material is unchanged as of this date.

09-098AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.

ASBESTOS CONTENT

ASBESTOS NAME

ASBESTOS CODE

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

CLASSROOMS 13-15 AND RESTROOMS BUILDING (BUILDING D)

CLASSROOMS 13-15 AND RESTROOMS BUILDING (BUILDING D)

09/06/2005	BUILDING NOTES:
09/06/2005	Existing Gypsum Wallboard Systems Removed and Replaced with new in-kind in Path-of-Construction. New Flooring Finishes per information received from the BUESD.
03/05/2007	Building Name changed from CLASSROOMS 13-15 AND RESTROOMS to CLASSROOMS 13-15 AND RESTROOMS BUILDING. No other changes as of this date.
03/10/2010	New Ceramic Wall and Floor Tiles installed in Restrooms per information received from BUESD.
08/06/2018	New Flooring Finishes installed Summer 2018 per information received from the BUESD.

CLASSROOMS 13-15 AND RESTROOMS BUILDING (BUILDING D)

BOILER ROOM, AND TWO STAFF RESTROOMS

PLASTER WALL

2,600 SF

09/06/2005	Plaster Walls and Ceiling. Existing Plaster Systems Removed and Replaced with new in-kind in Path-of-Construction. This Material is in GOOD condition as of this date.
08/23/2006	Two Staff Restrooms added to location. 1,200 SF added to quantity. Quantity changed from 1,400 SF to 2,600 SF. No other changes as of this date.
04/17/2008	<5% Physical damage in the form of several small cuts, holes and scratches observed on all walls in the Mechanical Room. Material is in FAIR condition overall as of this date.
03/03/2014	This Material is unchanged as of this date.
02/04/2020	This Material is unchanged as of this date.
08/26/2020	This Material is unchanged as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.
08/15/2022	This Material is unchanged as of this date.
02/13/2023	This Material is unchanged as of this date.
08/14/2023	This Material is unchanged as of this date.

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/12/2024 This Material is unchanged as of this date.

08/12/2024 This Material is unchanged as of this date.

02/25/2025 This Material is unchanged as of this date.

09/15/2025 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS 13-15 AND RESTROOMS BUILDING (BUILDING D)

BOILER ROOM, AND TWO STAFF RESTROOMS

PLASTER WALL SURFACING

2,600 SF

09/06/2005 Skim Coat for Plaster Walls and Ceiling. Existing Plaster Systems Removed and Replaced with new in-kind in Path-of-Construction. This Material is in GOOD condition as of this date.

08/23/2006 Two Staff Restrooms added to location. 1,200 SF added to quantity. Quantity changed from 1,400 SF to 2,600 SF. No other changes as of this date.

04/17/2008 <5% Physical damage in the form of several small cuts, holes and scratches observed on all walls in the Mechanical Room. Material is in FAIR condition overall as of this date.

03/03/2014 This Material is unchanged as of this date.

02/04/2020 This Material is unchanged as of this date.

02/04/2020 This Material is unchanged as of this date.

08/26/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/16/2022 This Material is unchanged as of this date.

08/15/2022 This Material is unchanged as of this date.

02/13/2023 This Material is unchanged as of this date.

08/14/2023 This Material is unchanged as of this date.

02/12/2024 This Material is unchanged as of this date.

08/12/2024 This Material is unchanged as of this date.

02/25/2025 This Material is unchanged as of this date.

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

09/15/2025 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS 13-15 AND RESTROOMS BUILDING (BUILDING D)

CLASSROOMS 13-15

SINK UNDERCOATING

18 SF

11/30/2011 Grey Thermal Undercoating on Sink (3 EA Sinks). This Material is in GOOD condition as of this date.
(Original Entry updated on 10/10/12.)

03/03/2014 This Material is unchanged as of this date.

02/04/2020 This Material is unchanged as of this date.

08/26/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/16/2022 This Material is unchanged as of this date.

08/15/2022 This Material is unchanged as of this date.

02/13/2023 This Material is unchanged as of this date.

08/14/2023 This Material is unchanged as of this date.

02/12/2024 This Material is unchanged as of this date.

08/12/2024 This Material is unchanged as of this date.

02/25/2025 This Material is unchanged as of this date.

09/15/2025 This Material is unchanged as of this date.

11-202AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS 13-15 AND RESTROOMS BUILDING (BUILDING D)

CLASSROOMS 13-15

SPRAY ON CEILING

2,880 SF

09/06/2005 Spray-On Ceiling. This Material is in GOOD condition as of this date.

02/04/2020 This Material is unchanged as of this date.

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
08/26/2020	This Material is unchanged as of this date.		
02/08/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/16/2022	This Material is unchanged as of this date.		
08/15/2022	This Material is unchanged as of this date.		
02/13/2023	This Material is unchanged as of this date.		
08/14/2023	This Material is unchanged as of this date.		
02/12/2024	This Material is unchanged as of this date.		
08/12/2024	This Material is unchanged as of this date.		
02/25/2025	This Material is unchanged as of this date.		
09/15/2025	This Material is unchanged as of this date.		
05-212AAA	ASSUMED	NO SAMPLE	(NS)

CLASSROOMS 13-15 AND RESTROOMS BUILDING (BUILDING D)

CLASSROOMS 13-15, AND TWO RESTROOMS

SMOOTH WALL MISCELLANEOUS

12,615 SF

09/06/2005	Gypsum Wallboard System Walls and Ceilings. Existing Gypsum Wallboard Systems Removed and Replaced with new in-kind in Path-of-Construction. This Material is in GOOD condition as of this date.
04/17/2008	Material is also present under Spray-On Ceiling. Quantity changed from 9,735 SF to 12,615 SF. This Material is in FAIR condition due to water damage in several locations as of this date.
09/12/2016	<10% Water Damage and <5% Physical Damage observed. Room 13 has cuts and holes; and Room 14 has 3 LF of cracks, cuts, and holes. This Material is in FAIR condition overall. No other changes as of this date.
03/27/2017	Additional Damage Observed. 4 SF of Peeling Skim Coat in Girls Restroom. No other changes as of this date.
02/04/2020	This Material is unchanged as of this date.
08/26/2020	This Material is unchanged as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.

SF= Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

HazMat Doc

AHERA Report B - Survey

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
02/16/2022	This Material is unchanged as of this date.		
08/15/2022	This Material is unchanged as of this date.		
02/13/2023	This Material is unchanged as of this date.		
08/14/2023	This Material is unchanged as of this date.		
02/12/2024	This Material is unchanged as of this date.		
08/12/2024	This Material is unchanged as of this date.		
02/25/2025	This Material is unchanged as of this date.		
09/15/2025	This Material is unchanged as of this date.		
05-212AAA	ASSUMED	NO SAMPLE	(NS)

CLASSROOMS 13-15 AND RESTROOMS BUILDING (BUILDING D)

CLASSROOMS 13-15, AND TWO RESTROOMS

SMOOTH WALL SURFACING

9,735 SF

08/23/2006	Skim Coat for Gypsum Wallboard System Walls and Ceilings. This Material is in GOOD condition as of this date.
09/12/2016	<10% Water Damage and <5% Physical Damage observed. Room 13 has cuts and holes; and Room 14 has 3 LF of cracks, cuts, and holes. This Material is in FAIR condition overall. No other changes as of this date.
03/27/2017	Additional Damage Observed. 4 SF of Peeling Skim Coat in Girls Restroom. No other changes as of this date.
02/04/2020	This Material is unchanged as of this date.
08/26/2020	This Material is unchanged as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.
08/15/2022	This Material is unchanged as of this date.
02/13/2023	This Material is unchanged as of this date.
08/14/2023	This Material is unchanged as of this date.

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/12/2024 This Material is unchanged as of this date.

08/12/2024 This Material is unchanged as of this date.

02/25/2025 This Material is unchanged as of this date.

09/15/2025 This Material is unchanged as of this date.

06-223AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS 13-15 AND RESTROOMS BUILDING (BUILDING D)

COVERED WALKWAY / OVERHANG

ROUGH CEILING

2,000 SF

09/06/2005 Stucco on Covered Walkway / Overhang. This Material is in GOOD condition as of this date.

03/03/2014 This Material is unchanged as of this date.

02/04/2020 This Material is unchanged as of this date.

08/26/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/16/2022 This Material is unchanged as of this date.

08/15/2022 This Material is unchanged as of this date.

02/13/2023 This Material is unchanged as of this date.

08/14/2023 This Material is unchanged as of this date.

02/12/2024 This Material is unchanged as of this date.

08/12/2024 This Material is unchanged as of this date.

02/25/2025 This Material is unchanged as of this date.

09/15/2025 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

COMMENTS

QTY (APPROXIMATE)

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

CLASSROOMS 13-15 AND RESTROOMS BUILDING (BUILDING D)

COVERED WALKWAY / OVERHANG

ROUGH CEILING SURFACING

2,000 SF

09/06/2005	Skim Coat for Stucco on Covered Walkway / Overhang. This Material is in GOOD condition as of this date.		
03/03/2014	This Material is unchanged as of this date.		
02/04/2020	This Material is unchanged as of this date.		
08/26/2020	This Material is unchanged as of this date.		
02/08/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/16/2022	This Material is unchanged as of this date.		
08/15/2022	This Material is unchanged as of this date.		
02/13/2023	This Material is unchanged as of this date.		
08/14/2023	This Material is unchanged as of this date.		
02/12/2024	This Material is unchanged as of this date.		
08/12/2024	This Material is unchanged as of this date.		
02/25/2025	This Material is unchanged as of this date.		
09/15/2025	This Material is unchanged as of this date.		

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS 13-15 AND RESTROOMS BUILDING (BUILDING D)

ENTIRE BUILDING

FIRE DOOR CORE INSULATION

147 SF

02/16/2022	Fire Door Core Insulation. (7 EA Doors). This Material is in GOOD condition as of this date.		
08/15/2022	Additional Damage Observed. <5% Physical Damage in the form of Damaged door knob with White Core Insulation Exposed in Mechanical Room. Material condition changed from GOOD to FAIR overall. No other changes as of this date.		
02/13/2023	This Material is unchanged as of this date.		

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

08/14/2023 This Material is unchanged as of this date.

02/12/2024 This Material is unchanged as of this date.

08/12/2024 This Material is unchanged as of this date.

02/25/2025 This Material is unchanged as of this date.

09/15/2025 This Material is unchanged as of this date.

22-025AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS 13-15 AND RESTROOMS BUILDING (BUILDING D)

EXTERIOR WINDOWS (EAST AND WEST SIDES)

WINDOW CAULKING

300 LF

05/13/2009 Sealant/Caulking on Exterior Windows. Damage: <75% Physical Damage in the form of cracked surfaces and degradation condition. This Material is in FAIR condition as of this date.

02/04/2020 This Material is unchanged as of this date.

08/26/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/16/2022 This Material is unchanged as of this date.

08/15/2022 This Material is unchanged as of this date.

02/13/2023 This Material is unchanged as of this date.

08/14/2023 This Material is unchanged as of this date.

02/12/2024 This Material is unchanged as of this date.

08/12/2024 This Material is unchanged as of this date.

02/25/2025 This Material is unchanged as of this date.

09/15/2025 This Material is unchanged as of this date.

09-098AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

CLASSROOMS 16-18 BUILDING (BUILDING F)

CLASSROOMS 16-18 BUILDING (BUILDING F)

09/06/2005	BUILDING NOTES:
09/06/2005	Existing Gypsum Wallboard Systems Removed and Replaced with new in-kind in Path-of-Construction. New Flooring Finishes per information received from the BUESD.
03/05/2007	Building Name changed from classrooms 16-18 to CLASSROOMS 16-18 BUILDING. No other changes as of this date.
08/06/2018	New Suspended Ceiling Tiles installed. New Flooring Finishes installed Summer 2018 per information received from the BUESD.

CLASSROOMS 16-18 BUILDING (BUILDING F)

ALL CLASSROOMS, BOILER ROOM, AND STORAGE ROOM

SMOOTH WALL MISCELLANEOUS

8,100 SF

09/06/2005	Gypsum Wallboard System Walls and Ceilings. Existing Gypsum Wallboard Systems Removed and Replaced with new in-kind in Path-of-Construction. This Material is in GOOD condition as of this date.
08/06/2018	Damage Observed. <5% Physical Damage - in the form of 1 SF Scrape in Lower Wall in Classroom 18. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.
02/04/2020	This Material is unchanged as of this date.
08/26/2020	This Material is unchanged as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.
08/15/2022	This Material is unchanged as of this date.
02/13/2023	This Material is unchanged as of this date.
08/14/2023	This Material is unchanged as of this date.
02/12/2024	This Material is unchanged as of this date.
08/12/2024	This Material is unchanged as of this date.
02/25/2025	This Material is unchanged as of this date.

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

09/15/2025 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS 16-18 BUILDING (BUILDING F)

ALL CLASSROOMS, BOILER ROOM, AND STORAGE ROOM

SMOOTH WALL SURFACING

8,100 SF

08/23/2006 Skim Coat for Gypsum Wallboard System Walls and Ceilings. Existing Gypsum Wallboard Systems Removed and Replaced with new in-kind in Path-of-Construction. This Material is in GOOD condition as of this date.

08/06/2018 Damage Observed. <5% Physical Damage - in the form of 1 SF Scrape in Lower Wall in Classroom 18. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.

02/04/2020 This Material is unchanged as of this date.

08/26/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/16/2022 This Material is unchanged as of this date.

08/15/2022 This Material is unchanged as of this date.

02/13/2023 This Material is unchanged as of this date.

08/14/2023 This Material is unchanged as of this date.

02/12/2024 This Material is unchanged as of this date.

08/12/2024 This Material is unchanged as of this date.

02/25/2025 This Material is unchanged as of this date.

09/15/2025 This Material is unchanged as of this date.

06-223AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

CLASSROOMS 16-18 BUILDING (BUILDING F)

BOILER ROOM

FIRE DOOR CORE INSULATION

147 SF

09/06/2005 **Fire Door Core Insulation (7 EA FIRE DOORS), (Entry Updated on 2/16/2022). This Material is in GOOD condition as of this date.**

02/04/2020 This Material is unchanged as of this date.

08/26/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

08/15/2022 This Material is unchanged as of this date.

02/13/2023 This Material is unchanged as of this date.

08/14/2023 This Material is unchanged as of this date.

02/12/2024 This Material is unchanged as of this date.

08/12/2024 This Material is unchanged as of this date.

02/25/2025 This Material is unchanged as of this date.

09/15/2025 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS 16-18 BUILDING (BUILDING F)

CLASSROOMS 16-18

WINDOW CAULKING

72 LF

10/14/2008 Window Caulking. This Material is in GOOD condition as of this date.

05/13/2009 Damage Observed. <10% Water Damage due to existing cracks on surfaces. Material condition changed from GOOD to FAIR overall as of this date. No other changes as of this date.

02/04/2020 This Material is unchanged as of this date.

08/26/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

SF= Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

50

HazMat Doc

AHERA Report B - Survey

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
02/16/2022	This Material is unchanged as of this date.		
08/15/2022	This Material is unchanged as of this date.		
02/13/2023	Additional Damage Observed. <5% Physical Damage in the form of 2 LF of Cracks on North Window of Classroom 18. Material remains in FAIR condition overall. No other changes as of this date.		
08/14/2023	This Material is unchanged as of this date.		
02/12/2024	This Material is unchanged as of this date.		
08/12/2024	This Material is unchanged as of this date.		
02/25/2025	This Material is unchanged as of this date.		
09/15/2025	This Material is unchanged as of this date.		
08-241AAA	ASSUMED	NO SAMPLE	(NS)

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

CLASSROOMS 19-23 BUILDING (BUILDING G)

CLASSROOMS 19-23 BUILDING (BUILDING G)

09/06/2005	BUILDING NOTES:
09/06/2005	Existing Gypsum Wallboard Systems Removed and Replaced with new in-kind in Path-of-Construction. New Flooring Finishes per information received from the BUESD.
03/05/2007	Building Name changed from CLASSROOMS 19-23 to CLASSROOMS 19-23 BUILDING. No other changes as of this date.
08/06/2018	New Flooring Finishes installed Summer 2018 per information received from the BUESD. New Suspended Ceiling Tiles installed.

CLASSROOMS 19-23 BUILDING (BUILDING G)

CLASSROOMS 19 AND 20

VINYL WALL COVER MASTIC

1,100 SF

11/30/2011	Mastic/Adhesive for Vinyl Wall Cover, (over Gypsum Wallboard System). This Material is in GOOD condition as of this date.
02/04/2020	This Material is unchanged as of this date.
08/26/2020	This Material is unchanged as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.
08/15/2022	This Material is unchanged as of this date.
02/13/2023	This Material is unchanged as of this date.
08/14/2023	This Material is unchanged as of this date.
02/12/2024	This Material is unchanged as of this date.
08/12/2024	This Material is unchanged as of this date.
02/25/2025	This Material is unchanged as of this date.
09/15/2025	This Material is unchanged as of this date.

11-202AAA

ASSUMED

NO SAMPLE

(NS)

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

52

HazMat Doc

AHERA Report B - Survey

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

CLASSROOMS 19-23 BUILDING (BUILDING G)

CLASSROOMS 19-23

MORTAR MISCELLANEOUS

720 SF

11/30/2011	Grout/Mortar for 2"x2" Blue Ceramic Floor Tiles. This Material is in GOOD condition as of this date.
03/27/2017	Damage Observed. <5% Physical Damage - in the form of a few Tiles in Various Rooms have Cracked and are Missing Grout. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.
02/04/2020	This Material is unchanged as of this date.
08/26/2020	This Material is unchanged as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.
08/15/2022	This Material is unchanged as of this date.
02/13/2023	This Material is unchanged as of this date.
08/14/2023	This Material is unchanged as of this date.
02/12/2024	This Material is unchanged as of this date.
08/12/2024	This Material is unchanged as of this date.
02/25/2025	This Material is unchanged as of this date.
09/15/2025	This Material is unchanged as of this date.

11-202AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS 19-23 BUILDING (BUILDING G)

CLASSROOMS 19-23, MECHANICAL ROOM, AND CUSTODIAL ROOM

SMOOTH WALL MISCELLANEOUS

11,490 SF

09/06/2005	Gypsum Wallboard System Walls and Ceilings. Existing Gypsum Wallboard Systems Removed and Replaced with new in-kind in Path-of-Construction. This Material is in GOOD condition as of this date.
09/25/2013	460 SF has been Removed and Replaced with New Materials in the Summer of 2013 in Custodial Room and Mechanical Room. Friability changed from Non-Friable to Friable. No other changes as of this date.

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
08/06/2018	Quantity changed from 10,800 SF to 11,490 SF. New Gypsum Wallboard System Walls found in Speech Room and Reading Room. No other changes as of this date.		
02/04/2020	This Material is unchanged as of this date.		
08/26/2020	This Material is unchanged as of this date.		
02/08/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/16/2022	This Material is unchanged as of this date.		
08/15/2022	Additional Damage Observed. <5% Physical Damage in the form of 4" Round Hole on Ceiling in Custodial Room. Mechanical Room has small Cuts and Holes on Walls and Ceiling. Material condition changed from GOOD to FAIR overall. No other changes as of this date.		
02/13/2023	This Material is unchanged as of this date.		
08/14/2023	This Material is unchanged as of this date.		
02/12/2024	This Material is unchanged as of this date.		
08/12/2024	This Material is unchanged as of this date.		
02/25/2025	This Material is unchanged as of this date.		
09/15/2025	This Material is unchanged as of this date.		
05-212AAA	ASSUMED	NO SAMPLE	(NS)

CLASSROOMS 19-23 BUILDING (BUILDING G)

CLASSROOMS 19-23, MECHANICAL ROOM, AND CUSTODIAL ROOM

SMOOTH WALL SURFACING

11,490 SF

08/23/2006	Skim Coat for Gypsum Wallboard System Walls and Ceilings. Existing Gypsum Wallboard Systems Removed and Replaced with new in-kind in Path-of-Construction. This Material is in GOOD condition as of this date.
09/25/2013	460 SF has been Removed and Replaced with New Materials in the Summer of 2013 in Custodial Room and Mechanical Room. Friability changed from Non-Friable to Friable. No other changes as of this date.
08/06/2018	Quantity changed from 10,800 SF to 11,490 SF. New Gypsum Wallboard System Walls found in Speech Room and Reading Room. No other changes as of this date.
02/04/2020	This Material is unchanged as of this date.
08/26/2020	This Material is unchanged as of this date.

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
02/08/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/16/2022	This Material is unchanged as of this date.		
08/15/2022	Additional Damage Observed. <5% Physical Damage in the form of 4" Round Hole on Ceiling in Custodial Room. Mechanical Room has small Cuts and Holes on Walls and Ceiling. Material condition changed from GOOD to FAIR overall. No other changes as of this date.		
02/13/2023	This Material is unchanged as of this date.		
08/14/2023	This Material is unchanged as of this date.		
02/12/2024	This Material is unchanged as of this date.		
08/12/2024	This Material is unchanged as of this date.		
02/25/2025	This Material is unchanged as of this date.		
09/15/2025	This Material is unchanged as of this date.		
06-223AAA	ASSUMED	NO SAMPLE	(NS)

CLASSROOMS 19-23 BUILDING (BUILDING G)

CLASSROOMS 22 AND 23

SINK UNDERCOATING

9 SF

08/30/2010	Grey Thermal Undercoating on Sink (6 EA Sinks). This Material is in GOOD condition as of this date.		
02/04/2020	This Material is unchanged as of this date.		
08/26/2020	This Material is unchanged as of this date.		
02/08/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/16/2022	This Material is unchanged as of this date.		
08/15/2022	This Material is unchanged as of this date.		
02/13/2023	This Material is unchanged as of this date.		
02/13/2023	This Material is unchanged as of this date.		
08/14/2023	This Material is unchanged as of this date.		

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/12/2024 This Material is unchanged as of this date.

08/12/2024 This Material is unchanged as of this date.

02/25/2025 This Material is unchanged as of this date.

09/15/2025 This Material is unchanged as of this date.

10-174AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS 19-23 BUILDING (BUILDING G)

COVERED WALKWAY / OVERHANG

ROUGH CEILING

1,600 SF

10/10/2012 Stucco on Ceiling. This Material is in GOOD condition as of this date.

02/04/2020 This Material is unchanged as of this date.

08/26/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/16/2022 This Material is unchanged as of this date.

08/15/2022 This Material is unchanged as of this date.

02/13/2023 This Material is unchanged as of this date.

08/14/2023 This Material is unchanged as of this date.

02/12/2024 This Material is unchanged as of this date.

08/12/2024 This Material is unchanged as of this date.

02/25/2025 This Material is unchanged as of this date.

09/15/2025 This Material is unchanged as of this date.

12-185AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

CLASSROOMS 19-23 BUILDING (BUILDING G)

COVERED WALKWAY / OVERHANG

ROUGH CEILING SURFACING

1,600 SF

10/10/2012 Skim Coat for Stucco on Ceiling. This Material is in GOOD condition as of this date.

02/04/2020 This Material is unchanged as of this date.

08/26/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/16/2022 This Material is unchanged as of this date.

08/15/2022 This Material is unchanged as of this date.

02/13/2023 This Material is unchanged as of this date.

08/14/2023 This Material is unchanged as of this date.

02/12/2024 This Material is unchanged as of this date.

08/12/2024 This Material is unchanged as of this date.

02/25/2025 This Material is unchanged as of this date.

09/15/2025 This Material is unchanged as of this date.

12-185AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS 19-23 BUILDING (BUILDING G)

CUSTODIAN ROOM, AND BOILER ROOM

FIRE DOOR CORE INSULATION

42 SF

09/06/2005 Fire Door Core Insulation (2 EA FIRE DOORS). This Material is in GOOD condition as of this date.

02/04/2020 This Material is unchanged as of this date.

08/26/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
02/16/2022	Material Re-assessed. Quantity changed from 42 SF to 168 SF and 2 EA Doors changed to 8 EA Doors. No other changes as of this date.		
08/15/2022	This Material is unchanged as of this date.		
02/13/2023	This Material is unchanged as of this date.		
08/14/2023	This Material is unchanged as of this date.		
02/12/2024	This Material is unchanged as of this date.		
08/12/2024	This Material is unchanged as of this date.		
02/25/2025	This Material is unchanged as of this date.		
09/15/2025	This Material is unchanged as of this date.		
05-212AAA	ASSUMED	NO SAMPLE	(NS)

CLASSROOMS 19-23 BUILDING (BUILDING G)

SPEECH ROOM, AND READING ROOM

WALL TILE

640 SF

11/05/2007	1'x1' Glued-on Tan Wall and Ceiling Tile. ~320 SF in each RoomDamage: <50% Physical Damage - Tiles Damaged in both Rooms on both Walls and Ceiling. This Material is in POOR condition as of this date.		
11/30/2011	Additional Damage observed - in the form of Speech Room has 1 Tile loose. No other changes as of this date.		
08/25/2017	Additional Damage Observed. Speech Room now has 4 Tiles Loose. No other changes as of this date.		
02/04/2020	This Material is unchanged as of this date.		
08/26/2020	This Material is unchanged as of this date.		
02/08/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/16/2022	This Material is unchanged as of this date.		
08/15/2022	This Material is unchanged as of this date.		
02/13/2023	This Material is unchanged as of this date.		
08/14/2023	This Material is unchanged as of this date.		

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/12/2024 This Material is unchanged as of this date.

08/12/2024 This Material is unchanged as of this date.

02/25/2025 This Material is unchanged as of this date.

09/15/2025 This Material is unchanged as of this date.

07-043AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS 19-23 BUILDING (BUILDING G)

SPEECH ROOM, AND READING ROOM

WALL TILE MASTIC

640 SF

11/05/2007 Mastic/Adhesive for 1'x1' Glued-on Tan Wall and Ceiling Tile. ~320 SF in each RoomDamage: <50% Physical Damage - Tiles Damaged in both Rooms on both Walls and Ceiling. This Material is in POOR condition as of this date.

11/30/2011 Additional Damage observed - in the form of Speech Room has 1 Tile loose. No other changes as of this date.

08/25/2017 Additional Damage Observed. Speech Room now has 4 Tiles Loose. No other changes as of this date.

02/04/2020 This Material is unchanged as of this date.

08/26/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/16/2022 This Material is unchanged as of this date.

08/15/2022 This Material is unchanged as of this date.

02/13/2023 This Material is unchanged as of this date.

08/14/2023 This Material is unchanged as of this date.

02/12/2024 This Material is unchanged as of this date.

08/12/2024 This Material is unchanged as of this date.

02/25/2025 This Material is unchanged as of this date.

09/15/2025 This Material is unchanged as of this date.

07-043AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

59

HazMat Doc

AHERA Report B - Survey

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

CLASSROOMS 24-37 - FLEXIBLE INSTRUCTIONAL SPACE (BUILDING I)

CLASSROOMS 24-37 - FLEXIBLE INSTRUCTIONAL SPACE (BUILDING I)

09/06/2005	BUILDING NOTES:
09/06/2005	Existing Gypsum Wallboard Systems Removed and Replaced with new in-kind in Path-of-Construction. New Flooring Finishes per information received from the BUESD.
03/10/2010	New Ceramic Wall and Floor Tiles installed in Restrooms per information received from BUESD.
08/06/2018	New Flooring Finishes installed Summer 2018 per information received from the BUESD.
08/26/2020	Building Name changed from SHOP, LIBRARY, AND CLASSROOMS BUILDING to CLASSROOMS 24-37 - FLEXIBLE INSTRUCTIONAL SPACE (BUILDING I).

CLASSROOMS 24-37 - FLEXIBLE INSTRUCTIONAL SPACE (BUILDING I)

CLASSROOM 25 (STORAGE), LIBRARY OFFICE, AND CLASSROOMS 32 & 34

SINK UNDERCOATING

60 SF

11/30/2011	Grey Thermal Undercoating on Sink (10 EA Sinks). This Material is in GOOD condition as of this date.
02/04/2020	This Material is unchanged as of this date.
08/26/2020	This Material is unchanged as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.
08/15/2022	This Material is unchanged as of this date.
02/13/2023	This Material is unchanged as of this date.
08/14/2023	This Material is unchanged as of this date.
02/12/2024	This Material is unchanged as of this date.
08/12/2024	This Material is unchanged as of this date.
02/25/2025	This Material is unchanged as of this date.
09/15/2025	This Material is unchanged as of this date.

11-202AAA

ASSUMED

NO SAMPLE

(NS)

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

60

HazMat Doc

AHERA Report B - Survey

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

CLASSROOMS 24-37 - FLEXIBLE INSTRUCTIONAL SPACE (BUILDING I)

CLASSROOMS 24, 25, 32, AND 34

MORTAR MISCELLANEOUS

415 SF

11/30/2011	Grout/Mortar for 2"x2" Blue Ceramic Floor Tiles. This Material is in GOOD condition as of this date.
03/18/2015	In Classroom 24, 3 Ceramic Floor Tiles are missing and the Mortar is exposed. Friability changed from Non-Friable to Friable. This Material is in FAIR condition as of this date.
09/12/2016	Additional Damage observed. Rooms 24 and 25 have cracked Tiles and cracked Mortar. No other changes as of this date.
02/04/2020	This Material is unchanged as of this date.
08/26/2020	This Material is unchanged as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.
08/15/2022	This Material is unchanged as of this date.
02/13/2023	This Material is unchanged as of this date.
08/14/2023	This Material is unchanged as of this date.
02/12/2024	This Material is unchanged as of this date.
08/12/2024	This Material is unchanged as of this date.
02/25/2025	This Material is unchanged as of this date.
09/15/2025	This Material is unchanged as of this date.

11-202AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS 24-37 - FLEXIBLE INSTRUCTIONAL SPACE (BUILDING I)

ENTIRE BUILDING (INCLUDING RESTROOMS)

SMOOTH WALL MISCELLANEOUS

35,800 SF

09/06/2005	Gypsum Wallboard System Walls and Ceilings. This Material is in GOOD condition as of this date.
10/10/2012	Material Re-Assessed and approximately 300 SF Removed and Replaced with New in Mechanical Rooms and Room 36. No other changes as of this date.

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
02/04/2020	This Material is unchanged as of this date.		
08/26/2020	Additonal Damage Observed. 3 SF of Cracks and Holes on Wall, Gypsum Exposed in Library Computer Lab. No other changes as of this date.		
02/08/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/16/2022	This Material is unchanged as of this date.		
08/15/2022	This Material is unchanged as of this date.		
02/13/2023	This Material is unchanged as of this date.		
08/14/2023	This Material is unchanged as of this date.		
02/12/2024	This Material is unchanged as of this date.		
08/12/2024	This Material is unchanged as of this date.		
02/25/2025	This Material is unchanged as of this date.		
09/15/2025	This Material is unchanged as of this date.		
05-212AAA	ASSUMED	NO SAMPLE	(NS)

CLASSROOMS 24-37 - FLEXIBLE INSTRUCTIONAL SPACE (BUILDING I)

ENTIRE BUILDING (INCLUDING RESTROOMS)

SMOOTH WALL SURFACING

35,500 SF

08/23/2006	Skim coat for Gypsum Wallboard System Walls and Ceilings. This Material is in GOOD condition as of this date.		
10/10/2012	Material Re-Assessed and approximately 300 SF Removed and Replaced with New in Mechanical Rooms and Room 36. No other changes as of this date.		
02/04/2020	This Material is unchanged as of this date.		
08/26/2020	Additonal Damage Observed. 3 SF of Cracks and Holes on Wall, Gypsum Exposed in Library Computer Lab. No other changes as of this date.		
02/08/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/16/2022	This Material is unchanged as of this date.		

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

08/15/2022 This Material is unchanged as of this date.

02/13/2023 This Material is unchanged as of this date.

08/14/2023 This Material is unchanged as of this date.

02/12/2024 This Material is unchanged as of this date.

08/12/2024 This Material is unchanged as of this date.

02/25/2025 This Material is unchanged as of this date.

09/15/2025 This Material is unchanged as of this date.

06-223AAA ASSUMED NO SAMPLE (NS)

CLASSROOMS 24-37 - FLEXIBLE INSTRUCTIONAL SPACE (BUILDING I)

EXTERIOR OVERHANG

ROUGH CEILING

100 SF

10/10/2012 Stucco on Exterior Walls and Overhangs. This Material is in GOOD condition as of this date.

02/04/2020 This Material is unchanged as of this date.

08/26/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/16/2022 This Material is unchanged as of this date.

08/15/2022 This Material is unchanged as of this date.

02/13/2023 This Material is unchanged as of this date.

08/14/2023 This Material is unchanged as of this date.

02/12/2024 This Material is unchanged as of this date.

08/12/2024 This Material is unchanged as of this date.

02/25/2025 This Material is unchanged as of this date.

09/15/2025 This Material is unchanged as of this date.

12-185AAA ASSUMED NO SAMPLE (NS)

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

CLASSROOMS 24-37 - FLEXIBLE INSTRUCTIONAL SPACE (BUILDING I)

EXTERIOR OVERHANG

ROUGH CEILING SURFACING

100 SF

10/10/2012 Skim Coat for Stucco on Exterior Overhangs. This Material is in GOOD condition as of this date.

02/04/2020 This Material is unchanged as of this date.

08/26/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/16/2022 This Material is unchanged as of this date.

08/15/2022 This Material is unchanged as of this date.

02/13/2023 This Material is unchanged as of this date.

08/14/2023 This Material is unchanged as of this date.

02/12/2024 This Material is unchanged as of this date.

08/12/2024 This Material is unchanged as of this date.

02/25/2025 This Material is unchanged as of this date.

09/15/2025 This Material is unchanged as of this date.

12-185AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS 24-37 - FLEXIBLE INSTRUCTIONAL SPACE (BUILDING I)

FURNACE CLOSET

BASEBOARD MASTIC

20 LF

05/13/2009 Mastic/Adhesive for 4" Brown Baseboard. This Material is in GOOD condition as of this date.

02/04/2020 This Material is unchanged as of this date.

08/26/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/16/2022 This Material is unchanged as of this date.

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

08/15/2022 This Material is unchanged as of this date.

02/13/2023 This Material is unchanged as of this date.

08/14/2023 This Material is unchanged as of this date.

02/12/2024 This Material is unchanged as of this date.

08/12/2024 This Material is unchanged as of this date.

02/25/2025 This Material is unchanged as of this date.

09/15/2025 This Material is unchanged as of this date.

09-098AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS 24-37 - FLEXIBLE INSTRUCTIONAL SPACE (BUILDING I)

KILN ROOM

KILN BRICK

80 SF

10/14/2008 Kiln Brick. This Material is in GOOD condition as of this date.

02/04/2020 This Material is unchanged as of this date.

08/26/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/16/2022 This Material is unchanged as of this date.

08/15/2022 This Material is unchanged as of this date.

02/13/2023 This Material is unchanged as of this date.

08/14/2023 This Material is unchanged as of this date.

02/12/2024 This Material is unchanged as of this date.

08/12/2024 This Material is unchanged as of this date.

02/25/2025 This Material is unchanged as of this date.

09/15/2025 This Material is unchanged as of this date.

08-241AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

CLASSROOMS 24-37 - FLEXIBLE INSTRUCTIONAL SPACE (BUILDING I)

LIBRARY SECTION OF THE BUILDING

WINDOW CAULKING

240 LF

05/13/2009	Sealant/Caulking on Exterior Windows. This Material is in GOOD condition as of this date.
08/25/2017	Damage Observed. >25% Physical Damage - in the form of 15 Windows with Cracked, Dry Material. Material Condition changed from GOOD to FAIR. Friability changed from NON to FRIABLE. No other changes as of this date.
02/04/2020	This Material is unchanged as of this date.
08/26/2020	This Material is unchanged as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.
08/15/2022	This Material is unchanged as of this date.
02/13/2023	This Material is unchanged as of this date.
08/14/2023	This Material is unchanged as of this date.
02/12/2024	This Material is unchanged as of this date.
08/12/2024	This Material is unchanged as of this date.
02/25/2025	This Material is unchanged as of this date.
09/15/2025	This Material is unchanged as of this date.

09-098AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS 24-37 - FLEXIBLE INSTRUCTIONAL SPACE (BUILDING I)

MECHANICAL ROOM AT REAR OF CLASSROOM 25

CEMENTITIOUS PIPE/FLUE

1 LF

05/13/2009	4" O.D. Cementitious Pipe. Material is inside Slab Floor in Mechanical Room by Classroom 32. . This Material is in GOOD condition as of this date.
03/03/2014	<5% Physical Damage overall. Friability changed from Non-Friable to Friable. This Material is in FAIR condition as of this date.
02/04/2020	This Material is unchanged as of this date.

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
08/26/2020	This Material is unchanged as of this date.		
02/08/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/16/2022	This Material is unchanged as of this date.		
08/15/2022	This Material is unchanged as of this date.		
02/13/2023	This Material is unchanged as of this date.		
08/14/2023	This Material is unchanged as of this date.		
02/12/2024	This Material is unchanged as of this date.		
08/12/2024	This Material is unchanged as of this date.		
02/25/2025	This Material is unchanged as of this date.		
09/15/2025	This Material is unchanged as of this date.		
09-098AAA	ASSUMED	NO SAMPLE	(NS)

CLASSROOMS 24-37 - FLEXIBLE INSTRUCTIONAL SPACE (BUILDING I)

ROOMS 33, 34, AND 36 (BAND ROOM)

CEILING TILE

4,426 SF

09/06/2005	1'x1' Glued-On Ceiling Tile. This Material is in GOOD condition as of this date.		
10/10/2012	Approximately 42 SF of Material Removed in Classroom 36. Quantity changed from 4,468 SF to 4,426 SF. No other changes as of this date.		
09/12/2016	Damage observed. <5% Physical Damage - Room 36 has 2 Tiles coming loose. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.		
02/04/2020	This Material is unchanged as of this date.		
08/26/2020	This Material is unchanged as of this date.		
02/08/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/16/2022	This Material is unchanged as of this date.		
08/15/2022	This Material is unchanged as of this date.		

SF= Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
02/13/2023	This Material is unchanged as of this date.		
08/14/2023	This Material is unchanged as of this date.		
02/12/2024	This Material is unchanged as of this date.		
08/12/2024	This Material is unchanged as of this date.		
02/25/2025	This Material is unchanged as of this date.		
09/15/2025	This Material is unchanged as of this date.		
05-212AAA	ASSUMED	NO SAMPLE	(NS)

CLASSROOMS 24-37 - FLEXIBLE INSTRUCTIONAL SPACE (BUILDING I)

ROOMS 33, 34, AND 36 (BAND ROOM)

CEILING TILE MASTIC

4,426 SF

09/06/2005	Mastic/Adhesive for 1'x1' Glued-On Ceiling Tile. This Material is in GOOD condition as of this date.		
10/10/2012	Approximately 42 SF of Material Removed in Classroom 36. Quantity changed from 4,468 SF to 4,426 SF. No other changes as of this date.		
09/12/2016	Damage observed. Damage: <5% Physical Damage - Room 36 has 2 Tiles coming loose. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.		
02/04/2020	This Material is unchanged as of this date.		
08/26/2020	This Material is unchanged as of this date.		
02/08/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/16/2022	This Material is unchanged as of this date.		
08/15/2022	This Material is unchanged as of this date.		
02/13/2023	This Material is unchanged as of this date.		
08/14/2023	This Material is unchanged as of this date.		
02/12/2024	This Material is unchanged as of this date.		
08/12/2024	This Material is unchanged as of this date.		
02/25/2025	This Material is unchanged as of this date.		

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

09/15/2025 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS 24-37 - FLEXIBLE INSTRUCTIONAL SPACE (BUILDING I)

SHOP, ALL CLASSROOMS, AND LIBRARY

VINYL FLOOR TILE MASTIC

10,158 SF

09/06/2005 Mastic/Adhesive for 9"x9" Vinyl Floor Tile. (Material May Exist Under Carpeting and 12"x12" Vinyl Floor Tile). This Material is in GOOD condition as of this date.

10/10/2012 Location Description changed from ALL SHOP CLASSROOMS, AND LIBRARY to SHOP, ALL CLASSROOMS, AND LIBRARY. Approximately 42 SF of flooring removed in Shop. Quantity changed from 10,200 SF to 10,158 SF. No other changes as of this date.

02/04/2020 This Material is unchanged as of this date.

08/26/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/16/2022 This Material is unchanged as of this date.

08/15/2022 This Material is unchanged as of this date.

02/13/2023 This Material is unchanged as of this date.

08/14/2023 This Material is unchanged as of this date.

02/12/2024 This Material is unchanged as of this date.

08/12/2024 This Material is unchanged as of this date.

02/25/2025 This Material is unchanged as of this date.

09/15/2025 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS 24-37 - FLEXIBLE INSTRUCTIONAL SPACE (BUILDING I)

SHOP, AND ALL CLASSROOMS, AND LIBRARY

VINYL FLOOR TILE

10,158 SF

09/06/2005 9"X9" Vinyl Floor Tile. (Material May Exist Under Carpeting and 12"X12" Vinyl Floor Tile). This Material is in GOOD condition as of this date.

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
10/10/2012	Location Description changed from ALL SHOP CLASSROOMS, AND LIBRARY to SHOP, AND ALL CLASSROOMS, AND LIBRARY. Approximately 42 SF of flooring removed in Shop. Quantity changed from 10,200 SF to 10,158 SF. No other changes as of this date.		
08/06/2018	Material Re-assessed. No access to Classroom 33, currently under constrction as of ths date. No oher changes as of this date.		
02/04/2020	This Material is unchanged as of this date.		
08/26/2020	This Material is unchanged as of this date.		
02/08/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/16/2022	This Material is unchanged as of this date.		
08/15/2022	This Material is unchanged as of this date.		
02/13/2023	This Material is unchanged as of this date.		
08/14/2023	This Material is unchanged as of this date.		
02/12/2024	This Material is unchanged as of this date.		
08/12/2024	This Material is unchanged as of this date.		
02/25/2025	This Material is unchanged as of this date.		
09/15/2025	This Material is unchanged as of this date.		
05-212AAA	ASSUMED	NO SAMPLE	(NS)
05-212AAA	ASSUMED	NO SAMPLE	(NS)

CLASSROOMS 24-37 - FLEXIBLE INSTRUCTIONAL SPACE (BUILDING I)

STORAGE CLOSETS, AND TWO MECHANICAL ROOMS

FIRE DOOR CORE INSULATION

126 SF

09/06/2005	Fire Door Core Insulation. (3 EA FIRE DOORS). This Material is in GOOD condition as of this date.		
08/23/2006	Two Mechanical Rooms added to location (3 more doors). 63 SF added to location. Quantity changed from 63 SF to 126 SF. This Material is unchanged as of this date.		
03/27/2017	Damage Observed. <5% Physical Damage - in the form of Door Broken, Core Material Exposed. in a 3" hole. Material condition changed from GOOD to FAIR overall. No other changes as of this date.		
02/04/2020	This Material is unchanged as of this date.		

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
08/26/2020	This Material is unchanged as of this date.		
02/08/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/16/2022	This Material is unchanged as of this date.		
08/15/2022	This Material is unchanged as of this date.		
02/13/2023	This Material is unchanged as of this date.		
08/14/2023	This Material is unchanged as of this date.		
02/12/2024	This Material is unchanged as of this date.		
08/12/2024	This Material is unchanged as of this date.		
02/25/2025	This Material is unchanged as of this date.		
09/15/2025	This Material is unchanged as of this date.		
05-212AAA	ASSUMED	NO SAMPLE	(NS)

CLASSROOMS 24-37 - FLEXIBLE INSTRUCTIONAL SPACE (BUILDING I)

STUDENT RESTROOMS (2)

MORTAR MISCELLANEOUS

280 SF

03/10/2010	Grout/Mortar for 2"x2" Tan Ceramic Floor Tiles. (Apparent New Material identified by the AHERA accredited Inspector). This Material is in GOOD condition as of this date.		
02/04/2020	This Material is unchanged as of this date.		
08/26/2020	This Material is unchanged as of this date.		
02/08/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/16/2022	This Material is unchanged as of this date.		
08/15/2022	This Material is unchanged as of this date.		
02/13/2023	This Material is unchanged as of this date.		
08/14/2023	This Material is unchanged as of this date.		
02/12/2024	This Material is unchanged as of this date.		

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

08/12/2024 This Material is unchanged as of this date.

02/25/2025 This Material is unchanged as of this date.

09/15/2025 This Material is unchanged as of this date.

10-052AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS 24-37 - FLEXIBLE INSTRUCTIONAL SPACE (BUILDING I)

STUDENT RESTROOMS (2)

MORTAR MISCELLANEOUS

680 SF

03/10/2010 Grout/Mortar for 4"x4" Multi-Color Ceramic Wall Tiles. (Apparent New Material identified by the AHERA accredited Inspector). This Material is in GOOD condition as of this date.

02/04/2020 This Material is unchanged as of this date.

08/26/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/16/2022 This Material is unchanged as of this date.

08/15/2022 This Material is unchanged as of this date.

02/13/2023 This Material is unchanged as of this date.

08/14/2023 This Material is unchanged as of this date.

02/12/2024 This Material is unchanged as of this date.

08/12/2024 This Material is unchanged as of this date.

02/25/2025 This Material is unchanged as of this date.

09/15/2025 This Material is unchanged as of this date.

10-052AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

CLASSROOMS P1, P4-P5 PORTABLES BUILDINGS

CLASSROOMS P1, P4-P5 PORTABLES BUILDINGS

09/06/2005 BUILDING NOTES:

09/06/2005 PORTABLE P1
BY AMERICAN MODULAR SYS; DATE 12/04; OSA# 01-106623;
SERIAL# 04-961-002A, 04-961-002B, 04-961-002C.
PORTABLE P4
BY AMERICAN MODULAR SYS; DATE 12/04; OSA# 01-106623;
SERIAL# 04-961-001A, 04-961-001B, 04-961-001C.
PORTABLE P5
BY AMERICAN MODULAR SYS; DATE 05/05; OSA# 01-106623;
SERIAL# 05-107-002A, 05-107-002B, 05-107-002C.
This Entry for informational and tracking purposes.

03/05/2007 Building Name changed from PORTABLES P1, P4, AND P5 to CLASSROOMS P1, P4-P5 PORTABLE BUILDING. No other changes as of this date.

CLASSROOMS P1, P4-P5 PORTABLES BUILDINGS

CLASSROOMS P1, P4-P5 PORTABLE BUILDINGS

PORTABLE BUILDING

2,880 SF

09/06/2005 New 2004 and 2005 Construction Relocatable Buildings per Manufacturer's Tag information.

04/02/2020 This Material is unchanged as of this date.

08/26/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/16/2022 This Material is unchanged as of this date.

08/15/2022 This Material is unchanged as of this date.

02/13/2023 This Material is unchanged as of this date.

08/14/2023 This Material is unchanged as of this date.

02/12/2024 This Material is unchanged as of this date.

08/12/2024 This Material is unchanged as of this date.

02/25/2025 This Material is unchanged as of this date.

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

09/15/2025 This Material is unchanged as of this date.

05-212.NS	NEW	NO SAMPLE	(NS)
-----------	-----	-----------	--------

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.

ASBESTOS CONTENT

ASBESTOS NAME

ASBESTOS CODE

CLASSROOMS P2 (BUILDING M)-P3 (BUILDING N) PORTABLE BUILDINGS

CLASSROOMS P2 (BUILDING M)-P3 (BUILDING N) PORTABLE BUILDINGS

03/05/2007 BUILDING NOTES:

03/05/2007 Building Name changed from PORTABLES P2-P3 to CLASSROOMS P2-P3 PORTABLE BUILDING. No other changes as of this date.

10/14/2008 Manufacturer's Tag Info:
PORTABLE P3
By Designed Mobile Systems Inc; Date 06/92; OSA# 57634; Serial # 2871-1, 2871-2.
This entry for informational and tracking purposes.

PORTABLE P2
All new Flooring and Suspended Ceiling Tiles installed per information received from BUESD.

CLASSROOMS P2 (BUILDING M)-P3 (BUILDING N) PORTABLE BUILDINGS

PORTABLE P2

PRESSED WOOD WALL PANEL

1,800 SF

09/06/2005 4'x10' Pressed Wood Wall Panel, (with Vinyl Wall Cover). This Material is in GOOD condition as of this date.

08/25/2017 Damage Observed. <5% Physical Damage - in the form of 5 Small Holes in Classroom P2. Material Condition changed from GOOD to FAIR. Friability changed from NON to MODERATE. No other changes as of this date.

02/04/2020 This Material is unchanged as of this date.

08/26/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/16/2022 This Material is unchanged as of this date.

08/15/2022 This Material is unchanged as of this date.

02/13/2023 This Material is unchanged as of this date.

08/14/2023 This Material is unchanged as of this date.

02/12/2024 This Material is unchanged as of this date.

08/12/2024 This Material is unchanged as of this date.

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/25/2025 This Material is unchanged as of this date.

09/15/2025 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

CLASSROOMS P2 (BUILDING M)-P3 (BUILDING N) PORTABLE BUILDINGS

PORTABLES P2

PRESSED WOOD WALL PANEL MASTIC

3,600 SF

09/06/2005 Mastic/Adhesive for 4'x10' Pressed Wood Wall Panel, (with Vinyl Wall Cover). This Material is in GOOD condition as of this date.

08/25/2017 Damage Observed. <5% Physical Damage - in the form of 5 Small Holes in Classroom P2. Material Condition changed from GOOD to FAIR. Friability changed from NON to MODERATE. No other changes as of this date.

02/04/2020 This Material is unchanged as of this date.

08/26/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/16/2022 This Material is unchanged as of this date.

08/15/2022 This Material is unchanged as of this date.

02/13/2023 This Material is unchanged as of this date.

08/14/2023 This Material is unchanged as of this date.

02/12/2024 This Material is unchanged as of this date.

08/12/2024 This Material is unchanged as of this date.

02/25/2025 This Material is unchanged as of this date.

09/15/2025 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

COMMENTS

QTY (APPROXIMATE)

SAMPLE NO.

ASBESTOS CONTENT

ASBESTOS NAME

ASBESTOS CODE

CLASSROOMS P2 (BUILDING M)-P3 (BUILDING N) PORTABLE BUILDINGS

PORTABLES P2

VINYL WALL COVER MASTIC

1,800 SF

09/06/2005	Mastic/Adhesive for Vinyl Covering on 4'x10' Pressed Wood Wall Panels. This Material is in GOOD condition as of this date.
08/25/2017	Damage Observed. <5% Physical Damage - in the form of 5 Small Holes in Classroom P2. Material Condition changed from GOOD to FAIR. Friability changed from NON to MODERATE. No other changes as of this date.
02/04/2020	This Material is unchanged as of this date.
08/26/2020	This Material is unchanged as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.
08/15/2022	This Material is unchanged as of this date.
02/13/2023	This Material is unchanged as of this date.
08/14/2023	This Material is unchanged as of this date.
02/12/2024	This Material is unchanged as of this date.
08/12/2024	This Material is unchanged as of this date.
02/25/2025	This Material is unchanged as of this date.
09/15/2025	This Material is unchanged as of this date.

05-212AAA

ASSUMED

NO SAMPLE

(NS)

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

GREEN HOUSE

GREEN HOUSE

05/13/2009 BUILDING NOTES:

05/13/2009 Metal and Glass Green House.

GREEN HOUSE

GREEN HOUSE ECHO LAB

PERMANENT BUILDING

270 SF

05/13/2009 Metal and Glass Green House.

03/03/2014 This Material is unchanged as of this date.

08/28/2014 This Material is unchanged as of this date.

02/04/2020 This Material is unchanged as of this date.

08/26/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/16/2022 This Material is unchanged as of this date.

08/15/2022 This Material is unchanged as of this date.

02/13/2023 This Material is unchanged as of this date.

08/14/2023 This Material is unchanged as of this date.

02/12/2024 This Material is unchanged as of this date.

08/12/2024 This Material is unchanged as of this date.

02/25/2025 This Material is unchanged as of this date.

09/15/2025 This Material is unchanged as of this date.

09-098.NS	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

GYM BUILDING (BUILDING E)

GYM BUILDING (BUILDING E)

09/06/2005	BUILDING NOTES:
09/06/2005	Existing Gypsum Wallboard Systems Removed and Replaced with new in-kind in Path-of-Construction. Existing Plaster Systems Removed and Replaced with new in-kind in Path-of-Construction. New Flooring Finishes per information received from the BUESD.
03/05/2007	Building Name changed from GYM to GYM BUILDING. No other changes as of this date.

GYM BUILDING (BUILDING E)

ATTIC AREA OF BOYS AND GIRLS LOCKER ROOMS

PIPE FITTING INSULATION

35 LF

09/06/2005	Pipe Fitting Insulation, 35 Fittings. This Material is in GOOD condition as of this date.
09/25/2013	Material has been REMOVED in Boiler Room in the Summer of 2013. Location changed from BOILER ROOM, AND ATTIC AREA OF BOYS AND GIRLS LOCKER ROOMS to ATTIC AREA OF BOYS AND GIRLS LOCKER ROOMS. No other changes as of this date.
02/04/2020	This Material is unchanged as of this date.
08/26/2020	This Material is unchanged as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.
08/15/2022	This Material is unchanged as of this date.
02/13/2023	This Material is unchanged as of this date.
08/14/2023	This Material is unchanged as of this date.
02/12/2024	This Material is unchanged as of this date.
08/12/2024	This Material is unchanged as of this date.
02/25/2025	This Material is unchanged as of this date.
09/15/2025	This Material is unchanged as of this date.

05-212AAA

ASSUMED

NO SAMPLE

(NS)

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

79

HazMat Doc

AHERA Report B - Survey

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

GYM BUILDING (BUILDING E)

BOILER ROOM

FIRE DOOR CORE INSULATION

42 SF

09/06/2005 Fire Door Core Insulation (2 EA). This Material is in GOOD condition as of this date.

02/04/2020 This Material is unchanged as of this date.

08/26/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/16/2022 This Material is unchanged as of this date.

08/15/2022 This Material is unchanged as of this date.

02/13/2023 This Material is unchanged as of this date.

08/14/2023 This Material is unchanged as of this date.

02/12/2024 This Material is unchanged as of this date.

08/12/2024 This Material is unchanged as of this date.

02/25/2025 This Material is unchanged as of this date.

09/15/2025 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

GYM BUILDING (BUILDING E)

BOILER ROOM, COACHES OFFICE, STORAGE ROOMS, GYM, BOYS' LOCKER ROOM AND GIRLS' LOCKER ROOM

SMOOTH WALL MISCELLANEOUS

10,400 SF

09/06/2005 Gypsum Wallboard System Walls and Ceilings. Existing Gypsum Wallboard Systems Removed and Replaced with new in-kind in Path-of-Construction. This Material is in GOOD condition as of this date.

09/16/2015 Location Description changed from 'BOILER ROOM, COACHES OFFICE, STORAGE ROOMS, AND GYM' to 'BOILER ROOM, COACHES OFFICE, STORAGE ROOMS, GYM, BOYS' LOCKER ROOM AND GIRLS' LOCKER ROOM '. Material quantity changed from 8,400 SF to 10,400 SF. No other change as of this date.

02/04/2020 This Material is unchanged as of this date.

08/26/2020 This Material is unchanged as of this date.

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

80

HazMat Doc

AHERA Report B - Survey

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
02/08/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/16/2022	This Material is unchanged as of this date.		
08/15/2022	Damages Observed. <5% Physical Damage in the form of 2 SF of Loose, Bubbling Skim Coat and Paint on Wall and Ceiling of Gym Storage Room. Material condition changed from GOOD to FAIR overall. Friability updated from Non-Friable to Friable. No other changes as of this date.		
02/13/2023	This Material is unchanged as of this date.		
08/14/2023	This Material is unchanged as of this date.		
02/12/2024	This Material is unchanged as of this date.		
08/12/2024	This Material is unchanged as of this date.		
02/25/2025	This Material is unchanged as of this date.		
09/15/2025	This Material is unchanged as of this date.		
05-212AAA	ASSUMED	NO SAMPLE	(NS)

GYM BUILDING (BUILDING E)

BOILER ROOM, COACHES OFFICE, STORAGE ROOMS, GYM, BOYS' LOCKER ROOM AND GIRLS' LOCKER ROOM

SMOOTH WALL SURFACING

10,400 SF

09/06/2005	Skim Coat for Gypsum Wallboard System Walls and Ceilings. Existing Gypsum Wallboard Systems Removed and Replaced with new in-kind in Path-of-Construction. This Material is in GOOD condition as of this date.		
09/16/2015	Location Description changed from 'BOILER ROOM, COACHES OFFICE, STORAGE ROOMS, AND GYM' to 'BOILER ROOM, COACHES OFFICE, STORAGE ROOMS, GYM, BOYS' LOCKER ROOM AND GIRLS' LOCKER ROOM '. Material quantity changed from 8,400 SF to 10,400 SF. No other change as of this date.		
02/04/2020	This Material is unchanged as of this date.		
08/26/2020	This Material is unchanged as of this date.		
02/08/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/16/2022	This Material is unchanged as of this date.		

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
08/15/2022	Damages Observed. <5% Physical Damage in the form of 2 SF of Loose, Bubbling Skim Coat and Paint on Wall and Ceiling of Gym Storage Room. Material condition changed from GOOD to FAIR overall. Friability updated from Non-Friable to Friable. No other changes as of this date.		
02/13/2023	This Material is unchanged as of this date.		
08/14/2023	This Material is unchanged as of this date.		
02/12/2024	This Material is unchanged as of this date.		
08/12/2024	This Material is unchanged as of this date.		
02/25/2025	This Material is unchanged as of this date.		
09/15/2025	This Material is unchanged as of this date.		
05-212AAA	ASSUMED	NO SAMPLE	(NS)

GYM BUILDING (BUILDING E)

BOYS' AND GIRLS' SHOWERS, AND COACHES RESTROOMS

MORTAR MISCELLANEOUS

700 SF

10/14/2008	Grout for 4"x4" Multi-Colored Ceramic Wall Tiles. This Material is in GOOD condition as of this date.		
02/04/2020	This Material is unchanged as of this date.		
08/26/2020	Damage Observed. <5% Physical Damage - in the form of 2 Broken Tiles and 4 Tiles with Missing Grout in Girls' Locker Room by Water Fountain. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.		
02/08/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/16/2022	This Material is unchanged as of this date.		
08/15/2022	This Material is unchanged as of this date.		
02/13/2023	This Material is unchanged as of this date.		
08/14/2023	This Material is unchanged as of this date.		
02/12/2024	This Material is unchanged as of this date.		
08/12/2024	This Material is unchanged as of this date.		
02/25/2025	This Material is unchanged as of this date.		

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

09/15/2025 This Material is unchanged as of this date.

08-241AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

GYM BUILDING (BUILDING E)

BOYS' AND GIRLS' SHOWERS, AND COACHES RESTROOMS

MORTAR MISCELLANEOUS

320 SF

10/14/2008 Grout for 2"x2" Beige Ceramic Floor Tiles. This Material is in GOOD condition as of this date.

02/04/2020 This Material is unchanged as of this date.

08/26/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/16/2022 This Material is unchanged as of this date.

08/15/2022 This Material is unchanged as of this date.

02/13/2023 This Material is unchanged as of this date.

08/14/2023 This Material is unchanged as of this date.

02/12/2024 This Material is unchanged as of this date.

08/12/2024 This Material is unchanged as of this date.

02/25/2025 This Material is unchanged as of this date.

09/15/2025 This Material is unchanged as of this date.

08-241AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

GYM BUILDING (BUILDING E)

BOYS' AND GIRLS' SHOWERS AND LOCKER ROOMS

PLASTER WALL

4,320 SF

09/06/2005 Plaster Walls and Ceilings. This Material is in GOOD condition as of this date.

11/30/2011 Damage Observed. <10% Water Damage - in the form of Water Damage observed on Ceiling of Girls' Shower Area. Material condition changed from GOOD to FAIR overall as of this date. Friability changed from Non-Friable to Friable to reflect this change.

02/04/2020 This Material is unchanged as of this date.

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

83

HazMat Doc

AHERA Report B - Survey

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
08/26/2020	This Material is unchanged as of this date.		
02/08/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/16/2022	This Material is unchanged as of this date.		
08/15/2022	This Material is unchanged as of this date.		
02/13/2023	This Material is unchanged as of this date.		
08/14/2023	This Material is unchanged as of this date.		
02/12/2024	This Material is unchanged as of this date.		
08/12/2024	This Material is unchanged as of this date.		
02/25/2025	This Material is unchanged as of this date.		
09/15/2025	This Material is unchanged as of this date.		
05-212AAA	ASSUMED	NO SAMPLE	(NS)
05-212AAA	ASSUMED	NO SAMPLE	(NS)

GYM BUILDING (BUILDING E)

BOYS' AND GIRLS' SHOWERS AND LOCKER ROOMS

PLASTER WALL SURFACING

4,320 SF

09/06/2005	Skim Coat for Plaster Walls and Ceilings. This Material is in GOOD condition as of this date.		
11/30/2011	Damage: <10% Water Damage - in the form of water damage observed on Ceiling of Girls' Shower Area. Material condition changed from GOOD to FAIR overall as of this date. Friability changed from Non-Friable to Friable to reflect this change.		
02/04/2020	This Material is unchanged as of this date.		
08/26/2020	This Material is unchanged as of this date.		
02/08/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/16/2022	This Material is unchanged as of this date.		
08/15/2022	This Material is unchanged as of this date.		

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/13/2023 This Material is unchanged as of this date.

08/14/2023 This Material is unchanged as of this date.

02/12/2024 This Material is unchanged as of this date.

08/12/2024 This Material is unchanged as of this date.

02/25/2025 This Material is unchanged as of this date.

09/15/2025 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

GYM BUILDING (BUILDING E)

EXTERIOR WALLS

ROUGH WALL SURFACING

8,300 SF

09/06/2005 Skim Coat for Stucco Walls and Overhangs. This Material is in GOOD condition as of this date.

02/04/2020 This Material is unchanged as of this date.

08/26/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/16/2022 This Material is unchanged as of this date.

08/15/2022 This Material is unchanged as of this date.

02/13/2023 This Material is unchanged as of this date.

08/14/2023 This Material is unchanged as of this date.

02/12/2024 This Material is unchanged as of this date.

08/12/2024 This Material is unchanged as of this date.

02/25/2025 This Material is unchanged as of this date.

09/15/2025 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

COMMENTS

QTY (APPROXIMATE)

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

GYM BUILDING (BUILDING E)

EXTERIOR WALLS AND OVERHANGS

ROUGH WALL

8,300 SF

09/06/2005 Stucco Walls and Overhangs. This Material is in GOOD condition as of this date.

02/04/2020 This Material is unchanged as of this date.

08/26/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/16/2022 This Material is unchanged as of this date.

08/15/2022 This Material is unchanged as of this date.

02/13/2023 This Material is unchanged as of this date.

08/14/2023 This Material is unchanged as of this date.

02/12/2024 This Material is unchanged as of this date.

08/12/2024 This Material is unchanged as of this date.

02/25/2025 This Material is unchanged as of this date.

09/15/2025 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

GYM BUILDING (BUILDING E)

GYM

CEILING PANEL

2,900 SF

09/06/2005 4'x4' Glued-On Ceiling and Wall Panels. This Material is in GOOD condition as of this date.

02/04/2020 This Material is unchanged as of this date.

08/26/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/16/2022 This Material is unchanged as of this date.

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

86

HazMat Doc

AHERA Report B - Survey

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

08/15/2022 This Material is unchanged as of this date.

02/13/2023 This Material is unchanged as of this date.

08/14/2023 This Material is unchanged as of this date.

02/12/2024 This Material is unchanged as of this date.

08/12/2024 This Material is unchanged as of this date.

02/25/2025 This Material is unchanged as of this date.

09/15/2025 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

GYM BUILDING (BUILDING E)

GYM

CEILING PANEL MASTIC

2,900 SF

09/06/2005 Mastic/Adhesive for 4'x4' Glued-On Ceiling and Wall Panels. This Material is in GOOD condition as of this date.

02/04/2020 This Material is unchanged as of this date.

08/26/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/16/2022 This Material is unchanged as of this date.

08/15/2022 This Material is unchanged as of this date.

02/13/2023 This Material is unchanged as of this date.

08/14/2023 This Material is unchanged as of this date.

02/12/2024 This Material is unchanged as of this date.

08/12/2024 This Material is unchanged as of this date.

02/25/2025 This Material is unchanged as of this date.

09/15/2025 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	(NS)
-----------	---------	-----------	--------

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

COMMENTS

QTY (APPROXIMATE)

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

GYM BUILDING (BUILDING E)

GYM

VINYL SHEETING

1,683 SF

09/06/2005 Vinyl Sheeting with Wood Pattern, (under New Vinyl Floor Sheeting installed in 2017). This Material is in GOOD condition as of this date. (Original Entry updated on 03/10/10.)

03/03/2017 Sample 17-041-048 collected from Building E, E1 Mini Gym, Resilient Flooring (Top Layer).

02/04/2020 This Material is unchanged as of this date.

08/26/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/16/2022 This Material is unchanged as of this date.

08/15/2022 This Material is unchanged as of this date.

02/13/2023 This Material is unchanged as of this date.

08/14/2023 This Material is unchanged as of this date.

02/12/2024 This Material is unchanged as of this date.

08/12/2024 This Material is unchanged as of this date.

02/25/2025 This Material is unchanged as of this date.

09/15/2025 This Material is unchanged as of this date.

17-041-048	ND	NONE DETECTED	(ND)
05-212AAA	ASSUMED	NO SAMPLE	(NS)

GYM BUILDING (BUILDING E)

GYM

VINYL SHEETING BACKING PAPER/MASTIC

1,683 SF

09/06/2005 Backing Paper/Adhesive for Vinyl Sheeting with Wood Pattern, (under New Vinyl Floor Sheeting installed in 2017). This Material is in GOOD condition as of this date. (Original Entry updated on 03/10/10.)

03/03/2017 Sample 17-041-049 collected from Building E, E1 Mini Gym, Resilient Flooring (Bottom Layer Adhesive).

02/04/2020 This Material is unchanged as of this date.

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
08/26/2020	This Material is unchanged as of this date.		
02/08/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/16/2022	This Material is unchanged as of this date.		
08/15/2022	This Material is unchanged as of this date.		
02/13/2023	This Material is unchanged as of this date.		
08/14/2023	This Material is unchanged as of this date.		
02/12/2024	This Material is unchanged as of this date.		
08/12/2024	This Material is unchanged as of this date.		
02/25/2025	This Material is unchanged as of this date.		
09/15/2025	This Material is unchanged as of this date.		
17-041-049	ND	NONE DETECTED	(ND)
05-212AAA	ASSUMED	NO SAMPLE	(NS)

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.

ASBESTOS CONTENT

ASBESTOS NAME

ASBESTOS CODE

LANCER GYM (BUILDING L)

LANCER GYM (BUILDING L)

02/12/2024 BUILDING NOTES:

02/12/2024 New Construction Building completed in 2023.

LANCER GYM (BUILDING L)

LANCER GYM

PERMANENT BUILDING

8,775 SF

02/12/2024 New Construction Building completed in 2023. This Material is in GOOD condition as of this date.

08/12/2024 This Material is unchanged as of this date.

02/25/2025 This Material is unchanged as of this date.

09/15/2025 This Material is unchanged as of this date.

24-016.NS

NEW

NO SAMPLE

(NS)

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

STORAGE CONTAINERS

STORAGE CONTAINERS

05/13/2009	BUILDING NOTES:
05/13/2009	Metal Storage Container. (1 EA Containers).
03/10/2010	Building Name changed from STORAGE CONTAINER to STORAGE CONTAINERS (2 EA). Quantity changed from 336 SF to 736 SF. 1 Container is located next to Kitchen Facilities, and 1 is located next to P.E. Field.

STORAGE CONTAINERS

METAL STORAGE CONTAINERS (3 EA)

STORAGE CONTAINER

504 SF

03/16/2016	Metal Storage Containers. 3 EA, approximately 64 SF, 120 SF, and 320 SF. (Original Entry Update on 8/25/17).
08/25/2017	Location Description changed from METAL STORAGE CONTAINERS (2 EA) to METAL STORAGE CONTAINERS (3 EA). Material Description changed from "Metal Storage Containers. 2 EA, approximately 368 SF EA" to "Metal Storage Containers. 3 EA, approximately 64 SF, 120 SF, and 320 SF". Quantity Re-Assessed from 736 SF to quantity 504 SF. No other changes as of this date.
02/04/2020	This Material is unchanged as of this date.
08/26/2020	This Material is unchanged as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.
08/15/2022	This Material is unchanged as of this date.
08/14/2023	This Material is unchanged as of this date.
02/12/2024	This Material is unchanged as of this date.
08/12/2024	This Material is unchanged as of this date.
02/25/2025	This Material is unchanged as of this date.
09/15/2025	This Material is unchanged as of this date.

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.

ASBESTOS CONTENT

ASBESTOS NAME

ASBESTOS CODE

16-074.NS

ASSUMED

NO SAMPLE

(NS)

SURVEY REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

WOOD SHED

WOOD SHED

03/10/2010 BUILDING NOTES:

03/10/2010 Storage Shed is located next to Gym Building.

03/16/2016 Building Name changed from WOOD STORAGE BUILDING to WOOD SHED (1 EA).

WOOD SHED

WOOD STORAGE BUILDING

STORAGE BUILDING

60 SF

03/10/2010 Apparent New Wood Construction structure identified by the AHERA Accredited inspector. This Material is in GOOD condition as of this date.

03/03/2014 This Material is unchanged as of this date.

08/28/2014 This Material is unchanged as of this date.

08/26/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/16/2022 This Material is unchanged as of this date.

08/15/2022 This Material is unchanged as of this date.

08/14/2023 This Material is unchanged as of this date.

02/12/2024 This Material is unchanged as of this date.

02/25/2025 This Material is unchanged as of this date.

09/15/2025 This Material is unchanged as of this date.

10-052.NS	NEW	NO SAMPLE	(NS)
-----------	-----	-----------	--------

End Of Report, Total Of 93 Pages

HOMOGENEOUS MATERIALS IN PIEDMONT MIDDLE SCHOOL

BUILDING NAME	MATERIAL CATEGORY	LOCATION	MATERIAL TYPE
ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDINGS J&K)			

MISCELLANEOUS MATERIAL

CHOIR ROOM	CEILING TILE
CHOIR ROOM	CEILING TILE MASTIC
COUNSELOR'S ROOM	VINYL WALL COVER
COUNSELOR'S ROOM	VINYL WALL COVER MASTIC
EXTERIOR	WINDOW CAULKING
KITCHEN, RESTROOM, AND SNACK BAR	VINYL SHEETING
KITCHEN, RESTROOM, AND SNACK BAR	VINYL SHEETING BACKING PAPER/MASTIC
MAIN MECHANICAL ROOM (BOILER ROOM), ELECTRICAL PANEL ROOM, AND FURNACE ROOMS	SMOOTH WALL MISCELLANEOUS
MAIN MECHANICAL ROOM, STAGE, FOOD STORAGE ROOM, BAND ROOM MECHANICAL ROOM, AND ALL ADMIN OFFICES	FIRE DOOR CORE INSULATION
ONE RESTROOM, FOOD STORAGE ROOM, AND KITCHEN	VINYL FLOOR TILE
ONE RESTROOM, FOOD STORAGE ROOM, AND KITCHEN	VINYL FLOOR TILE MASTIC
STAFF LOUNGE, NURSES' ROOM, AND SNACK BAR	SINK UNDERCOATING
STAGE, KITCHEN, STORAGE ROOM, BAND ROOM, RESTROOMS, AND HALLWAY OFFICES	SMOOTH WALL MISCELLANEOUS

SURFACING MATERIAL

MAIN MECHANICAL ROOM (BOILER ROOM), ELECTRICAL PANEL ROOM, AND FURNACE ROOMS	SMOOTH WALL SURFACING
SNACK BAR, AND ATTIC AREA	SPRAY ON CEILING
STAGE, KITCHEN, STORAGE ROOM, BAND ROOM, RESTROOMS, AND HALLWAY OFFICES	SMOOTH WALL SURFACING
WOOD WALLS, EXTERIOR UPPER LEVEL OVERHANG, AND COVERED WALKWAY	ROUGH CEILING
WOOD WALLS, UPPER LEVEL OVERHANG, AND COVERED WALKWAY	ROUGH CEILING SURFACING

THERMAL SYSTEM INSULATION

ATTIC / PLENUM	PIPE FITTING INSULATION
EXTERIOR OVERHANG (SOUTH SIDE)	PIPE FITTING INSULATION

CLASSROOMS 01-03 AND RESTROOMS BUILDING (BUILDING A)

MISCELLANEOUS MATERIAL

CLASSROOMS 01-03, RESTROOMS, BOILER ROOM, AND STORAGE ROOM	SMOOTH WALL MISCELLANEOUS
CLASSROOMS 1-3	SINK UNDERCOATING
ENTIRE BUILDING	FIRE DOOR CORE INSULATION
EXTERIOR WINDOWS	WINDOW CAULKING

SURFACING MATERIAL

CLASSROOMS 01-03	SPRAY ON CEILING
CLASSROOMS 01-03, RESTROOMS, BOILER ROOM, AND STORAGE ROOM MECHANICAL ROOM, AND TWO STAFF RESTROOMS	SMOOTH WALL SURFACING
MECHANICAL ROOM, AND TWO STAFF RESTROOMS	PLASTER WALL
OVERHANG NEXT TO RESTROOMS	PLASTER WALL SURFACING
OVERHANG NEXT TO RESTROOMS	ROUGH CEILING
OVERHANG NEXT TO RESTROOMS	ROUGH CEILING SURFACING

HOMOGENEOUS MATERIALS IN PIEDMONT MIDDLE SCHOOL

BUILDING NAME		MATERIAL CATEGORY		LOCATION		MATERIAL TYPE	
CLASSROOMS 04-09 BUILDING (BUILDING B)							
MISCELLANEOUS MATERIAL							
CLASSROOM 9				FIRE DOOR CORE INSULATION			
CLASSROOMS 4-9				SINK UNDERCOATING			
CLASSROOMS 4-9				SMOOTH WALL			
				MISCELLANEOUS			
EXTERIOR WINDOWS ON NORTH AND SOUTH SIDE				WINDOW CAULKING			
MECHANICAL ROOM B10 BY CLASSROOM 04				SMOOTH WALL			
				MISCELLANEOUS			
SURFACING MATERIAL							
CLASSROOMS 4-9				SMOOTH WALL SURFACING			
CLASSROOMS 4-9				SPRAY ON CEILING			
CLASSROOMS 10-12 BUILDING (BUILDING C)							
MISCELLANEOUS MATERIAL							
BOOK ROOM				FIRE DOOR CORE INSULATION			
CLASSROOMS 10-12				SINK UNDERCOATING			
CLASSROOMS 10-12				SMOOTH WALL			
				MISCELLANEOUS			
EXTERIOR WINDOWS (NORTH AND SOUTH SIDES)				WINDOW CAULKING			
SURFACING MATERIAL							
BOOK / SUPPLIES ROOM				PLASTER WALL			
BOOK / SUPPLIES ROOM				PLASTER WALL SURFACING			
CLASSROOMS 10-12				SMOOTH WALL SURFACING			
CLASSROOMS 10-12				SPRAY ON CEILING			
CLASSROOMS 13-15 AND RESTROOMS BUILDING (BUILDING D)							
MISCELLANEOUS MATERIAL							
CLASSROOMS 13-15				SINK UNDERCOATING			
CLASSROOMS 13-15, AND TWO RESTROOMS				SMOOTH WALL			
				MISCELLANEOUS			
ENTIRE BUILDING				FIRE DOOR CORE INSULATION			
EXTERIOR WINDOWS (EAST AND WEST SIDES)				WINDOW CAULKING			
SURFACING MATERIAL							
BOILER ROOM, AND TWO STAFF RESTROOMS				PLASTER WALL			
BOILER ROOM, AND TWO STAFF RESTROOMS				PLASTER WALL SURFACING			
CLASSROOMS 13-15				SPRAY ON CEILING			
CLASSROOMS 13-15, AND TWO RESTROOMS				SMOOTH WALL SURFACING			
COVERED WALKWAY / OVERHANG				ROUGH CEILING			
COVERED WALKWAY / OVERHANG				ROUGH CEILING SURFACING			
CLASSROOMS 16-18 BUILDING (BUILDING F)							

HOMOGENEOUS MATERIALS IN PIEDMONT MIDDLE SCHOOL

BUILDING NAME		
MATERIAL CATEGORY	LOCATION	MATERIAL TYPE
MISCELLANEOUS MATERIAL		
	ALL CLASSROOMS, BOILER ROOM, AND STORAGE ROOM	SMOOTH WALL MISCELLANEOUS
	BOILER ROOM	FIRE DOOR CORE INSULATION
	CLASSROOMS 16-18	WINDOW CAULKING
SURFACING MATERIAL		
	ALL CLASSROOMS, BOILER ROOM, AND STORAGE ROOM	SMOOTH WALL SURFACING
CLASSROOMS 19-23 BUILDING (BUILDING G)		
MISCELLANEOUS MATERIAL		
	CLASSROOMS 19 AND 20	VINYL WALL COVER MASTIC
	CLASSROOMS 19-23	MORTAR MISCELLANEOUS
	CLASSROOMS 19-23, MECHANICAL ROOM, AND CUSTODIAL ROOM	SMOOTH WALL MISCELLANEOUS
	CLASSROOMS 22 AND 23	SINK UNDERCOATING
	CUSTODIAN ROOM, AND BOILER ROOM	FIRE DOOR CORE INSULATION
	SPEECH ROOM, AND READING ROOM	WALL TILE
	SPEECH ROOM, AND READING ROOM	WALL TILE MASTIC
SURFACING MATERIAL		
	CLASSROOMS 19-23, MECHANICAL ROOM, AND CUSTODIAL ROOM	SMOOTH WALL SURFACING
	COVERED WALKWAY / OVERHANG	ROUGH CEILING
	COVERED WALKWAY / OVERHANG	ROUGH CEILING SURFACING
CLASSROOMS 24-37 - FLEXIBLE INSTRUCTIONAL SPACE (BUILDING I)		
MISCELLANEOUS MATERIAL		
	CLASSROOM 25 (STORAGE), LIBRARY OFFICE, AND CLASSROOMS 32 & 34	SINK UNDERCOATING
	CLASSROOMS 24, 25, 32, AND 34	MORTAR MISCELLANEOUS
	ENTIRE BUILDING (INCLUDING RESTROOMS)	SMOOTH WALL MISCELLANEOUS
	FURNACE CLOSET	BASEBOARD MASTIC
	KILN ROOM	KILN BRICK
	LIBRARY SECTION OF THE BUILDING	WINDOW CAULKING
	MECHANICAL ROOM AT REAR OF CLASSROOM 25	CEMENTITIOUS PIPE/FLUE
	ROOMS 33, 34, AND 36 (BAND ROOM)	CEILING TILE
	ROOMS 33, 34, AND 36 (BAND ROOM)	CEILING TILE MASTIC
	SHOP, ALL CLASSROOMS, AND LIBRARY	VINYL FLOOR TILE MASTIC
	SHOP, AND ALL CLASSROOMS, AND LIBRARY	VINYL FLOOR TILE
	STORAGE CLOSETS, AND TWO MECHANICAL ROOMS	FIRE DOOR CORE INSULATION
	STUDENT RESTROOMS (2)	MORTAR MISCELLANEOUS
	STUDENT RESTROOMS (2)	MORTAR MISCELLANEOUS

HOMOGENEOUS MATERIALS IN PIEDMONT MIDDLE SCHOOL

BUILDING NAME		
MATERIAL CATEGORY	LOCATION	MATERIAL TYPE
SURFACING MATERIAL		
	ENTIRE BUILDING (INCLUDING RESTROOMS)	SMOOTH WALL SURFACING
	EXTERIOR OVERHANG	ROUGH CEILING
	EXTERIOR OVERHANG	ROUGH CEILING SURFACING
CLASSROOMS P1, P4-P5 PORTABLES BUILDINGS		
MISCELLANEOUS MATERIAL		
	CLASSROOMS P1, P4-P5 PORTABLE BUILDINGS	PORTABLE BUILDING
CLASSROOMS P2 (BUILDING M)-P3 (BUILDING N) PORTABLE BUILDINGS		
MISCELLANEOUS MATERIAL		
	PORTABLE P2	PRESSED WOOD WALL PANEL
	PORTABLES P2	PRESSED WOOD WALL PANEL MASTIC
	PORTABLES P2	VINYL WALL COVER MASTIC
GREEN HOUSE		
MISCELLANEOUS MATERIAL		
	GREEN HOUSE ECHO LAB	PERMANENT BUILDING
GYM BUILDING (BUILDING E)		
MISCELLANEOUS MATERIAL		
	BOILER ROOM	FIRE DOOR CORE INSULATION
	BOILER ROOM, COACHES OFFICE, STORAGE ROOMS, GYM, BOYS' LOCKER ROOM AND GIRLS' LOCKER ROOM	SMOOTH WALL
	BOYS' AND GIRLS' SHOWERS, AND COACHES RESTROOMS	MISCELLANEOUS
	BOYS' AND GIRLS' SHOWERS, AND COACHES RESTROOMS	MORTAR MISCELLANEOUS
	GYM	MORTAR MISCELLANEOUS
	GYM	CEILING PANEL
	GYM	CEILING PANEL MASTIC
	GYM	VINYL SHEETING
	GYM	VINYL SHEETING BACKING PAPER/MASTIC
SURFACING MATERIAL		
	BOILER ROOM, COACHES OFFICE, STORAGE ROOMS, GYM, BOYS' LOCKER ROOM AND GIRLS' LOCKER ROOM	SMOOTH WALL SURFACING
	BOYS' AND GIRLS' SHOWERS AND LOCKER ROOMS	PLASTER WALL
	BOYS' AND GIRLS' SHOWERS AND LOCKER ROOMS	PLASTER WALL SURFACING
	EXTERIOR WALLS	ROUGH WALL SURFACING
	EXTERIOR WALLS AND OVERHANGS	ROUGH WALL
THERMAL SYSTEM INSULATION		
	ATTIC AREA OF BOYS AND GIRLS LOCKER ROOMS	PIPE FITTING INSULATION
LANCER GYM (BUILDING L)		

HOMOGENEOUS MATERIALS IN
PIEDMONT MIDDLE SCHOOL

BUILDING NAME		MATERIAL TYPE
MATERIAL CATEGORY		
LOCATION		

MISCELLANEOUS MATERIAL	
LANCER GYM	PERMANENT BUILDING

STORAGE CONTAINERS

MISCELLANEOUS MATERIAL	
METAL STORAGE CONTAINERS (3 EA)	STORAGE CONTAINER

WOOD SHED

MISCELLANEOUS MATERIAL	
WOOD STORAGE BUILDING	STORAGE BUILDING

End Of Report, Total Of 5 Pages

FRIABLE LOCATIONS IN PIEDMONT MIDDLE SCHOOL

BUILDING NAME			
LOCATION		QTY	ASBESTOS
MATERIAL TYPE		(APPROXIMATE)	CONTENT
ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDINGS J&K)			
ATTIC / PLENUM			
PIPE FITTING INSULATION		10 LF	Assumed
CHOIR ROOM			
CEILING TILE		1,000 SF	Assumed
EXTERIOR			
WINDOW CAULKING		78 LF	Assumed
KITCHEN, RESTROOM, AND SNACK BAR			
VINYL SHEETING		1,030 SF	Assumed
KITCHEN, RESTROOM, AND SNACK BAR			
VINYL SHEETING BACKING PAPER/MASTIC		1,030 SF	Assumed
MAIN MECHANICAL ROOM (BOILER ROOM), ELECTRICAL PANEL ROOM, AND FURNACE ROOMS			
SMOOTH WALL MISCELLANEOUS		3,000 SF	Assumed
MAIN MECHANICAL ROOM (BOILER ROOM), ELECTRICAL PANEL ROOM, AND FURNACE ROOMS			
SMOOTH WALL SURFACING		3,000 SF	Assumed
MAIN MECHANICAL ROOM, STAGE, FOOD STORAGE ROOM, BAND ROOM MECHANICAL ROOM, AND ALL ADMIN OFFICES			
FIRE DOOR CORE INSULATION		1,008 SF	Assumed
ONE RESTROOM, FOOD STORAGE ROOM, AND KITCHEN			
VINYL FLOOR TILE		200 SF	Assumed
ONE RESTROOM, FOOD STORAGE ROOM, AND KITCHEN			
VINYL FLOOR TILE MASTIC		200 SF	Assumed
SNACK BAR, AND ATTIC AREA			
SPRAY ON CEILING		220 SF	Assumed
STAGE, KITCHEN, STORAGE ROOM, BAND ROOM, RESTROOMS, AND HALLWAY OFFICES			
SMOOTH WALL MISCELLANEOUS		19,800 SF	Assumed
STAGE, KITCHEN, STORAGE ROOM, BAND ROOM, RESTROOMS, AND HALLWAY OFFICES			
SMOOTH WALL SURFACING		19,800 SF	Assumed
WOOD WALLS, EXTERIOR UPPER LEVEL OVERHANG, AND COVERED WALKWAY			
ROUGH CEILING		3,100 SF	Assumed
WOOD WALLS, UPPER LEVEL OVERHANG, AND COVERED WALKWAY			
ROUGH CEILING SURFACING		3,200 SF	Assumed

FRIABLE LOCATIONS IN PIEDMONT MIDDLE SCHOOL

BUILDING NAME	LOCATION	QTY (APPROXIMATE)	ASBESTOS CONTENT
MATERIAL TYPE			
CLASSROOMS 01-03 AND RESTROOMS BUILDING (BUILDING A)			
CLASSROOMS 01-03, RESTROOMS, BOILER ROOM, AND STORAGE ROOM	SMOOTH WALL MISCELLANEOUS	15,115 SF	Assumed
CLASSROOMS 01-03, RESTROOMS, BOILER ROOM, AND STORAGE ROOM	SMOOTH WALL SURFACING	12,235 SF	Assumed
ENTIRE BUILDING	FIRE DOOR CORE INSULATION	147 SF	Assumed
EXTERIOR WINDOWS	WINDOW CAULKING	300 LF	Assumed
MECHANICAL ROOM, AND TWO STAFF RESTROOMS	PLASTER WALL	2,600 SF	Assumed
MECHANICAL ROOM, AND TWO STAFF RESTROOMS	PLASTER WALL SURFACING	2,600 SF	Assumed
CLASSROOMS 04-09 BUILDING (BUILDING B)			
CLASSROOM 9	FIRE DOOR CORE INSULATION	189 SF	Assumed
CLASSROOMS 4-9	SPRAY ON CEILING	5,760 SF	Assumed
EXTERIOR WINDOWS ON NORTH AND SOUTH SIDE	WINDOW CAULKING	500 LF	Assumed
MECHANICAL ROOM B10 BY CLASSROOM 04	SMOOTH WALL MISCELLANEOUS	600 SF	Assumed
CLASSROOMS 10-12 BUILDING (BUILDING C)			
BOOK ROOM	FIRE DOOR CORE INSULATION	126 SF	Assumed
BOOK / SUPPLIES ROOM	PLASTER WALL	1,250 SF	Assumed
BOOK / SUPPLIES ROOM	PLASTER WALL SURFACING	1,250 SF	Assumed
CLASSROOMS 10-12	SMOOTH WALL SURFACING	8,500 SF	Assumed
CLASSROOMS 10-12	SPRAY ON CEILING	2,880 SF	Assumed
EXTERIOR WINDOWS (NORTH AND SOUTH SIDES)	WINDOW CAULKING	300 LF	Assumed

FRIABLE LOCATIONS IN PIEDMONT MIDDLE SCHOOL

BUILDING NAME	LOCATION	QTY (APPROXIMATE)	ASBESTOS CONTENT
	MATERIAL TYPE		
CLASSROOMS 13-15 AND RESTROOMS BUILDING (BUILDING D)			
	BOILER ROOM, AND TWO STAFF RESTROOMS PLASTER WALL	2,600 SF	Assumed
	BOILER ROOM, AND TWO STAFF RESTROOMS PLASTER WALL SURFACING	2,600 SF	Assumed
	CLASSROOMS 13-15 SPRAY ON CEILING	2,880 SF	Assumed
	CLASSROOMS 13-15, AND TWO RESTROOMS SMOOTH WALL MISCELLANEOUS	12,615 SF	Assumed
	CLASSROOMS 13-15, AND TWO RESTROOMS SMOOTH WALL SURFACING	9,735 SF	Assumed
	ENTIRE BUILDING FIRE DOOR CORE INSULATION	147 SF	Assumed
	EXTERIOR WINDOWS (EAST AND WEST SIDES) WINDOW CAULKING	300 LF	Assumed
CLASSROOMS 16-18 BUILDING (BUILDING F)			
	ALL CLASSROOMS, BOILER ROOM, AND STORAGE ROOM SMOOTH WALL MISCELLANEOUS	8,100 SF	Assumed
	ALL CLASSROOMS, BOILER ROOM, AND STORAGE ROOM SMOOTH WALL SURFACING	8,100 SF	Assumed
	BOILER ROOM FIRE DOOR CORE INSULATION	147 SF	Assumed
	CLASSROOMS 16-18 WINDOW CAULKING	72 LF	Assumed
CLASSROOMS 19-23 BUILDING (BUILDING G)			
	CLASSROOMS 19-23 MORTAR MISCELLANEOUS	720 SF	Assumed
	CLASSROOMS 19-23, MECHANICAL ROOM, AND CUSTODIAL ROOM SMOOTH WALL MISCELLANEOUS	11,490 SF	Assumed
	CLASSROOMS 19-23, MECHANICAL ROOM, AND CUSTODIAL ROOM SMOOTH WALL SURFACING	11,490 SF	Assumed
	CUSTODIAN ROOM, AND BOILER ROOM FIRE DOOR CORE INSULATION	42 SF	Assumed
	SPEECH ROOM, AND READING ROOM WALL TILE	640 SF	Assumed

FRIABLE LOCATIONS IN PIEDMONT MIDDLE SCHOOL

BUILDING NAME	LOCATION	QTY (APPROXIMATE)	ASBESTOS CONTENT
	MATERIAL TYPE		
	SPEECH ROOM, AND READING ROOM WALL TILE MASTIC	640 SF	Assumed
CLASSROOMS 24-37 - FLEXIBLE INSTRUCTIONAL SPACE (BUILDING I)			
	CLASSROOMS 24, 25, 32, AND 34 MORTAR MISCELLANEOUS	415 SF	Assumed
	ENTIRE BUILDING (INCLUDING RESTROOMS) SMOOTH WALL MISCELLANEOUS	35,800 SF	Assumed
	ENTIRE BUILDING (INCLUDING RESTROOMS) SMOOTH WALL SURFACING	35,500 SF	Assumed
	KILN ROOM KILN BRICK	80 SF	Assumed
	LIBRARY SECTION OF THE BUILDING WINDOW CAULKING	240 LF	Assumed
	MECHANICAL ROOM AT REAR OF CLASSROOM 25 CEMENTITIOUS PIPE/FLUE	1 LF	Assumed
	ROOMS 33, 34, AND 36 (BAND ROOM) CEILING TILE	4,426 SF	Assumed
	ROOMS 33, 34, AND 36 (BAND ROOM) CEILING TILE MASTIC	4,426 SF	Assumed
	STORAGE CLOSETS, AND TWO MECHANICAL ROOMS FIRE DOOR CORE INSULATION	126 SF	Assumed
CLASSROOMS P2 (BUILDING M)-P3 (BUILDING N) PORTABLE BUILDINGS			
	PORTABLE P2 PRESSED WOOD WALL PANEL	1,800 SF	Assumed
GYM BUILDING (BUILDING E)			
	ATTIC AREA OF BOYS AND GIRLS LOCKER ROOMS PIPE FITTING INSULATION	35 LF	Assumed
	BOILER ROOM FIRE DOOR CORE INSULATION	42 SF	Assumed
	BOILER ROOM, COACHES OFFICE, STORAGE ROOMS, GYM, BOYS' LOCKER ROOM AND GIRLS' LOCKER ROOM SMOOTH WALL SURFACING	10,400 SF	Assumed
	BOYS' AND GIRLS' SHOWERS, AND COACHES RESTROOMS MORTAR MISCELLANEOUS	700 SF	Assumed
	BOYS' AND GIRLS' SHOWERS AND LOCKER ROOMS PLASTER WALL	4,320 SF	Assumed

**FRIABLE LOCATIONS IN
PIEDMONT MIDDLE SCHOOL**

BUILDING NAME			
LOCATION		QTY	ASBESTOS
MATERIAL TYPE		(APPROXIMATE)	CONTENT
BOYS' AND GIRLS' SHOWERS AND LOCKER ROOMS			
PLASTER WALL SURFACING		4,320 SF	Assumed
GYM			
VINYL SHEETING BACKING PAPER/MASTIC		1,683 SF	Assumed
End Of Report, Total Of 5 Pages			

Non- Friable Locations In Piedmont Middle School

BUILDING NAME			
LOCATION		QTY	ASBESTOS
MATERIAL TYPE		(APPROXIMATE)	CONTENT
ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDINGS J&K)			
CHOIR ROOM			
CEILING TILE MASTIC		1,000 SF	Assumed
COUNSELOR'S ROOM			
VINYL WALL COVER		100 SF	Assumed
COUNSELOR'S ROOM			
VINYL WALL COVER MASTIC		100 SF	Assumed
EXTERIOR OVERHANG (SOUTH SIDE)			
PIPE FITTING INSULATION		8 SF	Assumed
STAFF LOUNGE, NURSES' ROOM, AND SNACK BAR			
SINK UNDERCOATING		15 SF	Assumed
CLASSROOMS 01-03 AND RESTROOMS BUILDING (BUILDING A)			
CLASSROOMS 01-03			
SPRAY ON CEILING		2,880 SF	Assumed
CLASSROOMS 1-3			
SINK UNDERCOATING		12 SF	Assumed
OVERHANG NEXT TO RESTROOMS			
ROUGH CEILING		2,000 SF	Assumed
OVERHANG NEXT TO RESTROOMS			
ROUGH CEILING SURFACING		2,000 SF	Assumed
CLASSROOMS 04-09 BUILDING (BUILDING B)			
CLASSROOMS 4-9			
SINK UNDERCOATING		24 SF	Assumed
CLASSROOMS 4-9			
SMOOTH WALL MISCELLANEOUS		20,430 SF	Assumed
CLASSROOMS 4-9			
SMOOTH WALL SURFACING		14,670 SF	Assumed
CLASSROOMS 10-12 BUILDING (BUILDING C)			
CLASSROOMS 10-12			
SINK UNDERCOATING		18 SF	Assumed
CLASSROOMS 10-12			
SMOOTH WALL MISCELLANEOUS		11,380 SF	Assumed
CLASSROOMS 13-15 AND RESTROOMS BUILDING (BUILDING D)			
CLASSROOMS 13-15			
SINK UNDERCOATING		18 SF	Assumed
COVERED WALKWAY / OVERHANG			
ROUGH CEILING		2,000 SF	Assumed
COVERED WALKWAY / OVERHANG			
ROUGH CEILING SURFACING		2,000 SF	Assumed

Non- Friable Locations In Piedmont Middle School

BUILDING NAME			
LOCATION		QTY	ASBESTOS
MATERIAL TYPE		(APPROXIMATE)	CONTENT
CLASSROOMS 19-23 BUILDING (BUILDING G)			
CLASSROOMS 19 AND 20			
VINYL WALL COVER MASTIC		1,100 SF	Assumed
CLASSROOMS 22 AND 23			
SINK UNDERCOATING		9 SF	Assumed
COVERED WALKWAY / OVERHANG			
ROUGH CEILING		1,600 SF	Assumed
COVERED WALKWAY / OVERHANG			
ROUGH CEILING SURFACING		1,600 SF	Assumed
CLASSROOMS 24-37 - FLEXIBLE INSTRUCTIONAL SPACE (BUILDING I)			
CLASSROOM 25 (STORAGE), LIBRARY OFFICE, AND CLASSROOMS 32 & 34			
SINK UNDERCOATING		60 SF	Assumed
EXTERIOR OVERHANG			
ROUGH CEILING		100 SF	Assumed
EXTERIOR OVERHANG			
ROUGH CEILING SURFACING		100 SF	Assumed
FURNACE CLOSET			
BASEBOARD MASTIC		20 LF	Assumed
SHOP, ALL CLASSROOMS, AND LIBRARY			
VINYL FLOOR TILE MASTIC		10,158 SF	Assumed
SHOP, AND ALL CLASSROOMS, AND LIBRARY			
VINYL FLOOR TILE		10,158 SF	Assumed
STUDENT RESTROOMS (2)			
MORTAR MISCELLANEOUS		280 SF	Assumed
STUDENT RESTROOMS (2)			
MORTAR MISCELLANEOUS		680 SF	Assumed
CLASSROOMS P2 (BUILDING M)-P3 (BUILDING N) PORTABLE BUILDINGS			
PORTABLES P2			
PRESSED WOOD WALL PANEL MASTIC		3,600 SF	Assumed
PORTABLES P2			
VINYL WALL COVER MASTIC		1,800 SF	Assumed
GYM BUILDING (BUILDING E)			
BOILER ROOM, COACHES OFFICE, STORAGE ROOMS, GYM, BOYS' LOCKER ROOM AND GIRLS' LOCKER ROOM			
SMOOTH WALL MISCELLANEOUS		10,400 SF	Assumed
BOYS' AND GIRLS' SHOWERS, AND COACHES RESTROOMS			
MORTAR MISCELLANEOUS		320 SF	Assumed
EXTERIOR WALLS			
ROUGH WALL SURFACING		8,300 SF	Assumed
EXTERIOR WALLS AND OVERHANGS			
ROUGH WALL		8,300 SF	Assumed
GYM			
CEILING PANEL		2,900 SF	Assumed

S=Sq. Ft, l=Inches, L=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

**Non- Friable Locations In
PIEDMONT MIDDLE SCHOOL**

BUILDING NAME			
LOCATION		QTY	ASBESTOS
MATERIAL TYPE		(APPROXIMATE)	CONTENT
GYM	CEILING PANEL MASTIC	2,900 SF	Assumed
GYM	VINYL SHEETING	1,683 SF	Assumed
End Of Report, Total Of 3 Pages			

RECOMMENDATIONS FOR
PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDINGS J&K)

ATTIC / PLENUM

PIPE FITTING INSULATION

10 LF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CHOIR ROOM

CEILING TILE

1,000 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CHOIR ROOM

CEILING TILE MASTIC

1,000 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

COUNSELOR'S ROOM

VINYL WALL COVER

100 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR
PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

COUNSELOR'S ROOM

VINYL WALL COVER MASTIC

100 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

EXTERIOR

WINDOW CAULKING

78 LF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

EXTERIOR OVERHANG (SOUTH SIDE)

PIPE FITTING INSULATION

8 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

KITCHEN, RESTROOM, AND SNACK BAR

VINYL SHEETING

1,030 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

KITCHEN, RESTROOM, AND SNACK BAR

VINYL SHEETING BACKING PAPER/MASTIC

1,030 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

MAIN MECHANICAL ROOM (BOILER ROOM), ELECTRICAL PANEL ROOM, AND FURNACE ROOMS

SMOOTH WALL MISCELLANEOUS

3,000 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

MAIN MECHANICAL ROOM (BOILER ROOM), ELECTRICAL PANEL ROOM, AND FURNACE ROOMS

SMOOTH WALL SURFACING

3,000 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

MAIN MECHANICAL ROOM, STAGE, FOOD STORAGE ROOM, BAND ROOM MECHANICAL ROOM, AND ALL ADMIN OFFICES

FIRE DOOR CORE INSULATION

1,008 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR
PIEDMONT MIDDLE SCHOOL

BUILDING NAME**LOCATION****MATERIAL TYPE****RECOMMENDATION****QTY****(APPROXIMATE)**

ONE RESTROOM, FOOD STORAGE ROOM, AND KITCHEN**VINYL FLOOR TILE****200 SF**

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

ONE RESTROOM, FOOD STORAGE ROOM, AND KITCHEN**VINYL FLOOR TILE MASTIC****200 SF**

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

SNACK BAR, AND ATTIC AREA**SPRAY ON CEILING****220 SF**

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

STAFF LOUNGE, NURSES' ROOM, AND SNACK BAR**SINK UNDERCOATING****15 SF**

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.
-

RECOMMENDATIONS FOR
PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

STAGE, KITCHEN, STORAGE ROOM, BAND ROOM, RESTROOMS, AND HALLWAY OFFICES

SMOOTH WALL MISCELLANEOUS

19,800 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

STAGE, KITCHEN, STORAGE ROOM, BAND ROOM, RESTROOMS, AND HALLWAY OFFICES

SMOOTH WALL SURFACING

19,800 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

WOOD WALLS, EXTERIOR UPPER LEVEL OVERHANG, AND COVERED WALKWAY

ROUGH CEILING

3,100 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

WOOD WALLS, UPPER LEVEL OVERHANG, AND COVERED WALKWAY

ROUGH CEILING SURFACING

3,200 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

CLASSROOMS 01-03 AND RESTROOMS BUILDING (BUILDING A)

CLASSROOMS 01-03

SPRAY ON CEILING 2,880 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOMS 01-03, RESTROOMS, BOILER ROOM, AND STORAGE ROOM

SMOOTH WALL MISCELLANEOUS 15,115 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOMS 01-03, RESTROOMS, BOILER ROOM, AND STORAGE ROOM

SMOOTH WALL SURFACING 12,235 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOMS 1-3

SINK UNDERCOATING 12 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR
PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

ENTIRE BUILDING

FIRE DOOR CORE INSULATION

147 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

EXTERIOR WINDOWS

WINDOW CAULKING

300 LF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

MECHANICAL ROOM, AND TWO STAFF RESTROOMS

PLASTER WALL

2,600 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

MECHANICAL ROOM, AND TWO STAFF RESTROOMS

PLASTER WALL SURFACING

2,600 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR
PIEDMONT MIDDLE SCHOOL

BUILDING NAME**LOCATION****MATERIAL TYPE****RECOMMENDATION****QTY****(APPROXIMATE)**

OVERHANG NEXT TO RESTROOMS**ROUGH CEILING****2,000 SF**

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

OVERHANG NEXT TO RESTROOMS**ROUGH CEILING SURFACING****2,000 SF**

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOMS 04-09 BUILDING (BUILDING B)

CLASSROOM 9**FIRE DOOR CORE INSULATION****189 SF**

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOMS 4-9**SINK UNDERCOATING****24 SF**

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

CLASSROOMS 4-9

SMOOTH WALL MISCELLANEOUS

20,430 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOMS 4-9

SMOOTH WALL SURFACING

14,670 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOMS 4-9

SPRAY ON CEILING

5,760 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

EXTERIOR WINDOWS ON NORTH AND SOUTH SIDE

WINDOW CAULKING

500 LF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR
PIEDMONT MIDDLE SCHOOL

BUILDING NAME**LOCATION****MATERIAL TYPE****RECOMMENDATION****QTY****(APPROXIMATE)**

MECHANICAL ROOM B10 BY CLASSROOM 04

SMOOTH WALL MISCELLANEOUS

600 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOMS 10-12 BUILDING (BUILDING C)

BOOK ROOM

FIRE DOOR CORE INSULATION

126 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

BOOK / SUPPLIES ROOM

PLASTER WALL

1,250 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

BOOK / SUPPLIES ROOM

PLASTER WALL SURFACING

1,250 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

CLASSROOMS 10-12

SINK UNDERCOATING

18 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOMS 10-12

SMOOTH WALL MISCELLANEOUS

11,380 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOMS 10-12

SMOOTH WALL SURFACING

8,500 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOMS 10-12

SPRAY ON CEILING

2,880 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

EXTERIOR WINDOWS (NORTH AND SOUTH SIDES)

WINDOW CAULKING

300 LF

- (a) Sample the material. If ACM include this material in the Operations and Maintenance (O & M) manual. Maintain the material in an intact and undamaged condition
- (b) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

CLASSROOMS 13-15 AND RESTROOMS BUILDING (BUILDING D)

BOILER ROOM, AND TWO STAFF RESTROOMS

PLASTER WALL

2,600 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

BOILER ROOM, AND TWO STAFF RESTROOMS

PLASTER WALL SURFACING

2,600 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

CLASSROOMS 13-15

SINK UNDERCOATING

18 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

CLASSROOMS 13-15

SPRAY ON CEILING

2,880 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOMS 13-15, AND TWO RESTROOMS

SMOOTH WALL MISCELLANEOUS

12,615 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOMS 13-15, AND TWO RESTROOMS

SMOOTH WALL SURFACING

9,735 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

COVERED WALKWAY / OVERHANG

ROUGH CEILING

2,000 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

COVERED WALKWAY / OVERHANG

ROUGH CEILING SURFACING

2,000 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

ENTIRE BUILDING

FIRE DOOR CORE INSULATION

147 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

EXTERIOR WINDOWS (EAST AND WEST SIDES)

WINDOW CAULKING

300 LF

- (a) Sample the material. If ACM include this material in the Operations and Maintenance (O & M) manual. Maintain the material in an intact and undamaged condition
 - (b) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR PIEDMONT MIDDLE SCHOOL

BUILDING NAME	
LOCATION	
MATERIAL TYPE	QTY
RECOMMENDATION	(APPROXIMATE)

CLASSROOMS 16-18 BUILDING (BUILDING F)

ALL CLASSROOMS, BOILER ROOM, AND STORAGE ROOM

SMOOTH WALL MISCELLANEOUS 8,100 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

ALL CLASSROOMS, BOILER ROOM, AND STORAGE ROOM

SMOOTH WALL SURFACING 8,100 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

BOILER ROOM

FIRE DOOR CORE INSULATION 147 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOMS 16-18

WINDOW CAULKING 72 LF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

CLASSROOMS 19-23 BUILDING (BUILDING G)

CLASSROOMS 19 AND 20

VINYL WALL COVER MASTIC 1,100 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOMS 19-23

MORTAR MISCELLANEOUS 720 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOMS 19-23, MECHANICAL ROOM, AND CUSTODIAL ROOM

SMOOTH WALL MISCELLANEOUS 11,490 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CLASSROOMS 19-23, MECHANICAL ROOM, AND CUSTODIAL ROOM

SMOOTH WALL SURFACING 11,490 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR
PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

CLASSROOMS 22 AND 23

SINK UNDERCOATING

9 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

COVERED WALKWAY / OVERHANG

ROUGH CEILING

1,600 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

COVERED WALKWAY / OVERHANG

ROUGH CEILING SURFACING

1,600 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CUSTODIAN ROOM, AND BOILER ROOM

FIRE DOOR CORE INSULATION

42 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

SPEECH ROOM, AND READING ROOM

WALL TILE

640 SF

- (a) Sample the material. If ACM include this material in the Operations and Maintenance (O & M) manual. Maintain the material in an intact and undamaged condition
- (b) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

SPEECH ROOM, AND READING ROOM

WALL TILE MASTIC

640 SF

- (a) Sample the material. If ACM include this material in the Operations and Maintenance (O & M) manual. Maintain the material in an intact and undamaged condition
- (b) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

CLASSROOMS 24-37 - FLEXIBLE INSTRUCTIONAL SPACE (BUILDING I)

CLASSROOM 25 (STORAGE), LIBRARY OFFICE, AND CLASSROOMS 32 & 34

SINK UNDERCOATING

60 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

CLASSROOMS 24, 25, 32, AND 34

MORTAR MISCELLANEOUS

415 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

ENTIRE BUILDING (INCLUDING RESTROOMS)

SMOOTH WALL MISCELLANEOUS 35,800 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

ENTIRE BUILDING (INCLUDING RESTROOMS)

SMOOTH WALL SURFACING 35,500 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

EXTERIOR OVERHANG

ROUGH CEILING 100 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

EXTERIOR OVERHANG

ROUGH CEILING SURFACING 100 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR
PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

FURNACE CLOSET

BASEBOARD MASTIC

20 LF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

KILN ROOM

KILN BRICK

80 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

LIBRARY SECTION OF THE BUILDING

WINDOW CAULKING

240 LF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

MECHANICAL ROOM AT REAR OF CLASSROOM 25

CEMENTITIOUS PIPE/FLUE

1 LF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

ROOMS 33, 34, AND 36 (BAND ROOM)

CEILING TILE

4,426 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

ROOMS 33, 34, AND 36 (BAND ROOM)

CEILING TILE MASTIC

4,426 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

SHOP, ALL CLASSROOMS, AND LIBRARY

VINYL FLOOR TILE MASTIC

10,158 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

SHOP, AND ALL CLASSROOMS, AND LIBRARY

VINYL FLOOR TILE

10,158 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME**LOCATION****MATERIAL TYPE****RECOMMENDATION****QTY****(APPROXIMATE)**

STORAGE CLOSETS, AND TWO MECHANICAL ROOMS**FIRE DOOR CORE INSULATION****126 SF**

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

STUDENT RESTROOMS (2)**MORTAR MISCELLANEOUS****280 SF**

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

STUDENT RESTROOMS (2)**MORTAR MISCELLANEOUS****680 SF**

- (a) This is a replacement/new material.
 - (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
 - (c) This documentation is to be maintained with the District's AHERA records.
-

RECOMMENDATIONS FOR
PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

CLASSROOMS P1, P4-P5 PORTABLES BUILDINGS

CLASSROOMS P1, P4-P5 PORTABLE BUILDINGS

PORTABLE BUILDING

2,880 SF

- (a) This is a replacement/new material.
- (b) The district should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the district's AHERA records.

CLASSROOMS P2 (BUILDING M)-P3 (BUILDING N) PORTABLE BUILDINGS

PORTABLE P2

PRESSED WOOD WALL PANEL

1,800 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

PORTABLES P2

PRESSED WOOD WALL PANEL MASTIC

3,600 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR
PIEDMONT MIDDLE SCHOOL

BUILDING NAME**LOCATION****MATERIAL TYPE****RECOMMENDATION****QTY****(APPROXIMATE)**

PORTABLES P2

VINYL WALL COVER MASTIC

1,800 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

GREEN HOUSE

GREEN HOUSE ECHO LAB

PERMANENT BUILDING

270 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

GYM BUILDING (BUILDING E)

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

ATTIC AREA OF BOYS AND GIRLS LOCKER ROOMS

PIPE FITTING INSULATION

35 LF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

BOILER ROOM

FIRE DOOR CORE INSULATION

42 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

BOILER ROOM, COACHES OFFICE, STORAGE ROOMS, GYM, BOYS' LOCKER ROOM AND GIRLS' LOCKER ROOM

SMOOTH WALL MISCELLANEOUS

10,400 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

BOILER ROOM, COACHES OFFICE, STORAGE ROOMS, GYM, BOYS' LOCKER ROOM AND GIRLS' LOCKER ROOM

SMOOTH WALL SURFACING

10,400 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

BOYS' AND GIRLS' SHOWERS, AND COACHES RESTROOMS

MORTAR MISCELLANEOUS

700 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

BOYS' AND GIRLS' SHOWERS, AND COACHES RESTROOMS

MORTAR MISCELLANEOUS

320 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

BOYS' AND GIRLS' SHOWERS AND LOCKER ROOMS

PLASTER WALL

4,320 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

BOYS' AND GIRLS' SHOWERS AND LOCKER ROOMS

PLASTER WALL SURFACING

4,320 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

EXTERIOR WALLS

ROUGH WALL SURFACING

8,300 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR
PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

EXTERIOR WALLS AND OVERHANGS

ROUGH WALL

8,300 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

GYM

CEILING PANEL

2,900 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

GYM

CEILING PANEL MASTIC

2,900 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

GYM

VINYL SHEETING

1,683 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME**LOCATION****MATERIAL TYPE****RECOMMENDATION****QTY****(APPROXIMATE)**

GYM

VINYL SHEETING BACKING PAPER/MASTIC

1,683 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

LANCER GYM (BUILDING L)

LANCER GYM

PERMANENT BUILDING

8,775 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

STORAGE CONTAINERS

This material has been deemed as Non-Asbestos Containing Material (Non-ACM) by the AHERA accredited Inspector. No recommendations are necessary.

METAL STORAGE CONTAINERS (3 EA)

STORAGE CONTAINER

504 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR
PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

WOOD SHED

WOOD STORAGE BUILDING

STORAGE BUILDING

60 SF

- (a) This is a replacement/new material.
 - (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
 - (c) This documentation is to be maintained with the District's AHERA records.
-

End Of Report, Total Of 29 Pages

SAMPLES REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE No. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDINGS J&K)

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDINGS J&K)

ATTIC / PLENUM

PIPE FITTING INSULATION

<u>05-212AAA</u>	9/6/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDINGS J&K)

CHOIR ROOM

CEILING TILE

<u>05-212AAA</u>	9/6/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDINGS J&K)

CHOIR ROOM

CEILING TILE MASTIC

<u>05-212AAA</u>	9/6/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDINGS J&K)

COUNSELOR'S ROOM

VINYL WALL COVER

<u>11-202AAA</u>	11/30/2011	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	------------	----------	---------	-----------	----

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDINGS J&K)

COUNSELOR'S ROOM

VINYL WALL COVER MASTIC

<u>11-202AAA</u>	11/30/2011	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	------------	----------	---------	-----------	----

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDINGS J&K)

EXTERIOR

WINDOW CAULKING

<u>08-241AAA</u>	10/14/2008	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	------------	----------	---------	-----------	----

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDINGS J&K)

EXTERIOR OVERHANG (SOUTH SIDE)

PIPE FITTING INSULATION

<u>06-223AAA</u>	8/23/2006	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

SAMPLES REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDINGS J&K)

KITCHEN, RESTROOM, AND SNACK BAR

VINYL SHEETING

<u>05-212AAA</u>	9/6/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDINGS J&K)

KITCHEN, RESTROOM, AND SNACK BAR

VINYL SHEETING BACKING PAPER/MASTIC

<u>05-212AAA</u>	9/6/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDINGS J&K)

MAIN MECHANICAL ROOM (BOILER ROOM), ELECTRICAL PANEL ROOM, AND FURNACE ROOMS

SMOOTH WALL MISCELLANEOUS

<u>09-098AAA</u>	5/13/2009	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDINGS J&K)

MAIN MECHANICAL ROOM (BOILER ROOM), ELECTRICAL PANEL ROOM, AND FURNACE ROOMS

SMOOTH WALL SURFACING

<u>09-098AAA</u>	5/13/2009	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDINGS J&K)

MAIN MECHANICAL ROOM, STAGE, FOOD STORAGE ROOM, BAND ROOM MECHANICAL ROOM, AND ALL ADMIN OFFICES

FIRE DOOR CORE INSULATION

<u>05-212AAA</u>	9/6/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDINGS J&K)

ONE RESTROOM, FOOD STORAGE ROOM, AND KITCHEN

VINYL FLOOR TILE

<u>05-212AAA</u>	9/6/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDINGS J&K)

ONE RESTROOM, FOOD STORAGE ROOM, AND KITCHEN

VINYL FLOOR TILE MASTIC

<u>05-212AAA</u>	9/6/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

SAMPLES REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDINGS J&K)

SNACK BAR, AND ATTIC AREA
 SPRAY ON CEILING

<u>05-212AAA</u>	9/6/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDINGS J&K)

STAFF LOUNGE, NURSES' ROOM, AND SNACK BAR
 SINK UNDERCOATING

<u>11-202AAA</u>	11/30/2011	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	------------	----------	---------	-----------	----

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDINGS J&K)

STAGE, KITCHEN, STORAGE ROOM, BAND ROOM, RESTROOMS, AND HALLWAY OFFICES
 SMOOTH WALL MISCELLANEOUS

<u>05-212AAA</u>	9/6/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDINGS J&K)

STAGE, KITCHEN, STORAGE ROOM, BAND ROOM, RESTROOMS, AND HALLWAY OFFICES
 SMOOTH WALL SURFACING

<u>06-223AAA</u>	8/23/2006	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDINGS J&K)

WOOD WALLS, EXTERIOR UPPER LEVEL OVERHANG, AND COVERED WALKWAY
 ROUGH CEILING

<u>05-212AAA</u>	9/6/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDINGS J&K)

WOOD WALLS, UPPER LEVEL OVERHANG, AND COVERED WALKWAY
 ROUGH CEILING SURFACING

<u>05-212AAA</u>	9/6/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

SAMPLES REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE No. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

CLASSROOMS 01-03 AND RESTROOMS BUILDING (BUILDING A)

CLASSROOMS 01-03 AND RESTROOMS BUILDING (BUILDING A)

CLASSROOMS 01-03
 SPRAY ON CEILING

<u>05-212AAA</u>	9/6/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

CLASSROOMS 01-03 AND RESTROOMS BUILDING (BUILDING A)

CLASSROOMS 01-03, RESTROOMS, BOILER ROOM, AND STORAGE ROOM
 SMOOTH WALL MISCELLANEOUS

<u>05-212AAA</u>	9/6/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

CLASSROOMS 01-03 AND RESTROOMS BUILDING (BUILDING A)

CLASSROOMS 01-03, RESTROOMS, BOILER ROOM, AND STORAGE ROOM
 SMOOTH WALL SURFACING

<u>06-223AAA</u>	8/23/2006	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS 01-03 AND RESTROOMS BUILDING (BUILDING A)

CLASSROOMS 1-3
 SINK UNDERCOATING

<u>08-241AAA</u>	10/14/2008	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	------------	----------	---------	-----------	----

CLASSROOMS 01-03 AND RESTROOMS BUILDING (BUILDING A)

ENTIRE BUILDING
 FIRE DOOR CORE INSULATION

<u>05-212AAA</u>	9/6/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

CLASSROOMS 01-03 AND RESTROOMS BUILDING (BUILDING A)

EXTERIOR WINDOWS
 WINDOW CAULKING

<u>28-241AAA</u>	10/14/2008	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	------------	----------	---------	-----------	----

CLASSROOMS 01-03 AND RESTROOMS BUILDING (BUILDING A)

MECHANICAL ROOM, AND TWO STAFF RESTROOMS
 PLASTER WALL

<u>05-212AAA</u>	9/6/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

SAMPLES REPORT FOR
PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE No. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

CLASSROOMS 01-03 AND RESTROOMS BUILDING (BUILDING A)

MECHANICAL ROOM, AND TWO STAFF RESTROOMS

PLASTER WALL SURFACING

<u>05-215AAA</u>	9/6/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

CLASSROOMS 01-03 AND RESTROOMS BUILDING (BUILDING A)

OVERHANG NEXT TO RESTROOMS

ROUGH CEILING

<u>05-212AAA</u>	9/6/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

CLASSROOMS 01-03 AND RESTROOMS BUILDING (BUILDING A)

OVERHANG NEXT TO RESTROOMS

ROUGH CEILING SURFACING

<u>05-212AAA</u>	9/6/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

SAMPLES REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

CLASSROOMS 04-09 BUILDING (BUILDING B)

CLASSROOMS 04-09 BUILDING (BUILDING B)

CLASSROOM 9

FIRE DOOR CORE INSULATION

<u>08-075AAA</u>	4/17/2008	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS 04-09 BUILDING (BUILDING B)

CLASSROOMS 4-9

SINK UNDERCOATING

<u>08-241AAA</u>	10/14/2008	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	------------	----------	---------	-----------	----

CLASSROOMS 04-09 BUILDING (BUILDING B)

CLASSROOMS 4-9

SMOOTH WALL MISCELLANEOUS

<u>05-212AAA</u>	9/6/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

CLASSROOMS 04-09 BUILDING (BUILDING B)

CLASSROOMS 4-9

SMOOTH WALL SURFACING

<u>06-223AAA</u>	8/23/2006	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS 04-09 BUILDING (BUILDING B)

CLASSROOMS 4-9

SPRAY ON CEILING

<u>05-212AAA</u>	9/6/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

CLASSROOMS 04-09 BUILDING (BUILDING B)

EXTERIOR WINDOWS ON NORTH AND SOUTH SIDE

WINDOW CAULKING

<u>14-051AAA</u>	3/3/2014	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

CLASSROOMS 04-09 BUILDING (BUILDING B)

MECHANICAL ROOM B10 BY CLASSROOM 04

SMOOTH WALL MISCELLANEOUS

<u>13-182AAA</u>	9/25/2013	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

SAMPLES REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE No. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

CLASSROOMS 10-12 BUILDING (BUILDING C)

CLASSROOMS 10-12 BUILDING (BUILDING C)

BOOK ROOM

FIRE DOOR CORE INSULATION

<u>14-198AAA</u>	8/28/2014	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS 10-12 BUILDING (BUILDING C)

BOOK / SUPPLIES ROOM

PLASTER WALL

<u>06-223AAA</u>	8/23/2006	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS 10-12 BUILDING (BUILDING C)

BOOK / SUPPLIES ROOM

PLASTER WALL SURFACING

<u>06-223AAA</u>	8/23/2006	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS 10-12 BUILDING (BUILDING C)

CLASSROOMS 10-12

SINK UNDERCOATING

<u>11-202AAA</u>	11/30/2011	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	------------	----------	---------	-----------	----

CLASSROOMS 10-12 BUILDING (BUILDING C)

CLASSROOMS 10-12

SMOOTH WALL MISCELLANEOUS

<u>05-212AAA</u>	9/6/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

CLASSROOMS 10-12 BUILDING (BUILDING C)

CLASSROOMS 10-12

SMOOTH WALL SURFACING

<u>06-223AAA</u>	8/23/2006	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS 10-12 BUILDING (BUILDING C)

CLASSROOMS 10-12

SPRAY ON CEILING

<u>05-212AAA</u>	9/6/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

SAMPLES REPORT FOR
PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE NO.	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
COMMENTS					

CLASSROOMS 10-12 BUILDING (BUILDING C)

EXTERIOR WINDOWS (NORTH AND SOUTH SIDES)

WINDOW CAULKING

<u>09-098AAA</u>	5/13/2009	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

SAMPLES REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE No. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

CLASSROOMS 13-15 AND RESTROOMS BUILDING (BUILDING D)

CLASSROOMS 13-15 AND RESTROOMS BUILDING (BUILDING D)

BOILER ROOM, AND TWO STAFF RESTROOMS
 PLASTER WALL

<u>05-212AAA</u>	9/6/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

CLASSROOMS 13-15 AND RESTROOMS BUILDING (BUILDING D)

BOILER ROOM, AND TWO STAFF RESTROOMS
 PLASTER WALL SURFACING

<u>05-212AAA</u>	9/6/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

CLASSROOMS 13-15 AND RESTROOMS BUILDING (BUILDING D)

CLASSROOMS 13-15
 SINK UNDERCOATING

<u>11-202AAA</u>	11/30/2011	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	------------	----------	---------	-----------	----

CLASSROOMS 13-15 AND RESTROOMS BUILDING (BUILDING D)

CLASSROOMS 13-15
 SPRAY ON CEILING

<u>05-212AAA</u>	9/6/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

CLASSROOMS 13-15 AND RESTROOMS BUILDING (BUILDING D)

CLASSROOMS 13-15, AND TWO RESTROOMS
 SMOOTH WALL MISCELLANEOUS

<u>05-212AAA</u>	9/6/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

CLASSROOMS 13-15 AND RESTROOMS BUILDING (BUILDING D)

CLASSROOMS 13-15, AND TWO RESTROOMS
 SMOOTH WALL SURFACING

<u>06-223AAA</u>	8/23/2006	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS 13-15 AND RESTROOMS BUILDING (BUILDING D)

COVERED WALKWAY / OVERHANG
 ROUGH CEILING

<u>05-212AAA</u>	9/6/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

SAMPLES REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

CLASSROOMS 13-15 AND RESTROOMS BUILDING (BUILDING D)

COVERED WALKWAY / OVERHANG

ROUGH CEILING SURFACING

<u>05-212AAA</u>	9/6/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

CLASSROOMS 13-15 AND RESTROOMS BUILDING (BUILDING D)

ENTIRE BUILDING

FIRE DOOR CORE INSULATION

<u>22-025AAA</u>	2/16/2022	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS 13-15 AND RESTROOMS BUILDING (BUILDING D)

EXTERIOR WINDOWS (EAST AND WEST SIDES)

WINDOW CAULKING

<u>09-098AAA</u>	5/13/2009	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

SAMPLES REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE No. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

CLASSROOMS 16-18 BUILDING (BUILDING F)

CLASSROOMS 16-18 BUILDING (BUILDING F)

ALL CLASSROOMS, BOILER ROOM, AND STORAGE ROOM
SMOOTH WALL MISCELLANEOUS

<u>05-212AAA</u>	9/6/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

CLASSROOMS 16-18 BUILDING (BUILDING F)

ALL CLASSROOMS, BOILER ROOM, AND STORAGE ROOM
SMOOTH WALL SURFACING

<u>06-223AAA</u>	8/23/2006	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS 16-18 BUILDING (BUILDING F)

BOILER ROOM
FIRE DOOR CORE INSULATION

<u>05-212AAA</u>	9/6/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

CLASSROOMS 16-18 BUILDING (BUILDING F)

CLASSROOMS 16-18
WINDOW CAULKING

<u>08-241AAA</u>	10/14/2008	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	------------	----------	---------	-----------	----

SAMPLES REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE No. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

CLASSROOMS 19-23 BUILDING (BUILDING G)

CLASSROOMS 19-23 BUILDING (BUILDING G)

CLASSROOMS 19 AND 20

VINYL WALL COVER MASTIC

<u>11-202AAA</u>	11/30/2011	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	------------	----------	---------	-----------	----

CLASSROOMS 19-23 BUILDING (BUILDING G)

CLASSROOMS 19-23

MORTAR MISCELLANEOUS

<u>11-202AAA</u>	11/30/2011	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	------------	----------	---------	-----------	----

CLASSROOMS 19-23 BUILDING (BUILDING G)

CLASSROOMS 19-23, MECHANICAL ROOM, AND CUSTODIAL ROOM

SMOOTH WALL MISCELLANEOUS

<u>05-212AAA</u>	9/6/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

CLASSROOMS 19-23 BUILDING (BUILDING G)

CLASSROOMS 19-23, MECHANICAL ROOM, AND CUSTODIAL ROOM

SMOOTH WALL SURFACING

<u>06-223AAA</u>	8/23/2006	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS 19-23 BUILDING (BUILDING G)

CLASSROOMS 22 AND 23

SINK UNDERCOATING

<u>10-174AAA</u>	8/30/2010	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS 19-23 BUILDING (BUILDING G)

COVERED WALKWAY / OVERHANG

ROUGH CEILING

<u>12-185AAA</u>	10/10/2012	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	------------	----------	---------	-----------	----

CLASSROOMS 19-23 BUILDING (BUILDING G)

COVERED WALKWAY / OVERHANG

ROUGH CEILING SURFACING

<u>12-185AAA</u>	10/10/2012	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	------------	----------	---------	-----------	----

SAMPLES REPORT FOR
PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE No. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

CLASSROOMS 19-23 BUILDING (BUILDING G)

CUSTODIAN ROOM, AND BOILER ROOM

FIRE DOOR CORE INSULATION

<u>05-212AAA</u>	9/6/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

CLASSROOMS 19-23 BUILDING (BUILDING G)

SPEECH ROOM, AND READING ROOM

WALL TILE

<u>07-043AAA</u>	11/6/2007	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS 19-23 BUILDING (BUILDING G)

SPEECH ROOM, AND READING ROOM

WALL TILE MASTIC

<u>07-043AAA</u>	11/6/2007	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

SAMPLES REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

CLASSROOMS 24-37 - FLEXIBLE INSTRUCTIONAL SPACE (BUILDING I)

CLASSROOMS 24-37 - FLEXIBLE INSTRUCTIONAL SPACE (BUILDING I)

CLASSROOM 25 (STORAGE), LIBRARY OFFICE, AND CLASSROOMS 32 & 34
 SINK UNDERCOATING

<u>11-202AAA</u>	11/30/2011	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	------------	----------	---------	-----------	----

CLASSROOMS 24-37 - FLEXIBLE INSTRUCTIONAL SPACE (BUILDING I)

CLASSROOMS 24, 25, 32, AND 34
 MORTAR MISCELLANEOUS

<u>11-202AAA</u>	11/30/2011	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	------------	----------	---------	-----------	----

CLASSROOMS 24-37 - FLEXIBLE INSTRUCTIONAL SPACE (BUILDING I)

ENTIRE BUILDING (INCLUDING RESTROOMS)
 SMOOTH WALL MISCELLANEOUS

<u>05-212AAA</u>	9/6/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

CLASSROOMS 24-37 - FLEXIBLE INSTRUCTIONAL SPACE (BUILDING I)

ENTIRE BUILDING (INCLUDING RESTROOMS)
 SMOOTH WALL SURFACING

<u>06-223AAA</u>	8/23/2006	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS 24-37 - FLEXIBLE INSTRUCTIONAL SPACE (BUILDING I)

EXTERIOR OVERHANG
 ROUGH CEILING

<u>12-185AAA</u>	10/10/2012	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	------------	----------	---------	-----------	----

CLASSROOMS 24-37 - FLEXIBLE INSTRUCTIONAL SPACE (BUILDING I)

EXTERIOR OVERHANG
 ROUGH CEILING SURFACING

<u>12-185AAA</u>	10/10/2012	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	------------	----------	---------	-----------	----

CLASSROOMS 24-37 - FLEXIBLE INSTRUCTIONAL SPACE (BUILDING I)

FURNACE CLOSET
 BASEBOARD MASTIC

<u>09-098AAA</u>	5/13/2009	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

SAMPLES REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

CLASSROOMS 24-37 - FLEXIBLE INSTRUCTIONAL SPACE (BUILDING I)

KILN ROOM
 KILN BRICK

<u>08-241AAA</u>	10/14/2008	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	------------	----------	---------	-----------	----

CLASSROOMS 24-37 - FLEXIBLE INSTRUCTIONAL SPACE (BUILDING I)

LIBRARY SECTION OF THE BUILDING
 WINDOW CAULKING

<u>09-098AAA</u>	5/13/2009	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS 24-37 - FLEXIBLE INSTRUCTIONAL SPACE (BUILDING I)

MECHANICAL ROOM AT REAR OF CLASSROOM 25
 CEMENTITIOUS PIPE/FLUE

<u>09-098AAA</u>	5/13/2009	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

CLASSROOMS 24-37 - FLEXIBLE INSTRUCTIONAL SPACE (BUILDING I)

ROOMS 33, 34, AND 36 (BAND ROOM)
 CEILING TILE

<u>05-212AAA</u>	9/6/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

CLASSROOMS 24-37 - FLEXIBLE INSTRUCTIONAL SPACE (BUILDING I)

ROOMS 33, 34, AND 36 (BAND ROOM)
 CEILING TILE MASTIC

<u>05-212AAA</u>	9/6/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

CLASSROOMS 24-37 - FLEXIBLE INSTRUCTIONAL SPACE (BUILDING I)

SHOP, ALL CLASSROOMS, AND LIBRARY
 VINYL FLOOR TILE MASTIC

<u>05-212AAA</u>	9/6/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

CLASSROOMS 24-37 - FLEXIBLE INSTRUCTIONAL SPACE (BUILDING I)

SHOP, AND ALL CLASSROOMS, AND LIBRARY
 VINYL FLOOR TILE

<u>05-212AAA</u>	9/6/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

	9/6/2005	Positive	ASSUMED	NO SAMPLE	NS
--	----------	----------	---------	-----------	----

SAMPLES REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

CLASSROOMS 24-37 - FLEXIBLE INSTRUCTIONAL SPACE (BUILDING I)

STORAGE CLOSETS, AND TWO MECHANICAL ROOMS

FIRE DOOR CORE INSULATION

<u>05-212AAA</u>	9/6/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

CLASSROOMS 24-37 - FLEXIBLE INSTRUCTIONAL SPACE (BUILDING I)

STUDENT RESTROOMS (2)

MORTAR MISCELLANEOUS

<u>10-052AAA</u>	3/10/2010	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

Apparent New Material as of this date.

CLASSROOMS 24-37 - FLEXIBLE INSTRUCTIONAL SPACE (BUILDING I)

STUDENT RESTROOMS (2)

MORTAR MISCELLANEOUS

<u>10-052AAA</u>	3/10/2010	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

Apparent New Material as of this date.

SAMPLES REPORT FOR
PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE NO.	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
COMMENTS					

CLASSROOMS P1, P4-P5 PORTABLES BUILDINGS

CLASSROOMS P1, P4-P5 PORTABLES BUILDINGS

CLASSROOMS P1, P4-P5 PORTABLE BUILDINGS

PORTABLE BUILDING

05-212.NS

9/6/2005

Negative

NEW MATERIAL

NO SAMPLE

NS

New 2004 and 2005 Construction Relocatable Building per Manufacturer's Tag information.

SAMPLES REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

CLASSROOMS P2 (BUILDING M)-P3 (BUILDING N) PORTABLE BUILDINGS

CLASSROOMS P2 (BUILDING M)-P3 (BUILDING N) PORTABLE BUILDINGS

PORTABLE P2

PRESSED WOOD WALL PANEL

<u>05-212AAA</u>	9/6/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

CLASSROOMS P2 (BUILDING M)-P3 (BUILDING N) PORTABLE BUILDINGS

PORTABLES P2

PRESSED WOOD WALL PANEL MASTIC

<u>05-212AAA</u>	9/6/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

CLASSROOMS P2 (BUILDING M)-P3 (BUILDING N) PORTABLE BUILDINGS

PORTABLES P2

VINYL WALL COVER MASTIC

<u>05-212AAA</u>	9/6/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

SAMPLES REPORT FOR
PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE NO.	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
COMMENTS					

GREEN HOUSE

GREEN HOUSE

GREEN HOUSE ECHO LAB

PERMANENT BUILDING

09-098.NS

5/13/2009

Positive

ASSUMED

NO SAMPLE

NS

SAMPLES REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

GYM BUILDING (BUILDING E)

GYM BUILDING (BUILDING E)

ATTIC AREA OF BOYS AND GIRLS LOCKER ROOMS
 PIPE FITTING INSULATION

<u>05-212AAA</u>	9/6/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

GYM BUILDING (BUILDING E)

BOILER ROOM
 FIRE DOOR CORE INSULATION

<u>05-212AAA</u>	9/6/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

GYM BUILDING (BUILDING E)

BOILER ROOM, COACHES OFFICE, STORAGE ROOMS, GYM, BOYS' LOCKER ROOM AND GIRLS' LOCKER ROOM
 SMOOTH WALL MISCELLANEOUS

<u>05-212AAA</u>	9/6/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

GYM BUILDING (BUILDING E)

BOILER ROOM, COACHES OFFICE, STORAGE ROOMS, GYM, BOYS' LOCKER ROOM AND GIRLS' LOCKER ROOM
 SMOOTH WALL SURFACING

<u>05-212AAA</u>	9/6/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

GYM BUILDING (BUILDING E)

BOYS' AND GIRLS' SHOWERS, AND COACHES RESTROOMS
 MORTAR MISCELLANEOUS

<u>08-241AAA</u>	10/14/2008	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	------------	----------	---------	-----------	----

GYM BUILDING (BUILDING E)

BOYS' AND GIRLS' SHOWERS, AND COACHES RESTROOMS
 MORTAR MISCELLANEOUS

<u>08-241AAA</u>	10/14/2008	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	------------	----------	---------	-----------	----

GYM BUILDING (BUILDING E)

BOYS' AND GIRLS' SHOWERS AND LOCKER ROOMS
 PLASTER WALL

<u>05-212AAA</u>	9/6/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

<u>05-212AAA</u>	9/6/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

SAMPLES REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME
LOCATION
MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

GYM BUILDING (BUILDING E)

BOYS' AND GIRLS' SHOWERS AND LOCKER ROOMS
 PLASTER WALL SURFACING

<u>05-212AAA</u>	9/6/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

GYM BUILDING (BUILDING E)

EXTERIOR WALLS
 ROUGH WALL SURFACING

<u>05-212AAA</u>	9/6/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

GYM BUILDING (BUILDING E)

EXTERIOR WALLS AND OVERHANGS
 ROUGH WALL

<u>05-212AAA</u>	9/6/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

GYM BUILDING (BUILDING E)

GYM
 CEILING PANEL

<u>05-212AAA</u>	9/6/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

GYM BUILDING (BUILDING E)

GYM
 CEILING PANEL MASTIC

<u>05-212AAA</u>	9/6/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

GYM BUILDING (BUILDING E)

GYM
 VINYL SHEETING

<u>05-212AAA</u>	9/6/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

<u>17-041-048</u>	3/3/2017	Negative	ND	NONE DETECTED	ND
--------------------------	----------	----------	----	---------------	----

Building E, E1 Mini Gym, Resilient Flooring (Top Layer).

GYM BUILDING (BUILDING E)

GYM
 VINYL SHEETING BACKING PAPER/MASTIC

<u>05-212AAA</u>	9/6/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

SAMPLES REPORT FOR
PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
--------------------------------	-------------	---------------	-----------------------------	--------------------------	--------------------------

17-041-049

3/3/2017

Negative

ND

NONE DETECTED

ND

Building E, E1 Mini Gym, Resilient Flooring (Bottom Layer).

SAMPLES REPORT FOR
PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

LANCER GYM (BUILDING L)

LANCER GYM (BUILDING L)

LANCER GYM

PERMANENT BUILDING

24-016.NS

2/12/2024

Negative

NEW MATERIAL

NO SAMPLE

NS

SAMPLES REPORT FOR
PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE NO.	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
COMMENTS					

STORAGE CONTAINERS

STORAGE CONTAINERS

METAL STORAGE CONTAINERS (3 EA)

STORAGE CONTAINER

16-074.NS

3/16/2016

Positive

ASSUMED

NO SAMPLE

NS

Metal Storage Structures.

SAMPLES REPORT FOR
PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE NO.	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
COMMENTS					

WOOD SHED

WOOD SHED

WOOD STORAGE BUILDING

STORAGE BUILDING

10-052.NS

3/10/2010

Negative

NEW MATERIAL

NO SAMPLE

NS

Wood Shed.

End Of Report, Total Of 25 Pages

DAMAGE REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDINGS J&K)

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDINGS J&K)

EXTERIOR

WINDOW CAULKING

78 LF

P: Less Than 10%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

10/14/2008	Window Caulking. Some of this Material is damaged. This Material is in FAIR condition as of this date.
05/13/2009	Damage: <5% Physical Damage due to cracked condition on South Side Windows. Material is in FAIR condition overall as of this date.
09/03/2009	Entry passed in error. Damage incorrectly identified. Damage should be <10% water damage due to water, moisture, and heat damages. No other changes as of this date.
02/04/2020	This Material is unchanged as of this date.
08/26/2020	This Material is unchanged as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.
08/17/2022	This Material is unchanged as of this date.
02/13/2023	This Material is unchanged as of this date.
08/14/2023	This Material is unchanged as of this date.
02/12/2024	This Material is unchanged as of this date.
08/12/2024	This Material is unchanged as of this date.
02/25/2025	This Material is unchanged as of this date.
09/15/2025	This Material is unchanged as of this date.

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDINGS J&K)

EXTERIOR OVERHANG (SOUTH SIDE)

PIPE FITTING INSULATION

8 SF

P: No Visible Damage

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED THERMAL SYSTEM INSULATION ACM

08/23/2006	Pipe Fitting Insulation (4" Outside Diameter) on Overhead TSI, 8 Fittings total. This Material is in GOOD condition as of this date.
02/04/2020	This Material is unchanged as of this date.
08/26/2020	This Material is unchanged as of this date.

DAMAGE REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RISK ASSESMENT CATEGORY

COMMENTS

QTY
(APPROXIMATE)

PHYSICAL DAMAGE (P:)
WATER DAMAGE (W:)

02/08/2021 This Material is unchanged as of this date.
08/09/2021 This Material is unchanged as of this date.
02/16/2022 This Material is unchanged as of this date.
08/17/2022 This Material is unchanged as of this date.
02/13/2023 This Material is unchanged as of this date.
08/14/2023 This Material is unchanged as of this date.
02/12/2024 This Material is unchanged as of this date.
08/12/2024 This Material is unchanged as of this date.
02/25/2025 This Material is unchanged as of this date.
09/15/2025 This Material is unchanged as of this date.

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDINGS J&K)

KITCHEN, RESTROOM, AND SNACK BAR

VINYL SHEETING

1,030 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/06/2005 Vinyl Sheeting. This Material is in good condition as of this date.
04/17/2008 <5% Physical Damage. 2 SF is damaged by the Sink and Refrigerator, and this Material is in FAIR condition as of this date.
05/13/2009 Damages Re-Assessed. Additional Damages in the form of Vinyl Sheeting has been Damaged in several seam locations with separation. No other changes as of this date.
02/04/2020 This Material is unchanged as of this date.
08/26/2020 This Material is unchanged as of this date.
02/08/2021 This Material is unchanged as of this date.
08/09/2021 This Material is unchanged as of this date.
02/16/2022 This Material is unchanged as of this date.
08/17/2022 This Material is unchanged as of this date.
02/13/2023 This Material is unchanged as of this date.
08/14/2023 This Material is unchanged as of this date.
02/12/2024 This Material is unchanged as of this date.
08/12/2024 This Material is unchanged as of this date.
02/25/2025 This Material is unchanged as of this date.

DAMAGE REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME		QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
LOCATION	MATERIAL TYPE		
RISK ASSESMENT CATEGORY			
COMMENTS			

09/15/2025 This Material is unchanged as of this date.

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDINGS J&K)

KITCHEN, RESTROOM, AND SNACK BAR

VINYL SHEETING BACKING PAPER/MASTIC	1,030 SF	P: Less Than 5% W: No Evidence
-------------------------------------	----------	---

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/06/2005	Backing Paper/Adhesive for Vinyl Floor Sheeting. This Material is in good condition as of this date.
04/17/2008	<5% Physical Damage. 2 SF is damaged by the Sink and Refrigerator and this Material is in FAIR condition as of this date.
05/13/2009	Damages Re-Assessed. Additional Damages in the form of Vinyl Sheeting has been Damaged in several seam locations with separation. No other changes as of this date.
02/04/2020	This Material is unchanged as of this date.
08/26/2020	This Material is unchanged as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.
08/17/2022	This Material is unchanged as of this date.
02/13/2023	This Material is unchanged as of this date.
08/14/2023	This Material is unchanged as of this date.
02/12/2024	This Material is unchanged as of this date.
08/12/2024	This Material is unchanged as of this date.
02/25/2025	This Material is unchanged as of this date.
09/15/2025	This Material is unchanged as of this date.

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDINGS J&K)

ONE RESTROOM, FOOD STORAGE ROOM, AND KITCHEN

VINYL FLOOR TILE	200 SF	P: Less Than 5% W: No Evidence
------------------	--------	---

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/06/2005	9"x9" Beige Vinyl Floor Tile. This Material is in good condition as of this date.
05/13/2009	Location Description changed from ONE RESTROOM AND FOOD STORAGE CLOSET to ONE RESTROOM AND FOOD STORAGE CLOSET IN FOOD STORAGE ROOM. Material has been Removed in Staff Restroom and Replaced with new 2"x2" Ceramic Floor Tile. Material is also present behind Stove and maybe under Red Vinyl Flooring. No other changes as of this date.

DAMAGE REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
RISK ASSESSMENT CATEGORY	COMMENTS			

09/03/2009	Damage: <5% Physical Damage due to 4 broken and chipped Tiles at Entrance Doorway. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.			
03/03/2014	Location changed from ONE RESTROOM AND FOOD STORAGE CLOSET IN FOOD STORAGE ROOM to ONE RESTROOM, FOOD STORAGE ROOM, AND KITCHEN. No other changes as of this date.			
03/16/2016	Additional Damage observed. 2 Tiles are broken in the Kitchen Storage Room exposing Mastic/Adhesive. No other changes as of this date.			
02/04/2020	This Material is unchanged as of this date.			
08/26/2020	This Material is unchanged as of this date.			
02/08/2021	This Material is unchanged as of this date.			
08/09/2021	This Material is unchanged as of this date.			
02/16/2022	This Material is unchanged as of this date.			
08/17/2022	Material not Observed in Multi-Purpose Room. Material may still exist under Tan Wood Design Vinyl Floor Sheeting. No other changes as of this date.			
02/13/2023	This Material is unchanged as of this date.			
08/14/2023	This Material is unchanged as of this date.			
02/12/2024	This Material is unchanged as of this date.			
08/12/2024	This Material is unchanged as of this date.			
02/25/2025	This Material is unchanged as of this date.			
09/15/2025	This Material is unchanged as of this date.			

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDINGS J&K)

ONE RESTROOM, FOOD STORAGE ROOM, AND KITCHEN

VINYL FLOOR TILE MASTIC

200 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/06/2005	Mastic/Adhesive for 9"x9" Vinyl Floor Tile. This Material is in good condition as of this date.			
05/13/2009	Location Description changed from ONE RESTROOM AND FOOD STORAGE CLOSET to ONE RESTROOM AND FOOD STORAGE CLOSET IN FOOD STORAGE ROOM. Material has been Removed in Staff Restroom and Replaced with new 2"x2" Ceramic Floor Tile. Material is also present behind Stove and maybe under Red Vinyl Flooring. No other changes as of this date.			
09/03/2009	Damage: <5% Physical Damage due to 4 broken and chipped Tiles at Entrance Doorway. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.			

DAMAGE REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RISK ASSESMENT CATEGORY

COMMENTS

QTY
(APPROXIMATE)

PHYSICAL DAMAGE (P:)
WATER DAMAGE (W:)

03/03/2014	Location changed from ONE RESTROOM AND FOOD STORAGE CLOSET IN FOOD STORAGE ROOM to ONE RESTROOM, FOOD STORAGE ROOM, AND KITCHEN. Quantity changed from 150 SF to 200 SF. No other changes as of this date.
03/16/2016	Additional Damage observed. 2 Tiles are broken in the Kitchen Storage Room exposing Mastic/Adhesive. No other changes as of this date.
02/04/2020	This Material is unchanged as of this date.
08/26/2020	This Material is unchanged as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.
08/17/2022	This Material is unchanged as of this date.
02/13/2023	This Material is unchanged as of this date.
08/14/2023	This Material is unchanged as of this date.
02/12/2024	This Material is unchanged as of this date.
08/12/2024	This Material is unchanged as of this date.
02/25/2025	This Material is unchanged as of this date.
09/15/2025	This Material is unchanged as of this date.

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDINGS J&K)

SNACK BAR, AND ATTIC AREA

SPRAY ON CEILING

220 SF

P: Less Than 5%

W: <10% Stains or Flaking

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/06/2005	Spray-On Ceiling. This Material is in good condition as of this date.
03/05/2007	Damage: <5% Physical Damage - degradation in the form of a Wall-to-Wall crack and two areas with holes. Additional damage in the form of water stains. Material condition changed from GOOD to FAIR. No other changes as of this date.
02/04/2020	This Material is unchanged as of this date.
08/26/2020	This Material is unchanged as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.
08/17/2022	This Material is unchanged as of this date.

DAMAGE REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME		QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
LOCATION	MATERIAL TYPE		
RISK ASSESMENT CATEGORY			
COMMENTS			

02/13/2023	This Material is unchanged as of this date.
08/14/2023	This Material is unchanged as of this date.
02/12/2024	This Material is unchanged as of this date.
08/12/2024	This Material is unchanged as of this date.
02/25/2025	This Material is unchanged as of this date.
09/15/2025	This Material is unchanged as of this date.

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDINGS J&K)

STAGE, KITCHEN, STORAGE ROOM, BAND ROOM, RESTROOMS, AND HALLWAY OFFICES

SMOOTH WALL MISCELLANEOUS

19,800 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/06/2005	Gypsum Wallboard System Walls and Ceilings. This Material is in good condition as of this date.
08/23/2006	Hallway Offices added to location. 12,000 SF added to quantity. Material Quantity changed from 7,800 SF to 19,800 SF. <5% Physical Damage. Several damages observed in Bathroom Hallway. 2" O.D. hole noticed in Kitchen next to oven. Material Condition changed from GOOD to FAIR. No other changes as of this date.
05/13/2009	Damages Re-Assessed. Additional Damage observed in the form of several cuts, holes, and scratches in Food Storage Room, Hallways to Stage, and Food Serving locations. No other changes as of this date.
08/28/2014	Material Re-Assessed. Kitchen wall has 3 SF Damage on the Wall. No other changes as of this date.
08/06/2018	Additional Damage Observed. 1 SF of Physical Damage by Vice Principals Office and Administration Office. No other changes as of this date.
02/04/2020	This Material is unchanged as of this date.
08/26/2020	This Material is unchanged as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.
08/17/2022	Additional Damage Observed. <5% Physical Damage in the form of 2 LF Crack on Wall (Ceiling Level) of Social Worker Office. Material remains in FAIR condition overall. No other changes as of this date.
02/13/2023	This Material is unchanged as of this date.
08/14/2023	This Material is unchanged as of this date.
02/12/2024	This Material is unchanged as of this date.
08/12/2024	This Material is unchanged as of this date.
02/25/2025	This Material is unchanged as of this date.

DAMAGE REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RISK ASSESSMENT CATEGORY

COMMENTS

QTY
(APPROXIMATE)

PHYSICAL DAMAGE (P:)
WATER DAMAGE (W:)

09/15/2025 This Material is unchanged as of this date.

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDINGS J&K)

STAGE, KITCHEN, STORAGE ROOM, BAND ROOM, RESTROOMS, AND HALLWAY OFFICES

SMOOTH WALL SURFACING

19,800 SF

P: Less Than 5%

W: No Evidence

DAMAGED FRIABLE SURFACING ACM

08/23/2006 Skim Coat for Gypsum Wallboard System Walls and Ceilings. <5% Physical Damage. Several damages observed in Bathroom Hallway. 2" O.D. hole noticed in Kitchen next to oven. This Material is in FAIR condition as of this date.

05/13/2009 Damages Re-Assessed. Additional Damage observed in the form of several cuts, holes, and scratches in Food Storage Room, Hallways to Stage, and Food Serving locations. No other changes as of this date.

08/28/2014 Material Re-Assessed. Kitchen wall has 3 SF Damage on the Wall. No other changes as of this date.

08/06/2018 Additional Damage Observed. 1 SF of Physical Damage by Vice Principals Office and Administration Office. No other changes as of this date.

02/04/2020 This Material is unchanged as of this date.

08/26/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/16/2022 This Material is unchanged as of this date.

08/17/2022 Additional Damage Observed. <5% Physical Damage in the form of 2 LF Crack on Wall (Ceiling Level) of Social Worker Office. Material remains in FAIR condition overall. No other changes as of this date.

02/13/2023 This Material is unchanged as of this date.

08/14/2023 This Material is unchanged as of this date.

02/12/2024 This Material is unchanged as of this date.

08/12/2024 This Material is unchanged as of this date.

02/25/2025 This Material is unchanged as of this date.

09/15/2025 This Material is unchanged as of this date.

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDINGS J&K)

WOOD WALLS, EXTERIOR UPPER LEVEL OVERHANG, AND COVERED WALKWAY

ROUGH CEILING

3,100 SF

P: Less Than 5%

W: No Evidence

DAMAGED FRIABLE SURFACING ACM

09/06/2005 Stucco on Walls and Covered Walkway. This Material is in good condition as of this date.

DAMAGE REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RISK ASSESMENT CATEGORY

COMMENTS

QTY
(APPROXIMATE)

PHYSICAL DAMAGE (P:)
WATER DAMAGE (W:)

05/13/2009	Location Description changed from EXTERIOR WALLS, UPPER LEVEL OVERHANG, AND COVERED WALKWAY to WOOD WALLS, UPPER LEVEL OVERHANG, AND COVERED WALKWAY. Material Type changed from ROUGH WALL to ROUGH CEILING. Material Description changed from ' SKIM COAT FOR STUCCO ON WALLS AND COVERED WALKWAY.' to 'SKIM COAT FOR STUCCO ON Overhang AND COVERED WALKWAY'. Quantity changed from 14,300 SF to 3,100 SF. Damages Re-Assessed. 2 cracked surfaces observed on East and South Sides. No other changes as of this date.
02/04/2020	This Material is unchanged as of this date.
08/26/2020	This Material is unchanged as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.
08/17/2022	This Material is unchanged as of this date.
02/13/2023	This Material is unchanged as of this date.
08/14/2023	This Material is unchanged as of this date.
02/12/2024	This Material is unchanged as of this date.
08/12/2024	This Material is unchanged as of this date.
02/25/2025	This Material is unchanged as of this date.
09/15/2025	This Material is unchanged as of this date.

ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDINGS J&K)

WOOD WALLS, UPPER LEVEL OVERHANG, AND COVERED WALKWAY

ROUGH CEILING SURFACING

3,200 SF

P: Less Than 5%

W: No Evidence

DAMAGED FRIABLE SURFACING ACM

09/06/2005	Skim Coat for Stucco on Walls and Covered Walkway. This Material is in good condition as of this date.
05/13/2009	Location Description changed from EXTERIOR WALLS, UPPER LEVEL OVERHANG, AND COVERED WALKWAY to WOOD WALLS, UPPER LEVEL OVERHANG, AND COVERED WALKWAY. Material Type changed from ROUGH WALL to ROUGH CEILING. Material Description changed from ' SKIM COAT FOR STUCCO ON WALLS AND COVERED WALKWAY.' to 'SKIM COAT FOR STUCCO ON Overhang AND COVERED WALKWAY'. Quantity changed from 14,300 SF to 3,100 SF. Damages Re-Assessed. 2 cracked surfaces observed on East and South Sides. No other changes as of this date.
02/04/2020	This Material is unchanged as of this date.
08/26/2020	This Material is unchanged as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.

DAMAGE REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME		QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
LOCATION	MATERIAL TYPE		
RISK ASSESMENT CATEGORY			
COMMENTS			

02/16/2022	This Material is unchanged as of this date.
08/17/2022	This Material is unchanged as of this date.
02/13/2023	This Material is unchanged as of this date.
08/14/2023	This Material is unchanged as of this date.
02/12/2024	This Material is unchanged as of this date.
08/12/2024	This Material is unchanged as of this date.
02/25/2025	This Material is unchanged as of this date.
09/15/2025	This Material is unchanged as of this date.

DAMAGE REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

CLASSROOMS 01-03 AND RESTROOMS BUILDING (BUILDING A)

CLASSROOMS 01-03 AND RESTROOMS BUILDING (BUILDING A)

CLASSROOMS 01-03, RESTROOMS, BOILER ROOM, AND STORAGE ROOM

SMOOTH WALL MISCELLANEOUS

15,115 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/06/2005	Gypsum Wallboard System Walls and Ceilings. Existing Gypsum Wallboard Systems Removed and Replaced with new in-kind in Path-of-Construction. This Material is in GOOD condition as of this date.
08/23/2006	Boiler Room and Storage Room added to Location. 2,500 SF added to quantity. Quantity changed from 9,735 SF to 12,235 SF. No other changes as of this date.
04/17/2008	Quantity changed from 12,235 SF to 15,115 SF to include area above Sprayed-On Ceiling Material. This Material condition is unchanged as of this date.
03/10/2010	Damage: <5% Physical Damage - in the form of scratches, holes, and cuts observed on various surfaces in all Classrooms. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.
02/12/2018	Additional Damage Observed. 2 Cracks 1 LF each located above window in Classroom 1. No other changes as of this date.
02/04/2020	This Material is unchanged as of this date.
08/26/2020	This Material is unchanged as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.
08/15/2022	This Material is unchanged as of this date.
02/13/2023	This Material is unchanged as of this date.
08/14/2023	This Material is unchanged as of this date.
02/12/2024	This Material is unchanged as of this date.
08/12/2024	This Material is unchanged as of this date.
02/25/2025	This Material is unchanged as of this date.
09/15/2025	This Material is unchanged as of this date.

DAMAGE REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESSMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	--------------------------	----------	----------------------	---

CLASSROOMS 01-03 AND RESTROOMS BUILDING (BUILDING A)

CLASSROOMS 01-03, RESTROOMS, BOILER ROOM, AND STORAGE ROOM

SMOOTH WALL SURFACING

12,235 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

08/23/2006	Skim Coat for Gypsum Wallboard System Walls and Ceilings. Existing Gypsum Wallboard Systems Removed and Replaced with new in-kind in Path-of-Construction. This Material is in GOOD condition as of this date.
03/10/2010	Damage Observed. <5% Physical Damage - in the form of scratches, holes, and cuts observed on various surfaces in all Classrooms. Material condition changed from GOOD to FAIR overall. No other changes as of this date.
02/12/2018	Additional Damage Observed. 2 Cracks 1 LF each located above window in Classroom 1. Remains in FAIR condition. No other changes as of this date.
02/04/2020	This Material is unchanged as of this date.
08/26/2020	This Material is unchanged as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.
08/15/2022	This Material is unchanged as of this date.
02/13/2023	This Material is unchanged as of this date.
08/14/2023	This Material is unchanged as of this date.
02/12/2024	This Material is unchanged as of this date.
08/12/2024	This Material is unchanged as of this date.
02/25/2025	This Material is unchanged as of this date.
09/15/2025	This Material is unchanged as of this date.

CLASSROOMS 01-03 AND RESTROOMS BUILDING (BUILDING A)

EXTERIOR WINDOWS

WINDOW CAULKING

300 LF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

10/14/2008	Window Caulking. This Material is in GOOD condition as of this date.
08/25/2017	Damage Observed. <5% Physical Damage - in the form of 6 Windows with Cracked and Dry Material. Material Condition changed from GOOD to FAIR. Friability changed from Non-Friable to Friable. No other changes as of this date.

DAMAGE REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESSMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	--------------------------	----------	----------------------	---

02/04/2020	This Material is unchanged as of this date.
08/26/2020	This Material is unchanged as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.
08/15/2022	This Material is unchanged as of this date.
02/13/2023	This Material is unchanged as of this date.
08/14/2023	This Material is unchanged as of this date.
02/12/2024	This Material is unchanged as of this date.
08/12/2024	This Material is unchanged as of this date.
02/25/2025	This Material is unchanged as of this date.
09/15/2025	This Material is unchanged as of this date.

CLASSROOMS 01-03 AND RESTROOMS BUILDING (BUILDING A)

MECHANICAL ROOM, AND TWO STAFF RESTROOMS

PLASTER WALL

2,600 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/06/2005	Plaster Walls and Ceiling. Damages noticed. <5% Physical Damage in the form of cuts and holes in various locations. Existing Plaster Systems Removed and Replaced with new in-kind in Path-of-Construction. This Material is in FAIR condition as of this date.
08/23/2006	Two Student Restrooms added to Location. 1,200 SF added to quantity. Quantity changed from 1,400 SF to 2,600 SF. No other changes as of this date.
03/16/2016	Location Description Re-Assessed. Restrooms are now Staff Restrooms. Location changed from BOILER ROOM, AND TWO STUDENT RESTROOMS to BOILER ROOM, AND TWO STAFF RESTROOMS. No other changes as of this date.
02/04/2020	This Material is unchanged as of this date.
08/26/2020	This Material is unchanged as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.
08/17/2022	Additional Damage Observed. <5% Physical Damage in the form of 2 SF of Cuts and Holes in Various Locations on Walls and Ceiling of Mechanical Room. Material remains in FAIR condition overall. No other changes as of this date.

DAMAGE REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME		QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
LOCATION	MATERIAL TYPE		
RISK ASSESMENT CATEGORY			
COMMENTS			

02/13/2023	This Material is unchanged as of this date.
08/14/2023	This Material is unchanged as of this date.
02/12/2024	This Material is unchanged as of this date.
08/12/2024	This Material is unchanged as of this date.
02/25/2025	This Material is unchanged as of this date.
09/15/2025	This Material is unchanged as of this date.

CLASSROOMS 01-03 AND RESTROOMS BUILDING (BUILDING A)

MECHANICAL ROOM, AND TWO STAFF RESTROOMS

PLASTER WALL SURFACING	2,600 SF	P: Less Than 5% W: No Evidence
------------------------	----------	-----------------------------------

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/06/2005	Skim Coat for Plaster Walls and Ceiling. Damages noticed. <5% Physical Damage in the form of cuts and holes in various locations. Existing Plaster Systems Removed and Replaced with new in-kind in Path-of-Construction. This Material is in FAIR condition as of this date.
08/23/2006	Two Student Restrooms added to Location. 1,200 SF added to quantity. Quantity changed from 1,400 SF to 2,600 SF. No other changes as of this date.
03/16/2016	Location Description Re-Assessed. Restrooms are now Staff Restrooms. Location changed from BOILER ROOM, AND TWO STUDENT RESTROOMS to BOILER ROOM, AND TWO STAFF RESTROOMS. No other changes as of this date.
02/04/2020	This Material is unchanged as of this date.
08/26/2020	This Material is unchanged as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.
08/17/2022	Additional Damage Observed. <5% Physical Damage in the form of 2 SF of Cuts and Holes in Various Locations on Walls and Ceiling of Mechanical Room. Material remains in FAIR condition overall. No other changes as of this date.
02/13/2023	This Material is unchanged as of this date.
08/14/2023	This Material is unchanged as of this date.
02/12/2024	This Material is unchanged as of this date.
08/12/2024	This Material is unchanged as of this date.
02/25/2025	This Material is unchanged as of this date.
09/15/2025	This Material is unchanged as of this date.

DAMAGE REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

CLASSROOMS 04-09 BUILDING (BUILDING B)

CLASSROOMS 04-09 BUILDING (BUILDING B)

EXTERIOR WINDOWS ON NORTH AND SOUTH SIDE

WINDOW CAULKING

500 LF

P: Less Than 10%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

03/03/2014	Window Caulking. This Material is in FAIR condition as of this date.
02/04/2020	This Material is unchanged as of this date.
08/26/2020	This Material is unchanged as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.
08/15/2022	This Material is unchanged as of this date.
02/13/2023	This Material is unchanged as of this date.
08/14/2023	This Material is unchanged as of this date.
02/12/2024	This Material is unchanged as of this date.
08/12/2024	This Material is unchanged as of this date.
02/25/2025	This Material is unchanged as of this date.
09/15/2025	This Material is unchanged as of this date.

DAMAGE REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RISK ASSESSMENT CATEGORY

COMMENTS

QTY

(APPROXIMATE)

PHYSICAL DAMAGE (P:)

WATER DAMAGE (W:)

CLASSROOMS 10-12 BUILDING (BUILDING C)

CLASSROOMS 10-12 BUILDING (BUILDING C)

BOOK / SUPPLIES ROOM

PLASTER WALL

1,250 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

08/23/2006	Plaster Walls and Ceiling. Existing Plaster Systems Removed and Replaced with new in-kind in Path-of-Construction. This Material is in GOOD condition as of this date.
10/10/2012	Damage Observed. <5% Physical Damage - in the form of several holes observed on Walls and Ceiling. Material condition changed from GOOD to FAIR overall as of this date. Friability changed from Non-Friable to Friable.
02/04/2020	This Material is unchanged as of this date.
08/26/2020	This Material is unchanged as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.
08/15/2022	This Material is unchanged as of this date.
02/13/2023	This Material is unchanged as of this date.
08/14/2023	This Material is unchanged as of this date.
02/12/2024	This Material is unchanged as of this date.
08/12/2024	This Material is unchanged as of this date.
02/25/2025	This Material is unchanged as of this date.
09/15/2025	This Material is unchanged as of this date.

CLASSROOMS 10-12 BUILDING (BUILDING C)

BOOK / SUPPLIES ROOM

PLASTER WALL SURFACING

1,250 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

08/23/2006	Skim Coat for Plaster Walls and Ceiling. Existing Plaster Systems Removed and Replaced with new in-kind in Path-of-Construction. This Material is in GOOD condition as of this date.
10/10/2012	Damage Observed. <5% Physical Damage - in the form of several holes observed on Walls and Ceiling. Material condition changed from GOOD to FAIR overall as of this date. Friability changed from Non-Friable to Friable to reflect this change.

DAMAGE REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RISK ASSESSMENT CATEGORY

COMMENTS

QTY
(APPROXIMATE)

PHYSICAL DAMAGE (P:)
WATER DAMAGE (W:)

02/04/2020 This Material is unchanged as of this date.
08/26/2020 This Material is unchanged as of this date.
02/08/2021 This Material is unchanged as of this date.
08/09/2021 This Material is unchanged as of this date.
02/16/2022 This Material is unchanged as of this date.
08/15/2022 This Material is unchanged as of this date.
02/13/2023 This Material is unchanged as of this date.
08/14/2023 This Material is unchanged as of this date.
02/12/2024 This Material is unchanged as of this date.
08/12/2024 This Material is unchanged as of this date.
02/25/2025 This Material is unchanged as of this date.
09/15/2025 This Material is unchanged as of this date.

CLASSROOMS 10-12 BUILDING (BUILDING C)

EXTERIOR WINDOWS (NORTH AND SOUTH SIDES)

WINDOW CAULKING

300 LF

P: Less Than 75% With Debris

W: >10% Evident

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

05/13/2009 Sealant/Caulking on Exterior Windows. Damage: <75% Physical Damage due to surfaces being cracked and in degradation condition. This Material is in FAIR condition as of this date.
02/04/2020 This Material is unchanged as of this date.
08/26/2020 This Material is unchanged as of this date.
02/08/2021 This Material is unchanged as of this date.
08/09/2021 This Material is unchanged as of this date.
02/16/2022 This Material is unchanged as of this date.
08/15/2022 This Material is unchanged as of this date.
02/13/2023 This Material is unchanged as of this date.
08/14/2023 This Material is unchanged as of this date.
02/12/2024 This Material is unchanged as of this date.
08/12/2024 This Material is unchanged as of this date.
02/25/2025 This Material is unchanged as of this date.
09/15/2025 This Material is unchanged as of this date.

DAMAGE REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESSMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	--------------------------	----------	----------------------	---

CLASSROOMS 13-15 AND RESTROOMS BUILDING (BUILDING D)

CLASSROOMS 13-15 AND RESTROOMS BUILDING (BUILDING D)

BOILER ROOM, AND TWO STAFF RESTROOMS

PLASTER WALL

2,600 SF

P: Less Than 5%

W: <10% Stains or Flaking

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/06/2005	Plaster Walls and Ceiling. Existing Plaster Systems Removed and Replaced with new in-kind in Path-of-Construction. This Material is in GOOD condition as of this date.
08/23/2006	Two Staff Restrooms added to location. 1,200 SF added to quantity. Quantity changed from 1,400 SF to 2,600 SF. No other changes as of this date.
04/17/2008	<5% Physical damage in the form of several small cuts, holes and scratches observed on all walls in the Mechanical Room. Material is in FAIR condition overall as of this date.
03/03/2014	This Material is unchanged as of this date.
02/04/2020	This Material is unchanged as of this date.
08/26/2020	This Material is unchanged as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.
08/15/2022	This Material is unchanged as of this date.
02/13/2023	This Material is unchanged as of this date.
08/14/2023	This Material is unchanged as of this date.
02/12/2024	This Material is unchanged as of this date.
08/12/2024	This Material is unchanged as of this date.
02/25/2025	This Material is unchanged as of this date.
09/15/2025	This Material is unchanged as of this date.

CLASSROOMS 13-15 AND RESTROOMS BUILDING (BUILDING D)

BOILER ROOM, AND TWO STAFF RESTROOMS

PLASTER WALL SURFACING

2,600 SF

P: Less Than 5%

W: No Evidence

DAMAGED FRIABLE SURFACING ACM

09/06/2005	Skim Coat for Plaster Walls and Ceiling. Existing Plaster Systems Removed and Replaced with new in-kind in Path-of-Construction. This Material is in GOOD condition as of this date.
------------	--

DAMAGE REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RISK ASSESSMENT CATEGORY

COMMENTS

QTY

(APPROXIMATE)

PHYSICAL DAMAGE (P:)

WATER DAMAGE (W:)

08/23/2006	Two Staff Restrooms added to location. 1,200 SF added to quantity. Quantity changed from 1,400 SF to 2,600 SF. No other changes as of this date.
04/17/2008	<5% Physical damage in the form of several small cuts, holes and scratches observed on all walls in the Mechanical Room. Material is in FAIR condition overall as of this date.
03/03/2014	This Material is unchanged as of this date.
02/04/2020	This Material is unchanged as of this date.
02/04/2020	This Material is unchanged as of this date.
08/26/2020	This Material is unchanged as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.
08/15/2022	This Material is unchanged as of this date.
02/13/2023	This Material is unchanged as of this date.
08/14/2023	This Material is unchanged as of this date.
02/12/2024	This Material is unchanged as of this date.
08/12/2024	This Material is unchanged as of this date.
02/25/2025	This Material is unchanged as of this date.
09/15/2025	This Material is unchanged as of this date.

CLASSROOMS 13-15 AND RESTROOMS BUILDING (BUILDING D)

CLASSROOMS 13-15, AND TWO RESTROOMS

SMOOTH WALL MISCELLANEOUS

12,615 SF

P: Less Than 5%

W: <10% Stains or Flaking

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/06/2005	Gypsum Wallboard System Walls and Ceilings. Existing Gypsum Wallboard Systems Removed and Replaced with new in-kind in Path-of-Construction. This Material is in GOOD condition as of this date.
04/17/2008	Material is also present under Spray-On Ceiling. Quantity changed from 9,735 SF to 12,615 SF. This Material is in FAIR condition due to water damage in several locations as of this date.
09/12/2016	<10% Water Damage and <5% Physical Damage observed. Room 13 has cuts and holes; and Room 14 has 3 LF of cracks, cuts, and holes. This Material is in FAIR condition overall. No other changes as of this date.
03/27/2017	Additional Damage Observed. 4 SF of Peeling Skim Coat in Girls Restroom. No other changes as of this date.
02/04/2020	This Material is unchanged as of this date.

DAMAGE REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME**LOCATION****MATERIAL TYPE****RISK ASSESMENT CATEGORY****COMMENTS****QTY
(APPROXIMATE)****PHYSICAL DAMAGE (P:)
WATER DAMAGE (W:)**

08/26/2020	This Material is unchanged as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.
08/15/2022	This Material is unchanged as of this date.
02/13/2023	This Material is unchanged as of this date.
08/14/2023	This Material is unchanged as of this date.
02/12/2024	This Material is unchanged as of this date.
08/12/2024	This Material is unchanged as of this date.
02/25/2025	This Material is unchanged as of this date.
09/15/2025	This Material is unchanged as of this date.

CLASSROOMS 13-15 AND RESTROOMS BUILDING (BUILDING D)**CLASSROOMS 13-15, AND TWO RESTROOMS****SMOOTH WALL SURFACING**

9,735 SF

P: No Visible Damage**W:** <10% Stains or Flaking**DAMAGED FRIABLE SURFACING ACM**

08/23/2006	Skim Coat for Gypsum Wallboard System Walls and Ceilings. This Material is in GOOD condition as of this date.
09/12/2016	<10% Water Damage and <5% Physical Damage observed. Room 13 has cuts and holes; and Room 14 has 3 LF of cracks, cuts, and holes. This Material is in FAIR condition overall. No other changes as of this date.
03/27/2017	Additional Damage Observed. 4 SF of Peeling Skim Coat in Girls Restroom. No other changes as of this date.
02/04/2020	This Material is unchanged as of this date.
08/26/2020	This Material is unchanged as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.
08/15/2022	This Material is unchanged as of this date.
02/13/2023	This Material is unchanged as of this date.
08/14/2023	This Material is unchanged as of this date.
02/12/2024	This Material is unchanged as of this date.

DAMAGE REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RISK ASSESSMENT CATEGORY

COMMENTS

QTY
(APPROXIMATE)

PHYSICAL DAMAGE (P:)
WATER DAMAGE (W:)

08/12/2024 This Material is unchanged as of this date.

02/25/2025 This Material is unchanged as of this date.

09/15/2025 This Material is unchanged as of this date.

CLASSROOMS 13-15 AND RESTROOMS BUILDING (BUILDING D)

ENTIRE BUILDING

FIRE DOOR CORE INSULATION

147 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

02/16/2022 Fire Door Core Insulation. (7 EA Doors). This Material is in GOOD condition as of this date.

08/15/2022 Additional Damage Observed. <5% Physical Damage in the form of Damaged door knob with White Core Insulation Exposed in Mechanical Room. Material condition changed from GOOD to FAIR overall. No other changes as of this date.

02/13/2023 This Material is unchanged as of this date.

08/14/2023 This Material is unchanged as of this date.

02/12/2024 This Material is unchanged as of this date.

08/12/2024 This Material is unchanged as of this date.

02/25/2025 This Material is unchanged as of this date.

09/15/2025 This Material is unchanged as of this date.

CLASSROOMS 13-15 AND RESTROOMS BUILDING (BUILDING D)

EXTERIOR WINDOWS (EAST AND WEST SIDES)

WINDOW CAULKING

300 LF

P: Less Than 75% With Debris

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

05/13/2009 Sealant/Caulking on Exterior Windows. Damage: <75% Physical Damage in the form of cracked surfaces and degradation condition. This Material is in FAIR condition as of this date.

02/04/2020 This Material is unchanged as of this date.

08/26/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/16/2022 This Material is unchanged as of this date.

08/15/2022 This Material is unchanged as of this date.

DAMAGE REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME		QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
LOCATION	MATERIAL TYPE		
RISK ASSESMENT CATEGORY			
COMMENTS			

02/13/2023	This Material is unchanged as of this date.
08/14/2023	This Material is unchanged as of this date.
02/12/2024	This Material is unchanged as of this date.
08/12/2024	This Material is unchanged as of this date.
02/25/2025	This Material is unchanged as of this date.
09/15/2025	This Material is unchanged as of this date.

DAMAGE REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RISK ASSESSMENT CATEGORY

COMMENTS

QTY
(APPROXIMATE)

PHYSICAL DAMAGE (P:)
WATER DAMAGE (W:)

CLASSROOMS 16-18 BUILDING (BUILDING F)

CLASSROOMS 16-18 BUILDING (BUILDING F)

ALL CLASSROOMS, BOILER ROOM, AND STORAGE ROOM

SMOOTH WALL MISCELLANEOUS

8,100 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/06/2005	Gypsum Wallboard System Walls and Ceilings. Existing Gypsum Wallboard Systems Removed and Replaced with new in-kind in Path-of-Construction. This Material is in GOOD condition as of this date.
08/06/2018	Damage Observed. <5% Physical Damage - in the form of 1 SF Scrape in Lower Wall in Classroom 18. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.
02/04/2020	This Material is unchanged as of this date.
08/26/2020	This Material is unchanged as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.
08/15/2022	This Material is unchanged as of this date.
02/13/2023	This Material is unchanged as of this date.
08/14/2023	This Material is unchanged as of this date.
02/12/2024	This Material is unchanged as of this date.
08/12/2024	This Material is unchanged as of this date.
02/25/2025	This Material is unchanged as of this date.
09/15/2025	This Material is unchanged as of this date.

CLASSROOMS 16-18 BUILDING (BUILDING F)

ALL CLASSROOMS, BOILER ROOM, AND STORAGE ROOM

SMOOTH WALL SURFACING

8,100 SF

P: Less Than 5%

W: No Evidence

DAMAGED FRIABLE SURFACING ACM

08/23/2006	Skim Coat for Gypsum Wallboard System Walls and Ceilings. Existing Gypsum Wallboard Systems Removed and Replaced with new in-kind in Path-of-Construction. This Material is in GOOD condition as of this date.
08/06/2018	Damage Observed. <5% Physical Damage - in the form of 1 SF Scrape in Lower Wall in Classroom 18. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.

DAMAGE REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESSMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	--------------------------	----------	----------------------	---

02/04/2020	This Material is unchanged as of this date.				
08/26/2020	This Material is unchanged as of this date.				
02/08/2021	This Material is unchanged as of this date.				
08/09/2021	This Material is unchanged as of this date.				
02/16/2022	This Material is unchanged as of this date.				
08/15/2022	This Material is unchanged as of this date.				
02/13/2023	This Material is unchanged as of this date.				
08/14/2023	This Material is unchanged as of this date.				
02/12/2024	This Material is unchanged as of this date.				
08/12/2024	This Material is unchanged as of this date.				
02/25/2025	This Material is unchanged as of this date.				
09/15/2025	This Material is unchanged as of this date.				

CLASSROOMS 16-18 BUILDING (BUILDING F)

CLASSROOMS 16-18

WINDOW CAULKING

72 LF

P: Less Than 10%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

10/14/2008	Window Caulking. This Material is in GOOD condition as of this date.				
05/13/2009	Damage Observed. <10% Water Damage due to existing cracks on surfaces. Material condition changed from GOOD to FAIR overall as of this date. No other changes as of this date.				
02/04/2020	This Material is unchanged as of this date.				
08/26/2020	This Material is unchanged as of this date.				
02/08/2021	This Material is unchanged as of this date.				
08/09/2021	This Material is unchanged as of this date.				
02/16/2022	This Material is unchanged as of this date.				
08/15/2022	This Material is unchanged as of this date.				
02/13/2023	Additional Damage Observed. <5% Physical Damage in the form of 2 LF of Cracks on North Window of Classroom 18. Material remains in FAIR condition overall. No other changes as of this date.				
08/14/2023	This Material is unchanged as of this date.				
02/12/2024	This Material is unchanged as of this date.				

DAMAGE REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RISK ASSESMENT CATEGORY

COMMENTS

QTY
(APPROXIMATE)

PHYSICAL DAMAGE (P:)
WATER DAMAGE (W:)

08/12/2024	This Material is unchanged as of this date.
02/25/2025	This Material is unchanged as of this date.
09/15/2025	This Material is unchanged as of this date.

DAMAGE REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

CLASSROOMS 19-23 BUILDING (BUILDING G)

CLASSROOMS 19-23 BUILDING (BUILDING G)

CLASSROOMS 19-23

MORTAR MISCELLANEOUS

720 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

11/30/2011	Grout/Mortar for 2"x2" Blue Ceramic Floor Tiles. This Material is in GOOD condition as of this date.
03/27/2017	Damage Observed. <5% Physical Damage - in the form of a few Tiles in Various Rooms have Cracked and are Missing Grout. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.
02/04/2020	This Material is unchanged as of this date.
08/26/2020	This Material is unchanged as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.
08/15/2022	This Material is unchanged as of this date.
02/13/2023	This Material is unchanged as of this date.
08/14/2023	This Material is unchanged as of this date.
02/12/2024	This Material is unchanged as of this date.
08/12/2024	This Material is unchanged as of this date.
02/25/2025	This Material is unchanged as of this date.
09/15/2025	This Material is unchanged as of this date.

CLASSROOMS 19-23 BUILDING (BUILDING G)

CLASSROOMS 19-23, MECHANICAL ROOM, AND CUSTODIAL ROOM

SMOOTH WALL MISCELLANEOUS

11,490 SF

P: Less Than 5%

W: No Evidence

DAMAGED FRIABLE SURFACING ACM

09/06/2005	Gypsum Wallboard System Walls and Ceilings. Existing Gypsum Wallboard Systems Removed and Replaced with new in-kind in Path-of-Construction. This Material is in GOOD condition as of this date.
09/25/2013	460 SF has been Removed and Replaced with New Materials in the Summer of 2013 in Custodial Room and Mechanical Room. Friability changed from Non-Friable to Friable. No other changes as of this date.
08/06/2018	Quantity changed from 10,800 SF to 11,490 SF. New Gypsum Wallboard System Walls found in Speech Room and Reading Room. No other changes as of this date.

DAMAGE REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

02/04/2020	This Material is unchanged as of this date.					
08/26/2020	This Material is unchanged as of this date.					
02/08/2021	This Material is unchanged as of this date.					
08/09/2021	This Material is unchanged as of this date.					
02/16/2022	This Material is unchanged as of this date.					
08/15/2022	Additional Damage Observed. <5% Physical Damage in the form of 4" Round Hole on Ceiling in Custodial Room. Mechanical Room has small Cuts and Holes on Walls and Ceiling. Material condition changed from GOOD to FAIR overall. No other changes as of this date.					
02/13/2023	This Material is unchanged as of this date.					
08/14/2023	This Material is unchanged as of this date.					
02/12/2024	This Material is unchanged as of this date.					
08/12/2024	This Material is unchanged as of this date.					
02/25/2025	This Material is unchanged as of this date.					
09/15/2025	This Material is unchanged as of this date.					

CLASSROOMS 19-23 BUILDING (BUILDING G)

CLASSROOMS 19-23, MECHANICAL ROOM, AND CUSTODIAL ROOM

SMOOTH WALL SURFACING

11,490 SF

P: Less Than 5%

W: No Evidence

DAMAGED FRIABLE SURFACING ACM

08/23/2006	Skim Coat for Gypsum Wallboard System Walls and Ceilings. Existing Gypsum Wallboard Systems Removed and Replaced with new in-kind in Path-of-Construction. This Material is in GOOD condition as of this date.					
09/25/2013	460 SF has been Removed and Replaced with New Materials in the Summer of 2013 in Custodial Room and Mechanical Room. Friability changed from Non-Friable to Friable. No other changes as of this date.					
08/06/2018	Quantity changed from 10,800 SF to 11,490 SF. New Gypsum Wallboard System Walls found in Speech Room and Reading Room. No other changes as of this date.					
02/04/2020	This Material is unchanged as of this date.					
08/26/2020	This Material is unchanged as of this date.					
02/08/2021	This Material is unchanged as of this date.					
08/09/2021	This Material is unchanged as of this date.					
02/16/2022	This Material is unchanged as of this date.					
08/15/2022	Additional Damage Observed. <5% Physical Damage in the form of 4" Round Hole on Ceiling in Custodial Room. Mechanical Room has small Cuts and Holes on Walls and Ceiling. Material condition changed from GOOD to FAIR overall. No other changes as of this date.					

DAMAGE REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME**LOCATION****MATERIAL TYPE****RISK ASSESSMENT CATEGORY****COMMENTS****QTY
(APPROXIMATE)****PHYSICAL DAMAGE (P:)
WATER DAMAGE (W:)**

02/13/2023 This Material is unchanged as of this date.
08/14/2023 This Material is unchanged as of this date.
02/12/2024 This Material is unchanged as of this date.
08/12/2024 This Material is unchanged as of this date.
02/25/2025 This Material is unchanged as of this date.
09/15/2025 This Material is unchanged as of this date.

CLASSROOMS 19-23 BUILDING (BUILDING G)**SPEECH ROOM, AND READING ROOM**

WALL TILE

640 SF

P: Less Than 50% No Debris**W:** No EvidenceDAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

11/05/2007 1'x1' Glued-on Tan Wall and Ceiling Tile. ~320 SF in each RoomDamage: <50% Physical Damage - Tiles Damaged in both Rooms on both Walls and Ceiling. This Material is in POOR condition as of this date.
11/30/2011 Additional Damage observed - in the form of Speech Room has 1 Tile loose. No other changes as of this date.
08/25/2017 Additional Damage Observed. Speech Room now has 4 Tiles Loose. No other changes as of this date.
02/04/2020 This Material is unchanged as of this date.
08/26/2020 This Material is unchanged as of this date.
02/08/2021 This Material is unchanged as of this date.
08/09/2021 This Material is unchanged as of this date.
02/16/2022 This Material is unchanged as of this date.
08/15/2022 This Material is unchanged as of this date.
02/13/2023 This Material is unchanged as of this date.
08/14/2023 This Material is unchanged as of this date.
02/12/2024 This Material is unchanged as of this date.
08/12/2024 This Material is unchanged as of this date.
02/25/2025 This Material is unchanged as of this date.
09/15/2025 This Material is unchanged as of this date.

DAMAGE REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

CLASSROOMS 24-37 - FLEXIBLE INSTRUCTIONAL SPACE (BUILDING I)

CLASSROOMS 24-37 - FLEXIBLE INSTRUCTIONAL SPACE (BUILDING I)

CLASSROOMS 24, 25, 32, AND 34

MORTAR MISCELLANEOUS

415 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

11/30/2011	Grout/Mortar for 2"x2" Blue Ceramic Floor Tiles. This Material is in GOOD condition as of this date.
03/18/2015	In Classroom 24, 3 Ceramic Floor Tiles are missing and the Mortar is exposed. Friability changed from Non-Friable to Friable. This Material is in FAIR condition as of this date.
09/12/2016	Additional Damage observed. Rooms 24 and 25 have cracked Tiles and cracked Mortar. No other changes as of this date.
02/04/2020	This Material is unchanged as of this date.
08/26/2020	This Material is unchanged as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.
08/15/2022	This Material is unchanged as of this date.
02/13/2023	This Material is unchanged as of this date.
08/14/2023	This Material is unchanged as of this date.
02/12/2024	This Material is unchanged as of this date.
08/12/2024	This Material is unchanged as of this date.
02/25/2025	This Material is unchanged as of this date.
09/15/2025	This Material is unchanged as of this date.

CLASSROOMS 24-37 - FLEXIBLE INSTRUCTIONAL SPACE (BUILDING I)

ENTIRE BUILDING (INCLUDING RESTROOMS)

SMOOTH WALL MISCELLANEOUS

35,800 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/06/2005	Gypsum Wallboard System Walls and Ceilings. This Material is in GOOD condition as of this date.
10/10/2012	Material Re-Assessed and approximately 300 SF Removed and Replaced with New in Mechanical Rooms and Room 36. No other changes as of this date.
02/04/2020	This Material is unchanged as of this date.

DAMAGE REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RISK ASSESSMENT CATEGORY

COMMENTS

QTY
(APPROXIMATE)

PHYSICAL DAMAGE (P:)
WATER DAMAGE (W:)

08/26/2020	Additional Damage Observed. 3 SF of Cracks and Holes on Wall, Gypsum Exposed in Library Computer Lab. No other changes as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.
08/15/2022	This Material is unchanged as of this date.
02/13/2023	This Material is unchanged as of this date.
08/14/2023	This Material is unchanged as of this date.
02/12/2024	This Material is unchanged as of this date.
08/12/2024	This Material is unchanged as of this date.
02/25/2025	This Material is unchanged as of this date.
09/15/2025	This Material is unchanged as of this date.

CLASSROOMS 24-37 - FLEXIBLE INSTRUCTIONAL SPACE (BUILDING I)

ENTIRE BUILDING (INCLUDING RESTROOMS)

SMOOTH WALL SURFACING

35,500 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

08/23/2006	Skim coat for Gypsum Wallboard System Walls and Ceilings. This Material is in GOOD condition as of this date.
10/10/2012	Material Re-Assessed and approximately 300 SF Removed and Replaced with New in Mechanical Rooms and Room 36. No other changes as of this date.
02/04/2020	This Material is unchanged as of this date.
08/26/2020	Additional Damage Observed. 3 SF of Cracks and Holes on Wall, Gypsum Exposed in Library Computer Lab. No other changes as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.
08/15/2022	This Material is unchanged as of this date.
02/13/2023	This Material is unchanged as of this date.
08/14/2023	This Material is unchanged as of this date.
02/12/2024	This Material is unchanged as of this date.
08/12/2024	This Material is unchanged as of this date.

DAMAGE REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RISK ASSESSMENT CATEGORY

COMMENTS

QTY
(APPROXIMATE)

PHYSICAL DAMAGE (P:)
WATER DAMAGE (W:)

02/25/2025 This Material is unchanged as of this date.

09/15/2025 This Material is unchanged as of this date.

CLASSROOMS 24-37 - FLEXIBLE INSTRUCTIONAL SPACE (BUILDING I)

LIBRARY SECTION OF THE BUILDING

WINDOW CAULKING

240 LF

P: Less Than 50% No Debris

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

05/13/2009 Sealant/Caulking on Exterior Windows. This Material is in GOOD condition as of this date.

08/25/2017 Damage Observed. >25% Physical Damage - in the form of 15 Windows with Cracked, Dry Material. Material Condition changed from GOOD to FAIR. Friability changed from NON to FRIABLE. No other changes as of this date.

02/04/2020 This Material is unchanged as of this date.

08/26/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/16/2022 This Material is unchanged as of this date.

08/15/2022 This Material is unchanged as of this date.

02/13/2023 This Material is unchanged as of this date.

08/14/2023 This Material is unchanged as of this date.

02/12/2024 This Material is unchanged as of this date.

08/12/2024 This Material is unchanged as of this date.

02/25/2025 This Material is unchanged as of this date.

09/15/2025 This Material is unchanged as of this date.

CLASSROOMS 24-37 - FLEXIBLE INSTRUCTIONAL SPACE (BUILDING I)

MECHANICAL ROOM AT REAR OF CLASSROOM 25

CEMENTITIOUS PIPE/FLUE

1 LF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

05/13/2009 4" O.D. Cementitious Pipe. Material is inside Slab Floor in Mechanical Room by Classroom 32. . This Material is in GOOD condition as of this date.

03/03/2014 <5% Physical Damage overall. Friability changed from Non-Friable to Friable. This Material is in FAIR condition as of this date.

02/04/2020 This Material is unchanged as of this date.

DAMAGE REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RISK ASSESMENT CATEGORY

COMMENTS

QTY
(APPROXIMATE)

PHYSICAL DAMAGE (P:)
WATER DAMAGE (W:)

08/26/2020 This Material is unchanged as of this date.
02/08/2021 This Material is unchanged as of this date.
08/09/2021 This Material is unchanged as of this date.
02/16/2022 This Material is unchanged as of this date.
08/15/2022 This Material is unchanged as of this date.
02/13/2023 This Material is unchanged as of this date.
08/14/2023 This Material is unchanged as of this date.
02/12/2024 This Material is unchanged as of this date.
08/12/2024 This Material is unchanged as of this date.
02/25/2025 This Material is unchanged as of this date.
09/15/2025 This Material is unchanged as of this date.

CLASSROOMS 24-37 - FLEXIBLE INSTRUCTIONAL SPACE (BUILDING I)

ROOMS 33, 34, AND 36 (BAND ROOM)

CEILING TILE

4,426 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/06/2005 1'x1' Glued-On Ceiling Tile. This Material is in GOOD condition as of this date.
10/10/2012 Approximately 42 SF of Material Removed in Classroom 36. Quantity changed from 4,468 SF to 4,426 SF. No other changes as of this date.
09/12/2016 Damage observed. <5% Physical Damage - Room 36 has 2 Tiles coming loose. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.
02/04/2020 This Material is unchanged as of this date.
08/26/2020 This Material is unchanged as of this date.
02/08/2021 This Material is unchanged as of this date.
08/09/2021 This Material is unchanged as of this date.
02/16/2022 This Material is unchanged as of this date.
08/15/2022 This Material is unchanged as of this date.
02/13/2023 This Material is unchanged as of this date.
08/14/2023 This Material is unchanged as of this date.
02/12/2024 This Material is unchanged as of this date.

DAMAGE REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RISK ASSESSMENT CATEGORY

COMMENTS

QTY

(APPROXIMATE)

PHYSICAL DAMAGE (P:)

WATER DAMAGE (W:)

08/12/2024 This Material is unchanged as of this date.

02/25/2025 This Material is unchanged as of this date.

09/15/2025 This Material is unchanged as of this date.

CLASSROOMS 24-37 - FLEXIBLE INSTRUCTIONAL SPACE (BUILDING I)

ROOMS 33, 34, AND 36 (BAND ROOM)

CEILING TILE MASTIC

4,426 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/06/2005 Mastic/Adhesive for 1'x1' Glued-On Ceiling Tile. This Material is in GOOD condition as of this date.

10/10/2012 Approximately 42 SF of Material Removed in Classroom 36. Quantity changed from 4,468 SF to 4,426 SF. No other changes as of this date.

09/12/2016 Damage observed. Damage: <5% Physical Damage - Room 36 has 2 Tiles coming loose. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.

02/04/2020 This Material is unchanged as of this date.

08/26/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/16/2022 This Material is unchanged as of this date.

08/15/2022 This Material is unchanged as of this date.

02/13/2023 This Material is unchanged as of this date.

08/14/2023 This Material is unchanged as of this date.

02/12/2024 This Material is unchanged as of this date.

08/12/2024 This Material is unchanged as of this date.

02/25/2025 This Material is unchanged as of this date.

09/15/2025 This Material is unchanged as of this date.

CLASSROOMS 24-37 - FLEXIBLE INSTRUCTIONAL SPACE (BUILDING I)

STORAGE CLOSETS, AND TWO MECHANICAL ROOMS

FIRE DOOR CORE INSULATION

126 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/06/2005 Fire Door Core Insulation. (3 EA FIRE DOORS). This Material is in GOOD condition as of this date.

DAMAGE REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME		QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
LOCATION	MATERIAL TYPE		
RISK ASSESMENT CATEGORY			
COMMENTS			
08/23/2006	Two Mechanical Rooms added to location (3 more doors). 63 SF added to location. Quantity changed from 63 SF to 126 SF. This Material is unchanged as of this date.		
03/27/2017	Damage Observed. <5% Physical Damage - in the form of Door Broken, Core Material Exposed. in a 3" hole. Material condition changed from GOOD to FAIR overall. No other changes as of this date.		
02/04/2020	This Material is unchanged as of this date.		
08/26/2020	This Material is unchanged as of this date.		
02/08/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/16/2022	This Material is unchanged as of this date.		
08/15/2022	This Material is unchanged as of this date.		
02/13/2023	This Material is unchanged as of this date.		
08/14/2023	This Material is unchanged as of this date.		
02/12/2024	This Material is unchanged as of this date.		
08/12/2024	This Material is unchanged as of this date.		
02/25/2025	This Material is unchanged as of this date.		
09/15/2025	This Material is unchanged as of this date.		

DAMAGE REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME**LOCATION****MATERIAL TYPE****RISK ASSESSMENT CATEGORY****COMMENTS****QTY**
(APPROXIMATE)**PHYSICAL DAMAGE (P:)**
WATER DAMAGE (W:)**CLASSROOMS P2 (BUILDING M)-P3 (BUILDING N) PORTABLE BUILDINGS****CLASSROOMS P2 (BUILDING M)-P3 (BUILDING N) PORTABLE BUILDINGS**

PORTABLE P2

PRESSED WOOD WALL PANEL

1,800 SF

P: Less Than 5%**W:** No EvidenceDAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/06/2005	4'x10' Pressed Wood Wall Panel, (with Vinyl Wall Cover). This Material is in GOOD condition as of this date.
08/25/2017	Damage Observed. <5% Physical Damage - in the form of 5 Small Holes in Classroom P2. Material Condition changed from GOOD to FAIR. Friability changed from NON to MODERATE. No other changes as of this date.
02/04/2020	This Material is unchanged as of this date.
08/26/2020	This Material is unchanged as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.
08/15/2022	This Material is unchanged as of this date.
02/13/2023	This Material is unchanged as of this date.
08/14/2023	This Material is unchanged as of this date.
02/12/2024	This Material is unchanged as of this date.
08/12/2024	This Material is unchanged as of this date.
02/25/2025	This Material is unchanged as of this date.
09/15/2025	This Material is unchanged as of this date.

DAMAGE REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

GYM BUILDING (BUILDING E)

GYM BUILDING (BUILDING E)

BOILER ROOM, COACHES OFFICE, STORAGE ROOMS, GYM, BOYS' LOCKER ROOM AND GIRLS' LOCKER ROOM

SMOOTH WALL MISCELLANEOUS

10,400 SF

P: No Visible Damage

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/06/2005	Gypsum Wallboard System Walls and Ceilings. Existing Gypsum Wallboard Systems Removed and Replaced with new in-kind in Path-of-Construction. This Material is in GOOD condition as of this date.
09/16/2015	Location Description changed from 'BOILER ROOM, COACHES OFFICE, STORAGE ROOMS, AND GYM' to 'BOILER ROOM, COACHES OFFICE, STORAGE ROOMS, GYM, BOYS' LOCKER ROOM AND GIRLS' LOCKER ROOM '. Material quantity changed from 8,400 SF to 10,400 SF. No other change as of this date.
02/04/2020	This Material is unchanged as of this date.
08/26/2020	This Material is unchanged as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.
08/15/2022	Damages Observed. <5% Physical Damage in the form of 2 SF of Loose, Bubbling Skim Coat and Paint on Wall and Ceiling of Gym Storage Room. Material condition changed from GOOD to FAIR overall. Friability updated from Non-Friable to Friable. No other changes as of this date.
02/13/2023	This Material is unchanged as of this date.
08/14/2023	This Material is unchanged as of this date.
02/12/2024	This Material is unchanged as of this date.
08/12/2024	This Material is unchanged as of this date.
02/25/2025	This Material is unchanged as of this date.
09/15/2025	This Material is unchanged as of this date.

GYM BUILDING (BUILDING E)

BOILER ROOM, COACHES OFFICE, STORAGE ROOMS, GYM, BOYS' LOCKER ROOM AND GIRLS' LOCKER ROOM

SMOOTH WALL SURFACING

10,400 SF

P: No Visible Damage

W: No Evidence

DAMAGED FRIABLE SURFACING ACM

09/06/2005	Skim Coat for Gypsum Wallboard System Walls and Ceilings. Existing Gypsum Wallboard Systems Removed and Replaced with new in-kind in Path-of-Construction. This Material is in GOOD condition as of this date.
------------	--

DAMAGE REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RISK ASSESSMENT CATEGORY

COMMENTS

QTY

(APPROXIMATE)

PHYSICAL DAMAGE (P:)

WATER DAMAGE (W:)

09/16/2015	Location Description changed from 'BOILER ROOM, COACHES OFFICE, STORAGE ROOMS, AND GYM' to 'BOILER ROOM, COACHES OFFICE, STORAGE ROOMS, GYM, BOYS' LOCKER ROOM AND GIRLS' LOCKER ROOM '. Material quantity changed from 8,400 SF to 10,400 SF. No other change as of this date.
02/04/2020	This Material is unchanged as of this date.
08/26/2020	This Material is unchanged as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.
08/15/2022	Damages Observed. <5% Physical Damage in the form of 2 SF of Loose, Bubbling Skim Coat and Paint on Wall and Ceiling of Gym Storage Room. Material condition changed from GOOD to FAIR overall. Friability updated from Non-Friable to Friable. No other changes as of this date.
02/13/2023	This Material is unchanged as of this date.
08/14/2023	This Material is unchanged as of this date.
02/12/2024	This Material is unchanged as of this date.
08/12/2024	This Material is unchanged as of this date.
02/25/2025	This Material is unchanged as of this date.
09/15/2025	This Material is unchanged as of this date.

GYM BUILDING (BUILDING E)

BOYS' AND GIRLS' SHOWERS, AND COACHES RESTROOMS

MORTAR MISCELLANEOUS

700 SF

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

10/14/2008	Grout for 4"x4" Multi-Colored Ceramic Wall Tiles. This Material is in GOOD condition as of this date.
02/04/2020	This Material is unchanged as of this date.
08/26/2020	Damage Observed. <5% Physical Damage - in the form of 2 Broken Tiles and 4 Tiles with Missing Grout in Girls' Locker Room by Water Fountain. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.
08/15/2022	This Material is unchanged as of this date.
02/13/2023	This Material is unchanged as of this date.
08/14/2023	This Material is unchanged as of this date.

DAMAGE REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

RISK ASSESSMENT CATEGORY

COMMENTS

QTY
(APPROXIMATE)

PHYSICAL DAMAGE (P:)
WATER DAMAGE (W:)

02/12/2024 This Material is unchanged as of this date.

08/12/2024 This Material is unchanged as of this date.

02/25/2025 This Material is unchanged as of this date.

09/15/2025 This Material is unchanged as of this date.

GYM BUILDING (BUILDING E)

BOYS' AND GIRLS' SHOWERS AND LOCKER ROOMS

PLASTER WALL

4,320 SF

P: Less Than 5%

W: <10% Stains or Flaking

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/06/2005 Plaster Walls and Ceilings. This Material is in GOOD condition as of this date.

11/30/2011 Damage Observed. <10% Water Damage - in the form of Water Damage observed on Ceiling of Girls' Shower Area. Material condition changed from GOOD to FAIR overall as of this date. Friability changed from Non-Friable to Friable to reflect this change.

02/04/2020 This Material is unchanged as of this date.

08/26/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/16/2022 This Material is unchanged as of this date.

08/15/2022 This Material is unchanged as of this date.

02/13/2023 This Material is unchanged as of this date.

08/14/2023 This Material is unchanged as of this date.

02/12/2024 This Material is unchanged as of this date.

08/12/2024 This Material is unchanged as of this date.

02/25/2025 This Material is unchanged as of this date.

09/15/2025 This Material is unchanged as of this date.

GYM BUILDING (BUILDING E)

BOYS' AND GIRLS' SHOWERS AND LOCKER ROOMS

PLASTER WALL SURFACING

4,320 SF

P: Less Than 5%

W: <10% Stains or Flaking

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/06/2005 Skim Coat for Plaster Walls and Ceilings. This Material is in GOOD condition as of this date.

DAMAGE REPORT FOR

PIEDMONT MIDDLE SCHOOL

BUILDING NAME		QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
LOCATION	MATERIAL TYPE		
RISK ASSESMENT CATEGORY			
COMMENTS			
11/30/2011	Damage: <10% Water Damage - in the form of water damage observed on Ceiling of Girls' Shower Area. Material condition changed from GOOD to FAIR overall as of this date. Friability changed from Non-Friable to Friable to reflect this change.		
02/04/2020	This Material is unchanged as of this date.		
08/26/2020	This Material is unchanged as of this date.		
02/08/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/16/2022	This Material is unchanged as of this date.		
08/15/2022	This Material is unchanged as of this date.		
02/13/2023	This Material is unchanged as of this date.		
08/14/2023	This Material is unchanged as of this date.		
02/12/2024	This Material is unchanged as of this date.		
08/12/2024	This Material is unchanged as of this date.		
02/25/2025	This Material is unchanged as of this date.		
09/15/2025	This Material is unchanged as of this date.		

End Of Report, Total Of 38 Pages

Piedmont Middle School

18 Maio	17 Donovan	16 Umali
------------	---------------	-------------

Girl's Locker Room	Boy's Locker Room
Mini Gym	

P1	P2	P3	P4
----	----	----	----

35
Social
Worker

ISO rm	19 Malno	20 Pridham	21 Balsbaugh	22 Sullivan	23 Inam
Speech					

Cargo
bins

B	G	13 Capili	14 Phillips	15 Segoviano
---	---	--------------	----------------	-----------------

9 Storage	8 ROCK	7 Lee	6 Burke	5 Wolter- beek	4 ISO
--------------	-----------	----------	------------	----------------------	----------

Store	12 Suarez	11 Locke	10 Valdez
-------	--------------	-------------	--------------

QUAD

PIEDMONT MIDDLE SCHOOL INSPECTED ON: 9-15-25					
G	B	24 Dajani	25 Durant	Storage	Library
32 Martinez	33 FIS	34 Yparra- guirre	35 ART	36 Schadeck	37 Leader- ship


Main Office	Chorus Wilson	Storage	Multi-Purpose Room	Kitchen	Service Yard
----------------	------------------	---------	-----------------------	---------	-----------------

3 Gin	2 Caronon- gan	1 Sanyal
----------	----------------------	-------------

B	G
---	---

Cargo
bins

Piedmont Middle School

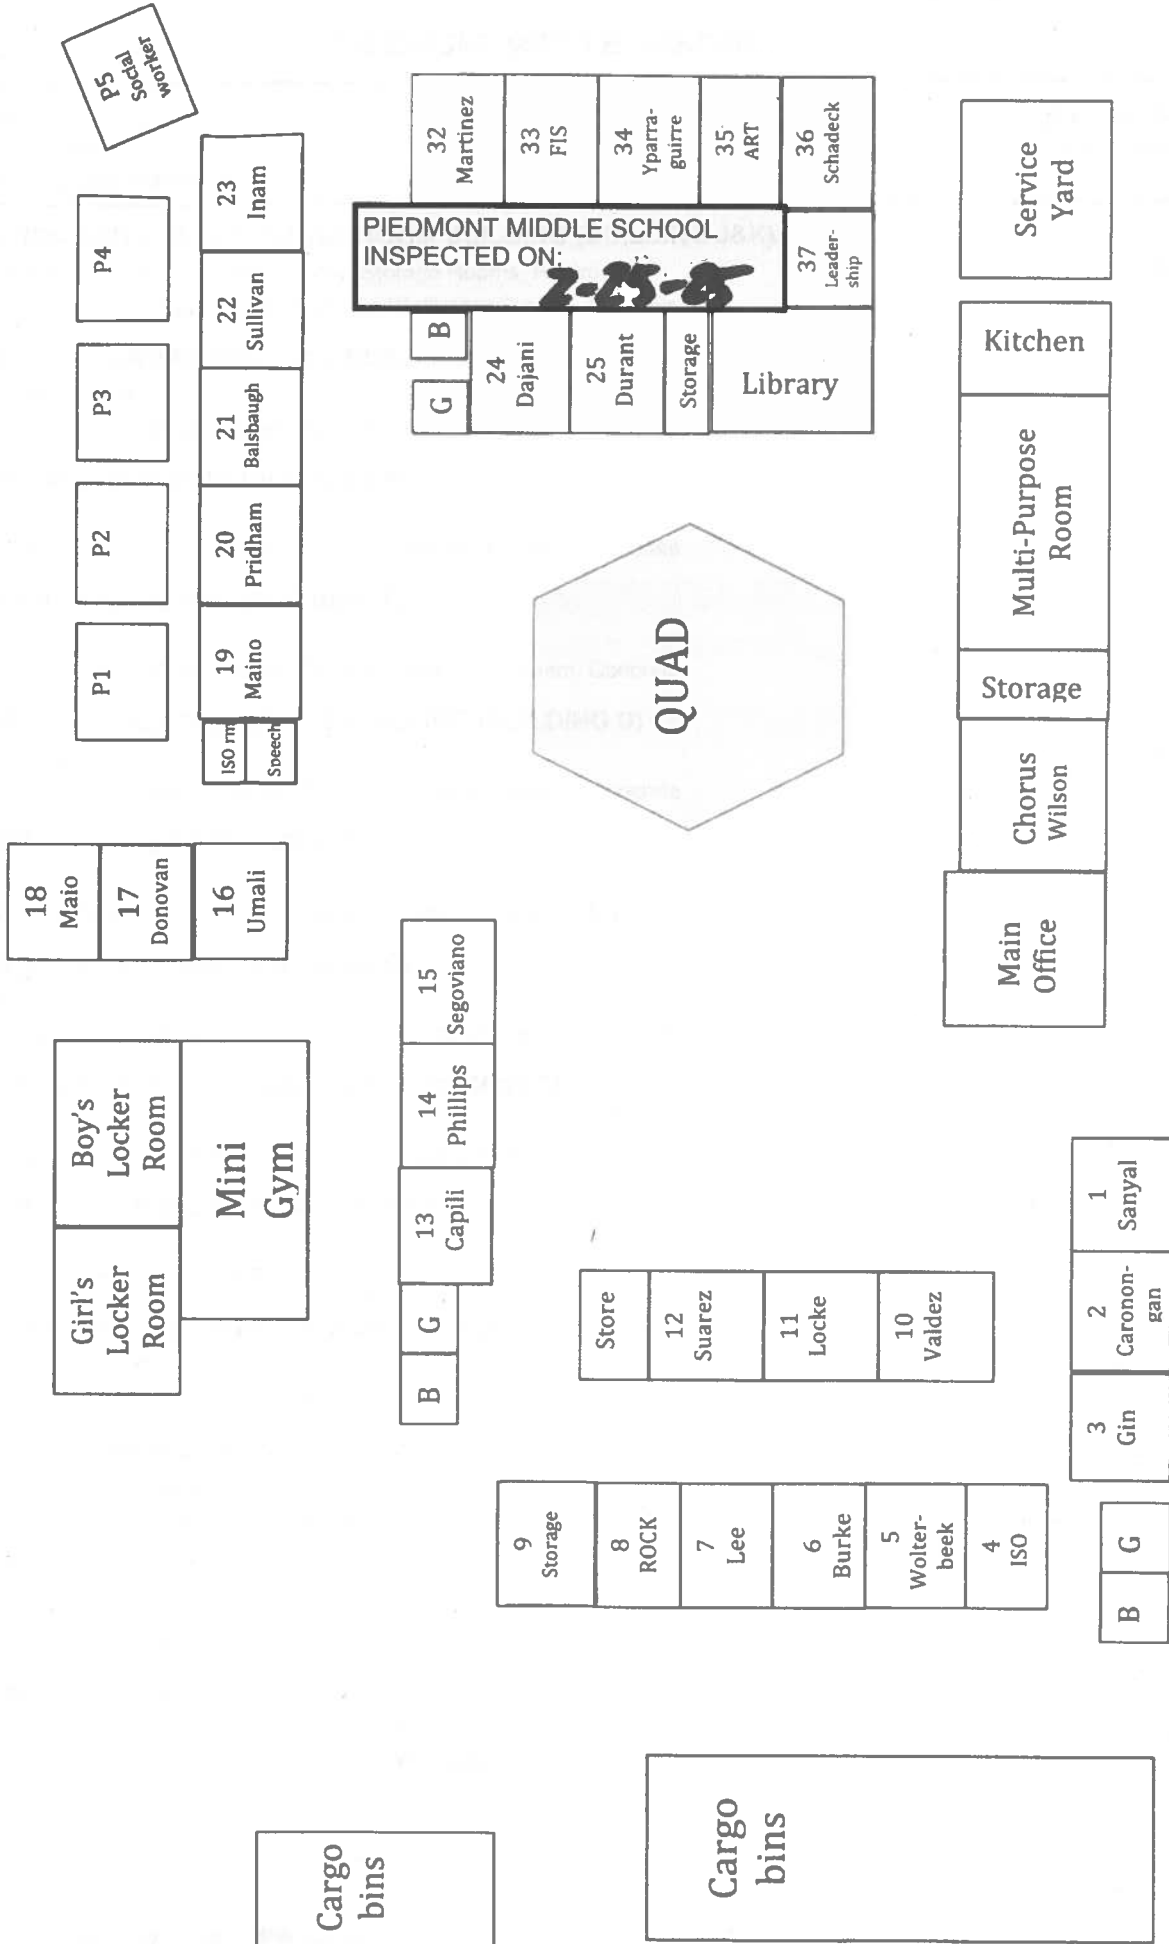

Piedmont Middle School

18 Maio	17 Donovan	16 Umali
------------	---------------	-------------

Girl's Locker Room	Boy's Locker Room
Mini Gym	

P1	P2	P3	P4
----	----	----	----

P5
Social
Worker


ISO rm	19 Maino	20 Pridham	21 Balsbaugh	22 Sullivan	23 Inam
Speech					

Cargo
bins

B	G	13 Capili	14 Phillips	15 Segoviano
---	---	--------------	----------------	-----------------

9 Storage	8 ROCK	7 Lee	6 Burke	5 Wolter- beek	4 ISO
--------------	-----------	----------	------------	----------------------	----------

Store	12 Suarez	11 Locke	10 Valdez
-------	--------------	-------------	--------------

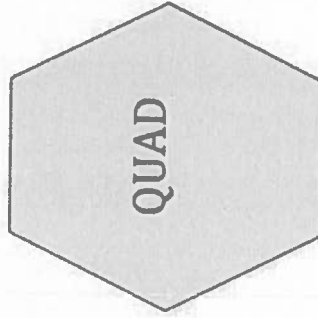

PIEDMONT MIDDLE SCHOOL INSPECTED ON: 8/12/24					
G	B	24 Dajani	25 Durant	Storage	Library
32 Martinez	33 FIS	34 Yparra- guirre	35 ART	36 Schadeck	37 Leader- ship


Main Office	Chorus Wilson	Storage	Multi-Purpose Room	Kitchen	Service Yard
----------------	------------------	---------	-----------------------	---------	-----------------

3 Gin	2 Caronon- gan	1 Sanyal
----------	----------------------	-------------

B	G
---	---

Cargo
bins

Piedmont Middle School

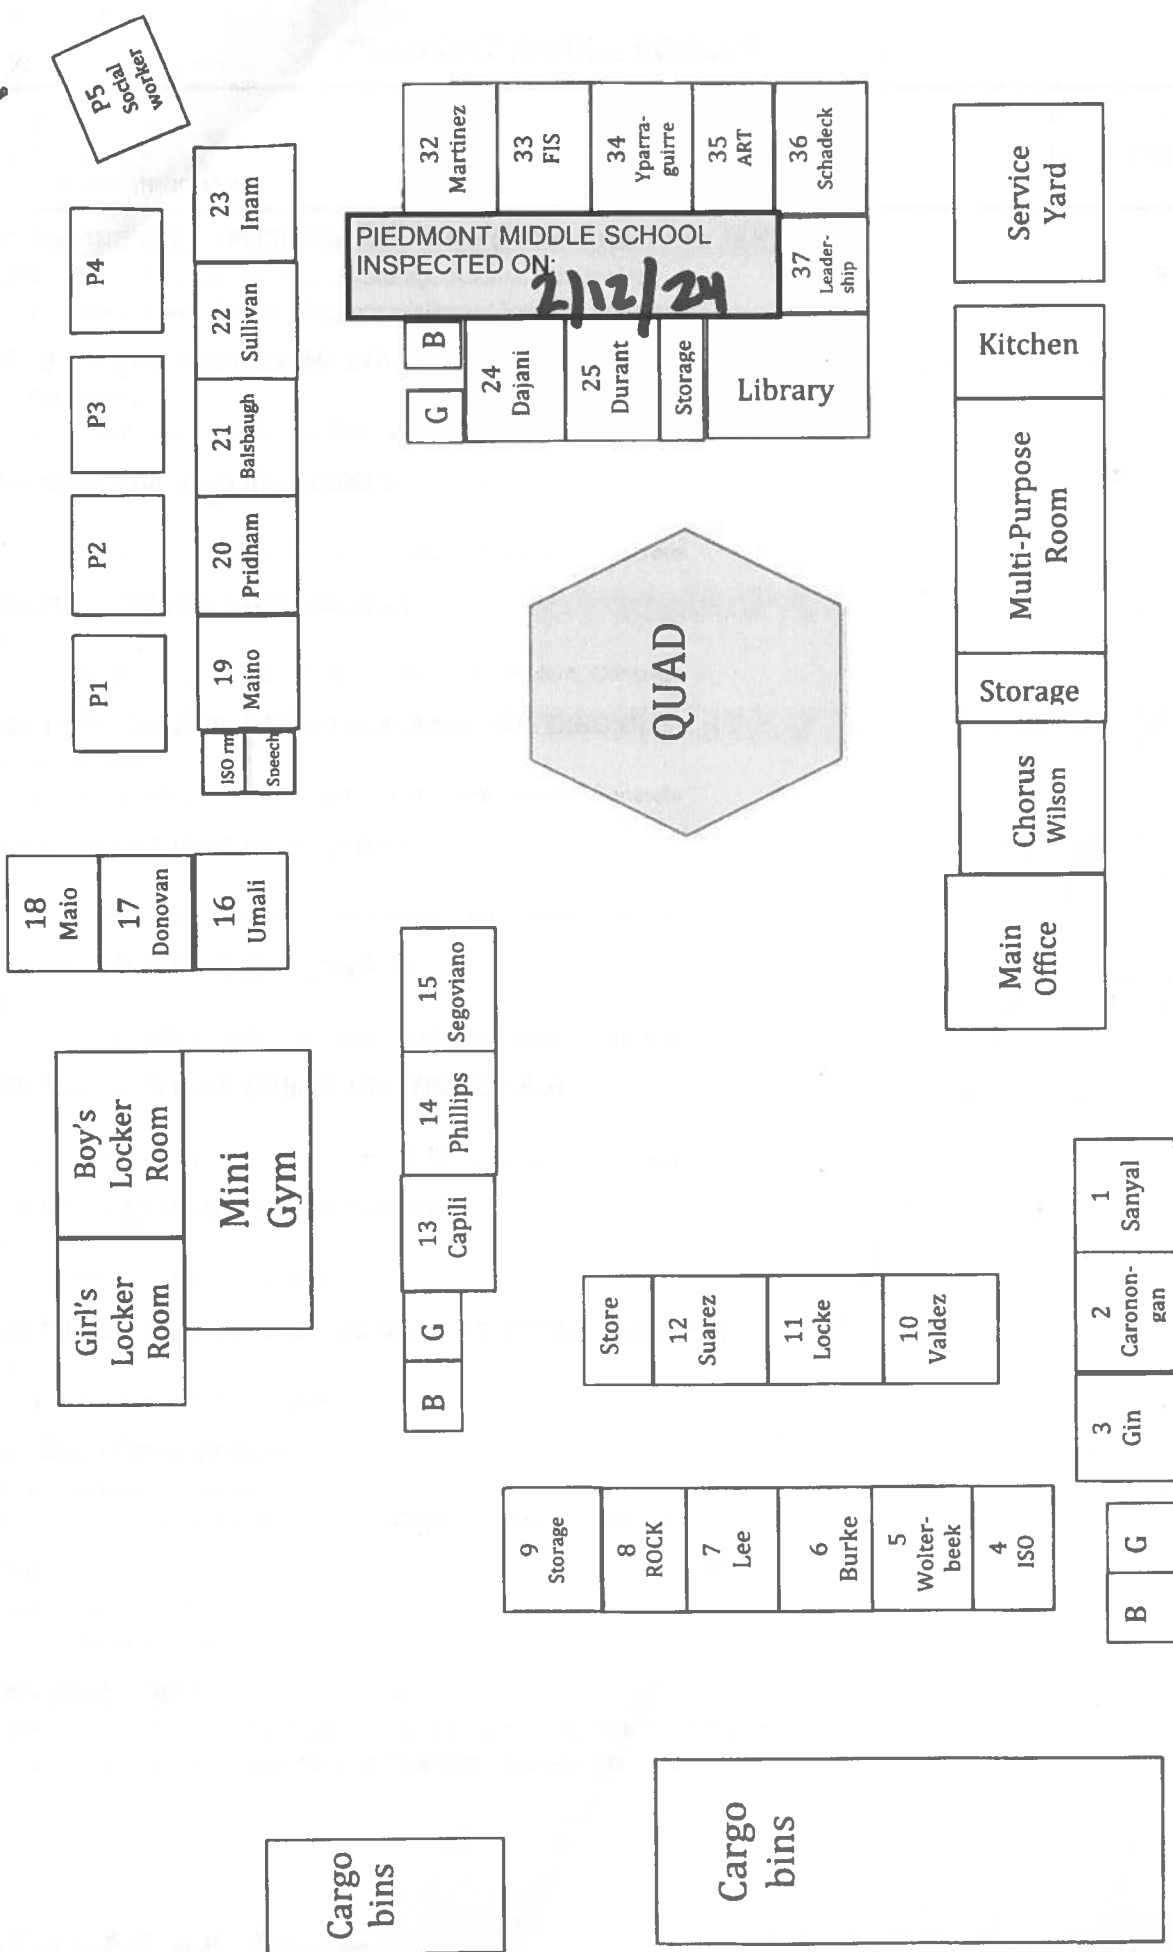

Piedmont Middle School

LANCER GYM

Girl's Locker Room

Boy's Locker Room

18
Maio

17
Donovan

16
Umalì

Mini Gym

B

G

13
Capili

14
Phan

15
Segoviano

Nurse

19
Maino

20
Pridham

21
Balsbaugh

22
Sullivan

23
Inam

Speech

P1

P2

P3

P4

P5
Social worker

Cargo bins

PIEDMONT MIDDLE SCHOOL
INSPECTED ON: 02-12-2024

9
Storage

8
ROCK

7
Lee

6
Burke

5
Wolter-beek

4
ISO

Store

12
Suarez

11
Locke

10
Valdez

QUAD

G

B

24
Sharma

25
Durant

Storage

Library

37
Leader-ship

32
Martinez

33
FIS

34
Yparra-guirre

35
ART

36
Schadeck

Cargo bins

B

G

3
Gin

2
Caronon-ran

1
Sanyal

Main Office

Chorus Wilson

Storage

Multi-Purpose Room

Kitchen

Service Yard

Piedmont Middle School

955 Piedmont Road

San Jose, CA 95132

(408) 923-1945

Basketball Courts

Volleyball Courts

Girl's Locker Room

Boy's Locker Room

Mini-Gym

18

17

16

26

27

28

29

30

31

P1

P2

P3

P4

P5

19

20

21

22

23

9

8

7

6

5

4

12

11

10

M

W

13

14

15

Quad Amphitheater

G

B

24

25

Library Student Resource Center

32

33

34

35

36

37

Office

Choir/Drama Room

Storage

Multipurpose Room

Kitchen

Service Yard

B

G

3

2


1

PIEDMONT MIDDLE SCHOOL
INSPECTED ON: 08-14-2023

Piedmont Road

Piedmont Middle School 955 Piedmont Road San Jose, CA 95132 (408) 923-1945

PIEDMONT MIDDLE SCHOOL
 INSPECTED ON: 2/13/23

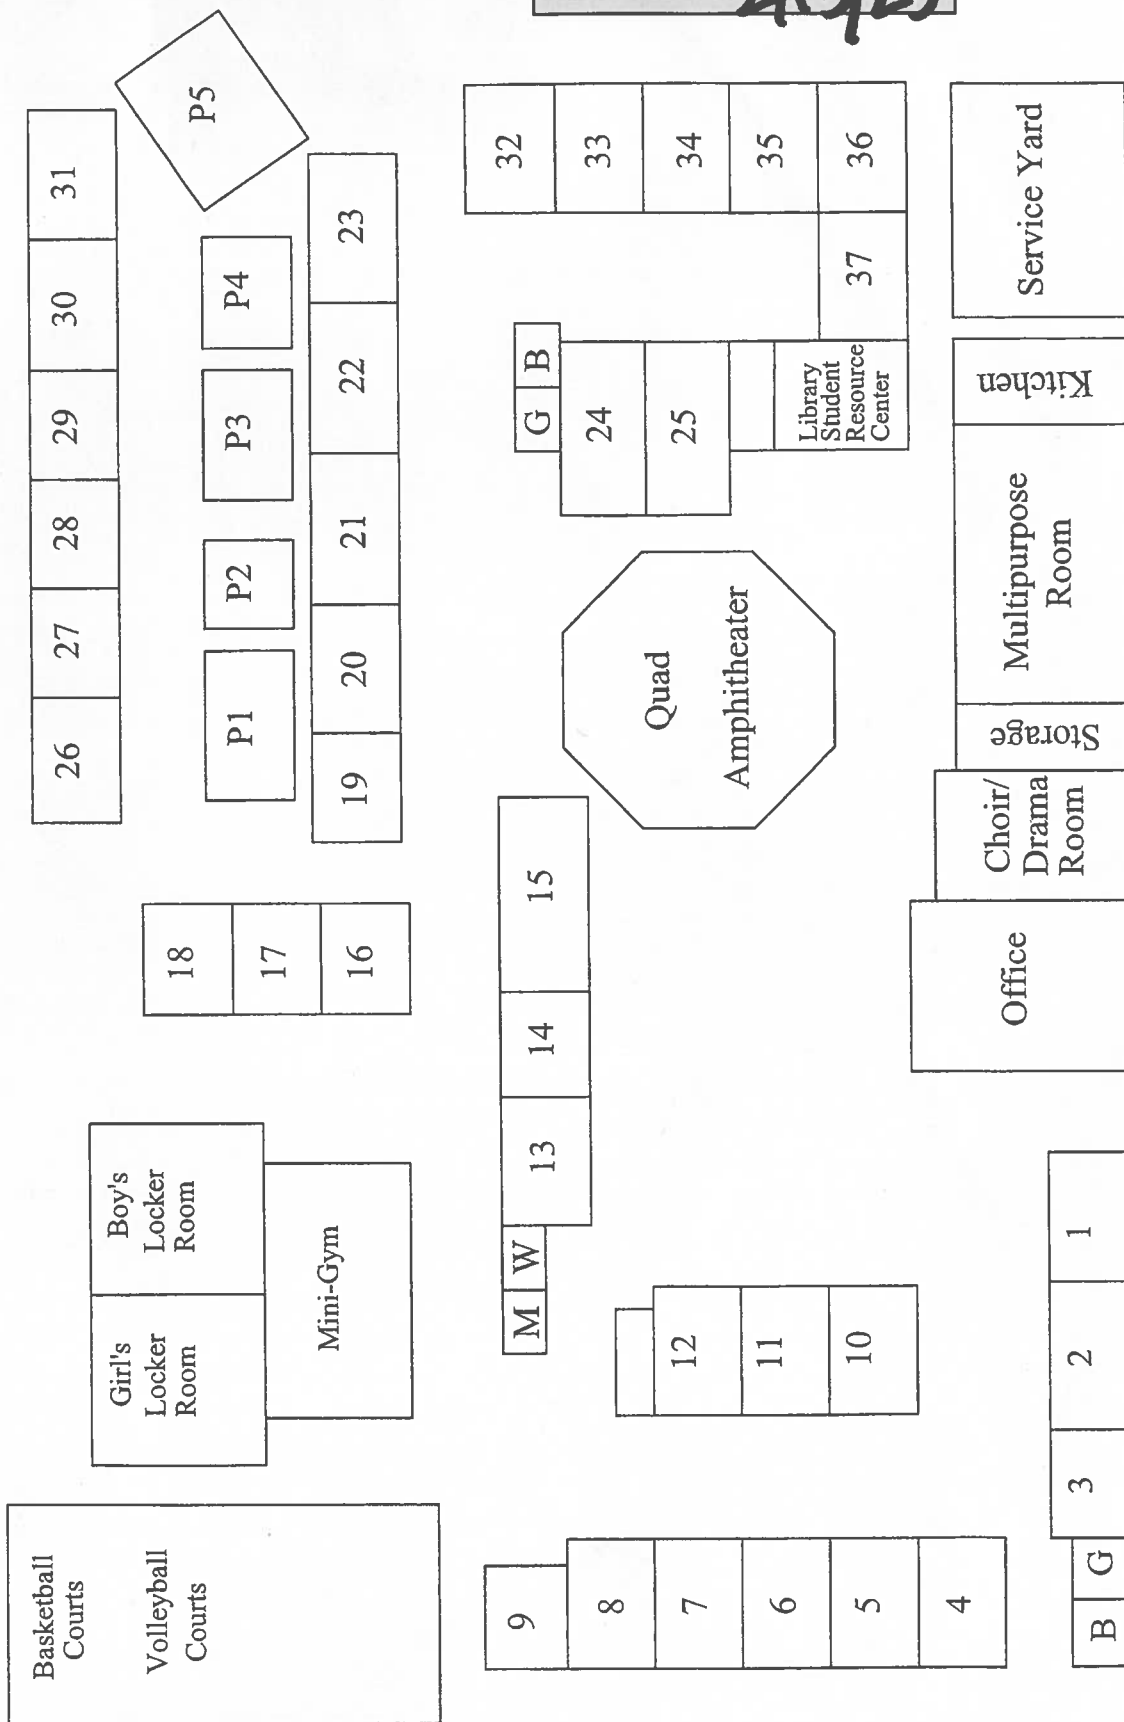

Piedmont Road

Piedmont Middle School


955 Piedmont Road

San Jose, CA 95132

(408) 923-1945



PIEDMONT MIDDLE SCHOOL
INSPECTED ON: 08-15-2022

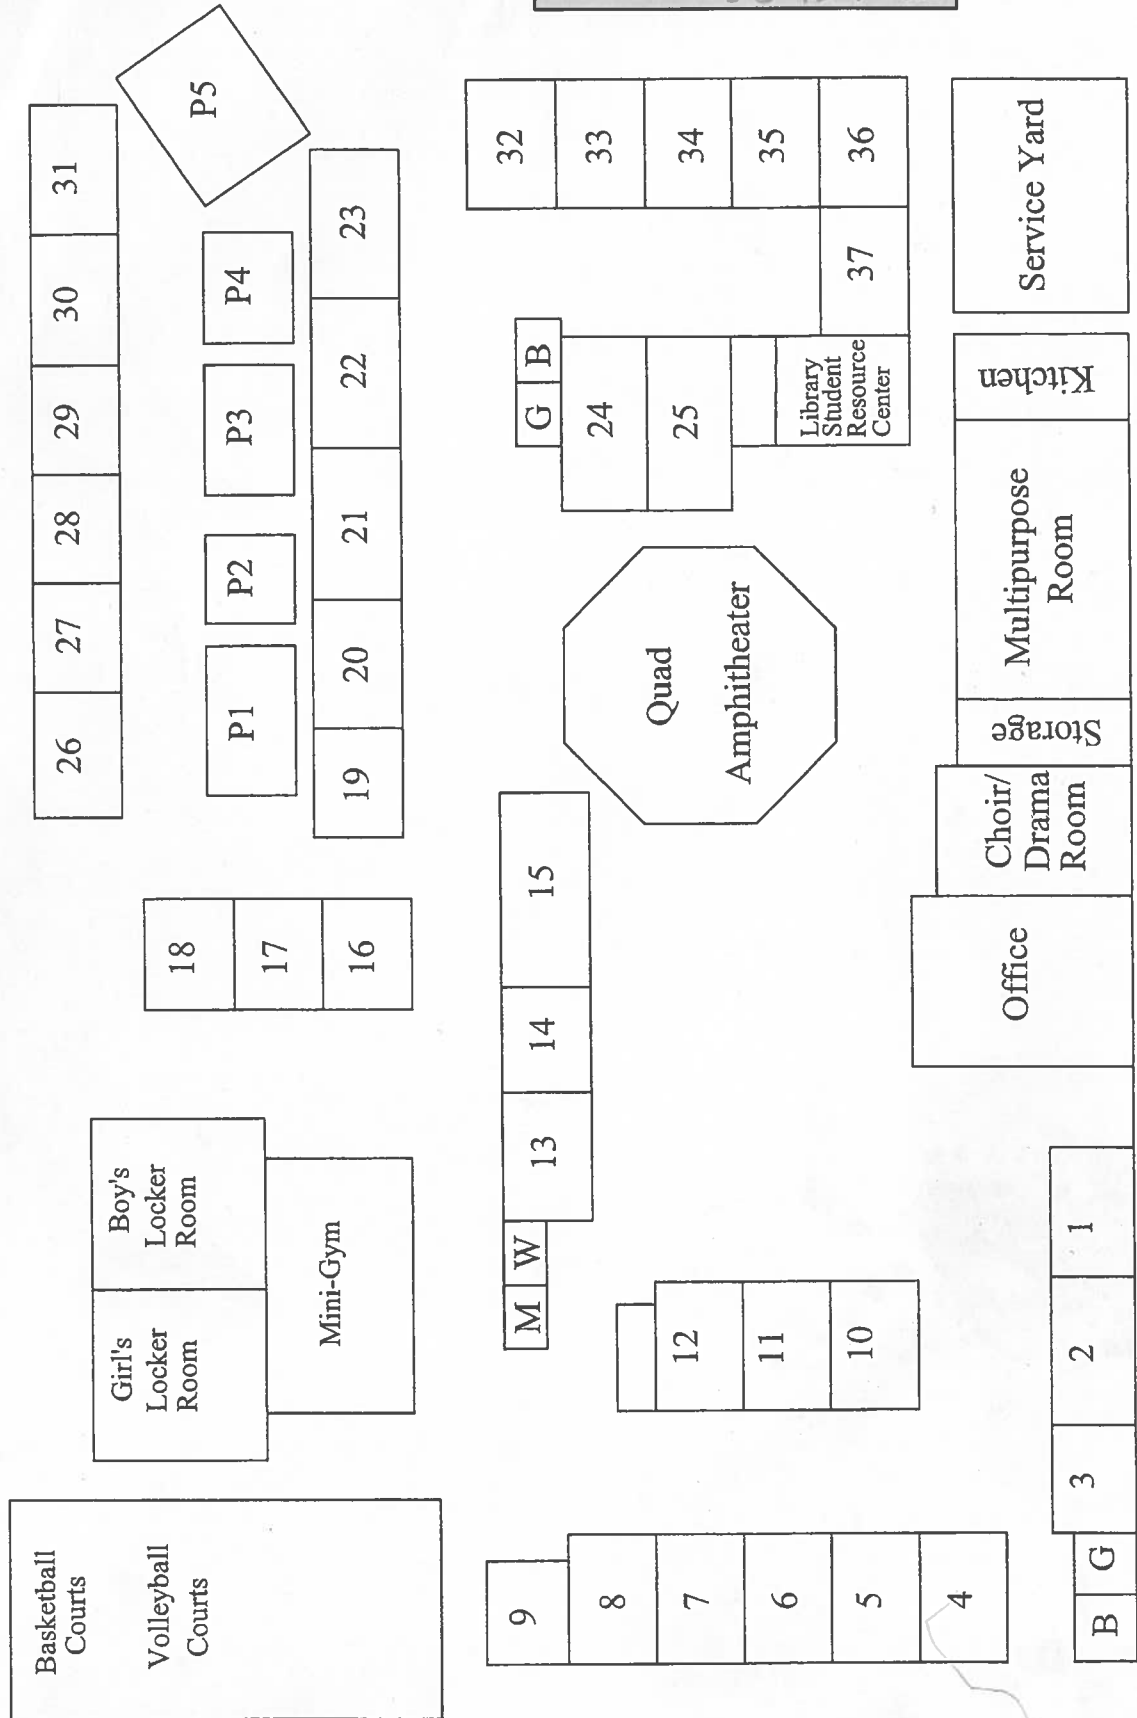

Piedmont Road

Volleyball Courts

Basketball Courts

Girl's Locker Room

Boy's Locker Room

Mini Gym

18 Maio

17 Donovan

16 Umali

26

27

28

29

30

31

P1 Maino

P2 Sullivan

P3 Yparaguire

P4 Pridham

P5 Social Worker

ISO rm

Speech

19

20

21 Balsbaugh

22

23 Inam

B

G

13 Capili

14 Phillips

15 Segoviano

9 storage

8 ROCK

7 Lee

6 Burke

5 Wolterbeek

4 TBD

Store

12 Suarez

11 Locke

10 Valdez

QUAD

PIEDMONT MIDDLE SCHOOL
INSPECTED ON: 08-15-2022

G

B

24 Swardenski

25 Durant

Storage

Library

32 Da

33 FIS

34

35 ART

36 Schadeck

37 Leadership

B

G

3 Gin

2 Caronongan

1 Sanyal

Main Office

Chorus Wilson

Storage


Multi-Purpose Room

Kitchen

Service Yard

Piedmont Middle School 955 Piedmont Road San Jose, CA 95132 (408) 923-1945

PIEDMONT MIDDLE SCHOOL
 INSPECTED ON: 02-16-2022

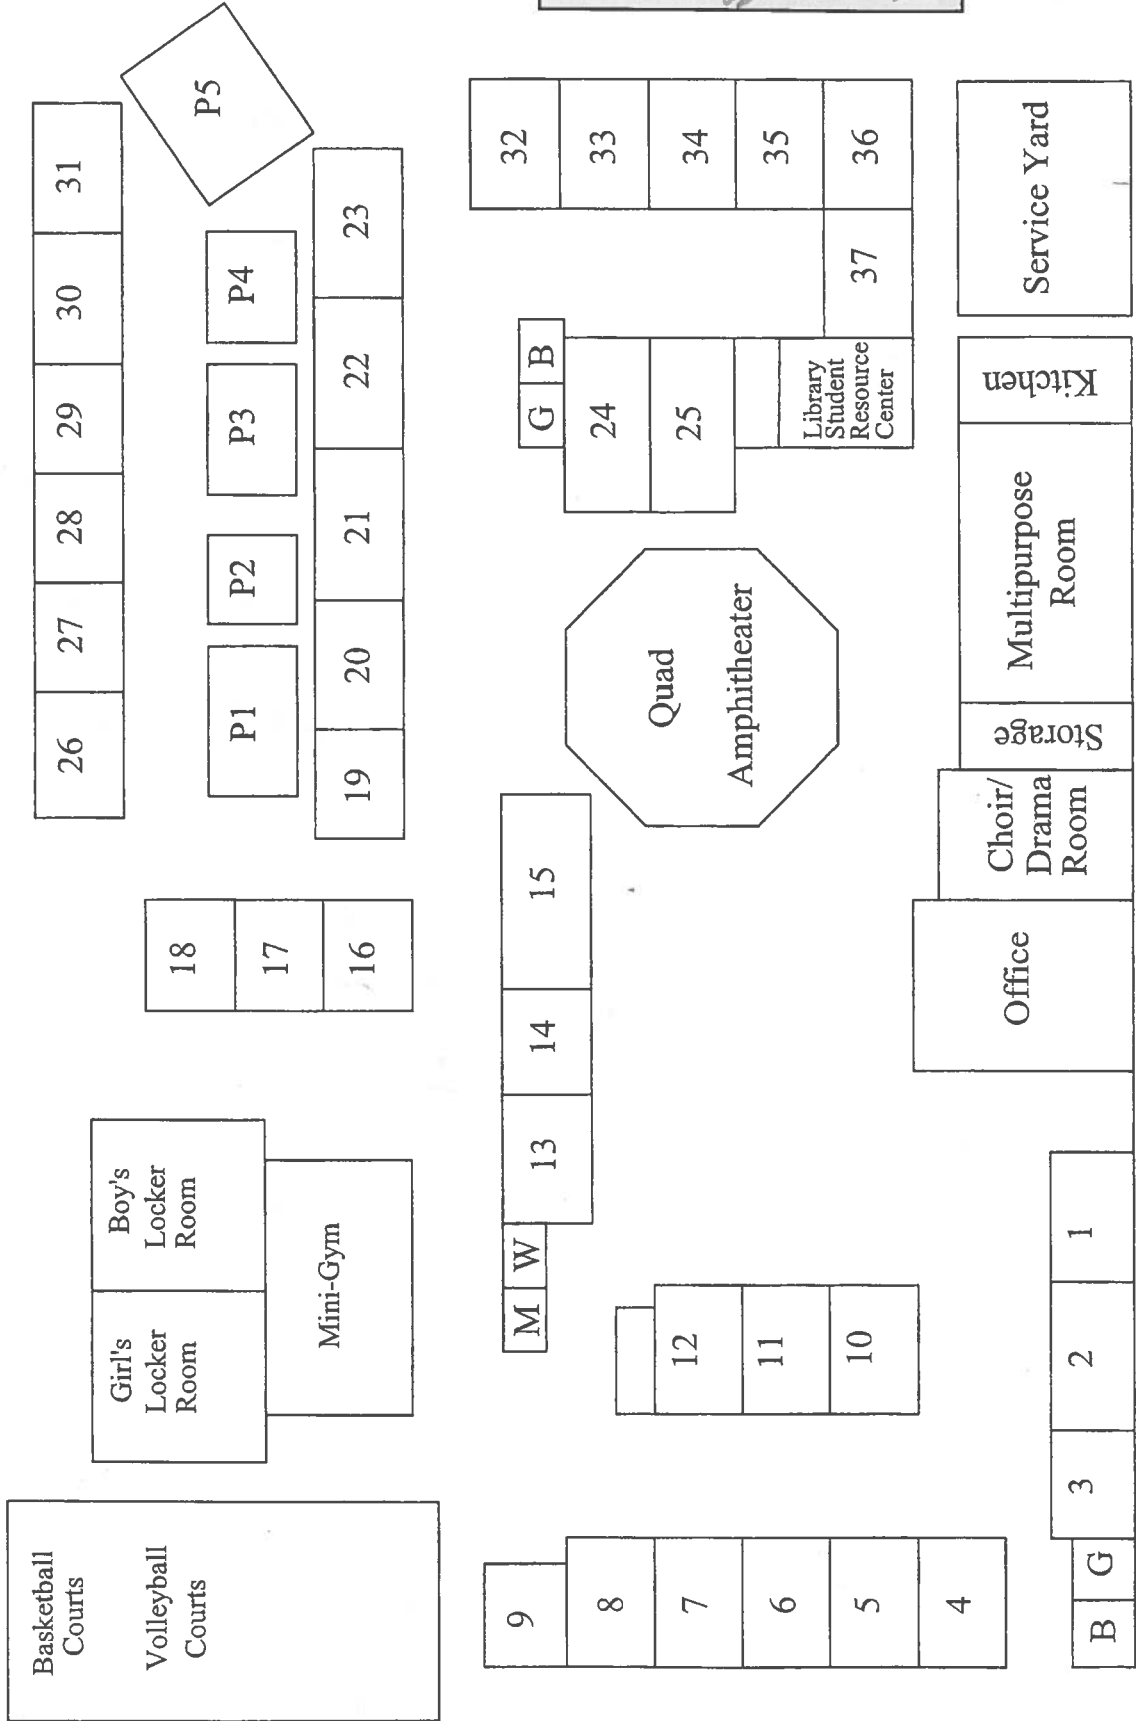

Piedmont Road

Piedmont Middle School 955 Piedmont Road San Jose, CA 95132 (408) 923-1945

Basketball Courts

Volleyball Courts

Girl's Locker Room

Boy's Locker Room

Mini-Gym

26

27

28

29

30

31

P5

P1

P2

P3

P4

19

20

21

22

23

18

17

16

9

8

7

6

5

4

12

11

10

M

W

13

14

15

Quad Amphitheater

G

B

24

25

32

33

34

35

36

37

Library Student Resource Center

Office

Choir/Drama Room

Storage

Multipurpose Room

Kitchen

Service Yard

B

G

3

2

1

PIEDMONT MIDDLE SCHOOL
 INSPECTED ON 8/9/21

Piedmont Road

Piedmont Middle School 955 Piedmont Road San Jose, CA 95132 (408) 923-1945

Basketball Courts

Volleyball Courts

Girl's Locker Room

Boy's Locker Room

Mini-Gym

18

17

16

26

27

28

29

30

31

P5

P1

P2

P3

P4

19

20

21

22

23

9

8

7

6

5

4

12

11

10

M

W

13

14

15

Quad Amphitheater

G

B

24

25

Library Student Resource Center

32

33

34

35

36

37

Office

Choir/Drama Room

Storage

Multipurpose Room

Kitchen

Service Yard

B

G

3

2

1

PIEDMONT MIDDLE SCHOOL
 INSPECTED ON: 2/8/21

Piedmont Road


Piedmont Middle School

955 Piedmont Road

San Jose, CA 95132

(408) 923-1945

PIEDMONT MIDDLE SCHOOL
INSPECTED ON: 8/26/20

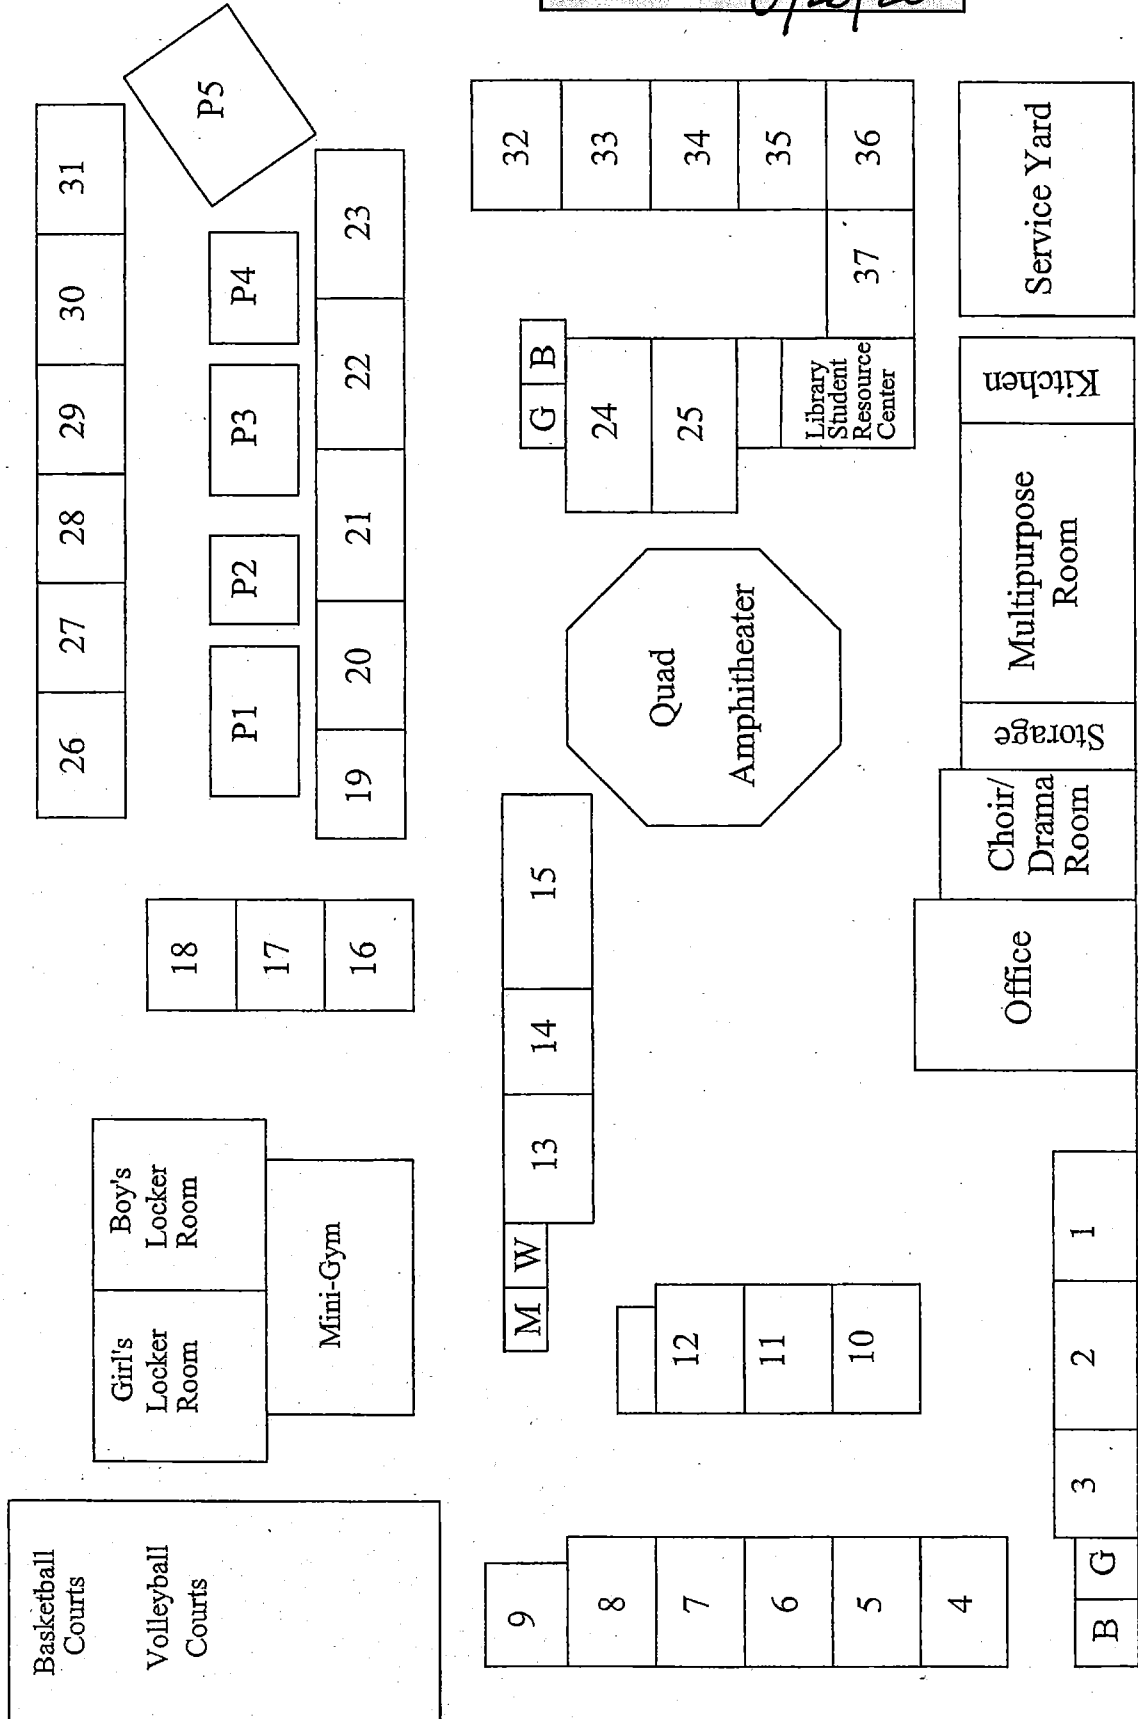

Piedmont Road


Piedmont Middle School

955 Piedmont Road

San Jose, CA 95132

(408) 923-1945

PIEDMONT MIDDLE SCHOOL
INSPECTED ON: 2-4-7020

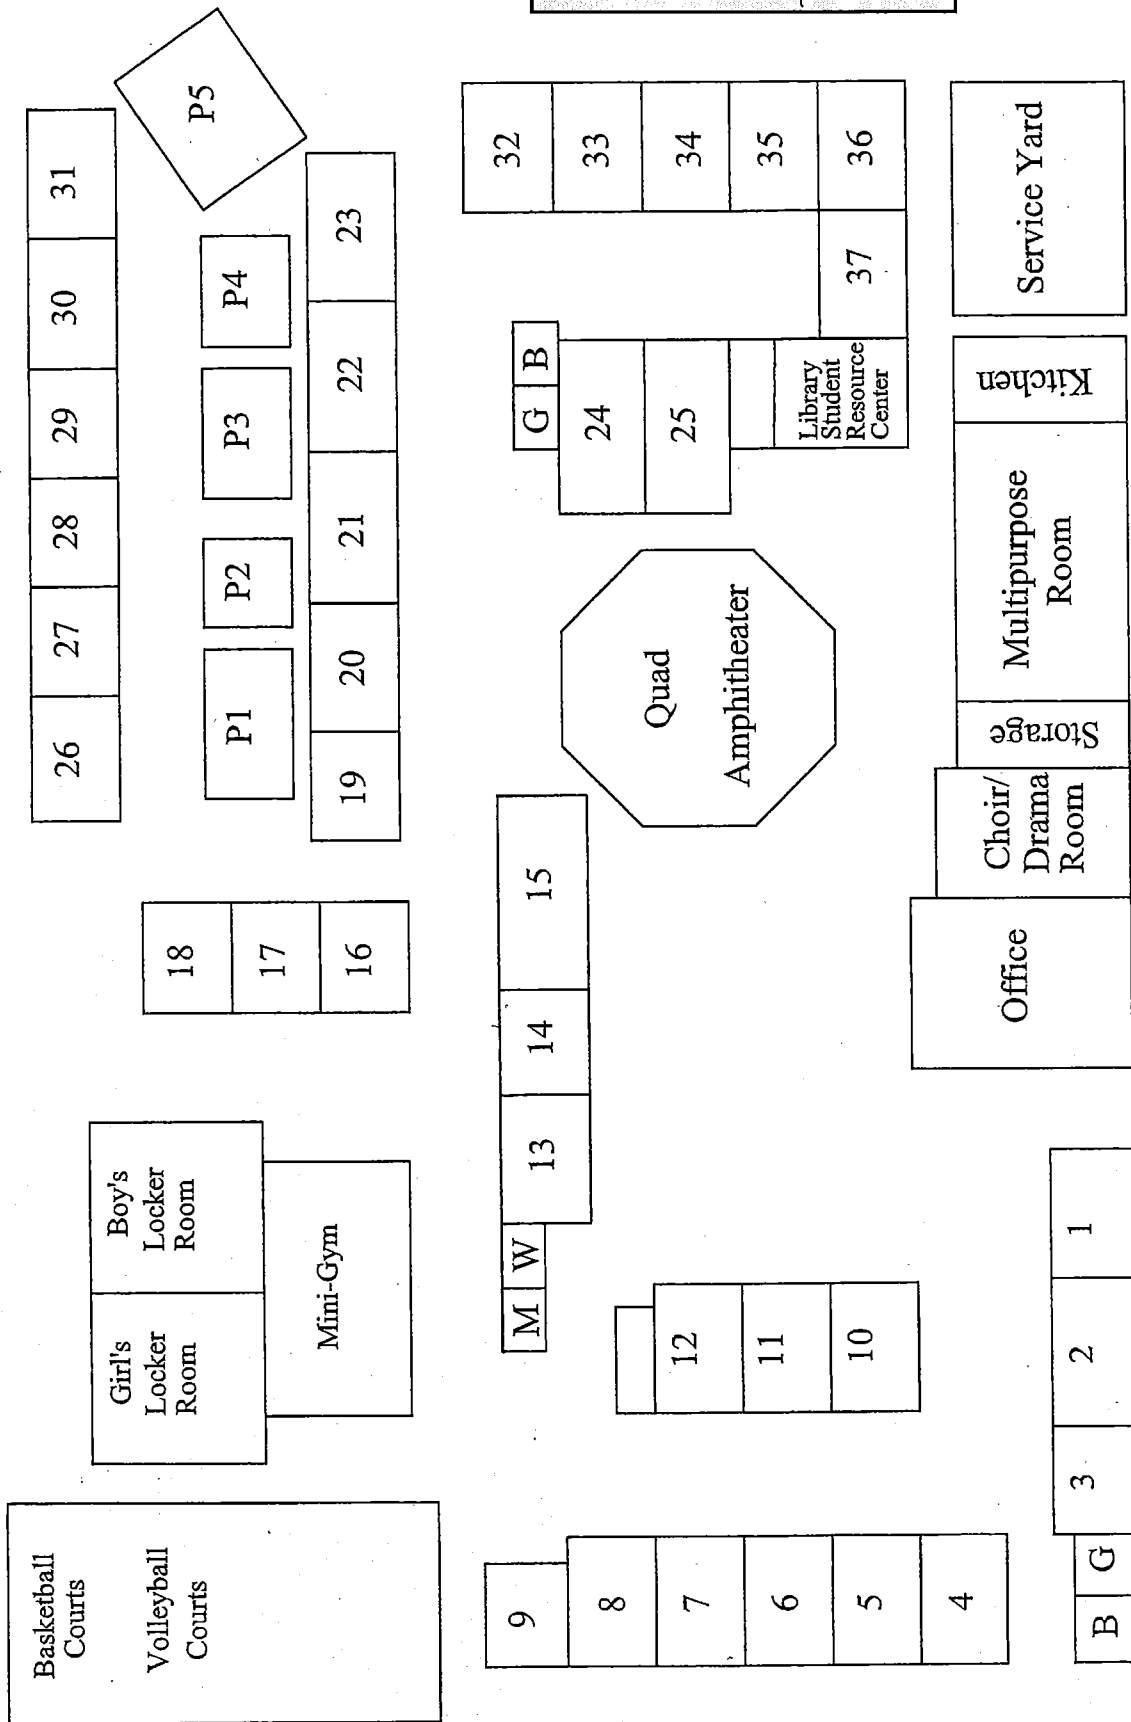

Piedmont Road

Piedmont Middle School

955 Piedmont Road

San Jose, CA 95132

(408) 923-1945

Basketball Courts

Volleyball Courts

Girl's Locker Room

Boy's Locker Room

Mini-Gym

18

17

16

26

27

28

29

30

31

P1

P2

P3

P4

P5

19

20

21

22

23

9

8

7

6

5

4

12

11

10

M

W

13

14

15

Quad

Amphitheater

G

B

24

25

Library

Student

Resource

Center

32

33

34

35

36

37

Office

Choir/
Drama
Room

Storage

Multipurpose
Room

Kitchen

Service Yard

B

G

3

2

1

PIEDMONT MIDDLE SCHOOL


INSPECTED ON:

8/12/19

Piedmont Road

Piedmont Middle School 955 Piedmont Road San Jose, CA 95132 (408) 923-1945

PIEDMONT MIDDLE SCHOOL
 INSPECTED ON 02-04-2019

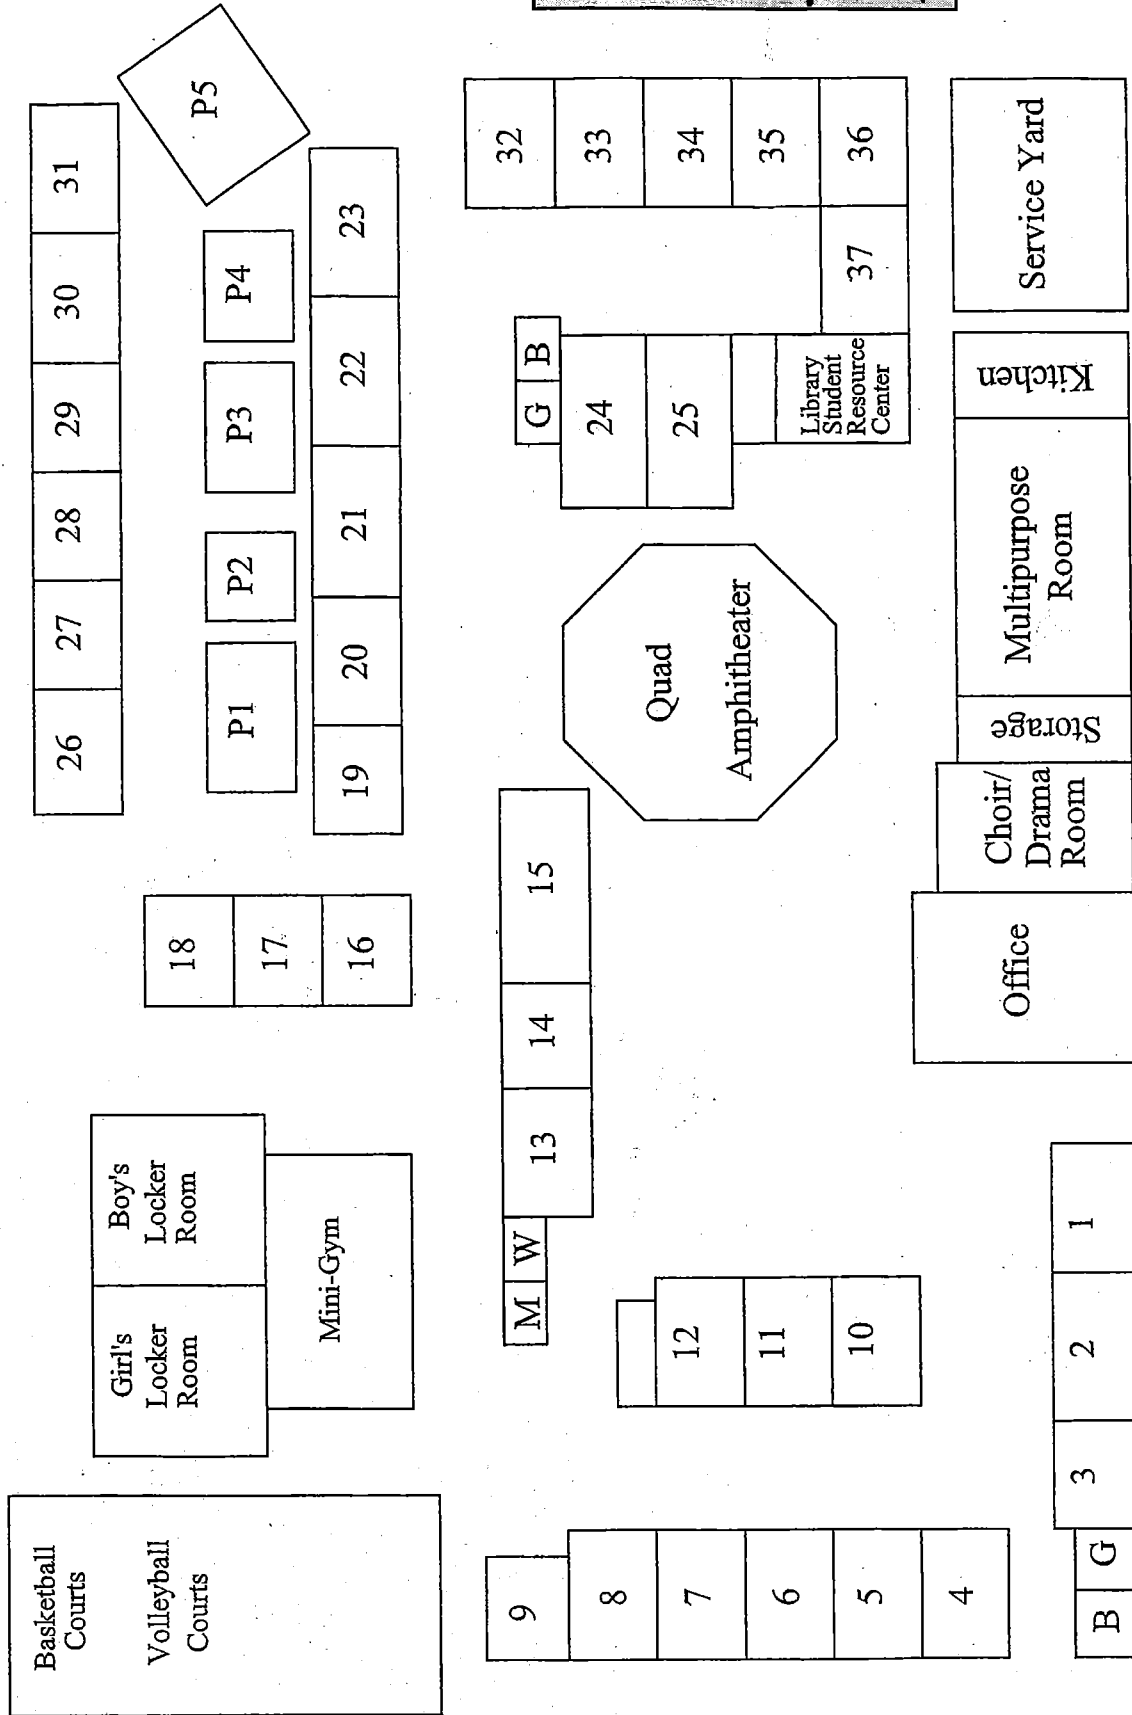


Piedmont Road

Piedmont Middle School


955 Piedmont Road

San Jose, CA 95132

(408) 923-1945

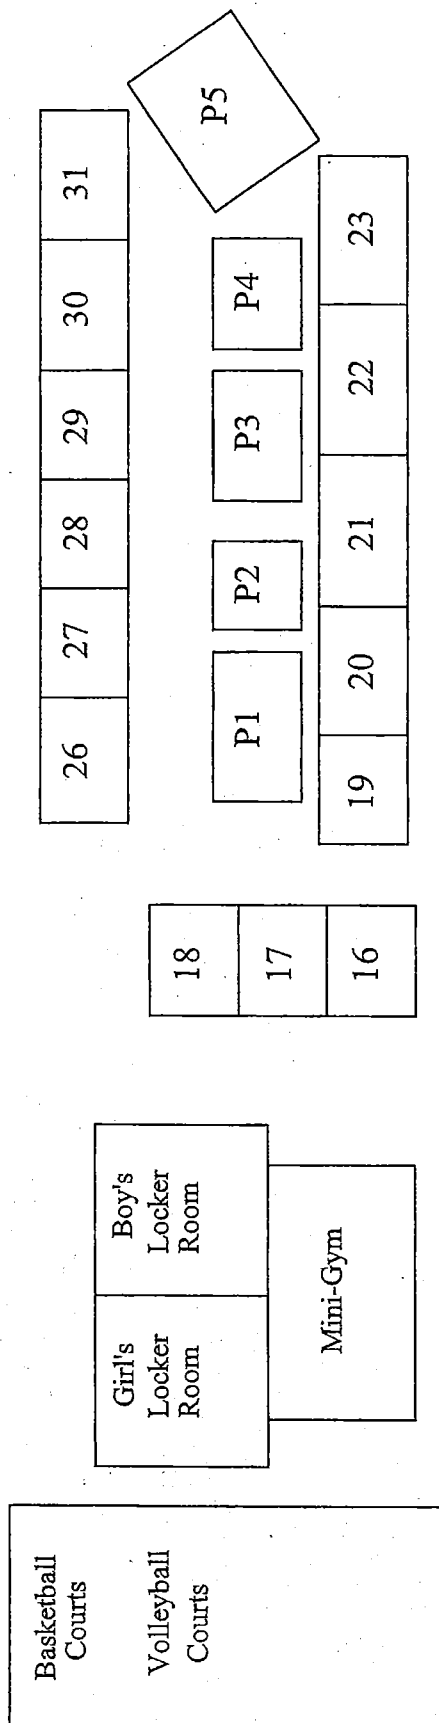

PIEDMONT MIDDLE SCHOOL
INSPECTED ON: 8/6/18

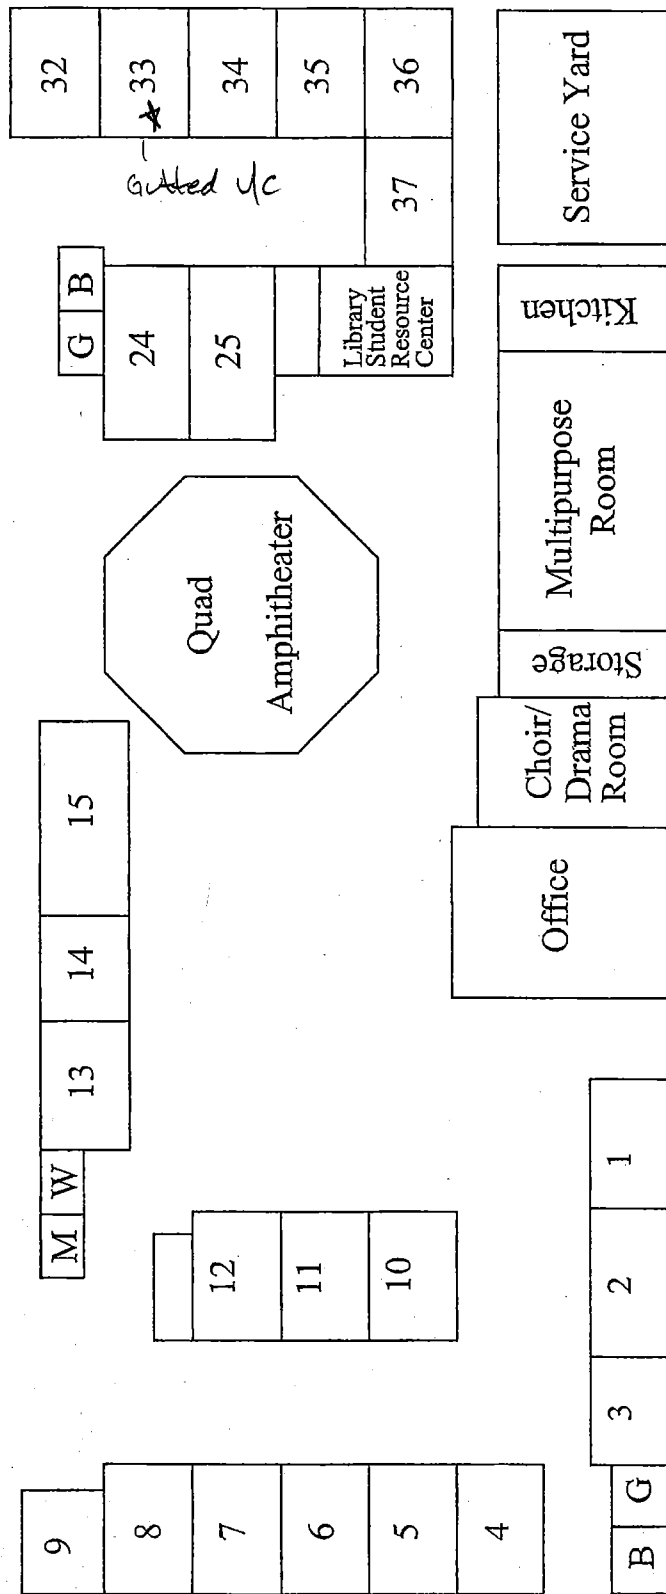
























Piedmont Road

Piedmont Middle School

955 Piedmont Road

San Jose, CA 95132

(408) 923-1945

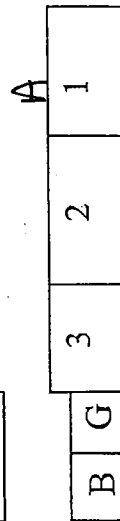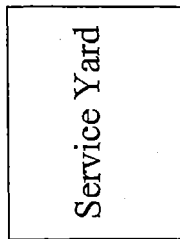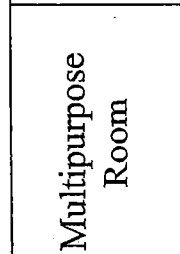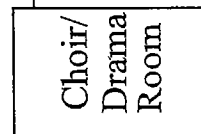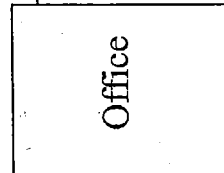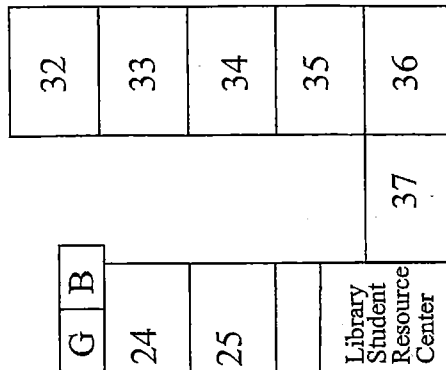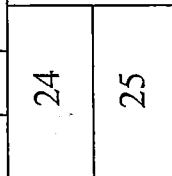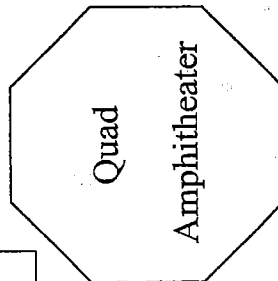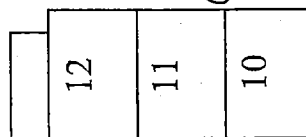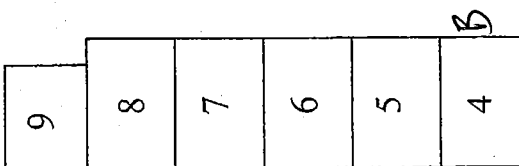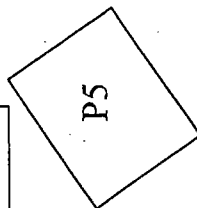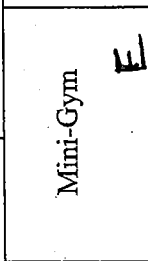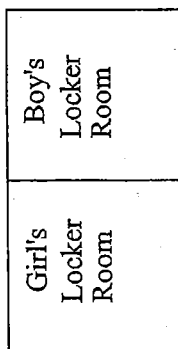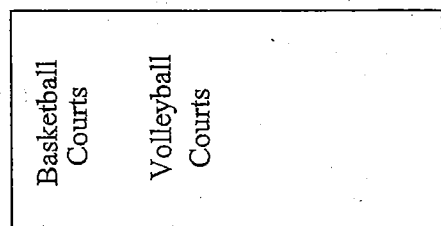

PIEDMONT MIDDLE SCHOOL
INSPECTED ON: 2/12/18

Piedmont Road

Piedmont Middle School

955 Piedmont Road

San Jose, CA 95132

(408) 923-1945

Basketball Courts

Volleyball Courts

Girl's Locker Room

Boy's Locker Room

Mini-Gym

26

27

28

29

30

31

P5

P1

P2

P3

P4

18

17

16

19

20

21

22

23

9

8

7

6

5

4

12

11

10

M

W

13

14

15

Quad

Amphitheater

G

B

24

25

Library

Student Resource Center

32

33

34

35

36

37

Office

Choir/Drama Room

Storage

Multipurpose Room

Kitchen

Service Yard

B

G

3

2

1

Piedmont Road

PIEDMONT MIDDLE SCHOOL

INSPECTED ON:

8/25/17

Piedmont Middle School

955 Piedmont Road

San Jose, CA 95132

(408) 923-1945

PIEDMONT MIDDLE SCHOOL
INSPECTED ON: 3/27/17

Basketball Courts

Volleyball Courts

Girl's Locker Room

Boy's Locker Room

Mini-Gym

26

27

28

29

30

31

P5

P1

P2

P3

P4

19

20

21

22

23

18

17

16

9

8

7

6

5

4

M

W

13

14

15

12

11

10

Quad Amphitheater

G

B

24

25

Library Student Resource Center

32

33

34

35

36

37

Office

Choir/Drama Room

Storage

Multipurpose Room

Kitchen

Service Yard

B

G

3

2

1

Piedmont Road


Piedmont Middle School

955 Piedmont Road

San Jose, CA 95132

(408) 923-1945

PIEDMONT MIDDLE SCHOOL
INSPECTED ON: 9/12/16

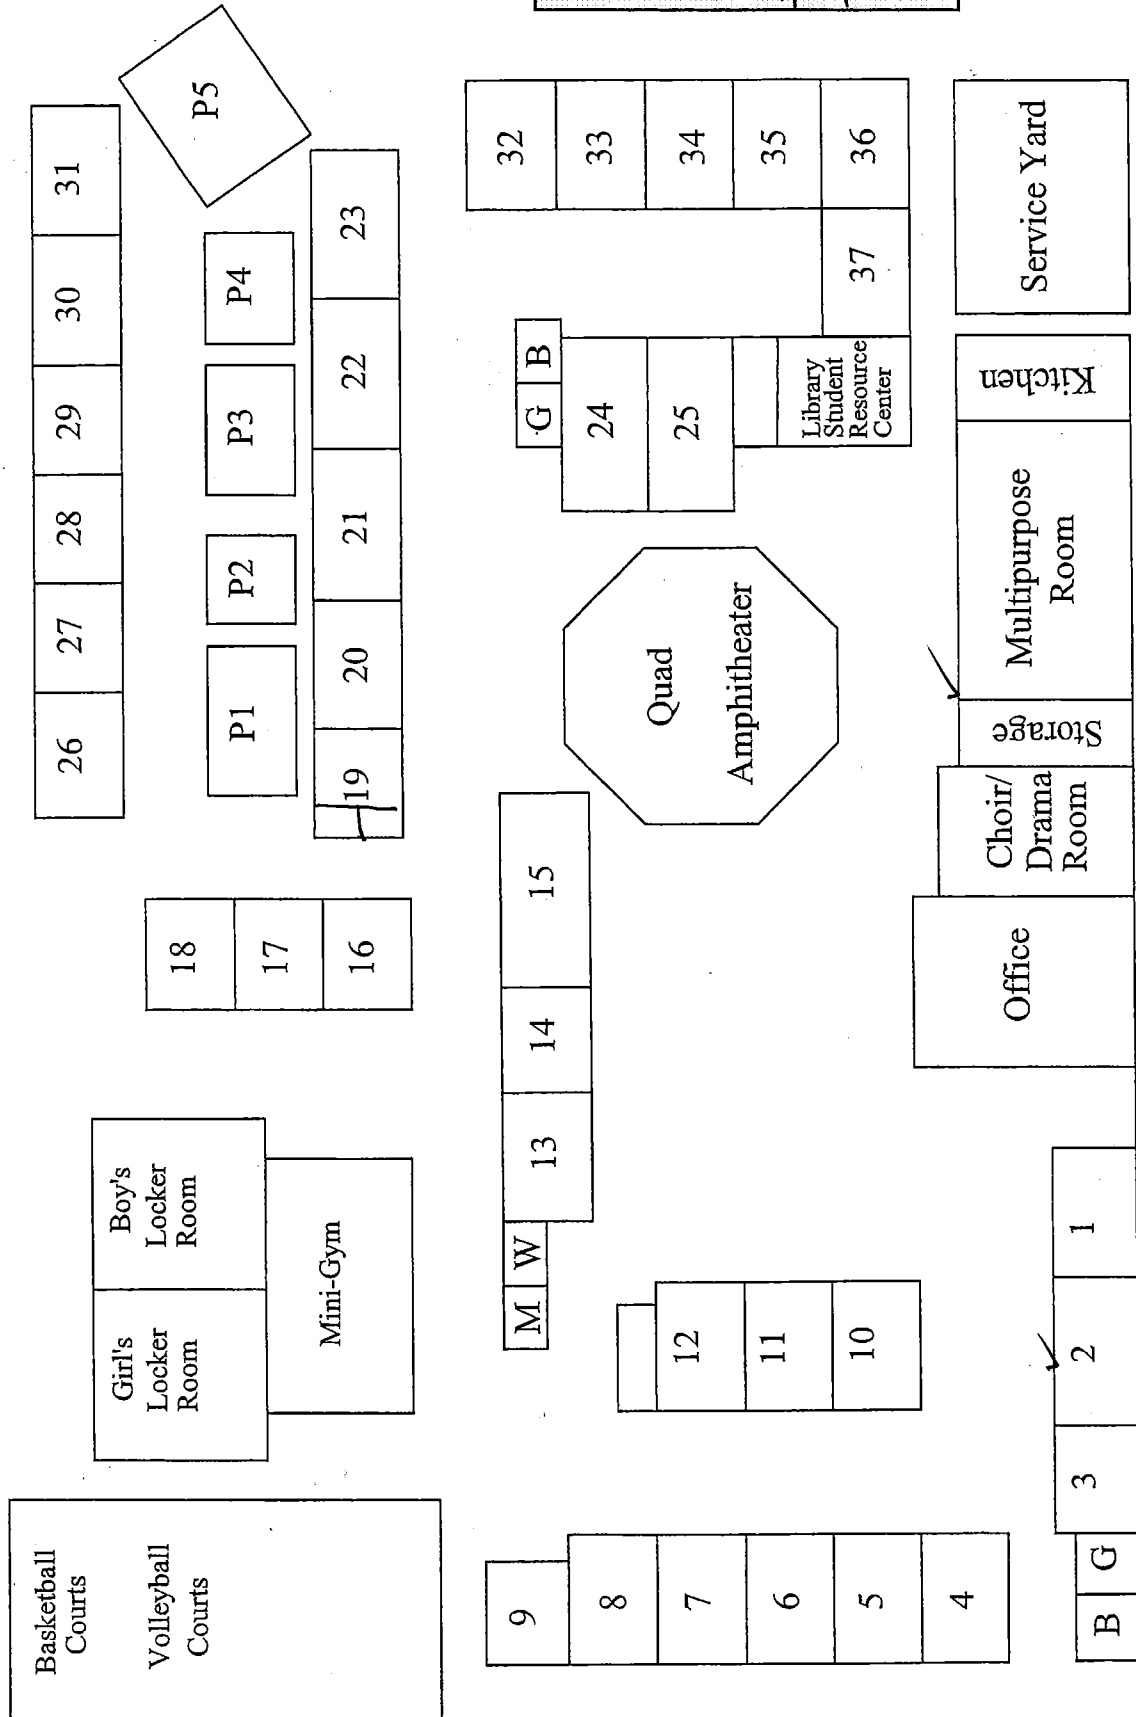

Piedmont Road


Piedmont Middle School

955 Piedmont Road

San Jose, CA 95132

(408) 923-1945

PIEDMONT MIDDLE SCHOOL
INSPECTED ON: 3-16-10

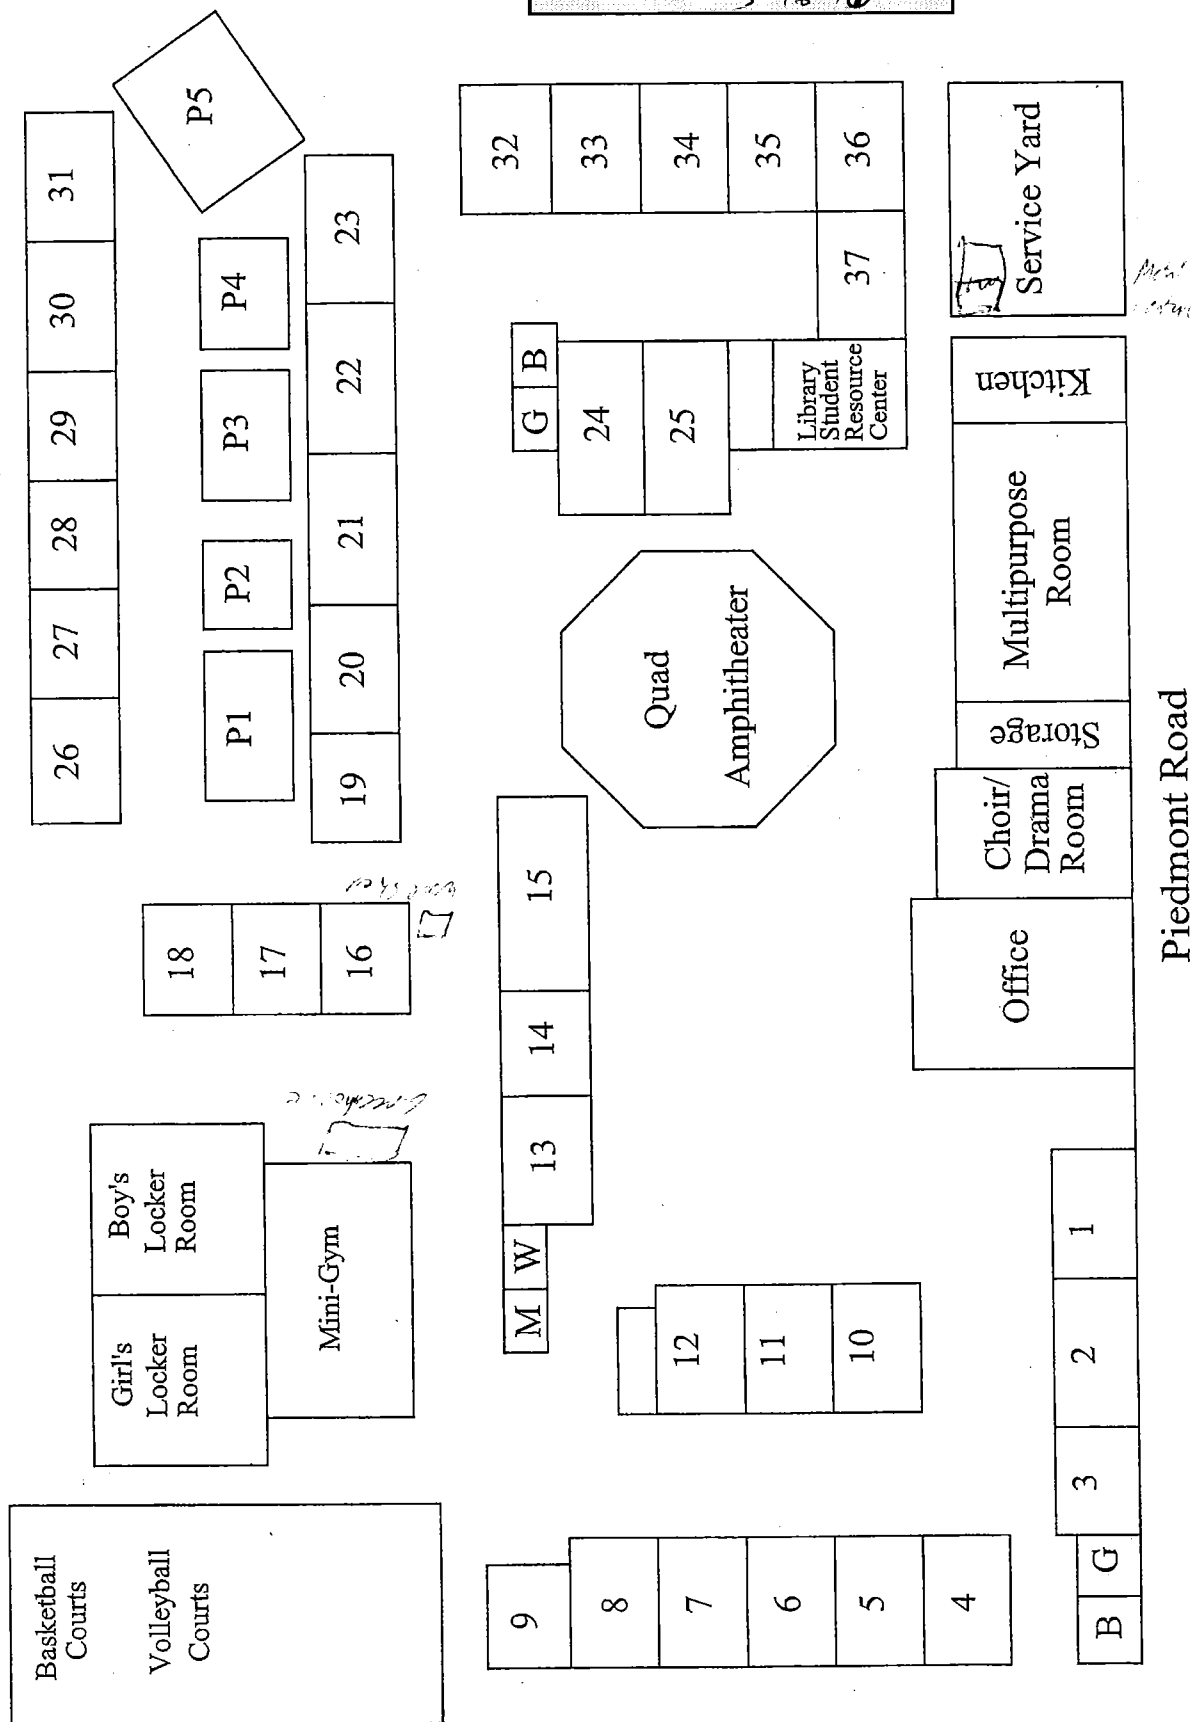

Piedmont Middle School

955 Piedmont Road

San Jose, CA 95132

(408) 923-1945

Basketball Courts

Volleyball Courts

Girl's Locker Room

Boy's Locker Room

Mini-Gym

26

27

28

29

30

31

P5

P1

P2

P3

P4

19

20

21

22

23

18

17

16

9

8

7

6

5

4

12

11

10

M

W

13

14

15

Quad

Amphitheater

G

B

24

25

Library

Student Resource Center

32

33

34

35

36

37

Office

Choir/Drama Room

Storage

Multipurpose Room

Kitchen

Service Yard

B

G

3

2

1

Piedmont Road

PIEDMONT MIDDLE SCHOOL


INSPECTED ON:

9/15/15


Piedmont Middle School


955 Piedmont Road
 San Jose, CA 95132
 (408) 923-1945


PIEDMONT MIDDLE SCHOOL
 INSPECTED ON: 3-18-15

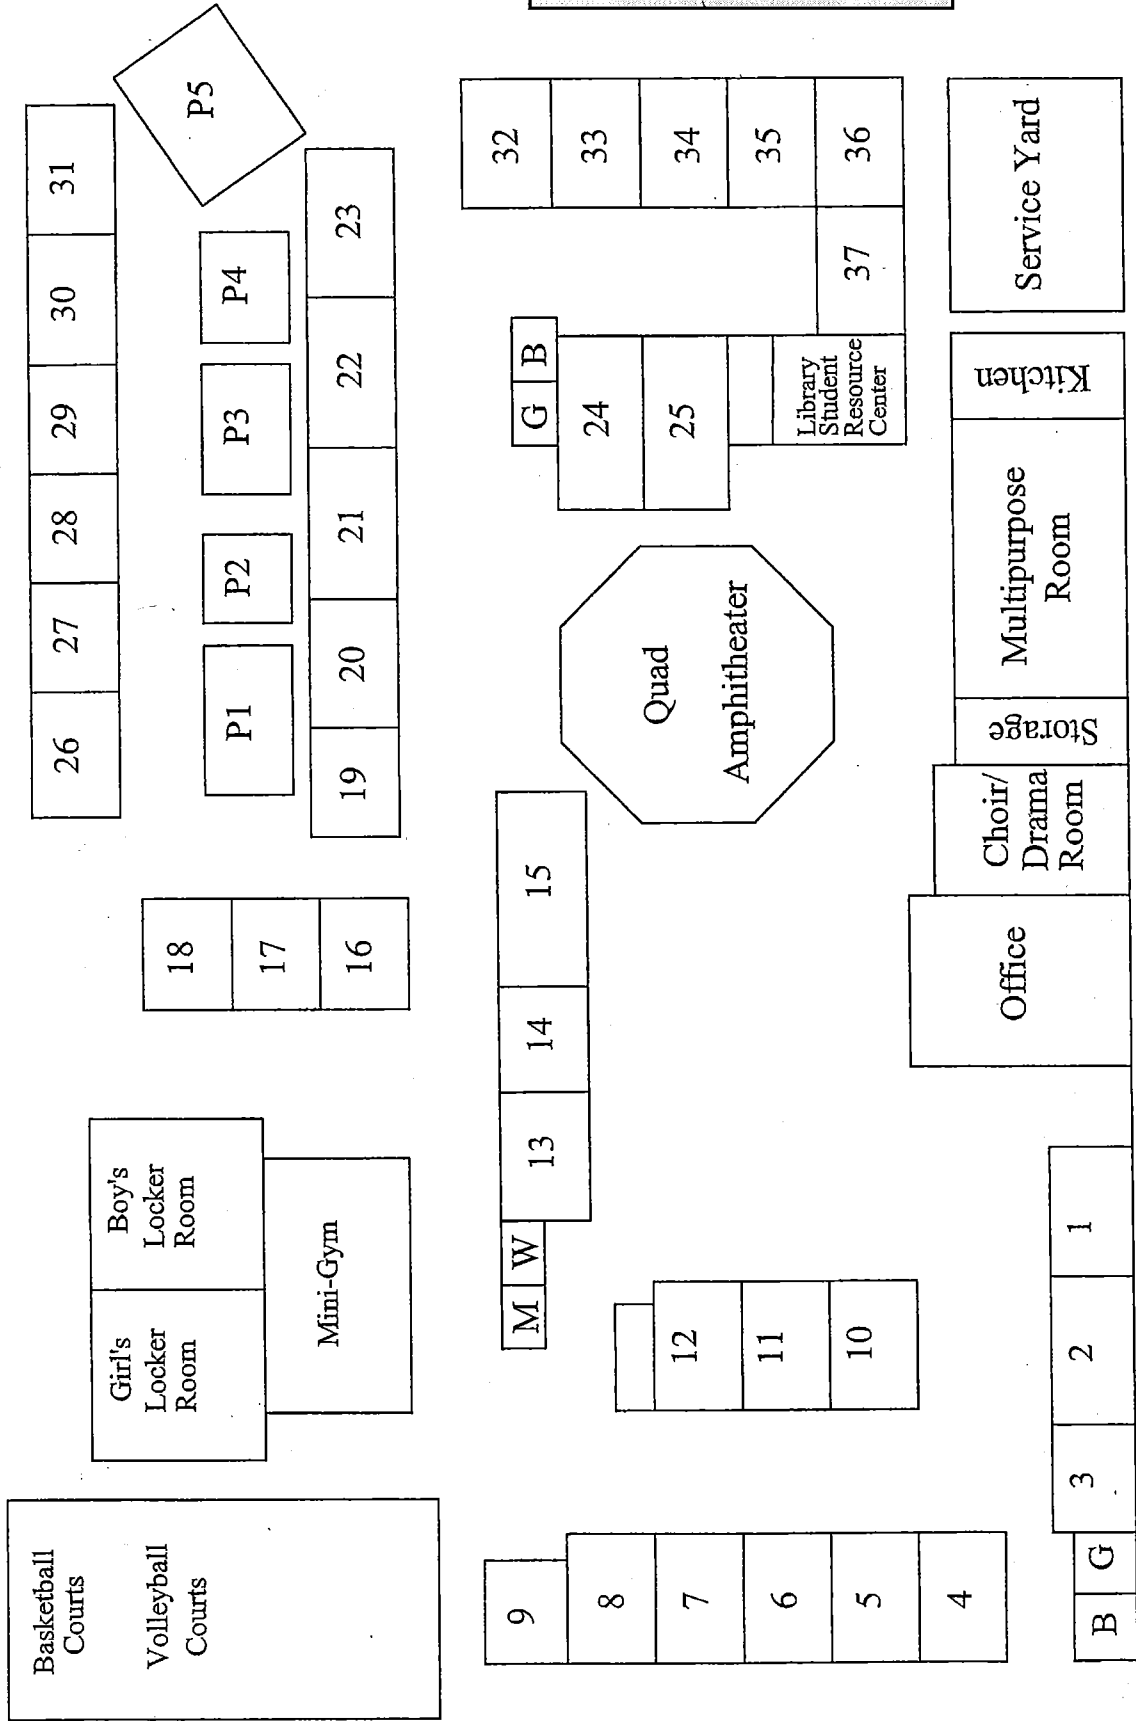


Piedmont Road

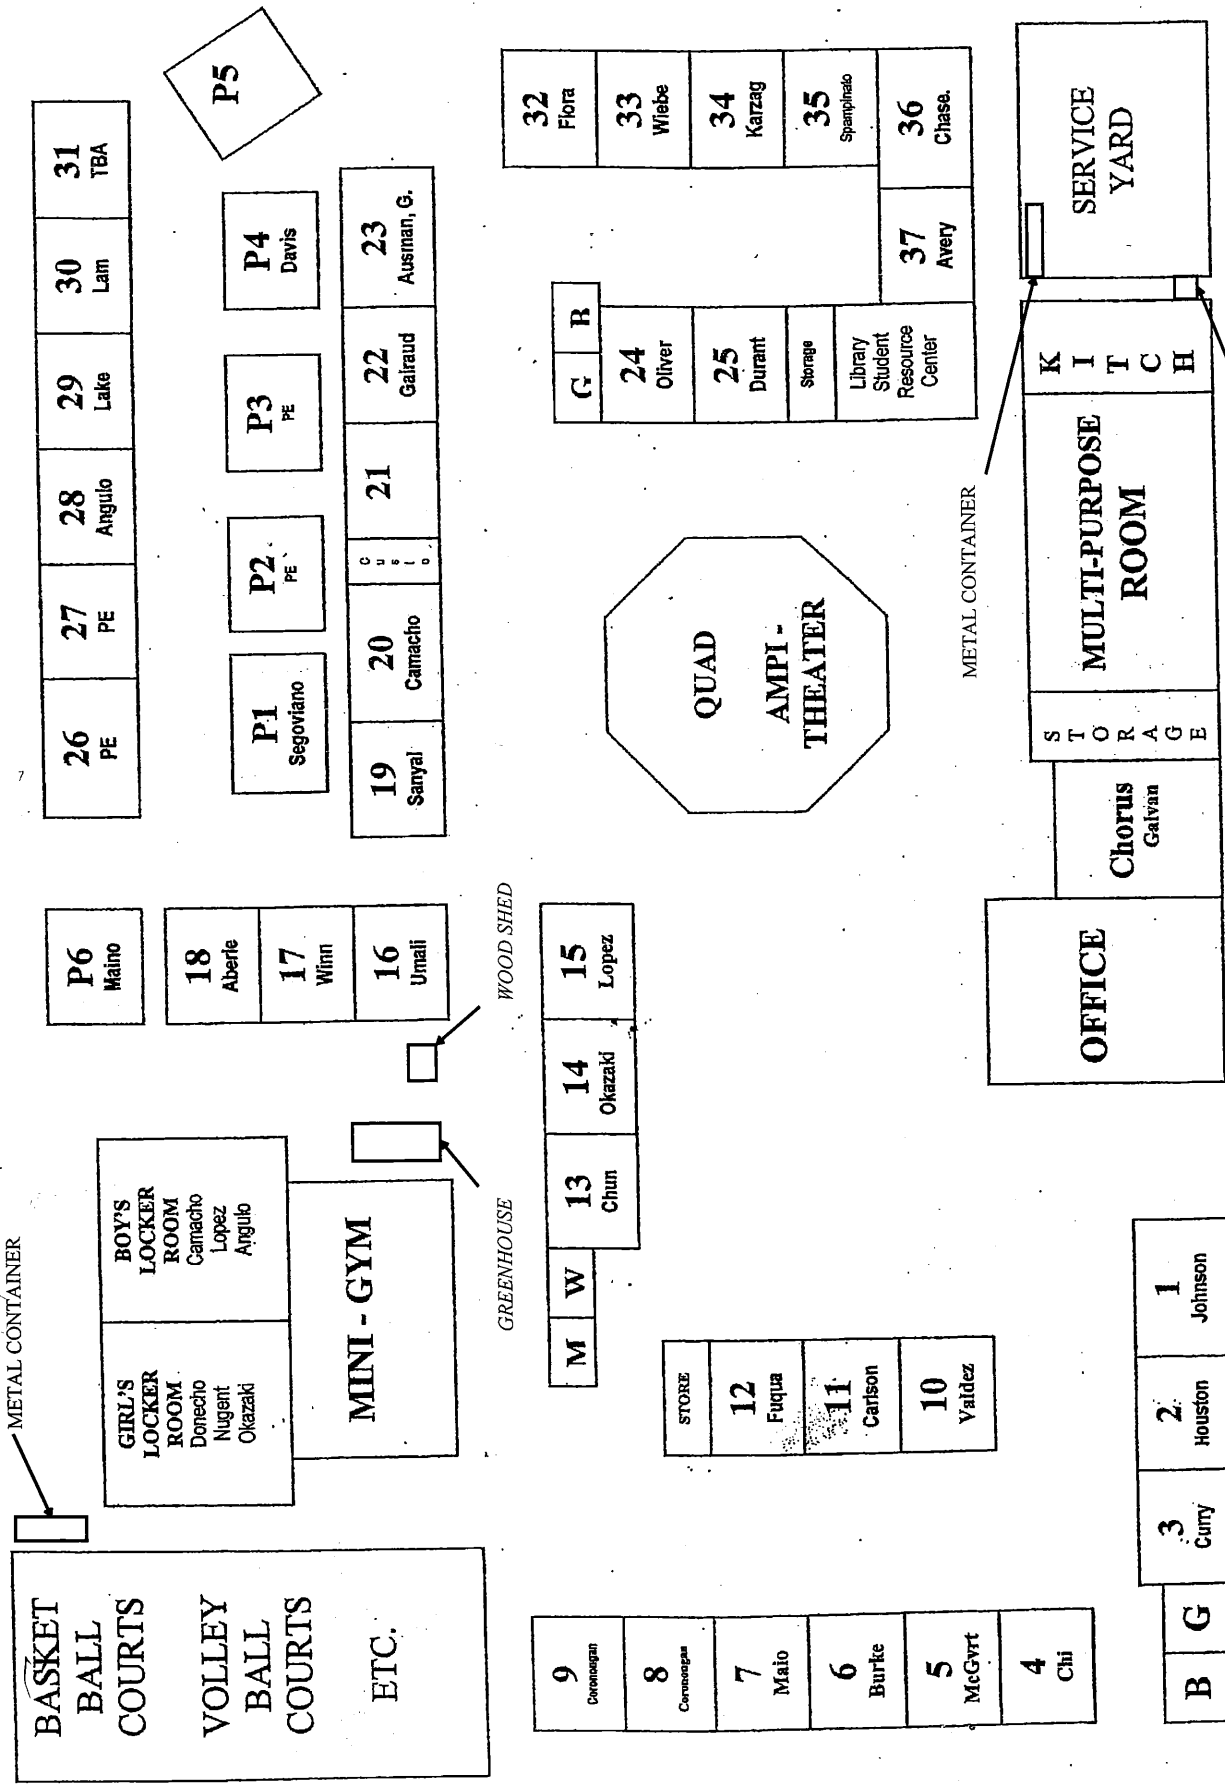


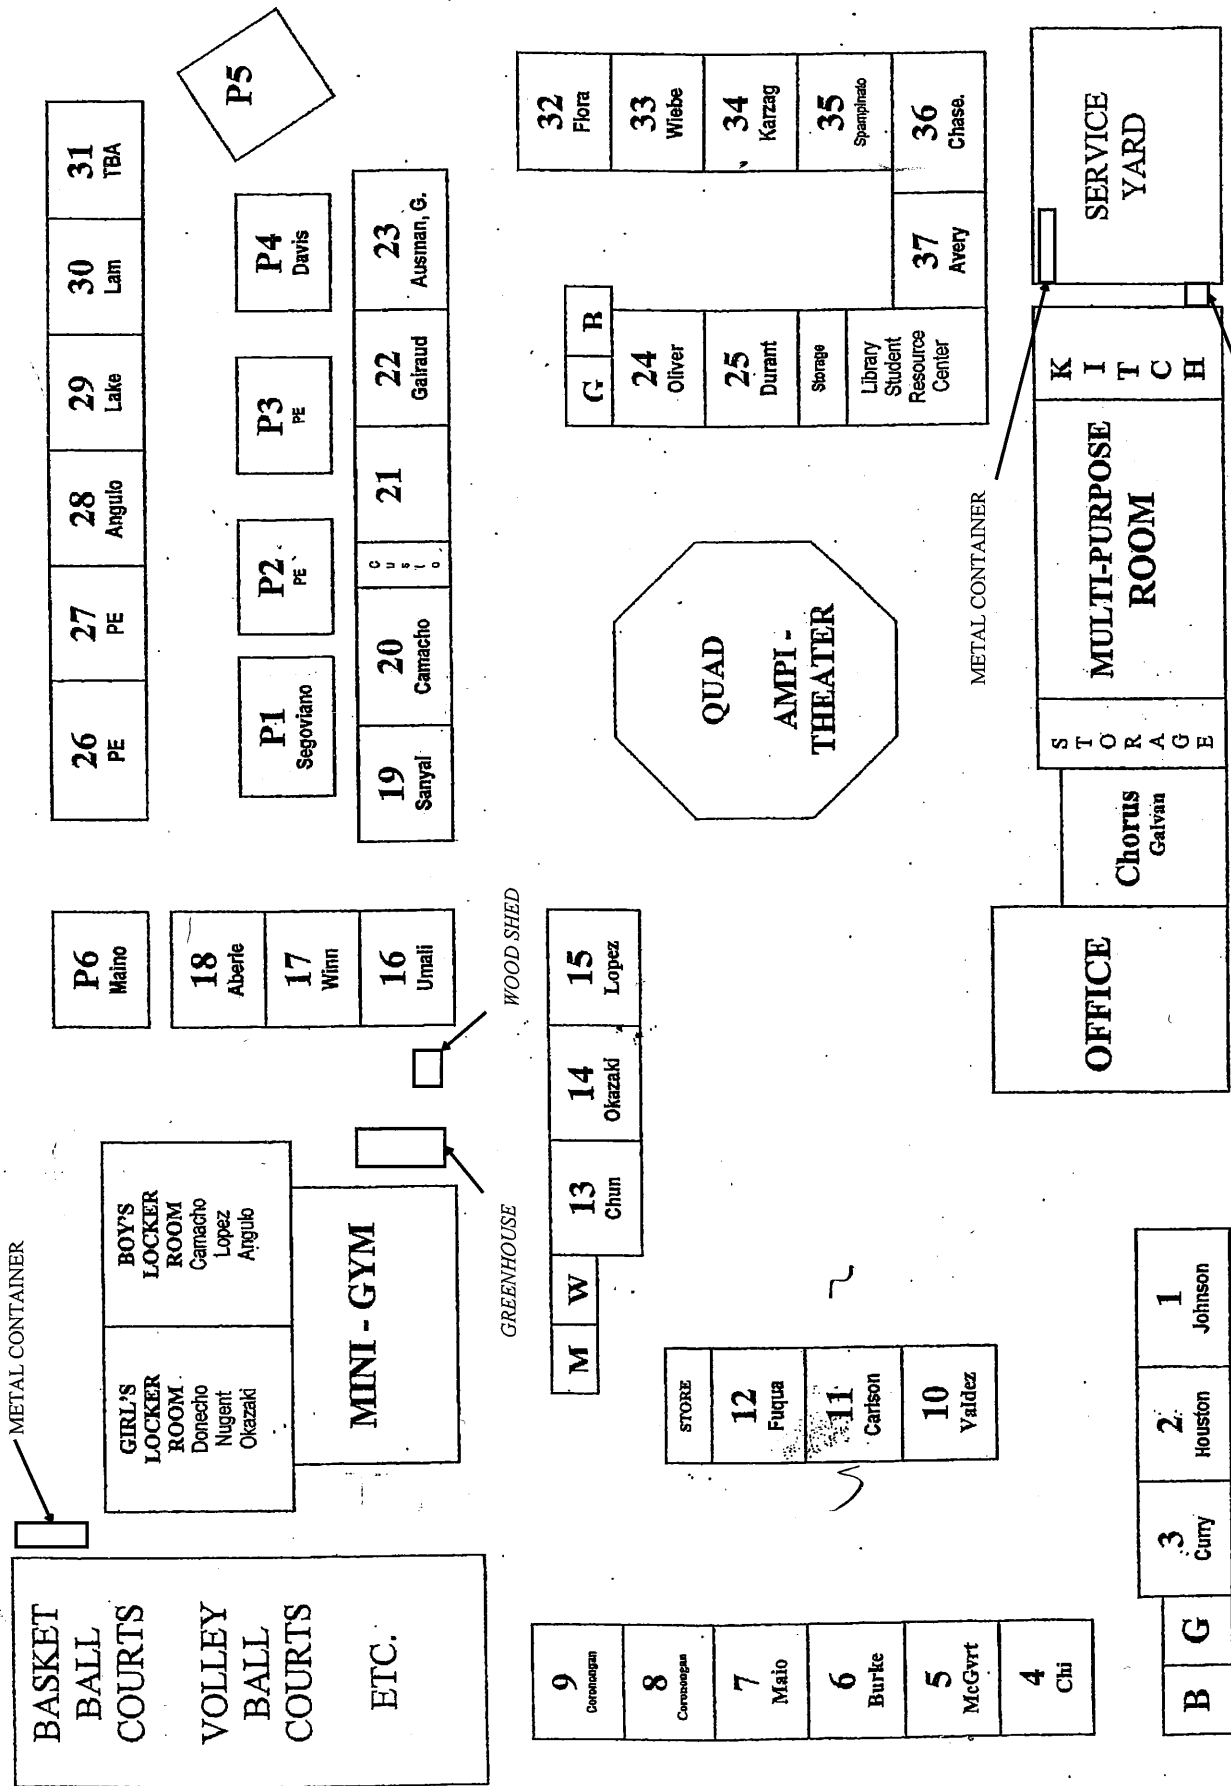

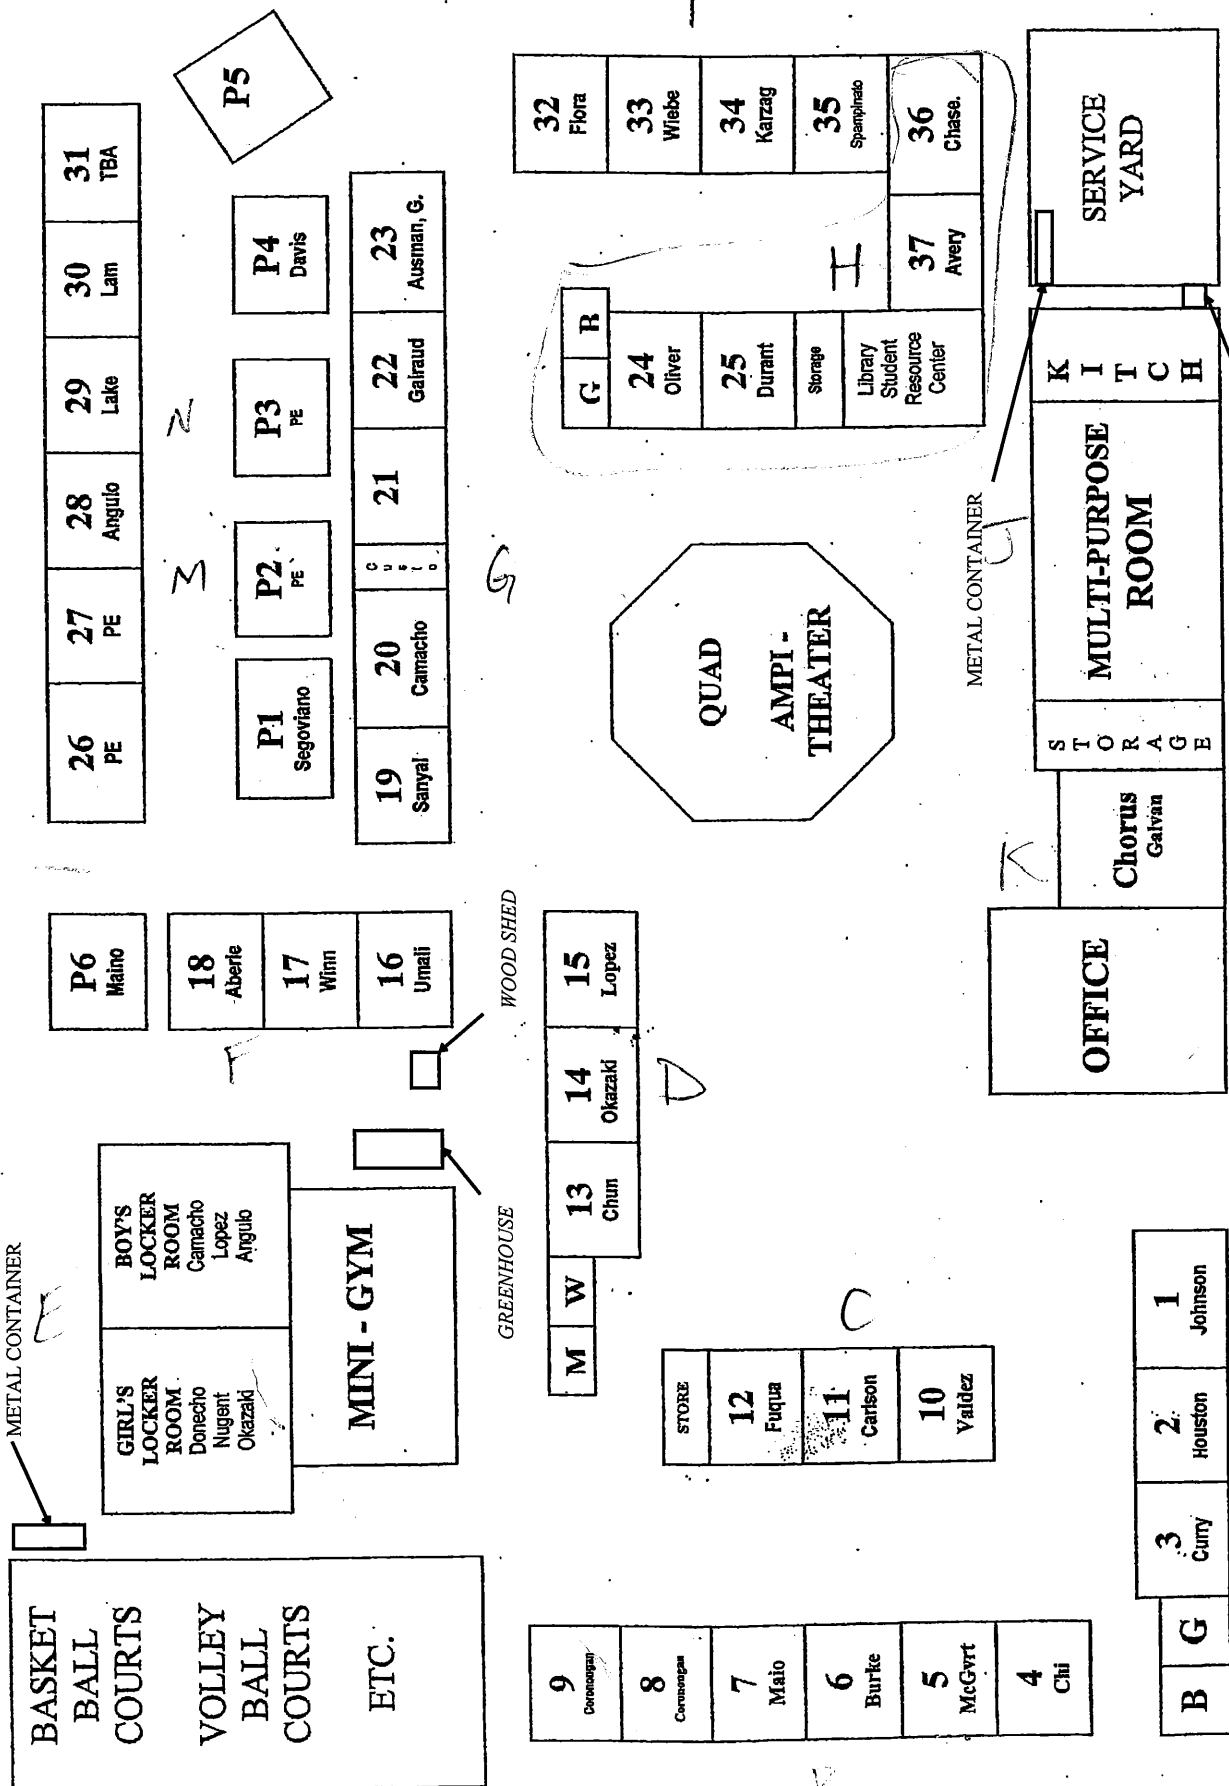


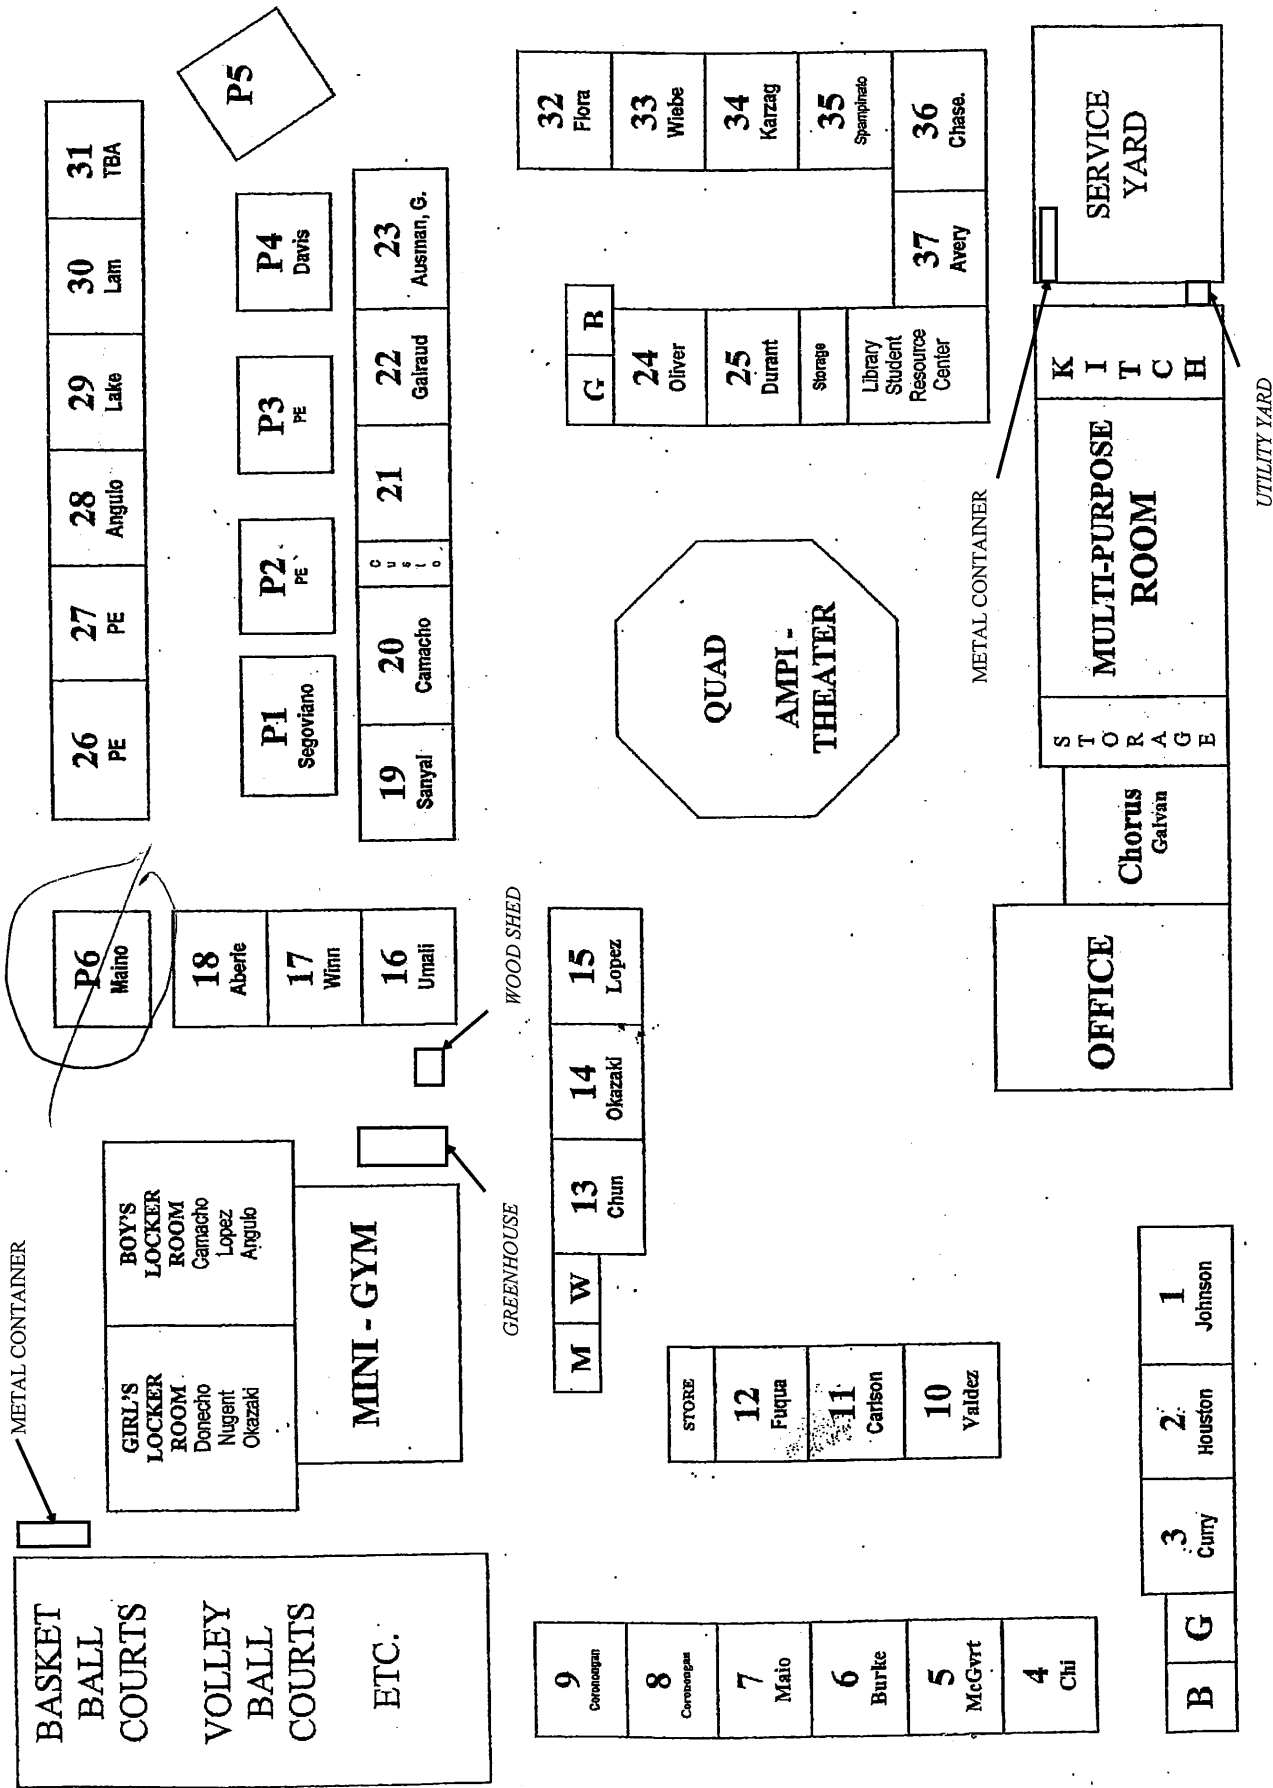


PIEDMONT MIDDLE SCHOOL
INSPECTED ON: 10-10-12

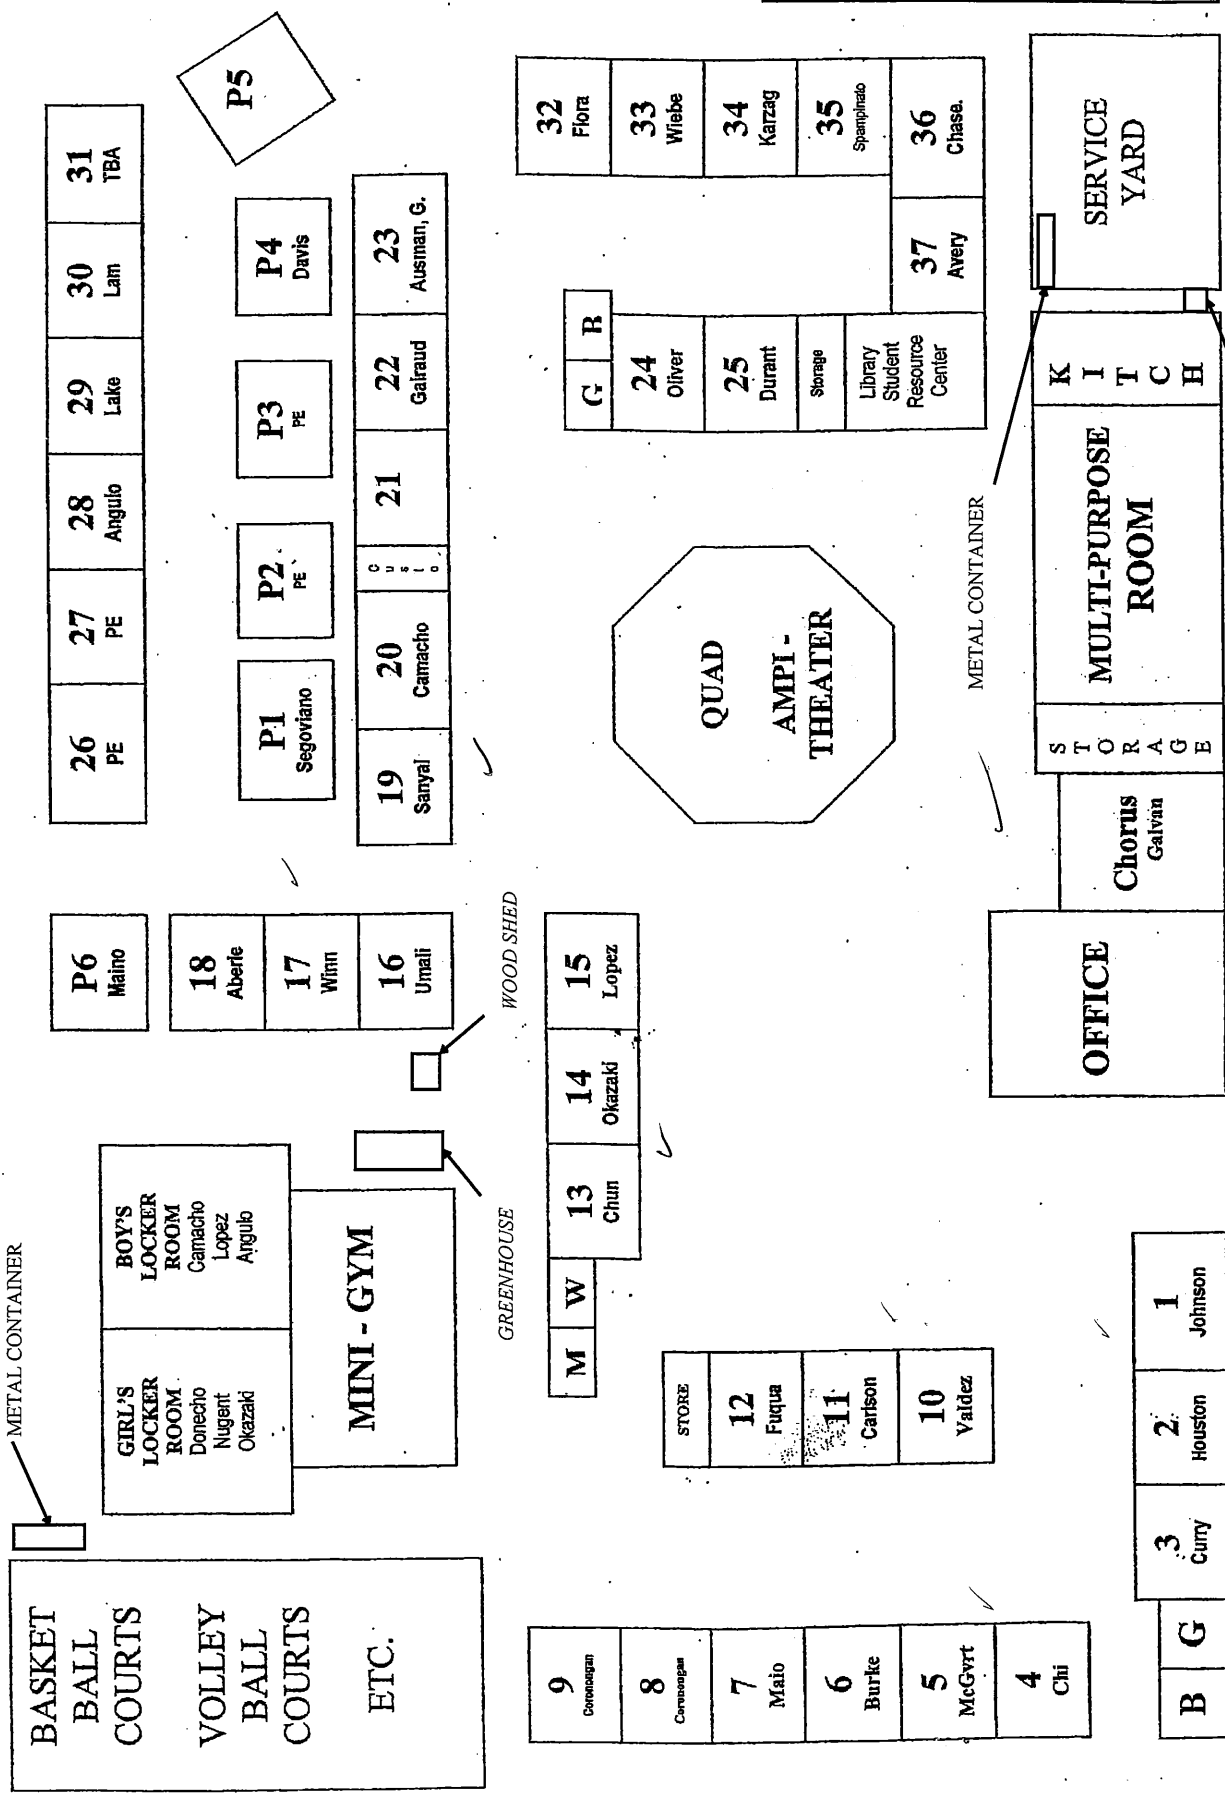

PIEDMONT MIDDLE SCHOOL
INSPECTED ON: 04-10-12

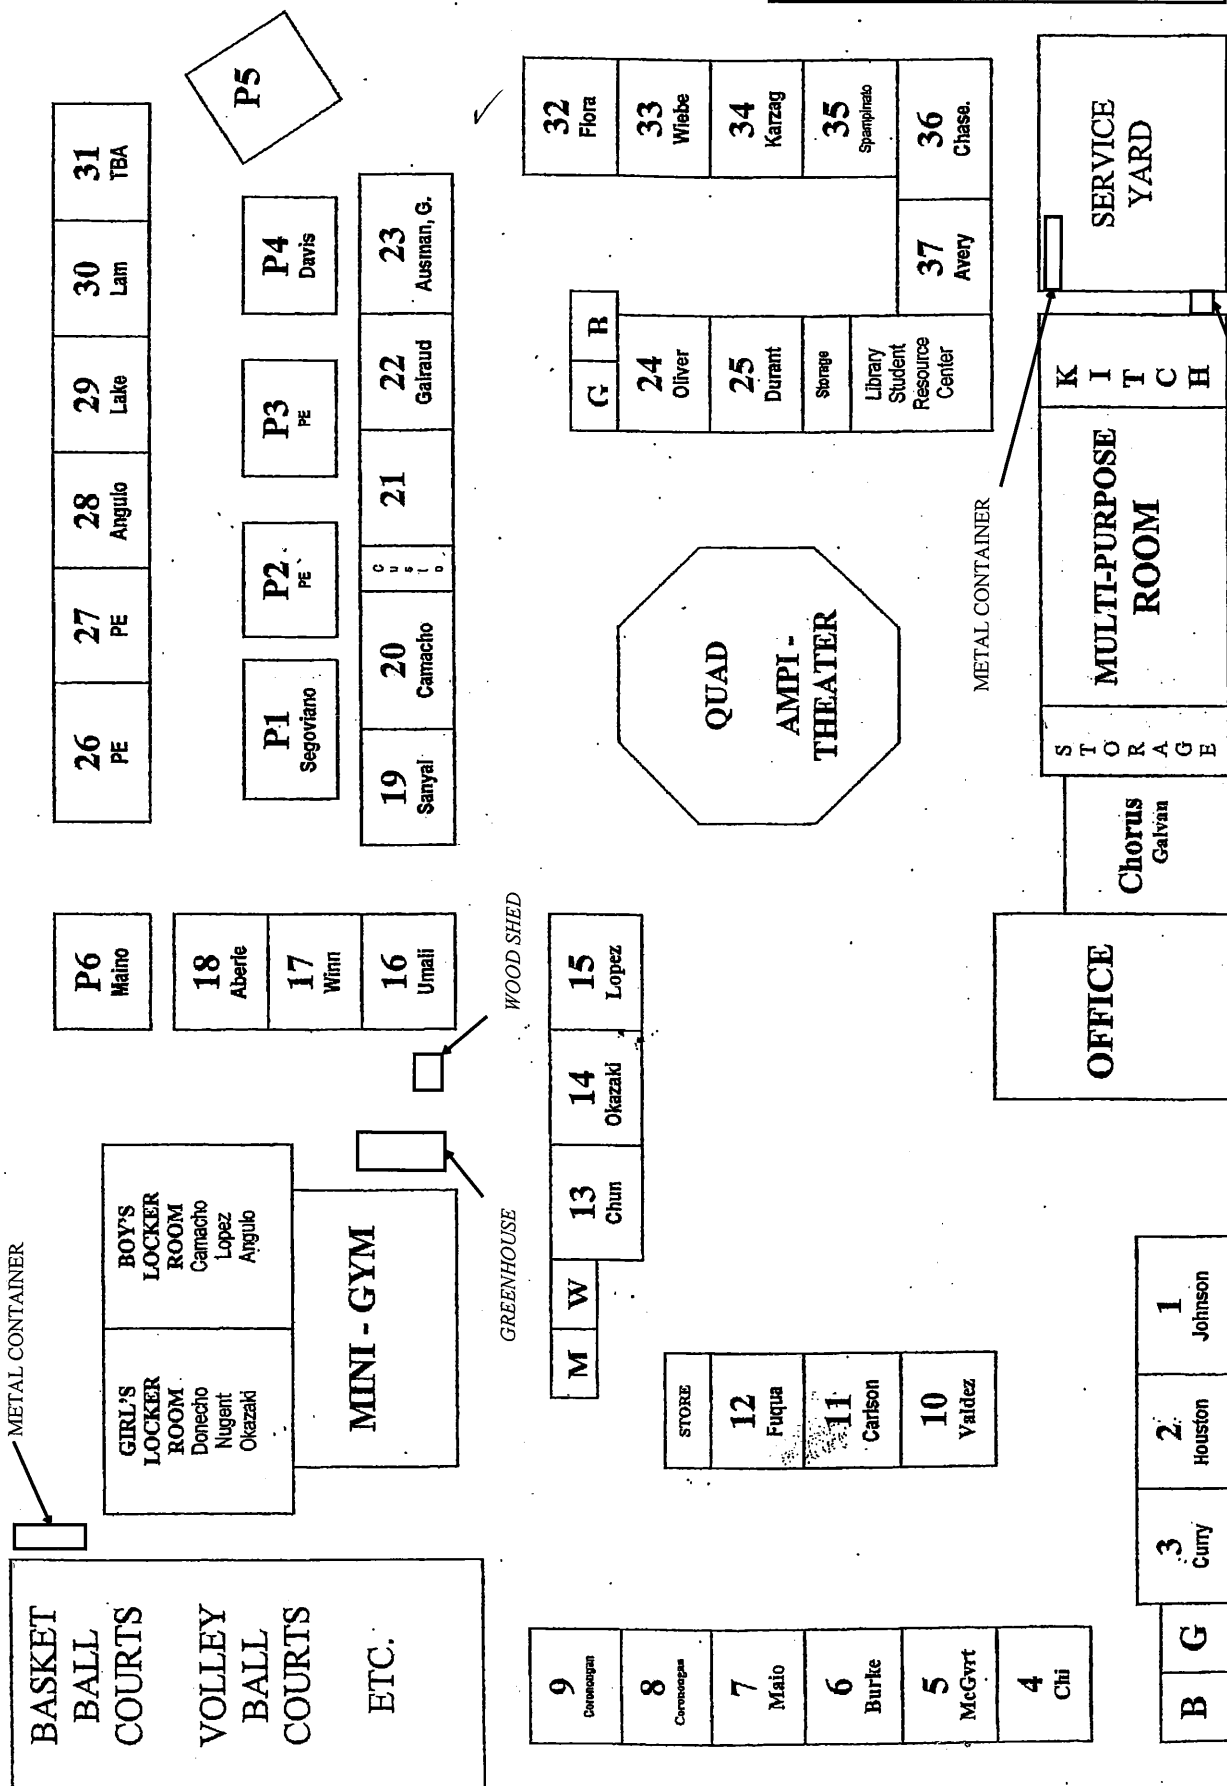

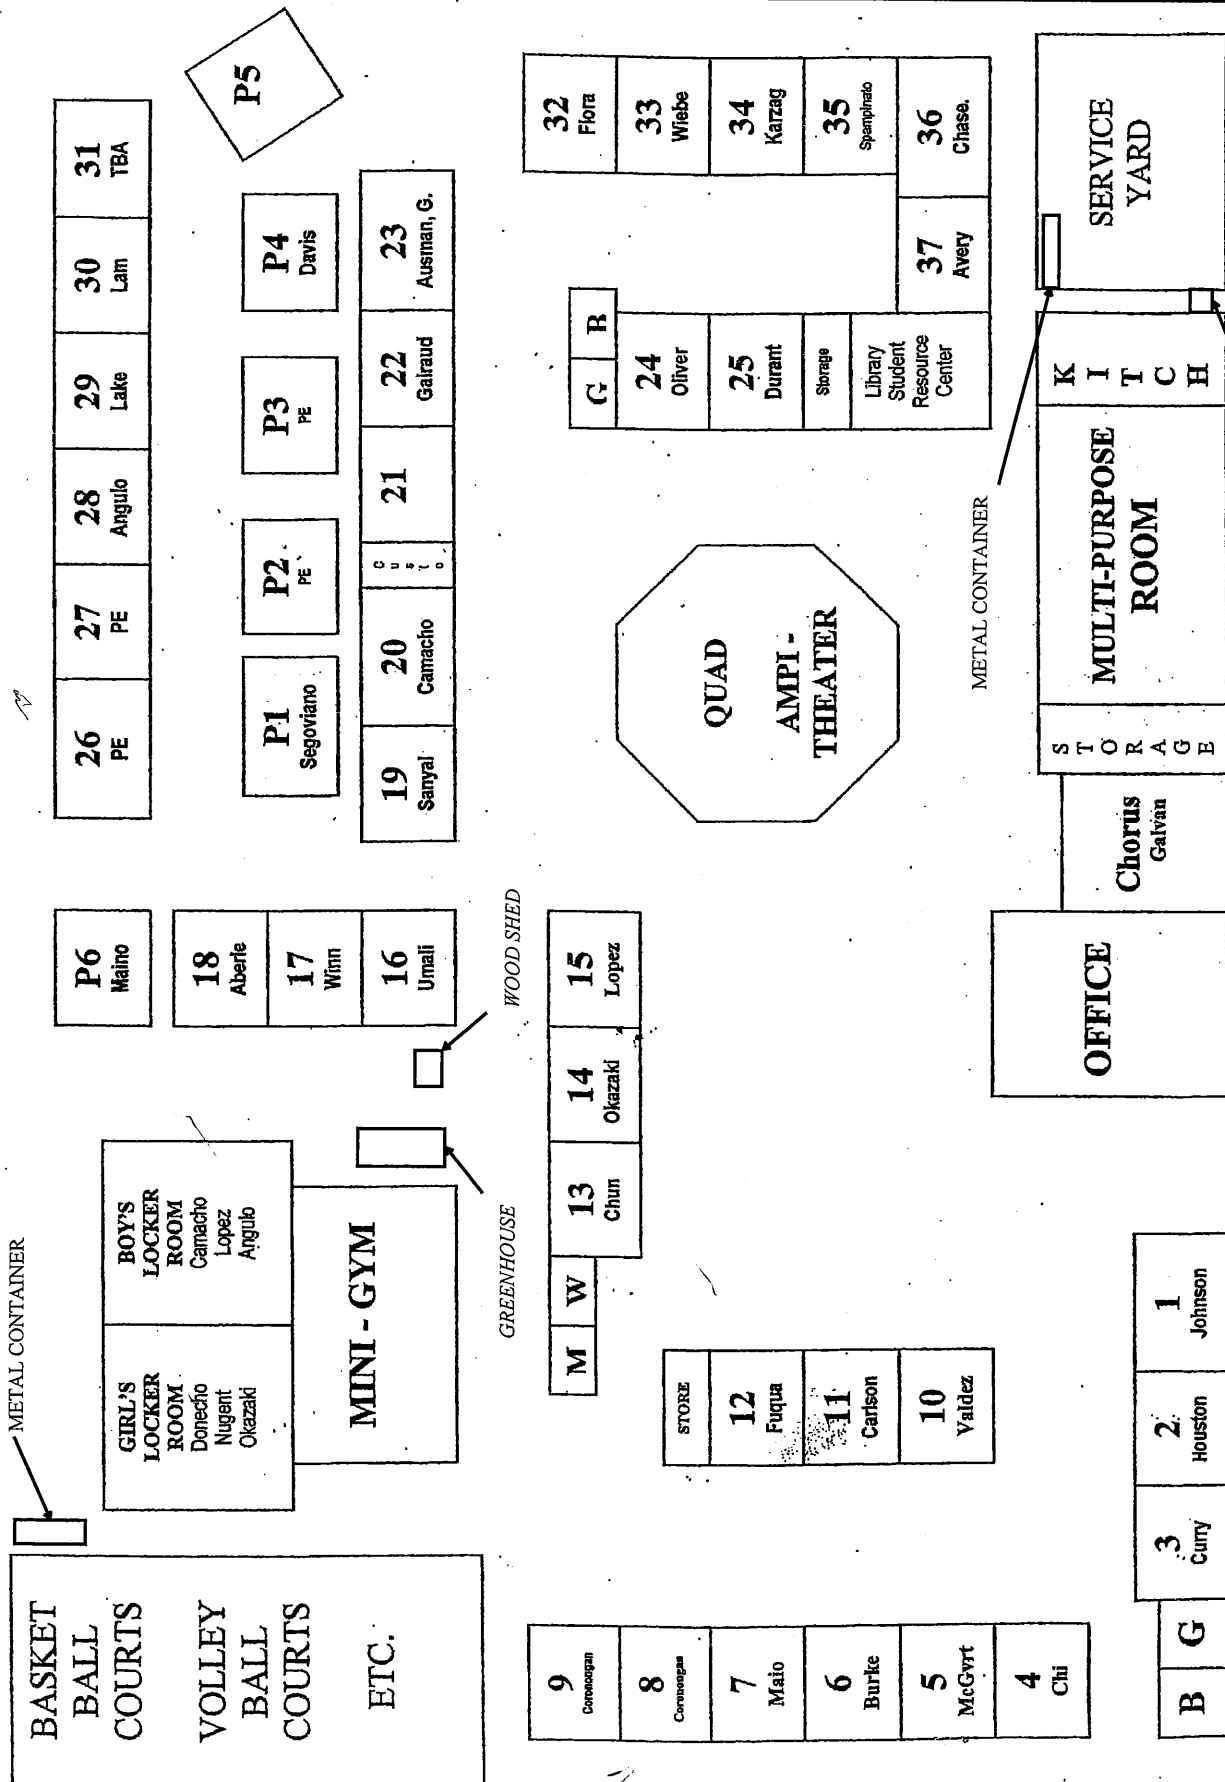

25

BASKET BALL COURTS
VOLLEY BALL COURTS
ETC.

GIRL'S LOCKER ROOM
Donacho
Nugent
Okazaki
Pridham

BOY'S LOCKER ROOM
Camacho
Lopez
Malino

MINI - GYM

P6 Chi

18 Aberle

17 Winn

16 Umali

P1 Segoviano

P2 Pandit

P3 TBA

P4 Davis

P5 Carmonagan

26 TBA

27 Curry

28 Spacek

29 Lake

30 TBA

31 Sanyal

19 Wong

20 McCullough

21 Galraud

22 Flora

23 Ausman, G.

9 Alternative Center

8 Pantore

7 TBA

6 Rygiel

5 Braden

4 Prazma

M

W

13 Stewart

14 Avery

15 Locke

STORE

12 Fuqua

11 Williams

10 Valdez

QUAD
AMPI -
THEATER

32 Atunson, L

33 Werbe

34 Karzag

35 Aguilar

36 Atunson, S.

37 Anderson

24 Ausman, M.

25 Angulo

Duplicating

Library Student Resource Center

G B

OFFICE

BAND ROOM

STORAGE

MULTI-PURPOSE ROOM

KITCH

SERVICE YARD

B

G

3 McNeil

2 Cosgrove

1 Johnson, N.

PIEDMONT MIDDLE SCHOOL

BASKET
BALL
COURTS

VOLLEY
BALL
COURTS

ETC.

GIRL'S
LOCKER
ROOM
Donacho
Nugent
Okazaki
Pridham

BOY'S
LOCKER
ROOM
Camacho
Lopez
Malino

MINI - GYM

P6
Chi

18
Aberle

17
Winn

16
Unall

26
TBA

27
Curry

28
Spacek

29
Lake

30
TBA

31
Sanyal

P5
Caronongun

P4
Davis

P3
TBA

P2
Pandit

P1
Segoviano

19
Wong

20
McCullough

21
Galraud

22
Flora

23
Aushman, G.

9
Alternative
Center

8
Paratore

7
TBA

6
Rygiol

5
Braden

4
Przma

M

W

13
Stewart

14
Avery

15
Locke

STORE

12
Fuqua

11
Williams

10
Valdez

QUAD
AMPI -
THEATER

32
Aunton, L.

33
Webe

34
Karzag

35
Aguar

36
Aunton, S.

37
Anderson

24
Aushman, M.

25
Angulo

Duplicating

Library
Student
Resource
Center

G

B

OFFICE

STORAGE

BAND
ROOM

MULTI-PURPOSE
ROOM

KITCHEN

SERVICE
YARD

B

G

3
McNeil

2
Cogrove

1
Johnson, N.

PIEDMONT MIDDLE SCHOOL

BASKET
BALL
COURTS

VOLLEY
BALL
COURTS

ETC.

GIRL'S
LOCKER
ROOM
Dorecho
Nugent
Okazaki
Prdham

BOY'S
LOCKER
ROOM
Camacho
Lopez
Maino

MINI - GYM

P6
Chi

18
Aberle

17
Winn

16
Umali

26
TBA

27
Curry

28
Spacek

29
Lake

30
TBA

31
Sanyal

P4
Davis

P3
TBA

P2
Pandit

P1
Segoviano

P5
Caronogun

19
Wong

20
McCullough

21
Galraud

22
Flora

23
Ausman, G.

9
Alternative
Center

8
Paratore

7
TBA

6
Rygiel

5
Braden

4
Prazma

M

W

13
Stewart

14
Avery

15
Locke

STORE

12
Fuqua

11
Williams

10
Valdez

QUAD
AMPI -
THEATER

32
Atundon, L

33
Webe

34
Karrag

35
Aguar

36
Atundon, S.

37
Anderson

24
Ausman, M.

25
Angulo

Duplicating

Library
Student
Resource
Center

G

B

OFFICE

STORAGE

MULTI-PURPOSE
ROOM

KITCHEN

SERVICE
YARD

B

G

3
McNeil

2
Cosgrove

1
Johnson, N.

PIEDMONT MIDDLE SCHOOL

Metal
Containers
→
Megh
Yard

BASKET
 BALL
 COURTS
 VOLLEY
 BALL
 COURTS
 ETC.

GIRL'S LOCKER ROOM Donecho Nugent Okazaki Phdham	BOY'S LOCKER ROOM Camacho Lopez Maino
--	--

MINI - GYM

P6 Chi

18 Aberle	17 Winn	16 Umall
--------------	------------	-------------

26 TBA	27 Curry	28 Spacek	29 Lake	30 TBA	31 Sanyal
-----------	-------------	--------------	------------	-----------	--------------

P5
Carmonagan

P4
Davis

P3
TBA

P2
Pandit

P1
Segoviano

19 Wong	20 McCullough	21 Galraud	22 Flora	23 Ausman, G.
------------	------------------	---------------	-------------	------------------

9 Alternative Center	8 Paratore	7 TBA	6 Rygiol	5 Braden	4 Prazma
----------------------------	---------------	----------	-------------	-------------	-------------

M	W
---	---

13 Stewart	14 Avery	15 Locke
---------------	-------------	-------------

STORE	12 Fuqua	11 Williams	10 Valdez
-------	-------------	----------------	--------------

QUAD
 AMPI -
 THEATER

32 Atunodon, L.	33 Webe	34 Karzag	35 Aguilar	36 Atunodon, S.
--------------------	------------	--------------	---------------	--------------------

G	B
---	---

24 Ausman, M.	25 Angulo	Duplicating	Library Student Resource Center
------------------	--------------	-------------	--

37 Anderson

OFFICE

BAND
ROOM

S T O R A G E

MULTI-PURPOSE
ROOM

K I T C H

SERVICE
YARD

B	G	3 McNeil	2 Cosgrove	1 Johnson, N.
---	---	-------------	---------------	------------------

PIEDMONT MIDDLE SCHOOL

BASKET BALL COURTS
VOLLEY BALL COURTS
ETC.

GIRL'S LOCKER ROOM
Donacho
Nugent
Okazaki
Pridham

BOY'S LOCKER ROOM
Canacho
Lopez
Maino

MINI - GYM

P6
Chi

18
Aberle

17
Winn

16
Umall

26 TBA

27 Curry

28 Spacek

29 Lake

30 TBA

31 Sanyal

P1
Sagoviano

P2
Pandit

P3
TBA

P4
Davis

P5
Carmonagan

19 Wong

20 McCullough

21 Galraud

22 Flora

23 Ausman, G.

9
Atambya Center

8
Paratore

7
TBA

6
Rygiol

5
Braden

4
Prazma

M

W

13
Stewart

14
Avery

15
Locke

STORE

12
Fuqua

11
Williams

10
Valdez

32
Atunden, L.

33
Webe

34
Katzag

35
Aguar

36
Atunden, S.

37
Anderson

24
Ausman, M.

25
Angulo

Duplicating

Library Student Resource Center

G

B

QUAD
AMPI -
THEATER

OFFICE

BAND ROOM

STORAGE

MULTI-PURPOSE ROOM

KITCH

SERVICE YARD

B

G

3
McNeil

2
Cosgrove

1
Johnson, N.

PIEDMONT MIDDLE SCHOOL
INSPECTED ON: 10/14/08

PIEDMONT MIDDLE SCHOOL

BASKET
BALL
COURTS

VOLLEY
BALL
COURTS

ETC.

GIRL'S LOCKER ROOM Donecho Nugent Okazaki Pridham	BOY'S LOCKER ROOM Carnacho Lopez Maino
---	---

MINI - GYM

P6
Chi

18
Aberle

17
Winn

16
Umall

26 TBA	27 Curry	28 Spacek	29 Lake	30 TBA	31 Sanyal
-----------	-------------	--------------	------------	-----------	--------------

P5
Carmonagan

P4
Davis

P3
TBA

P2
Pandit

P1
Segoviano

19 Wong	20 McCullough	21 Gallaud	22 Flora	23 Ausman, G.
------------	------------------	---------------	-------------	------------------

PIEDMONT MIDDLE SCHOOL
INSPECTED ON: 4-17-08

9 Alternative Center	8 Paratore	7 TBA	6 Rygiol	5 Braden	4 Prazma
----------------------------	---------------	----------	-------------	-------------	-------------

M	W
---	---

13 Stewart	14 Avery	15 Locke
---------------	-------------	-------------

STORE	12 Fuqua	11 Williams	10 Valdez
-------	-------------	----------------	--------------

QUAD
AMPI -
THEATER

32 Ausmon, L.	33 Wiebe	34 Karrag	35 Aguilar	36 Ausmon, S.
24 Ausman, M.	25 Angulo	Duplicating	Library Student Resource Center	37 Anderson
G	B			

OFFICE

BAND
ROOM

STORAGE

MULTI-PURPOSE
ROOM

KITCHEN

SERVICE
YARD

B	G	3 McNeil	2 Cosgrove	1 Johnson, N.
---	---	-------------	---------------	------------------

PIEDMONT MIDDLE SCHOOL

BASKET
BALL
COURTS

VOLLEY
BALL
COURTS

ETC.

GIRL'S LOCKER ROOM Donecho Nugent Okazaki Prdham	BOY'S LOCKER ROOM Camacho Lopez Maino
--	--

MINI - GYM

P6 Chi	18 Aberle	17 Winn	16 Umall
-----------	--------------	------------	-------------

26 TBA	27 Curry	28 Spacak	29 Lake	30 TBA	31 Sanyal
-----------	-------------	--------------	------------	-----------	--------------

P5
Carmongan

P4
Davis

P3
TBA

P2
Pandit

P1
Segoviano

19 Wong	20 McCullough	21 Galraud	22 Flora	23 Ausman, G.
------------	------------------	---------------	-------------	------------------

PIEDMONT MIDDLE SCHOOL
INSPECTED ON: 11-05-07

9 Alternative Center	8 Prazore	7 TBA	6 Rygiol	5 Braden	4 Prazma
----------------------------	--------------	----------	-------------	-------------	-------------

M	W	13 Stewart	14 Avery	15 Locke
---	---	---------------	-------------	-------------

STORE	12 Fuqua	11 Williams	10 Valdez
-------	-------------	----------------	--------------

QUAD
AMPI -
THEATER

32 Asundon, L.	33 Webe	34 Kuzag	35 Aguilar	36 Asundon, S.
24 Ausman, M.	25 Angulo	Duplicating	Library Student Resource Center	37 Anderson
G	B			

OFFICE

BAND
ROOM

STORAGE

MULTI-PURPOSE
ROOM

KITCHEN

SERVICE
YARD

B	G	3 McNeil	2 Cosgrove	1 Johnson, N.
---	---	-------------	---------------	------------------

PIEDMONT MIDDLE SCHOOL

Counselor

BASKET BALL COURTS
VOLLEY BALL COURTS
ETC.

Counselor

GIRL'S LOCKER ROOM
Donecho
Nugent
Okazaki
Pridham

BOY'S LOCKER ROOM
Camacho
Lopez
Maino

MINI - GYM

P6
Chi

18
Aberfe

17
Winn

16
Umall

26
Johnson, S.

27
Curry

28
Spacek

29
Lake

30
TBA

31
Sanyal

P5
Caronongan

P4
Davis

P3
Kim

P2
Pandit

P1
Segoviano

19
Wong

20
McCullough

21
Gairaud

22
Flora

23
Ausman, G.

E

9
Alternative Center

8
McNeil

7
TBA

6
Rygiol

5
Braden

4
Prazma

STORE

12
Fuqua

11
Williams

10
TBA

M W

13
Stewart

14
Avery

15
Locke

32
Asuncion, S.

33
Wiebe

34
Karzag

35
Aguilar

36
Asuncion, S.

G B

24
Ausman, M.

25
Angulo

Duplicating

Library Student Resource Center

37
Anderson

QUAD
AMPI -
THEATER

OFFICE

BAND ROOM

STORAGE

MULTI-PURPOSE ROOM

KITCHEN

SERVICE YARD

B G

3
Tenbreull

2
Cosgrove

1
Johnson, N.

PIEDMONT MIDDLE SCHOOL QUAD STATIONS

BREAK DUTY

Room from (X) as indicated - WATCH RESTROOMS

PB2
6-223

Counselor

BASKET
BALL
COURTS
VOLLEY
BALL
COURTS
ETC.

GIRL'S
LOCKER
ROOM
Donecho
Nugent
Okazaki
Pridham

BOY'S
LOCKER
ROOM
Camacho
Lopez
Maino

MINI - GYM

P6
Chi

18
Aberle

17
Winn

16
Umali

26
Johnson, S.

P1
Segoviano

P2
Pandit

P3
Kim

P4
Davis

P5
Caronongan

19
Wong

20
McCullough

21
Gaud

22
Flora

23
Ausman, G.

9
Alternative
Center

8
McNeil

7
TBA

6
Rygiel

5
Braden

4
Prazma

M
W

13
Stewart

14
Avery

15
Locke

STORE

12
Fuqua

11
Williams

10
TBA

32
Asuncion, S.

33
Wiebe

34
Kazag

35
Aguilar

36
Asuncion, S.

G
B

24
Ausman, M.

25
Angulo

Duplicating

Library
Student
Resource
Center

E

QUAD
AMPI -
THEATER

OFFICE

BAND
ROOM

STORAGE

MULTI-PURPOSE
ROOM

KITCHEN

SERVICE
YARD

B
G

3
Tembreull

2
Cosgrove

1
Johnson, M.

PIEDMONT MIDDLE SCHOOL QUAD STATIONS
Rune from (X) as indicated - WATCH RESTROOMS

BREAK DUTY

Counselor

BASKET BALL COURTS
VOLLEY BALL COURTS
ETC.

GIRL'S LOCKER ROOM
BOY'S LOCKER ROOM
Domecho
Nugent
Okazaki
Pridham
Camacho
Lopez
Maino

MINI - GYM

P6
Chi

18
Aberle

17
Winn

16
Umali

26 Johnson, S. 27 Curry 28 Spacek 29 Lake 30 TBA 31 Sanyal

P4
Davis

P3
Kim

P2
Pandit

P1
Segoviano

P5
Caronongan

19 Wong 20 McCullough 21 Gairaud 22 Flora 23 Ausman, G.

9 Alternative Center 8 McNeil 7 TBA 6 Rygiol 5 Braden 4 Prazma

STORE 12 Fuqua 11 Williams 10 TBA

M W 13 Stewart 14 Avery 15 Locke

32 Asuncion, S. 33 Wiebe 34 Karzag 35 Aguiar 36 Asuncion, S. 37 Anderson

G B 24 Ausman, M. 25 Angulo

QUAD
AMPI - THEATER

OFFICE

BAND ROOM

STORAGE

MULTI-PURPOSE ROOM

KITCHEN

SERVICE YARD

B G 3 Tembreull 2 Cosgrove 1 Johnson, N.

PIEDMONT MIDDLE SCHOOL
INSPECTED ON: 04/18/06

PIEDMONT MIDDLE SCHOOL QUAD STATIONS
Name from (X) as indicated - WATCH RESTROOMS

BREAK DUTY

Counselor

BASKET BALL COURTS
VOLLEY BALL COURTS
ETC.

GIRL'S LOCKER ROOM
BOY'S LOCKER ROOM
Domecho
Nugent
Okazaki
Pridham
Camacho
Lopez
Maino

MINI - GYM

P6
Chi

18
Aberle

17
Winn

16
Umali

26 Johnson, S. 27 Curry 28 Spacek 29 Lake 30 TBA 31 Sanyal

P4
Davis

P3
Kim

P2
Pandit

P1
Segoviano

P5
Caronongan

19 Wong 20 McCullough 21 Gairaud 22 Flora 23 Ausman, G.

9 Alternative Center 8 McNeil 7 TBA 6 Rygiol 5 Braden 4 Prazma

STORE 12 Fuqua 11 Williams 10 TBA

M W 13 Stewart 14 Avery 15 Locke

32 Asuncion, S. 33 Wiebe 34 Karzag 35 Aguiar 36 Asuncion, S. 37 Anderson

G B 24 Ausman, M. 25 Angulo Duplicating Library Student Resource Center

QUAD
AMPI - THEATER

OFFICE

BAND ROOM

STORAGE

MULTI-PURPOSE ROOM

KITCHEN

SERVICE YARD

B G 3 Tembreull 2 Cosgrove 1 Johnson, N.

PIEDMONT MIDDLE SCHOOL
INSPECTED SEPTEMBER 2005

PIEDMONT MIDDLE SCHOOL QUAD STATIONS
Name from (X) as indicated - WATCH RESTROOMS

BREAK DUTY